



BONDING STRAP INSTALLED ON SLEEVE-TYPE COUPLING

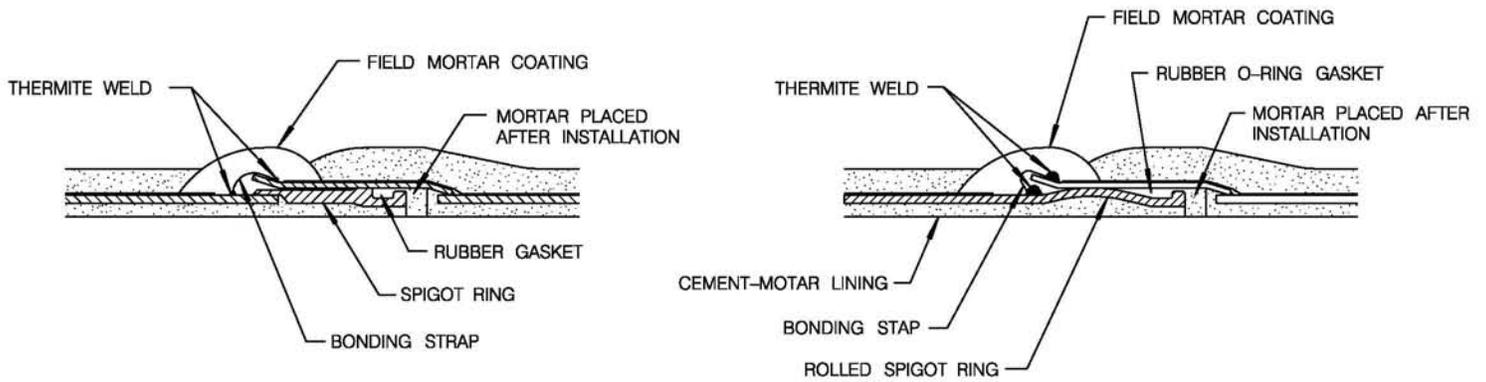

BONDING STRAP FOR BELL AND SPIGOT RUBBER-GASKETED JOINT

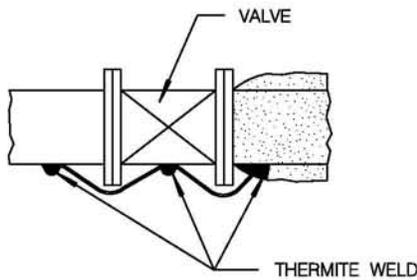

BONDING STRAP INSTALLED ON VALVE

NOTES:

1. REMOVE COATING AND CLEAN APPROXIMATELY 2" AREA TO A BRIGHT METAL SURFACE FOR WELDING.
2. THE EXACT TYPE, SIZE AND NUMBER OF BONDING WIRE /STRAP SHALL BE DETERMINED BY PIPE SIZE AND TYPE.
3. WHERE NOT PROTECTED BY CEMENT MORTAR COATING, THERMITE WELD SHALL BE COVERED WITH COLD APPLIED COAL TAR SOLUTION.

REVISION	BY	APPROVED	DATE
ORIGINAL		T. MUELLER	2-12-86
		J. CASEY	8-22-86
UPDATED	KA	J. NAGELVOORT	01/12

CITY OF SAN DIEGO - STANDARD DRAWING

**BONDING STRAP FOR
STEEL AND SCRW PIPE**

RECOMMENDED BY THE CITY OF SAN DIEGO
STANDARDS COMMITTEE

H. Hadi 1/31/2012
COORDINATOR R.C.E. 65271 DATE

DRAWING
NUMBER **SDW-116**