

Appendix F

Hazardous Materials Technical Report

HAZARDOUS MATERIALS TECHNICAL STUDY MONTGOMERY-GIBBS EXECUTIVE AIRPORT SAN DIEGO, CALIFORNIA

Prepared For:
Helix Environmental Planning, Inc.
7578 El Cajon Boulevard
La Mesa, California 91942

PREPARED BY:
The Bodhi Group Inc.

APRIL 2019
PROJECT NO. 91340011





April 2, 2019
Project No. 9134001

Mr. Lance Unverzagt
HELIX Environmental Planning, Inc.
7578 El Cajon Boulevard
La Mesa, California 91942

Subject: Montgomery-Gibbs Executive Airport Master Plan
 Hazardous Materials Technical Study
 San Diego, California

Dear Mr. Unverzagt,

We are pleased to submit our Hazardous Material Technical Study for the Montgomery-Gibbs Executive Airport in San Diego, California. This report identifies potential environmental concerns at the Site in respect to proposed redevelopment described in the Airport Master Plan.

Respectfully submitted,

THE BODHI GROUP, INC.

Sree Gopinath, P.E.
Principal Engineer

Brianne Cortright
Project Geologist

Distribution: 1) Addressee

TABLE OF CONTENTS

1. INTRODUCTION	1
1.1. Significant Assumptions	2
1.2. Limitations and Exceptions	2
1.3. User Reliance	3
2. SITE DESCRIPTION AND SETTING	3
2.1. Location and Description	3
2.2. Site Use and Occupancy	3
2.3. Site Geology and Regional Hydrogeology	3
2.3.1. Site Geology	3
2.3.2. Regional Hydrogeology	4
3. SITE HISTORY	4
3.1. Historical Aerial Photographs and Topographic Maps	4
3.2. Fire Insurance Maps	5
4. TYPES OF HAZARDOUS CHEMICALS AND EXPOSURE PATHWAYS	5
4.1. Total Petroleum Hydrocarbons	6
4.2. Chlorinated Volatile Organic Compounds	6
4.3. Lead	6
4.4. Other Metals	7
4.5. Contaminants of Emerging Concern	7
4.6. Asbestos	7
4.7. Pesticides	7
4.8. Polychlorinated Biphenyls	7
5. ENVIRONMENTAL DATABASE SEARCH AND RECORDS REVIEW	8
5.1. Standard Environmental Record Sources	8
5.2. Regulatory Records Review	11
5.2.1. Previous Reports	11
6. SITE RECONNAISSANCE	11
6.1. General Site Setting	12
7. INTERVIEWS	13
8. EVALUATION OF HAZARDOUS MATERIALS	13
9. HAZARD EVALUATION	14
10. CONCLUSIONS AND RECOMMENDATIONS	16
11. REFERENCES	17

Figures

Figure 1 – Site Location Map

Figure 2 – Site Plan

Tables

Table 1 – Facilities of Potential Concern

Table 2 – Hazard Summary and Mitigation Measures

Appendices

Appendix A – Site Photographs

Appendix B – EDR Database Report

Appendix C – Regulatory Documentation

Appendix D – Background Documents

1. INTRODUCTION

The Bodhi Group, Inc. (Bodhi Group) has completed a Hazardous Materials Technical Study (HMTS) in support of the Montgomery-Gibbs Executive Airport Master Plan (Site). The Site is owned and operated by the City of San Diego (City) and is currently occupied by the Montgomery-Gibbs Executive Airport (MYF), commercial properties, City offices, and a police station (**Figure 1**).

The purpose of the Montgomery-Gibbs Executive Airport Master Plan (Master Plan) is to present a 20-year strategic development plan based on the forecasted activity for MYF. It is used as a decision-making tool and is intended to complement other local and regional plans. The proposed Master Plan involves both landside and airside components. The proposed landside components include a hangar site within the westernmost portion of MYF and up to 92 new hangars and space for 48 new tie-down areas. A 6,000 square foot (sf) expansion to the existing terminal building is proposed, along with other improvements such as a public viewing area, aircraft wash racks, and a self-service fueling facility (fuel island). Airside improvements proposed by the Master Plan include removal of runway pavement and taxiways and reconfiguration of taxiways. Additionally, relocation of safety areas such as the Runway Protection Zone, approach surfaces and associated improvements. As part of the Master Plan, the City will also request from the Federal Aviation Administration (FAA) that an approximately 4-acre area adjacent to Aero Drive and Glenn H Curtis Road be converted to “Non-Aeronautical Land Use” (City of San Diego, 2019).

This HMTS addresses the presence and levels of hazardous chemicals that could have potentially adverse effects to the proposed land uses of the Site. Locations within the Site where hazardous chemicals and petroleum have been used, stored, conveyed, and/or dispensed, and properties where there have been spills or unauthorized releases of hazardous chemicals or petroleum to the subsurface have been identified and assessed based on the degree of potential adverse effects to human health, the environment, and groundwater resources. The HMTS was prepared in compliance with Compensation, and Liability Act (CERCLA), Section VIII ‘Hazards and Hazardous Materials’ of (Environmental Checklist Form) of the California Environmental Quality Act (CEQA) Statute and Guidelines and closely follows the American Society for Testing and Materials (ASTM) standard for preparing Phase I Environmental Site Assessment (ESA) reports, discussed below (ASTM, 2013).

Consistent with the requirements of a Phase I ESA, this study identified locations on or adjacent to the Site where hazardous chemicals and petroleum have been used, stored, conveyed, or dispensed, and locations where there have been documented spills or unauthorized releases of hazardous chemicals or petroleum to the subsurface.

We have reviewed properties in the Site and Site vicinity and screened those properties with the potential to have adverse effects to future land use. We then evaluated the types of hazardous chemicals present, medium affected, and potential adverse effects and presented our opinion regarding the potential exposure pathways, and possible mitigation measures.

There were no potential impacts related to environmental hazards from the implementation of the proposed Master Plan that cannot be avoided, reduced to an acceptable level of risk, or reduced below a level of significance through conformance with applicable regulatory requirements and mitigation measures recommend in Section 9 of this report.

Intrusive investigation, including the collection and analysis of subsurface media samples, was beyond the scope of this evaluation. Intrusive investigations (referred to as Phase II ESAs) may be required as properties are redeveloped to confirm or revise the findings of this study of the presence of hazardous materials and petroleum constituents below ground and to assess the adverse effects at the individual property-level of detail.

1.1. Significant Assumptions

Documentation and data referred to in the preparation of this assessment are assumed to be complete and correct and have been used and referenced with the understanding that the Bodhi Group assumes no responsibility or liability for their accuracy. The conclusions contained herein are based upon such information and documentation that was available at the time of preparation of this report. Because the Site and subsurface conditions may change significantly over time and additional data may become available, conclusions drawn in this report are limited to current conditions and may not be relied upon on a significantly later date or if changes have occurred at the Site that were not known at the time of report preparation.

1.2. Limitations and Exceptions

Reasonable efforts were made to identify potential adverse effects from hazardous materials. “Reasonable efforts” are limited to information gained from recorded database information and regulatory records readily-accessible to the public. Such methods may not identify contaminant sources that are not listed in information readily-accessible to the public. While some observations and discussion in this report may address conditions and/or operations that may be regulated, the regulatory compliance discussions of those conditions and/or operations is outside the scope of this evaluation. Nothing in this report constitutes a legal opinion or legal advice.

This evaluation does not address the following:

- asbestos-containing materials (other than those in shallow soil),
- radon,
- lead in drinking water,
- wetlands, protected environments and habitat,
- threatened or endangered species, industrial hygiene concerns,
- human health risk assessment,
- indoor air quality,
- high voltage power lines,
- geotechnical conditions,
- cultural and historical resources,
- health and safety, and
- mold.

Monetary valuation was not performed for this assessment. In some instances, we may provide opinion on the potential for adverse health effects from the intrusion of volatile chemicals from the subsurface into indoor air.

1.3. User Reliance

This report was solely and exclusively prepared for use by Helix Environmental Planning, Inc. and the City of San Diego. The report is not for the use or benefit of, nor may it be relied upon by, any other person or entity for any purpose without the advance written consent of the Bodhi Group. In the preparation of this report, the Bodhi Group has used the degree of care and skill ordinarily exercised by a reasonably prudent environmental professional in the same community in the same time frame given the same or similar facts and circumstances.

2. SITE DESCRIPTION AND SETTING

2.1. Location and Description

The Site encompasses approximately 549-acres and is located at 3750 John J. Montgomery Drive, in the Kearny Mesa community of San Diego, California. The Site is bounded by Balboa Avenue to the north, Ruffin Road to the east, Aero Drive to the south, and Kearny Villa Road to the west. The Site was founded by William “Bill” Gibbs in 1937, as a single runway, turf airfield. Since then, it has expanded into one of the busiest general aviation reliever airports in the United States.

Due to MYF’s proximity to downtown San Diego and the large population served, it is classified by the National Plan of Integrated Airport Systems as a regional reliever airport. A reliever airport accommodates overflow and general aviation traffic that would otherwise cause congestion at a neighboring airport, in this case San Diego International (SAN) (City of San Diego, 2019).

The majority of the Site sits at an elevation of between 390 and 430 North American Vertical Datum of 1988 in feet (NAVD 88) sloping gently to the south and southeast. Photographs of the Site are provided in Appendix A.

2.2. Site Use and Occupancy

The majority of the Site is currently used as an airport, and consists of three runways, and 12 taxiways, a helicopter landing area, and various navigational aids (NAVAIDS), aircraft parking areas, hangars, and an FAA Airport Traffic Control Tower (ATCT), administrative offices, a restaurant, a hotel, and support facilities. Support facilities include fueling facilities, aircraft maintenance, aircraft sales, and flight training (City of San Diego, 2019). Commercial properties, City offices, and a police station are located outside of the MYF property with the Site boundary.

2.3. Site Geology and Regional Hydrogeology

The following sections describe the geology and the hydrogeology at the Site.

2.3.1. Site Geology

In increasing order of age, soils at the Site consist of the Mission Valley Formation, Stadium Conglomerate and Friars Formation (Kennedy and Tan, 2008). Descriptions of the general characteristics of these units are presented below.

- Tmv – Mission Valley Formation (middle Eocene). The Mission Valley Formation consists predominantly of light olive-gray, soft and friable, fine- to medium-grained marine and non-marine sandstone containing cobble conglomerate tongues.
- Tst – Stadium Conglomerate (middle Eocene). The Stadium Conglomerate contains slightly metamorphosed volcanic and volcanoclastic rocks and quartzite. The conglomerate is very well consolidated and locally very well cemented.
- Tf – Friars Formation (middle Eocene). This formation consists of yellowish-gray, medium-grained, massive, poorly indurated non-marine and lagoonal sandstone and claystone with tongues of cobble conglomerate.

2.3.2. Regional Hydrogeology

According to the Regional Water Quality Control Board (RWQCB) San Diego Basin Plan (RWQCB, 1994), the Site lies within the Mission San Diego Hydrologic Subarea (HSA) in the Lower San Diego Hydrologic Area of the San Diego Hydrologic Unit. The Mission San Diego HSA has existing beneficial uses for agricultural, industrial service supply, and industrial processing supply, and potential beneficial use for municipal supply.

Because the Mission San Diego HSA has potential beneficial use for municipal supply, the water quality should meet California Code of Regulations Maximum Contaminant Levels (MCLs) for drinking water requirements (RWQCB, 1994).

Site specific depth to groundwater information was not available; however, based on a review of previous environmental investigation reports and monitoring well data collected from State Water Resources Control Board-managed GeoTracker website (Geotracker), groundwater levels at a property adjacent to the west of the Site (3870 Kearny Villa Road) were recorded ranging from approximately 26.3 to approximately 27.6 feet below ground surface (bgs) in 2014 and flowed generally to the west. Localized groundwater flow direction and groundwater levels can influence the potential adverse effects caused by hazardous chemicals present in groundwater. The general effects of chemicals in groundwater are discussed in Section 4.

3. SITE HISTORY

The following sections present a general overview of the historical uses of the Site as documented through our review of available online historical aerial photographs and historical topographic maps. The purpose of the aerial photograph and topographic map review is to observe historical use that may have impacted the subsurface at the Site or surrounding areas that may have left residual contamination.

3.1. Historical Aerial Photographs and Topographic Maps

The Bodhi Group reviewed aerial photographs from 1953, 1964, 1966, 1972, 1980, 1981, 1989, 1994, 1996, 2002, 2003, 2009, 2010, 2012, and 2014 from Historical Aerials online resources. Topographic maps were also reviewed for years 1903, 1909, 1913, 1920, 1927, 1929, 1934, 1940, 1942, 1943, 1955, 1959, 1960, 1970, 1973, 1978, 2000, 2012, and 2015.

- In the 1903 through 1929 topographic maps, the majority of the Site is depicted as vacant with the exception of multiple roads traversing the Site and three small buildings or dwellings. One road on the eastern portion of the Site is labeled “Rosedale”. Murphy Canyon is located just east of the Site and is depicted to contain an intermittent stream. Adjacent properties are depicted as vacant land with

some roads present. A small water body is depicted south of the Site along with multiple canyons containing intermittent streams.

- The 1934 through 1942 topographic maps are similar to the 1929 map except that the buildings are no longer depicted.
- The 1943 topographic map is similar to the 1942 map with the addition of a “landing field” depicted on the Site.
- The first aerial photograph coverage was available for the year 1953. The majority of the Site is occupied by Montgomery Field airstrip, which appears unpaved, and the remaining areas appear undeveloped. A main road labeled “Cabrillo Freeway,” in a similar configuration to present-day State Route 163, is observed along the western Site boundary. Surrounding properties appear to remain vacant with the exception of an area south of the Site which appears under development.
- In the 1959 topographic map, the Site is depicted as Montgomery Field City Airport. Surrounding areas to the south and southwest are depicted as built-up areas.
- In the early 1964 and 1966, the airstrip appears paved; however, the remainder of the Site appears to be unpaved. Multiple airplanes, hangars, support structures, and associated buildings are located throughout the Site. Balboa Avenue and Aero drive are in their current configuration, along the northern and southern Site boundaries, respectively. Surrounding areas to the north, south, and west are heavily developed with residences, commercial, and industrial properties. Interstate 15 is depicted to the east of the Site. and Clairemont Mesa Boulevard and Balboa Avenue are in their present-day configurations. Cabrillo Freeway is depicted as California State Route 163.
- In the 1970s through the early 1980s, the Site and adjacent properties are similar to the previous years with increased development. The area south of the airstrip appears paved and the number of hangars and structures have increased. The surrounding area east of the Site appears under development.
- In the late 1980s, the Site is in a similar configuration to the previous years with the addition of the present-day hotel in the southwestern corner of the Site, appears to be under construction. The present-day commercial structures are located on the south portion of the Site. The adjacent property to the east appears to be developed with commercial structures in a similar configuration to the present-day.
- The Site and surrounding areas appear to be generally in their current configuration since the early 90’s. The Site remains developed with a paved air strip, a hotel, multiple hangars and associated airport structures, and unpaved areas. The surrounding areas are significantly developed with residential, industrial and commercial properties.

3.2. Fire Insurance Maps

There is no Fire Insurance Map coverage for the Site.

4. TYPES OF HAZARDOUS CHEMICALS AND EXPOSURE PATHWAYS

Past and present land use at the Site and surrounding properties (historical uses summarized in Section 3.1), including industrial use and waste storage and disposal, may have resulted in releases of hazardous chemicals to the environment. In addition, spills and leaks of fuel from locations where fuel was stored and dispensed could have impacted the subsurface. Releases of hazardous substances along transportation corridors and deterioration of building materials that contained hazardous chemicals could also have impacted the environment.

Releases of these hazardous chemicals can leave residual contamination in soil, soil vapor, and groundwater within the Site. These chemicals are classified based on their properties, persistence in the environment, and general adverse effects, as described below.

4.1. Total Petroleum Hydrocarbons

Total petroleum hydrocarbons (TPH) is a term used to describe a large family of chemical compounds that originate from crude oil and are used to make petroleum and other industrial products. Benzene, toluene, ethylbenzene, naphthalene, and xylenes are part of the more volatile fractions of TPH (gasoline mixture) and polynuclear aromatic hydrocarbons (e.g., benzo(a)pyrene) are part of the less volatile fractions (diesel and heavier mixtures). Both groups, volatile organic compounds (VOCs) and fractions that are non-volatile, can have adverse health effects based on the type of chemical, routes of exposure (inhalation, direct contact, ingestion), and the mass of chemical available for exposure.

Relative to other classes of hazardous substances, petroleum hydrocarbons will degrade in aerobic conditions (in the presence of oxygen). If present in significant quantities in groundwater, TPH can exist in its own phase (as product) and will float on the surface of the water table (EPA, 2012).

The most common pathways for exposure to the volatile fraction of TPH is inhalation, followed by direct contact (if the pathways of exposure are complete). The most common pathway of exposure to the non-volatile fractions of TPH is direct contact. The inhalation exposure pathway to the non-volatile fraction is incomplete (with the exception of TPH-impacted dust particles that can be inhaled in areas of soil disturbance).

4.2. Chlorinated Volatile Organic Compounds

Chlorinated volatile organic compounds (CVOCs) were commonly used for cleaning and degreasing and were associated with dry cleaning, manufacturing, automobile maintenance, and at former military facilities. Some common CVOCs that can be found in the environment are tetrachloroethylene (PCE), trichloroethylene (TCE), and their breakdown products, such as cis-1,2-dichloroethene, trans-1,2-dichloroethene, and vinyl chloride. Exposure to CVOCs can result in adverse health effects. CVOCs are generally more persistent and can remain in the environment (soil, groundwater, soil vapor) for extended periods of time. CVOCs can migrate into indoor air from soil vapor and result in adverse health effects from inhalation exposure (EPA, 2012).

4.3. Lead

Lead is a heavy metal with multiple industrial and other applications. Exposed shallow soil may have been contaminated with aerially-deposited lead (ADL) along well-traveled transportation road corridors, aircraft runways, and taxiways, and along the aircraft flight paths, prior to the phasing out of leaded gasoline in the late 1970s.. The ADL is caused by historical emissions from vehicle and aircraft exhausts (tetraethyl lead was mixed with gasoline from the 1920s to the 1970s as an anti-knock agent).

Lead-based paint (LBP) can be found on structures built before 1978 (when it was banned in paint). Deteriorating LBP can contaminate shallow soil around the structures. Soil contaminated lead (e.g., from ADL and LBP), when disturbed, can become airborne in dust. Exposure to lead, either through direct contact, inhalation of dust containing lead, or through ingestion (can be a problem in younger children who may ingest deteriorating LBP or soil contaminated with lead) at significant concentrations can result in adverse health effects (lead is a known neurotoxin).

4.4. Other Metals

Metals can be found in manufacturing and industrial facilities and landfills (e.g., arsenic, chromium, mercury, and copper). Although metals can be naturally occurring, in higher concentrations they can be toxic to human health. If released to the environment in significant quantities, metals are more likely to be present in shallow soil. Exposure to metals in soil can occur through direct contact and inhalation of dust containing metals. Some chemicals used in industrial processes, such as hexavalent chromium can contaminate groundwater and threaten drinking water sources.

4.5. Contaminants of Emerging Concern

Because of the many chemicals in commerce, improved methods for detecting chemicals in environmental and biological media, and the increased interest by scientists and the public in understanding the types of toxicity that chemicals may pose, scientists and toxicologists are identifying “emerging chemicals of concern,” or ECCs. Recent studies have shown that some of these ECCs can act as endocrine disruptors, disrupting normal hormone function, and can produce effects at the parts per billion or parts per trillion level (EPA, 2017a). Also, effects of some ECCs can be transgenerational - when animals are exposed in utero, effects are transmitted not only to the offspring, but are inherited for many generations thereafter.

Some examples of ECCs include bis-phenol-A, phthalates, Per- and polyfluoroalkyl substances (PFAS) arsenic, perchlorate, nonylphenols, synthetic musks and other personal care product ingredients, nitrosodimethylamine, brominated flame retardants, nanoparticles, pharmaceutical wastes, and industrial chemical additives, stabilizers and adjuvants (EPA, 2017a). Areas within the Site may contain ECCs especially in areas where firefighting foams and suppressants have been used (firefighting training areas, aircraft or vehicle crashes, or other areas where fires occurred) or stored. Cases under regulatory oversight may not have been tested for ECCs. ECCs may be present in the subsurface and can be harmful to human health through ingestion, direct contact, and by inhalation.

4.6. Asbestos

Asbestos is a fibrous mineral that occurs naturally in rock and soil (EPA, 2017b). It has been used in a wide variety of building materials such as insulation, roofing materials, and tiles. It has also been commonly used in automobile parts such as brakes and transmissions. Asbestos is likely present in structures within the Site and may be present in shallow soil near buildings and near busy right-of-way corridors (ROW). The most common route of exposure is through inhalation of tiny particles of deteriorated (friable) asbestos containing materials. Exposure to asbestos is harmful to human health.

4.7. Pesticides

Pesticides are chemicals used for agricultural purposes. Pesticides are commonly found in shallow soil in areas where agricultural use is present or was historically present. Pesticides are potentially harmful to human health through direct contact, and through inhalation. Based on a review of historical documents, the Site does not appear to have been historically used for agriculture.

4.8. Polychlorinated Biphenyls

Polychlorinated Biphenyls (PCBs) belong to a broad family of man-made organic chemicals and were manufactured from 1929 to 1979 (when manufacturing was banned). PCBs are chemically stable and

have a high boiling point and electrical insulation and because of these properties, were used in a wide range of industrial and commercial applications. PCBs were commonly used in electrical and hydraulic equipment, as a plasticizer in paints, plastics and rubber manufacturing, and may be found in transformers and capacitors, electrical equipment, hydraulic systems, fluorescent light ballasts, cable installation, oil-based paint, plastics caulking, adhesives, and floor finishes (EPA 2018). Even though they are no longer manufactured, PCBs can be released into the environment from past applications, and from the disposal or storage of PCBs wastes. The EPA, International Agency for Research on Cancer, and the National Toxicology Program have concluded that PCBs are a probable human carcinogen (EPA, 2018). If released to the environment, PCBs are more likely to be in soil (relative to other media) and building materials and can be harmful to human health through ingestion and direct contact.

5. ENVIRONMENTAL DATABASE SEARCH AND RECORDS REVIEW

In order to assess the significance of properties on and in the vicinity of the Site with documented hazardous waste impacts, a search and review of federal, state, local, and regional environmental regulatory agency databases was conducted for facilities located within the Site and adjacent properties within a 1/8-mile radius of the Site. The following sections summarize the results of searches of federal, state, and local databases by Environmental Data Resources Inc (EDR), regulatory agency records, and online database searched. The EDR Database Report is provided in Appendix B.

5.1. Standard Environmental Record Sources

Multiple properties/businesses that have historically or currently operate at the Site and Site Vicinity were listed in the environmental database report. To supplement the information in the EDR report, the State Water Resources Control Board (SWRCB) Geotracker database and regulatory records were reviewed.

On-Site Properties of Potential Concern		
Name/Address	Database	Summary
San Diego City Police Department, Air Support Unit/Gibbs Flying Service 3750 John J. Montgomery Drive	HMMD UST HAZNET FINDS AST SAM CORTESE NPDES CIWQS WDS CHMIRS LUST	These Site occupants are located on the western portion of the Site. According to the Database Report, two 10,000-gallon aviation fuel USTs and one 50-gallon unleaded gasoline UST were removed between 1988 and 1991. The Site address is associated with two unauthorized release cases (H21291-001 and -002) and according to the closure reports, approximately 245 cubic yards of impacted soil was removed after removal of the USTs. The soil was stockpiled on Site and soil samples from the stockpile in 1996 indicated the concentrations of TPH constituents were below the cleanup goals at the time of 1000 milligrams per kilogram (mg/kg). It was recommended the soil be reused on Site; however, according to the closure report, the soil was still stockpiled as of 2006. According to the Closure Report for the second case (-002), approximately 20 cubic yards of TPH-impacted soil remains in the area of the 50-gallon fuel tank. Both cases were closed for the current facility uses at that time (airplane parking and commercial use, respectively) and the subsurface conditions are to be reevaluated if land use changes. The Site address is also associated with multiple permits for storage and disposal of hazardous wastes including; hydrocarbon, jet fuel, cleaners and solvents, waste oil, asbestos containing waste, and propane. Inspection reports on file with the County of San Diego Department of Environmental Health (DEH) and RWQCB indicate violations observed were minor and related to bookkeeping. Stormwater reports and

On-Site Properties of Potential Concern		
Name/Address	Database	Summary
		Industrial Inspection Reports from 1994 through 2017 indicated the facilities were generally in compliance with Best Management Practices (BMPs) and hazardous materials storage, with the exception of a sheen occasionally observed in parking areas and fuel trucks were observed not parked on secondary containment in 2017.
Gibbs Service Center/Flying R Aviation/Armed Forces Aero C 8906 Aero Drive	HIST AUTO LUST SLIC AST HMMD CORTESE	The Site occupant, Gibbs Service Center, was listed in the Historical Gasoline Service Station database as an active service station from 1985 to 2007 and is located in the south portion of the Site. The Site address was also associated with a closed unauthorized release case (H21283-001) for a release discovered during a UST removal in 1986. The release affected soil only and was closed the same year. The address was also listed for storage and disposal of waste oils and oil filters, solvents, parts washers, liquids with chromium VI, and compressed gasses. Violations on file were not of environmental concern. Gibbs Service is listed on the UST database with active permits for operation of two 12,000-gallon aviation fuel USTs, a 2,000-gallon unleaded UST, and a 2,000-gallon diesel UST.
Montgomery Demolition Landfill 3750 John J Montgomery Drive	RGA LF	The facility is a closed demolition solid waste disposal Site and is inspected annually. Violations were not noted in the inspection reports and no enforcement actions were on file for the landfill.
Spiders Aircraft Service Incorporated 3873 Kearny Villa Road	HIST UST HMMD	The facility is located on the far west portion of the Site and is listed on the UST database with an active permit for a 250-gallon waste oil UST, and an inactive permit for a 550-gallon UST containing solvents that was removed in 1986.
National Air College/Texaco 3760 Glen H. Curtiss Road	LUST HMMD UST SQG SWEEPS	The Site occupant has one closed case on file (H15636-001). According to records on Geotracker, two 10,000-gallon USTs were removed in 1993. Impacted soil was excavated, stockpiled and then backfilled. An estimated three to four hundred cubic yards of TPH-impacted soil remains at the locations of the former ASTs. The case was closed in 1998 for the facility use at the time (aircraft storage and maintenance) and groundwater was not believed to be at risk from contamination. The Site occupant was also listed on the Database Report for use and disposal of waste oil, used batteries, hydrocarbon solvents, and used oil filters. Violations were minor and not an environmental concern to the Site at this time.
CrownAir/Mercy Air/Critical Air 3717 and 3753 John J Montgomery Drive	HAZNET CHMIRS UST LUST SQG HMMD SLIC SAM AST San Diego LOP HIST CORTESE FINDS	The Site addresses are associated with four unauthorized release cases (H00465-001 through-004). According to the Database Report, four USTs containing jet fuel and aviation fuel, were removed between 1988 and 1992. The Site occupant was listed on the database report for disposal for unspecified organic mixture, organic solids, organic liquids, used oil filters, used batteries, CrownAir is also associated with active UST permits for operation of a 20,000-gallon Aviation Gas UST, and 20,000-gallon jet fuel UST. A Violation for obstruction of secondary containment piping preventing drainage to sump was recorded in 2012. Remaining permit violations listed in the Database Report were minor or related to training and bookkeeping and are not an environmental concern at this time. Multiple inspection reports regarding BMPs, USTs, and hazardous material handling were on file with the RWQCB and DEH from as early as 1993. The facilities associated with the Site address appeared to

On-Site Properties of Potential Concern		
Name/Address	Database	Summary
		be in compliance and violations of environmental concern were not noted.
San Diego City Public Works Department, Eastern Police Substation 9225 Aero Drive	FINDS HAULERS HMMD UST	The Site address is located south of Aero Drive in the southeastern portion of the Site and has an active permit for a 10,000-gallon unleaded gasoline UST, a 1,000-gallon used oil UST, and a 1,000-gallon motor oil UST. A 10,000-gallon unleaded gasoline UST and a 550-gallon diesel UST were removed in 1988 and 2004, respectively. The facility also has active permits for storage and disposal of oil, diesel, gasoline, acetylene, antifreeze, brake fluid, used batteries, and lead containing waste. Violations listed were minor and not an environmental concern to the Site at this time.
Federal Aviation Administration Montgomery Field 4302/4298 Ponderosa Avenue	SWEEPS HMMD CHMIRS LUST SAM HMMD SWEEPS	The Site occupant is located on the eastern portion of the Site and has one unauthorized release case (H21302-001) for a diesel release affecting soil. According to a Request for No Further Action on file with the RWQCB, diesel fuel related contamination from a former 1,000-gallon UST remains in soil in the area of the existing Air Traffic Control Tower. A human health risk assessment determined the excess cancer risk to building occupants to be less than significant and groundwater resources are not anticipated to be impacted by the soil contamination. A No Further Action Closure Letter by the RWQCB is dated May 10, 2011. The facility is also associated with multiple active permits for storage of hazardous waste including; waste oil, diesel fuel, organic waste, antifreeze, and used batteries. Violations on file were minor.
TRM RCO/FAA PDS 8665 Gibbs Drive	HIST UST FINDS HAZNET	The Site occupant is located in the strip mall south of MYF adjacent to the north of Aero Drive. The facility reportedly had one 80-gallon UST containing fuel for a generator. According to documents on Geotracker, the tank has been out of use since 1983; however, it is unclear if the UST was removed. The Site address is also listed in the Database report for storage and disposal of waste oil and latex waste.
Mission Bay Vortac/Oasis Sports Medical Group 8575 Gibbs Drive	HMMD UST SQG	The Site occupant is located in the strip mall south of MYF and adjacent to the north of Aero Drive and reportedly had one 515-gallon UST containing unleaded gasoline. The UST was installed in 1988 and it is unclear if the UST has been removed or closed in place.
Off-Site Properties of Potential Concern to the Site.		
Name/Address	Database	Summary
San Diego City Fire Repair Facility/Rural Metro San Diego 3870/3880 Kearny Villa Road	HMMD UST HAZNET FINDS AST SAM CORTESE NPDES CIWQS LUST SLIC CIWQS LUST SLIC	The property is located adjacent to the southwest of the Site beyond Kearny Villa Road and has five closed unauthorized release cases (H19194-001 through -005). The most recent cases (-004 and -005) were due to a diesel release affecting soil and groundwater at the property. The cases were closed in 2015 and groundwater flow was measured to the west, down gradient from the Site. The property is also listed in the Database Report for storage and disposal of waste oil, cleaning solvents, propane, unleaded fuel, compressed gas, antifreeze, pharmaceutical waste, and firefighting foam concentrates. Although the facility is located downgradient from the Site, reports of firefighter training on the west portion of the MYF, may have resulted in a release of PFAS from the use of Class B firefighting foam.

On-Site Properties of Potential Concern		
Name/Address	Database	Summary
Cubic Corporation 9233 Balboa Avenue	LQG SWEEPS HIST UST EMI SAM HMMD SLIC	The property is located adjacent to the west in the northernmost portion of the Site and has one closed unauthorized release case (H00070-001 and one open cleanup case (DEH2018-LSAM-00521). According to documents on Geotracker, the property formerly used and stored acids and solvents for industrial purposes. A diesel UST was closed in place in 1987 and an AST containing 1,1,1 trichloroethane (1,1,1-TCA) was removed from the property in 1990. Metals (copper, chromium, lead, and zinc) and CVOCs were reportedly detected in soil at the property. Approximately 40 cubic yards (cy) of soil with concentrations above cleanup levels was removed in 1989. Groundwater reportedly contained elevated levels of CVOCs and was believed to be a shallow perched water body. Perched groundwater was remediated via a pump and treat system in 1990. During the most recent investigation (December 2018), CVOCs were detected in soil below the Environmental Screening Level (ESL) but above the mitigation measure for the property (10 times below the ESL). and in soil vapor with a maximum concentration of TCE of 2,200 µg/L. Although the areas of concern at the property are located approximately 150 feet east of the Site, concentrations of metals and CVOCs in soil and CVOCs in soil vapor have not been delineated in the direction of the Site. Indoor air samples within 50 feet of the Site were beneath laboratory detection limits. The property is proposed to be redeveloped under regulatory oversight and the investigation is ongoing. Impacts to the Site are unknown at this time.

Additional Site and off-Site properties were listed in the EDR Database Report and/or had records on file with regulatory agencies; however, based on the nature of the database, or nature of the infraction, the facilities are not considered an environmental concern to the Site at this time. Multiple aircraft maintenance facilities and fueling stations have historically operated and currently operate at the Site, some of which are discussed above. Releases of petroleum products and solvents may have occurred in the areas of current and historical airport support operations (fueling and maintenance).

5.2. Regulatory Records Review

In addition to the EDR Database Report, properties regulated for unauthorized releases of chemicals were identified through a search of the SWRCB-managed Geotracker website, the California Environmental Protection Agency Department of Toxic Substances Control (DTSC)-managed EnviroStor website (Envirostor), DEH file review, CalRecycle records, and EDR Database reports. Information relating to areas of potential concern at the Site has been included in **Table 1** above. Select files from the regulatory records review are included in Appendix C.

5.2.1. Previous Reports

Available previous reports were reviewed for properties within the Site and pertinent information involving environmental conditions are included in the individual property discussions in **Table 1** above.

6. SITE RECONNAISSANCE

The objective of the Site reconnaissance was to identify areas of potential environmental concern. Ms. Brianne Cortright, conducted the reconnaissance on March 14, 2019. Ms. Cortright was escorted by Mr. Wayne Reiter, Airport Program Manager. A Site Plan is provided as **Figure 2**, photographic

documentation is provided in Appendix A, and a list of current MYF occupants is provided in Appendix D. The Site reconnaissance consisted of driving along accessible portions of the Site to view areas of potential hazardous material storage, disposal, or applications.

6.1. General Site Setting

At the time of the Site reconnaissance, the majority of the Site was developed as an airport. The airport was comprised of paved runways, taxiways, and multiple structures utilized as aircraft hangars, offices, maintenance facilities, a terminal, and a restaurant. Areas observed during the Site reconnaissance of potential environmental concern include the following facilities:

- Crownair Aviation (3753 John J Montgomery Drive) – Crownair Aviation (Crownair) operates a fueling station which includes, an aviation fuel dispenser, two 20,000-gallon USTs (one containing Jet A fuel and one containing aviation gas), and one 850-gallon aviation fuel truck, one 2,400-gallon and one 3,000-gallon trucks for Jet A fuel. The fueling station is located south of the runways, in the central portion of the Site (**Figure 2**). The dispenser and fuel trucks appeared in good condition, were on secondary containment, and staining or evidence of a release was not observed.
- Gibbs Flying Service (3717 John J Montgomery Drive) – Gibbs Flying Service (Gibbs) is located east of John J. Montgomery Drive in the south portion of the Site. Gibbs operates two 12,000-gallon underground fuel tanks (one contains Jet A fuel and the other contains aviation fuel) and two 2,000-gallon ASTs. The ASTs are specifically used for motor fuel gasoline. All four of the tanks are located on the Gibbs fuel farm adjacent to the north of Aero drive (**Figure 2**). Gibbs Aviation Services operates six fuel trucks containing Jet A and Aviation Gas fuels. Two 2,200-gallon trucks and one 1,200-gallon truck provide Jet A fuel for the airport. Aviation gas is provided by a 750-gallon truck, a 1,000-gallon truck, and a 1,200-gallon truck. The fuel farm was not observed due to a locked fence and gate; however, the fuel trucks were observed to be in good condition and on paved surfaces.
- Former City Helicopter and Fuel Truck Area – According to Mr. Reiter a helicopter and fuel truck were previously stationed south of the runway and northwest of Gibbs Service. A concrete pad remains in the location that the helicopter was previously parked and the surrounding area is unpaved. Stains were not observed in the area.
- Former Fire Truck Parking – Mr. Reiter also stated a fire truck with a 500-gallon tank was previously stored in a shed located in the central portion of the Site (**Figure 2**). Mr. Reiter was unsure of the firefighting fluid stored in the truck. Based on previous research by the Bodhi Group regarding Aqueous film forming foam (AFFF), it was likely water in the tank, and is possible that class B material (AFFF foam) was stored separately on the truck and mixed with the water when needed for a petroleum fire, as class B fire equipment is more commonly used at airports. Staining or evidence of a release was not observed near the shed.
- Area Near Fire Station 28 – A fire station is not located on the Site; however, a San Diego City Fire Station is located adjacent to the west of the Site, beyond Kearny Mesa Road, and is responsible for responding to emergencies at the airport. According to Mr. Reiter the firefighters occasionally perform training in an unpaved area north of the hotel (**Figure 2**) and may have practiced with water/AFFF foam.
- Landfill -The Montgomery Demolition Closed Landfill is located in the southeast portion of the Site. The landfill was not viewed during the Site reconnaissance due to muddy road conditions; however, because it accepted demolition debris only, landfill gas wells were not installed. The landfill is inspected annually.

In addition to the MYF property, a hotel is located in the southwest corner of the Site, a small strip mall containing eateries, offices, and a dry cleaner (that does not perform in-house dry cleaning) is located adjacent to the south of the Site and north of Aero Drive. An additional portion of the Site is occupied by multiple city administration and police structures, and associated parking and is located in the southeast portion of the Site adjacent to the south of Aero Drive.

The Site is generally flat, and the southern and central areas where the hangars, offices, commercial structures, and the runway are located is paved. Areas west, north, and east of the runway are unpaved and mainly covered with vegetation. Surface drainage is expected to flow to storm drains located throughout the Site or seep into unpaved areas.

7. INTERVIEWS

Interviews were conducted to identify current and/or historical Site use that may have contributed to environmental spills or releases at the Site.

Mr. Reiter completed the Owner Questionnaire on March 13, 2019. According to Mr. Reiter the Site has been owned by the City of San Diego since 1947. Mr. Reiter was aware of underground fuel tanks located on MYF property and is unaware of any environmental cleanup liens at the Site. He stated it is possible that PFAS products were released during firefighter training in the west portion of the Site.

Mr. Buzz Gibbs, President of Gibbs Flying Service, Incorporated, completed a Tenant Questionnaire on March 19, 2019. Mr. Gibbs was aware of a release at an underground fuel farm and stated the case has been closed by regulatory agencies. He also stated the Gibbs facility recycles and collects used oil and hazardous materials and are disposed of under proper manifests he indicated that they report directly to California regulatory agencies. Mr. Gibbs stated the USTs located at the Gibbs facility were replaced in 1986 and an unauthorized release case was opened during the removal and stated the regulatory documentation is on file.

8. EVALUATION OF HAZARDOUS MATERIALS

Based on the Site history, and review of regulatory records, online databases, and the database report, sources of contamination within and near the Site with the potential for adverse effects on land use changes include the following:

- Unauthorized releases of petroleum from storage systems such as USTs and ASTs can result in impacts from petroleum hydrocarbons, which can contain chemicals of concern in the volatile and non-volatile fractions as discussed previously;
- Unauthorized releases of petroleum products, waste oil, and solvents from vehicle/equipment maintenance and storage that can result in impacts from petroleum hydrocarbons, CVOCs, and metals;
- Lead in shallow soil from ADL and LBP.
- Asbestos from building materials.
- Unauthorized releases of PCBs from electrical equipment, including transformers, waste oil, and building materials that may have contained PCBs.

- Releases of ECCS into soil and groundwater from firefighting training or storage (AFFF can result in PFAS impacts).

The five potentially complete pathways of exposure of contaminants to receptors from land use changes and/or redevelopment are listed below.

- Long term exposure and potential risks to human health from vapor intrusion of volatile chemicals into occupied structures.
- Long-term exposure to hazardous chemicals in groundwater that may be a source of drinking water and other beneficial municipal use.
- Long-term direct exposure of occupants to hazardous chemicals in soil through dermal contact.
- Short-term direct exposure of construction workers to hazardous chemicals in soil through dermal contact.
- Short-term inhalation exposure of construction workers and the public to potential chemicals in dust generated by construction. Dust is an irritant on its own, but could also carry contaminants, such as lead, asbestos, polynuclear aromatic hydrocarbons, PCBs, and organochlorine pesticides (ATSDR, 2001).

Additionally, standards for evaluating risks to human health are evolving and new emerging contaminants are being discovered that may not have been evaluated in the past. Cases with closed regulatory status may need to be re-evaluated based on evolving standards or new information.

9. HAZARD EVALUATION

The properties determined to be a potential hazard to proposed future redevelopment or future land use change within the Site were evaluated with respect to the classes of hazardous chemicals and potential exposure pathways described in Sections 4 and 8.

The mitigation measures recommended for the impacted medium based on the type of hazardous chemicals potentially present are described in the table below. Areas and facilities of potential concern are illustrated on **Figure 2**.

Table 1 – Hazard Summary and Mitigation Measures

Mitigation Measures	Medium Affected			Types of Hazardous Chemical						
	Ground-water	Soil	Soil Vapor	Non-Volatile fraction of TPH	Petroleum VOCs	Chlorinated VOCs	Lead and other metals	PCBs	Pesticides	Asbestos
Construction-Related Measures: health and safety plans, risk management plans, environmental monitoring, waste management and disposal.	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
Properties located within groundwater basins designated for current or potential municipal beneficial uses may require remediation of impacted groundwater to drinking water standards.	✓			✓	✓	✓	✓			
Vapor intrusion study and appropriate response action may be required.	✓	✓	✓		✓	✓				
Investigation of soil impacted with ADL, LBP, and other hazardous building materials and appropriate response action may be required.		✓					✓	✓		✓

As discussed in Section 4.5, Emerging Contaminants may be present at the Site in areas where firefighting materials were stored or training using AFFF occurred; however, releases of AFFF have not been confirmed or documented. ECCs, such as PFAS, may not have been documented. ECCs may affect soil, groundwater, and soil vapor.

10. CONCLUSIONS AND RECOMMENDATIONS

As part of the Montgomery-Gibbs Executive Airport Master Plan, the Bodhi Group evaluated properties at the Site and immediate vicinity for potential hazards to the Site with respect to proposed redevelopment and land use changes. Information was gathered through multiple sources (EDR, Geotracker, Envirostor, and CalRecycle) to evaluate the potential environmental hazards. Properties of potential concern were evaluated based on the types of chemicals anticipated to be present, the medium affected, and potentially complete exposure pathways to receptors. Mitigation measures based on the potentially complete exposure pathways are discussed in Section 9. Based on the historical use of the Site (airport) the possibility of chemical contamination, especially related to ECCS, at the Site exists; however, there were no potential impacts related to environmental hazards from the implementation of the proposed Master Plan that cannot be avoided, reduced to an acceptable level of risk, or reduced below a level of significance through conformance with applicable regulatory requirements and mitigation measures recommend in Section 9 of this report.

11. REFERENCES

- Agency for Toxic Substances & Disease Registry (ASTSDR), 2001, Public Health Statement for Asbestos, dated: September 2001. <https://www.atsdr.cdc.gov/phs/phs.asp?id=28&tid=4>.
- ASTM International (ASTM), 2013, Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process Designation No. E 1527-013: dated November.
- California Department of Toxic Substances Control (DTSC), 2017, Envirostor Online Database, <http://www.envirostor.dtsc.ca.gov/public/>: accessed in March.
- City of San Diego, 2019, Public Notice of Preparation of a Program Environmental Impact Report: dated February.
- EDR, 2019, Area/Corridor Report, Montgomery-Gibbs Executive Airport: dated March.
- Historic Aerials by NETRONLINE, <https://www.historicaerials.com/>: accessed in April.
- Kennedy, M.P., and Tan, S.S, 2008, California Geological Survey, Geologic Map of the San Diego 30' x 60' Quadrangle, California.
- San Diego Geographic Information Systems (SANGIS), 2018, Parcels, Community, Transportation, Land Use, and Other Shapefiles, <https://www.sangis.org/>: accessed in April.
- San Diego Regional Water Quality Control Board (RWQCB), 1994, Water Quality Control Plan for the San Diego Basin (9), with amendments effective on or before May 17, 2016, dated: September. https://www.waterboards.ca.gov/sandiego/water_issues/programs/basin_plan/.
- San Diego Regional Water Quality Control Board (RWQCB), 2012, Tentative Resolution No. R9-21012-0045, dated: June 13.
- State Water Resources Control Board, 2018, GeoTracker Website, <http://www.geotracker.swrcb.ca.gov>: accessed in April.
- United States Environmental Protection Agency (EPA, 2012), Petroleum Hydrocarbons and Chlorinated Solvents Differ in Their Potential for Vapor Intrusion. <https://www.epa.gov/sites/production/files/2014-09/documents/pvicvi.pdf>.
- United States Environmental Protection Agency (USEPA), 2017a, Emerging Contaminants and Federal Facility Contaminants of Concern. <https://www.epa.gov/fedfac/emerging-contaminants-and-federal-facility-contaminants-concern>.
- United States Environmental Protection Agency (USEPA), 2017b, Learn About Asbestos. <https://www.epa.gov/asbestos/learn-about-asbestos>.
- United States Environmental Protection Agency (USEPA), 2017c, Introduction to Pesticide Drift. <https://www.epa.gov/reducing-pesticide-drift/introduction-pesticide-drift>.
- United States Environmental Protection Agency (USEPA), 2018, Learn about Polychlorinated Biphenyls (PCBs). <https://www.epa.gov/pcbs/learn-about-polychlorinated-biphenyls-pcbs>
- United States Geological Survey, 2015a, La Jolla, California, 7.5-Minute Series (Topographic): Scale 1:24,000.
- United States Geological Survey, 2015a, La Mesa, California, 7.5-Minute Series (Topographic): Scale 1:24,000.

FIGURES

- Areas Discussed in the Report
- 1

San Diego City Police
Department - Air Support Unit
- 2

Spider's Aircraft Service
- 3

Fire Training Area
- 4

Four Points by Sheraton
- 5

National Air College
- 6

Crown Air and Fueling Station
- 7

Former Fire Truck Shed
- 8

Terminal and Offices
- 9

Former Helicopter and Fuel
Truck Location
- 10

Gibbs Service Center and Fuel
Farm
- 11

Mission Bay Vortac
- 12


Air Traffic Control Tower
- 13

Montgomery Demolition
Closed Landfill
- 14

Cubic Corporation
- 15

City of San Diego Fire Repair
Facility
- 16

City of San Diego Police
Department

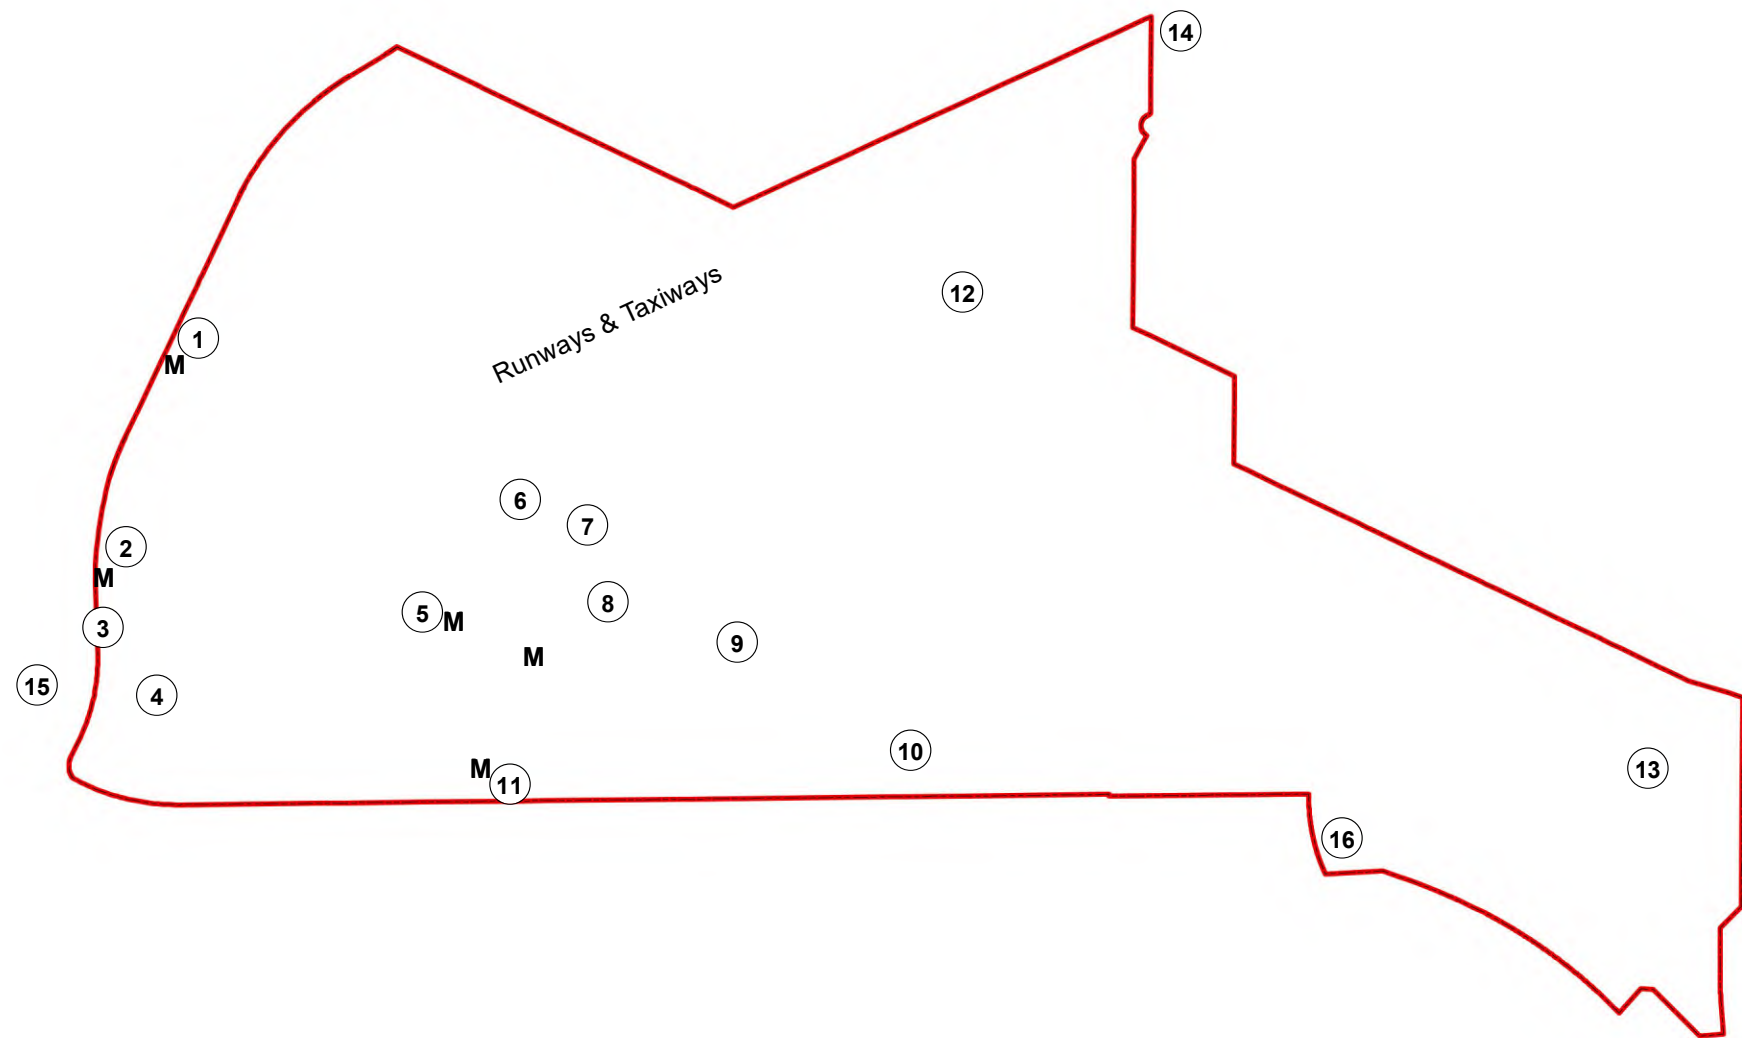

Legend M Areas where aircraft maintenance has occurred ① Areas discussed in the Report Site		Project No. 9134001	Site Plan Montgomery-Gibbs Executive Airport	
		Date: 04/2019		
	0 500 1,000 Feet	Drawn By: SG	3750 John J. Montgomery Drive San Diego, California	

Figure 2

Appendix A
Photographs



View of Spider's Aircraft Service buildings in the west portion of the Site.



View of San Diego City Police Air Unit Hangar in the west portion of the Site.



View of CrownAir fueling station and fuel truck in the central portion of the Site.



View of the shed which historically held a fire truck with a 500 gallon tank for fire suppression located in the central portion of the Site.



View of concrete pad which is the location of a former helicopter and fuel truck previously stored at the Site, located in the central portion of the Site (standing water is from a recent storm).



View of one of multiple aircraft maintenance hangars throughout the Site.



View of Gibbs fuel truck on secondary containment, located in the south/central portion of the Site.



View of San Diego Police Station located on the southeast portion of the Site.



View of San Diego Fire Repair Facility adjacent to the east of the Site.

Appendix B
EDR Database Report

Montgomery-Gibbs Executive Airport

3750 John J Montgomery Drive
San Diego, CA 92123

Inquiry Number: 5582211.3s
March 07, 2019

EDR Area / Corridor Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

SECTION	PAGE
Executive Summary	ES1
Mapped Sites Summary	2
Key Map	7
Map Findings Summary	8
Focus Maps	12
Map Findings	19
Orphan Summary	OR-1
Government Records Searched/Data Currency Tracking	GR-1

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2019 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-13), the ASTM Standard Practice for Environmental Site Assessments for Forestland or Rural Property (E 2247-16), the ASTM Standard Practice for Limited Environmental Due Diligence: Transaction Screen Process (E 1528-14) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

SUBJECT PROPERTY INFORMATION

ADDRESS

3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

TARGET PROPERTY SEARCH RESULTS

The Target Property was identified in the following databases.

Page Numbers and Map Identifications refer to the EDR Area/Corridor Report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

STANDARD ENVIRONMENTAL RECORDS

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

A review of the RCRA-LQG list, as provided by EDR, and dated 03/01/2018 has revealed that there is 1 RCRA-LQG site within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
LOCKHEED MARTIN ASTR EPA ID:: CAD982317547	4001 KEARNY VILLA RD	B10 / 1	31

RCRA-SQG: RCRA - Small Quantity Generators

A review of the RCRA-SQG list, as provided by EDR, and dated 03/01/2018 has revealed that there are 3 RCRA-SQG sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
AIR 88 INC DBA CROWN EPA ID:: CA0000269506	3753 J J MONTGOMERY	D23 / 1	42
<i>NATIONAL AIR COLLEGE</i> EPA ID:: CAD982401325	<i>3760 GLEN L CURTIS R</i>	<i>G78 / 1</i>	<i>234</i>
<i>OASIS SPORTS MEDICAL</i> EPA ID:: CAD983628900	<i>8575 GIBBS DR STE 11</i>	<i>J90 / 1</i>	<i>255</i>

EXECUTIVE SUMMARY

Federal ERNS list

ERNS: Emergency Response Notification System

A review of the ERNS list, as provided by EDR, and dated 09/24/2018 has revealed that there are 2 ERNS sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
Not reported NRC Report #: 1095572	3750 JOHN J. MONTGOM	E42 / 1	93
Not reported NRC Report #: 1019212	3870 KEARNY VILLA RD	F70 / 1	227

State and tribal landfill and/or solid waste disposal site lists

CA SWF/LF: Solid Waste Information System

A review of the CA SWF/LF list, as provided by EDR, has revealed that there is 1 CA SWF/LF site within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
SDCTY-POLICE, AIR SU Database: SWF/LF (SWIS), Date of Government Version: 02/11/2019 Operational Status: Closed Facility ID: 37-AA-0021 Regulation Status: To Be Determined	3750 JOHN J MONTGOME	E43 / 1	94

State and tribal leaking storage tank lists

CA LUST: Geotracker's Leaking Underground Fuel Tank Report

A review of the CA LUST list, as provided by EDR, has revealed that there are 8 CA LUST sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
CROWNAIR Database: LUST REG 9, Date of Government Version: 03/01/2001 Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed Closed Date: 4/5/88 Status: Case Closed Global Id: T06019751361 Global Id: T0607300944 Case Number: 9UT887	3753 JOHN J MONTGOME	D28 / 1	47
SDCTY-POLICE, AIR SU Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed Status: Preliminary site assessment underway	3750 JOHN J MONTGOME	E43 / 1	94

EXECUTIVE SUMMARY

Global Id: T0607300033			
Global Id: T0607300722			
Case Number: 9UT1011			
Case Number: 9UT1945			
MONTGOMERY FIELD	3750 JOHN J. MONTGOM	E51 / 1	120
Database: LUST REG 9, Date of Government Version: 03/01/2001			
SDCTY-FIRE REPAIR FA	3870 KEARNY VILLA RD	F57 / 1	129
Database: LUST REG 9, Date of Government Version: 03/01/2001			
Database: LUST, Date of Government Version: 12/10/2018			
Status: Completed - Case Closed			
Status: Preliminary site assessment workplan submitted			
Global Id: T0607302628			
Global Id: T0607302510			
Case Number: 9UT3869			
Case Number: 9UT3742			
NATIONAL AIR COLLEGE	3760 GLEN H. CURTISS	G72 / 1	227
Database: LUST, Date of Government Version: 12/10/2018			
Status: Completed - Case Closed			
Global Id: T0607301116			
CROWN AIR	3735 JOHN J. MONTGOM	H76 / 1	232
Database: LUST REG 9, Date of Government Version: 03/01/2001			
Closed Date: 6/20/93			
Status: Case Closed			
Case Number: 9UT2174			
NATIONAL AIR COLLEGE	3760 GLEN L CURTIS R	G78 / 1	234
Database: LUST REG 9, Date of Government Version: 03/01/2001			
Closed Date: 11/2/98			
Status: Case Closed			
Case Number: 9UT2345			
GIBBS SERVICE CENTER	8906 AERO DR	L111 / 1	283
Database: LUST REG 9, Date of Government Version: 03/01/2001			
Closed Date: 11/5/86			
Status: Case Closed			
Case Number: 9UT196			

CA CPS-SLIC: Statewide SLIC Cases

A review of the CA CPS-SLIC list, as provided by EDR, has revealed that there are 3 CA CPS-SLIC sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
CROWNAIR	3753 JOHN J MONTGOME	D28 / 1	47
Database: CPS-SLIC, Date of Government Version: 12/10/2018			
Facility Status: Completed - Case Closed			
Global Id: T0608162352			
Global Id: T0607303130			
SDCTY-FIRE REPAIR FA	3870 KEARNY VILLA RD	F57 / 1	129
Database: CPS-SLIC, Date of Government Version: 12/10/2018			
Facility Status: Completed - Case Closed			
Global Id: T0608180826			
Global Id: T0608142426			

EXECUTIVE SUMMARY

Global Id: T0608159447

GIBBS SERVICE CENTER

8906 AERO DR

L111 / 1

283

Database: CPS-SLIC, Date of Government Version: 12/10/2018

Facility Status: Completed - Case Closed

Global Id: T0607300735

State and tribal registered storage tank lists

CA UST: Active UST Facilities

A review of the CA UST list, as provided by EDR, has revealed that there are 6 CA UST sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
CROWNAIR	3753 JOHN J MONTGOME	D28 / 1	47
Database: UST, Date of Government Version: 12/10/2018			
Facility Id: H00465			
MYF HOLDINGS, LLC DB	3753 JOHN J MONTGOME	D31 / 1	85
Database: UST, Date of Government Version: 12/10/2018			
Facility Id: 37-000-100465			
SDCTY-FIRE-RESCUE DE	3870 KEARNY VILLA RD	F66 / 1	224
Database: UST, Date of Government Version: 12/10/2018			
Facility Id: 37-000-119194			
Facility Id: H19194			
FOUR POINTS BY SHERA	8110 AERO DR	K108 / 1	282
Database: UST, Date of Government Version: 12/10/2018			
Facility Id: 37-000-004078			
GIBBS FLYING SERVICE	8906 AERO DR	L119 / 1	294
Database: UST, Date of Government Version: 12/10/2018			
Facility Id: 37-000-121283			
SDCTY-INTERNAL OPERA	9225 AERO DR	N128 / 1	335
Database: UST, Date of Government Version: 12/10/2018			
Facility Id: 37-000-101877			

CA AST: Aboveground Petroleum Storage Tank Facilities

A review of the CA AST list, as provided by EDR, has revealed that there are 4 CA AST sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
CROWNAIR	3753 JOHN J MONTGOME	D28 / 1	47
Database: AST, Date of Government Version: 07/06/2016			
SDCTY-FIRE-RESCUE DE	3750 JOHN J MONTGOME	E33 / 1	86
Database: AST, Date of Government Version: 07/06/2016			
SDCTY-FIRE-RESCUE DE	3870 KEARNY VILLA RD	F58 / 1	219
Database: AST, Date of Government Version: 07/06/2016			
GIBBS SERVICE CENTER	8906 AERO DR	L111 / 1	283
Database: AST, Date of Government Version: 07/06/2016			

EXECUTIVE SUMMARY

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

CA HAULERS: Registered Waste Tire Haulers Listing

A review of the CA HAULERS list, as provided by EDR, and dated 09/26/2018 has revealed that there is 1 CA HAULERS site within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
SDCTY-FLEET OPERATIO Facility ID: 1306457	9225 AERO DR	N127 / 1	310

Local Lists of Registered Storage Tanks

CA SWEEPS UST: SWEEPS UST Listing

A review of the CA SWEEPS UST list, as provided by EDR, and dated 06/01/1994 has revealed that there are 8 CA SWEEPS UST sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
FEDERAL AVIATION ADM Status: A Tank Status: A Comp Number: 21303	4302-4298 PONDEROSA	C11 / 1	33
CROWNAIR Status: A Tank Status: A Comp Number: 465	3753 JOHN J MONTGOME	D28 / 1	47
SDCTY-POLICE, AIR SU Status: A Comp Number: 21291	3750 JOHN J MONTGOME	E43 / 1	94
SDCTY-FIRE-RESCUE DE Status: A Tank Status: A Comp Number: 19194	3870 KEARNY VILLA RD	F66 / 1	224
NATIONAL AIR COLLEGE Status: A Tank Status: A Comp Number: 15636	3760 GLEN L CURTIS R	G78 / 1	234
BARD VOTAC Comp Number: 11559	8575 GIBBS DR 101	J98 / 1	260
GIBBS FLYING SERVICE Status: A Tank Status: A Comp Number: 21283	8906 AERO DR	L119 / 1	294
SDCTY-FLEET OPERATIO Status: A	9225 AERO DR	N127 / 1	310

EXECUTIVE SUMMARY

Tank Status: A
Comp Number: 1877

CA HIST UST: Hazardous Substance Storage Container Database

A review of the CA HIST UST list, as provided by EDR, and dated 10/15/1990 has revealed that there are 15 CA HIST UST sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
SPIDERS AIRCRAFT SER Facility Id: 00000037331	BLD 119 MONTGOMERY F	6 / 1	29
TEXACO (NATIONAL AIR Facility Id: 00000016077	MONTGOMERY FIELD	7 / 1	30
CROWN AIR Facility Id: 00000011152	3753 JOHN J MONTGOME	D28 / 1	47
SDCTY-POLICE, AIR SU Facility Id: 00000029034	3750 JOHN J MONTGOME	E43 / 1	94
SDCTY-FIRE-RESCUE DE Facility Id: 00000000268	3870 KEARNY VILLA RD	F66 / 1	224
NATIONAL AIR COLLEGE Facility Id: 00000052768	3760 GLEN L CURTIS R	G78 / 1	234
TRM RCO Facility Id: 00000068502	8665 GIBBS DRIVE-SUI	I86 / 1	250
MISSION BAY VORTAC MISSION BAY VORTAC Facility Id: 00000058839	8575 GIBBS DRIVE SUI 8575 GIBBS DRIVE, SU	J89 / 1 J91 / 1	252 256
IMPERIAL VOR Facility Id: 00000058694	8575 GIBBS DRIVE, SU	J92 / 1	257
SEAL BEACH VORIAC Facility Id: 00000058816	8575 GIBBS DRIVE, SU	J93 / 1	257
POGGI VORTAC Facility Id: 00000058838	8575 GIBBS DRIVE, SU	J94 / 1	258
BARD VOTAC Facility Id: 00000058817	8575 GIBBS DRIVE, SU	J95 / 1	258
GARDEN GROVE RADAR Facility Id: 00000058697	8575 GIBBS DR STE 10	J97 / 1	259
POLICE DEPARTMENT Facility Id: 00000024477	9265 AERO DR	O129 / 1	336

Records of Emergency Release Reports

CA CHMIRS: California Hazardous Material Incident Report System

A review of the CA CHMIRS list, as provided by EDR, and dated 10/24/2018 has revealed that there are 3 CA CHMIRS sites within the requested target property.

EXECUTIVE SUMMARY

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
Not reported OES Incident Number: 1-5505	4302 PONDEROSA AVE.	C15 / 1	37
Not reported OES Incident Number: 4-5233	3750 JOHN J MONTGOME	E48 / 1	117
SDCTY-FIRE REPAIR FA OES Incident Number: 12-4394	3870 KEARNY VILLA RD	F57 / 1	129

Other Ascertainable Records

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

A review of the FTTS list, as provided by EDR, has revealed that there is 1 FTTS site within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
WATKINS CONTRACTING Database: FTTS INSP, Date of Government Version: 04/09/2009	8690 AERO DR STE M32	M121 / 1	305

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A review of the HIST FTTS list, as provided by EDR, has revealed that there is 1 HIST FTTS site within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
WATKINS CONTRACTING Database: HIST FTTS INSP, Date of Government Version: 10/19/2006	8690 AERO DR STE M32	M121 / 1	305

FINDS: Facility Index System/Facility Registry System

A review of the FINDS list, as provided by EDR, and dated 11/15/2018 has revealed that there are 20 FINDS sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
SDCTY-POLICE DEPTNA Registry ID:: 110065802475	4141 KEARNY VILLA RD	A4 / 1	28
MONTGOMERY FIELD Registry ID:: 110038069238	UNKNOWN	8 / 1	31
AIR 88 INC DBA CROWN Registry ID:: 110018956842	3753 JOHN J MONTGOME	D29 / 1	84
CROWNAIR Registry ID:: 110066462562	3753 JOHN J MONTGOME	D32 / 1	85
SDCTY-POLICENA AIR S Registry ID:: 110066467594	3750 JOHN J MONTGOME	E34 / 1	86
MONTGOMERY FIELD	3750 JOHN J MONTGOME	E46 / 1	116

EXECUTIVE SUMMARY

Registry ID:: 110070089647			
SDCTY-FIRE-RESCUE DE Registry ID:: 110055877788 Registry ID:: 110057054592	3750 JOHN J MONTGOME	E49 / 1	119
MEDIMPACT FLIGHT OPE Registry ID:: 110065266205	3751 JOHN J MONTGOME	E55 / 1	127
SDCTY-FIRE REPAIR FA Registry ID:: 110066762890	3870 KEARNY VILLA RD	F60 / 1	220
SDCTY-FIRE-RESCUE DE Registry ID:: 110055868351	3870 KEARNY VILLA RD	F62 / 1	222
RURAL/METRO SAN DIEG Registry ID:: 110066056564	3870 KEARNY VILLA RD	F69 / 1	226
NATIONAL AIR COLLEGE Registry ID:: 110002804261	3760 GLEN L CURTIS R	G78 / 1	234
CRITICAL AIR MEDICIN Registry ID:: 110066313741	3717 JOHN J MONTGOME	I83 / 1	245
FAA PDS SMO Registry ID:: 110018951017	8665 GIBBS DR SUITE	I88 / 1	252
OASIS SPORTS MEDICAL Registry ID:: 110002872856	8575 GIBBS DR STE 11	J90 / 1	255
ADVANCED AIRCRAFT SE Registry ID:: 110064970027	8622 GIBBS DR	J101 / 1	272
GIBBS FLYING SERVICE Registry ID:: 110064957943	8906 AERO DR	L113 / 1	289
GIBBS SERVICE CENTER Registry ID:: 110065721543	8906 AERO DR	L116 / 1	291
WATKINS CONTRACTING Registry ID:: 110011642892	8690 AERO DRIVE SUIT	M123 / 1	306
SDCTY-PUBLIC WORKS D Registry ID:: 110057054583	9225 AERO DR	N126 / 1	310

ECHO: Enforcement & Compliance History Information

A review of the ECHO list, as provided by EDR, and dated 09/02/2018 has revealed that there are 4 ECHO sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
AIR 88 INC DBA CROWN Registry ID: 110018956842	3753 JOHN J MONTGOME	D29 / 1	84
MONTGOMERY FIELD Registry ID: 110070089647	3750 JOHN J MONTGOME	E46 / 1	116
NATIONAL AIR COLLEGE Registry ID: 110002804261	3760 GLEN L CURTIS R	G78 / 1	234
OASIS SPORTS MEDICAL Registry ID: 110002872856	8575 GIBBS DR STE 11	J90 / 1	255

EXECUTIVE SUMMARY

CA ENF: Enforcement Action Listing

A review of the CA ENF list, as provided by EDR, and dated 11/01/2018 has revealed that there is 1 CA ENF site within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
NATIONAL AIR COLLEGE Status: Historical Status: Historical Facility Id: 243886	3760 GLEN L CURTIS R	G78 / 1	234

CA HAZNET: Facility and Manifest Data

A review of the CA HAZNET list, as provided by EDR, and dated 12/31/2017 has revealed that there are 28 CA HAZNET sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
SDCTY-POLICE DEPT, A GEPAID: CAL000309699	4141 KEARNY VILLA RD	A1 / 1	18
EXECUTIVE AIR SVC GEPAID: CAL000006999	4141 KEARNY VILLA RD	A3 / 1	28
MERCY AIR SERVICE GEPAID: CAL000404314	3753 JOHN J MONTGOME	C12 / 1	33
MYF HOLDINGS LLC DBA GEPAID: CA0000269506	3753 JOHN J MONTGOME	C13 / 1	34
MONTGOMERY FIELD SAN GEPAID: CAC002738433	4302 PONDEROSA AV	C14 / 1	36
C & B CONSULTING, LL GEPAID: CAC002871180	3753 JOHN J MONTGOME	D16 / 1	39
AIR 88 INC DBA CROWN GEPAID: CA0000269506	3753 JOHN J MONTGOME	D17 / 1	39
SHIER AVIATION CORPO GEPAID: CAL000203338	3753 JOHN J MONTGOME	D27 / 1	45
SO PACIFIC CAPITOL GEPAID: CAC002204025	3753 JOHN J MONTGOME	D30 / 1	85
SDCTY FIRE-RESCUE AI GEPAID: CAL000293341	3750 JOHN J MONTGOME	E44 / 1	114
CITY OF SAN DIEGO GEPAID: CAC002857706	3750 JOHN J. MONTGOM	E50 / 1	119
SDCTY-FIRE REPAIR FA GEPAID: CAL000209336	3870 KEARNY VILLA RD	F57 / 1	129
SDCTY-FIRE DEPT REPA GEPAID: CAL000006175	3870 KEARNY VILLA RO	F61 / 1	221
NATIONAL AIR COLLEGE GEPAID: CAD982401325	3760 GLENN CURTISS R	G80 / 1	239
SORBI AIRCRAFT MAINT GEPAID: CAL000400721	3760 GLENN CURTISS R	G81 / 1	241
FAA PDS SMO	8665 GIBBS DR SUITE	I87 / 1	250

EXECUTIVE SUMMARY

GEPAID: CA9690590188			
DETENTION'S FACILITY GEPAID: CAL000308757	8525 GIBBS DR STE 10	J104 / 1	275
COAST AIRCRAFT SALES GEPAID: CAL000039776	8620 GIBBS DRIVE	J105 / 1	277
DETENTION'S FACILITY GEPAID: CAL000206099	8525 GIBBS DR STE 30	J106 / 1	277
FOUR POINTS BY SHERA GEPAID: CAL000385498	8110 AERO DR	K107 / 1	279
ARMED FORCES AERO CL GEPAID: CAL000249882	8906 AERO DR	L114 / 1	289
GIBBS FLYING SERVICE GEPAID: CAL000049163	8906 AERO DRIVE	L118 / 1	292
CLEAN HARBORS ENVIRO GEPAID: CAC002633049	9225 AERO DR	N124 / 1	307
SDCTY POLICE EASTERN GEPAID: CAL000012920	9225 AERO DR	N125 / 1	308
SAN DIEGO POLICE GAR GEPAID: CAD982009193	9265 AERO DR	O130 / 1	336
POLICE TRAFFIC DIVIS GEPAID: CAC002215929	9265 AERO DR	O131 / 1	337
SDCTY/ENGINEERING MT GEPAID: CAL000177991	9515 AERO DR	P132 / 1	338
ARC OF SAN DIEGO, AR GEPAID: CAC002858200 GEPAID: CAC002637519	9575 AERO DR	134 / 1	341

CA HIST CORTESE: Hazardous Waste & Substance Site List

A review of the CA HIST CORTESE list, as provided by EDR, and dated 04/01/2001 has revealed that there are 6 CA HIST CORTESE sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
CROWNAIR Reg Id: 9UT887	3753 JOHN J MONTGOME	D28 / 1	47
SDCTY-POLICE, AIR SU Reg Id: 9UT1945 Reg Id: 9UT1011	3750 JOHN J MONTGOME	E43 / 1	94
SDCTY-FIRE REPAIR FA Reg Id: 9UT3742 Reg Id: 9UT3869	3870 KEARNY VILLA RD	F57 / 1	129
CROWN AIR Reg Id: 9UT2174	3735 JOHN J. MONTGOM	H76 / 1	232
NATIONAL AIR COLLEGE Reg Id: 9UT2345	3760 GLEN L CURTIS R	G78 / 1	234
GIBBS SERVICE CENTER Reg Id: 9UT196	8906 AERO DR	L111 / 1	283

EXECUTIVE SUMMARY

CA NPDES: NPDES Permits Listing

A review of the CA NPDES list, as provided by EDR, and dated 11/12/2018 has revealed that there are 2 CA NPDES sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
SDCTY-POLICE, AIR SU Facility Status: Active Facility Status: Terminated	3750 JOHN J MONTGOME	E43 / 1	94
SDCTY-FIRE REPAIR FA Facility Status: Active	3870 KEARNY VILLA RD	F57 / 1	129

CA Notify 65: Proposition 65 Records

A review of the CA Notify 65 list, as provided by EDR, and dated 09/19/2018 has revealed that there is 1 CA Notify 65 site within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
Not reported	3750 JOHN J MONTGOME	E38 / 1	92

CA WDS: Waste Discharge System

A review of the CA WDS list, as provided by EDR, and dated 06/19/2007 has revealed that there is 1 CA WDS site within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
MONTGOMERY FIELD ARP Facility Status: A Facility Id: 9 371004117	3750 JOHN J. MONTGOM	E47 / 1	116

CA CIWQS: California Integrated Water Quality System

A review of the CA CIWQS list, as provided by EDR, and dated 12/03/2018 has revealed that there are 3 CA CIWQS sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
MONTGOMERY FIELD AIR		A5 / 1	29
SDCTY-POLICE, AIR SU	3750 JOHN J MONTGOME	E43 / 1	94
SDCTY-FIRE REPAIR FA	3870 KEARNY VILLA RD	F57 / 1	129

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR Hist Auto: EDR Exclusive Historical Auto Stations

A review of the EDR Hist Auto list, as provided by EDR, has revealed that there are 2 EDR Hist Auto

EXECUTIVE SUMMARY

sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
PACIFIC DIAMOND PETR	8525 GIBBS DR STE 10	J102 / 1	272
GIBBS FLYING SERVICE	8906 AERO DR MNTGRY	L110 / 1	282

EDR Hist Cleaner: EDR Exclusive Historical Cleaners

A review of the EDR Hist Cleaner list, as provided by EDR, has revealed that there is 1 EDR Hist Cleaner site within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
VAKSHOUR JAFAR	8690 AERO DR STE 119	M122 / 1	306

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

CA RGA LF: Recovered Government Archive Solid Waste Facilities List

A review of the CA RGA LF list, as provided by EDR, has revealed that there is 1 CA RGA LF site within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
MONTGOMERY DEMOLITIO Facility ID: 37-AA-0021	3750 JOHN J. MONTGOM	E41 / 1	93

CA RGA LUST: Recovered Government Archive Leaking Underground Storage Tank

A review of the CA RGA LUST list, as provided by EDR, has revealed that there are 28 CA RGA LUST sites within the requested target property.

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
CROWNAIR	3753 JOHN J. MONTGOM	D18 / 1	41
CROWNAIR	3753 MONTGOMERY DR.	D19 / 1	41
CROWNAIR	3753 JOHN J. MONTGOM	D20 / 1	42
CROWNAIR	3753 JOHN MONTGOMERY	D21 / 1	42
CROWNAIR	3753 JOHN J. MONTGOM	D22 / 1	42
CROWNAIR	3753 JOHN J MONTGOME	D24 / 1	43
CROWNAIR	3753 JOHN J MONTGOME	D25 / 1	44
MONTGOMERY FIELD	3750 JOHN J. MONTGOM	E35 / 1	87
MONTGOMERY FIELD	3750 JOHN J. MONTGOM	E37 / 1	92
SDCTY-POLICE, AIR SU	3750 JOHN J MONTGOME	E39 / 1	92
CITY OF SAN DIEGO-MO	3750 JOHN J MONTGOME	E40 / 1	92
CITY OF SAN DIEGO-MO	3750 JOHN J MONTGOME	E45 / 1	116
MONTGOMERY FIELD	3750 JOHN J. MONTGOM	E54 / 1	127
CITY OF SAN DIEGO FI	3870 KEARNY VILLA RD	F59 / 1	220
FIRE STATION REPAIR	3870 KEARNY VILLA RD	F63 / 1	223
SDCTY-FIRE REPAIR FA	3870 KEARNY VILLA RD	F64 / 1	223
CITY OF SAN DIEGO-FI	3870 KEARNY VILLA RD	F65 / 1	223
FIRE STATION REPIAR	3870 KEARNY VILLA RD	F67 / 1	226

EXECUTIVE SUMMARY

<u>Site</u>	<u>Address</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
CITY OF SD-FIRE REPA	3870 KEARNY VILLA RD	F68 / 1	226
CITY OF SAN DIEGO-FI	3870 KEARNY VILLA RD	F71 / 1	227
CROWN AIR	3735 JOHN J. MONTGOM	H73 / 1	232
CROWN AIR	3735 JOHN J. MONTGOM	H74 / 1	232
CROWN AIR	3735 JOHN J. MONTGOM	H75 / 1	232
NATIONAL AIR COLLEGE	3760 GLENN CURTIS RD	G79 / 1	239
GIBBS FLYING SERVICE	8906 AERO DR	L109 / 1	282
GIBBS FLYING SERVICE	8906 AERO DRIVE	L115 / 1	291
GIBBS FLYING SERVICE	8906 AERO DR	L117 / 1	292
GIBBS FLYING SERVICE	8906 AERO DR	L120 / 1	305

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Page Numbers and Map Identifications refer to the EDR Area/Corridor Report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal CERCLIS NFRAP site list

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

A review of the SEMS-ARCHIVE list, as provided by EDR, and dated 12/13/2018 has revealed that there are 2 SEMS-ARCHIVE sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
<i>TELEDYNE RYAN ELECTR</i> Site ID: 0902621 EPA Id: CAD990833014	<i>8650 BALBOA AVE</i>	<i>NNE 0 - 1/8 (0.104 mi.)</i>	<i>AE199 / 1</i>	<i>775</i>
SILTEC SAN DIEGO PAC Site ID: 0900278 EPA Id: CAD086002631	3566 CORPORATE COURT	S 0 - 1/8 (0.125 mi.)	AI222 / 1	1046

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

A review of the CORRACTS list, as provided by EDR, and dated 03/01/2018 has revealed that there is 1 CORRACTS site within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
<i>TELEDYNE RYAN ELECTR</i>	<i>8650 BALBOA AVE</i>	<i>NNE 0 - 1/8 (0.104 mi.)</i>	<i>AE199 / 1</i>	<i>775</i>

EXECUTIVE SUMMARY

EPA ID:: CAD990833014

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

A review of the RCRA-TSDF list, as provided by EDR, and dated 03/01/2018 has revealed that there is 1 RCRA-TSDF site within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
TELEDYNE RYAN ELECTR EPA ID:: CAD990833014	8650 BALBOA AVE	NNE 0 - 1/8 (0.104 mi.)	AE199 / 1	775

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

A review of the RCRA-LQG list, as provided by EDR, and dated 03/01/2018 has revealed that there are 8 RCRA-LQG sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
KYOCERA INTERNATIONAL EPA ID:: CAD047896097	8611 BALBOA AVE.	NNE 0 - 1/8 (0.040 mi.)	X164 / 1	468
SUNDSTRAND POWER SYS EPA ID:: CAD981439128	8975 BALBOA AVENUE	NNW 0 - 1/8 (0.046 mi.)	Y169 / 1	660
MAXWELL TECHNOLOGIES EPA ID:: CAD981394455	3912 CALLE FORTUNADA	NNE 0 - 1/8 (0.070 mi.)	177 / 1	676
HAWTHORNE MACHINERY EPA ID:: CAD064127160	4200 KEARNY MESA ROA	WNW 0 - 1/8 (0.079 mi.)	AA182 / 1	693
BOSTON SCIENTIFIC - EPA ID:: CAR000018804	3574 RUFFIN ROAD	SSW 0 - 1/8 (0.082 mi.)	184 / 1	715
CUBIC DEFENSE APPLIC EPA ID:: CAD008382293	9233 BALBOA AVE	NE 0 - 1/8 (0.105 mi.)	AF202 / 1	829
SENIOR AEROSPACE / J EPA ID:: CAR009569740	9106 BALBOA AVENUE	NNW 0 - 1/8 (0.113 mi.)	AG208 / 1	948
MAXWELL ELECTRONIC C EPA ID:: CAD981456536	9244 BALBOA AVENUE	NE 0 - 1/8 (0.115 mi.)	AF213 / 1	961

RCRA-SQG: RCRA - Small Quantity Generators

A review of the RCRA-SQG list, as provided by EDR, and dated 03/01/2018 has revealed that there are 20 RCRA-SQG sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
LEIDOS	4211 PONDEROSA AVE	E 0 - 1/8 (0.013 mi.)	S142 / 1	391

EXECUTIVE SUMMARY

EPA ID:: CAR000073643				
SUPERSHUTTLE	4229 PONDEROSA AVE	E 0 - 1/8 (0.018 mi.)	S147 / 1	401
EPA ID:: CAD982498644				
3-D INDUSTRIES, INC	9630 AERO DR	E 0 - 1/8 (0.025 mi.)	U152 / 1	411
EPA ID:: CAD981386097				
ACTION INSTRUMENTS C	8601 AERO DR	S 0 - 1/8 (0.026 mi.)	V154 / 1	417
EPA ID:: CAD056586738				
8575 AERO DR	8575 AERO DR	S 0 - 1/8 (0.029 mi.)	V156 / 1	423
EPA ID:: CAD008232829				
LORAL INSTRUMENTATIO	8401 AERO DR	S 0 - 1/8 (0.037 mi.)	W160 / 1	440
EPA ID:: CAD118589092				
GREMLIN INDUSTRIES I	8401 AERO DRIVE	S 0 - 1/8 (0.037 mi.)	W161 / 1	442
EPA ID:: CAD064475478				
C P KELCO	8225 AERO DR	S 0 - 1/8 (0.040 mi.)	162 / 1	444
EPA ID:: CAD981695380				
CALIFORNIA METER SER	9645 AERO DR	E 0 - 1/8 (0.060 mi.)	T175 / 1	668
EPA ID:: CAD981463656				
WAVETEK	9045 BALBOA AVE	NNW 0 - 1/8 (0.075 mi.)	181 / 1	689
EPA ID:: CAD009568205				
SHELL OIL SERV STATI	3860 KEARNEY MESA	NW 0 - 1/8 (0.084 mi.)	Z189 / 1	758
EPA ID:: CAD980695597				
ULTRASIGNS, INC	9025 BALBOA AVENUE S	NNW 0 - 1/8 (0.086 mi.)	191 / 1	762
EPA ID:: CAL000289019				
SCIENTIFIC ATLANTA G	8911 BLABOA AVE	NNW 0 - 1/8 (0.087 mi.)	192 / 1	764
EPA ID:: CAD000144626				
TELEDYNE RYAN ELECTR	8650 BALBOA AVE	NNE 0 - 1/8 (0.104 mi.)	AE199 / 1	775
EPA ID:: CAD990833014				
DIGITAL DEVELOPMENT	8650 BALBOA AVE	NNE 0 - 1/8 (0.104 mi.)	AE200 / 1	824
EPA ID:: CAD008248452				
USNAVY NAVAL UNDERSE	9284 BALBOA AVE B	NE 0 - 1/8 (0.112 mi.)	AF206 / 1	876
EPA ID:: CA7170090552				
SENIOR AEROSPACE / J	9106 BALBOA AVE	NNW 0 - 1/8 (0.113 mi.)	AG209 / 1	950
EPA ID:: CAD009569740				
DATA DEVICE CORPORAT	9244 BALBOA AVE	NE 0 - 1/8 (0.115 mi.)	AF214 / 1	962
EPA ID:: CAD980638050				
TRICARE OUTPATIENT C	8808 BALBOA AVE	NNW 0 - 1/8 (0.121 mi.)	AH216 / 1	998
EPA ID:: CAD981396419				
TELEDYNE ELECTRONIC	3565 CORPORATE CT	S 0 - 1/8 (0.124 mi.)	221 / 1	1043
EPA ID:: CAD981378946				

State- and tribal - equivalent CERCLIS

CA ENVIROSTOR: EnviroStor Database

A review of the CA ENVIROSTOR list, as provided by EDR, and dated 01/28/2019 has revealed that there

EXECUTIVE SUMMARY

are 3 CA ENVIROSTOR sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
8575 AERO DR Facility Id: 71002149 Status: Certified O&M - Land Use Restrictions Only	8575 AERO DR	S 0 - 1/8 (0.029 mi.)	V156 / 1	423
TELEDYNE RYAN ELECTR Facility Id: 37360090 Facility Id: 80001516 Status: Refer: RCRA Status: Active	8650 BALBOA AVE	NNE 0 - 1/8 (0.104 mi.)	AE199 / 1	775
SENIOR AEROSPACE JET Facility Id: 71003760 Status: Inactive - Needs Evaluation	9106 BALBOA AV	NNW 0 - 1/8 (0.113 mi.)	AG207 / 1	878

State and tribal leaking storage tank lists

CA LUST: Geotracker's Leaking Underground Fuel Tank Report

A review of the CA LUST list, as provided by EDR, has revealed that there are 16 CA LUST sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
MONTGOMERY FIELD ATC Database: LUST REG 9, Date of Government Version: 03/01/2001	4298 PONDEROSA AV	ESE 0 - 1/8 (0.004 mi.)	R137 / 1	355
MONTGOMERY FIELD ATC Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed Status: Preliminary site assessment workplan submitted Global Id: T0607302461 Case Number: 9UT3693	4298 PONDEROSA AV	ESE 0 - 1/8 (0.004 mi.)	R138 / 1	374
J. BITTLE AMERICAN, Database: LUST REG 9, Date of Government Version: 03/01/2001 Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed Closed Date: 2/1/94 Status: Case Closed Global Id: T0607300495 Case Number: 9UT1679	9630 AERO DR	E 0 - 1/8 (0.025 mi.)	U153 / 1	413
KYOCERA INTERNATIONAL Database: LUST REG 9, Date of Government Version: 03/01/2001 Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed Closed Date: 1/29/93 Status: Case Closed Global Id: T0607300283 Case Number: 9UT1458	8611 BALBOA AVE.	NNE 0 - 1/8 (0.040 mi.)	X164 / 1	468
SUNSET MOTORS Database: LUST REG 9, Date of Government Version: 03/01/2001 Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed	3888 KEARNY MESA RD	NW 0 - 1/8 (0.073 mi.)	Z178 / 1	682

EXECUTIVE SUMMARY

Closed Date: 3/2/89
 Status: Case Closed
 Global Id: T0607303212
 Case Number: 9UT978

STAPLES THE OFFICE S	4200 KEARNY MESA RD	WNW 0 - 1/8 (0.079 mi.)	AA183 / 1	705
Database: LUST REG 9, Date of Government Version: 03/01/2001				
Database: LUST, Date of Government Version: 12/10/2018				
Status: Completed - Case Closed				
Closed Date: 10/14/91				
Closed Date: 9/21/92				
Closed Date: 2/19/92				
Status: Case Closed				
Global Id: T0607301645				
Global Id: T0607300521				
Global Id: T0607300976				
Case Number: 9UT1723				
Case Number: 9UT2210				
Case Number: 9UT2883				
KEARNY MESA 76, LLC.	3860 KEARNY MESA RD	NW 0 - 1/8 (0.084 mi.)	Z185 / 1	725
Database: LUST REG 9, Date of Government Version: 03/01/2001				
Closed Date: 3/17/99				
Status: Case Closed				
Case Number: 9UT3716				
PROPEL BIOFUELS 76	3860 KEARNY MESA ROA	NW 0 - 1/8 (0.084 mi.)	Z187 / 1	747
Database: LUST, Date of Government Version: 12/10/2018				
Status: Open - Site Assessment				
Global Id: T10000004590				
KEARNY MESA EXXON	3860 KEARNY MESA RD	NW 0 - 1/8 (0.084 mi.)	Z190 / 1	760
Database: LUST, Date of Government Version: 12/10/2018				
Status: Completed - Case Closed				
Global Id: T0607302484				
HIPP MARINE SERVICES	4070 KEARNY MESA RD	WNW 0 - 1/8 (0.101 mi.)	AC195 / 1	767
Database: LUST, Date of Government Version: 12/10/2018				
Status: Completed - Case Closed				
Global Id: T0607301653				
GEMINI MOVING SPECIA	4070 KEARNY MESA RD	WNW 0 - 1/8 (0.101 mi.)	AC196 / 1	770
Database: LUST REG 9, Date of Government Version: 03/01/2001				
Closed Date: 2/27/97				
Status: Case Closed				
Case Number: 9UT2891				
MY MECHANIC	3833 CONVOY ST	WNW 0 - 1/8 (0.103 mi.)	AD198 / 1	772
Database: LUST REG 9, Date of Government Version: 03/01/2001				
Database: LUST, Date of Government Version: 12/10/2018				
Status: Completed - Case Closed				
Closed Date: 6/30/87				
Status: Case Closed				
Global Id: T0607301646				
Case Number: 9UT2884				
NAVAL UNDERSEA WARFA	9284 BALBOA AV	NE 0 - 1/8 (0.112 mi.)	AF205 / 1	875
Database: LUST, Date of Government Version: 12/10/2018				
Status: Completed - Case Closed				
Global Id: T10000005029				
MAXWELL LABORATORIES	9244 BALBOA AVE	NE 0 - 1/8 (0.115 mi.)	AF212 / 1	957
Database: LUST REG 9, Date of Government Version: 03/01/2001				

EXECUTIVE SUMMARY

Closed Date: 5/3/99
 Closed Date: 5/25/00
 Status: Case Closed
 Case Number: 9UT3259
 Case Number: 9UT3542

DATA DEVICE CORPORAT **9244 BALBOA AVE** **NE 0 - 1/8 (0.115 mi.)** **AF214 / 1** **962**
 Database: LUST, Date of Government Version: 12/10/2018
 Status: Completed - Case Closed
 Global Id: T0607302012
 Global Id: T0607302311

TRICARE OUTPATIENT C **8808 BALBOA AVE** **NNW 0 - 1/8 (0.121 mi.)** **AH216 / 1** **998**
 Database: LUST REG 9, Date of Government Version: 03/01/2001
 Closed Date: 5/25/88
 Status: Case Closed
 Case Number: 9UT717

CA CPS-SLIC: Statewide SLIC Cases

A review of the CA CPS-SLIC list, as provided by EDR, has revealed that there are 8 CA CPS-SLIC sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
PROGENY SYSTEMS Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Global Id: T0608158316 Global Id: T06019753982	4217 PONDEROSA AVE S	E 0 - 1/8 (0.013 mi.)	S141 / 1	388
PRIII/BROADSTONE KEA Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Global Id: T10000004281	8601 AERO DR	S 0 - 1/8 (0.026 mi.)	V155 / 1	419
KYOCERA INTERNATIONAL Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Global Id: T0608123224	8611 BALBOA AVE.	NNE 0 - 1/8 (0.040 mi.)	X164 / 1	468
STAPLES THE OFFICE S Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Global Id: T0608126644 Global Id: T0608190244 Global Id: T0608114274 Global Id: T0608131812	4200 KEARNY MESA RD	WNW 0 - 1/8 (0.079 mi.)	AA183 / 1	705
CUBIC DEFENSE APPLIC Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Facility Status: Open - Active Global Id: T0608107991 Global Id: T10000012319	9233 BALBOA AV	NE 0 - 1/8 (0.105 mi.)	AF204 / 1	845
FORMER MAXWELL TECH Database: SLIC REG 9, Date of Government Version: 09/10/2007 Status: Dead	9244 BALBOA AVENUE	NE 0 - 1/8 (0.115 mi.)	AF211 / 1	956
DATA DEVICE CORPORAT Database: CPS-SLIC, Date of Government Version: 12/10/2018	9244 BALBOA AVE	NE 0 - 1/8 (0.115 mi.)	AF214 / 1	962

EXECUTIVE SUMMARY

Facility Status: Completed - Case Closed

Global Id: T0608115110

Global Id: T0608163822

TRICARE OUTPATIENT C **8808 BALBOA AVE** **NNW 0 - 1/8 (0.121 mi.)** **AH217 / 1** **1003**
 Database: CPS-SLIC, Date of Government Version: 12/10/2018
 Facility Status: Completed - Case Closed
 Global Id: T0607302983

State and tribal registered storage tank lists

CA UST: Active UST Facilities

A review of the CA UST list, as provided by EDR, has revealed that there are 4 CA UST sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
SDCTY-FIRE-RESCUE DE Database: UST, Date of Government Version: 12/10/2018 Facility Id: 37-000-126616 Facility Id: H26616	3750 KEARNY VILLA RD	ESE 0 - 1/8 (0.001 mi.)	135 / 1	345
SDCTY-FIRE STATION # Database: UST, Date of Government Version: 12/10/2018 Facility Id: H21297 Facility Id: 37-000-121297	3880 KEARNY VILLA RD	NNE 0 - 1/8 (0.007 mi.)	Q139 / 1	384
7-ELEVEN INC #32606 Database: UST, Date of Government Version: 12/10/2018 Facility Id: H38191 Facility Id: 37-000-138191	9609 AERO DR	E 0 - 1/8 (0.023 mi.)	T148 / 1	403
KEARNY MESA 76, LLC. Database: UST, Date of Government Version: 12/10/2018 Facility Id: 37-000-217190 Facility Id: H15306 Facility Id: 37-000-217250	3860 KEARNY MESA RD	NW 0 - 1/8 (0.084 mi.)	Z188 / 1	753

CA AST: Aboveground Petroleum Storage Tank Facilities

A review of the CA AST list, as provided by EDR, has revealed that there are 9 CA AST sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
LEVEL 3 COMMUNICATIO Database: AST, Date of Government Version: 07/06/2016	8929 AERO DR	S 0 - 1/8 (0.023 mi.)	149 / 1	403
AEROVAULT VENTURE, L Database: AST, Date of Government Version: 07/06/2016	8875 AERO DR	S 0 - 1/8 (0.023 mi.)	L150 / 1	404
KYOCERA INTERNATIONAL Database: AST, Date of Government Version: 07/06/2016	8611 BALBOA AVE.	NNE 0 - 1/8 (0.040 mi.)	X164 / 1	468
KYOCERA CO-GEN Database: AST, Date of Government Version: 07/06/2016	8611 BALBOA AVE	NNE 0 - 1/8 (0.040 mi.)	X165 / 1	645
CASTLE ACCESS Database: AST, Date of Government Version: 07/06/2016	9606 AERO DR STE 190	E 0 - 1/8 (0.046 mi.)	168 / 1	659

EXECUTIVE SUMMARY

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
JACK HENRY & ASSOCIA Database: AST, Date of Government Version: 07/06/2016	8975 BALBOA AVE	NNW 0 - 1/8 (0.046 mi.)	Y170 / 1	661
SHARP HEALTH CARE (D Database: AST, Date of Government Version: 07/06/2016	3571 CORPORATE CT	S 0 - 1/8 (0.055 mi.)	173 / 1	664
ECONO LUBE N TUNE & Database: AST, Date of Government Version: 07/06/2016	7979 AERO DR	W 0 - 1/8 (0.087 mi.)	193 / 1	766
SENIOR AEROSPACE JET Database: AST, Date of Government Version: 07/06/2016	9106 BALBOA AV	NNW 0 - 1/8 (0.113 mi.)	AG207 / 1	878

State and tribal voluntary cleanup sites

CA VCP: Voluntary Cleanup Program Properties

A review of the CA VCP list, as provided by EDR, and dated 01/28/2019 has revealed that there is 1 CA VCP site within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
8575 AERO DR Status: Certified O&M - Land Use Restrictions Only Facility Id: 71002149	8575 AERO DR	S 0 - 1/8 (0.029 mi.)	V156 / 1	423

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Registered Storage Tanks

CA SWEEPS UST: SWEEPS UST Listing

A review of the CA SWEEPS UST list, as provided by EDR, and dated 06/01/1994 has revealed that there are 18 CA SWEEPS UST sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
SDCTY-FIRE-RESCUE DE Status: A Tank Status: A Comp Number: 26616	3750 KEARNY VILLA RD	ESE 0 - 1/8 (0.001 mi.)	135 / 1	345
SPIDERS AIRCRAFT SER Status: A Comp Number: 4244	3873 KEARNY VILLA RD	W 0 - 1/8 (0.002 mi.)	Q136 / 1	346
MONTGOMERY FIELD ATC Status: A Tank Status: A Comp Number: 21302	4298 PONDEROSA AV	ESE 0 - 1/8 (0.004 mi.)	R138 / 1	374
SDCTY-FIRE STATION # Status: A Tank Status: A	3880 KEARNY VILLA RD	NNE 0 - 1/8 (0.007 mi.)	Q139 / 1	384

EXECUTIVE SUMMARY

Comp Number: 21297				
MADISON SQUARE PARTN Comp Number: 21381	4223 PONDEROSA AVE A	E 0 - 1/8 (0.018 mi.)	S146 / 1	401
SAN DIEGO CENTRAL CA Status: A Tank Status: A Comp Number: 21288	8875 AERO DR 4062	S 0 - 1/8 (0.023 mi.)	L151 / 1	410
J. BITTLE AMERICAN, Status: A Comp Number: 11	9630 AERO DR	E 0 - 1/8 (0.025 mi.)	U153 / 1	413
NATURESCAPE SERVICES Status: A Tank Status: A Comp Number: 9462	8575 AERO DR	S 0 - 1/8 (0.029 mi.)	V158 / 1	437
KYOCERA AMERICA INC Status: A Comp Number: 62	8611 BALBOA AVE	NNE 0 - 1/8 (0.040 mi.)	X163 / 1	467
SAN DIEGO COUNTY MED Comp Number: 21299	3702 RUFFIN RD	E 0 - 1/8 (0.053 mi.)	171 / 1	662
SUNSET MOTORS Comp Number: 15307	3888 KEARNY MESA RD	NW 0 - 1/8 (0.073 mi.)	Z178 / 1	682
HAWTHORNE MACHINERY Status: A Tank Status: A Comp Number: 2728	4200 KEARNY MESA ROA	WNW 0 - 1/8 (0.079 mi.)	AA182 / 1	693
KEARNY MESA 76, LLC. Status: A Tank Status: A Comp Number: 15306	3860 KEARNY MESA RD	NW 0 - 1/8 (0.084 mi.)	Z185 / 1	725
GEMINI MOVING SPECIA Status: A Tank Status: A Comp Number: 3121	4070 KEARNY MESA RD	WNW 0 - 1/8 (0.101 mi.)	AC196 / 1	770
CUBIC CORPORATION Status: A Tank Status: A Comp Number: 70	9233 BALBOA AVE	NE 0 - 1/8 (0.105 mi.)	AF203 / 1	842
MAXWELL LABORATORIES Status: A Tank Status: A Comp Number: 2930	9244 BALBOA AVE	NE 0 - 1/8 (0.115 mi.)	AF212 / 1	957
TRICARE OUTPATIENT C Status: A Comp Number: 9343	8808 BALBOA AVE	NNW 0 - 1/8 (0.121 mi.)	AH216 / 1	998
AEROSPACE SUPPLY INC Status: A Comp Number: 1391	3738 RUFFIN RD	E 0 - 1/8 (0.121 mi.)	219 / 1	1042

EXECUTIVE SUMMARY

CA HIST UST: Hazardous Substance Storage Container Database

A review of the CA HIST UST list, as provided by EDR, and dated 10/15/1990 has revealed that there are 17 CA HIST UST sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
MONTGOMERY FIELD ATC Facility Id: 00000059099	4298 PONDEROSA AV	ESE 0 - 1/8 (0.004 mi.)	R138 / 1	374
FIRE STATION 28 Facility Id: 00000000280	3880 KEARNY VILLA RD	NNE 0 - 1/8 (0.007 mi.)	Q140 / 1	387
NUVASIVE MADISON SQUARE PARTN Facility Id: 00000004492	4223 PONDEROSA AVE C 4223 PONDEROSA AVE S	E 0 - 1/8 (0.018 mi.) E 0 - 1/8 (0.018 mi.)	S144 / 1 S145 / 1	395 400
AEROVAULT VENTURE, L Facility Id: 00000016566	8875 AERO DR	S 0 - 1/8 (0.023 mi.)	L150 / 1	404
8575 AERO DR Facility Id: 00000054619	8575 AERO DR	S 0 - 1/8 (0.029 mi.)	V156 / 1	423
MOORE PRINTED CIRCUIT KYOCERA INTERNATIONAL Facility Id: 00000054264	8575 AERO DR 8611 BALBOA AVE.	S 0 - 1/8 (0.029 mi.) NNE 0 - 1/8 (0.040 mi.)	V157 / 1 X164 / 1	435 468
SAN DIEGO COUNTY MED Facility Id: 00000038799	3702 RUFFIN RD	E 0 - 1/8 (0.053 mi.)	171 / 1	662
SUNSET MOTORS PHD CORP Facility Id: 00000067629 Facility Id: 00000067630	3888 KEARNY MESA RD 3888 KEARNEY MESA RD	NW 0 - 1/8 (0.073 mi.) NW 0 - 1/8 (0.073 mi.)	Z178 / 1 Z179 / 1	682 686
LEASEWAY TRANSPORTATION Facility Id: 00000010272	3888 KEARNY MESA RD	NW 0 - 1/8 (0.073 mi.)	Z180 / 1	689
SHELL OIL SERVICE STATION Facility Id: 00000056810	3860 KEARNEY MESA	NW 0 - 1/8 (0.084 mi.)	Z189 / 1	758
CUBIC CORPORATION Facility Id: 00000014328	9233 BALBOA AVE	NE 0 - 1/8 (0.105 mi.)	AF203 / 1	842
CUBIC DEFENSE APPLICATION BUILDING 1 Facility Id: 00000000914	9233 BALBOA AV 9244 BALBOA AVE	NE 0 - 1/8 (0.105 mi.) NE 0 - 1/8 (0.115 mi.)	AF204 / 1 AF210 / 1	845 955
DATA DEVICE CORPORATION	9244 BALBOA AVE	NE 0 - 1/8 (0.115 mi.)	AF214 / 1	962

Local Land Records

CA DEED: Deed Restriction Listing

A review of the CA DEED list, as provided by EDR, and dated 12/03/2018 has revealed that there is 1 CA DEED site within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
8575 AERO DR Status: CERTIFIED O&M - LAND USE RESTRICTIONS ONLY Envirostor ID: 71002149	8575 AERO DR	S 0 - 1/8 (0.029 mi.)	V156 / 1	423

EXECUTIVE SUMMARY

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 03/01/2018 has revealed that there are 6 RCRA NonGen / NLR sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
MAXWELL LABORATORIES EPA ID:: CAD981684160	4241 PONDEROSA AVE	E 0 - 1/8 (0.017 mi.)	R143 / 1	393
KYOCERA SOLAR INC EPA ID:: CAR000207639	8611 BALBOA AVE	NNE 0 - 1/8 (0.040 mi.)	X167 / 1	655
LOCKHEED MARTIN MARI EPA ID:: CAR000162909	3853 CALLE FORTUNADA	NNE 0 - 1/8 (0.064 mi.)	176 / 1	670
PHD CORP EPA ID:: CAD981162381	3888 KEARNEY MESA RD	NW 0 - 1/8 (0.073 mi.)	Z179 / 1	686
G D E SYSTEMS INC EPA ID:: CAD982482580	8804 BALBOA AVE	NNW 0 - 1/8 (0.121 mi.)	AB218 / 1	1040
DELTA GROUP ELECTRON EPA ID:: CAD981666076	3566 CORPORATE COURT	S 0 - 1/8 (0.125 mi.)	AI223 / 1	1047

2020 COR ACTION: 2020 Corrective Action Program List

A review of the 2020 COR ACTION list, as provided by EDR, and dated 09/30/2017 has revealed that there is 1 2020 COR ACTION site within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
TELEDYNE RYAN ELECTR EPA ID:: CAD990833014	8650 BALBOA AVE	NNE 0 - 1/8 (0.104 mi.)	AE199 / 1	775

CA HIST CORTESE: Hazardous Waste & Substance Site List

A review of the CA HIST CORTESE list, as provided by EDR, and dated 04/01/2001 has revealed that there are 11 CA HIST CORTESE sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
MONTGOMERY FIELD ATC Reg Id: 9UT3693	4298 PONDEROSA AV	ESE 0 - 1/8 (0.004 mi.)	R138 / 1	374
J. BITTLE AMERICAN, Reg Id: 9UT1679	9630 AERO DR	E 0 - 1/8 (0.025 mi.)	U153 / 1	413
KYOCERA INTERNATIONAL Reg Id: 9UT1458	8611 BALBOA AVE.	NNE 0 - 1/8 (0.040 mi.)	X164 / 1	468
SUNSET MOTORS Reg Id: 9UT978	3888 KEARNY MESA RD	NW 0 - 1/8 (0.073 mi.)	Z178 / 1	682
STAPLES THE OFFICE S Reg Id: 9UT2883	4200 KEARNY MESA RD	WNW 0 - 1/8 (0.079 mi.)	AA183 / 1	705

EXECUTIVE SUMMARY

Reg Id: 9UT2210

Reg Id: 9UT1723

KEARNY MESA EXXON Reg Id: 9UT3716	3860 KEARNY MESA RD	NW 0 - 1/8 (0.084 mi.)	Z190 / 1	760
HIPP MARINE SERVICES Reg Id: 9UT2891	4070 KEARNY MESA RD	WNW 0 - 1/8 (0.101 mi.)	AC195 / 1	767
MY MECHANIC Reg Id: 9UT2884	3833 CONVOY ST	WNW 0 - 1/8 (0.103 mi.)	AD198 / 1	772
TELEDYNE RYAN ELECTR Reg Id: 37360090	8650 BALBOA AVE	NNE 0 - 1/8 (0.104 mi.)	AE199 / 1	775
DATA DEVICE CORPORAT Reg Id: 9UT3542 Reg Id: 9UT3259	9244 BALBOA AVE	NE 0 - 1/8 (0.115 mi.)	AF214 / 1	962
TRICARE OUTPATIENT C Reg Id: 9UT717	8808 BALBOA AVE	NNW 0 - 1/8 (0.121 mi.)	AH217 / 1	1003

CA HWP: EnviroStor Permitted Facilities Listing

A review of the CA HWP list, as provided by EDR, and dated 02/19/2019 has revealed that there are 2 CA HWP sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
KYOCERA INTERNATIONAL EPA Id: CAD047896097 Cleanup Status: CLOSED	8611 BALBOA AVE	NNE 0 - 1/8 (0.040 mi.)	X166 / 1	645
TELEDYNE RYAN ELECTR EPA Id: CAD990833014 Cleanup Status: UNDERGOING CLOSURE	8650 BALBOA AVE	NNE 0 - 1/8 (0.104 mi.)	AE201 / 1	825

NY MANIFEST: Facility and Manifest Data

A review of the NY MANIFEST list, as provided by EDR, and dated 01/01/2019 has revealed that there are 2 NY MANIFEST sites within approximately 0.25 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
C P KELCO EPA ID: CAD981695380	8225 AERO DR	S 0 - 1/8 (0.040 mi.)	162 / 1	444
SOLAR TURBINES INCOR EPA ID: CAT000626549	4200 RUFFIN ROAD	NE 1/8 - 1/4 (0.158 mi.)	224 / 1	1050

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR Hist Auto: EDR Exclusive Historical Auto Stations

A review of the EDR Hist Auto list, as provided by EDR, has revealed that there are 5 EDR Hist Auto

EXECUTIVE SUMMARY

sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
E & R TRANSMISSION A	3587 RUFFIN RD UNIT	SSW 0 - 1/8 (0.054 mi.)	172 / 1	663
KEARNY MESA SHELL SE	3860 KEARNY MESA R	NW 0 - 1/8 (0.084 mi.)	Z186 / 1	747
SAN DIEGO PORSCHE RE	8861 BALBOA AVE	NNW 0 - 1/8 (0.088 mi.)	AB194 / 1	766
AMERICAN OIL CO	3833 CONVOY ST	WNW 0 - 1/8 (0.103 mi.)	AD197 / 1	772
BLVO BEESON FLOYD CH	4398 KEARNY MESA R	WNW 0 - 1/8 (0.122 mi.)	220 / 1	1043

EDR Hist Cleaner: EDR Exclusive Historical Cleaners

A review of the EDR Hist Cleaner list, as provided by EDR, has revealed that there are 2 EDR Hist Cleaner sites within approximately 0.125 miles of the requested target property.

<u>Site</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID / Focus Map(s)</u>	<u>Page</u>
ON SITE DRAPERY CLEA	8555 AERO DR	S 0 - 1/8 (0.029 mi.)	V159 / 1	440
WEB SERVICE CO INC	9645 AERO DR	E 0 - 1/8 (0.060 mi.)	T174 / 1	668

MAPPED SITES SUMMARY

Target Property:
3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

MAP ID / FOCUS MAP	SITE NAME	ADDRESS	DATABASE ACRONYMS	DIST (ft. & mi.) DIRECTION
A1 / 1	SDCTY-POLICE DEPT, A	4141 KEARNY VILLA RD	CA San Diego Co. HMMD, CA HAZNET	TP
A2 / 1	SDCTY-POLICE AIR SUP	4141 KEARNY VILLA RD	CA San Diego Co. HMMD	TP
A3 / 1	EXECUTIVE AIR SVC	4141 KEARNY VILLA RD	CA HAZNET	TP
A4 / 1	SDCTY-POLICE DEPTNA	4141 KEARNY VILLA RD	FINDS	TP
A5 / 1	MONTGOMERY FIELD AIR		CA CIWQS	TP
6 / 1	SPIDERS AIRCRAFT SER	BLD 119 MONTGOMERY F	CA HIST UST	TP
7 / 1	TEXACO (NATIONAL AIR	MONTGOMERY FIELD	CA HIST UST	TP
8 / 1	MONTGOMERY FIELD	UNKNOWN	FINDS	TP
B9 / 1	CALIFORNIA WINGS	4025 KEARNY VILLA RD	CA San Diego Co. HMMD	TP
B10 / 1	LOCKHEED MARTIN ASTR	4001 KEARNY VILLA RD	RCRA-LQG	TP
C11 / 1	FEDERAL AVIATION ADM	4302-4298 PONDEROSA	CA SWEEPS UST	TP
C12 / 1	MERCY AIR SERVICE	3753 JOHN J MONTGOME	CA HAZNET	TP
C13 / 1	MYF HOLDINGS LLC DBA	3753 JOHN J MONTGOME	CA HAZNET	TP
C14 / 1	MONTGOMERY FIELD SAN	4302 PONDEROSA AV	CA San Diego Co. HMMD, CA HAZNET	TP
C15 / 1		4302 PONDEROSA AVE.	CA CHMIRS	TP
D16 / 1	C & B CONSULTING, LL	3753 JOHN J MONTGOME	CA HAZNET	TP
D17 / 1	AIR 88 INC DBA CROWN	3753 JOHN J MONTGOME	CA HAZNET	TP
D18 / 1	CROWNAIR	3753 JOHN J. MONTGOM	CA RGA LUST	TP
D19 / 1	CROWNAIR	3753 MONTGOMERY DR.	CA RGA LUST	TP
D20 / 1	CROWNAIR	3753 JOHN J. MONTGOM	CA RGA LUST	TP
D21 / 1	CROWNAIR	3753 JOHN MONTGOMERY	CA RGA LUST	TP
D22 / 1	CROWNAIR	3753 JOHN J. MONTGOM	CA RGA LUST	TP
D23 / 1	AIR 88 INC DBA CROWN	3753 J J MONTGOMERY	RCRA-SQG	TP
D24 / 1	CROWNAIR	3753 JOHN J MONTGOME	CA RGA LUST	TP
D25 / 1	CROWNAIR	3753 JOHN J MONTGOME	CA RGA LUST	TP
D26 / 1	CRITICAL AIR MEDICIN	3753 JOHN J MONTGOME	CA San Diego Co. HMMD	TP
D27 / 1	SHIER AVIATION CORPO	3753 JOHN J MONTGOME	CA HAZNET	TP
D28 / 1	CROWNAIR	3753 JOHN J MONTGOME	CA LUST, CA SAN DIEGO CO. SAM, CA CPS-SL...	TP
D29 / 1	AIR 88 INC DBA CROWN	3753 JOHN J MONTGOME	FINDS, ECHO	TP
D30 / 1	SO PACIFIC CAPITOL	3753 JOHN J MONTGOME	CA HAZNET	TP
D31 / 1	MYF HOLDINGS, LLC DB	3753 JOHN J MONTGOME	CA UST	TP
D32 / 1	CROWNAIR	3753 JOHN J MONTGOME	FINDS	TP
E33 / 1	SDCTY-FIRE-RESCUE DE	3750 JOHN J MONTGOME	CA AST	TP
E34 / 1	SDCTY-POLICENA AIR S	3750 JOHN J MONTGOME	FINDS	TP
E35 / 1	MONTGOMERY FIELD	3750 JOHN J. MONTGOM	CA RGA LUST	TP
E36 / 1	SDCTY- FIRE & RESCUE	3750 JOHN J MONTGOME	CA San Diego Co. HMMD	TP
E37 / 1	MONTGOMERY FIELD	3750 JOHN J. MONTGOM	CA RGA LUST	TP
E38 / 1		3750 JOHN J MONTGOME	CA Notify 65	TP
E39 / 1	SDCTY-POLICE, AIR SU	3750 JOHN J MONTGOME	CA RGA LUST	TP

MAPPED SITES SUMMARY

Target Property:

3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

MAP ID / FOCUS MAP	SITE NAME	ADDRESS	DATABASE ACRONYMS	DIST (ft. & mi.) DIRECTION
E40 / 1	CITY OF SAN DIEGO-MO	3750 JOHN J MONTGOME	CA RGA LUST	TP
E41 / 1	MONTGOMERY DEMOLITIO	3750 JOHN J. MONTGOM	CA RGA LF	TP
E42 / 1		3750 JOHN J. MONTGOM	ERNS	TP
E43 / 1	SDCTY-POLICE, AIR SU	3750 JOHN J MONTGOME	CA SWF/LF, CA LUST, CA SAN DIEGO CO. SAM...	TP
E44 / 1	SDCTY FIRE-RESCUE AI	3750 JOHN J MONTGOME	CA HAZNET	TP
E45 / 1	CITY OF SAN DIEGO-MO	3750 JOHN J MONTGOME	CA RGA LUST	TP
E46 / 1	MONTGOMERY FIELD	3750 JOHN J MONTGOME	FINDS, ECHO	TP
E47 / 1	MONTGOMERY FIELD ARP	3750 JOHN J. MONTGOM	CA WDS	TP
E48 / 1		3750 JOHN J MONTGOME	CA CHMIRS	TP
E49 / 1	SDCTY-FIRE-RESCUE DE	3750 JOHN J MONTGOME	FINDS	TP
E50 / 1	CITY OF SAN DIEGO	3750 JOHN J. MONTGOM	CA HAZNET	TP
E51 / 1	MONTGOMERY FIELD	3750 JOHN J. MONTGOM	CA LUST	TP
E52 / 1	SDCTY-FIRE-RESCUE DE	3750 JOHN J MONTGOME	CA San Diego Co. HMMD	TP
E53 / 1	SDCTY-REA, MONTGOMER	3750 JOHN J MONTGOME	CA San Diego Co. HMMD	TP
E54 / 1	MONTGOMERY FIELD	3750 JOHN J. MONTGOM	CA RGA LUST	TP
E55 / 1	MEDIMPACT FLIGHT OPE	3751 JOHN J MONTGOME	FINDS	TP
E56 / 1	MEDIMPACT FLIGHT OPE	3751 JOHN J MONTGOME	CA San Diego Co. HMMD	TP
F57 / 1	SDCTY-FIRE REPAIR FA	3870 KEARNY VILLA RD	CA LUST, CA SAN DIEGO CO. SAM, CA CPS-SL...	TP
F58 / 1	SDCTY-FIRE-RESCUE DE	3870 KEARNY VILLA RD	CA AST	TP
F59 / 1	CITY OF SAN DIEGO FI	3870 KEARNY VILLA RD	CA RGA LUST	TP
F60 / 1	SDCTY-FIRE REPAIR FA	3870 KEARNY VILLA RD	FINDS	TP
F61 / 1	SDCTY-FIRE DEPT REPA	3870 KEARNY VILLA RO	CA HAZNET	TP
F62 / 1	SDCTY-FIRE-RESCUE DE	3870 KEARNY VILLA RD	FINDS	TP
F63 / 1	FIRE STATION REPAIR	3870 KEARNY VILLA RD	CA RGA LUST	TP
F64 / 1	SDCTY-FIRE REPAIR FA	3870 KEARNY VILLA RD	CA RGA LUST	TP
F65 / 1	CITY OF SAN DIEGO-FI	3870 KEARNY VILLA RD	CA RGA LUST	TP
F66 / 1	SDCTY-FIRE-RESCUE DE	3870 KEARNY VILLA RD	CA UST, CA SWEEPS UST, CA HIST UST	TP
F67 / 1	FIRE STATION REPIAR	3870 KEARNY VILLA RD	CA RGA LUST	TP
F68 / 1	CITY OF SD-FIRE REPA	3870 KEARNY VILLA RD	CA RGA LUST	TP
F69 / 1	RURAL/METRO SAN DIEG	3870 KEARNY VILLA RD	FINDS	TP
F70 / 1		3870 KEARNY VILLA RD	ERNS	TP
F71 / 1	CITY OF SAN DIEGO-FI	3870 KEARNY VILLA RD	CA RGA LUST	TP
G72 / 1	NATIONAL AIR COLLEGE	3760 GLEN H. CURTISS	CA LUST, CA San Diego Co. HMMD, CA SAN D...	TP
H73 / 1	CROWN AIR	3735 JOHN J. MONTGOM	CA RGA LUST	TP
H74 / 1	CROWN AIR	3735 JOHN J. MONTGOM	CA RGA LUST	TP
H75 / 1	CROWN AIR	3735 JOHN J. MONTGOM	CA RGA LUST	TP
H76 / 1	CROWN AIR	3735 JOHN J. MONTGOM	CA LUST, CA HIST CORTESE	TP
G77 / 1	PACIFIC AIR CHARTER	3760 GLEN L CURTIS R	CA San Diego Co. HMMD	TP
G78 / 1	NATIONAL AIR COLLEGE	3760 GLEN L CURTIS R	RCRA-SQG, CA LUST, CA SWEEPS UST, CA HIS...TP	

MAPPED SITES SUMMARY

Target Property:
3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

MAP ID / FOCUS MAP	SITE NAME	ADDRESS	DATABASE ACRONYMS	DIST (ft. & mi.) DIRECTION
G79 / 1	NATIONAL AIR COLLEGE	3760 GLENN CURTIS RD	CA RGA LUST	TP
G80 / 1	NATIONAL AIR COLLEGE	3760 GLENN CURTISS R	CA HAZNET	TP
G81 / 1	SORBI AIRCRAFT MAINT	3760 GLENN CURTISS R	CA HAZNET	TP
G82 / 1	NATIONAL AIR COLLEGE	3760 GLEN CURTISS RD	CA San Diego Co. HMMD	TP
I83 / 1	CRITICAL AIR MEDICIN	3717 JOHN J MONTGOME	FINDS	TP
I84 / 1	CRITICAL AIR MEDICIN	3717 JOHN J MONTGOME	CA San Diego Co. HMMD	TP
I85 / 1	OKAZAKI CHIROPRACTIC	8665 GIBBS DR	CA San Diego Co. HMMD	TP
I86 / 1	TRM RCO	8665 GIBBS DRIVE-SUI	CA HIST UST	TP
I87 / 1	FAA PDS SMO	8665 GIBBS DR SUITE	CA HAZNET	TP
I88 / 1	FAA PDS SMO	8665 GIBBS DR SUITE	FINDS	TP
J89 / 1	MISSION BAY VORTAC	8575 GIBBS DRIVE SUI	CA San Diego Co. HMMD, CA HIST UST	TP
J90 / 1	OASIS SPORTS MEDICAL	8575 GIBBS DR STE 11	RCRA-SQG, FINDS, ECHO	TP
J91 / 1	MISSION BAY VORTAC	8575 GIBBS DRIVE, SU	CA HIST UST	TP
J92 / 1	IMPERIAL VOR	8575 GIBBS DRIVE, SU	CA HIST UST	TP
J93 / 1	SEAL BEACH VORIAC	8575 GIBBS DRIVE, SU	CA HIST UST	TP
J94 / 1	POGGI VORTAC	8575 GIBBS DRIVE, SU	CA HIST UST	TP
J95 / 1	BARD VOTAC	8575 GIBBS DRIVE, SU	CA HIST UST	TP
J96 / 1	OASIS SPORTS MEDICAL	8575 GIBBS DR	CA San Diego Co. HMMD	TP
J97 / 1	GARDEN GROVE RADAR	8575 GIBBS DR STE 10	CA HIST UST	TP
J98 / 1	BARD VOTAC	8575 GIBBS DR 101	CA SWEEPS UST	TP
J99 / 1	ADVANCED AIRCRAFT SE	8622 GIBBS DR	CA San Diego Co. HMMD	TP
J100 / 1	SCANDANAVIAN AVIATIO	8622 GIBBS DR	CA San Diego Co. HMMD	TP
J101 / 1	ADVANCED AIRCRAFT SE	8622 GIBBS DR	FINDS	TP
J102 / 1	PACIFIC DIAMOND PETR	8525 GIBBS DR STE 10	EDR Hist Auto	TP
J103 / 1	SD CNTY DETENTION FA	8525 GIBBS DR	CA San Diego Co. HMMD	TP
J104 / 1	DETENTION'S FACILITY	8525 GIBBS DR STE 10	CA HAZNET	TP
J105 / 1	COAST AIRCRAFT SALES	8620 GIBBS DRIVE	CA HAZNET	TP
J106 / 1	DETENTION'S FACILITY	8525 GIBBS DR STE 30	CA HAZNET	TP
K107 / 1	FOUR POINTS BY SHERA	8110 AERO DR	CA San Diego Co. HMMD, CA HAZNET	TP
K108 / 1	FOUR POINTS BY SHERA	8110 AERO DR	CA UST	TP
L109 / 1	GIBBS FLYING SERVICE	8906 AERO DR	CA RGA LUST	TP
L110 / 1	GIBBS FLYING SERVICE	8906 AERO DR MNTGRY	EDR Hist Auto	TP
L111 / 1	GIBBS SERVICE CENTER	8906 AERO DR	CA LUST, CA CPS-SLIC, CA AST, CA San Die...	TP
L112 / 1	FLYING R AVIATION	8906 AERO DR	CA San Diego Co. HMMD	TP
L113 / 1	GIBBS FLYING SERVICE	8906 AERO DR	FINDS	TP
L114 / 1	ARMED FORCES AERO CL	8906 AERO DR	CA HAZNET	TP
L115 / 1	GIBBS FLYING SERVICE	8906 AERO DRIVE	CA RGA LUST	TP
L116 / 1	GIBBS SERVICE CENTER	8906 AERO DR	FINDS	TP
L117 / 1	GIBBS FLYING SERVICE	8906 AERO DR	CA RGA LUST	TP

MAPPED SITES SUMMARY

Target Property:
3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

MAP ID / FOCUS MAP	SITE NAME	ADDRESS	DATABASE ACRONYMS	DIST (ft. & mi.) DIRECTION
L118 / 1	GIBBS FLYING SERVICE	8906 AERO DRIVE	CA HAZNET	TP
L119 / 1	GIBBS FLYING SERVICE	8906 AERO DR	CA SAN DIEGO CO. SAM, CA UST, CA San Die...	TP
L120 / 1	GIBBS FLYING SERVICE	8906 AERO DR	CA RGA LUST	TP
M121 / 1	WATKINS CONTRACTING	8690 AERO DR STE M32	FTTS, HIST FTTS	TP
M122 / 1	VAKSHOUR JAFAR	8690 AERO DR STE 119	EDR Hist Cleaner	TP
M123 / 1	WATKINS CONTRACTING	8690 AERO DRIVE SUIT	FINDS	TP
N124 / 1	CLEAN HARBORS ENVIRO	9225 AERO DR	CA HAZNET	TP
N125 / 1	SDCTY POLICE EASTERN	9225 AERO DR	CA HAZNET	TP
N126 / 1	SDCTY-PUBLIC WORKS D	9225 AERO DR	FINDS	TP
N127 / 1	SDCTY-FLEET OPERATIO	9225 AERO DR	CA HAULERS, CA San Diego Co. HMMD, CA SW...	TP
N128 / 1	SDCTY-INTERNAL OPERA	9225 AERO DR	CA UST	TP
O129 / 1	POLICE DEPARTMENT	9265 AERO DR	CA HIST UST	TP
O130 / 1	SAN DIEGO POLICE GAR	9265 AERO DR	CA HAZNET	TP
O131 / 1	POLICE TRAFFIC DIVIS	9265 AERO DR	CA HAZNET	TP
P132 / 1	SDCTY/ENGINEERING MT	9515 AERO DR	CA HAZNET	TP
P133 / 1	SDCTY-ENG/MAT TEST L	9515 AERO DR	CA San Diego Co. HMMD	TP
134 / 1	ARC OF SAN DIEGO, AR	9575 AERO DR	CA San Diego Co. HMMD, CA HAZNET	TP
135 / 1	SDCTY-FIRE-RESCUE DE	3750 KEARNY VILLA RD	CA UST, CA SWEEPS UST	6 0.001 ESE
Q136 / 1	SPIDERS AIRCRAFT SER	3873 KEARNY VILLA RD	CA San Diego Co. HMMD, CA SWEEPS UST, CA...	8 0.002 West
R137 / 1	MONTGOMERY FIELD ATC	4298 PONDEROSA AV	CA LUST, CA SAN DIEGO CO. SAM, CA San Di...	22 0.004 ESE
R138 / 1	MONTGOMERY FIELD ATC	4298 PONDEROSA AV	CA LUST, CA San Diego Co. HMMD, CA SWEEP...	22 0.004 ESE
Q139 / 1	SDCTY-FIRE STATION #	3880 KEARNY VILLA RD	CA UST, CA San Diego Co. HMMD, CA SWEEPS...	38 0.007 NNE
Q140 / 1	FIRE STATION 28	3880 KEARNY VILLA RD	CA HIST UST	38 0.007 NNE
S141 / 1	PROGENY SYSTEMS	4217 PONDEROSA AVE S	CA SAN DIEGO CO. SAM, CA CPS-SLIC, CA Sa...	70 0.013 East
S142 / 1	LEIDOS	4211 PONDEROSA AVE	RCRA-SQG, FINDS	70 0.013 East
R143 / 1	MAXWELL LABORATORIES	4241 PONDEROSA AVE	RCRA NonGen / NLR, FINDS, ECHO	92 0.017 East
S144 / 1	NUVASIVE	4223 PONDEROSA AVE C	CA San Diego Co. HMMD, CA HIST UST, CA H...	93 0.018 East
S145 / 1	MADISON SQUARE PARTN	4223 PONDEROSA AVE S	CA HIST UST	93 0.018 East
S146 / 1	MADISON SQUARE PARTN	4223 PONDEROSA AVE A	CA SWEEPS UST	93 0.018 East
S147 / 1	SUPERSHUTTLE	4229 PONDEROSA AVE	RCRA-SQG, FINDS, ECHO	93 0.018 East
T148 / 1	7-ELEVEN INC #32606	9609 AERO DR	CA UST	122 0.023 East
149 / 1	LEVEL 3 COMMUNICATIO	8929 AERO DR	CA AST	122 0.023 South
L150 / 1	AEROVAULT VENTURE, L	8875 AERO DR	CA AST, CA San Diego Co. HMMD, CA HIST U...	123 0.023 South
L151 / 1	SAN DIEGO CENTRAL CA	8875 AERO DR 4062	CA SWEEPS UST	123 0.023 South
U152 / 1	3-D INDUSTRIES, INC	9630 AERO DR	RCRA-SQG, FINDS, ECHO	133 0.025 East
U153 / 1	J. BITTLE AMERICAN,	9630 AERO DR	CA LUST, CA SAN DIEGO CO. SAM, CA San Di...	133 0.025 East
V154 / 1	ACTION INSTRUMENTS C	8601 AERO DR	RCRA-SQG, FINDS, ECHO	137 0.026 South
V155 / 1	PRIII/BROADSTONE KEA	8601 AERO DR	CA CPS-SLIC, CA San Diego Co. HMMD, CA H...	137 0.026 South
V156 / 1	8575 AERO DR	8575 AERO DR	RCRA-SQG, CA ENVIROSTOR, CA VCP, CA HIST...	153 0.029 South

MAPPED SITES SUMMARY

Target Property:
3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

MAP ID / FOCUS MAP	SITE NAME	ADDRESS	DATABASE ACRONYMS	DIST (ft. & mi.) DIRECTION		
V157 / 1	MOORE PRINTED CIRCUIT	8575 AERO DR	CA SAN DIEGO CO. SAM, CA HIST UST, FTTS,...	153	0.029	South
V158 / 1	NATURESCAPE SERVICES	8575 AERO DR	CA San Diego Co. HMMD, CA SWEEPS UST, CA...	153	0.029	South
V159 / 1	ON SITE DRAPERY CLEANING	8555 AERO DR	EDR Hist Cleaner	153	0.029	South
W160 / 1	LORAL INSTRUMENTATION	8401 AERO DR	RCRA-SQG, CA San Diego Co. HMMD, FINDS, ...	196	0.037	South
W161 / 1	GREMLIN INDUSTRIES INC	8401 AERO DRIVE	RCRA-SQG	196	0.037	South
162 / 1	C P KELCO	8225 AERO DR	RCRA-SQG, CA San Diego Co. HMMD, CA HAZN...	210	0.040	South
X163 / 1	KYOCERA AMERICA INC	8611 BALBOA AVE	CA SWEEPS UST	213	0.040	NNE
X164 / 1	KYOCERA INTERNATIONAL	8611 BALBOA AVE.	RCRA-LQG, CA LUST, CA SAN DIEGO CO. SAM,...	213	0.040	NNE
X165 / 1	KYOCERA CO-GEN	8611 BALBOA AVE	CA AST	213	0.040	NNE
X166 / 1	KYOCERA INTERNATIONAL	8611 BALBOA AVE	CA HAZNET, CA HWP, CA NPDES	213	0.040	NNE
X167 / 1	KYOCERA SOLAR INC	8611 BALBOA AVE	RCRA NonGen / NLR, CA HAZNET	213	0.040	NNE
168 / 1	CASTLE ACCESS	9606 AERO DR STE 190	CA AST	241	0.046	East
Y169 / 1	SUNDSTRAND POWER SYS	8975 BALBOA AVENUE	RCRA-LQG, FINDS	242	0.046	NNW
Y170 / 1	JACK HENRY & ASSOCIATES	8975 BALBOA AVE	CA AST	242	0.046	NNW
171 / 1	SAN DIEGO COUNTY MEDICAL	3702 RUFFIN RD	CA San Diego Co. HMMD, CA SWEEPS UST, CA...	280	0.053	East
172 / 1	E & R TRANSMISSION A	3587 RUFFIN RD UNIT	EDR Hist Auto	287	0.054	SSW
173 / 1	SHARP HEALTH CARE (D)	3571 CORPORATE CT	CA AST, CA San Diego Co. HMMD	290	0.055	South
T174 / 1	WEB SERVICE CO INC	9645 AERO DR	EDR Hist Cleaner	316	0.060	East
T175 / 1	CALIFORNIA METER SERVICES	9645 AERO DR	RCRA-SQG, CA San Diego Co. HMMD, FINDS, ...	316	0.060	East
176 / 1	LOCKHEED MARTIN MARINE	3853 CALLE FORTUNADA	CA San Diego Co. HMMD, RCRA NonGen / NLR...	336	0.064	NNE
177 / 1	MAXWELL TECHNOLOGIES	3912 CALLE FORTUNADA	RCRA-LQG, FINDS, ECHO	370	0.070	NNE
Z178 / 1	SUNSET MOTORS	3888 KEARNY MESA RD	CA LUST, CA SAN DIEGO CO. SAM, CA San Di...	383	0.073	NW
Z179 / 1	PHD CORP	3888 KEARNEY MESA RD	CA HIST UST, RCRA NonGen / NLR, FINDS, E...	383	0.073	NW
Z180 / 1	LEASEWAY TRANSPORTATION	3888 KEARNY MESA RD	CA HIST UST	383	0.073	NW
181 / 1	WAVETEK	9045 BALBOA AVE	RCRA-SQG, FINDS, ECHO	394	0.075	NNW
AA182 / 1	HAWTHORNE MACHINERY	4200 KEARNY MESA ROAD	RCRA-LQG, CA SAN DIEGO CO. SAM, CA San D...	417	0.079	WNW
AA183 / 1	STAPLES THE OFFICE SUPPLY	4200 KEARNY MESA RD	CA LUST, CA CPS-SLIC, CA San Diego Co. H...	417	0.079	WNW
184 / 1	BOSTON SCIENTIFIC -	3574 RUFFIN ROAD	RCRA-LQG, FINDS, ECHO	432	0.082	SSW
Z185 / 1	KEARNY MESA 76, LLC.	3860 KEARNY MESA RD	CA LUST, CA San Diego Co. HMMD, CA SWEEP...	444	0.084	NW
Z186 / 1	KEARNY MESA SHELL SERVICE	3860 KEARNY MESA RD	EDR Hist Auto	444	0.084	NW
Z187 / 1	PROPEL BIOFUELS 76	3860 KEARNY MESA ROAD	CA LUST, CA HAZNET, CA SAN DIEGO CO LOP	444	0.084	NW
Z188 / 1	KEARNY MESA 76, LLC.	3860 KEARNY MESA RD	CA SAN DIEGO CO. SAM, CA UST, CA San Die...	444	0.084	NW
Z189 / 1	SHELL OIL SERVICE STATION	3860 KEARNEY MESA	RCRA-SQG, CA HIST UST, FINDS, ECHO	444	0.084	NW
Z190 / 1	KEARNY MESA EXXON	3860 KEARNY MESA RD	CA LUST, CA HIST CORTESE	444	0.084	NW
191 / 1	ULTRASIGNS, INC	9025 BALBOA AVENUE S	RCRA-SQG	452	0.086	NNW
192 / 1	SCIENTIFIC ATLANTA GROUP	8911 BALBOA AVE	RCRA-SQG, CA San Diego Co. HMMD, FINDS, ...	459	0.087	NNW
193 / 1	ECONOLUBE N TUNE & LUBE	7979 AERO DR	CA AST	460	0.087	West
AB194 / 1	SAN DIEGO PORSCHE RENTALS	8861 BALBOA AVE	EDR Hist Auto	465	0.088	NNW
AC195 / 1	HIPP MARINE SERVICES	4070 KEARNY MESA RD	CA LUST, CA SAN DIEGO CO. SAM, CA San Di...	532	0.101	WNW

MAPPED SITES SUMMARY


Target Property:
3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

MAP ID / FOCUS MAP	SITE NAME	ADDRESS	DATABASE ACRONYMS	DIST (ft. & mi.) DIRECTION		
AC196 / 1	GEMINI MOVING SPECIA	4070 KEARNY MESA RD	CA LUST, CA SWEEPS UST	532	0.101	WNW
AD197 / 1	AMERICAN OIL CO	3833 CONVOY ST	EDR Hist Auto	544	0.103	WNW
AD198 / 1	MY MECHANIC	3833 CONVOY ST	CA LUST, CA SAN DIEGO CO. SAM, CA San Di...	544	0.103	WNW
AE199 / 1	TELEDYNE RYAN ELECTR	8650 BALBOA AVE	SEMS-ARCHIVE, CORRACTS, RCRA-TSDF, RCRA-548	0.104	NNE	
AE200 / 1	DIGITAL DEVELOPMENT	8650 BALBOA AVE	RCRA-SQG, FINDS, ECHO	548	0.104	NNE
AE201 / 1	TELEDYNE RYAN ELECTR	8650 BALBOA AVE	CA HWP, CA NPDES	548	0.104	NNE
AF202 / 1	CUBIC DEFENSE APPLIC	9233 BALBOA AVE	RCRA-LQG	554	0.105	NE
AF203 / 1	CUBIC CORPORATION	9233 BALBOA AVE	CA SWEEPS UST, CA HIST UST, CA EMI	554	0.105	NE
AF204 / 1	CUBIC DEFENSE APPLIC	9233 BALBOA AV	CA SAN DIEGO CO. SAM, CA CPS-SLIC, CA Sa...	554	0.105	NE
AF205 / 1	NAVAL UNDERSEA WARFA	9284 BALBOA AV	CA LUST, CA SAN DIEGO CO. SAM, CA San Di...	591	0.112	NE
AF206 / 1	USNAVY NAVAL UNDERSE	9284 BALBOA AVE B	RCRA-SQG	591	0.112	NE
AG207 / 1	SENIOR AEROSPACE JET	9106 BALBOA AV	CA ENVIROSTOR, CA AST, CA San Diego Co. ...	598	0.113	NNW
AG208 / 1	SENIOR AEROSPACE / J	9106 BALBOA AVENUE	RCRA-LQG	598	0.113	NNW
AG209 / 1	SENIOR AEROSPACE / J	9106 BALBOA AVE	RCRA-SQG, FINDS, ECHO, CA WDS	598	0.113	NNW
AF210 / 1	BUILDING 1	9244 BALBOA AVE	CA HIST UST	605	0.115	NE
AF211 / 1	FORMER MAXWELL TECH	9244 BALBOA AVENUE	CA CPS-SLIC	605	0.115	NE
AF212 / 1	MAXWELL LABORATORIES	9244 BALBOA AVE	CA LUST, CA SWEEPS UST	605	0.115	NE
AF213 / 1	MAXWELL ELECTRONIC C	9244 BALBOA AVENUE	RCRA-LQG, FINDS, ECHO	605	0.115	NE
AF214 / 1	DATA DEVICE CORPORAT	9244 BALBOA AVE	RCRA-SQG, CA LUST, CA SAN DIEGO CO. SAM,...	605	0.115	NE
AH215 / 1	TRICARE OUTPATIENT C	8808 BALBOA AV	CA SAN DIEGO CO. SAM	638	0.121	NNW
AH216 / 1	TRICARE OUTPATIENT C	8808 BALBOA AVE	RCRA-SQG, CA LUST, CA SWEEPS UST, FINDS,...	638	0.121	NNW
AH217 / 1	TRICARE OUTPATIENT C	8808 BALBOA AVE	CA CPS-SLIC, CA San Diego Co. HMMD, CA H...	638	0.121	NNW
AB218 / 1	G D E SYSTEMS INC	8804 BALBOA AVE	RCRA NonGen / NLR, FINDS, ECHO	640	0.121	NNW
219 / 1	AEROSPACE SUPPLY INC	3738 RUFFIN RD	CA San Diego Co. HMMD, CA SWEEPS UST	641	0.121	East
220 / 1	BLVO BEESON FLOYD CH	4398 KEARNY MESA R	EDR Hist Auto	643	0.122	WNW
221 / 1	TELEDYNE ELECTRONIC	3565 CORPORATE CT	RCRA-SQG, FINDS, ECHO	657	0.124	South
AI222 / 1	SILTEC SAN DIEGO PAC	3566 CORPORATE COURT	SEMS-ARCHIVE	658	0.125	South
AI223 / 1	DELTA GROUP ELECTRON	3566 CORPORATE COURT	RCRA NonGen / NLR, FINDS, ECHO	658	0.125	South
224 / 1	SOLAR TURBINES INCOR	4200 RUFFIN ROAD	SEMS-ARCHIVE, CORRACTS, RCRA-TSDF, RCRA-832	0.158	NE	

Key Map - 5582211.3s



- ▲ Sites
- Target Property
- Search Buffer
- Focus Map - No Sites
- Focus Map - Sites
- National Priority List Sites
- Areas of Concern
- Dept. Defense Sites
- Indian Reservations BIA



SITE NAME: Montgomery-Gibbs Executive Airport
 ADDRESS: 3750 John J Montgomery Drive
 CITY/STATE: San Diego CA
 ZIP: 92123

CLIENT: Bodhi Group
 CONTACT: Brianne Cortright
 INQUIRY #: 5582211.3s
 DATE: 03/07/19

12:54 PM

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
<u>STANDARD ENVIRONMENTAL RECORDS</u>								
<i>Federal NPL site list</i>								
NPL	0.125		0	NR	NR	NR	NR	0
Proposed NPL	0.125		0	NR	NR	NR	NR	0
NPL LIENS	0.125		0	NR	NR	NR	NR	0
<i>Federal Delisted NPL site list</i>								
Delisted NPL	0.125		0	NR	NR	NR	NR	0
<i>Federal CERCLIS list</i>								
FEDERAL FACILITY	0.125		0	NR	NR	NR	NR	0
SEMS	0.125		0	NR	NR	NR	NR	0
<i>Federal CERCLIS NFRAP site list</i>								
SEMS-ARCHIVE	0.125		2	NR	NR	NR	NR	2
<i>Federal RCRA CORRACTS facilities list</i>								
CORRACTS	0.125		1	NR	NR	NR	NR	1
<i>Federal RCRA non-CORRACTS TSD facilities list</i>								
RCRA-TSDF	0.125		1	NR	NR	NR	NR	1
<i>Federal RCRA generators list</i>								
RCRA-LQG	0.125	1	8	NR	NR	NR	NR	9
RCRA-SQG	0.125	3	20	NR	NR	NR	NR	23
RCRA-CESQG	0.125		0	NR	NR	NR	NR	0
<i>Federal institutional controls / engineering controls registries</i>								
LUCIS	0.125		0	NR	NR	NR	NR	0
US ENG CONTROLS	0.125		0	NR	NR	NR	NR	0
US INST CONTROL	0.125		0	NR	NR	NR	NR	0
<i>Federal ERNS list</i>								
ERNS	TP	2	NR	NR	NR	NR	NR	2
<i>State- and tribal - equivalent NPL</i>								
CA RESPONSE	0.125		0	NR	NR	NR	NR	0
<i>State- and tribal - equivalent CERCLIS</i>								
CA ENVIROSTOR	0.125		3	NR	NR	NR	NR	3
<i>State and tribal landfill and/or solid waste disposal site lists</i>								
CA SWF/LF	0.125	1	0	NR	NR	NR	NR	1
<i>State and tribal leaking storage tank lists</i>								
CA LUST	0.125	8	16	NR	NR	NR	NR	24

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
INDIAN LUST	0.125		0	NR	NR	NR	NR	0
CA CPS-SLIC	0.125	3	8	NR	NR	NR	NR	11
State and tribal registered storage tank lists								
FEMA UST	0.125		0	NR	NR	NR	NR	0
CA UST	0.125	6	4	NR	NR	NR	NR	10
CA AST	0.125	4	9	NR	NR	NR	NR	13
INDIAN UST	0.125		0	NR	NR	NR	NR	0
State and tribal voluntary cleanup sites								
CA VCP	0.125		1	NR	NR	NR	NR	1
INDIAN VCP	0.125		0	NR	NR	NR	NR	0
State and tribal Brownfields sites								
CA BROWNFIELDS	0.125		0	NR	NR	NR	NR	0
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.125		0	NR	NR	NR	NR	0
Local Lists of Landfill / Solid Waste Disposal Sites								
CA WMUDS/SWAT	0.125		0	NR	NR	NR	NR	0
CA SWRCY	0.125		0	NR	NR	NR	NR	0
CA HAULERS	TP	1	NR	NR	NR	NR	NR	1
INDIAN ODI	0.125		0	NR	NR	NR	NR	0
ODI	0.125		0	NR	NR	NR	NR	0
DEBRIS REGION 9	0.125		0	NR	NR	NR	NR	0
IHS OPEN DUMPS	0.125		0	NR	NR	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US HIST CDL	TP		NR	NR	NR	NR	NR	0
CA HIST Cal-Sites	0.125		0	NR	NR	NR	NR	0
CA SCH	0.125		0	NR	NR	NR	NR	0
CA CDL	TP		NR	NR	NR	NR	NR	0
CA Toxic Pits	0.125		0	NR	NR	NR	NR	0
CA CERS HAZ WASTE	0.125		0	NR	NR	NR	NR	0
US CDL	TP		NR	NR	NR	NR	NR	0
Local Lists of Registered Storage Tanks								
CA SWEEPS UST	0.125	8	18	NR	NR	NR	NR	26
CA HIST UST	0.125	15	17	NR	NR	NR	NR	32
CA CERS TANKS	0.125		0	NR	NR	NR	NR	0
CA FID UST	0.125		0	NR	NR	NR	NR	0
Local Land Records								
CA LIENS	TP		NR	NR	NR	NR	NR	0
LIENS 2	TP		NR	NR	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
CA DEED	0.125		1	NR	NR	NR	NR	1
Records of Emergency Release Reports								
HMIRS	TP	3	NR	NR	NR	NR	NR	0
CA CHMIRS	TP		NR	NR	NR	NR	NR	3
CA LDS	TP		NR	NR	NR	NR	NR	0
CA MCS	TP		NR	NR	NR	NR	NR	0
CA SPILLS 90	TP		NR	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA NonGen / NLR	0.125	1	6	NR	NR	NR	NR	6
FUDS	0.125		0	NR	NR	NR	NR	0
DOD	0.125		0	NR	NR	NR	NR	0
SCRD DRYCLEANERS	0.125		0	NR	NR	NR	NR	0
US FIN ASSUR	TP		NR	NR	NR	NR	NR	0
EPA WATCH LIST	TP		NR	NR	NR	NR	NR	0
2020 COR ACTION	0.125		1	NR	NR	NR	NR	1
TSCA	TP		NR	NR	NR	NR	NR	0
TRIS	TP		NR	NR	NR	NR	NR	0
SSTS	TP		NR	NR	NR	NR	NR	0
ROD	0.125		0	NR	NR	NR	NR	0
RMP	TP		NR	NR	NR	NR	NR	0
RAATS	TP		NR	NR	NR	NR	NR	0
PRP	TP		NR	NR	NR	NR	NR	0
PADS	TP		NR	NR	NR	NR	NR	0
ICIS	TP		NR	NR	NR	NR	NR	0
FTTS	TP		NR	NR	NR	NR	NR	1
MLTS	TP		NR	NR	NR	NR	NR	0
COAL ASH DOE	TP		NR	NR	NR	NR	NR	0
COAL ASH EPA	0.125		0	NR	NR	NR	NR	0
PCB TRANSFORMER	TP		NR	NR	NR	NR	NR	0
RADINFO	TP		NR	NR	NR	NR	NR	0
HIST FTTS	TP		NR	NR	NR	NR	NR	1
DOT OPS	TP		NR	NR	NR	NR	NR	0
CONSENT	0.125		0	NR	NR	NR	NR	0
INDIAN RESERV	0.125		0	NR	NR	NR	NR	0
FUSRAP	0.125		0	NR	NR	NR	NR	0
UMTRA	0.125		0	NR	NR	NR	NR	0
LEAD SMELTERS	TP		NR	NR	NR	NR	NR	0
US AIRS	TP		NR	NR	NR	NR	NR	0
US MINES	0.125	0	NR	NR	NR	NR	0	
ABANDONED MINES	0.125	0	NR	NR	NR	NR	0	
FINDS	TP	20	NR	NR	NR	NR	NR	20
DOCKET HWC	TP		NR	NR	NR	NR	NR	0
UXO	0.125		0	NR	NR	NR	NR	0
ECHO	TP	4	NR	NR	NR	NR	NR	4
FUELS PROGRAM	0.125		0	NR	NR	NR	NR	0
CA BOND EXP. PLAN	0.125		0	NR	NR	NR	NR	0
CA Cortese	0.125		0	NR	NR	NR	NR	0
CA CUPA Listings	0.125		0	NR	NR	NR	NR	0
CA DRYCLEANERS	0.125		0	NR	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
CA EMI	TP		NR	NR	NR	NR	NR	0
CA ENF	TP	1	NR	NR	NR	NR	NR	1
CA Financial Assurance	TP		NR	NR	NR	NR	NR	0
CA HAZNET	TP	28	NR	NR	NR	NR	NR	28
CA ICE	TP		NR	NR	NR	NR	NR	0
CA HIST CORTESE	0.125	6	11	NR	NR	NR	NR	17
CA HWP	0.125		2	NR	NR	NR	NR	2
CA HWT	0.125		0	NR	NR	NR	NR	0
NY MANIFEST	0.250		1	1	NR	NR	NR	2
CA MINES	0.125		0	NR	NR	NR	NR	0
CA MWMP	0.125		0	NR	NR	NR	NR	0
CA NPDES	TP	2	NR	NR	NR	NR	NR	2
CA PEST LIC	TP		NR	NR	NR	NR	NR	0
CA PROC	0.125		0	NR	NR	NR	NR	0
CA Notify 65	0.125	1	0	NR	NR	NR	NR	1
CA UIC	TP		NR	NR	NR	NR	NR	0
CA UIC GEO	TP		NR	NR	NR	NR	NR	0
CA WASTEWATER PITS	0.125		0	NR	NR	NR	NR	0
CA WDS	TP	1	NR	NR	NR	NR	NR	1
CA MILITARY PRIV SITES	TP		NR	NR	NR	NR	NR	0
CA PROJECT	TP		NR	NR	NR	NR	NR	0
CA WDR	TP		NR	NR	NR	NR	NR	0
CA CIWQS	TP	3	NR	NR	NR	NR	NR	3
CA CERS	TP		NR	NR	NR	NR	NR	0
CA WIP	0.125		0	NR	NR	NR	NR	0
CA NON-CASE INFO	TP		NR	NR	NR	NR	NR	0
CA OTHER OIL GAS	TP		NR	NR	NR	NR	NR	0
CA PROD WATER PONDS	TP		NR	NR	NR	NR	NR	0
CA SAMPLING POINT	TP		NR	NR	NR	NR	NR	0
CA WELL STIM PROJ	TP		NR	NR	NR	NR	NR	0

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP	0.125		0	NR	NR	NR	NR	0
EDR Hist Auto	0.125	2	5	NR	NR	NR	NR	7
EDR Hist Cleaner	0.125	1	2	NR	NR	NR	NR	3

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

CA RGA LF	TP	1	NR	NR	NR	NR	NR	1
CA RGA LUST	TP	28	NR	NR	NR	NR	NR	28

- Totals --	155	137	1	0	0	0	293


NOTES:

TP = Target Property


NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Focus Map - 1 - 5582211.3s

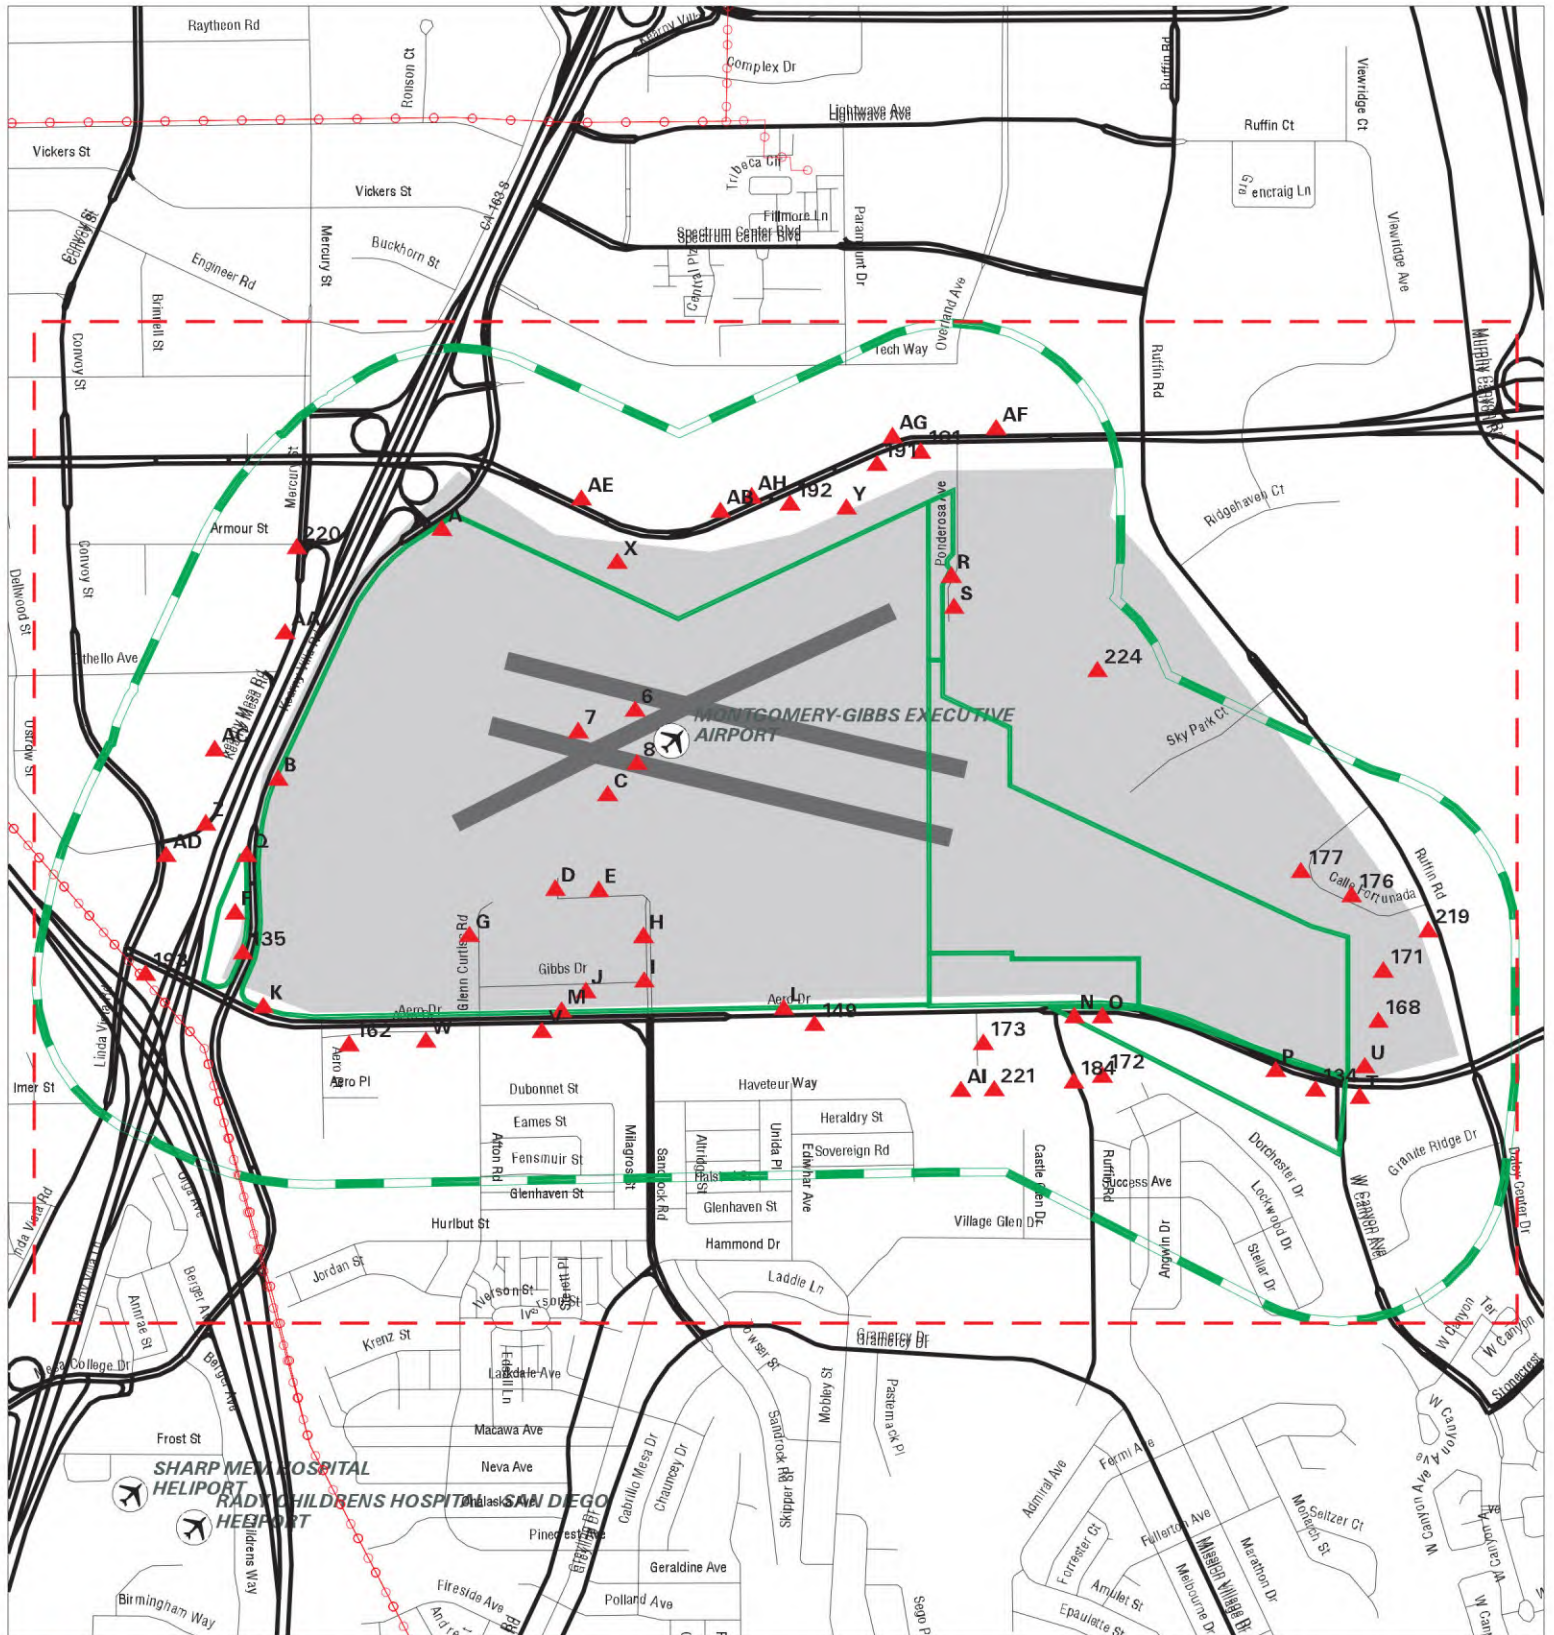

Sites	Focus Map - Sites	Dept. Defense Sites
Target Property	Power Line	Indian Reservations BIA
Search Buffer	National Priority List Sites	
Focus Map - No Sites	Areas of Concern	



SITE NAME: Montgomery-Gibbs Executive Airport
ADDRESS: 3750 John J Montgomery Drive
CITY/STATE: San Diego CA
ZIP: 92123

CLIENT: Bodhi Group
CONTACT: Brianne Cortright
INQUIRY #: 5582211.3s
DATE: 03/07/19

MAPPED SITES SUMMARY - FOCUS MAP 1

Target Property:

3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

MAP ID / FOCUS MAP	SITE NAME	ADDRESS	DATABASE ACRONYMS	DIST (ft. & mi.) DIRECTION
A1 / 1	SDCTY-POLICE DEPT, A	4141 KEARNY VILLA RD	CA San Diego Co. HMMD, CA HAZNET	TP
A2 / 1	SDCTY-POLICE AIR SUP	4141 KEARNY VILLA RD	CA San Diego Co. HMMD	TP
A3 / 1	EXECUTIVE AIR SVC	4141 KEARNY VILLA RD	CA HAZNET	TP
A4 / 1	SDCTY-POLICE DEPTNA	4141 KEARNY VILLA RD	FINDS	TP
A5 / 1	MONTGOMERY FIELD AIR		CA CIWQS	TP
6 / 1	SPIDERS AIRCRAFT SER	BLD 119 MONTGOMERY F	CA HIST UST	TP
7 / 1	TEXACO (NATIONAL AIR	MONTGOMERY FIELD	CA HIST UST	TP
8 / 1	MONTGOMERY FIELD	UNKNOWN	FINDS	TP
B9 / 1	CALIFORNIA WINGS	4025 KEARNY VILLA RD	CA San Diego Co. HMMD	TP
B10 / 1	LOCKHEED MARTIN ASTR	4001 KEARNY VILLA RD	RCRA-LQG	TP
C11 / 1	FEDERAL AVIATION ADM	4302-4298 PONDEROSA	CA SWEEPS UST	TP
C12 / 1	MERCY AIR SERVICE	3753 JOHN J MONTGOME	CA HAZNET	TP
C13 / 1	MYF HOLDINGS LLC DBA	3753 JOHN J MONTGOME	CA HAZNET	TP
C14 / 1	MONTGOMERY FIELD SAN	4302 PONDEROSA AV	CA San Diego Co. HMMD, CA HAZNET	TP
C15 / 1		4302 PONDEROSA AVE.	CA CHMIRS	TP
D16 / 1	C & B CONSULTING, LL	3753 JOHN J MONTGOME	CA HAZNET	TP
D17 / 1	AIR 88 INC DBA CROWN	3753 JOHN J MONTGOME	CA HAZNET	TP
D18 / 1	CROWNAIR	3753 JOHN J. MONTGOM	CA RGA LUST	TP
D19 / 1	CROWNAIR	3753 MONTGOMERY DR.	CA RGA LUST	TP
D20 / 1	CROWNAIR	3753 JOHN J. MONTGOM	CA RGA LUST	TP
D21 / 1	CROWNAIR	3753 JOHN MONTGOMERY	CA RGA LUST	TP
D22 / 1	CROWNAIR	3753 JOHN J. MONTGOM	CA RGA LUST	TP
D23 / 1	AIR 88 INC DBA CROWN	3753 J J MONTGOMERY	RCRA-SQG	TP
D24 / 1	CROWNAIR	3753 JOHN J MONTGOME	CA RGA LUST	TP
D25 / 1	CROWNAIR	3753 JOHN J MONTGOME	CA RGA LUST	TP
D26 / 1	CRITICAL AIR MEDICIN	3753 JOHN J MONTGOME	CA San Diego Co. HMMD	TP
D27 / 1	SHIER AVIATION CORPO	3753 JOHN J MONTGOME	CA HAZNET	TP
D28 / 1	CROWNAIR	3753 JOHN J MONTGOME	CA LUST, CA SAN DIEGO CO. SAM, CA CPS-SL...	TP
D29 / 1	AIR 88 INC DBA CROWN	3753 JOHN J MONTGOME	FINDS, ECHO	TP
D30 / 1	SO PACIFIC CAPITOL	3753 JOHN J MONTGOME	CA HAZNET	TP
D31 / 1	MYF HOLDINGS, LLC DB	3753 JOHN J MONTGOME	CA UST	TP
D32 / 1	CROWNAIR	3753 JOHN J MONTGOME	FINDS	TP
E33 / 1	SDCTY-FIRE-RESCUE DE	3750 JOHN J MONTGOME	CA AST	TP
E34 / 1	SDCTY-POLICENA AIR S	3750 JOHN J MONTGOME	FINDS	TP
E35 / 1	MONTGOMERY FIELD	3750 JOHN J. MONTGOM	CA RGA LUST	TP
E36 / 1	SDCTY- FIRE & RESCUE	3750 JOHN J MONTGOME	CA San Diego Co. HMMD	TP
E37 / 1	MONTGOMERY FIELD	3750 JOHN J. MONTGOM	CA RGA LUST	TP
E38 / 1		3750 JOHN J MONTGOME	CA Notify 65	TP
E39 / 1	SDCTY-POLICE, AIR SU	3750 JOHN J MONTGOME	CA RGA LUST	TP

MAPPED SITES SUMMARY - FOCUS MAP 1

Target Property:

3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

MAP ID / FOCUS MAP	SITE NAME	ADDRESS	DATABASE ACRONYMS	DIST (ft. & mi.) DIRECTION
E40 / 1	CITY OF SAN DIEGO-MO	3750 JOHN J MONTGOME	CA RGA LUST	TP
E41 / 1	MONTGOMERY DEMOLITIO	3750 JOHN J. MONTGOM	CA RGA LF	TP
E42 / 1		3750 JOHN J. MONTGOM	ERNS	TP
E43 / 1	SDCTY-POLICE, AIR SU	3750 JOHN J MONTGOME	CA SWF/LF, CA LUST, CA SAN DIEGO CO. SAM...	TP
E44 / 1	SDCTY FIRE-RESCUE AI	3750 JOHN J MONTGOME	CA HAZNET	TP
E45 / 1	CITY OF SAN DIEGO-MO	3750 JOHN J MONTGOME	CA RGA LUST	TP
E46 / 1	MONTGOMERY FIELD	3750 JOHN J MONTGOME	FINDS, ECHO	TP
E47 / 1	MONTGOMERY FIELD ARP	3750 JOHN J. MONTGOM	CA WDS	TP
E48 / 1		3750 JOHN J MONTGOME	CA CHMIRS	TP
E49 / 1	SDCTY-FIRE-RESCUE DE	3750 JOHN J MONTGOME	FINDS	TP
E50 / 1	CITY OF SAN DIEGO	3750 JOHN J. MONTGOM	CA HAZNET	TP
E51 / 1	MONTGOMERY FIELD	3750 JOHN J. MONTGOM	CA LUST	TP
E52 / 1	SDCTY-FIRE-RESCUE DE	3750 JOHN J MONTGOME	CA San Diego Co. HMMD	TP
E53 / 1	SDCTY-REA, MONTGOMER	3750 JOHN J MONTGOME	CA San Diego Co. HMMD	TP
E54 / 1	MONTGOMERY FIELD	3750 JOHN J. MONTGOM	CA RGA LUST	TP
E55 / 1	MEDIMPACT FLIGHT OPE	3751 JOHN J MONTGOME	FINDS	TP
E56 / 1	MEDIMPACT FLIGHT OPE	3751 JOHN J MONTGOME	CA San Diego Co. HMMD	TP
F57 / 1	SDCTY-FIRE REPAIR FA	3870 KEARNY VILLA RD	CA LUST, CA SAN DIEGO CO. SAM, CA CPS-SL...	TP
F58 / 1	SDCTY-FIRE-RESCUE DE	3870 KEARNY VILLA RD	CA AST	TP
F59 / 1	CITY OF SAN DIEGO FI	3870 KEARNY VILLA RD	CA RGA LUST	TP
F60 / 1	SDCTY-FIRE REPAIR FA	3870 KEARNY VILLA RD	FINDS	TP
F61 / 1	SDCTY-FIRE DEPT REPA	3870 KEARNY VILLA RO	CA HAZNET	TP
F62 / 1	SDCTY-FIRE-RESCUE DE	3870 KEARNY VILLA RD	FINDS	TP
F63 / 1	FIRE STATION REPAIR	3870 KEARNY VILLA RD	CA RGA LUST	TP
F64 / 1	SDCTY-FIRE REPAIR FA	3870 KEARNY VILLA RD	CA RGA LUST	TP
F65 / 1	CITY OF SAN DIEGO-FI	3870 KEARNY VILLA RD	CA RGA LUST	TP
F66 / 1	SDCTY-FIRE-RESCUE DE	3870 KEARNY VILLA RD	CA UST, CA SWEEPS UST, CA HIST UST	TP
F67 / 1	FIRE STATION REPIAR	3870 KEARNY VILLA RD	CA RGA LUST	TP
F68 / 1	CITY OF SD-FIRE REPA	3870 KEARNY VILLA RD	CA RGA LUST	TP
F69 / 1	RURAL/METRO SAN DIEG	3870 KEARNY VILLA RD	FINDS	TP
F70 / 1		3870 KEARNY VILLA RD	ERNS	TP
F71 / 1	CITY OF SAN DIEGO-FI	3870 KEARNY VILLA RD	CA RGA LUST	TP
G72 / 1	NATIONAL AIR COLLEGE	3760 GLEN H. CURTISS	CA LUST, CA San Diego Co. HMMD, CA SAN D...	TP
H73 / 1	CROWN AIR	3735 JOHN J. MONTGOM	CA RGA LUST	TP
H74 / 1	CROWN AIR	3735 JOHN J. MONTGOM	CA RGA LUST	TP
H75 / 1	CROWN AIR	3735 JOHN J. MONTGOM	CA RGA LUST	TP
H76 / 1	CROWN AIR	3735 JOHN J. MONTGOM	CA LUST, CA HIST CORTESE	TP
G77 / 1	PACIFIC AIR CHARTER	3760 GLEN L CURTIS R	CA San Diego Co. HMMD	TP
G78 / 1	NATIONAL AIR COLLEGE	3760 GLEN L CURTIS R	RCRA-SQG, CA LUST, CA SWEEPS UST, CA HIS...TP	

MAPPED SITES SUMMARY - FOCUS MAP 1

Target Property:

3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

MAP ID / FOCUS MAP	SITE NAME	ADDRESS	DATABASE ACRONYMS	DIST (ft. & mi.) DIRECTION
G79 / 1	NATIONAL AIR COLLEGE	3760 GLENN CURTIS RD	CA RGA LUST	TP
G80 / 1	NATIONAL AIR COLLEGE	3760 GLENN CURTISS R	CA HAZNET	TP
G81 / 1	SORBI AIRCRAFT MAINT	3760 GLENN CURTISS R	CA HAZNET	TP
G82 / 1	NATIONAL AIR COLLEGE	3760 GLEN CURTISS RD	CA San Diego Co. HMMD	TP
I83 / 1	CRITICAL AIR MEDICIN	3717 JOHN J MONTGOME	FINDS	TP
I84 / 1	CRITICAL AIR MEDICIN	3717 JOHN J MONTGOME	CA San Diego Co. HMMD	TP
I85 / 1	OKAZAKI CHIROPRACTIC	8665 GIBBS DR	CA San Diego Co. HMMD	TP
I86 / 1	TRM RCO	8665 GIBBS DRIVE-SUI	CA HIST UST	TP
I87 / 1	FAA PDS SMO	8665 GIBBS DR SUITE	CA HAZNET	TP
I88 / 1	FAA PDS SMO	8665 GIBBS DR SUITE	FINDS	TP
J89 / 1	MISSION BAY VORTAC	8575 GIBBS DRIVE SUI	CA San Diego Co. HMMD, CA HIST UST	TP
J90 / 1	OASIS SPORTS MEDICAL	8575 GIBBS DR STE 11	RCRA-SQG, FINDS, ECHO	TP
J91 / 1	MISSION BAY VORTAC	8575 GIBBS DRIVE, SU	CA HIST UST	TP
J92 / 1	IMPERIAL VOR	8575 GIBBS DRIVE, SU	CA HIST UST	TP
J93 / 1	SEAL BEACH VORAC	8575 GIBBS DRIVE, SU	CA HIST UST	TP
J94 / 1	POGGI VORTAC	8575 GIBBS DRIVE, SU	CA HIST UST	TP
J95 / 1	BARD VOTAC	8575 GIBBS DRIVE, SU	CA HIST UST	TP
J96 / 1	OASIS SPORTS MEDICAL	8575 GIBBS DR	CA San Diego Co. HMMD	TP
J97 / 1	GARDEN GROVE RADAR	8575 GIBBS DR STE 10	CA HIST UST	TP
J98 / 1	BARD VOTAC	8575 GIBBS DR 101	CA SWEEPS UST	TP
J99 / 1	ADVANCED AIRCRAFT SE	8622 GIBBS DR	CA San Diego Co. HMMD	TP
J100 / 1	SCANDANAVIAN AVIATIO	8622 GIBBS DR	CA San Diego Co. HMMD	TP
J101 / 1	ADVANCED AIRCRAFT SE	8622 GIBBS DR	FINDS	TP
J102 / 1	PACIFIC DIAMOND PETR	8525 GIBBS DR STE 10	EDR Hist Auto	TP
J103 / 1	SD CNTY DETENTION FA	8525 GIBBS DR	CA San Diego Co. HMMD	TP
J104 / 1	DETENTION'S FACILITY	8525 GIBBS DR STE 10	CA HAZNET	TP
J105 / 1	COAST AIRCRAFT SALES	8620 GIBBS DRIVE	CA HAZNET	TP
J106 / 1	DETENTION'S FACILITY	8525 GIBBS DR STE 30	CA HAZNET	TP
K107 / 1	FOUR POINTS BY SHERA	8110 AERO DR	CA San Diego Co. HMMD, CA HAZNET	TP
K108 / 1	FOUR POINTS BY SHERA	8110 AERO DR	CA UST	TP
L109 / 1	GIBBS FLYING SERVICE	8906 AERO DR	CA RGA LUST	TP
L110 / 1	GIBBS FLYING SERVICE	8906 AERO DR MNTGRY	EDR Hist Auto	TP
L111 / 1	GIBBS SERVICE CENTER	8906 AERO DR	CA LUST, CA CPS-SLIC, CA AST, CA San Die...	TP
L112 / 1	FLYING R AVIATION	8906 AERO DR	CA San Diego Co. HMMD	TP
L113 / 1	GIBBS FLYING SERVICE	8906 AERO DR	FINDS	TP
L114 / 1	ARMED FORCES AERO CL	8906 AERO DR	CA HAZNET	TP
L115 / 1	GIBBS FLYING SERVICE	8906 AERO DRIVE	CA RGA LUST	TP
L116 / 1	GIBBS SERVICE CENTER	8906 AERO DR	FINDS	TP
L117 / 1	GIBBS FLYING SERVICE	8906 AERO DR	CA RGA LUST	TP

MAPPED SITES SUMMARY - FOCUS MAP 1

Target Property:
3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

MAP ID / FOCUS MAP	SITE NAME	ADDRESS	DATABASE ACRONYMS	DIST (ft. & mi.) DIRECTION
L118 / 1	GIBBS FLYING SERVICE	8906 AERO DRIVE	CA HAZNET	TP
L119 / 1	GIBBS FLYING SERVICE	8906 AERO DR	CA SAN DIEGO CO. SAM, CA UST, CA San Die...	TP
L120 / 1	GIBBS FLYING SERVICE	8906 AERO DR	CA RGA LUST	TP
M121 / 1	WATKINS CONTRACTING	8690 AERO DR STE M32	FTTS, HIST FTTS	TP
M122 / 1	VAKSHOUR JAFAR	8690 AERO DR STE 119	EDR Hist Cleaner	TP
M123 / 1	WATKINS CONTRACTING	8690 AERO DRIVE SUIT	FINDS	TP
N124 / 1	CLEAN HARBORS ENVIRO	9225 AERO DR	CA HAZNET	TP
N125 / 1	SDCTY POLICE EASTERN	9225 AERO DR	CA HAZNET	TP
N126 / 1	SDCTY-PUBLIC WORKS D	9225 AERO DR	FINDS	TP
N127 / 1	SDCTY-FLEET OPERATIO	9225 AERO DR	CA HAULERS, CA San Diego Co. HMMD, CA SW...	TP
N128 / 1	SDCTY-INTERNAL OPERA	9225 AERO DR	CA UST	TP
O129 / 1	POLICE DEPARTMENT	9265 AERO DR	CA HIST UST	TP
O130 / 1	SAN DIEGO POLICE GAR	9265 AERO DR	CA HAZNET	TP
O131 / 1	POLICE TRAFFIC DIVIS	9265 AERO DR	CA HAZNET	TP
P132 / 1	SDCTY/ENGINEERING MT	9515 AERO DR	CA HAZNET	TP
P133 / 1	SDCTY-ENG/MAT TEST L	9515 AERO DR	CA San Diego Co. HMMD	TP
134 / 1	ARC OF SAN DIEGO, AR	9575 AERO DR	CA San Diego Co. HMMD, CA HAZNET	TP
135 / 1	SDCTY-FIRE-RESCUE DE	3750 KEARNY VILLA RD	CA UST, CA SWEEPS UST	6 0.001 ESE
Q136 / 1	SPIDERS AIRCRAFT SER	3873 KEARNY VILLA RD	CA San Diego Co. HMMD, CA SWEEPS UST, CA...	8 0.002 West
R137 / 1	MONTGOMERY FIELD ATC	4298 PONDEROSA AV	CA LUST, CA SAN DIEGO CO. SAM, CA San Di...	22 0.004 ESE
R138 / 1	MONTGOMERY FIELD ATC	4298 PONDEROSA AV	CA LUST, CA San Diego Co. HMMD, CA SWEEP...	22 0.004 ESE
Q139 / 1	SDCTY-FIRE STATION #	3880 KEARNY VILLA RD	CA UST, CA San Diego Co. HMMD, CA SWEEPS...	38 0.007 NNE
Q140 / 1	FIRE STATION 28	3880 KEARNY VILLA RD	CA HIST UST	38 0.007 NNE
S141 / 1	PROGENY SYSTEMS	4217 PONDEROSA AVE S	CA SAN DIEGO CO. SAM, CA CPS-SLIC, CA Sa...	70 0.013 East
S142 / 1	LEIDOS	4211 PONDEROSA AVE	RCRA-SQG, FINDS	70 0.013 East
R143 / 1	MAXWELL LABORATORIES	4241 PONDEROSA AVE	RCRA NonGen / NLR, FINDS, ECHO	92 0.017 East
S144 / 1	NUVASIVE	4223 PONDEROSA AVE C	CA San Diego Co. HMMD, CA HIST UST, CA H...	93 0.018 East
S145 / 1	MADISON SQUARE PARTN	4223 PONDEROSA AVE S	CA HIST UST	93 0.018 East
S146 / 1	MADISON SQUARE PARTN	4223 PONDEROSA AVE A	CA SWEEPS UST	93 0.018 East
S147 / 1	SUPERSHUTTLE	4229 PONDEROSA AVE	RCRA-SQG, FINDS, ECHO	93 0.018 East
T148 / 1	7-ELEVEN INC #32606	9609 AERO DR	CA UST	122 0.023 East
149 / 1	LEVEL 3 COMMUNICATIO	8929 AERO DR	CA AST	122 0.023 South
L150 / 1	AEROVAULT VENTURE, L	8875 AERO DR	CA AST, CA San Diego Co. HMMD, CA HIST U...	123 0.023 South
L151 / 1	SAN DIEGO CENTRAL CA	8875 AERO DR 4062	CA SWEEPS UST	123 0.023 South
U152 / 1	3-D INDUSTRIES, INC	9630 AERO DR	RCRA-SQG, FINDS, ECHO	133 0.025 East
U153 / 1	J. BITTLE AMERICAN,	9630 AERO DR	CA LUST, CA SAN DIEGO CO. SAM, CA San Di...	133 0.025 East
V154 / 1	ACTION INSTRUMENTS C	8601 AERO DR	RCRA-SQG, FINDS, ECHO	137 0.026 South
V155 / 1	PRIII/BROADSTONE KEA	8601 AERO DR	CA CPS-SLIC, CA San Diego Co. HMMD, CA H...	137 0.026 South
V156 / 1	8575 AERO DR	8575 AERO DR	RCRA-SQG, CA ENVIROSTOR, CA VCP, CA HIST...	153 0.029 South

MAPPED SITES SUMMARY - FOCUS MAP 1

Target Property:
3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

MAP ID / FOCUS MAP	SITE NAME	ADDRESS	DATABASE ACRONYMS	DIST (ft. & mi.) DIRECTION		
V157 / 1	MOORE PRINTED CIRCUIT	8575 AERO DR	CA SAN DIEGO CO. SAM, CA HIST UST, FTTS,...	153	0.029	South
V158 / 1	NATURESCAPE SERVICES	8575 AERO DR	CA San Diego Co. HMMD, CA SWEEPS UST, CA...	153	0.029	South
V159 / 1	ON SITE DRAPERY CLEANING	8555 AERO DR	EDR Hist Cleaner	153	0.029	South
W160 / 1	LORAL INSTRUMENTATION	8401 AERO DR	RCRA-SQG, CA San Diego Co. HMMD, FINDS, ...	196	0.037	South
W161 / 1	GREMLIN INDUSTRIES INC	8401 AERO DRIVE	RCRA-SQG	196	0.037	South
162 / 1	C P KELCO	8225 AERO DR	RCRA-SQG, CA San Diego Co. HMMD, CA HAZN...	210	0.040	South
X163 / 1	KYOCERA AMERICA INC	8611 BALBOA AVE	CA SWEEPS UST	213	0.040	NNE
X164 / 1	KYOCERA INTERNATIONAL	8611 BALBOA AVE.	RCRA-LQG, CA LUST, CA SAN DIEGO CO. SAM,...	213	0.040	NNE
X165 / 1	KYOCERA CO-GEN	8611 BALBOA AVE	CA AST	213	0.040	NNE
X166 / 1	KYOCERA INTERNATIONAL	8611 BALBOA AVE	CA HAZNET, CA HWP, CA NPDES	213	0.040	NNE
X167 / 1	KYOCERA SOLAR INC	8611 BALBOA AVE	RCRA NonGen / NLR, CA HAZNET	213	0.040	NNE
168 / 1	CASTLE ACCESS	9606 AERO DR STE 190	CA AST	241	0.046	East
Y169 / 1	SUNDSTRAND POWER SYS	8975 BALBOA AVENUE	RCRA-LQG, FINDS	242	0.046	NNW
Y170 / 1	JACK HENRY & ASSOCIATES	8975 BALBOA AVE	CA AST	242	0.046	NNW
171 / 1	SAN DIEGO COUNTY MEDICAL	3702 RUFFIN RD	CA San Diego Co. HMMD, CA SWEEPS UST, CA...	280	0.053	East
172 / 1	E & R TRANSMISSION A	3587 RUFFIN RD UNIT	EDR Hist Auto	287	0.054	SSW
173 / 1	SHARP HEALTH CARE (D)	3571 CORPORATE CT	CA AST, CA San Diego Co. HMMD	290	0.055	South
T174 / 1	WEB SERVICE CO INC	9645 AERO DR	EDR Hist Cleaner	316	0.060	East
T175 / 1	CALIFORNIA METER SERVICES	9645 AERO DR	RCRA-SQG, CA San Diego Co. HMMD, FINDS, ...	316	0.060	East
176 / 1	LOCKHEED MARTIN MARINE	3853 CALLE FORTUNADA	CA San Diego Co. HMMD, RCRA NonGen / NLR...	336	0.064	NNE
177 / 1	MAXWELL TECHNOLOGIES	3912 CALLE FORTUNADA	RCRA-LQG, FINDS, ECHO	370	0.070	NNE
Z178 / 1	SUNSET MOTORS	3888 KEARNY MESA RD	CA LUST, CA SAN DIEGO CO. SAM, CA San Di...	383	0.073	NW
Z179 / 1	PHD CORP	3888 KEARNEY MESA RD	CA HIST UST, RCRA NonGen / NLR, FINDS, E...	383	0.073	NW
Z180 / 1	LEASEWAY TRANSPORTATION	3888 KEARNY MESA RD	CA HIST UST	383	0.073	NW
181 / 1	WAVETEK	9045 BALBOA AVE	RCRA-SQG, FINDS, ECHO	394	0.075	NNW
AA182 / 1	HAWTHORNE MACHINERY	4200 KEARNY MESA ROAD	RCRA-LQG, CA SAN DIEGO CO. SAM, CA San D...	417	0.079	WNW
AA183 / 1	STAPLES THE OFFICE SUPPLY	4200 KEARNY MESA RD	CA LUST, CA CPS-SLIC, CA San Diego Co. H...	417	0.079	WNW
184 / 1	BOSTON SCIENTIFIC -	3574 RUFFIN ROAD	RCRA-LQG, FINDS, ECHO	432	0.082	SSW
Z185 / 1	KEARNY MESA 76, LLC.	3860 KEARNY MESA RD	CA LUST, CA San Diego Co. HMMD, CA SWEEP...	444	0.084	NW
Z186 / 1	KEARNY MESA SHELL SERVICE	3860 KEARNY MESA RD	EDR Hist Auto	444	0.084	NW
Z187 / 1	PROPEL BIOFUELS 76	3860 KEARNY MESA ROAD	CA LUST, CA HAZNET, CA SAN DIEGO CO LOP	444	0.084	NW
Z188 / 1	KEARNY MESA 76, LLC.	3860 KEARNY MESA RD	CA SAN DIEGO CO. SAM, CA UST, CA San Die...	444	0.084	NW
Z189 / 1	SHELL OIL SERVICE STATION	3860 KEARNEY MESA	RCRA-SQG, CA HIST UST, FINDS, ECHO	444	0.084	NW
Z190 / 1	KEARNY MESA EXXON	3860 KEARNY MESA RD	CA LUST, CA HIST CORTESE	444	0.084	NW
191 / 1	ULTRASIGNS, INC	9025 BALBOA AVENUE S	RCRA-SQG	452	0.086	NNW
192 / 1	SCIENTIFIC ATLANTA GROUP	8911 BALBOA AVE	RCRA-SQG, CA San Diego Co. HMMD, FINDS, ...	459	0.087	NNW
193 / 1	ECONOLUBE N TUNE & LUBE	7979 AERO DR	CA AST	460	0.087	West
AB194 / 1	SAN DIEGO PORSCHE RENTALS	8861 BALBOA AVE	EDR Hist Auto	465	0.088	NNW
AC195 / 1	HIPP MARINE SERVICES	4070 KEARNY MESA RD	CA LUST, CA SAN DIEGO CO. SAM, CA San Di...	532	0.101	WNW

MAPPED SITES SUMMARY - FOCUS MAP 1

Target Property:
3750 JOHN J MONTGOMERY DRIVE
SAN DIEGO, CA 92123

MAP ID / FOCUS MAP	SITE NAME	ADDRESS	DATABASE ACRONYMS	DIST (ft. & mi.) DIRECTION		
AC196 / 1	GEMINI MOVING SPECIA	4070 KEARNY MESA RD	CA LUST, CA SWEEPS UST	532	0.101	WNW
AD197 / 1	AMERICAN OIL CO	3833 CONVOY ST	EDR Hist Auto	544	0.103	WNW
AD198 / 1	MY MECHANIC	3833 CONVOY ST	CA LUST, CA SAN DIEGO CO. SAM, CA San Di...	544	0.103	WNW
AE199 / 1	TELEDYNE RYAN ELECTR	8650 BALBOA AVE	SEMS-ARCHIVE, CORRACTS, RCRA-TSDF, RCRA-548	0.104	NNE	
AE200 / 1	DIGITAL DEVELOPMENT	8650 BALBOA AVE	RCRA-SQG, FINDS, ECHO	548	0.104	NNE
AE201 / 1	TELEDYNE RYAN ELECTR	8650 BALBOA AVE	CA HWP, CA NPDES	548	0.104	NNE
AF202 / 1	CUBIC DEFENSE APPLIC	9233 BALBOA AVE	RCRA-LQG	554	0.105	NE
AF203 / 1	CUBIC CORPORATION	9233 BALBOA AVE	CA SWEEPS UST, CA HIST UST, CA EMI	554	0.105	NE
AF204 / 1	CUBIC DEFENSE APPLIC	9233 BALBOA AV	CA SAN DIEGO CO. SAM, CA CPS-SLIC, CA Sa...	554	0.105	NE
AF205 / 1	NAVAL UNDERSEA WARFA	9284 BALBOA AV	CA LUST, CA SAN DIEGO CO. SAM, CA San Di...	591	0.112	NE
AF206 / 1	USNAVY NAVAL UNDERSE	9284 BALBOA AVE B	RCRA-SQG	591	0.112	NE
AG207 / 1	SENIOR AEROSPACE JET	9106 BALBOA AV	CA ENVIROSTOR, CA AST, CA San Diego Co. ...	598	0.113	NNW
AG208 / 1	SENIOR AEROSPACE / J	9106 BALBOA AVENUE	RCRA-LQG	598	0.113	NNW
AG209 / 1	SENIOR AEROSPACE / J	9106 BALBOA AVE	RCRA-SQG, FINDS, ECHO, CA WDS	598	0.113	NNW
AF210 / 1	BUILDING 1	9244 BALBOA AVE	CA HIST UST	605	0.115	NE
AF211 / 1	FORMER MAXWELL TECH	9244 BALBOA AVENUE	CA CPS-SLIC	605	0.115	NE
AF212 / 1	MAXWELL LABORATORIES	9244 BALBOA AVE	CA LUST, CA SWEEPS UST	605	0.115	NE
AF213 / 1	MAXWELL ELECTRONIC C	9244 BALBOA AVENUE	RCRA-LQG, FINDS, ECHO	605	0.115	NE
AF214 / 1	DATA DEVICE CORPORAT	9244 BALBOA AVE	RCRA-SQG, CA LUST, CA SAN DIEGO CO. SAM,...	605	0.115	NE
AH215 / 1	TRICARE OUTPATIENT C	8808 BALBOA AV	CA SAN DIEGO CO. SAM	638	0.121	NNW
AH216 / 1	TRICARE OUTPATIENT C	8808 BALBOA AVE	RCRA-SQG, CA LUST, CA SWEEPS UST, FINDS,...	638	0.121	NNW
AH217 / 1	TRICARE OUTPATIENT C	8808 BALBOA AVE	CA CPS-SLIC, CA San Diego Co. HMMD, CA H...	638	0.121	NNW
AB218 / 1	G D E SYSTEMS INC	8804 BALBOA AVE	RCRA NonGen / NLR, FINDS, ECHO	640	0.121	NNW
219 / 1	AEROSPACE SUPPLY INC	3738 RUFFIN RD	CA San Diego Co. HMMD, CA SWEEPS UST	641	0.121	East
220 / 1	BLVO BEESON FLOYD CH	4398 KEARNY MESA R	EDR Hist Auto	643	0.122	WNW
221 / 1	TELEDYNE ELECTRONIC	3565 CORPORATE CT	RCRA-SQG, FINDS, ECHO	657	0.124	South
AI222 / 1	SILTEC SAN DIEGO PAC	3566 CORPORATE COURT	SEMS-ARCHIVE	658	0.125	South
AI223 / 1	DELTA GROUP ELECTRON	3566 CORPORATE COURT	RCRA NonGen / NLR, FINDS, ECHO	658	0.125	South
224 / 1	SOLAR TURBINES INCOR	4200 RUFFIN ROAD	SEMS-ARCHIVE, CORRACTS, RCRA-TSDF, RCRA-832	0.158	NE	

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A1 SDCTY-POLICE DEPT, AIR SUPPORT UNIT
Target 4141 KEARNY VILLA RD
Property SAN DIEGO, CA 92123

CA San Diego Co. HMMD S113143757
CA HAZNET N/A

Site 1 of 5 in cluster A

Actual:
413 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000309699
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 858-495-7890
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 02/07/2018
Facility Owner: Not reported
Facility Mailing Address: 4141 KEARNY VILLA RD, SAN DIEGO, CA 92123
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

UST DTL:

Record ID: DEH2006-HUPFP-207395
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-207395
Facility Type (Ust Facility): Not reported
Tank Owner Name: SDCTY-POLICE DEPT
Tankid: 26950
Tank Status: Removed
Date Ust Permanently Closed: 02/26/1991
Tank Use: 01
Piping System Type: Not reported
Last Updated: 2018-02-07T02:30:48.000
Tank Capacityin Gallons: 50
Tank Contents: 1A
Type Of Tank: 95

Record ID: DEH2006-HUPFP-207395
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-207395
Facility Type (Ust Facility): Not reported
Tank Owner Name: SDCTY-POLICE DEPT
Tankid: 26949
Tank Status: Removed
Date Ust Permanently Closed: 07/07/1988
Tank Use: 01
Piping System Type: Not reported
Last Updated: 2018-02-07T02:30:48.000
Tank Capacityin Gallons: 10000
Tank Contents: Aviation Gas

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE DEPT, AIR SUPPORT UNIT (Continued)

S113143757

Type Of Tank: 01

Record ID: DEH2006-HUPFP-207395
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-207395
Facility Type (Ust Facility): Not reported
Tank Owner Name: SDCTY-POLICE DEPT
Tankid: 26948
Tank Status: Removed
Date Ust Permanently Closed: 07/07/1988
Tank Use: 01
Piping System Type: Not reported
Last Updated: 2018-02-07T02:30:48.000
Tank Capacityin Gallons: 10000
Tank Contents: Aviation Gas
Type Of Tank: 01

Waste and Materials:

Record ID: DEH2006-HUPFP-207395
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0138965
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-02-07T02:30:48.000
Chemical Name: WASTE OIL
Common Name: WASTE OIL
Case Number: Not reported

Record ID: DEH2006-HUPFP-207395
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0138966
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-02-07T02:30:48.000
Chemical Name: WASTE OILY ABSORBENT
Common Name: WASTE OILY ABSORBENT
Case Number: Not reported

Record ID: DEH2006-HUPFP-207395
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0121103
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-05-23T01:24:00.000
Chemical Name: WASTE OIL
Common Name: WASTE OIL
Case Number: Not reported

Record ID: DEH2006-HUPFP-207395
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0121104
Trade Secret: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE DEPT, AIR SUPPORT UNIT (Continued)

S113143757

Hazardous Material Type: Not reported
Last Updated: 2017-05-23T01:24:00.000
Chemical Name: WASTE OILY ABSORBENT
Common Name: WASTE OILY ABSORBENT
Case Number: Not reported

Record ID: DEH2006-HUPFP-207395
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0078618
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-01-26T02:31:25.000
Chemical Name: WASTE OIL
Common Name: WASTE OIL
Case Number: Not reported

Record ID: DEH2006-HUPFP-207395
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0078619
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-01-26T02:31:25.000
Chemical Name: WASTE AQUEOUS PARTS WASHER
Common Name: WASTE AQUEOUS PARTS WASHER
Case Number: Not reported

Record ID: DEH2006-HUPFP-207395
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0078620
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-01-26T02:31:25.000
Chemical Name: WASTE OILY ABSORBENT
Common Name: WASTE OILY ABSORBENT
Case Number: Not reported

HAZNET:

Facility Name: SDCTY-POLICE AIR SUPPORT
envid: S113143757
Year: 2016
GEPAID: CAL000309699
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Off-specification, aged or surplus inorganics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.01251

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE DEPT, AIR SUPPORT UNIT (Continued)

S113143757

Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113143757
Year: 2016
GEPAID: CAL000309699
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Tons: 0.0248
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113143757
Year: 2016
GEPAID: CAL000309699
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Tons: 0.0248
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113143757
Year: 2016
GEPAID: CAL000309699
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Laboratory waste chemicals
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Tons: 0.02919

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE DEPT, AIR SUPPORT UNIT (Continued)

S113143757

Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113143757
Year: 2016
GEPAID: CAL000309699
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Off-specification, aged or surplus inorganics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)

Tons: 0.01251
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
13 additional CA_HAZNET: record(s) in the EDR Site Report.

**A2
Target
Property**

**SDCTY-POLICE AIR SUPPORT UNIT
4141 KEARNY VILLA RD
SAN DIEGO, CA 92123**

**CA San Diego Co. HMMD S104575385
N/A**

Site 2 of 5 in cluster A

**Actual:
413 ft.**

**Focus Map:
1**

HMMD SAN DIEGO:
Permit Number: 207395
Business Type: 6HK52
EPA Id Number: CAL000309699
APN: 421-290-11-00
Last HMMD Inspection: 09/19/2012
Facility Telephone: 858-495-7890
Permit Status: OPEN
Permit Expiration: 02/28/2013
Date Last Updated: 11/02/2012
Facility Owner: CITY OF SAN DIEGO
Facility Mailing Address: 4141 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):
Permit Number: 207395
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE AIR SUPPORT UNIT (Continued)

S104575385

Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: AQUEOUS PARTS WASHER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 207395
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: USED OIL/ HAULED TO FIRE REPAIR
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 207395
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY ABSORBENT- RAGS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 207395
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: FUEL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 207395
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: USED OIL FILTERS HAULED TO FIRE REPAIR
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

UST:

UST Name: UNDERGROUND TANK 121291 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 207395
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 10000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: REMOVED
Remove Close Date: 1988-07-07 00:00:00
Year Installed: 1979-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE AIR SUPPORT UNIT (Continued)

S104575385

Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALLY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 121291 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 207395
Tank Type: SINGLE WALL
Additional Id: 2
Capacity Gallons: 10000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: REMOVED
Remove Close Date: 1988-07-07 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALLY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 121291 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 207395
Tank Type: UNKNOWN
Additional Id: 3
Capacity Gallons: 50
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1991-02-26 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING
ALTERNATIVE DURING INSPECTION.

Permit Number: 130433
Business Type: 6HK26
EPA Id Number: CAL000006999
APN: 421-290-11-00
Last HMMI Inspection: 01/30/2006
Facility Telephone: 858-571-5973
Permit Status: INAC
Permit Expiration: 08/31/2007
Date Last Updated: 11/02/2012
Facility Owner: CRITICAL AIR MEDICINE INC
Facility Mailing Address: 13400 SABRE SPRINGS PY #270
Facility Mailing City: POWAY
Facility Mailing State: CA
Facility Mailing Zip: 92128
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE AIR SUPPORT UNIT (Continued)

S104575385

Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Violations Inactive Permits:

Permit Number: 130433
Update Date: 11/02/2012
Inspection Date: 01/16/2004
Violation Code: 6HV0131
Violation: UPF Permit NOT OBTAINED for HAZWASTE
Violation Citation: A Unified Program Facility permit has not been obtained for the generation of hazardous waste. 68.905
Activity: Inactive Permit

Permit Number: 130433
Update Date: 11/02/2012
Inspection Date: 01/16/2004
Violation Code: 6HV1001
Violation: NO UPF PERMIT FOR HAZMATS
Violation Citation: A Unified Program Facility permit has not been obtained for hazardous materials. 68.905
Activity: Inactive Permit

Permit Number: 130433
Update Date: 11/02/2012
Inspection Date: 01/16/2004
Violation Code: 6HV4201
Violation: NO UPF PERMIT FOR MEDICAL WASTE
Violation Citation: A Unified Program Facility Permit has not been obtained for the generation of medical waste. 117705, 68.905
Activity: Inactive Permit

Permit Number: 130433
Update Date: 11/02/2012
Inspection Date: 01/30/2006
Violation Code: 6HV0131
Violation: UPF Permit NOT OBTAINED for HAZWASTE
Violation Citation: A Unified Program Facility permit has not been obtained for the generation of hazardous waste. 68.905
Activity: Inactive Permit

Permit Number: 130433
Update Date: 11/02/2012
Inspection Date: 01/30/2006
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: Inactive Permit

Permit Number: 130433
Update Date: 11/02/2012
Inspection Date: 01/30/2006
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE AIR SUPPORT UNIT (Continued)

S104575385

Activity: 66265.16(d)&(e)
Inactive Permit

Permit Number: 130433
Update Date: 11/02/2012
Inspection Date: 01/30/2006
Violation Code: 6HV1002
Violation: HMBP NOT ESTABISHED/IMPLEMENTED.
Violation Citation: Hazardous materials handler has not established/implemented a business plan. HSC 25503.5(a)
Activity: Inactive Permit

Permit Number: 207395
Business Type: 6HK52
EPA Id Number: CAL000309699
APN: 421-290-11-00
Last HMMD Inspection: 09/19/2012
Facility Telephone: 858-495-7890
Permit Status: OPEN
Permit Expiration: 02/28/2013
Date Last Updated: 11/02/2012
Facility Owner: CITY OF SAN DIEGO
Facility Mailing Address: 4141 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 207395
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: AQUEOUS PARTS WASHER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 207395
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: USED OIL/ HAULED TO FIRE REPAIR
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 207395
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE AIR SUPPORT UNIT (Continued)

S104575385

Other Information: OILY ABSORBENT- RAGS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 207395
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: FUEL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 207395
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: USED OIL FILTERS HAULED TO FIRE REPAIR
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

UST:

UST Name: UNDERGROUND TANK 121291 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 207395
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 10000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: REMOVED
Remove Close Date: 1988-07-07 00:00:00
Year Installed: 1979-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 121291 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 207395
Tank Type: SINGLE WALL
Additional Id: 2
Capacity Gallons: 10000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: REMOVED
Remove Close Date: 1988-07-07 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE AIR SUPPORT UNIT (Continued)

S104575385

UST Name: UNDERGROUND TANK 121291 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 207395
Tank Type: UNKNOWN
Additional Id: 3
Capacity Gallons: 50
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1991-02-26 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

A3
Target
Property
EXECUTIVE AIR SVC
4141 KEARNY VILLA RD
SAN DIEGO, CA 92123

CA HAZNET
S113024127
N/A

Site 3 of 5 in cluster A

Actual:
413 ft.
Focus Map:
1
HAZNET:
Facility Name: EXECUTIVE AIR SVC
envid: S113024127
Year: 1999
GEPAID: CAL000006999
Contact: EXECUTIVE AIR SVC
Telephone: 0000000000
Mailing Name: Not reported
Mailing Address: 4141 KEARNY VILLA RD
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAT080013352
TSD County: Not reported
Waste Category: Waste oil and mixed oil
Disposal Method: Recycler
Tons: .3544
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

A4
Target
Property
SDCTY-POLICE DEPTNA AIR SUPPORT UNIT
4141 KEARNY VILLA RD
SAN DIEGO, CA 92123

FINDS
1023288944
N/A

Site 4 of 5 in cluster A

Actual:
413 ft.
Focus Map:
1
FINDS:
Registry ID: 110065802475
Environmental Interest/Information System
STATE MASTER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE DEPTNA AIR SUPPORT UNIT (Continued)

1023288944

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

A5
Target
Property

MONTGOMERY FIELD AIRPORT LOCALIZER
SAN DIEGO (County), CA

CA CIWQS
S121656814
N/A

Site 5 of 5 in cluster A

Actual:
412 ft.
Focus Map:
1

CIWQS:
Agency: San Diego City Administration Building (Facilities & Dept Directors)
Agency Address: 2797 Caminito Chollas, San Diego, CA 92105
Place/Project Type: Dredge/Fill Site
SIC/NAICS: Not reported
Region: 9
Program: CERFILLEXC
Regulatory Measure Status: Historical
Regulatory Measure Type: Enrollee - 401 Certification
Order Number: 2004-0004-DWQ
WDID: 9000001999
NPDES Number: Not reported
Adoption Date: Not reported
Effective Date: 12/03/2009
Termination Date: 12/03/2014
Expiration/Review Date: 12/03/2014
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.820304
Longitude: -117.145185

6
Target
Property

SPIDERS AIRCRAFT SER INC
BLD 119 MONTGOMERY FIELD
SAN DIEGO, CA 92123

CA HIST UST
1000188461
N/A

HIST UST:

Actual:
422 ft.
Focus Map:
1

HIST UST:
File Number: 0002F352
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002F352.pdf>
Region: STATE
Facility ID: 00000037331
Facility Type: Other
Other Type: AIRCRAFT SERVICE
Contact Name: FRANK SCHOSSOW
Telephone: 6192770312
Owner Name: SPIDER'S AIRCRAFT SERVICE INC.
Owner Address: BLD 119 MONTGOMERY FIELD
Owner City,St,Zip: SAN DIEGO, CA 92123
Total Tanks: 0002

Tank Num: 001
Container Num: 2
Year Installed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPIDERS AIRCRAFT SER INC (Continued)

1000188461

Tank Capacity: 00000250
Tank Used for: WASTE
Type of Fuel: WASTE OIL
Container Construction Thickness: Not reported
Leak Detection: None

Tank Num: 002
Container Num: 1
Year Installed: Not reported
Tank Capacity: 00000550
Tank Used for: PRODUCT
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: None

[Click here for Geo Tracker PDF:](#)

7
Target
Property

TEXACO (NATIONAL AIR COLLEGE)
MONTGOMERY FIELD
SAN DIEGO, CA 90010

CA HIST UST

U001560460
N/A

Actual:
419 ft.
Focus Map:
1

HIST UST:

File Number: 0002F3A5
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002F3A5.pdf>
Region: STATE
Facility ID: 00000016077
Facility Type: Not reported
Other Type: Not reported
Contact Name: NUG NADARIDGE
Telephone: 6192794595
Owner Name: TEXACO-USA
Owner Address: 3350 WILSHIRE BLVD.
Owner City,St,Zip: LOS ANGELES, CA 90010
Total Tanks: 0002

Tank Num: 001
Container Num: 2
Year Installed: 1978
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: 06
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

Tank Num: 002
Container Num: 1
Year Installed: 1978
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: 06
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

[Click here for Geo Tracker PDF:](#)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8
Target
Property **MONTGOMERY FIELD**
UNKNOWN
SAN DIEGO, CA 92101

FINDS **1011979681**
N/A

FINDS:

Actual: Registry ID: 110038069238
422 ft.

Focus Map: Environmental Interest/Information System
1 AIR EMISSIONS CLASSIFICATION UNKNOWN

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

B9
Target
Property **CALIFORNIA WINGS**
4025 KEARNY VILLA RD
SAN DIEGO, CA 92123

CA San Diego Co. HMMD **S104750885**
N/A

Site 1 of 2 in cluster B

Actual: HMMD SAN DIEGO:
409 ft. Permit Number: 126011
Focus Map: Business Type: 6HK26
1 EPA Id Number: CAL000077076
APN: 421-290-11-00
Last HMMD Inspection: 04/30/1998
Facility Telephone: 858-569-8282
Permit Status: INAC
Permit Expiration: 04/30/1998
Date Last Updated: 11/02/2012
Facility Owner: DAVID BUTLER
Facility Mailing Address: 4025 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1704
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

B10
Target
Property **LOCKHEED MARTIN ASTRONAUTICS KEARNY MESA**
4001 KEARNY VILLA RD
SAN DIEGO, CA 92186

RCRA-LQG **1007199803**
CAD982317547

Site 2 of 2 in cluster B

Actual: RCRA-LQG:
407 ft. Date form received by agency: 03/06/1996
Focus Map: Facility name: LOCKHEED MARTIN ASTRONAUTICS KEARNY MESA
1 Facility address: 4001 KEARNY VILLA RD
SAN DIEGO, CA 92186-5990
EPA ID: CAD982317547
Mailing address: P.O. BOX 80667 MZ 93-7160
SAN DIEGO, CA 92138-0667

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LOCKHEED MARTIN ASTRONAUTICS KEARNY MESA (Continued)

1007199803

Contact: JIM O'BRIEN
Contact address: Not reported
Contact country: US
Contact telephone: 619-542-3017
Contact email: Not reported
EPA Region: 09
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 03/29/1994
Site name: GENERAL DYNAMICS SPACE SYSTEMS
Classification: Large Quantity Generator

Date form received by agency: 02/28/1992
Site name: GENERAL DYNAMICS SPACE SYSTEMS KEARNY ME
Classification: Large Quantity Generator

Date form received by agency: 04/16/1990
Site name: GENERAL DYNAMICS SPACE SYSTEMS
Classification: Large Quantity Generator

Violation Status: No violations found

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C11
Target
Property

FEDERAL AVIATION ADMIN
4302-4298 PONDEROSA AVE
SAN DIEGO, CA 92123

CA SWEEPS UST
S106926141
N/A

Site 1 of 5 in cluster C

Actual:
419 ft.

Focus Map:
1

SWEEPS UST:

Status: Active
Comp Number: 21303
Number: 9
Board Of Equalization: 44-023520
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021303-000001
Tank Status: A
Capacity: 3000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: 1

C12
Target
Property

MERCY AIR SERVICE
3753 JOHN J MONTGOMERY DR BLDG 31B
SAN DIEGO, CA 92123

CA HAZNET
S123077894
N/A

Site 2 of 5 in cluster C

Actual:
419 ft.

Focus Map:
1

HAZNET:

Facility Name: MERCY AIR SERVICE
envid: S123077894
Year: 2017
GEPAID: CAL000404314
Contact: JOSHUA DOWNING
Telephone: 7608817126
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR BLDG 31B
Mailing City,St,Zip: SAN DIEGO, CA 921231751
Gen County: San Diego
TSD EPA ID: CAT080013352
TSD County: Los Angeles
Waste Category: Unspecified organic liquid mixture
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration, Organics Recovery Ect
Tons: 0.102
Cat Decode: Unspecified organic liquid mixture
Method Decode: Other Recovery Of Reclamation For Reuse Including Acid Regeneration, Organics Recovery Ect
Facility County: San Diego

envid: S123077894
Year: 2017
GEPAID: CAL000404314
Contact: JOSHUA DOWNING
Telephone: 7608817126
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR BLDG 31B
Mailing City,St,Zip: SAN DIEGO, CA 921231751

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MERCY AIR SERVICE (Continued)

S123077894

Gen County: San Diego
TSD EPA ID: AZR000515924
TSD County: 99
Waste Category: Other organic solids
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.025
Cat Decode: Other organic solids
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Facility County: San Diego

C13 **MYF HOLDINGS LLC DBA CROWNAIR AVIATION**
Target **3753 JOHN J MONTGOMERY DR**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S123044533**
N/A

Site 3 of 5 in cluster C

Actual:
419 ft.

Focus Map:
1

HAZNET:
Facility Name: MYF HOLDINGS LLC DBA CROWNAIR AVIATION
envid: S123044533
Year: 2017
GEPAID: CA0000269506
Contact: JULIE HARLESS
Telephone: 8582771453
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: AZR000515924
TSD County: 99
Waste Category: Other organic solids
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.35
Cat Decode: Other organic solids
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S123044533
Year: 2017
GEPAID: CA0000269506
Contact: JULIE HARLESS
Telephone: 8582771453
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD008252405
TSD County: Los Angeles
Waste Category: Other organic solids
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.1
Cat Decode: Other organic solids
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MYF HOLDINGS LLC DBA CROWNAIR AVIATION (Continued)

S123044533

Facility County: San Diego

envid: S123044533
Year: 2017
GEPAID: CA0000269506
Contact: JULIE HARLESS
Telephone: 8582771453
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAT080013352
TSD County: Los Angeles
Waste Category: Unspecified organic liquid mixture
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 1.224
Cat Decode: Unspecified organic liquid mixture
Method Decode: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Facility County: San Diego

envid: S123044533
Year: 2016
GEPAID: CA0000269506
Contact: JULIE HARLESS
Telephone: 8582771453
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAT080013352
TSD County: Los Angeles
Waste Category: Unspecified organic liquid mixture
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 0.901
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S123044533
Year: 2016
GEPAID: CA0000269506
Contact: JULIE HARLESS
Telephone: 8582771453
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD008252405
TSD County: Los Angeles
Waste Category: Other organic solids
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.5875
Cat Decode: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MYF HOLDINGS LLC DBA CROWNAIR AVIATION (Continued)

S123044533

Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
45 additional CA_HAZNET: record(s) in the EDR Site Report.

C14 **MONTGOMERY FIELD SAN AFSS**
Target **4302 PONDEROSA AV**
Property **SAN DIEGO, CA 92123**

CA San Diego Co. HMMD **S106061845**
CA HAZNET **N/A**

Site 4 of 5 in cluster C

Actual: HMMD SAN DIEGO:
419 ft. Permit Number: 121303
Focus Map: Business Type: 6HK18
1 EPA Id Number: CA9690590188
APN: 369-170-24-00
Last HMMD Inspection: 01/18/2007
Facility Telephone: 858-292-7247
Permit Status: INAC
Permit Expiration: 03/31/2009
Date Last Updated: 11/02/2012
Facility Owner: JAMES N ROUTH DEVELOPMENT
Facility Mailing Address: 9175 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92028-
UST Owner: JAMES N ROUTH DEVELOPMENT
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 121303 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121303
Tank Type: DOUBLE WALL
Additional Id: SANAFSS
Capacity Gallons: 3000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1998-10-24 00:00:00
Year Installed: 1986-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 21
UST Monitor Method: DW TANK DW SUCTION AND/ OR GRAVITY PIPING WITH INTERSTITIAL
MONITORS: INTERSTITIAL.

HAZNET:

Facility Name: FEDERAL AVIATION ADMINISTRATION
envid: S106061845
Year: 2013

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD SAN AFSS (Continued)

S106061845

GEPAID: CAC002738433
Contact: SECM
Telephone: 8585375516
Mailing Name: Not reported
Mailing Address: 9175 KEARNY VILLA RD
Mailing City,St,Zip: SAN DIEGO, CA 921267055
Gen County: San Diego
TSD EPA ID: AZC950823111
TSD County: 99
Waste Category: Not reported
Disposal Method: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Tons: 1.2
Cat Decode: Not reported
Method Decode: Not reported
Facility County: Not reported

envid: S106061845
Year: 2013
GEPAID: CAC002738433
Contact: SECM
Telephone: 8585375516
Mailing Name: Not reported
Mailing Address: 9175 KEARNY VILLA RD
Mailing City,St,Zip: SAN DIEGO, CA 921267055
Gen County: San Diego
TSD EPA ID: CAD028409019
TSD County: Los Angeles
Waste Category: Not reported
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.35
Cat Decode: Not reported
Method Decode: Not reported
Facility County: Not reported

C15

Target 4302 PONDEROSA AVE.
Property SAN DIEGO, CA 92126

CA CHMIRS **S105671749**
N/A

Site 5 of 5 in cluster C

Actual: CHMIRS:
419 ft. OES Incident Number: 1-5505
Focus Map: OES notification: 09/28/2001
1 OES Date: Not reported
OES Time: Not reported
Date Completed: **Not reported**
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105671749

Responding Agency Personnel # Of Injuries: Not reported
Responding Agency Personnel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: No
Waterway: Not reported
Spill Site: Not reported
Cleanup By: Responsible Party
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Date/Time: Not reported
Year: 2001
Agency: County of San Diego, Hazardous Materials Response
Incident Date: 9/28/200112:00:00 AM
Admin Agency: San Diego County Health Services Dept.
Amount: Not reported
Contained: Yes
Site Type: Other
E Date: Not reported
Substance: Sulfuric Acid, LiquidSulfuric Acid, Vapor
Ounces: 2
Unknown: 0.000000
Substance #2: Not reported
Substance #3: Not reported
Evacuations: 20
Number of Injuries: 1
Number of Fatalities: 0
#1 Pipeline: Not reported
#2 Pipeline: Not reported
#3 Pipeline: Not reported
#1 Vessel >= 300 Tons: Not reported
#2 Vessel >= 300 Tons: Not reported
#3 Vessel >= 300 Tons: Not reported
Evacs: Not reported
Injuries: Not reported
Fataals: Not reported
Comments: Not reported
Description: 2 batteries boiled over, due to overcharging, inside an FAA building. This was accidental by an employee. The building was evacuated, one person had a headache.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

D16
Target
Property

C & B CONSULTING, LLC
3753 JOHN J MONTGOMERY DR
SAN DIEGO, CA 92123

CA HAZNET **S121005848**
N/A

Site 1 of 17 in cluster D

Actual:
412 ft.
Focus Map:
1

HAZNET:
Facility Name: C & B CONSULTING, LLC
envid: S121005848
Year: 2016
GEPaid: CAC002871180
Contact: JOEL CHAMPAGNE JR
Telephone: 4066402371
Mailing Name: Not reported
Mailing Address: PO BOX 161831
Mailing City,St,Zip: BIG SKY, MT 59716
Gen County: San Diego
TSD EPA ID: CAT080013352
TSD County: Los Angeles
Waste Category: Unspecified organic liquid mixture
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 0.68
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

D17
Target
Property

AIR 88 INC DBA CROWNAIR
3753 JOHN J MONTGOMERY DR
SAN DIEGO, CA 92123

CA HAZNET **S112835910**
N/A

Site 2 of 17 in cluster D

Actual:
412 ft.
Focus Map:
1

HAZNET:
Facility Name: MYF HOLDINGS LLC DBA CROWNAIR AVIATION
envid: S112835910
Year: 2017
GEPaid: CA0000269506
Contact: JULIE HARLESS
Telephone: 8582771453
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: AZR000515924
TSD County: 99
Waste Category: Other organic solids
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.35
Cat Decode: Other organic solids
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S112835910
Year: 2017
GEPaid: CA0000269506
Contact: JULIE HARLESS
Telephone: 8582771453

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AIR 88 INC DBA CROWNAIR (Continued)

S112835910

Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD008252405
TSD County: Los Angeles
Waste Category: Other organic solids
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.1
Cat Decode: Other organic solids
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S112835910
Year: 2017
GEPAID: CA0000269506
Contact: JULIE HARLESS
Telephone: 8582771453
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAT080013352
TSD County: Los Angeles
Waste Category: Unspecified organic liquid mixture
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 1.224
Cat Decode: Unspecified organic liquid mixture
Method Decode: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Facility County: San Diego

envid: S112835910
Year: 2016
GEPAID: CA0000269506
Contact: JULIE HARLESS
Telephone: 8582771453
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAT080013352
TSD County: Los Angeles
Waste Category: Unspecified organic liquid mixture
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 0.901
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112835910
Year: 2016
GEPAID: CA0000269506

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AIR 88 INC DBA CROWNAIR (Continued)

S112835910

Contact: JULIE HARLESS
Telephone: 8582771453
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD008252405
TSD County: Los Angeles
Waste Category: Other organic solids
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.5875
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
45 additional CA_HAZNET: record(s) in the EDR Site Report.

D18
Target
Property

CROWNAIR
3753 JOHN J. MONTGOMERY D
SAN DIEGO, CA

CA RGA LUST **S114608078**
N/A

Site 3 of 17 in cluster D

Actual: RGA LUST:
412 ft. 1995 CROWNAIR 3753 JOHN J. MONTGOMERY D
Focus Map:
1

D19
Target
Property

CROWNAIR
3753 MONTGOMERY DR.
SAN DIEGO, CA

CA RGA LUST **S114608081**
N/A

Site 4 of 17 in cluster D

Actual: RGA LUST:
412 ft. 1992 CROWNAIR 3753 MONTGOMERY DR.
Focus Map:
1

CA RGA LUST S114608079
N/A

Site 5 of 17 in cluster D

Actual: RGA LUST: 2002 CROWNAIR 3753 JOHN J. MONTGOMERY
412 ft.
Focus Map:
1

CA RGA LUST S114608080
N/A

Site 6 of 17 in cluster D

Actual:	1994	CROWNAIR	3753 JOHN MONTGOMERY DR.
412 ft.	1993	CROWNAIR	3753 JOHN MONTGOMERY DR.
Focus Map:			
1			

CA RGA LUST S114608077
N/A

Site 7 of 17 in cluster D

Actual:	RGA LUST:			
412 ft.		2001	CROWNAIR	3753 JOHN J. MONTGOMERY DR
		2000	CROWNAIR	3753 JOHN J. MONTGOMERY DR
Focus Map:		1998	CROWNAIR	3753 JOHN J. MONTGOMERY DR
1		1997	CROWNAIR	3753 JOHN J. MONTGOMERY DR
		1996	CROWNAIR	3753 JOHN J. MONTGOMERY DR

RCRA-SQG 1000905018
CA0000269506

Site 8 of 17 in cluster D

Actual:	RCRA-SQG:	
412 ft.	Date form received by agency:	04/26/1994
Focus Map:	Facility name:	AIR 88 INC DBA CROWNAIR
1	Facility address:	3753 J J MONTGOMERY DR SAN DIEGO, CA 92123-1795
	EPA ID:	CA0000269506
	Mailing address:	J J MONTGOMERY DR SAN DIEGO, CA 92123-1795
	Contact:	THOMAS NOLAN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AIR 88 INC DBA CROWNAIR (Continued)

1000905018

Contact address: 3753 J J MONTGOMERY DR
SAN DIEGO, CA 92123-1795
Contact country: US
Contact telephone: 619-277-1453
Contact email: Not reported
EPA Region: 09
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: AIR 88 INC DBA CROWNAIR
Owner/operator address: 3753 J J MONTGOMERY DR
SAN DIEGO, CA 92123
Owner/operator country: Not reported
Owner/operator telephone: 619-277-1453
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

D24 CROWNAIR
Target 3753 JOHN J MONTGOMERY DR
Property SAN DIEGO, CA

CA RGA LUST S114608075
N/A

Site 9 of 17 in cluster D

Actual:
412 ft.

RGA LUST:

Focus Map:
1

2012	CROWNAIR	3753 JOHN J MONTGOMERY DR
2011	CROWNAIR	3753 JOHN J MONTGOMERY DR
2010	CROWNAIR	3753 JOHN J MONTGOMERY DR
2009	CROWNAIR	3753 JOHN J MONTGOMERY DR
2008	CROWNAIR	3753 JOHN J MONTGOMERY DR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

S114608075

2007	CROWNAIR	3753 JOHN J MONTGOMERY DR
2007	CROWNAIR	3753 JOHN J MONTGOMERY DR
2007	CROWNAIR	3753 JOHN J MONTGOMERY DR
2007	CROWNAIR	3753 JOHN J MONTGOMERY DR
2006	CROWNAIR	3753 JOHN J MONTGOMERY DR
2005	CROWNAIR	3753 JOHN J MONTGOMERY DR
2003	CROWNAIR	3753 JOHN J MONTGOMERY DR

D25
Target
Property

CROWNAIR
3753 JOHN J MONTGOMERY
SAN DIEGO, CA

CA RGA LUST
S114608076
N/A

Site 10 of 17 in cluster D

Actual:
412 ft.

Focus Map:
1

RGALUST:
2004 CROWNAIR 3753 JOHN J MONTGOMERY

D26
Target
Property

CRITICAL AIR MEDICINE, INC.
3753 JOHN J MONTGOMERY DR 34
SAN DIEGO, CA 92123

CA San Diego Co. HMMD
S121516822
N/A

Site 11 of 17 in cluster D

Actual:
412 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number:	Not reported
Business Type:	Not reported
EPA Id Number:	Not reported
APN:	Not reported
Last HMMD Inspection:	Not reported
Facility Telephone:	8583000224
Permit Status:	Permit Renewed
Permit Expiration:	Not reported
Date Last Updated:	03/23/2018
Facility Owner:	Not reported
Facility Mailing Address:	PO BOX 23699 , San Diego, CA 92193
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
UST Owner:	N
Handle Regulated Hazmat:	Not reported
Own Or Operate UST:	Not reported
Subject To APSA:	Not reported
Generate Haz Waste:	N
Treat Haz Waste:	N
Generate Medical Waste:	Not reported

Waste and Materials:

Record ID:	DEH2016-HUPFP-003202
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0128610
Trade Secret:	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CRITICAL AIR MEDICINE, INC. (Continued)

S121516822

Hazardous Material Type: Pure
Last Updated: 2018-03-23T02:32:50.000
Chemical Name: Oxygen
Common Name: Oxygen
Case Number: 7782-44-7

D27 **SHIER AVIATION CORPORATION**
Target **3753 JOHN J MONTGOMERY DR SUITE 2**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S113465225**
N/A

Site 12 of 17 in cluster D

Actual:
412 ft.

Focus Map:
1

HAZNET:

Facility Name: SHIER AVIATION CORPORATION
envid: S113465225
Year: 2017
GEPAID: CAL000203338
Contact: ROBERT ROMERO
Telephone: 8585055650
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR STE 2
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAT080013352
TSD County: Los Angeles
Waste Category: Unspecified organic liquid mixture
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 0.374
Cat Decode: Unspecified organic liquid mixture
Method Decode: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Facility County: San Diego

envid: S113465225
Year: 2016
GEPAID: CAL000203338
Contact: JOHN GUTIERREZ
Telephone: 8585055650
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR STE 2
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAT080013352
TSD County: Los Angeles
Waste Category: Unspecified organic liquid mixture
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 0.187
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113465225
Year: 2016
GEPAID: CAL000203338
Contact: JOHN GUTIERREZ

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHIER AVIATION CORPORATION (Continued)

S113465225

Telephone: 8585055650
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR STE 2
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD097030993
TSD County: Los Angeles
Waste Category: Other organic solids
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.1
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113465225
Year: 2015
GEPAID: CAL000203338
Contact: JOHN GUTIERREZ
Telephone: 8585055650
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR STE 2
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD097030993
TSD County: Los Angeles
Waste Category: Other organic solids
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.05
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113465225
Year: 2015
GEPAID: CAL000203338
Contact: JOHN GUTIERREZ
Telephone: 8585055650
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR STE 2
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAT080013352
TSD County: Los Angeles
Waste Category: Unspecified organic liquid mixture
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 0.374
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
7 additional CA_HAZNET: record(s) in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

D28
Target
Property

CROWNAIR
3753 JOHN J MONTGOMERY DR
SAN DIEGO, CA 92123

Site 13 of 17 in cluster D

Actual:
412 ft.

Focus Map:
1

CA LUST
CA SAN DIEGO CO. SAM
CA CPS-SLIC
CA UST
CA AST
CA San Diego Co. HMMD
CA SWEEPS UST
CA HIST UST
CA HIST CORTESE
CA SAN DIEGO CO LOP

U001573207
N/A

LUST REG 9:

Region: 9
Status: Case Closed
Case Number: 9UT887
Local Case: H00465-002
Substance: Waste Oil
Qty Leaked: Not reported
Abate Method: Excavate and Dispose - remove contaminated soil and dispose in approved site
Local Agency: San Diego
How Found: Other Means
How Stopped: Close Tank
Source: Unknown
Cause: Unknown
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 01/26/1988
Date Stopped: 01/27/1988
Confirm Date: 01/27/1988
Submit Workplan: Not reported
Prelim Assess: 01/27/1988
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 01/27/1988
Enforce Date: Not reported
Closed Date: 4/5/88
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: Not reported
Beneficial Use: Not reported
NPDES Number: Not reported
Priority: Low priority. Priority ranking can change over time.
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

LUST:

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T06019751361
Global Id: T06019751361
Latitude: 32.812314
Longitude: -117.140513
Status: Completed - Case Closed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Status Date: 10/03/2006
Case Worker: Not reported
RB Case Number: Not reported
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H00465-004
Potential Media Affect: Soil
Potential Contaminants of Concern: Aviation
Site History: Not reported

LUST:

Global Id: T06019751361
Action Type: Other
Date: 10/25/2005
Action: Leak Reported

Global Id: T06019751361
Action Type: Other
Date: 10/12/2004
Action: Leak Began

Global Id: T06019751361
Action Type: Other
Date: 10/12/2004
Action: Leak Discovery

Global Id: T06019751361
Action Type: ENFORCEMENT
Date: 11/02/2005
Action: Notice of Responsibility

LUST:

Global Id: T06019751361
Status: Completed - Case Closed
Status Date: 10/03/2006

Global Id: T06019751361
Status: Open - Case Begin Date
Status Date: 10/12/2004

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607300944
Global Id: T0607300944
Latitude: 32.811684
Longitude: -117.1401613
Status: Completed - Case Closed
Status Date: 06/20/1993
Case Worker: Not reported
RB Case Number: 9UT2174
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H00465-003
Potential Media Affect: Other Groundwater (uses other than drinking water)
Potential Contaminants of Concern: Aviation
Site History: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

LUST:

Global Id: T0607300944
Action Type: Other
Date: 05/25/1992
Action: Leak Reported

Global Id: T0607300944
Action Type: Other
Date: 05/25/1992
Action: Leak Began

Global Id: T0607300944
Action Type: Other
Date: 05/25/1992
Action: Leak Discovery

Global Id: T0607300944
Action Type: ENFORCEMENT
Date: 02/13/1992
Action: Notice of Responsibility

Global Id: T0607300944
Action Type: Other
Date: 05/25/1992
Action: Leak Stopped

LUST:

Global Id: T0607300944
Status: Completed - Case Closed
Status Date: 06/20/1993

Global Id: T0607300944
Status: Open - Case Begin Date
Status Date: 02/13/1992

SAN DIEGO CO. SAM:

Case Number: H00465-001
Agency: DEH Site Assessment & Mitigation
Funding: **Non Billable**
Facility Type: Failed Integrity Test
Facility Status: Closed Case
Date: 2/3/1988
Date Began: 6/26/1987

Case Number: H00465-002
Agency: DEH Site Assessment & Mitigation
Funding: **Private - VAP**
Facility Type: Soils Only
Facility Status: Closed Case
Date: 4/5/1988
Date Began: 1/27/1988

Case Number: H00465-003
Agency: DEH Site Assessment & Mitigation
Funding: **LOP - Federal Fund**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Facility Type: GW With No Beneficial Use Designation
Facility Status: Closed Case
Date: 6/20/1993
Date Began: 5/25/1992

Case Number: H00465-004
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: Soils Only
Facility Status: Closed Case
Date: 10/3/2006
Date Began: 10/12/2004

CPS-SLIC:

Region: STATE
Facility Status: Completed - Case Closed
Status Date: 02/03/1988
Global Id: T0608162352
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H00465-001
Latitude: 32.812314
Longitude: -117.140513
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Under Investigation
Potential Contaminants of Concern: Aviation
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

Region: STATE
Facility Status: Completed - Case Closed
Status Date: 04/05/1988
Global Id: T0607303130
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H00465-002
Latitude: 32.813004
Longitude: -117.142872
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: 9UT887
File Location: Local Agency
Potential Media Affected: Soil
Potential Contaminants of Concern: Waste Oil / Motor / Hydraulic / Lubricating
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

UST:

Facility ID: H00465
Permitting Agency: SAN DIEGO COUNTY
Latitude: 32.814353

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Longitude: -117.141523

AST:

Certified Unified Program Agencies: Not reported
Owner: AIR 88 INC. DBA CROWNAIR AVIAITON
Total Gallons: Not reported
CERSID: 10390327
Facility ID: 37-000-100465
Business Name: AIR 88, INC. DBA CROWNAIR AVIATION
Phone: 858-277-1453
Fax: 8582771937
Mailing Address: 3753 JOHN J MONTGOMERY DR
Mailing Address City: SAN DIEGO
Mailing Address State: CA
Mailing Address Zip Code: Not reported
Operator Name: AIR 88, INC. DBA CROWNAIR AVIATION
Operator Phone: 8582771453
Owner Phone: 8582771453
Owner Mail Address: 3753 JOHN J MONTGOMERY DR
Owner State: CA
Owner Zip Code: 92123
Owner Country: United States
Property Owner Name: CITY OF SAN DIEGO
Property Owner Phone: Not reported
Property Owner Mailing Address: Not reported
Property Owner City: Not reported
Property Owner Stat : Not reported
Property Owner Zip Code: 0
Property Owner Country: United States
EPAID: CA0000269506

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CA0000269506
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 858-277-1453
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 05/08/2018
Facility Owner: Not reported
Facility Mailing Address: 3753 JOHN J MONTGOMERY DR, SAN DIEGO, CA 92123-1732
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: Y
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Active Permit: Y
Facility Id Number: 37-000-100465
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5037902
Return To Compliance Date: 2015-04-15T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 15738
Container/Tank Id: Not reported
Last Update: 2018-07-27T07:15:10.000
Inspection Date: 2015-04-15T00:00:00.000
Violation Code: 2030054 Failure to comply with one or more of the following: maintain the spill bucket in good condition, containment free of debris/liquid, and/or to remove the contents of the spill bucket when a release/leak/spill was observed. 23 CCR 16 2635(b), 2715(c)(2).

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100465
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5402167
Return To Compliance Date: 2016-05-20T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-07-27T07:15:10.000
Inspection Date: 2016-04-15T11:38:00.000
Violation Code: 1010008 HMBP not certified annually as complete and accurate in CERS. HSC 25508.2

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100465
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5645926
Return To Compliance Date: 2017-04-21T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 15737
Container/Tank Id: Not reported
Last Update: 2018-07-27T07:15:10.000
Inspection Date: 2017-04-11T17:17:00.000
Violation Code: 2030025 (RD) Failure of the pressurized piping to meet one or more of the following requirements: monitored at least hourly with the capability of detecting a release of 3.0 gallons per hour, and will restrict the flow or product through the piping or trigger an alarm when a release occurs. 23 CCR 2636(f)(2)

UST DTL:
Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Active Permit: Y
Facility Id Number: 37-000-100465
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: MYF HOLDINGS, LLC DBA CROWNAIR AVIATION
Tankid: 15738
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2018-07-27T07:15:10.000
Tank Capacityin Gallons: 20000
Tank Contents: Aviation Gas
Type Of Tank: Double Wall

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100465
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: MYF HOLDINGS, LLC DBA CROWNAIR AVIATION
Tankid: 15737
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2018-07-27T07:15:10.000
Tank Capacityin Gallons: 20000
Tank Contents: Jet Fuel
Type Of Tank: Double Wall

Waste and Materials:

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140959
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T02:31:57.000
Chemical Name: AVIATION FUEL
Common Name: UNDERGROUND TANK 100465 T006
Case Number: Not reported

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140960
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T02:31:57.000
Chemical Name: AEROSHELL OIL W MULTIGRADE 15W-50
Common Name: AEROSHELL OIL W MULTIGRADE 15W-50
Case Number: 68937-40-6

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140961

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T02:31:57.000
Chemical Name: VISTA LPA-142 SOLVENT
Common Name: VISTA LPA-142 SOLVENT
Case Number: 64742-47-8

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140967
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T02:31:57.000
Chemical Name: Diesel Fuel
Common Name: Diesel Fuel
Case Number: 68334-30-5

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119542
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T02:31:57.000
Chemical Name: WASTE 213 HYDROCARBON SOLVENTS
Common Name: VISTA LPA 142 SYSTEM 1 PARTS WASHER, NAPTHA SOLVENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119543
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T02:31:57.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: FUEL FILTERS/ABSORBENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140962
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T02:31:57.000
Chemical Name: JP4 JET FUEL
Common Name: UNDERGROUND TANK 100465 T005
Case Number: Not reported

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140963
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Last Updated: 2018-01-31T02:31:57.000
Chemical Name: NITROGEN, N2, 99%, COMPRESSED GAS
Common Name: NITROGEN, N2, 99%, COMPRESSED GAS
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140964
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T02:31:57.000
Chemical Name: OXYGEN, O2, 99%, COMPRESSED GAS
Common Name: OXYGEN, O2, 99%, COMPRESSED GAS
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140965
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T02:31:57.000
Chemical Name: KEROSENE/PETROLEUM DISTILLATE FUEL
Common Name: Jet A
Case Number: 8008-20-6

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140966
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T02:31:57.000
Chemical Name: GASOLINE
Common Name: Avgas 100ll
Case Number: 86290-81-5

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119544
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T02:31:57.000
Chemical Name: WASTE 172 METAL DUST & MACHINING WASTE
Common Name: BEADBLASTER DUST W/METALS (MISSION ABRASIVE)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119545
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T02:31:57.000
Chemical Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Common Name:	AVIATION FUEL
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100465
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0182293
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-27T07:15:10.000
Chemical Name:	JP4 JET FUEL
Common Name:	UNDERGROUND TANK 100465 T005
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100465
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0182294
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-27T07:15:10.000
Chemical Name:	NITROGEN, N2, 99%, COMPRESSED GAS
Common Name:	NITROGEN, N2, 99%, COMPRESSED GAS
Case Number:	7727-37-9
Record ID:	DEH2002-HUPFP-100465
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0182296
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-07-27T07:15:10.000
Chemical Name:	KEROSENE/PETROLEUM DISTILLATE FUEL
Common Name:	Jet A
Case Number:	8008-20-6
Record ID:	DEH2002-HUPFP-100465
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0119546
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-01-31T02:31:57.000
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL
Common Name:	USED OIL
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100465
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0156455
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-07-27T07:15:10.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name:	FUEL FILTERS/ABSORBENT
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0182295
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-27T07:15:10.000
Chemical Name: OXYGEN, 02, 99%, COMPRESSED GAS
Common Name: OXYGEN, 02, 99%, COMPRESSED GAS
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0182297
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-27T07:15:10.000
Chemical Name: GASOLINE
Common Name: Avgas 100ll
Case Number: 86290-81-5

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0182298
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-27T07:15:10.000
Chemical Name: Diesel Fuel
Common Name: Diesel Fuel
Case Number: 68334-30-5

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0156454
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-27T07:15:10.000
Chemical Name: WASTE 213 HYDROCARBON SOLVENTS
Common Name: VISTA LPA 142 SYSTEM 1 PARTS WASHER, NAPTHA SOLVENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0156456
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-27T07:15:10.000
Chemical Name: WASTE 172 METAL DUST & MACHINING WASTE
Common Name: BEADBLASTER DUST W/METALS (MISSION ABRASIVE)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100465
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0156458
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-07-27T07:15:10.000
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL
Common Name:	USED OIL
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100465
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0182290
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-27T07:15:10.000
Chemical Name:	AVIATION FUEL
Common Name:	UNDERGROUND TANK 100465 T006
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100465
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0182291
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-27T07:15:10.000
Chemical Name:	AEROSHELL OIL W MULTIGRADE 15W-50
Common Name:	AEROSHELL OIL W MULTIGRADE 15W-50
Case Number:	68937-40-6
Record ID:	DEH2002-HUPFP-100465
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0182292
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-27T07:15:10.000
Chemical Name:	VISTA LPA-142 SOLVENT
Common Name:	VISTA LPA-142 SOLVENT
Case Number:	64742-47-8
Record ID:	DEH2002-HUPFP-100465
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0156457
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-07-27T07:15:10.000
Chemical Name:	WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Common Name:	AVIATION FUEL
Case Number:	Not reported
Permit Number:	100465
Business Type:	6HK29
EPA Id Number:	CA0000269506

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

APN: 421-290-11-00
Last HMMI Inspection: 04/27/2012
Facility Telephone: 858-277-1453
Permit Status: OPEN
Permit Expiration: 02/28/2013
Date Last Updated: 11/02/2012
Facility Owner: CROWN AIR AVIATION
Facility Mailing Address: 3753 JOHN J MONTGOMERY DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1732
UST Owner: AIRLINE TRAINING CENTER
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Y
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: AEROSHELL OIL W 100
Other Information: 100W OIL
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: AEROSHELL OIL W MULTIGRADE 15W-50
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: AVIATION FUEL
Other Information: UNDERGROUND TANK 100465 T006
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Material Waste: Not reported
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Case Number: Not reported
Name: JP4 JET FUEL
Other Information: UNDERGROUND TANK 100465 T005
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN, N2, 99%, COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 100465
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN, O2, 99%, COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100465
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN, O2; ACETYLENE, C2H2 :
Other Information: COMPRESSED GASES, CUTTING TORCH
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100465
Update Date: 11/02/2012
Case Number: 64742-47-8
Name: VISTA LPA-142 SOLVENT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 172 METAL DUST & MACHINING WASTE
Other Information: BEADBLASTER DUST W/METALS (MISSION ABRASIVE)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: 8032-32-4
Name: WASTE 213 HYDROCARBON SOLVENTS
Other Information: VISTA LPA 142 SYSTEM 1 PARTS WASHER, NAPHTHA SOLVENT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	USED OIL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE
Other Information:	WASTE OIL/DEGREASER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information:	AVIATION FUEL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information:	FUEL FILTERS/ABSORBENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 444 USED BATTERIES
Other Information:	INTERSTATE BATTERY
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 888 USED OIL FILTERS
Other Information:	TO VORTEX - GAS & OIL FILTERS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Violations Active Permits:

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/28/2010
Violation Code: 6HV3262
Violation: SEC CONT PIPING DRAINAGE OBSTRUCTED
Violation Citation: Secondary containment piping obstructed preventing drainage to sump.
2632
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/28/2010
Violation Code: 6HV3262
Violation: SEC CONT PIPING DRAINAGE OBSTRUCTED
Violation Citation: Secondary containment piping obstructed preventing drainage to sump.
2632
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/28/2010
Violation Code: 6HV3115
Violation: NO 2NDARY CONTAINMT. TEST/REPAIRS
Violation Citation: Secondary containment testing not completed (passed) for all
components &/or repairs to secondary containment components not
completed. 25284.1, 25291(a)(2); 2637
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/28/2010
Violation Code: 6HV3193
Violation: NO TRAINING/RECORD INCOMPLETE-NOT ONSITE
Violation Citation: Facility employee(s) are not trained, training records are incomplete,
and/or not onsite. 2715(f)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 05/27/2011
Violation Code: 6HV3116
Violation: NO YRLY CERT. FOR CONTIN. MONITOR
Violation Citation: Annual certification for continuous monitoring system not completed
(new tanks). 25284.1(a)(4)(C); 2630(d), 2638
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 06/05/2003
Violation Code: 6HV3103
Violation: NO UST PLAN CHECK PERMIT OBTAINED
Violation Citation: UST repair/modify/closure permit not obtained .68.1004, 68.1005,
68.1009.5
Activity: ACTIVE

Permit Number: 100465

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Update Date: 11/02/2012
Inspection Date: 06/05/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 06/05/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 06/23/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/24/2009
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR 262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/24/2009
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/27/2012
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/27/2012
Violation Code: 6HV3114
Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/03/2006
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 100465 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: SINGLE WALL
Additional Id: 100 OCT. I
Capacity Gallons: 12000
UST Contents: Not reported
Other Content Info: INVALID CODE
Reg Status: REMOVED
Remove Close Date: 1992-05-26 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY MONTHLY, TANK TEST BIENNIALLY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 100465 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: UNKNOWN
Additional Id: WASTE I
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1988-12-02 00:00:00
Year Installed: 1968-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 100465 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: SINGLE WALL
Additional Id: JET I
Capacity Gallons: 14000
UST Contents: Not reported
Other Content Info: INVALID CODE
Reg Status: REMOVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Remove Close Date: 1992-05-26 00:00:00
Year Installed: 1976-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 100465 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: SINGLE WALL
Additional Id: 100 OCT. I
Capacity Gallons: 12000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: REMOVED
Remove Close Date: 1992-05-26 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 100465 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: DOUBLE WALL
Additional Id: NT1606, RT2692
Capacity Gallons: 20000
UST Contents: JET FUEL
Other Content Info: JET FUEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1992-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 29A
UST Monitor Method: DW TANKS W/DRY ANNULAR; DW PRESSURIZED ABOVEGROUND PIPE W/ POSITIVE
SHUT-OFF & FAILSAFE 3.0LLD; NO UDC

UST Name: UNDERGROUND TANK 100465 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: DOUBLE WALL
Additional Id: NT1606, RT2692
Capacity Gallons: 20000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1992-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 29A
UST Monitor Method: DW TANKS W/DRY ANNULAR; DW PRESSURIZED ABOVEGROUND PIPE W/ POSITIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

SHUT-OFF & FAILSAFE 3.0LLD; NO UDC

Permit Number: 100465
Business Type: 6HK29
EPA Id Number: CA0000269506
APN: 421-290-11-00
Last HMMI Inspection: 04/27/2012
Facility Telephone: 858-277-1453
Permit Status: OPEN
Permit Expiration: 02/28/2013
Date Last Updated: 11/02/2012
Facility Owner: CROWN AIR AVIATION
Facility Mailing Address: 3753 JOHN J MONTGOMERY DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1732
UST Owner: AIRLINE TRAINING CENTER
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: AEROSHELL OIL W 100
Other Information: 100W OIL
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: AEROSHELL OIL W MULTIGRADE 15W-50
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: AVIATION FUEL
Other Information: UNDERGROUND TANK 100465 T006
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Material Waste:	Not reported
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	JP4 JET FUEL
Other Information:	UNDERGROUND TANK 100465 T005
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	7727-37-9
Name:	NITROGEN, N2, 99%, COMPRESSED GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	7782-44-7
Name:	OXYGEN, O2, 99%, COMPRESSED GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	PRESSURE RELEASE
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	7782-44-7
Name:	OXYGEN, O2; ACETYLENE, C2H2 :
Other Information:	COMPRESSED GASES, CUTTING TORCH
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	PRESSURE RELEASE
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	64742-47-8
Name:	VISTA LPA-142 SOLVENT
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 172 METAL DUST & MACHINING WASTE
Other Information:	BEADBLASTER DUST W/METALS (MISSION ABRASIVE)
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Permit Number: 100465
Update Date: 11/02/2012
Case Number: 8032-32-4
Name: WASTE 213 HYDROCARBON SOLVENTS
Other Information: VISTA LPA 142 SYSTEM 1 PARTS WASHER, NAPTHA SOLVENT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: USED OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE
Other Information: WASTE OIL/DEGREASER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information: AVIATION FUEL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: FUEL FILTERS/ABSORBENT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 444 USED BATTERIES
Other Information: INTERSTATE BATTERY
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Name: WASTE 888 USED OIL FILTERS
Other Information: TO VORTEX - GAS & OIL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/28/2010
Violation Code: 6HV3262
Violation: SEC CONT PIPING DRAINAGE OBSTRUCTED
Violation Citation: Secondary containment piping obstructed preventing drainage to sump.
2632
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/28/2010
Violation Code: 6HV3262
Violation: SEC CONT PIPING DRAINAGE OBSTRUCTED
Violation Citation: Secondary containment piping obstructed preventing drainage to sump.
2632
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/28/2010
Violation Code: 6HV3115
Violation: NO 2NDARY CONTAINMT. TEST/REPAIRS
Violation Citation: Secondary containment testing not completed (passed) for all components &/or repairs to secondary containment components not completed. 25284.1, 25291(a)(2); 2637
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/28/2010
Violation Code: 6HV3193
Violation: NO TRAINING/RECORD INCOMPLETE-NOT ONSITE
Violation Citation: Facility employee(s) are not trained, training records are incomplete, and/or not onsite. 2715(f)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 05/27/2011
Violation Code: 6HV3116
Violation: NO YRLY CERT. FOR CONTIN. MONITOR
Violation Citation: Annual certification for continuous monitoring system not completed (new tanks). 25284.1(a)(4)(C); 2630(d), 2638
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 06/05/2003
Violation Code: 6HV3103

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Violation: NO UST PLAN CHECK PERMIT OBTAINED
Violation Citation: UST repair/modify/closure permit not obtained .68.1004, 68.1005, 68.1009.5
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 06/05/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 06/05/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 06/23/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/24/2009
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR 262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/24/2009
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/27/2012
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/27/2012
Violation Code: 6HV3114
Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA
Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/03/2006
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 100465 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: SINGLE WALL
Additional Id: 100 OCT. I
Capacity Gallons: 12000
UST Contents: Not reported
Other Content Info: INVALID CODE
Reg Status: REMOVED
Remove Close Date: 1992-05-26 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 100465 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: UNKNOWN
Additional Id: WASTE I
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1988-12-02 00:00:00
Year Installed: 1968-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 100465 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: SINGLE WALL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Additional Id: JET I
Capacity Gallons: 14000
UST Contents: Not reported
Other Content Info: INVALID CODE
Reg Status: REMOVED
Remove Close Date: 1992-05-26 00:00:00
Year Installed: 1976-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 100465 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: SINGLE WALL
Additional Id: 100 OCT. I
Capacity Gallons: 12000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: REMOVED
Remove Close Date: 1992-05-26 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 100465 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: DOUBLE WALL
Additional Id: NT1606, RT2692
Capacity Gallons: 20000
UST Contents: JET FUEL
Other Content Info: JET FUEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1992-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 29A
UST Monitor Method: DW TANKS W/ DRY ANNULAR; DW PRESSURIZED ABOVEGROUND PIPE W/ POSITIVE
SHUT-OFF & FAILSAFE 3.0LLD; NO UDC

UST Name: UNDERGROUND TANK 100465 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: DOUBLE WALL
Additional Id: NT1606, RT2692
Capacity Gallons: 20000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: ACTIVE
Remove Close Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Year Installed: 1992-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 29A
UST Monitor Method: DW TANKS W/DRY ANNULAR; DW PRESSURIZED ABOVEGROUND PIPE W/ POSITIVE SHUT-OFF & FAILSAFE 3.0LLD; NO UDC

Permit Number: 100465
Business Type: 6HK29
EPA Id Number: CA0000269506
APN: 421-290-11-00
Last HMMI Inspection: 04/27/2012
Facility Telephone: 858-277-1453
Permit Status: OPEN
Permit Expiration: 02/28/2013
Date Last Updated: 11/02/2012
Facility Owner: CROWN AIR AVIATION
Facility Mailing Address: 3753 JOHN J MONTGOMERY DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1732
UST Owner: AIRLINE TRAINING CENTER
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: AEROSHELL OIL W 100
Other Information: 100W OIL
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: AEROSHELL OIL W MULTIGRADE 15W-50
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: AVIATION FUEL
Other Information: UNDERGROUND TANK 100465 T006
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Material Waste: Not reported
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: JP4 JET FUEL
Other Information: UNDERGROUND TANK 100465 T005
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN, N2, 99%, COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 100465
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN, O2, 99%, COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100465
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN, O2; ACETYLENE, C2H2 :
Other Information: COMPRESSED GASES, CUTTING TORCH
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100465
Update Date: 11/02/2012
Case Number: 64742-47-8
Name: VISTA LPA-142 SOLVENT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Name:	WASTE 172 METAL DUST & MACHINING WASTE
Other Information:	BEADBLASTER DUST W/METALS (MISSION ABRASIVE)
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	8032-32-4
Name:	WASTE 213 HYDROCARBON SOLVENTS
Other Information:	VISTA LPA 142 SYSTEM 1 PARTS WASHER, NAPTHA SOLVENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	USED OIL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE
Other Information:	WASTE OIL/DEGREASER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information:	AVIATION FUEL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information:	FUEL FILTERS/ABSORBENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100465
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 444 USED BATTERIES
Other Information:	INTERSTATE BATTERY
Material Waste:	Waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100465
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: TO VORTEX - GAS & OIL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/28/2010
Violation Code: 6HV3262
Violation: SEC CONT PIPING DRAINAGE OBSTRUCTED
Violation Citation: Secondary containment piping obstructed preventing drainage to sump.
2632
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/28/2010
Violation Code: 6HV3262
Violation: SEC CONT PIPING DRAINAGE OBSTRUCTED
Violation Citation: Secondary containment piping obstructed preventing drainage to sump.
2632
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/28/2010
Violation Code: 6HV3115
Violation: NO 2NDARY CONTAINMT. TEST/REPAIRS
Violation Citation: Secondary containment testing not completed (passed) for all components &/or repairs to secondary containment components not completed. 25284.1, 25291(a)(2); 2637
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/28/2010
Violation Code: 6HV3193
Violation: NO TRAINING/RECORD INCOMPLETE-NOT ONSITE
Violation Citation: Facility employee(s) are not trained, training records are incomplete, and/or not onsite. 2715(f)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 05/27/2011
Violation Code: 6HV3116
Violation: NO YRLY CERT. FOR CONTIN. MONITOR
Violation Citation: Annual certification for continuous monitoring system not completed (new tanks). 25284.1(a)(4)(C); 2630(d), 2638

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 06/05/2003
Violation Code: 6HV3103
Violation: NO UST PLAN CHECK PERMIT OBTAINED
Violation Citation: UST repair/modify/closure permit not obtained .68.1004, 68.1005, 68.1009.5

Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 06/05/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)

Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 06/05/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)

Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 06/23/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)

Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/24/2009
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR 262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]

Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/24/2009
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)

Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Inspection Date: 04/27/2012
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or
DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/27/2012
Violation Code: 6HV3114
Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA
Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent
to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 100465
Update Date: 11/02/2012
Inspection Date: 04/03/2006
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or
DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 100465 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: SINGLE WALL
Additional Id: 100 OCT. I
Capacity Gallons: 12000
UST Contents: Not reported
Other Content Info: INVALID CODE
Reg Status: REMOVED
Remove Close Date: 1992-05-26 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALLY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 100465 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: UNKNOWN
Additional Id: WASTE I
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1988-12-02 00:00:00
Year Installed: 1968-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 100465 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: SINGLE WALL
Additional Id: JET I
Capacity Gallons: 14000
UST Contents: Not reported
Other Content Info: INVALID CODE
Reg Status: REMOVED
Remove Close Date: 1992-05-26 00:00:00
Year Installed: 1976-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY

MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 100465 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: SINGLE WALL
Additional Id: 100 OCT. I
Capacity Gallons: 12000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: REMOVED
Remove Close Date: 1992-05-26 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY

MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 100465 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 100465
Tank Type: DOUBLE WALL
Additional Id: NT1606, RT2692
Capacity Gallons: 20000
UST Contents: JET FUEL
Other Content Info: JET FUEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1992-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 29A
UST Monitor Method: DW TANKS W/DRY ANNULAR; DW PRESSURIZED ABOVEGROUND PIPE W/ POSITIVE

SHUT-OFF & FAILSAFE 3.0LLD; NO UDC

UST Name: UNDERGROUND TANK 100465 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 100465

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Tank Type: DOUBLE WALL
Additional Id: NT1606, RT2692
Capacity Gallons: 20000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1992-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 29A
UST Monitor Method: DW TANKS W/DRY ANNULAR; DW PRESSURIZED ABOVEGROUND PIPE W/ POSITIVE SHUT-OFF & FAILSAFE 3.0LLD; NO UDC

SWEEPS UST:

Status: Active
Comp Number: 465
Number: 9
Board Of Equalization: 44-021563
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000465-000005
Tank Status: A
Capacity: 20000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: JET FUEL
Number Of Tanks: 2

Status: Active
Comp Number: 465
Number: 9
Board Of Equalization: 44-021563
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000465-000006
Tank Status: A
Capacity: 20000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: AVIA. GAS
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 465
Number: Not reported
Board Of Equalization: 44-021563
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000465-000001
Tank Status: Not reported
Capacity: 12000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: JET FUEL
Number Of Tanks: 4

Status: Not reported
Comp Number: 465
Number: Not reported
Board Of Equalization: 44-021563
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000465-000002
Tank Status: Not reported
Capacity: 550
Active Date: Not reported
Tank Use: PETROLEUM
STG: WASTE
Content: Not reported
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 465
Number: Not reported
Board Of Equalization: 44-021563
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000465-000003
Tank Status: Not reported
Capacity: 14000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: JET FUEL
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 465
Number: Not reported
Board Of Equalization: 44-021563
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000465-000004
Tank Status: Not reported
Capacity: 12000
Active Date: Not reported
Tank Use: M.V. FUEL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

STG: PRODUCT
Content: AVIA. GAS
Number Of Tanks: Not reported

HIST UST:

File Number: 0002AB1C
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002AB1C.pdf>
Region: STATE
Facility ID: 00000011152
Facility Type: Gas Station
Other Type: AVIATION
Contact Name: LEONARD H. HENKE
Telephone: 6192771453
Owner Name: AIRLINE TRAINING CENTER
Owner Address: 3753 JOHN J. MONTGOMERY DRIVE
Owner City,St,Zip: SAN DIEGO, CA 92123
Total Tanks: 0004

Tank Num: 001
Container Num: 100 OCT. I
Year Installed: Not reported
Tank Capacity: 00012000
Tank Used for: PRODUCT
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor, 10

Tank Num: 002
Container Num: WASTE I
Year Installed: 1968
Tank Capacity: 00000000
Tank Used for: WASTE
Type of Fuel: WASTE OIL
Container Construction Thickness: Not reported
Leak Detection: None

Tank Num: 003
Container Num: JET I
Year Installed: 1976
Tank Capacity: 00014000
Tank Used for: PRODUCT
Type of Fuel: 06
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor, 10

Tank Num: 004
Container Num: 100 OCT. I
Year Installed: Not reported
Tank Capacity: 00012000
Tank Used for: PRODUCT
Type of Fuel: 06
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor, 10

[Click here for Geo Tracker PDF:](#)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT887

SAN DIEGO CO LOP:

Record ID: DEH1992-LSAM-H00465-003
Record Status: Completed
Opened Date: 05/25/1992
Parcel Number: 421-290-11-00
Case Type: LOP - Local Oversight Program
Historical Name: CROWNAIR
SWRCB Global ID: T0607300944
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 05/25/1992
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 C 3
Latitude: 32.8145972
Longitude: -117.1412173
X MapCoord: 6287850.143
Y MapCoord: 1877338.887

Record ID: DEH2005-LSAM-H00465-004
Record Status: Completed
Opened Date: 10/25/2005
Parcel Number: 421-290-11-00
Case Type: LOP - Local Oversight Program
Historical Name: CROWNAIR
SWRCB Global ID: T06019751361
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 11/02/2005
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 C 3
Latitude: 32.8145972
Longitude: -117.1412173
X MapCoord: 6287850.143
Y MapCoord: 1877338.887

Record ID: DEH1987-LSAM-H00465-001
Record Status: Completed
Opened Date: 06/26/1987
Parcel Number: 421-290-11-00
Case Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWNAIR (Continued)

U001573207

Historical Name: CROWNAIR
SWRCB Global ID: T0608162352
Funding: N - Non-Billable
Lead Agency: DEH/SAM
Lead Agency Date: 06/30/1987
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 C 3
Latitude: 32.8145972
Longitude: -117.1412173
X MapCoord: 6287850.143
Y MapCoord: 1877338.887

D29
Target
Property

AIR 88 INC DBA CROWNAIR
3753 JOHN J MONTGOMERY DR
SAN DIEGO, CA 92123

FINDS **1007737300**
ECHO **N/A**

Site 14 of 17 in cluster D

Actual:
412 ft.

FINDS:

Focus Map:
1

Registry ID: 110018956842

Environmental Interest/Information System

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1007737300
Registry ID: 110018956842
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110018956842>

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

D30
Target
Property

SO PACIFIC CAPITOL
3753 JOHN J MONTGOMERY DR
SAN DIEGO, CA 92123

CA HAZNET **S112903522**
N/A

Site 15 of 17 in cluster D

Actual: HAZNET:
412 ft. Facility Name: SO PACIFIC CAPITOL
Focus Map: envid: S112903522
1 Year: 1999
GEPAID: CAC002204025
Contact: SO PACIFIC CAPITOL
Telephone: 0000000000
Mailing Name: Not reported
Mailing Address: 3753 JOHN J MONTGOMERY DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAD008252405
TSD County: Not reported
Waste Category: Unspecified organic liquid mixture
Disposal Method: Recycler
Tons: .1251
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

D31
Target
Property

MYF HOLDINGS, LLC DBA CROWNAIR AVIATION
3753 JOHN J MONTGOMERY DR
SAN DIEGO, CA 92123

CA UST **U004261876**
N/A

Site 16 of 17 in cluster D

Actual: UST:
412 ft. Facility ID: 37-000-100465
Focus Map: Permitting Agency: San Diego County Department of Environmental Health
1 Latitude: 32.81223
Longitude: -117.14001

D32
Target
Property

CROWNAIR
3753 JOHN J MONTGOMERY DR
SAN DIEGO, CA 92123

FINDS **1023349986**
N/A

Site 17 of 17 in cluster D

Actual: FINDS:
412 ft.
Focus Map: Registry ID: 110066462562
1 Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

E33 SDCTY-FIRE-RESCUE DEPT, AIR OPERATIONS DIVISION
Target 3750 JOHN J MONTGOMERY DR
Property SAN DIEGO, CA 92123

CA AST A100424303
N/A

Site 1 of 24 in cluster E

Actual:
412 ft.

AST:

Focus Map:
1

Certified Unified Program Agencies: Not reported
Owner: CITY OF SAN DIEGO
Total Gallons: Not reported
CERSID: 10390504
Facility ID: 37-000-205304
Business Name: City of San Diego
Phone: 858-573-1437
Fax: Not reported
Mailing Address: 1010 2ND AVE, SUITE 400/MS-604
Mailing Address City: SAN DIEGO
Mailing Address State: CA
Mailing Address Zip Code: 92101
Operator Name: SDCTY-FIRE-RESCUE DEPT
Operator Phone: 858-573-1437
Owner Phone: 858-573-1437
Owner Mail Address: 101 2ND AVE, SUITE 400/MS-604
Owner State: CA
Owner Zip Code: 92101
Owner Country: United States
Property Owner Name: CITY OF SAN DIEGO
Property Owner Phone: Not reported
Property Owner Mailing Address: Not reported
Property Owner City: Not reported
Property Owner Stat : Not reported
Property Owner Zip Code: 0
Property Owner Country: United States
EPAID: CAL00029334

E34 SDCTY-POLICENA AIR SUPPORT UNIT
Target 3750 JOHN J MONTGOMERY DR
Property SAN DIEGO, CA 92123

FINDS 1023350445
N/A

Site 2 of 24 in cluster E

Actual:
412 ft.

FINDS:

Focus Map:
1

Registry ID: 110066467594
Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

E35
Target
Property

MONTGOMERY FIELD
3750 JOHN J. MONTGOMERY
SAN DIEGO, CA

CA RGA LUST
S114656540
N/A

Site 3 of 24 in cluster E

Actual:
412 ft.

Focus Map:
1

RGA LUST:

2002	MONTGOMERY FIELD	3750 JOHN J. MONTGOMERY
1994	MONTGOMERY FIELD	3750 JOHN J. MONTGOMERY
1993	MONTGOMERY FIELD	3750 JOHN J. MONTGOMERY

E36
Target
Property

SDCTY- FIRE & RESCUE AIR OPS UNIT
3750 JOHN J MONTGOMERY DR
SAN DIEGO, CA 92123

CA San Diego Co. HMMD
S106880152
N/A

Site 4 of 24 in cluster E

Actual:
412 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number:	205304
Business Type:	6HK52
EPA Id Number:	CAL000293341
APN:	421-290-11-00
Last HMMD Inspection:	09/19/2012
Facility Telephone:	858-573-1437
Permit Status:	OPEN
Permit Expiration:	08/31/2013
Date Last Updated:	11/02/2012
Facility Owner:	CITY OF SAN DIEGO-FIRE & RESCUE DEPT
Facility Mailing Address:	1010 2ND AVE, #400 / MS-604
Facility Mailing City:	SAN DIEGO
Facility Mailing State:	CA
Facility Mailing Zip:	92101
UST Owner:	Not reported
Handle Regulated Hazmat:	Y
Own Or Operate UST:	Not reported
Subject To APSA:	Y
Generate Haz Waste:	Y
Treat Haz Waste:	Not reported
Generate Medical Waste:	Y

Inventory Active Permits (not SQG Medical):

Permit Number:	205304
Update Date:	11/02/2012
Case Number:	Not reported
Name:	AVGAS 100 LL
Other Information:	JET A
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE

Permit Number:	205304
Update Date:	11/02/2012
Case Number:	Not reported
Name:	AVIATION FUEL & WATER
Other Information:	JET FUEL TYPE A & WATER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported

Permit Number:	205304

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY- FIRE & RESCUE AIR OPS UNIT (Continued)

S106880152

Update Date: 11/02/2012
Case Number: Not reported
Name: BRAKE CLEAN
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 205304
Update Date: 11/02/2012
Case Number: Not reported
Name: CARBON REMOVER (PROPRIETARY)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 205304
Update Date: 11/02/2012
Case Number: Not reported
Name: CAR-N-TRUCK WASH
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 205304
Update Date: 11/02/2012
Case Number: 68476-85-7
Name: PROPANE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 205304
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: WASTE LUBRICATING OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 205304
Update Date: 11/02/2012
Inspection Date: 07/09/2010
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)

Activity: ACTIVE

Permit Number: 205304
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY- FIRE & RESCUE AIR OPS UNIT (Continued)

S106880152

Inspection Date: 10/10/2008
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank.
66262.34(f)
Activity: ACTIVE

Permit Number: 205304
Update Date: 11/02/2012
Inspection Date: 10/10/2008
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 205304
Update Date: 11/02/2012
Inspection Date: 01/09/2007
Violation Code: 6HV1015
Violation: EMPLOYEE TRAINING NOT ADEQUATE
Violation Citation: Did not have adequate employee training program 2732 &/or 25504(c)
Activity: ACTIVE

Permit Number: 205304
Update Date: 11/02/2012
Inspection Date: 01/09/2007
Violation Code: 6HV0149
Violation: NO RECEIPTS (3 YRS) FOR OIL/FUEL FILTERS
Violation Citation: Failed to keep disposal receipts (3 years) for drained used oil
filters and/or drained fuel filters. 25250.22 and 66266.130(c)(5)
Activity: ACTIVE

Permit Number: 205304
Business Type: 6HK52
EPA Id Number: CAL000293341
APN: 421-290-11-00
Last HMMI Inspection: 09/19/2012
Facility Telephone: 858-573-1437
Permit Status: OPEN
Permit Expiration: 08/31/2013
Date Last Updated: 11/02/2012
Facility Owner: CITY OF SAN DIEGO-FIRE & RESCUE DEPT
Facility Mailing Address: 1010 2ND AVE, #400 / MS-604
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92101
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Y

Inventory Active Permits (not SQG Medical):
Permit Number: 205304
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY- FIRE & RESCUE AIR OPS UNIT (Continued)

S106880152

Case Number:	Not reported
Name:	AVGAS 100 LL
Other Information:	JET A
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	205304
Update Date:	11/02/2012
Case Number:	Not reported
Name:	AVIATION FUEL & WATER
Other Information:	JET FUEL TYPE A & WATER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	205304
Update Date:	11/02/2012
Case Number:	Not reported
Name:	BRAKE CLEAN
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	205304
Update Date:	11/02/2012
Case Number:	Not reported
Name:	CARBON REMOVER (PROPRIETARY)
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	205304
Update Date:	11/02/2012
Case Number:	Not reported
Name:	CAR-N-TRUCK WASH
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	205304
Update Date:	11/02/2012
Case Number:	68476-85-7
Name:	PROPANE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	PRESSURE RELEASE
Permit Number:	205304
Update Date:	11/02/2012
Case Number:	8002-05-9
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	WASTE LUBRICATING OIL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY- FIRE & RESCUE AIR OPS UNIT (Continued)

S106880152

Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 205304
Update Date: 11/02/2012
Inspection Date: 07/09/2010
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)

Activity: ACTIVE

Permit Number: 205304
Update Date: 11/02/2012
Inspection Date: 10/10/2008
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)

Activity: ACTIVE

Permit Number: 205304
Update Date: 11/02/2012
Inspection Date: 10/10/2008
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174

Activity: ACTIVE

Permit Number: 205304
Update Date: 11/02/2012
Inspection Date: 01/09/2007
Violation Code: 6HV1015
Violation: EMPLOYEE TRAINING NOT ADEQUATE
Violation Citation: Did not have adequate employee training program 2732 &/or 25504(c)

Activity: ACTIVE

Permit Number: 205304
Update Date: 11/02/2012
Inspection Date: 01/09/2007
Violation Code: 6HV0149
Violation: NO RECEIPTS (3 YRS) FOR OIL/FUEL FILTERS
Violation Citation: Failed to keep disposal receipts (3 years) for drained used oil filters and/or drained fuel filters. 25250.22 and 66266.130(c)(5)

Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

E37
Target MONTGOMERY FIELD
Property 3750 JOHN J. MONTGOMERY DR
SAN DIEGO, CA

CA RGA LUST S114656538
N/A

Site 5 of 24 in cluster E

Actual: RGA LUST:
412 ft.
Focus Map:
1

2001	MONTGOMERY FIELD	3750 JOHN J. MONTGOMERY DR
2000	MONTGOMERY FIELD	3750 JOHN J. MONTGOMERY DR
1998	MONTGOMERY FIELD	3750 JOHN J. MONTGOMERY DR
1997	MONTGOMERY FIELD	3750 JOHN J. MONTGOMERY DR
1996	MONTGOMERY FIELD	3750 JOHN J. MONTGOMERY DR
1994	MONTGOMERY FIELD	3750 JOHN J. MONTGOMERY DR

E38
Target 3750 JOHN J MONTGOMERY RD
Property SAN DIEGO, CA 92123

CA Notify 65 S100178078
N/A

Site 6 of 24 in cluster E

Actual: NOTIFY 65:
412 ft.
Focus Map:
1

Date Reported:	Not reported
Staff Initials:	Not reported
Board File Number:	Not reported
Facility Type:	Not reported
Discharge Date:	Not reported
Issue Date:	Not reported
Incident Description:	Not reported

E39
Target SDCTY-POLICE, AIR SUPPORT UNIT
Property 3750 JOHN J MONTGOMERY DR
SAN DIEGO, CA

CA RGA LUST S114684162
N/A

Site 7 of 24 in cluster E

Actual: RGA LUST:
412 ft.
Focus Map:
1

2012	SDCTY-POLICE, AIR SUPPORT UNIT	3750 JOHN J MONTGOMERY DR
2011	SDCTY-POLICE, AIR SUPPORT UNIT	3750 JOHN J MONTGOMERY DR
2010	SDCTY-POLICE, AIR SUPPORT UNIT	3750 JOHN J MONTGOMERY DR
2009	SDCTY-POLICE, AIR SUPPORT UNIT	3750 JOHN J MONTGOMERY DR
2008	SDCTY-POLICE, AIR SUPPORT UNIT	3750 JOHN J MONTGOMERY DR
2007	SDCTY-POLICE, AIR SUPPORT UNIT	3750 JOHN J MONTGOMERY DR
2007	SDCTY-POLICE, AIR SUPPORT UNIT	3750 JOHN J MONTGOMERY DR
2006	SDCTY-POLICE, AIR SUPPORT UNIT	3750 JOHN J MONTGOMERY DR
2005	SDCTY-POLICE, AIR SUPPORT UNIT	3750 JOHN J MONTGOMERY DR

E40
Target CITY OF SAN DIEGO-MONTGMRY
Property 3750 JOHN J MONTGOMERY
SAN DIEGO, CA

CA RGA LUST S114603305
N/A

Site 8 of 24 in cluster E

Actual: RGA LUST:
412 ft.
Focus Map:
1

2004	CITY OF SAN DIEGO-MONTGMRY	3750 JOHN J MONTGOMERY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

E41
Target
Property

MONTGOMERY DEMOLITION LANDFILL
3750 JOHN J. MONTGOMERY DRIVE
SAN DIEGO, CA

CA RGA LF
S114730496
N/A

Site 9 of 24 in cluster E

Actual:
412 ft.

RGA LF:

Focus Map:
1

2012	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
2011	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
2010	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
2009	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
2007	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
2006	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
2005	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
2004	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
2003	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
2002	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
2001	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
2000	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
1999	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
1998	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE
1997	MONTGOMERY DEMOLITION LANDFILL	3750 JOHN J. MONTGOMERY DRIVE

E42
Target
Property

3750 JOHN J. MONTGOMERY DRIVE
SAN DIEGO, CA 92123

ERNS
2014095572
N/A

Site 10 of 24 in cluster E

Actual:
412 ft.

Focus Map:
1

[Click this hyperlink](#) while viewing on your computer to access additional ERNS detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

E43 SDCTY-POLICE, AIR SUPPORT UNIT
Target 3750 JOHN J MONTGOMERY DR
Property SAN DIEGO, CA 92123

Site 11 of 24 in cluster E

Actual:
412 ft.

Focus Map:
1

CA SWF/LF U001573223
CA LUST N/A
CA SAN DIEGO CO. SAM
CA San Diego Co. HMM
CA SWEEPS UST
CA HIST UST
CA HIST CORTESE
CA NPDES
CA SAN DIEGO CO LOP
CA CIWQS

SWF/LF (SWIS):

Facility ID: 37-AA-0021
Lat/Long: 32.8117 / -117.1401
Owner Name: City of San Diego, Airports Division
Owner Telephone: 8585731441
Owner Address: Mike Tussey
Owner Address2: 3750 John J. Montgomery Dr., MS 14
Owner City,St,Zip: San Diego, CA 92123
Operational Status: Closed
Operator: Not reported
Operator Phone: Not reported
Operator Address: Not reported
Operator Address2: Not reported
Operator City,St,Zip: Not reported
Permit Date: Not reported
Permit Status: Not reported
Permitted Acreage: \$0.00
Activity: Solid Waste Disposal Site
Regulation Status: To Be Determined
Landuse Name: Not reported
GIS Source: Map
Category: Disposal
Unit Number: 01
Inspection Frequency: Annual
Accepted Waste: Not reported
Closure Date: Not reported
Closure Type: Not reported
Disposal Acreage: \$0.00
SWIS Num: 37-AA-0021
Waste Discharge Requirement Num: Not reported
Program Type: Not reported
Permitted Throughput with Units: 0
Actual Throughput with Units: Not reported
Permitted Capacity with Units: 0
Remaining Capacity: 0
Remaining Capacity with Units: Not reported
Lat/Long: 32.8117 / -117.1401

LUST:

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607300033
Global Id: T0607300033
Latitude: 32.8121479
Longitude: -117.1402007
Status: Completed - Case Closed
Status Date: 12/29/2006
Case Worker: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

RB Case Number: 9UT1011
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H21291-001
Potential Media Affect: Soil
Potential Contaminants of Concern: Aviation
Site History: Not reported

LUST:

Global Id: T0607300033
Action Type: Other
Date: 07/12/1988
Action: Leak Reported

Global Id: T0607300033
Action Type: Other
Date: 07/12/1988
Action: Leak Began

Global Id: T0607300033
Action Type: Other
Date: 07/12/1988
Action: Leak Discovery

Global Id: T0607300033
Action Type: ENFORCEMENT
Date: 11/07/2006
Action: Notice of Responsibility

Global Id: T0607300033
Action Type: Other
Date: 07/12/1988
Action: Leak Stopped

Global Id: T0607300033
Action Type: ENFORCEMENT
Date: 11/08/2006
Action: Notice of Responsibility

LUST:

Global Id: T0607300033
Status: Completed - Case Closed
Status Date: 12/29/2006

Global Id: T0607300033
Status: Open - Case Begin Date
Status Date: 07/12/1988

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607300722
Global Id: T0607300722
Latitude: 32.8121479
Longitude: -117.1402007
Status: Completed - Case Closed
Status Date: 04/26/2004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Case Worker: Not reported
RB Case Number: 9UT1945
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H21291-002
Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:

Global Id: T0607300722
Action Type: Other
Date: 03/01/1991
Action: Leak Reported

Global Id: T0607300722
Action Type: Other
Date: 02/26/1991
Action: Leak Began

Global Id: T0607300722
Action Type: Other
Date: 02/26/1991
Action: Leak Discovery

Global Id: T0607300722
Action Type: ENFORCEMENT
Date: 04/09/1991
Action: Notice of Responsibility

Global Id: T0607300722
Action Type: Other
Date: 02/26/1991
Action: Leak Stopped

LUST:

Global Id: T0607300722
Status: Completed - Case Closed
Status Date: 04/26/2004

Global Id: T0607300722
Status: Open - Case Begin Date
Status Date: 02/26/1991

SAN DIEGO CO. SAM:

Case Number: H21291-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: Soils Only
Facility Status: Closed Case
Date: 12/29/2006
Date Began: 7/12/1988

Case Number: H21291-002
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Facility Type: Soils Only
Facility Status: Closed Case
Date: 4/26/2004
Date Began: 2/26/1991

HMMD SAN DIEGO:

Permit Number: 204520
Business Type: 6HK18
EPA Id Number: Not reported
APN: 760-222-17-00
Last HMMD Inspection: 09/19/2012
Facility Telephone: 858-573-1440
Permit Status: OPEN
Permit Expiration: 02/28/2013
Date Last Updated: 11/02/2012
Facility Owner: CITY OF SAN DIEGO
Facility Mailing Address: 3750 JOHN J MONTGOMERY DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Y
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 204520
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Violations Active Permits:

Permit Number: 204520
Update Date: 11/02/2012
Inspection Date: 05/08/2009
Violation Code: 6HV0407
Violation: EMPLOYEE TRAINING NOT ADEQUATE
Violation Citation: Employee training program for small quantity generator of hazardous waste is inadequate. CFR 262.34(d)(5)(iii)
Activity: ACTIVE

Permit Number: 204520
Update Date: 11/02/2012
Inspection Date: 01/09/2007
Violation Code: 6HV1015
Violation: EMPLOYEE TRAINING NOT ADEQUATE
Violation Citation: Did not have adequate employee training program 2732 &/or 25504(c)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

SWEEPS UST:

Status: Active
Comp Number: 21291
Number: 9
Board Of Equalization: 44-023516
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: Not reported
Tank Status: Not reported
Capacity: Not reported
Active Date: Not reported
Tank Use: Not reported
STG: Not reported
Content: Not reported
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 21291
Number: Not reported
Board Of Equalization: 44-023516
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021291-000001
Tank Status: Not reported
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: AVIA. GAS
Number Of Tanks: 3

Status: Not reported
Comp Number: 21291
Number: Not reported
Board Of Equalization: 44-023516
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021291-000002
Tank Status: Not reported
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: AVIA. GAS
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 21291
Number: Not reported
Board Of Equalization: 44-023516
Referral Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021291-000003
Tank Status: Not reported
Capacity: 50
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: REG UNLEADED
Number Of Tanks: Not reported

HIST UST:

File Number: 0002AF60
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002AF60.pdf>
Region: STATE
Facility ID: 00000029034
Facility Type: Other
Other Type: AIRPORT
Contact Name: Not reported
Telephone: 6195606645
Owner Name: CITY OF SAN DIEGO
Owner Address: 2740 CAMINITO CHOLLAS
Owner City,St,Zip: SAN DIEGO, CA 92105
Total Tanks: 0001

Tank Num: 001
Container Num: 1
Year Installed: 1979
Tank Capacity: 00000100
Tank Used for: PRODUCT
Type of Fuel: REGULAR
Container Construction Thickness: Not reported
Leak Detection: 10

Click here for Geo Tracker PDF:

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT1945

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT1011

NPDES:

Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported
Order Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

WDID: 9 371004117
Regulatory Measure Type: Industrial
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Active
Status Date: 04/06/1992
Operator Name: Montgomery Field
Operator Address: 3750 John J Montgomery Dr
Operator City: San Diego
Operator State: California
Operator Zip: 92123

NPDES as of 03/2018:

NPDES Number: Not reported
Status: Not reported
Agency Number: Not reported
Region: 9
Regulatory Measure ID: 218270
Order Number: Not reported
Regulatory Measure Type: Industrial
Place ID: Not reported
WDID: 9 371004117
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Received Date: 05/09/2008
Processed Date: 04/06/1992
Status: Active
Status Date: 04/06/1992
Place Size: 450
Place Size Unit: Acres
Contact: Matthew Schmitzer
Contact Title: Airport Manager
Contact Phone: 858-573-1430
Contact Phone Ext: Not reported
Contact Email: mschmitzer@sandiego.gov
Operator Name: Montgomery Field
Operator Address: 3750 John J Montgomery Dr
Operator City: San Diego
Operator State: California
Operator Zip: 92123
Operator Contact: Rod Propst
Operator Contact Title: Airports Deputy Director

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Operator Contact Phone:	858-573-1430
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Rpropst@sandiego.gov
Operator Type:	City/Town Agency
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	California
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	858-573-1430
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	N
Receiving Water Name:	San Diego River
Certifier:	Matthew Schmitzer
Certifier Title:	Acting Airport Manager
Certification Date:	30-SEP-15
Primary Sic:	4581-Airports, Flying Fields, and Airport Terminal Services
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	CAS000001
Status:	Active
Agency Number:	0
Region:	9
Regulatory Measure ID:	218270
Order Number:	97-03-DWQ
Regulatory Measure Type:	Enrollee
Place ID:	Not reported
WDID:	9 37I004117
Program Type:	Industrial
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	04/06/1992
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Montgomery Field
Discharge Address:	3750 John J Montgomery Dr
Discharge City:	San Diego
Discharge State:	California

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Discharge Zip:	92123
Received Date:	Not reported
Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Facility Status:	Active
NPDES Number:	CAS000001
Region:	9
Agency Number:	0
Regulatory Measure ID:	218270
Place ID:	Not reported
Order Number:	97-03-DWQ
WDID:	9 371004117
Regulatory Measure Type:	Enrollee
Program Type:	Industrial
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	04/06/1992
Termination Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Discharge Address:	3750 John J Montgomery Dr
Discharge Name:	Montgomery Field
Discharge City:	San Diego
Discharge State:	California
Discharge Zip:	92123
Status:	Not reported
Status Date:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
NPDES as of 03/2018:	
NPDES Number:	Not reported
Status:	Not reported
Agency Number:	Not reported
Region:	9
Regulatory Measure ID:	218270
Order Number:	Not reported
Regulatory Measure Type:	Industrial
Place ID:	Not reported
WDID:	9 371004117
Program Type:	Not reported
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Not reported
Discharge Address:	Not reported
Discharge City:	Not reported
Discharge State:	Not reported
Discharge Zip:	Not reported
Received Date:	05/09/2008
Processed Date:	04/06/1992
Status:	Active
Status Date:	04/06/1992
Place Size:	450
Place Size Unit:	Acres
Contact:	Matthew Schmitzer
Contact Title:	Airport Manager
Contact Phone:	858-573-1430
Contact Phone Ext:	Not reported
Contact Email:	mschmitzer@sandiego.gov

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Operator Name:	Montgomery Field
Operator Address:	3750 John J Montgomery Dr
Operator City:	San Diego
Operator State:	California
Operator Zip:	92123
Operator Contact:	Rod Propst
Operator Contact Title:	Airports Deputy Director
Operator Contact Phone:	858-573-1430
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Rpropst@sandiego.gov
Operator Type:	City/Town Agency
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	California
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	858-573-1430
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	N
Receiving Water Name:	San Diego River
Certifier:	Matthew Schmitzer
Certifier Title:	Acting Airport Manager
Certification Date:	30-SEP-15
Primary Sic:	4581-Airports, Flying Fields, and Airport Terminal Services
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	CAS000001
Status:	Active
Agency Number:	0
Region:	9
Regulatory Measure ID:	218270
Order Number:	97-03-DWQ
Regulatory Measure Type:	Enrollee
Place ID:	Not reported
WDID:	9 371004117
Program Type:	Industrial
Adoption Date Of Regulatory Measure:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Effective Date Of Regulatory Measure: 04/06/1992
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Montgomery Field
Discharge Address: 3750 John J Montgomery Dr
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92123
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported
Contact: Not reported
Contact Title: Not reported
Contact Phone: Not reported
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Contact: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported
Operator Contact Phone Ext: Not reported
Operator Contact Email: Not reported
Operator Type: Not reported
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: Not reported
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: Not reported
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported
Constype Recons Ind: Not reported
Constype Residential Ind: Not reported
Constype Transport Ind: Not reported
Constype Utility Description: Not reported
Constype Utility Ind: Not reported
Constype Water Sewer Ind: Not reported
Dir Discharge Uswater Ind: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Receiving Water Name: Not reported
Certifier: Not reported
Certifier Title: Not reported
Certification Date: Not reported
Primary Sic: Not reported
Secondary Sic: Not reported
Tertiary Sic: Not reported

Facility Status: Terminated
NPDES Number: CAS000002
Region: 9
Agency Number: 0
Regulatory Measure ID: 453652
Place ID: Not reported
Order Number: 2009-0009-DWQ
WDID: 9 37C372679
Regulatory Measure Type: Enrollee
Program Type: Construction
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 04/15/2015
Termination Date Of Regulatory Measure: 05/19/2017
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: 9485 Aero Dr
Discharge Name: City of San DiegoEngineering and Capital Projects Department
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92123
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

NPDES as of 03/2018:

NPDES Number: CAS000002
Status: Terminated
Agency Number: 0
Region: 9
Regulatory Measure ID: 453652
Order Number: 2009-0009-DWQ
Regulatory Measure Type: Enrollee
Place ID: Not reported
WDID: 9 37C372679
Program Type: Construction
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 04/15/2015
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: 05/19/2017
Discharge Name: City of San DiegoEngineering and Capital Projects Department
Discharge Address: 9485 Aero Dr
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92123
Received Date: Not reported
Processed Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	Not reported
Status:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Agency Number:	Not reported
Region:	9
Regulatory Measure ID:	453652
Order Number:	Not reported
Regulatory Measure Type:	Construction
Place ID:	Not reported
WDID:	9 37C372679
Program Type:	Not reported
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Not reported
Discharge Address:	Not reported
Discharge City:	Not reported
Discharge State:	Not reported
Discharge Zip:	Not reported
Received Date:	04/07/2015
Processed Date:	04/15/2015
Status:	Active
Status Date:	05/19/2017
Place Size:	549
Place Size Unit:	Acres
Contact:	Jihad Sleiman
Contact Title:	Not reported
Contact Phone:	619-533-7532
Contact Phone Ext:	Not reported
Contact Email:	jodi@h2ologged.com
Operator Name:	City of San DiegoEngineering and Capital Projects Department
Operator Address:	9485 Aero Dr
Operator City:	San Diego
Operator State:	California
Operator Zip:	92123
Operator Contact:	Jihad Sleiman
Operator Contact Title:	Not reported
Operator Contact Phone:	619-533-7532
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	jsleiman@sandiego.gov
Operator Type:	City/Town Agency
Developer:	West Coast General Corporation
Developer Address:	13700 Stowe Drive Suite 100
Developer City:	Poway
Developer State:	California
Developer Zip:	92064
Developer Contact:	Joe Solorzano
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	N
Emergency Phone:	951-704-6165
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	N
Constype Below Ground Ind:	N
Constype Cable Line Ind:	N
Constype Comm Line Ind:	N
Constype Commercial Ind:	N
Constype Electrical Line Ind:	N
Constype Gas Line Ind:	N
Constype Industrial Ind:	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Constype Other Description:	Not reported
Constype Other Ind:	N
Constype Recons Ind:	N
Constype Residential Ind:	N
Constype Transport Ind:	Y
Constype Utility Description:	Not reported
Constype Utility Ind:	N
Constype Water Sewer Ind:	N
Dir Discharge Uswater Ind:	N
Receiving Water Name:	Not reported
Certifier:	Julie Ballesteros
Certifier Title:	Senior Civil Engineer
Certification Date:	07-APR-15
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
Facility Status:	Not reported
NPDES Number:	Not reported
Region:	Not reported
Agency Number:	Not reported
Regulatory Measure ID:	Not reported
Place ID:	Not reported
Order Number:	Not reported
WDID:	9 37C372679
Regulatory Measure Type:	Construction
Program Type:	Not reported
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Discharge Address:	Not reported
Discharge Name:	Not reported
Discharge City:	Not reported
Discharge State:	Not reported
Discharge Zip:	Not reported
Status:	Terminated
Status Date:	11/07/2017
Operator Name:	City of San DiegoEngineering and Capital Projects Department
Operator Address:	9485 Aero Dr
Operator City:	San Diego
Operator State:	California
Operator Zip:	92123
NPDES as of 03/2018:	
NPDES Number:	CAS000002
Status:	Terminated
Agency Number:	0
Region:	9
Regulatory Measure ID:	453652
Order Number:	2009-0009-DWQ
Regulatory Measure Type:	Enrollee
Place ID:	Not reported
WDID:	9 37C372679
Program Type:	Construction
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	04/15/2015

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: 05/19/2017
Discharge Name: City of San DiegoEngineering and Capital Projects Department
Discharge Address: 9485 Aero Dr
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92123
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported
Contact: Not reported
Contact Title: Not reported
Contact Phone: Not reported
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Contact: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported
Operator Contact Phone Ext: Not reported
Operator Contact Email: Not reported
Operator Type: Not reported
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: Not reported
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: Not reported
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported
Constype Recons Ind: Not reported
Constype Residential Ind: Not reported
Constype Transport Ind: Not reported
Constype Utility Description: Not reported
Constype Utility Ind: Not reported
Constype Water Sewer Ind: Not reported
Dir Discharge Uswater Ind: Not reported
Receiving Water Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	Not reported
Status:	Not reported
Agency Number:	Not reported
Region:	9
Regulatory Measure ID:	453652
Order Number:	Not reported
Regulatory Measure Type:	Construction
Place ID:	Not reported
WDID:	9 37C372679
Program Type:	Not reported
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Not reported
Discharge Address:	Not reported
Discharge City:	Not reported
Discharge State:	Not reported
Discharge Zip:	Not reported
Received Date:	04/07/2015
Processed Date:	04/15/2015
Status:	Active
Status Date:	05/19/2017
Place Size:	549
Place Size Unit:	Acres
Contact:	Jihad Sleiman
Contact Title:	Not reported
Contact Phone:	619-533-7532
Contact Phone Ext:	Not reported
Contact Email:	jodi@h2ologged.com
Operator Name:	City of San DiegoEngineering and Capital Projects Department
Operator Address:	9485 Aero Dr
Operator City:	San Diego
Operator State:	California
Operator Zip:	92123
Operator Contact:	Jihad Sleiman
Operator Contact Title:	Not reported
Operator Contact Phone:	619-533-7532
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	jsleiman@sandiego.gov
Operator Type:	City/Town Agency
Developer:	West Coast General Corporation
Developer Address:	13700 Stowe Drive Suite 100
Developer City:	Poway
Developer State:	California
Developer Zip:	92064
Developer Contact:	Joe Solorzano
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	N
Emergency Phone:	951-704-6165

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	N
Constype Below Ground Ind:	N
Constype Cable Line Ind:	N
Constype Comm Line Ind:	N
Constype Commercial Ind:	N
Constype Electrical Line Ind:	N
Constype Gas Line Ind:	N
Constype Industrial Ind:	N
Constype Other Description:	Not reported
Constype Other Ind:	N
Constype Recons Ind:	N
Constype Residential Ind:	N
Constype Transport Ind:	Y
Constype Utility Description:	Not reported
Constype Utility Ind:	N
Constype Water Sewer Ind:	N
Dir Discharge Uswater Ind:	N
Receiving Water Name:	Not reported
Certifier:	Julie Ballesteros
Certifier Title:	Senior Civil Engineer
Certification Date:	07-APR-15
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

SAN DIEGO CO LOP:

Record ID:	DEH1988-LSAM-H21291-001
Record Status:	Completed
Opened Date:	07/12/1988
Parcel Number:	421-290-11-00
Case Type:	LOP - Local Oversight Program
Historical Name:	GIBBS FLYING SERVICE -MONTGOMERY FIELD
SWRCB Global ID:	T0607300033
Funding:	F - LOP Federal Fund
Lead Agency:	DEH/SAM
Lead Agency Date:	07/12/1988
Census Tract:	85.11
Community:	San Diego
Jurisdiction:	SAN DIEGO
Watershed Basin Number:	907.11
Water Purveyor:	SAN DIEGO
Fire Agency:	SAN DIEGO
Thomas Bros Map Page Grid:	1249 C 3
Latitude:	32.8145972
Longitude:	-117.1412173
X MapCoord:	6287850.143
Y MapCoord:	1877338.887

Record ID:	DEH1991-LSAM-H21291-002
Record Status:	Completed
Opened Date:	03/01/1991
Parcel Number:	421-290-11-00
Case Type:	LOP - Local Oversight Program
Historical Name:	CITY OF SAN DIEGO-MONTGOMERY FIELD
SWRCB Global ID:	T0607300722

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 04/22/1991
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 C 3
Latitude: 32.8145972
Longitude: -117.1412173
X MapCoord: 6287850.143
Y MapCoord: 1877338.887

CIWQS:

Agency: Montgomery Field
Agency Address: 3750 John J Montgomery Dr, San Diego, CA 92123
Place/Project Type: Industrial - Airports, Flying Fields, and Airport Terminal Services
SIC/NAICS: 4581
Region: 9
Program: INDSTW
Regulatory Measure Status: Active
Regulatory Measure Type: Storm water industrial
Order Number: 2014-0057-DWQ
WDID: 9 37I004117
NPDES Number: CAS000001
Adoption Date: Not reported
Effective Date: 04/06/1992
Termination Date: Not reported
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.81214
Longitude: -117.14019

Agency: City of San Diego Engineering and Capital Projects Department
Agency Address: 9485 Aero Dr, San Diego, CA 92123
Place/Project Type: Construction - Transportation
SIC/NAICS: Not reported
Region: 9
Program: CONSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water construction
Order Number: 2009-0009-DWQ
WDID: 9 37C372679
NPDES Number: CAS000002
Adoption Date: Not reported
Effective Date: 04/15/2015
Termination Date: 05/19/2017
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-POLICE, AIR SUPPORT UNIT (Continued)

U001573223

Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.73646
Longitude: -117.16644

E44 **SDCTY FIRE-RESCUE AIR OPERATION**
Target **3750 JOHN J MONTGOMERY DR**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S113136884**
N/A

Site 12 of 24 in cluster E

Actual:
412 ft.

Focus Map:
1

HAZNET:
Facility Name: SDCTY FIRE-RESCUE AIR OPERATION
envid: S113136884
Year: 2017
GEPAID: CAL000293341
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Unspecified organic liquid mixture
Disposal Method: Fuel Blending Prior To Energy Recovery At Another Site
Tons: 0.051
Cat Decode: Unspecified organic liquid mixture
Method Decode: Fuel Blending Prior To Energy Recovery At Another Site
Facility County: San Diego

envid: S113136884
Year: 2014
GEPAID: CAL000293341
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Not reported
Disposal Method: Fuel Blending Prior To Energy Recovery At Another Site
Tons: Not reported
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113136884
Year: 2014
GEPAID: CAL000293341
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY FIRE-RESCUE AIR OPERATION (Continued)

S113136884

Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: AZC950823111
TSD County: 99
Waste Category: Asbestos containing waste
Disposal Method: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Tons: 0.0175
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113136884
Year: 2014
GEPAID: CAL000293341
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Fuel Blending Prior To Energy Recovery At Another Site
Tons: 0.033
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113136884
Year: 2014
GEPAID: CAL000293341
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Disposal Method: Not reported
Tons: 0.14595
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
12 additional CA_HAZNET: record(s) in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

E45
Target
Property

CITY OF SAN DIEGO-MONTGMRY FLD
3750 JOHN J MONTGOMERY DR
SAN DIEGO, CA

CA RGA LUST
S114603304
N/A

Site 13 of 24 in cluster E

Actual:
412 ft.

Focus Map:
1

RGA LUST:
2003 CITY OF SAN DIEGO-MONTGMRY FLD 3750 JOHN J MONTGOMERY DR

E46
Target
Property

MONTGOMERY FIELD
3750 JOHN J MONTGOMERY DR
SAN DIEGO, CA 92123

FINDS
ECHO
1023692608
N/A

Site 14 of 24 in cluster E

Actual:
412 ft.

Focus Map:
1

FINDS:
Registry ID: 110070089647
Environmental Interest/Information System
US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1023692608
Registry ID: 110070089647
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110070089647>

E47
Target
Property

MONTGOMERY FIELD ARPRT OPER
3750 JOHN J. MONTGOMERY DR
SAN DIEGO, CA 92123

CA WDS
S106100999
N/A

Site 15 of 24 in cluster E

Actual:
412 ft.

Focus Map:
1

WDS:
Facility ID: San Diego 371004117
Facility Type: Industrial - Facility that treats and/or disposes of liquid or semisolid wastes from any servicing, producing, manufacturing or processing operation of whatever nature, including mining, gravel washing, geothermal operations, air conditioning, ship building and repairing, oil production, storage and disposal operations, water pumping.
Facility Status: Active - Any facility with a continuous or seasonal discharge that is

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ARPRT OPER (Continued)

S106100999

NPDES Number: under Waste Discharge Requirements.
CAS000001 The 1st 2 characters designate the state. The remaining 7
are assigned by the Regional Board
Subregion: 9
Facility Telephone: Not reported
Facility Contact: Not reported
Agency Name: SAN DIEGO CITY OF
Agency Address: Not reported
Agency City,St,Zip: 0
Agency Contact: Not reported
Agency Telephone: Not reported
Agency Type: City
SIC Code: 0
SIC Code 2: Not reported
Primary Waste Type: Not reported
Primary Waste: Not reported
Waste Type2: Not reported
Waste2: Not reported
Primary Waste Type: Not reported
Secondary Waste: Not reported
Secondary Waste Type: Not reported
Design Flow: 0
Baseline Flow: 0
Reclamation: Not reported
POTW: Not reported
Treat To Water: Minor Threat to Water Quality. A violation of a regional board order
should cause a relatively minor impairment of beneficial uses compared
to a major or minor threat. Not: All nurds without a TTWQ will be
considered a minor threat to water quality unless coded at a higher
Level. A Zero (0) may be used to code those NURDS that are found to
represent no threat to water quality.
Complexity: Category C - Facilities having no waste treatment systems, such as
cooling water dischargers or those who must comply through best
management practices, facilities with passive waste treatment and
disposal systems, such as septic systems with subsurface disposal, or
dischargers having waste storage systems with land disposal such as
dairy waste ponds.

E48

Target 3750 JOHN J MONTGOMERY DR (MONTGOMERY AIRFIELD)
Property SAN DIEGO, CA 92123

CA CHMIRS S117331700
N/A

Site 16 of 24 in cluster E

Actual: CHMIRS:
412 ft. OES Incident Number: 4-5233
Focus Map: OES notification: 09/16/2014
1 OES Date: Not reported
OES Time: Not reported
Date Completed: **Not reported**
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S117331700

More Than Two Substances Involved?: Not reported
Resp Agency Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: San Diego River
Spill Site: Airport
Cleanup By: No
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Type: PETROLEUM
Measure: Gal(s)
Other: Not reported
Date/Time: 1718
Year: 2014
Agency: SD City FD
Incident Date: 9/16/2014
Admin Agency: Not reported
Amount: Not reported
Contained: Yes
Site Type: San Diego River
E Date: Not reported
Substance: Fuel - Jet A Type
Quantity Released: 20
Unknown: Not reported
Substance #2: Not reported
Substance #3: Not reported
Evacuations: Not reported
Number of Injuries: Natural Causes
Number of Fatalities: Not reported
#1 Pipeline: No
#2 Pipeline: No
#3 Pipeline: No
#1 Vessel >= 300 Tons: No
#2 Vessel >= 300 Tons: No
#3 Vessel >= 300 Tons: No
Evacs: No
Injuries: Other
Fataals: No
Comments: Not reported
Description: Micro burst storm dislodged 6 planes from their moorings damaging their fuel tanks and causing

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S117331700

the release, material flowed onto asphalt then into two storm drains, material flowed from drains into one outfall, that outfall was boomed and monitored by RP, FD and SD Co Env Health handled the containment, responsible parties will perform clean up.

E49 SDCTY-FIRE-RESCUE DEPT, AIR OPERATIONS DIVISION
Target 3750 JOHN J MONTGOMERY DR
Property SAN DIEGO, CA 92123

FINDS 1006249017
N/A

Site 17 of 24 in cluster E

Actual: FINDS:
412 ft.

Focus Map: Registry ID: 110055877788
1

Environmental Interest/Information System
STATE MASTER

Registry ID: 110057054592

Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

E50 CITY OF SAN DIEGO
Target 3750 JOHN J. MONTGOMERY DR.
Property SAN DIEGO, CA 92123

CA HAZNET S120997323
N/A

Site 18 of 24 in cluster E

Actual: HAZNET:
412 ft.

Focus Map: Facility Name: CITY OF SAN DIEGO
1 envid: S120997323

Year: 2016
GEPAID: CAC002857706
Contact: GEORGE KATSIKARIS
Telephone: 8586273312
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT STE 310
Mailing City,St,Zip: SAN DIEGO, CA 921231676
Gen County: San Diego

TSD EPA ID: AZC950823111
TSD County: 99
Waste Category: Asbestos containing waste
Disposal Method: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)

Tons: 0.23
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

E51
Target
Property

MONTGOMERY FIELD
3750 JOHN J. MONTGOMERY DR
SAN DIEGO, CA 92123

CA LUST
S105034326
N/A

Site 19 of 24 in cluster E

Actual:
412 ft.

Focus Map:
1

E52
Target
Property

SDCTY-FIRE-RESCUE DEPT, AIR OPERATIONS DIVISION
3750 JOHN J MONTGOMERY DR
SAN DIEGO, CA 92123

CA San Diego Co. HMMD
S119097065
N/A

Site 20 of 24 in cluster E

Actual:
412 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number:	Not reported
Business Type:	Not reported
EPA Id Number:	CAL00029334
APN:	Not reported
Last HMMD Inspection:	Not reported
Facility Telephone:	858-573-1437
Permit Status:	Permit Renewed
Permit Expiration:	Not reported
Date Last Updated:	01/16/2018
Facility Owner:	Not reported
Facility Mailing Address:	1010 2ND AVE, SUITE 400 /MS-604, SAN DIEGO, CA 92101
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
UST Owner:	N
Handle Regulated Hazmat:	Not reported
Own Or Operate UST:	Not reported
Subject To APSA:	Not reported
Generate Haz Waste:	Y
Treat Haz Waste:	N
Generate Medical Waste:	Not reported

Inspection Violation:

Record ID:	DEH2005-HUPFP-205304
Permit Status:	Permit Renewed
Active Permit:	Y
Facility Id Number:	37-000-205304
Program Element:	Aboveground Petroleum Storage Act
Inspection Type:	Routine
Inspection Number:	5751028
Return To Compliance Date:	2017-11-01T00:00:00.000
Nov:	No
Violation Classification:	Class II
Underground Storage Tank Id:	Not reported
Container/Tank Id:	Not reported
Last Update:	2018-10-26T20:33:59.000
Inspection Date:	2017-10-02T13:14:00.000
Violation Code:	4010009 Failed to perform and properly document a 5-year review of the SPCC Plan. (40 CFR 112.5(b).) HSC 25270.4.5(a)

Record ID:	DEH2005-HUPFP-205304
Permit Status:	Permit Renewed
Active Permit:	Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE-RESCUE DEPT, AIR OPERATIONS DIVISION (Continued)

S119097065

Facility Id Number: 37-000-205304
Program Element: Aboveground Petroleum Storage Act
Inspection Type: Routine
Inspection Number: 4100062
Return To Compliance Date: 2016-05-16T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T20:33:59.000
Inspection Date: 2015-10-01T09:25:00.000
Violation Code: 4010008 Failed to maintain a copy of the Plan on site (applies if facility is manned at least 4 hours/day). (40 CFR 112.3(e)(1).) HSC 25270.4.5(a)

Record ID: DEH2005-HUPFP-205304
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-205304
Program Element: Aboveground Petroleum Storage Act
Inspection Type: Routine
Inspection Number: 5751028
Return To Compliance Date: 2017-11-01T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T20:33:59.000
Inspection Date: 2017-10-02T13:14:00.000
Violation Code: 4010010 Failed to make SPCC plan technical amendment(s), within 6 months, when the facility has had a change in: design, construction, operation, or maintenance which affects the facility's discharge potential; failed to implement within six months following preparation of the amendment. (40 CFR 112.5(a).) HSC 25270.4.5(a)

Record ID: DEH2005-HUPFP-205304
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-205304
Program Element: Aboveground Petroleum Storage Act
Inspection Type: Routine
Inspection Number: 5751028
Return To Compliance Date: 2017-11-01T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T20:33:59.000
Inspection Date: 2017-10-02T13:14:00.000
Violation Code: 4010020 (General Containment) Failed to provide, or discuss within the plan, appropriate containment/diversionary structures/equipment designed to address the typical failure of all oil storage including tanks, equipment, containers, mobile refuelers, piping and related appurtenances, so that any discharge will not escape containment before cleanup occurs. (40 CFR 112.7(c).) HSC 25270.4.5(a)

Record ID: DEH2005-HUPFP-205304

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE-RESCUE DEPT, AIR OPERATIONS DIVISION (Continued)

S119097065

Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-205304
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5751028
Return To Compliance Date: 2017-11-01T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T20:33:59.000
Inspection Date: 2017-10-02T13:14:00.000
Violation Code: 1010006 Failed to update HMBP in CERS within 30 days of a substantial change to any portion of the HMBP, including inventory changes or facility information. HSC 25508.1(a-f); 19 CCR 2654(d); SDCC 68.904(c)(6)

Waste and Materials:

Record ID: DEH2005-HUPFP-205304
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111528
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-11-29T00:51:41.000
Chemical Name: HYDROCARBON SOLVENTS
Common Name: JET FUEL TYPE A & WATER
Case Number: Not reported

Record ID: DEH2005-HUPFP-205304
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111529
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-11-29T00:51:41.000
Chemical Name: OILY DEBRIS
Common Name: OILY DEBRIS
Case Number: Not reported

Record ID: DEH2005-HUPFP-205304
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0164477
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-12-28T01:19:52.000
Chemical Name: BONDERITE C-MC 5884 AERO
Common Name: BONDERITE C-MC 5884 AERO
Case Number: Not reported

Record ID: DEH2005-HUPFP-205304
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0164478
Trade Secret: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE-RESCUE DEPT, AIR OPERATIONS DIVISION (Continued)

S119097065

Hazardous Material Type:	Mixture
Last Updated:	2017-12-28T01:19:52.000
Chemical Name:	AVGAS 100 LL
Common Name:	JET A FUEL
Case Number:	NA
Record ID:	DEH2005-HUPFP-205304
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0164479
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-12-28T01:19:52.000
Chemical Name:	Extreme Simple Green Aircraft & Precision Cleaner
Common Name:	Extreme Simple Green Aircraft & Precision Cleaner
Case Number:	Not reported
Record ID:	DEH2005-HUPFP-205304
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0139822
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-12-28T01:19:52.000
Chemical Name:	WASTE OIL & MIXED OIL
Common Name:	WASTE LUBRICATING OIL / SELF HAULED TO FIRE REPAIR #119194
Case Number:	Not reported
Record ID:	DEH2005-HUPFP-205304
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0139823
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-12-28T01:19:52.000
Chemical Name:	HYDROCARBON SOLVENTS
Common Name:	JET FUEL TYPE A & WATER
Case Number:	Not reported
Record ID:	DEH2005-HUPFP-205304
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0139824
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-12-28T01:19:52.000
Chemical Name:	OILY DEBRIS
Common Name:	OILY DEBRIS
Case Number:	Not reported
Record ID:	DEH2005-HUPFP-205304
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0164492
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-26T20:33:59.000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE-RESCUE DEPT, AIR OPERATIONS DIVISION (Continued)

S119097065

Chemical Name: AVGAS 100 LL
Common Name: JET A FUEL
Case Number: NA

Record ID: DEH2005-HUPFP-205304
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133299
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-11-29T00:51:41.000
Chemical Name: BRAKE CLEAN
Common Name: BRAKE CLEAN
Case Number: Not reported

Record ID: DEH2005-HUPFP-205304
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133300
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-11-29T00:51:41.000
Chemical Name: AVGAS 100 LL
Common Name: JET A FUEL
Case Number: NA

Record ID: DEH2005-HUPFP-205304
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133301
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-11-29T00:51:41.000
Chemical Name: PROPANE
Common Name: PROPANE
Case Number: 68476-85-7

Record ID: DEH2005-HUPFP-205304
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133302
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-11-29T00:51:41.000
Chemical Name: CARBON REMOVER (PROPRIETARY)
Common Name: CARBON REMOVER (PROPRIETARY)
Case Number: Not reported

Record ID: DEH2005-HUPFP-205304
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111527
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-11-29T00:51:41.000
Chemical Name: WASTE OIL & MIXED OIL
Common Name: WASTE LUBRICATING OIL / SELF HAULED TO FIRE REPAIR #119194

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE-RESCUE DEPT, AIR OPERATIONS DIVISION (Continued)

S119097065

Case Number:	Not reported
Record ID:	DEH2005-HUPFP-205304
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0164491
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-26T20:33:59.000
Chemical Name:	BONDERITE C-MC 5884 AERO
Common Name:	BONDERITE C-MC 5884 AERO
Case Number:	Not reported
Record ID:	DEH2005-HUPFP-205304
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0164493
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-26T20:33:59.000
Chemical Name:	Extreme Simple Green Aircraft & Precision Cleaner
Common Name:	Extreme Simple Green Aircraft & Precision Cleaner
Case Number:	Not reported
Record ID:	DEH2005-HUPFP-205304
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0139831
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T20:33:59.000
Chemical Name:	WASTE OIL & MIXED OIL
Common Name:	WASTE LUBRICATING OIL / SELF HAULED TO FIRE REPAIR #119194
Case Number:	Not reported
Record ID:	DEH2005-HUPFP-205304
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0139832
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T20:33:59.000
Chemical Name:	HYDROCARBON SOLVENTS
Common Name:	JET FUEL TYPE A & WATER
Case Number:	Not reported
Record ID:	DEH2005-HUPFP-205304
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0139833
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T20:33:59.000
Chemical Name:	OILY DEBRIS
Common Name:	OILY DEBRIS
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

E53
Target
Property

SDCTY-REA, MONTGOMERY FIELD AIRPORT
3750 JOHN J MONTGOMERY DR
SAN DIEGO, CA 92123

CA San Diego Co. HMMD
S119097019
N/A

Site 21 of 24 in cluster E

Actual:
412 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number:	Not reported
Business Type:	Not reported
EPA Id Number:	Not reported
APN:	Not reported
Last HMMD Inspection:	Not reported
Facility Telephone:	858-573-1440
Permit Status:	Permit Renewed
Permit Expiration:	Not reported
Date Last Updated:	01/30/2018
Facility Owner:	Not reported
Facility Mailing Address:	3750 JOHN J MONTGOMERY DR, SAN DIEGO, CA 92123
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
UST Owner:	N
Handle Regulated Hazmat:	Not reported
Own Or Operate UST:	Not reported
Subject To APSA:	Not reported
Generate Haz Waste:	N
Treat Haz Waste:	N
Generate Medical Waste:	Not reported

Waste and Materials:

Record ID:	DEH2004-HUPFP-204520
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0142261
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-05-23T00:56:29.000
Chemical Name:	PROPANE
Common Name:	PROPANE
Case Number:	74-98-6

Record ID:	DEH2004-HUPFP-204520
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2015-HCHEM-0083273
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-01-27T02:33:28.000
Chemical Name:	PROPANE
Common Name:	PROPANE
Case Number:	74-98-6

Record ID:	DEH2004-HUPFP-204520
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0160013
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-01-30T02:33:53.000
Chemical Name:	PROPANE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-REA, MONTGOMERY FIELD AIRPORT (Continued)

S119097019

Common Name: PROPANE
Case Number: 74-98-6

E54 **MONTGOMERY FIELD**
Target **3750 JOHN J. MONTGOMERY D**
Property **SAN DIEGO, CA**

CA RGA LUST **S114656539**
N/A

Site 22 of 24 in cluster E

Actual: RGA LUST:
412 ft.
Focus Map:
1

1995	MONTGOMERY FIELD	3750 JOHN J. MONTGOMERY D
1993	MONTGOMERY FIELD	3750 JOHN J. MONTGOMERY D

E55 **MEDIMPACT FLIGHT OPERATIONS**
Target **3751 JOHN J MONTGOMERY DR**
Property **SAN DIEGO, CA 92123**

FINDS **1023238976**
N/A

Site 23 of 24 in cluster E

Actual: FINDS:
412 ft.
Focus Map:
1

Registry ID: 110065266205

Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

E56 **MEDIMPACT FLIGHT OPERATIONS**
Target **3751 JOHN J MONTGOMERY RD**
Property **SAN DIEGO, CA 92123**

CA San Diego Co. HMMD **S119097597**
N/A

Site 24 of 24 in cluster E

Actual: HMMD SAN DIEGO:
412 ft.
Focus Map:
1

Permit Number:	Not reported
Business Type:	Not reported
EPA Id Number:	Ca0000269506
APN:	Not reported
Last HMMD Inspection:	Not reported
Facility Telephone:	858-790-7185
Permit Status:	Permit Renewed
Permit Expiration:	Not reported
Date Last Updated:	11/01/2017
Facility Owner:	Not reported
Facility Mailing Address:	3751 JOHN J MONTGOMERY DR, SAN DIEGO, CA 92123
Facility Mailing City:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MEDIMPACT FLIGHT OPERATIONS (Continued)

S119097597

Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2010-HUPFP-212314
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-212314
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5727604
Return To Compliance Date: 2017-08-11T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-17T00:50:22.000
Inspection Date: 2017-08-11T12:58:23.000
Violation Code: 1010008 HMBP not certified annually as complete and accurate in CERS.
HSC 25508(a)(1)(A), 25508.2, 19 CCR 2654(b)

Waste and Materials:

Record ID: DEH2010-HUPFP-212314
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2015-HCHEM-0073378
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-11-18T02:30:21.000
Chemical Name: OXYGEN GAS
Common Name: OXYGEN GAS
Case Number: 7782-44-7

Record ID: DEH2010-HUPFP-212314
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2015-HWAST-0057222
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-11-18T02:30:21.000
Chemical Name: WASTE FUEL
Common Name: Waste Fuel
Case Number: Not reported

Record ID: DEH2010-HUPFP-212314
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0150002
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MEDIMPACT FLIGHT OPERATIONS (Continued)

S119097597

Last Updated: 2018-10-17T00:50:26.000
Chemical Name: OXYGEN GAS
Common Name: OXYGEN GAS
Case Number: 7782-44-7

Record ID: DEH2010-HUPFP-212314
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0128419
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-17T00:50:26.000
Chemical Name: WASTE AVGAS
Common Name: WASTE AVGAS
Case Number: Not reported

Record ID: DEH2010-HUPFP-212314
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0128420
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-17T00:50:26.000
Chemical Name: WASTE JET A
Common Name: WASTE JET A
Case Number: Not reported

F57 **SDCTY-FIRE REPAIR FACILITY**
Target **3870 KEARNY VILLA RD**
Property **SAN DIEGO, CA 92123**

Site 1 of 15 in cluster F

Actual:
400 ft.

Focus Map:
1

CA LUST **S103472125**
CA SAN DIEGO CO. SAM **N/A**
CA CPS-SLIC
CA San Diego Co. HMMD
CA CHMIRS
CA HAZNET
CA HIST CORTESE
CA NPDES
CA SAN DIEGO CO LOP
CA CIWQS

LUST REG 9:

Region: 9
Status: Preliminary site assessment workplan submitted
Case Number: 9UT3869
Local Case: H19194-005
Substance: Unleaded Gasoline
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Unknown
Cause: Unknown
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 02/17/1999
Date Stopped: 02/17/1999
Confirm Date: 03/22/1999
Submit Workplan: 3/31/99

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Prelim Assess: / /
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 03/31/1999
Enforce Date: Not reported
Closed Date: Not reported
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: Not reported
Beneficial Use: MUNBU
NPDES Number: Not reported
Priority: 3A
File Disp: Administratively opened on database, however no file physically exists
Interim Remedial Actions: Not reported
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

Region: 9
Status: Preliminary site assessment workplan submitted
Case Number: 9UT3742
Local Case: H19194-004
Substance: Diesel
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Unknown
Cause: Unknown
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 04/28/1998
Date Stopped: 04/28/1998
Confirm Date: 10/01/1998
Submit Workplan: 10/6/98
Prelim Assess: / /
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 08/26/1998
Enforce Date: Not reported
Closed Date: Not reported
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: 9'
Beneficial Use: MUNBU
NPDES Number: Not reported
Priority: Not reported
File Disp: Administratively opened on database, however no file physically exists
Interim Remedial Actions: Not reported
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

LUST:

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607302628
Global Id: T0607302628
Latitude: 32.8115950552731
Longitude: -117.150812815941
Status: Completed - Case Closed
Status Date: 01/26/2010
Case Worker: TS
RB Case Number: 9UT3869
Local Agency: SAN DIEGO COUNTY LOP
File Location: Local Agency
Local Case Number: H19194-005
Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline
Site History: Note: Release H19194-005 (gasoline release- described below) is being administratively consolidated with case H19194-004 (diesel dispenser release) in January 2010, and case H19194-005 is being administratively closed. Both releases, -004 and -005, will be investigated under -004. Please see case H19194-004 (T0607302510) for additional case information. Release -005: On 2/17/1999, one 550-gallon waste oil tank was removed from within a shop bay at the facility. In addition, one 1,000 gallon gasoline UST and 80 feet of associated piping were removed from an area just south of the former diesel tank area and just west of the Maintenance Building. Based on a TPH-gas concentrations of 1100 (6 foot depth) to 2,000 mg/kg (12 foot depth) in soil samples collected from the gasoline tank excavation pit, release -005 was opened. DEH sent a Notice of Responsibility letter to the City on 3/31/1999, and in a subsequent letter, DEH requested a Workplan for site assessment. On July 16, 2001, DEH received a combined workplan to assess both releases (004- and -005) from the City's consultant entitled "Revised Work Plan for Site Assessment. The workplan, prepared by GeoCon, was initially dated May 21, 2001, then was revised and dated July 12, 2001. The revised workplan was conditionally approved by SAM in August 2001. Due to City budget issues, the workplan was not implemented. In a letter dated 12/4/2006, DEH requested a new workplan. Again, due to the ranking of the site as low priority (low risk), available City funds were allocated to higher risk sites. The City plans to address the site in 2010, if the funds are available.

LUST:

Global Id: T0607302628
Contact Type: Local Agency Caseworker
Contact Name: TERESA SHERMAN
Organization Name: SAN DIEGO COUNTY LOP
Address: P.O. Box 129261
City: San Diego
Email: teresa.sherman@sdcounty.ca.gov
Phone Number: Not reported

LUST:

Global Id: T0607302628
Action Type: ENFORCEMENT
Date: 01/19/2010
Action: Closure/No Further Action Letter

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Global Id: T0607302628
Action Type: Other
Date: 03/16/1999
Action: Leak Reported

Global Id: T0607302628
Action Type: ENFORCEMENT
Date: 07/13/2009
Action: Letter - Notice

Global Id: T0607302628
Action Type: Other
Date: 02/17/1999
Action: Leak Began

Global Id: T0607302628
Action Type: Other
Date: 02/17/1999
Action: Leak Discovery

Global Id: T0607302628
Action Type: ENFORCEMENT
Date: 03/31/1999
Action: Notice of Responsibility

Global Id: T0607302628
Action Type: Other
Date: 02/17/1999
Action: Leak Stopped

LUST:

Global Id: T0607302628
Status: Completed - Case Closed
Status Date: 01/26/2010

Global Id: T0607302628
Status: Open - Case Begin Date
Status Date: 02/17/1999

Global Id: T0607302628
Status: Open - Site Assessment
Status Date: 03/22/1999

Global Id: T0607302628
Status: Open - Site Assessment
Status Date: 01/14/2010

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607302510
Global Id: T0607302510
Latitude: 32.8116956661913
Longitude: -117.150868605692
Status: Completed - Case Closed
Status Date: 09/24/2015
Case Worker: TS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

RB Case Number: 9UT3742
Local Agency: SAN DIEGO COUNTY LOP
File Location: Local Agency
Local Case Number: H19194-004
Potential Media Affect: Soil
Potential Contaminants of Concern: Diesel

Site History:

The City of San Diego operates the Fire Department Repair Facility (the Site) as a centralized repair station for heavy vehicles. In January 2010, two open unauthorized release cases at the Site, #H19194-004 (diesel release) and #H19194-005 (gasoline release), were consolidated into one case (#H19194-004). Case #H19194-005 was administratively closed. On April 28, 1998, a 550-gallon diesel underground storage tank (UST) and associated piping were removed from the site. Soil samples were collected in the tank excavation and below product piping. The maximum concentration of total petroleum hydrocarbons reported as diesel (TPH-d) was 5500 milligrams per kilogram (mg/kg) in a soil sample collected beneath piping adjacent to a former diesel dispenser. The following year, two more USTs were removed. On February 17, 1999, one 550-gallon waste oil UST was removed from within a shop bay, and one 1,000-gallon gasoline UST was removed from an area south of the former diesel UST excavation. The maximum concentration of total recoverable petroleum hydrocarbons was 48 mg/kg in a soil sample from the waste oil tank excavation. The maximum concentration of TPH reported as gasoline (TPH-g) was 2,000 mg/kg in a soil sample collected from the gasoline UST excavation. In August 2001, a site assessment workplan (SAP) was conditionally approved by DEH; however, the assessment was never completed. A revised SAP was approved in March 2011, and implemented in May 2011. One boring/groundwater monitoring well (MW1) was advanced next to the former diesel dispenser, and a second boring/groundwater monitoring well (MW2) was installed adjacent to the former gasoline UST excavation. TPH-d concentrations in soil samples collected from the MW1 boring ranged from 986 mg/kg to 5,470 mg/kg. The groundwater sample from MW1 contained elevated concentrations of benzene, ethylbenzene, and 1,2-dichloroethane (1,2-DCA), but dissolved methyl tertiary butyl ether (MTBE) was not detected. In contrast, the MW2 groundwater sample contained MTBE, but dissolved benzene, ethylbenzene, and 1,2-DCA were not detected. Soil samples collected from the MW2 boring contained low concentrations of TPH-d, but TPH-g was not detected. In October/November 2012, two additional monitoring wells and one boring were installed at the site. A maximum concentration of 7,600 mg/kg TPH-g was reported in a soil sample collected from the boring advanced next to the former diesel dispenser. Groundwater monitoring and sampling events were conducted between 2011 and 2014. No free product was observed at the site. The consultant estimates that approximately 1,051 cubic yards of impacted soil with TPH concentrations above 100 mg/kg remain at the site. Groundwater beneath the site has designated beneficial uses, including potential municipal use, in the States Basin Plan. The consultant estimates that, based on stable and decreasing concentration trends, dissolved benzene, ethylbenzene, and 1,2-DCA concentrations will naturally degrade to concentrations below their Maximum Contaminant Levels (MCLs) in approximately 2033 (18 years), 2015 (this year), and 2021 (6 years), respectively. The consultant concludes that the dissolved contaminant plume is stable and has been adequately delineated, and recommends case closure. DEH concurs with the conclusions and recommendation for case closure. A 60-day time

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

period was provided for the public to review and comment on DEHs Intent to Close Case Notification letter. Comments were only received from the City of San Diego Public Utilities Department (PUD). In a response letter to PUD dated April 9, 2015, DEH acknowledges the Citys right to develop groundwater sources, and states that the consultant estimates that contaminant concentrations will degrade to MCLs within twenty years. In addition, clean-up activities conducted at the site have remediated contaminants to levels which meet the State Water Resources Control Boards Low-Threat UST Case Closure Policy. The four groundwater monitoring wells on the site were destroyed on June 15, 2015, under DEH permit #DEH2015-LMWP-001645.

LUST:

Global Id: T0607302510
Contact Type: Local Agency Caseworker
Contact Name: TERESA SHERMAN
Organization Name: SAN DIEGO COUNTY LOP
Address: P.O. Box 129261
City: San Diego
Email: teresa.sherman@sdcounty.ca.gov
Phone Number: Not reported

LUST:

Global Id: T0607302510
Action Type: RESPONSE
Date: 02/05/2013
Action: Site Assessment Report - Regulator Responded

Global Id: T0607302510
Action Type: Other
Date: 08/26/1998
Action: Leak Reported

Global Id: T0607302510
Action Type: RESPONSE
Date: 03/18/2014
Action: Request for Closure - Regulator Responded

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 09/24/2015
Action: Closure/No Further Action Letter

Global Id: T0607302510
Action Type: RESPONSE
Date: 04/16/2013
Action: Other Report / Document

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 07/13/2009
Action: Letter - Notice

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 01/19/2010
Action: Letter - Notice

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 11/23/2010
Action: Technical Correspondence / Assistance / Other

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 10/05/2011
Action: Technical Correspondence / Assistance / Other

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 08/25/2010
Action: Letter - Notice

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 09/21/2011
Action: Technical Correspondence / Assistance / Other

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 03/08/2011
Action: Technical Correspondence / Assistance / Other

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 01/10/2012
Action: Technical Correspondence / Assistance / Other

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 10/01/2012
Action: Technical Correspondence / Assistance / Other

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 04/10/2013
Action: Technical Correspondence / Assistance / Other

Global Id: T0607302510
Action Type: RESPONSE
Date: 12/03/2014
Action: Fact Sheets - Public Participation

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 04/16/2013
Action: Technical Correspondence / Assistance / Other

Global Id: T0607302510
Action Type: ENFORCEMENT
Date: 12/03/2013
Action: Technical Correspondence / Assistance / Other

Global Id: T0607302510
Action Type: ENFORCEMENT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Date:	12/05/2013
Action:	Technical Correspondence / Assistance / Other
Global Id:	T0607302510
Action Type:	ENFORCEMENT
Date:	05/19/2015
Action:	Technical Correspondence / Assistance / Other
Global Id:	T0607302510
Action Type:	ENFORCEMENT
Date:	05/01/2014
Action:	Technical Correspondence / Assistance / Other
Global Id:	T0607302510
Action Type:	ENFORCEMENT
Date:	04/09/2015
Action:	Technical Correspondence / Assistance / Other
Global Id:	T0607302510
Action Type:	RESPONSE
Date:	02/03/2015
Action:	Correspondence
Global Id:	T0607302510
Action Type:	Other
Date:	04/28/1998
Action:	Leak Began
Global Id:	T0607302510
Action Type:	Other
Date:	04/28/1998
Action:	Leak Discovery
Global Id:	T0607302510
Action Type:	ENFORCEMENT
Date:	10/07/1998
Action:	Notice of Responsibility
Global Id:	T0607302510
Action Type:	Other
Date:	04/28/1998
Action:	Leak Stopped
Global Id:	T0607302510
Action Type:	RESPONSE
Date:	10/15/2010
Action:	Preliminary Site Assessment Workplan - Regulator Responded
Global Id:	T0607302510
Action Type:	RESPONSE
Date:	12/31/2010
Action:	Soil and Water Investigation Workplan - Regulator Responded
Global Id:	T0607302510
Action Type:	RESPONSE
Date:	07/01/2011
Action:	Site Assessment Report - Regulator Responded

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Global Id: T0607302510
Action Type: RESPONSE
Date: 12/05/2011
Action: Soil and Water Investigation Workplan - Regulator Responded

LUST:

Global Id: T0607302510
Status: Completed - Case Closed
Status Date: 09/24/2015

Global Id: T0607302510
Status: Open - Case Begin Date
Status Date: 04/28/1998

Global Id: T0607302510
Status: Open - Eligible for Closure
Status Date: 05/01/2014

Global Id: T0607302510
Status: Open - Eligible for Closure
Status Date: 05/18/2015

Global Id: T0607302510
Status: Open - Site Assessment
Status Date: 10/07/1998

Global Id: T0607302510
Status: Open - Site Assessment
Status Date: 01/13/2009

Global Id: T0607302510
Status: Open - Site Assessment
Status Date: 12/09/2009

Global Id: T0607302510
Status: Open - Site Assessment
Status Date: 01/13/2010

Global Id: T0607302510
Status: Open - Site Assessment
Status Date: 06/19/2014

SAN DIEGO CO. SAM:

Case Number: H19194-001
Agency: DEH Site Assessment & Mitigation
Funding: **Non Billable**
Facility Type: Failed Integrity Test
Facility Status: Closed Case
Date: 10/27/1988
Date Began: 10/21/1987

Case Number: H19194-002
Agency: DEH Site Assessment & Mitigation
Funding: **Non Billable**
Facility Type: Failed Integrity Test

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Facility Status: Closed Case
Date: 11/8/1995
Date Began: 9/15/1995

Case Number: H19194-003
Agency: DEH Site Assessment & Mitigation
Funding: Non Billable
Facility Type: Failed Integrity Test
Facility Status: Closed Case
Date: 10/1/1998
Date Began: 9/15/1995

Case Number: H19194-004
Agency: DEH Site Assessment & Mitigation
Funding: LOP - State Fund
Facility Type: Soils Only
Facility Status: Preliminary Assessment
Date: 10/7/1998
Date Began: 4/28/1998

Case Number: H19194-005
Agency: DEH Site Assessment & Mitigation
Funding: LOP - State Fund
Facility Type: Soils Only
Facility Status: Closed Case
Date: 1/26/2010
Date Began: 2/17/1999

CPS-SLIC:

Region: STATE
Facility Status: Completed - Case Closed
Status Date: 10/01/1998
Global Id: T0608180826
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H19194-003
Latitude: 32.811457205733
Longitude: -117.150918501063
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Under Investigation
Potential Contaminants of Concern: Diesel
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

Region: STATE
Facility Status: Completed - Case Closed
Status Date: 10/27/1988
Global Id: T0608142426
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H19194-001
Latitude: 32.8114867234296
Longitude: -117.151030081547
Case Type: Cleanup Program Site

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

Region: STATE
Facility Status: Completed - Case Closed
Status Date: 11/08/1995
Global Id: T0608159447
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H19194-002
Latitude: 32.811349
Longitude: -117.15097
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Under Investigation
Potential Contaminants of Concern: Gasoline
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: cal000209336
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 858-636-4850
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 07/06/2018
Facility Owner: Not reported
Facility Mailing Address: 3870 KEARNY VILLA RD, SAN DIEGO, CA 92123
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5873094
Return To Compliance Date: 2018-09-05T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2018-05-02T15:17:00.000
Violation Code: 1010017 HMBP not readily available to facility personnel or the CUPA.
HSC 25505(c)

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 5040725
Return To Compliance Date: 2017-04-11T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2016-03-22T14:40:00.000
Violation Code: 3010002 Failed to obtain and/or maintain an active EPA ID. 22 CCR
66262.12

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5873094
Return To Compliance Date: 2018-09-05T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2018-05-02T15:17:00.000
Violation Code: 1010006 Failed to update HMBP in CERS within 30 days of a substantial
change to any portion of the HMBP, including inventory changes or
facility information. HSC 25508.1(a-f); 19 CCR 2654(d); SDCC
68.904(c)(6)

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4113518
Return To Compliance Date: 2014-03-05T00:00:00.000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2014-03-05T10:34:00.000
Violation Code: 3030007 Failure to properly label hazardous waste accumulation containers with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.; 22 CCR 12 66262.34(f).

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5873094
Return To Compliance Date: 2018-05-31T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2018-05-02T15:17:00.000
Violation Code: 1020002 Initial &/or annual employee training not conducted in safety procedures for a hazardous material release or threatened release &/or employee training records not available or not maintained for 3 years. HSC 25505(a)(4); 19 CCR 2659(b)

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4113518
Return To Compliance Date: 2016-03-22T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2014-03-05T10:34:00.000
Violation Code: 3030019 Failure to inspect hazardous waste storage areas at least weekly.; 22 CCR 12 66262.34(d)(2); 40 CFR 1 265.174.

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 5040725
Return To Compliance Date: 2016-03-22T00:00:00.000
Nov: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2016-03-22T14:40:00.000
Violation Code: HMD0226 Did not accumulate waste in a container or tank. (40 CFR 262.34(d)(2).) 22 CCR 66262.34(d)(2)

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5873094
Return To Compliance Date: 2018-09-05T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2018-05-02T15:17:00.000
Violation Code: 1010008 HMBP not certified annually as complete and accurate in CERS. HSC 25508(a)(1)(A), 25508.2, 19 CCR 2654(b)

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5040725
Return To Compliance Date: 2016-03-22T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2016-03-22T14:40:00.000
Violation Code: 1010006 HMBP not updated to reflect inventory changes or facility information. HSC 25508.1(a-e)

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5873094
Return To Compliance Date: 2018-09-05T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2018-05-02T15:17:00.000
Violation Code: 1010005 Site map not submitted in CERS or not sufficient. HSC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

25505(a)(2); 25508.1(f); 19 CCR 2652(a)(3)

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4113518
Return To Compliance Date: 2016-03-22T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2014-03-05T10:34:00.000
Violation Code: 3010010 Failure to maintain uniform hazardous waste manifest, consolidated manifest, or bills of lading copies for three years.; 22 CCR 12 66262.40(a).

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 5040725
Return To Compliance Date: 2016-03-22T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2016-03-22T14:40:00.000
Violation Code: 3030017 Failed to properly close hazardous waste container(s). (40 CFR 262.34(d)(2); 265.173.) 22 CCR 66262.34(d)(2)

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 5873094
Return To Compliance Date: 2018-06-26T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2018-05-02T15:17:00.000
Violation Code: 3010010 Failed to maintain copies of Uniform Hazardous Waste Manifest, consolidated manifest, or Bills of Lading for 3 years. HSC 25160.2(b)(3), 25185(a)(4); 22 CCR 66262.40(a), 66262.23(a)(3)

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 4113518
Return To Compliance Date: 2014-11-18T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2014-03-05T10:34:00.000
Violation Code: 1010008 Failure to submit inventory reports (Activities, Owner/Operator, Hazardous Materials Descriptions and Map pages, if required. Documentation must be resubmitted (for facilities which exceed EPCRA thresholds) or re-certified (for facilities which do not exceed EPCRA thresholds) by March 1; 19 CCR 4 2729.4(b), 2729.5.

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 4113518
Return To Compliance Date: 2014-11-18T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2014-03-05T10:34:00.000
Violation Code: 1010006 Failure to update hazardous material inventory within 30 days when one of the following occurs: A 100 percent or more increase in the quantity of a previously disclosed material; Any handling of a previously undisclosed hazardous materials; A change of business address, business ownership, or business name; 19 CCR 4 2729.4(d); HSC 6.95 25505(b), 25510.

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5040725
Return To Compliance Date: 2016-03-22T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2016-03-22T14:40:00.000
Violation Code: HMD1013 HMBP not readily available for review. HSC 25505(c)

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Active Permit: Y
Facility Id Number: 37-000-216243
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5040725
Return To Compliance Date: 2016-03-22T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:15:35.000
Inspection Date: 2016-03-22T14:40:00.000
Violation Code: 1010008 HMBP not certified annually as complete and accurate in CERS.
HSC 25508.2

Waste and Materials:

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0101292
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-11-04T02:34:08.000
Chemical Name: LUBRICATING OILS
Common Name: LUBRICATING OILS
Case Number: 72623-86-0

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0083254
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-11-04T02:34:08.000
Chemical Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Common Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Case Number: Not reported

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0083255
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-11-04T02:34:08.000
Chemical Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Common Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Case Number: Not reported

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0083256
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-11-04T02:34:08.000
Chemical Name: WASTE 135 UNSPECIFIED AQUEOUS SOLUTION

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Common Name:	PARTS WASHER
Case Number:	Not reported
Record ID:	DEH2012-HUPFP-216243
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0083257
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-11-04T02:34:08.000
Chemical Name:	WASTE OIL
Common Name:	WASTE OIL
Case Number:	Not reported
Record ID:	DEH2012-HUPFP-216243
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0083258
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-11-04T02:34:08.000
Chemical Name:	WASTE 223 UNSPECIFIED OIL CONTAINING WASTE
Common Name:	OIL ABSORBENT
Case Number:	Not reported
Record ID:	DEH2012-HUPFP-216243
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0083259
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-11-04T02:34:08.000
Chemical Name:	ETHYLENE GLYCOL
Common Name:	NEW AND USED ANTI FREEZE
Case Number:	Not reported
Record ID:	DEH2012-HUPFP-216243
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0166973
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T22:15:35.000
Chemical Name:	ANTI FREEZE
Common Name:	USED ANTI-FREEZE
Case Number:	Not reported
Record ID:	DEH2012-HUPFP-216243
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0193197
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-26T22:15:35.000
Chemical Name:	ANTI-FREEZE
Common Name:	NEW ANTI-FREEZE
Case Number:	107-21-1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0193198
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T22:15:35.000
Chemical Name: LUBRICATING OILS
Common Name: LUBRICATING OILS
Case Number: 72623-86-0

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0166974
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T22:15:35.000
Chemical Name: ARMAKLEEN 4 IN 1 CLEANER
Common Name: PARTS WASHER
Case Number: Not reported

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0166975
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T22:15:35.000
Chemical Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Common Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Case Number: Not reported

Record ID: DEH2012-HUPFP-216243
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0166976
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T22:15:35.000
Chemical Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Common Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Case Number: Not reported

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000006175
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: (858) 573-1353
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 06/20/2018
Facility Owner: Not reported
Facility Mailing Address: 3870 KEARNY VILLA RD, SAN DIEGO, CA 92123-1702
Facility Mailing City: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: Y
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-119194
Program Element: Hazardous Waste Generator
Inspection Type: Return To Compliance (RTC)
Inspection Number: 4857462
Return To Compliance Date: 2013-05-31T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-20T00:00:00.000
Inspection Date: 2013-05-01T07:37:00.000
Violation Code: 3030019 Failure to inspect hazardous waste storage areas at least weekly.; 22 CCR 12 66262.34(d)(2); 40 CFR 1 265.174.

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-119194
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4886083
Return To Compliance Date: 2014-03-05T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-20T00:00:00.000
Inspection Date: 2014-03-04T10:50:00.000
Violation Code: 3030007 Failure to properly label hazardous waste accumulation containers with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.; 22 CCR 12 66262.34(f).

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-119194
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4834582
Return To Compliance Date: 2013-07-01T00:00:00.000
Nov: No
Violation Classification: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-20T00:00:00.000
Inspection Date: 2013-05-01T10:13:00.000
Violation Code: 3030019 Failure to inspect hazardous waste storage areas at least weekly.; 22 CCR 12 66262.34(d)(2); 40 CFR 1 265.174.

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-119194
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 4087469
Return To Compliance Date: 2013-03-13T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 24413
Container/Tank Id: Not reported
Last Update: 2018-06-20T00:00:00.000
Inspection Date: 2013-03-05T14:49:00.000
Violation Code: 2030012 Failure to comply with one or more of the following: provide training to facility employee(s) responsible for proper operation and maintenance every 12 months and/or train new employee(s) who are responsible for proper operation and maintenance within 30-days of hire and/or to have at least one employee present during operating hours that has been trained in the proper operation and maintenance of the UST system. 23 CCR 16 2715(c)(6), 2715(f)

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-119194
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 4859685
Return To Compliance Date: 2015-03-04T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 24413
Container/Tank Id: Not reported
Last Update: 2018-06-20T00:00:00.000
Inspection Date: 2015-03-04T00:00:00.000
Violation Code: 2030036 Failure of the overfill prevention system to meet one of the following requirements: 1. Alert the transfer operator when the tank is 90 percent full by restricting the flow into the tank or triggering an audible and visual alarm; or 2. Restrict delivery of flow to the tank at least 30 minutes before the tank overfills, provided the restriction occurs when the tank is filled to no more than 95 percent of capacity; and activate an audible alarm at least five minutes before the tank overfills; or 3. Provide positive shut-off of flow to the tank when the tank is filled to no more than 95 percent of capacity; or 4. Provide positive shut-off of flow to the tank so that none of the fittings located on the top of the tank are exposed to product due to overfilling. 23 CCR 16 2635(b)(2), 2665.

Record ID: DEH2002-HUPFP-119194

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-119194
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Return To Compliance (RTC)
Inspection Number: 4857462
Return To Compliance Date: 2013-06-14T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-20T00:00:00.000
Inspection Date: 2013-05-01T07:37:00.000
Violation Code: 1020002 Failure to include provisions in the business plan to ensure that appropriate personnel receive initial and annual training. 19 CCR 4 2732(b); HSC 6.95 25504(c).

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-119194
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4886083
Return To Compliance Date: 2014-04-04T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-20T00:00:00.000
Inspection Date: 2014-03-04T10:50:00.000
Violation Code: 3030010 Failure to dispose of hazardous waste within 180 days (or 270 if waste is transported over 200 miles) for the generator who generates less than 1000 kilogram per month, but more than 100 kilograms per month.; 22 CCR 12 66262.34(d).

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-119194
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4886083
Return To Compliance Date: 2014-04-04T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-20T00:00:00.000
Inspection Date: 2014-03-04T10:50:00.000
Violation Code: 3030013 Failure to accumulate hazardous waste in a container that is in good condition.; 22 CCR 12 66262.34(d)(2); 40 CFR 1 265.171.

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-119194

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 4087469
Return To Compliance Date: 2013-03-05T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 24414
Container/Tank Id: Not reported
Last Update: 2018-06-20T00:00:00.000
Inspection Date: 2013-03-05T14:49:00.000
Violation Code: 2030054 Failure to comply with one or more of the following: maintain the spill bucket in good condition, containment free of debris/liquid, and/or to remove the contents of the spill bucket when a release/leak/spill was observed. 23 CCR 16 2635(b), 2715(c)(2)

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-119194
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 4834582
Return To Compliance Date: 2013-07-01T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-20T00:00:00.000
Inspection Date: 2013-05-01T10:13:00.000
Violation Code: 1020001 Failure to include an adequate training program in the business plan, which is reasonable and appropriate for the size of the business and the nature of the hazardous material handled; 19 CCR 4 2732(a); HSC 6.95 25504(c).

UST DTL:

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-119194
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: SDCTY-FIRE-RESCUE DEPT
Tankid: 24413
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2018-06-20T02:32:46.000
Tank Capacityin Gallons: 1000
Tank Contents: Regular Unleaded
Type Of Tank: Double Wall

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-119194
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: SDCTY-FIRE-RESCUE DEPT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Tankid: 24414
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Hazardous Waste (includes used oil)
Piping System Type: Gravity
Last Updated: 2018-06-20T02:32:46.000
Tank Capacityin Gallons: 1000
Tank Contents: Used Oil
Type Of Tank: Double Wall

Waste and Materials:

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0178852
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-20T02:32:46.000
Chemical Name: Oxygen Gas
Common Name: Oxygen Gas
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0178853
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-20T02:32:46.000
Chemical Name: Chemguard Class A Firefighting Foam
Common Name: Chemguard Class A Firefighting Foam
Case Number: Not reported

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0178854
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-20T02:32:46.000
Chemical Name: Chemguard 3% AR-AFFF C-333
Common Name: Chemguard Class B Firefighting Foam
Case Number: Not reported

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0178857
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-20T02:32:46.000
Chemical Name: TruFuel Oil and Fuel Mix
Common Name: TruFuel
Case Number: Not reported

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Active Permit: Y
Child Record Id: DEH2018-HCHEM-0178858
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-20T02:32:46.000
Chemical Name: Ethylene Glycol Solution
Common Name: Coolant
Case Number: Not reported

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0178859
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-20T02:32:46.000
Chemical Name: Acetylene Gas
Common Name: Acetylene Gas
Case Number: 74-86-2

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153306
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-20T02:32:46.000
Chemical Name: Waste Oil - UST
Common Name: Waste Oil - UST
Case Number: Not reported

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153307
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-20T02:32:46.000
Chemical Name: Water Containing Gasoline
Common Name: Water Containing Gasoline
Case Number: Not reported

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133052
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-12-27T01:41:49.000
Chemical Name: REGULAR UNLEADED
Common Name: GASOLINE, UNDERGROUND TANK 119194 T006
Case Number: 8006-61-9

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133053

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-12-27T01:41:49.000
Chemical Name:	OXYGEN
Common Name:	OXYGEN
Case Number:	7782-44-7
Record ID:	DEH2002-HUPFP-119194
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133054
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-12-27T01:41:49.000
Chemical Name:	CHEMGUARD CLASS A FIREFIGHTING FOAM
Common Name:	CHEMGUARD CLASS A FIREFIGHTING FOAM
Case Number:	Varies
Record ID:	DEH2002-HUPFP-119194
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133055
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-12-27T01:41:49.000
Chemical Name:	CHEMGUARD 3% AR-AFFF C-333
Common Name:	CHEMGUARD CLASS B FIREFIGHTING FOAM
Case Number:	Varies
Record ID:	DEH2002-HUPFP-119194
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133056
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-12-27T01:41:49.000
Chemical Name:	BlueDEF Diesel Exhaust Fluid
Common Name:	BlueDEF Diesel Exhaust Fluid
Case Number:	57-13-6
Record ID:	DEH2002-HUPFP-119194
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133057
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-12-27T01:41:49.000
Chemical Name:	15-40 OIL
Common Name:	MOTOR OIL
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-119194
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133058
Trade Secret:	N
Hazardous Material Type:	Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Last Updated: 2017-12-27T01:41:49.000
Chemical Name: TruFuel
Common Name: TruFuel
Case Number: Not reported

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133059
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-12-27T01:41:49.000
Chemical Name: Ethylene Glycol
Common Name: Coolant
Case Number: 107-21-1

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133060
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-12-27T01:41:49.000
Chemical Name: ACETYLENE
Common Name: ACETYLENE
Case Number: 74-86-2

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111355
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-12-27T01:41:49.000
Chemical Name: WASTE OIL & MIXED OIL, UNDERGROUND TANK 119194 T007
Common Name: WASTE OIL, UNDERGROUND TANK 119194 T007
Case Number: Not reported

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111356
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-12-27T01:41:49.000
Chemical Name: WATER CONTAMINATED WITH GASOLINE
Common Name: WATER CONTAMINATED WITH GASOLINE
Case Number: Not reported

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0178851
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-20T02:32:46.000
Chemical Name: Gasoline - UST

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Common Name: Gasoline - UST
Case Number: 86290-81-5

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0178855
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-20T02:32:46.000
Chemical Name: BlueDEF Diesel Exhaust Fluid
Common Name: BlueDEF Diesel Exhaust Fluid
Case Number: Not reported

Record ID: DEH2002-HUPFP-119194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0178856
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-20T02:32:46.000
Chemical Name: Motor Oil
Common Name: Motor Oil
Case Number: 64742-54-7

Permit Number: 119194
Business Type: 6HK24
EPA Id Number: CAL000006175
APN: 421-290-09-00
Last HMMD Inspection: 03/23/2012
Facility Telephone: 858-573-1353
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: CITY OF SAN DIEGO
Facility Mailing Address: 3870 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1702
UST Owner: CITY OF SAN DIEGO
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Y
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 74-86-2
Name: ACETYLENE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Permit Number: 119194
Update Date: 11/02/2012
Case Number: VARIOUS
Name: ANSULITE 3X3 LOW VISCOSITY FOAM
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 107-21-1
Name: ANTIFREEZE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 7440-37-1
Name: ARGON
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: MIXTURE
Name: ARGON 75% CARBON DIOXIDE 25%
Other Information: COMPRESSED GAS
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: AUTOMOTICE AIR CONDITIONING FLUSH
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: BRAKE CLEAN IH
Other Information: VARIES
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 124-38-9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Name: CARBON DIOXIDE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 67-56-1
Name: METHANOL
Other Information: ZEP KLEAR
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING: HYDRAULIC OIL, MOTOR OIL, GEAR, ATF
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: VARIOUS
Name: PHOS-CHEK
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 68476-85-7
Name: PROPANE
Other Information: Not reported
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 8006-61-9
Name: REGULAR UNLEADED
Other Information: UNDERGROUND TANK 119194 T006
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: VARIES
Name: SILV-EX FOAM CONCENTRATE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG
Other Information: MIRACHEM 500 CLEANER/DEGREASER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG*
Other Information: QSOL 220 CLEANING SOLVENT
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: WASTE ANTIFREEZE, RCYLD ONSITE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 212 OXYGENATED SOLVENTS
Other Information: AQUEOUS BRAKE WASHER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: INCLUDES OFF SITE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY DEBRIS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: PLASTIC FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 311 PHARMACEUTICAL WASTE
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 311 PHARMACEUTICAL WASTE
Other Information: NON RCRA
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information: WASTE BRAKE FLUID
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Name: WASTE 444 USED BATTERIES
Other Information: BATTERY SYSTEMS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: OIL & GAS FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information: RED BAGS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2007
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2007
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/13/2007

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or
DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/13/2007
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment
(UDC):Line leak detector is not installed, not functional, or not
tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank.
66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment
(UDC):Line leak detector is not installed, not functional, or not
tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR
66265.173(a)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV3405
Violation: LLD DOESN'T DETECT 3.0 GPH OR EQUIVA
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not detect 3.0 gph or equivalent? 2636(f)(2)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV3251
Violation: MONITOR IN ALARM AT START OF INSPECTION
Violation Citation: Monitor in alarm at beginning of inspection. Alarm not investigated, recorded or reported. 2632 (c)(2)(B), 2650(e)(3)&(4), 2630(d)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV3261
Violation: DISPENSER CONTAINMENT NOT DRY
Violation Citation: Dispenser containment not free of liquid. 2631(d)(4)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional. 2630, 2641(j), 2632

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)

Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV4203
Violation: MED WASTE STORAGE NOT SECURED
Violation Citation: Generator has not secured the enclosure or designated accumulation area for medical waste containers so as to deny access to unauthorized persons. 118307, 118310
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV0210
Violation: DID NOT CLEAN SPILL TO FLOOR
Violation Citation: Failure to clean up hazardous waste off of floor surface. 66262.10b
Activity: ACTIVE

Permit Number: 119194

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV4205
Violation: MED SOLID WASTE NOT SECURED TO DENY ACCE
Violation Citation: Medical Solid Waste not secured to deny access to unauthorized persons. 68.1211
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/02/2012
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/02/2012
Violation Code: 6HV3267
Violation: DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation: Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name, address, and phone number. 68.1205
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV0132
Violation: EPA ID NUMBER NOT OBTAINED/MAINTAINED
Violation Citation: Generator of hazardous waste has not obtained/maintained an EPA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

identification number. CCR 66262.12(a)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel filters. 25250.22 and 66266.130(c)(3)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR 262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Violation Code: 6HV3255
Violation: SPILL CONTAIN. NOT DRY/IN GOOD CONDITION
Violation Citation: Spill container is not in good condition and/or liquid free.
2635(b)(1), 2636(a)(1)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained
onsite to document proper disposal of hazardous waste. CCR 66262.40(a)
& 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0307
Violation: ILLEGAL DISPOSAL OF UNIVERSAL WASTE
Violation Citation: Disposal of universal waste to an unauthorized point. 25189.5(a);
SQH:66273.11(a); LQH: 66273.31(a)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel
filters. 25250.22 and 66266.130(c)(3)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0224
Violation: MISMANAGED EMPTY CONTAINERS >5GALS.
Violation Citation: Failed to mark date on empty container larger than 5 gallons and/or
manage it within one year. 66261.7(e) & (f).
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR
66265.173(a)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0205
Violation: WASTE CONTAINER: POOR CONDITION
Violation Citation: Failed to transfer hazardous waste from a container that leaked or was in poor condition to another container in good condition. CCR 66265.171
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV4213
Violation: NO LABEL: LIDS/SIDES OF CONTAINER
Violation Citation: Did not label waste container/bin on the lid and side so as to be clearly visible. 118280(b)
Activity: ACTIVE

UST:
UST Name: UNDERGROUND TANK 119194 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF01
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1988-10-17 00:00:00
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 119194 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Capacity Gallons:	1000
UST Contents:	REGULAR UNLEADED
Other Content Info:	REGULAR UNLEADED
Reg Status:	REMOVED
Remove Close Date:	1999-02-17 00:00:00
Year Installed:	1966-01-01 00:00:00
Pipe Type:	SINGLE WALL
Delivery System:	SUCTION
Monitor Code:	06
UST Monitor Method:	SW TANK SW SUCTION PIPE W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK TEST ANNUAL (EXEMPT IF UST < 551 GAL), PIPE TEST TRIENNIALLY
UST Name:	UNDERGROUND TANK 119194 T003
Last Update:	2012-11-02 14:17:38
Permit Number:	119194
Tank Type:	SINGLE WALL
Additional Id:	RF03
Capacity Gallons:	550
UST Contents:	DIESEL
Other Content Info:	DIESEL
Reg Status:	REMOVED
Remove Close Date:	Not reported
Year Installed:	1966-01-01 00:00:00
Pipe Type:	SINGLE WALL
Delivery System:	SUCTION
Monitor Code:	06
UST Monitor Method:	SW TANK SW SUCTION PIPE W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK TEST ANNUAL (EXEMPT IF UST < 551 GAL), PIPE TEST TRIENNIALLY
UST Name:	UNDERGROUND TANK 119194 T004
Last Update:	2012-11-02 14:17:38
Permit Number:	119194
Tank Type:	SINGLE WALL
Additional Id:	RF04
Capacity Gallons:	550
UST Contents:	Not reported
Other Content Info:	WASTE OIL
Reg Status:	REMOVED
Remove Close Date:	1999-02-17 00:00:00
Year Installed:	1966-01-01 00:00:00
Pipe Type:	SINGLE WALL
Delivery System:	GRAVITY
Monitor Code:	06
UST Monitor Method:	SW TANK SW SUCTION PIPE W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK TEST ANNUAL (EXEMPT IF UST < 551 GAL), PIPE TEST TRIENNIALLY
UST Name:	UNDERGROUND TANK 119194 T006
Last Update:	2012-11-02 14:17:38
Permit Number:	119194
Tank Type:	DOUBLE WALL
Additional Id:	NT2119, RT4166
Capacity Gallons:	1000
UST Contents:	REGULAR UNLEADED
Other Content Info:	REGULAR UNLEADED
Reg Status:	ACTIVE
Remove Close Date:	Not reported
Year Installed:	1999-01-01 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 31B
UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ DRY TANK ANNULAR; POSITIVE SHUT-OFF & FAILSAFE, 3.0LLD; UDC W/ MECHANICAL FLOAT

UST Name: UNDERGROUND TANK 119194 T007
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: DOUBLE WALL
Additional Id: NT2119
Capacity Gallons: 1000
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1999-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 21
UST Monitor Method: DW TANK DW SUCTION AND/ OR GRAVITY PIPING WITH INTERSTITIAL MONITORS: INTERSTITIAL.

Permit Number: 119194
Business Type: 6HK24
EPA Id Number: CAL000006175
APN: 421-290-09-00
Last HMMMD Inspection: 03/23/2012
Facility Telephone: 858-573-1353
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: CITY OF SAN DIEGO
Facility Mailing Address: 3870 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1702
UST Owner: CITY OF SAN DIEGO
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Y
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 74-86-2
Name: ACETYLENE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Case Number: VARIOUS
Name: ANSULITE 3X3 LOW VISCOSITY FOAM
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 107-21-1
Name: ANTIFREEZE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 7440-37-1
Name: ARGON
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: MIXTURE
Name: ARGON 75% CARBON DIOXIDE 25%
Other Information: COMPRESSED GAS
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: AUTOMOTICE AIR CONDITIONING FLUSH
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: BRAKE CLEAN IH
Other Information: VARIES
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 124-38-9
Name: CARBON DIOXIDE
Other Information: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 67-56-1
Name: METHANOL
Other Information: ZEP KLEAR
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING: HYDRAULIC OIL, MOTOR OIL, GEAR, ATF
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: VARIOUS
Name: PHOS-CHEK
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 68476-85-7
Name: PROPANE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 8006-61-9
Name: REGULAR UNLEADED
Other Information: UNDERGROUND TANK 119194 T006
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: VARIES
Name: SILV-EX FOAM CONCENTRATE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG
Other Information: MIRACHEM 500 CLEANER/DEGREASER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG*
Other Information: QSOL 220 CLEANING SOLVENT
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: WASTE ANTIFREEZE, RCYLD ONSITE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 212 OXYGENATED SOLVENTS
Other Information: AQUEOUS BRAKE WASHER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: INCLUDES OFF SITE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY DEBRIS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: PLASTIC FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 311 PHARMACEUTICAL WASTE
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 311 PHARMACEUTICAL WASTE
Other Information: NON RCRA
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information: WASTE BRAKE FLUID
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 444 USED BATTERIES
Other Information: BATTERY SYSTEMS
Material Waste: Waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: OIL & GAS FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information: RED BAGS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2007
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2007
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/13/2007
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Activity: DO inspection reports not onsite 2715 (c)(d)(e)
ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/13/2007
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Activity: ACTIVE

Permit Number: 119194

Update Date: 11/02/2012

Inspection Date: 03/12/2003

Violation Code: 6HV3405

Violation: LLD DOESN'T DETECT 3.0 GPH OR EQUIVA

Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not detect 3.0 gph or equivalent? 2636(f)(2)

Activity: ACTIVE

Permit Number: 119194

Update Date: 11/02/2012

Inspection Date: 03/12/2003

Violation Code: 6HV3257

Violation: 2NDRY CONTAINMENT NOT LIQUID FREE

Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)

Activity: ACTIVE

Permit Number: 119194

Update Date: 11/02/2012

Inspection Date: 03/16/2005

Violation Code: 6HV3251

Violation: MONITOR IN ALARM AT START OF INSPECTION

Violation Citation: Monitor in alarm at beginning of inspection. Alarm not investigated, recorded or reported. 2632 (c)(2)(B), 2650(e)(3)&(4), 2630(d)

Activity: ACTIVE

Permit Number: 119194

Update Date: 11/02/2012

Inspection Date: 03/16/2005

Violation Code: 6HV3261

Violation: DISPENSER CONTAINMENT NOT DRY

Violation Citation: Dispenser containment not free of liquid. 2631(d)(4)

Activity: ACTIVE

Permit Number: 119194

Update Date: 11/02/2012

Inspection Date: 03/16/2005

Violation Code: 6HV3263

Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL

Violation Citation: Monitoring system components &/or devices are not all functional. 2630, 2641(j), 2632

Activity: ACTIVE

Permit Number: 119194

Update Date: 11/02/2012

Inspection Date: 03/16/2005

Violation Code: 6HV0201

Violation: WASTE CONTAINER NOT CLOSED

Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)

Activity: ACTIVE

Permit Number: 119194

Update Date: 11/02/2012

Inspection Date: 03/16/2005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV4203
Violation: MED WASTE STORAGE NOT SECURED
Violation Citation: Generator has not secured the enclosure or designated accumulation area for medical waste containers so as to deny access to unauthorized persons. 118307, 118310
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV0210
Violation: DID NOT CLEAN SPILL TO FLOOR
Violation Citation: Failure to clean up hazardous waste off of floor surface. 66262.10b
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV3257

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV4205
Violation: MED SOLID WASTE NOT SECURED TO DENY ACCE
Violation Citation: Medical Solid Waste not secured to deny access to unauthorized persons. 68.1211
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/02/2012
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/02/2012
Violation Code: 6HV3267
Violation: DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation: Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name, address, and phone number. 68.1205
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV0132
Violation: EPA ID NUMBER NOT OBTAINED/MAINTAINED
Violation Citation: Generator of hazardous waste has not obtained/maintained an EPA identification number. CCR 66262.12(a)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel filters. 25250.22 and 66266.130(c)(3)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR 262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV3255
Violation: SPILL CONTAIN. NOT DRY/IN GOOD CONDITION
Violation Citation: Spill container is not in good condition and/or liquid free.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

2635(b)(1), 2636(a)(1)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0307
Violation: ILLEGAL DISPOSAL OF UNIVERSAL WASTE
Violation Citation: Disposal of universal waste to an unauthorized point. 25189.5(a); SQH:66273.11(a); LQH: 66273.31(a)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel filters. 25250.22 and 66266.130(c)(3)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0224
Violation: MISMANAGED EMPTY CONTAINERS >5GALS.
Violation Citation: Failed to mark date on empty container larger than 5 gallons and/or manage it within one year. 66261.7(e) & (f).

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0205
Violation: WASTE CONTAINER: POOR CONDITION
Violation Citation: Failed to transfer hazardous waste from a container that leaked or was in poor condition to another container in good condition. CCR 66265.171

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV4213
Violation: NO LABEL: LIDS/SIDES OF CONTAINER
Violation Citation: Did not label waste container/bin on the lid and side so as to be clearly visible. 118280(b)

Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 119194 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF01
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1988-10-17 00:00:00
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 119194 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF02
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Reg Status: REMOVED
Remove Close Date: 1999-02-17 00:00:00
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 06
UST Monitor Method: SW TANK SW SUCTION PIPE W/DAILY RECONCILIATION OR WEEKLY GAUGING:
TANK TEST ANNUAL (EXEMPT IF UST < 551 GAL), PIPE TEST TRIENNIALLY

UST Name: UNDERGROUND TANK 119194 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF03
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: Not reported
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 06
UST Monitor Method: SW TANK SW SUCTION PIPE W/DAILY RECONCILIATION OR WEEKLY GAUGING:
TANK TEST ANNUAL (EXEMPT IF UST < 551 GAL), PIPE TEST TRIENNIALLY

UST Name: UNDERGROUND TANK 119194 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF04
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1999-02-17 00:00:00
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: GRAVITY
Monitor Code: 06
UST Monitor Method: SW TANK SW SUCTION PIPE W/DAILY RECONCILIATION OR WEEKLY GAUGING:
TANK TEST ANNUAL (EXEMPT IF UST < 551 GAL), PIPE TEST TRIENNIALLY

UST Name: UNDERGROUND TANK 119194 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: DOUBLE WALL
Additional Id: NT2119, RT4166
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1999-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 31B

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ DRY TANK ANNULAR; POSITIVE SHUT-OFF & FAILSAFE, 3.0LLD; UDC W/ MECHANICAL FLOAT

UST Name: UNDERGROUND TANK 119194 T007

Last Update: 2012-11-02 14:17:38

Permit Number: 119194

Tank Type: DOUBLE WALL

Additional Id: NT2119

Capacity Gallons: 1000

UST Contents: Not reported

Other Content Info: WASTE OIL

Reg Status: ACTIVE

Remove Close Date: Not reported

Year Installed: 1999-01-01 00:00:00

Pipe Type: Not reported

Delivery System: Not reported

Monitor Code: 21

UST Monitor Method: DW TANK DW SUCTION AND/ OR GRAVITY PIPING WITH INTERSTITIAL MONITORS: INTERSTITIAL.

Permit Number: 216243

Business Type: 6HK10

EPA Id Number: Not reported

APN: 421-290-09-00

Last HMMD Inspection: 03/23/2012

Facility Telephone: 858-636-4850

Permit Status: OPEN

Permit Expiration: 11/30/2012

Date Last Updated: 11/02/2012

Facility Owner: RURAL/METRO SAN DIEGO

Facility Mailing Address: 3870 KEARNY VILLA RD

Facility Mailing City: SAN DIEGO

Facility Mailing State: CA

Facility Mailing Zip: 92123

UST Owner: Not reported

Handle Regulated Hazmat: Not reported

Own Or Operate UST: Not reported

Subject To APSA: Not reported

Generate Haz Waste: Not reported

Treat Haz Waste: Not reported

Generate Medical Waste: Y

Inventory Active Permits (SQG Medical):

Permit Number: 216243

Update Date: 11/02/2012

Case Number: Not reported

Name: WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION

Other Information: NON-RCRA HAZ WASTE

Material Waste: Waste

Hazardous Categories 1: Not reported

Hazardous Categories 2: Not reported

Permit Number: 216243

Update Date: 11/02/2012

Case Number: Not reported

Name: WASTE 901 INFECTIOUS WASTE, GENERAL

Other Information: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 216243
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Business Type: 6HK24
EPA Id Number: CAL000006175
APN: 421-290-09-00
Last HMMD Inspection: 03/23/2012
Facility Telephone: 858-573-1353
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: CITY OF SAN DIEGO
Facility Mailing Address: 3870 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1702
UST Owner: CITY OF SAN DIEGO
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 74-86-2
Name: ACETYLENE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: VARIOUS
Name: ANSULITE 3X3 LOW VISCOSITY FOAM
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 107-21-1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Name: ANTIFREEZE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 7440-37-1
Name: ARGON
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: MIXTURE
Name: ARGON 75% CARBON DIOXIDE 25%
Other Information: COMPRESSED GAS
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: AUTOMOTICE AIR CONDITIONING FLUSH
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: BRAKE CLEAN IH
Other Information: VARIES
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 124-38-9
Name: CARBON DIOXIDE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 67-56-1
Name: METHANOL
Other Information: ZEP KLEAR
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING: HYDRAULIC OIL, MOTOR OIL, GEAR, ATF
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: VARIOUS
Name: PHOS-CHEK
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 68476-85-7
Name: PROPANE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 8006-61-9
Name: REGULAR UNLEADED
Other Information: UNDERGROUND TANK 119194 T006
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Permit Number: 119194
Update Date: 11/02/2012
Case Number: VARIES
Name: SILV-EX FOAM CONCENTRATE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG
Other Information: MIRACHEM 500 CLEANER/DEGREASER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG*
Other Information: QSOL 220 CLEANING SOLVENT
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: WASTE ANTIFREEZE, RCYLD ONSITE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 212 OXYGENATED SOLVENTS
Other Information: AQUEOUS BRAKE WASHER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: INCLUDES OFF SITE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY DEBRIS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: PLASTIC FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 311 PHARMACEUTICAL WASTE
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 311 PHARMACEUTICAL WASTE
Other Information: NON RCRA
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information: WASTE BRAKE FLUID
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 444 USED BATTERIES
Other Information: BATTERY SYSTEMS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: OIL & GAS FILTERS
Material Waste: Waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information: RED BAGS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2007
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2007
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/13/2007
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/13/2007
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

(UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV3405
Violation: LLD DOESN'T DETECT 3.0 GPH OR EQUIVA
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not detect 3.0 gph or equivalent? 2636(f)(2)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV3251
Violation: MONITOR IN ALARM AT START OF INSPECTION
Violation Citation: Monitor in alarm at beginning of inspection. Alarm not investigated, recorded or reported. 2632 (c)(2)(B), 2650(e)(3)&(4), 2630(d)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV3261
Violation: DISPENSER CONTAINMENT NOT DRY
Violation Citation: Dispenser containment not free of liquid. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional. 2630, 2641(j), 2632
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Inspection Date: 03/16/2005
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV4203
Violation: MED WASTE STORAGE NOT SECURED
Violation Citation: Generator has not secured the enclosure or designated accumulation area for medical waste containers so as to deny access to unauthorized persons. 118307, 118310
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV0210
Violation: DID NOT CLEAN SPILL TO FLOOR
Violation Citation: Failure to clean up hazardous waste off of floor surface. 66262.10b
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV4205
Violation: MED SOLID WASTE NOT SECURED TO DENY ACCE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Violation Citation: Medical Solid Waste not secured to deny access to unauthorized persons. 68.1211
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/02/2012
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/02/2012
Violation Code: 6HV3267
Violation: DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation: Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name, address, and phone number. 68.1205
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV0132
Violation: EPA ID NUMBER NOT OBTAINED/MAINTAINED
Violation Citation: Generator of hazardous waste has not obtained/maintained an EPA identification number. CCR 66262.12(a)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 119194

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel filters. 25250.22 and 66266.130(c)(3)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR 262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV3255
Violation: SPILL CONTAIN. NOT DRY/IN GOOD CONDITION
Violation Citation: Spill container is not in good condition and/or liquid free. 2635(b)(1), 2636(a)(1)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0307
Violation: ILLEGAL DISPOSAL OF UNIVERSAL WASTE
Violation Citation: Disposal of universal waste to an unauthorized point. 25189.5(a); SQH:66273.11(a); LQH: 66273.31(a)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel filters. 25250.22 and 66266.130(c)(3)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0224
Violation: MISMANAGED EMPTY CONTAINERS >5GALS.
Violation Citation: Failed to mark date on empty container larger than 5 gallons and/or manage it within one year. 66261.7(e) & (f).

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0205
Violation: WASTE CONTAINER: POOR CONDITION
Violation Citation: Failed to transfer hazardous waste from a container that leaked or was in poor condition to another container in good condition. CCR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Activity: 66265.171
ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR
66265.16(d)&(e)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV4213
Violation: NO LABEL: LIDS/SIDES OF CONTAINER
Violation Citation: Did not label waste container/bin on the lid and side so as to be clearly visible. 118280(b)

Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 119194 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF01
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1988-10-17 00:00:00
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 119194 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF02
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1999-02-17 00:00:00
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 06
UST Monitor Method: SW TANK SW SUCTION PIPE W/DAILY RECONCILIATION OR WEEKLY GAUGING:
TANK TEST ANNUAL (EXEMPT IF UST < 551 GAL), PIPE TEST TRIENNIALLY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

UST Name: UNDERGROUND TANK 119194 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF03
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: Not reported
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 06
UST Monitor Method: SW TANK SW SUCTION PIPE W/DAILY RECONCILIATION OR WEEKLY GAUGING:
TANK TEST ANNUAL (EXEMPT IF UST < 551 GAL), PIPE TEST TRIENNIALLY

UST Name: UNDERGROUND TANK 119194 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF04
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1999-02-17 00:00:00
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: GRAVITY
Monitor Code: 06
UST Monitor Method: SW TANK SW SUCTION PIPE W/DAILY RECONCILIATION OR WEEKLY GAUGING:
TANK TEST ANNUAL (EXEMPT IF UST < 551 GAL), PIPE TEST TRIENNIALLY

UST Name: UNDERGROUND TANK 119194 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: DOUBLE WALL
Additional Id: NT2119, RT4166
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1999-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 31B
UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ DRY TANK ANNULAR; POSITIVE SHUT-OFF &
FAILSAFE, 3.0LLD; UDC W/ MECHANICAL FLOAT

UST Name: UNDERGROUND TANK 119194 T007
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: DOUBLE WALL
Additional Id: NT2119
Capacity Gallons: 1000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1999-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 21
UST Monitor Method: DW TANK DW SUCTION AND/ OR GRAVITY PIPING WITH INTERSTITIAL MONITORS: INTERSTITIAL.

Permit Number: 119194
Business Type: 6HK24
EPA Id Number: CAL000006175
APN: 421-290-09-00
Last HMMI Inspection: 03/23/2012
Facility Telephone: 858-573-1353
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: CITY OF SAN DIEGO
Facility Mailing Address: 3870 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1702
UST Owner: CITY OF SAN DIEGO
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Y
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 74-86-2
Name: ACETYLENE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: VARIOUS
Name: ANSULITE 3X3 LOW VISCOSITY FOAM
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 107-21-1
Name: ANTIFREEZE
Other Information: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	119194
Update Date:	11/02/2012
Case Number:	7440-37-1
Name:	ARGON
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	119194
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	ARGON 75% CARBON DIOXIDE 25%
Other Information:	COMPRESSED GAS
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	119194
Update Date:	11/02/2012
Case Number:	Not reported
Name:	AUTOMOTICE AIR CONDITIONING FLUSH
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	119194
Update Date:	11/02/2012
Case Number:	Not reported
Name:	BRAKE CLEAN IH
Other Information:	VARIES
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	119194
Update Date:	11/02/2012
Case Number:	124-38-9
Name:	CARBON DIOXIDE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	119194
Update Date:	11/02/2012
Case Number:	67-56-1
Name:	METHANOL
Other Information:	ZEP KLEAR
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING: HYDRAULIC OIL, MOTOR OIL, GEAR, ATF
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: VARIOUS
Name: PHOS-CHEK
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 68476-85-7
Name: PROPANE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: 8006-61-9
Name: REGULAR UNLEADED
Other Information: UNDERGROUND TANK 119194 T006
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: VARIES

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Name:	SILV-EX FOAM CONCENTRATE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	CHRONIC
Permit Number:	119194
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG
Other Information:	MIRACHEM 500 CLEANER/DEGREASER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	119194
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG*
Other Information:	QSOL 220 CLEANING SOLVENT
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	119194
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information:	WASTE ANTIFREEZE, RCYLD ONSITE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	119194
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 212 OXYGENATED SOLVENTS
Other Information:	AQUEOUS BRAKE WASHER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	119194
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	INCLUDES OFF SITE OIL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	119194
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information:	OILY DEBRIS
Material Waste:	Waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: PLASTIC FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 311 PHARMACEUTICAL WASTE
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 311 PHARMACEUTICAL WASTE
Other Information: NON RCRA
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information: WASTE BRAKE FLUID
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 444 USED BATTERIES
Other Information: BATTERY SYSTEMS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: OIL & GAS FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information: RED BAGS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 119194
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2007
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2007
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/13/2007
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/13/2007
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/12/2003
Violation Code: 6HV3405
Violation: LLD DOESN'T DETECT 3.0 GPH OR EQUIVA
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not detect 3.0 gph or equivalent? 2636(f)(2)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Inspection Date: 03/12/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV3251
Violation: MONITOR IN ALARM AT START OF INSPECTION
Violation Citation: Monitor in alarm at beginning of inspection. Alarm not investigated, recorded or reported. 2632 (c)(2)(B), 2650(e)(3)&(4), 2630(d)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV3261
Violation: DISPENSER CONTAINMENT NOT DRY
Violation Citation: Dispenser containment not free of liquid. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional. 2630, 2641(j), 2632
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

explosion or release. CCR 66265.31
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/16/2005
Violation Code: 6HV4203
Violation: MED WASTE STORAGE NOT SECURED
Violation Citation: Generator has not secured the enclosure or designated accumulation area for medical waste containers so as to deny access to unauthorized persons. 118307, 118310

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV0210
Violation: DID NOT CLEAN SPILL TO FLOOR
Violation Citation: Failure to clean up hazardous waste off of floor surface. 66262.10b

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)

Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV4205
Violation: MED SOLID WASTE NOT SECURED TO DENY ACCE
Violation Citation: Medical Solid Waste not secured to deny access to unauthorized persons. 68.1211

Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/02/2012
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/02/2012
Violation Code: 6HV3267
Violation: DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation: Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name, address, and phone number. 68.1205
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV0132
Violation: EPA ID NUMBER NOT OBTAINED/MAINTAINED
Violation Citation: Generator of hazardous waste has not obtained/maintained an EPA identification number. CCR 66262.12(a)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/23/2012
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank.
66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel
filters. 25250.22 and 66266.130(c)(3)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/11/2009
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR
262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV3255
Violation: SPILL CONTAIN. NOT DRY//IN GOOD CONDITION
Violation Citation: Spill container is not in good condition and/or liquid free.
2635(b)(1), 2636(a)(1)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained
onsite to document proper disposal of hazardous waste. CCR 66262.40(a)
& 25160.2(b)(3)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0307
Violation: ILLEGAL DISPOSAL OF UNIVERSAL WASTE
Violation Citation: Disposal of universal waste to an unauthorized point. 25189.5(a); SQH:66273.11(a); LQH: 66273.31(a)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel filters. 25250.22 and 66266.130(c)(3)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0224
Violation: MISMANAGED EMPTY CONTAINERS >5GALS.
Violation Citation: Failed to mark date on empty container larger than 5 gallons and/or manage it within one year. 66261.7(e) & (f).
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0205
Violation: WASTE CONTAINER: POOR CONDITION
Violation Citation: Failed to transfer hazardous waste from a container that leaked or was in poor condition to another container in good condition. CCR 66265.171
Activity: ACTIVE

Permit Number: 119194

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 119194
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV4213
Violation: NO LABEL: LIDS/SIDES OF CONTAINER
Violation Citation: Did not label waste container/bin on the lid and side so as to be clearly visible. 118280(b)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 119194 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF01
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1988-10-17 00:00:00
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 119194 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF02
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1999-02-17 00:00:00
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 06
UST Monitor Method: SW TANK SW SUCTION PIPE W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK TEST ANNUAL (EXEMPT IF UST < 551 GAL), PIPE TEST TRIENNIALLY

UST Name: UNDERGROUND TANK 119194 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Additional Id: RF03
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: Not reported
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 06
UST Monitor Method: SW TANK SW SUCTION PIPE W/DAILY RECONCILIATION OR WEEKLY GAUGING:
TANK TEST ANNUAL (EXEMPT IF UST < 551 GAL), PIPE TEST TRIENNIALLY

UST Name: UNDERGROUND TANK 119194 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: SINGLE WALL
Additional Id: RF04
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1999-02-17 00:00:00
Year Installed: 1966-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: GRAVITY
Monitor Code: 06
UST Monitor Method: SW TANK SW SUCTION PIPE W/DAILY RECONCILIATION OR WEEKLY GAUGING:
TANK TEST ANNUAL (EXEMPT IF UST < 551 GAL), PIPE TEST TRIENNIALLY

UST Name: UNDERGROUND TANK 119194 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: DOUBLE WALL
Additional Id: NT2119, RT4166
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1999-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 31B
UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ DRY TANK ANNULAR; POSITIVE SHUT-OFF &
FAILSAFE, 3.0LLD; UDC W/ MECHANICAL FLOAT

UST Name: UNDERGROUND TANK 119194 T007
Last Update: 2012-11-02 14:17:38
Permit Number: 119194
Tank Type: DOUBLE WALL
Additional Id: NT2119
Capacity Gallons: 1000
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: ACTIVE
Remove Close Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Year Installed: 1999-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 21
UST Monitor Method: DW TANK DW SUCTION AND/ OR GRAVITY PIPING WITH INTERSTITIAL MONITORS: INTERSTITIAL.

CHMIRS:

OES Incident Number: 12-4394
OES notification: 07/27/2012
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: No
Waterway: Not reported
Spill Site: Other
Cleanup By: Reporting Party
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Gal(s)
Other: Not reported
Date/Time: 2305
Year: 2012
Agency: City of San Diego Fire Dept. repair shop
Incident Date: 7/27/2012
Admin Agency: San Diego County Health Services Department
Amount: Not reported
Contained: Yes
Site Type: Not reported
E Date: Not reported
Substance: Motor oil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Quantity Released:	100
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	RP is reporting that the product spilled from a clarifier due to a wash rack overflowing. The product was diked and is contained on their property.

HAZNET:

Facility Name:	RURAL METRO AMBULANCE
envid:	S103472125
Year:	2017
GEPAID:	CAL000209336
Contact:	MATTHEW CASSARA
Telephone:	5623053768
Mailing Name:	Not reported
Mailing Address:	10405 SAN DIEGO MISSION RD STE 200
Mailing City,St,Zip:	SAN DIEGO, CA 921230000
Gen County:	San Diego
TSD EPA ID:	CAD044429835
TSD County:	Los Angeles
Waste Category:	Unspecified oil-containing waste
Disposal Method:	Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery (H010-H129) Or (H131-H135)
Tons:	0.05
Cat Decode:	Unspecified oil-containing waste
Method Decode:	Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery (H010-H129) Or (H131-H135)
Facility County:	San Diego
envid:	S103472125
Year:	2017
GEPAID:	CAL000209336
Contact:	MATTHEW CASSARA
Telephone:	5623053768
Mailing Name:	Not reported
Mailing Address:	10405 SAN DIEGO MISSION RD STE 200
Mailing City,St,Zip:	SAN DIEGO, CA 921230000
Gen County:	San Diego
TSD EPA ID:	CAD044429835
TSD County:	Los Angeles
Waste Category:	Unspecified oil-containing waste
Disposal Method:	Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

(H010-H129) Or (H131-H135)
Tons: 0.05
Cat Decode: Unspecified oil-containing waste
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S103472125
Year: 2017
GEPAID: CAL000209336
Contact: MATTHEW CASSARA
Telephone: 5623053768
Mailing Name: Not reported
Mailing Address: 10405 SAN DIEGO MISSION RD STE 200
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Unspecified oil-containing waste
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Tons: 0.05
Cat Decode: Unspecified oil-containing waste
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S103472125
Year: 2016
GEPAID: CAL000209336
Contact: MATTHEW CASSARA
Telephone: 5623053768
Mailing Name: Not reported
Mailing Address: 10405 SAN DIEGO MISSION RD STE 200
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Unspecified oil-containing waste
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Tons: 0.15
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S103472125
Year: 2016
GEPAID: CAL000209336
Contact: MATTHEW CASSARA
Telephone: 5623053768
Mailing Name: Not reported
Mailing Address: 10405 SAN DIEGO MISSION RD STE 200
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Waste Category: Unspecified oil-containing waste
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.15
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
106 additional CA_HAZNET: record(s) in the EDR Site Report.

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT3742

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT3869

NPDES:

Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported
Order Number: Not reported
WDID: 9 371027834
Regulatory Measure Type: Industrial
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Active
Status Date: 08/14/2018
Operator Name: American Medical Response West
Operator Address: 1510 Rollins Road
Operator City: Burlingame
Operator State: California
Operator Zip: 94010

Facility Status: Active
NPDES Number: CAS000001
Region: 9
Agency Number: 0
Regulatory Measure ID: 497679
Place ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Order Number: 97-03-DWQ
WDID: 9 371027834
Regulatory Measure Type: Enrollee
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 08/14/2018
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: 1510 Rollins Road
Discharge Name: American Medical Response West
Discharge City: Burlingame
Discharge State: California
Discharge Zip: 94010
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

SAN DIEGO CO LOP:

Record ID: DEH1998-LSAM-H19194-004
Record Status: Completed
Opened Date: 08/26/1998
Parcel Number: 421-290-09-00
Case Type: LOP - Local Oversight Program
Historical Name: CITY OF SAN DIEGO - FS REPAIR FAC.
SWRCB Global ID: T0607302510
Funding: S - LOP State Fund
Lead Agency: DEH/SAM
Lead Agency Date: 10/01/1998
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 4
Latitude: 32.8116323
Longitude: -117.1509161
X MapCoord: 6284861.048
Y MapCoord: 1876285.713

Record ID: DEH1999-LSAM-H19194-005
Record Status: Completed
Opened Date: 03/16/1999
Parcel Number: 421-290-09-00
Case Type: LOP - Local Oversight Program
Historical Name: CITY OF SAN DIEGO- FS REPAIR FACILITY
SWRCB Global ID: T0607302628
Funding: S - LOP State Fund
Lead Agency: DEH/SAM
Lead Agency Date: 03/22/1999
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 4
Latitude: 32.8116323
Longitude: -117.1509161
X MapCoord: 6284861.048
Y MapCoord: 1876285.713

Record ID: DEH1987-LSAM-H19194-001
Record Status: Completed
Opened Date: 10/21/1987
Parcel Number: 421-290-09-00
Case Type: Not reported
Historical Name: CITY OF SAN DIEGO - FS REPAIR FAC.
SWRCB Global ID: T0608142426
Funding: N - Non-Billable
Lead Agency: DEH/SAM
Lead Agency Date: 10/21/1987
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 4
Latitude: 32.8116323
Longitude: -117.1509161
X MapCoord: 6284861.048
Y MapCoord: 1876285.713

Record ID: DEH1995-LSAM-H19194-002
Record Status: Completed
Opened Date: 09/15/1995
Parcel Number: 421-290-09-00
Case Type: Not reported
Historical Name: CITY OF SAN DIEGO - FS REPAIR FAC.
SWRCB Global ID: T0608159447
Funding: N - Non-Billable
Lead Agency: DEH/SAM
Lead Agency Date: 11/08/1995
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 4
Latitude: 32.8116323
Longitude: -117.1509161
X MapCoord: 6284861.048
Y MapCoord: 1876285.713

Record ID: DEH1995-LSAM-H19194-003
Record Status: Completed
Opened Date: 09/15/1995
Parcel Number: 421-290-09-00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE REPAIR FACILITY (Continued)

S103472125

Case Type: Not reported
Historical Name: CITY OF SAN DIEGO - FS REPAIR FAC.
SWRCB Global ID: T0608180826
Funding: N - Non-Billable
Lead Agency: DEH/SAM
Lead Agency Date: 11/08/1995
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 4
Latitude: 32.8116323
Longitude: -117.1509161
X MapCoord: 6284861.048
Y MapCoord: 1876285.713

CIWQS:

Agency: American Medical Response West
Agency Address: 1510 Rollins Road, Burlingame, CA 94010
Place/Project Type: Industrial - Local Passenger Transportation, NEC
SIC/NAICS: 4119
Region: 9
Program: INDSTW
Regulatory Measure Status: Active
Regulatory Measure Type: Storm water industrial
Order Number: 2014-0057-DWQ
WDID: 9 371027834
NPDES Number: CAS000001
Adoption Date: Not reported
Effective Date: 08/14/2018
Termination Date: Not reported
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.812035
Longitude: -117.150779

F58
Target
Property
SDCTY-FIRE-RESCUE DEPT, FIRE REPAIR FACILITY
3870 KEARNY VILLA RD
SAN DIEGO, CA 92123

CA AST
A100424304
N/A

Site 2 of 15 in cluster F

Actual:
400 ft.

Focus Map:
1

AST:
Certified Unified Program Agencies: Not reported
Owner: CITY OF SAN DIEGO
Total Gallons: Not reported
CERSID: 10390315
Facility ID: 37-000-119194
Business Name: City of San Diego
Phone: (858) 573-1353

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE-RESCUE DEPT, FIRE REPAIR FACILITY (Continued)

A100424304

Fax: Not reported
Mailing Address: 3870 KEARNY VILLA RD
Mailing Address City: SAN DIEGO
Mailing Address State: CA
Mailing Address Zip Code: Not reported
Operator Name: SDCTY-FIRE-RESCUE DEPT
Operator Phone: (858) 573-1357
Owner Phone: (858) 573-1353
Owner Mail Address: 3870 KEARNY VILLA RD
Owner State: CA
Owner Zip Code: 92123
Owner Country: United States
Property Owner Name: CITY OF SAN DIEGO
Property Owner Phone: Not reported
Property Owner Mailing Address: Not reported
Property Owner City: Not reported
Property Owner Stat : Not reported
Property Owner Zip Code: 0
Property Owner Country: United States
EPAID: CAL000006175

F59 **CITY OF SAN DIEGO FIRE REPAIR**
Target **3870 KEARNY VILLA RD**
Property **SAN DIEGO, CA**

CA RGA LUST **S114603252**
N/A

Site 3 of 15 in cluster F

Actual: **400 ft.** **RGA LUST:**
Focus Map: 2002 CITY OF SAN DIEGO FIRE REPAIR 3870 KEARNY VILLA RD
1 2001 CITY OF SAN DIEGO FIRE REPAIR 3870 KEARNY VILLA RD
2000 CITY OF SAN DIEGO FIRE REPAIR 3870 KEARNY VILLA RD

F60 **SDCTY-FIRE REPAIR FACILITY**
Target **3870 KEARNY VILLA RD**
Property **SAN DIEGO, CA 92123**

FINDS **1023378002**
N/A

Site 4 of 15 in cluster F

Actual: **400 ft.** **FINDS:**
Focus Map: Registry ID: 110066762890
1 Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F61
Target
Property

SDCTY-FIRE DEPT REPAIR FAC
3870 KEARNY VILLA ROAD
SAN DIEGO, CA 92123

CA HAZNET **S113023901**
N/A

Site 5 of 15 in cluster F

Actual:
400 ft.

Focus Map:
1

HAZNET:

Facility Name: SDCTY-FLEET-FIRE REPAIR FAC
envid: S113023901
Year: 2016
GEPAID: CAL000006175
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Unspecified organic liquid mixture
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.0136
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113023901
Year: 2016
GEPAID: CAL000006175
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Unspecified organic liquid mixture
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.0136
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113023901
Year: 2016
GEPAID: CAL000006175
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE DEPT REPAIR FAC (Continued)

S113023901

(H010-H129) Or (H131-H135)
Tons: 0.0168
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113023901
Year: 2016
GEPAID: CAL000006175
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.0168
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113023901
Year: 2016
GEPAID: CAL000006175
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.0168
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
706 additional CA_HAZNET: record(s) in the EDR Site Report.

F62 SDCTY-FIRE-RESCUE DEPT, FIRE REPAIR FACILITY
Target 3870 KEARNY VILLA RD
Property SAN DIEGO, CA 92123

FINDS 1016434427
N/A

Site 6 of 15 in cluster F

Actual:
400 ft.

FINDS:

Focus Map:
1

Registry ID: 110055868351
Environmental Interest/Information System

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE-RESCUE DEPT, FIRE REPAIR FACILITY (Continued)

1016434427

STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

F63
Target
Property

FIRE STATION REPAIR FAC.
3870 KEARNY VILLA RD
SAN DIEGO, CA

CA RGA LUST **S114620281**
N/A

Site 7 of 15 in cluster F

Actual:
400 ft.

RGA LUST:

2004	FIRE STATION REPAIR FAC.	3870 KEARNY VILLA RD
2003	FIRE STATION REPAIR FAC.	3870 KEARNY VILLA RD

Focus Map:
1

F64
Target
Property

SDCTY-FIRE REPAIR FACILITY
3870 KEARNY VILLA RD
SAN DIEGO, CA

CA RGA LUST **S114684126**
N/A

Site 8 of 15 in cluster F

Actual:
400 ft.

RGA LUST:

2012	SDCTY-FIRE REPAIR FACILITY	3870 KEARNY VILLA RD
2011	SDCTY-FIRE REPAIR FACILITY	3870 KEARNY VILLA RD
2010	SDCTY-FIRE REPAIR FACILITY	3870 KEARNY VILLA RD
2009	SDCTY-FIRE REPAIR FACILITY	3870 KEARNY VILLA RD
2008	SDCTY-FIRE REPAIR FACILITY	3870 KEARNY VILLA RD
2007	SDCTY-FIRE REPAIR FACILITY	3870 KEARNY VILLA RD
2007	SDCTY-FIRE REPAIR FACILITY	3870 KEARNY VILLA RD
2007	SDCTY-FIRE REPAIR FACILITY	3870 KEARNY VILLA RD
2007	SDCTY-FIRE REPAIR FACILITY	3870 KEARNY VILLA RD
2007	SDCTY-FIRE REPAIR FACILITY	3870 KEARNY VILLA RD
2006	SDCTY-FIRE REPAIR FACILITY	3870 KEARNY VILLA RD
2005	SDCTY-FIRE REPAIR FACILITY	3870 KEARNY VILLA RD

Focus Map:
1

F65
Target
Property

CITY OF SAN DIEGO-FIRE FACI
3870 KEARNY VILLA RD
SAN DIEGO, CA

CA RGA LUST **S114603275**
N/A

Site 9 of 15 in cluster F

Actual:
400 ft.

RGA LUST:

2004	CITY OF SAN DIEGO-FIRE FACI	3870 KEARNY VILLA RD

Focus Map:
1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F66 SDCTY-FIRE-RESCUE DEPT, FIRE REPAIR FACILITY
Target 3870 KEARNY VILLA RD
Property SAN DIEGO, CA 92123

CA UST U001573239
CA SWEEPS UST N/A
CA HIST UST

Site 10 of 15 in cluster F

Actual:
400 ft.

UST:

Focus Map:
1

Facility ID: H19194
Permitting Agency: SAN DIEGO COUNTY
Latitude: 32.81308
Longitude: -117.15036

Facility ID: 37-000-119194
Permitting Agency: San Diego County Department of Environmental Health
Latitude: 32.8122
Longitude: -117.15036

SWEEPS UST:

Status: Active
Comp Number: 19194
Number: 9
Board Of Equalization: 44-023008
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-019194-000002
Tank Status: A
Capacity: 1000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: REG UNLEADED
Number Of Tanks: 3

Status: Active
Comp Number: 19194
Number: 9
Board Of Equalization: 44-023008
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-019194-000003
Tank Status: A
Capacity: 550
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: Not reported

Status: Active
Comp Number: 19194
Number: 9
Board Of Equalization: 44-023008
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE-RESCUE DEPT, FIRE REPAIR FACILITY (Continued)

U001573239

Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-019194-000004
Tank Status: A
Capacity: 550
Active Date: Not reported
Tank Use: PETROLEUM
STG: W
Content: Not reported
Number Of Tanks: Not reported

HIST UST:

File Number: 0002AF6D
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002AF6D.pdf>
Region: STATE
Facility ID: 00000000268
Facility Type: Other
Other Type: VEHICLE REPAIR
Contact Name: CHIEF C. KNIGHT
Telephone: 6192366860
Owner Name: CITY OF SAN DIEGO FIRE DEPT
Owner Address: 1222 1ST AV
Owner City,St,Zip: SAN DIEGO, CA 92101
Total Tanks: 0004

Tank Num: 001
Container Num: RF01
Year Installed: 1966
Tank Capacity: 00001000
Tank Used for: PRODUCT
Type of Fuel: UNLEADED
Container Construction Thickness: 12
Leak Detection: Visual, Stock Inventor

Tank Num: 002
Container Num: RF02
Year Installed: 1966
Tank Capacity: 00001000
Tank Used for: PRODUCT
Type of Fuel: UNLEADED
Container Construction Thickness: 12
Leak Detection: Visual, Stock Inventor

Tank Num: 003
Container Num: RF03
Year Installed: 1966
Tank Capacity: 00000550
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: 12
Leak Detection: Visual, Stock Inventor

Tank Num: 004
Container Num: RF04
Year Installed: 1966
Tank Capacity: 00000500
Tank Used for: WASTE
Type of Fuel: WASTE OIL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE-RESCUE DEPT, FIRE REPAIR FACILITY (Continued)

U001573239

Container Construction Thickness: 12
Leak Detection: Visual, Stock Inventor

[Click here for Geo Tracker PDF:](#)

F67
Target
Property

FIRE STATION REPIAR FAC.
3870 KEARNY VILLA RD
SAN DIEGO, CA

CA RGA LUST

S114620282
N/A

Site 11 of 15 in cluster F

Actual:
400 ft.
Focus Map:
1

RGA LUST:

2004	FIRE STATION REPIAR FAC.	3870 KEARNY VILLA RD
2003	FIRE STATION REPIAR FAC.	3870 KEARNY VILLA RD

F68
Target
Property

CITY OF SD-FIRE REPAIR FAC.
3870 KEARNY VILLA RD
SAN DIEGO, CA

CA RGA LUST

S114603437
N/A

Site 12 of 15 in cluster F

Actual:
400 ft.
Focus Map:
1

RGA LUST:

2004	CITY OF SD-FIRE REPAIR FAC.	3870 KEARNY VILLA RD
2003	CITY OF SD-FIRE REPAIR FAC.	3870 KEARNY VILLA RD

F69
Target
Property

RURAL/METRO SAN DIEGO
3870 KEARNY VILLA RD
SAN DIEGO, CA 92123

FINDS

1023312717
N/A

Site 13 of 15 in cluster F

Actual:
400 ft.
Focus Map:
1

FINDS:

Registry ID: 110066056564
Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

F70

Target
Property

3870 KEARNY VILLA RD
SAN DIEGO, CA

ERNS

2012019212
N/A

Site 14 of 15 in cluster F

Actual:
400 ft.

[Click this hyperlink](#) while viewing on your computer to access
additional ERNS detail in the EDR Site Report.

Focus Map:
1

F71

Target
Property

CITY OF SAN DIEGO-FIRE FACILIT
3870 KEARNY VILLA RD
SAN DIEGO, CA

CA RGA LUST

S114603276
N/A

Site 15 of 15 in cluster F

Actual:
400 ft.

RGA LUST:

2003 CITY OF SAN DIEGO-FIRE FACILIT 3870 KEARNY VILLA RD

Focus Map:
1

G72

Target
Property

NATIONAL AIR COLLEGE
3760 GLEN H. CURTISS RD
SAN DIEGO, CA 92123

CA LUST
CA San Diego Co. HMMMD
CA SAN DIEGO CO LOP

S109279573
N/A

Site 1 of 7 in cluster G

Actual:
410 ft.

LUST:

Focus Map:
1

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607301116
Global Id: T0607301116
Latitude: 32.811541
Longitude: -117.1447705
Status: Completed - Case Closed
Status Date: 11/02/1998
Case Worker: Not reported
RB Case Number: 9UT2345
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H15636-001
Potential Media Affect: Other Groundwater (uses other than drinking water)
Potential Contaminants of Concern: Aviation
Site History: Not reported

LUST:

Global Id: T0607301116
Action Type: Other
Date: 01/20/1993
Action: Leak Reported

Global Id: T0607301116

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE (Continued)

S109279573

Action Type: ENFORCEMENT
Date: 10/27/1998
Action: Clean Up Fund - Case Closure Review Summary Report (RSR)

Global Id: T0607301116
Action Type: Other
Date: 01/20/1993
Action: Leak Began

Global Id: T0607301116
Action Type: Other
Date: 01/20/1993
Action: Leak Discovery

Global Id: T0607301116
Action Type: ENFORCEMENT
Date: 01/28/1993
Action: Notice of Responsibility

Global Id: T0607301116
Action Type: Other
Date: 01/20/1993
Action: Leak Stopped

LUST:
Global Id: T0607301116
Status: Completed - Case Closed
Status Date: 11/02/1998

Global Id: T0607301116
Status: Open - Case Begin Date
Status Date: 01/20/1993

HMMD SAN DIEGO:
Permit Number: 115636
Business Type: 6HK18
EPA Id Number: CAD982401325
APN: 421-290-11-00
Last HMMD Inspection: 06/05/2012
Facility Telephone: 858-279-4595
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: OSCAR MADARIAGA
Facility Mailing Address: 3760 GLEN H CURTISS RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1731
UST Owner: NATIONAL AIR COLLEGE
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE (Continued)

S109279573

Inventory Active Permits (not SQG Medical):

Permit Number: 115636
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: WASTE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 115636
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 444 USED BATTERIES
Other Information: TO BRODING'S BATTERY
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 115636
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: DRAINED OIL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 115636
Update Date: 11/02/2012
Inspection Date: 06/05/2012
Violation Code: 6HV0224
Violation: MISMANAGED EMPTY CONTAINERS >5GALS.
Violation Citation: Failed to mark date on empty container larger than 5 gallons and/or manage it within one year. 66261.7(e) & (f).
Activity: ACTIVE

Permit Number: 115636
Update Date: 11/02/2012
Inspection Date: 01/25/2007
Violation Code: 6HV1013
Violation: HMBP NOT AVAILABLE FOR REVIEW
Violation Citation: Copy of HMBP not onsite for inspector's review. 25505(e)
Activity: ACTIVE

Permit Number: 115636
Update Date: 11/02/2012
Inspection Date: 01/25/2007
Violation Code: 6HV1017
Violation: HMBP NOT CERTIFIED ANNUALLY
Violation Citation: Business Plan not certified annually. 25505(d) & (e)(2)
Activity: ACTIVE

Permit Number: 115636
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE (Continued)

S109279573

Inspection Date: 01/25/2007
Violation Code: 6HV0132
Violation: EPA ID NUMBER NOT OBTAINED/MAINTAINED
Violation Citation: Generator of hazardous waste has not obtained/maintained an EPA identification number. CCR 66262.12(a)
Activity: ACTIVE

Permit Number: 115636
Update Date: 11/02/2012
Inspection Date: 01/25/2007
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 115636
Update Date: 11/02/2012
Inspection Date: 01/25/2007
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel filters. 25250.22 and 66266.130(c)(3)
Activity: ACTIVE

Permit Number: 115636
Update Date: 11/02/2012
Inspection Date: 01/25/2007
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 115636
Update Date: 11/02/2012
Inspection Date: 01/25/2007
Violation Code: 6HV0407
Violation: EMPLOYEE TRAINING NOT ADEQUATE
Violation Citation: Employee training program for small quantity generator of hazardous waste is inadequate. CFR 262.34(d)(5)(iii)
Activity: ACTIVE

Permit Number: 115636
Update Date: 11/02/2012
Inspection Date: 01/25/2007
Violation Code: 6HV0408
Violation: FAILED TO POST ER PLAN BY PHONE
Violation Citation: Small quantity generator of hazardous waste failed to post emergency response plan by phone. CFR 262.34(d)(5)(ii)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 115636 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 115636
Tank Type: SINGLE WALL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE (Continued)

S109279573

Additional Id: 2
Capacity Gallons: 10000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: REMOVED
Remove Close Date: 1993-01-20 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 115636 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 115636
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 10000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: REMOVED
Remove Close Date: 1993-01-20 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

SAN DIEGO CO LOP:

Record ID: DEH1993-LSAM-H15636-001
Record Status: Completed
Opened Date: 01/20/1993
Parcel Number: 421-290-11-00
Case Type: LOP - Local Oversight Program
Historical Name: CITY OF SAN DIEGO-NATL AIR COL
SWRCB Global ID: T0607301116
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 01/20/1993
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 C 3
Latitude: 32.8145972
Longitude: -117.1412173
X MapCoord: 6287850.143
Y MapCoord: 1877338.887

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

H73
Target
Property **CROWN AIR**
3735 JOHN J. MONTGOMERY DR
SAN DIEGO, CA

CA RGA LUST **S114607981**
N/A

Site 1 of 4 in cluster H

Actual: **416 ft.** **RGA LUST:**
Focus Map:
1

2001	CROWN AIR	3735 JOHN J. MONTGOMERY DR
2000	CROWN AIR	3735 JOHN J. MONTGOMERY DR
1998	CROWN AIR	3735 JOHN J. MONTGOMERY DR
1997	CROWN AIR	3735 JOHN J. MONTGOMERY DR
1996	CROWN AIR	3735 JOHN J. MONTGOMERY DR

H74
Target
Property **CROWN AIR**
3735 JOHN J. MONTGOMERY D
SAN DIEGO, CA

CA RGA LUST **S114607982**
N/A

Site 2 of 4 in cluster H

Actual: **416 ft.** **RGA LUST:**
Focus Map:
1

1995	CROWN AIR	3735 JOHN J. MONTGOMERY D

H75
Target
Property **CROWN AIR**
3735 JOHN J. MONTGOMERY
SAN DIEGO, CA

CA RGA LUST **S114607983**
N/A

Site 3 of 4 in cluster H

Actual: **416 ft.** **RGA LUST:**
Focus Map:
1

2002	CROWN AIR	3735 JOHN J. MONTGOMERY
1994	CROWN AIR	3735 JOHN J. MONTGOMERY
1993	CROWN AIR	3735 JOHN J. MONTGOMERY

H76
Target
Property **CROWN AIR**
3735 JOHN J. MONTGOMERY DR
SAN DIEGO, CA 92123

CA LUST **S102859052**
CA HIST CORTESE **N/A**

Site 4 of 4 in cluster H

Actual: **416 ft.** **LUST REG 9:**
Focus Map:
1

Region:	9
Status:	Case Closed
Case Number:	9UT2174
Local Case:	H00465-003
Substance:	Jet Fuel
Qty Leaked:	115
Abate Method:	FPNA
Local Agency:	San Diego
How Found:	Other Means
How Stopped:	Other Means
Source:	Unknown
Cause:	Unknown

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CROWN AIR (Continued)

S102859052

Lead Agency: Local Agency
Case Type: Aquifer affected
Date Found: 01/27/1992
Date Stopped: 01/27/1992
Confirm Date: 05/25/1992
Submit Workplan: 2/11/92
Prelim Assess: 05/25/1992
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 01/27/1992
Enforce Date: Not reported
Closed Date: 6/20/93
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: Not reported
Beneficial Use: Municipal groundwater use
NPDES Number: Not reported
Priority: 2B
File Dispn: File discarded, case closed
Interim Remedial Actions: No
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT2174

G77
Target
Property
PACIFIC AIR CHARTER
3760 GLEN L CURTIS RD
SAN DIEGO, CA 92123

CA San Diego Co. HMMD
S104756216
N/A

Site 2 of 7 in cluster G

Actual:
409 ft.
Focus Map:
1
HMMD SAN DIEGO:
Permit Number: 137500
Business Type: 6HK26
EPA Id Number: Not reported
APN: DEH-137500
Last HMMD Inspection: 12/02/1997
Facility Telephone: 858-277-5346
Permit Status: INAC
Permit Expiration: 02/28/1998
Date Last Updated: 11/02/2012
Facility Owner: AIR NET SYSTEMS
Facility Mailing Address: 3760 GLENN CURTIS RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PACIFIC AIR CHARTER (Continued)

S104756216

Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

G78
Target
Property

NATIONAL AIR COLLEGE
3760 GLEN L CURTIS RD
SAN DIEGO, CA 92123

Site 3 of 7 in cluster G

Actual:
409 ft.

Focus Map:
1

RCRA-SQG:

Date form received by agency: 12/11/1989
Facility name: NATIONAL AIR COLLEGE
Facility address: 3760 GLEN L CURTIS RD
SAN DIEGO, CA 92123
EPA ID: CAD982401325
Contact: ENVIRONMENTAL MANAGER
Contact address: 3760 GLEN L CURTIS RD
SAN DIEGO, CA 92123
Contact country: US
Contact telephone: 619-279-4595
Contact email: Not reported
EPA Region: 09
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: NATIONAL AIR COLLEGE
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator

RCRA-SQG
CA LUST
CA SWEEPS UST
CA HIST UST
FINDS
ECHO
CA ENF
CA HIST CORTESE

1000260535
CAD982401325

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE (Continued)

1000260535

Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

LUST REG 9:

Region: 9
Status: Case Closed
Case Number: 9UT2345
Local Case: H15636-001
Substance: Jet Fuel
Qty Leaked: Not reported
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Unknown
Cause: Unknown
Lead Agency: Local Agency
Case Type: Aquifer affected
Date Found: 01/20/1993
Date Stopped: 01/20/1993
Confirm Date: 01/20/1993
Submit Workplan: Not reported
Prelim Assess: 01/20/1993
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 01/20/1993
Enforce Date: 1/28/93
Closed Date: 11/2/98
Enforce Type: SEL
Pilot Program: LOP
Basin Number: 907.11
GW Depth: >100
Beneficial Use: Municipal groundwater use
NPDES Number: Not reported
Priority: 2B
File Dispn: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE (Continued)

1000260535

Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

SWEEPS UST:

Status: Active
Comp Number: 15636
Number: 9
Board Of Equalization: 44-022923
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-015636-000001
Tank Status: A
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: AVIA. GAS
Number Of Tanks: 2

Status: Active
Comp Number: 15636
Number: 9
Board Of Equalization: 44-022923
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-015636-000002
Tank Status: A
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: AVIA. GAS
Number Of Tanks: Not reported

HIST UST:

File Number: 0002F3A7
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002F3A7.pdf>
Region: STATE
Facility ID: 00000052768
Facility Type: Gas Station
Other Type: Not reported
Contact Name: NUG MADARIAGA
Telephone: 6192794595
Owner Name: TEXACO, INC.
Owner Address: 3350 WILSHIRE BL
Owner City,St,Zip: LOS ANGELES, CA 90010
Total Tanks: 0002

Tank Num: 001
Container Num: 1
Year Installed: 1972

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE (Continued)

1000260535

Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: 06
Container Construction Thickness: Not reported
Leak Detection: Visual, Stock Inventor

Tank Num: 002
Container Num: 2
Year Installed: 1972
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: 06
Container Construction Thickness: Not reported
Leak Detection: Visual, Stock Inventor

Click here for Geo Tracker PDF:

FINDS:

Registry ID: 110002804261

Environmental Interest/Information System

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000260535
Registry ID: 110002804261
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002804261>

ENF:

Region: 9
Facility Id: 243886
Agency Name: National Air
Place Type: Facility
Place Subtype: Not reported
Facility Type: Not reported
Agency Type: Privately-Owned Business
Of Agencies: 1
Place Latitude: 32.811417
Place Longitude: -117.144518

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE (Continued)

1000260535

SIC Code 1:	Not reported
SIC Desc 1:	Not reported
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	Not reported
Threat To Water Quality:	Not reported
Complexity:	Not reported
Pretreatment:	Not reported
Facility Waste Type:	Not reported
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	Not reported
Program Category1:	Not reported
Program Category2:	UNREGS
# Of Programs:	Not reported
WDID:	UNREG001
Reg Measure Id:	166297
Reg Measure Type:	Unregulated
Region:	9
Order #:	Not reported
Npdes# CA#:	Not reported
Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	Not reported
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	06/17/2005
Effective Date:	Not reported
Expiration/Review Date:	Not reported
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Passive
Enforcement Id(EID):	234633
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Notice to Comply

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE (Continued)

1000260535

Effective Date: 05/26/2000
Adoption/Issuance Date: Not reported
Achieve Date: 2000-05-26
Termination Date: Not reported
ACL Issuance Date: Not reported
EPL Issuance Date: Not reported
Status: Historical
Title: Enforcement - UNREG001
Description: Facility operator is required to abate the discharge immediately, as of day of inspection 5/26/00.
Program: UNREGS
Latest Milestone Completion Date: 2000-05-26
Of Programs1: 1
Total Assessment Amount: 0
Initial Assessed Amount: 0
Liability \$ Amount: 0
Project \$ Amount: 0
Liability \$ Paid: 0
Project \$ Completed: 0
Total \$ Paid/Completed Amount: 0

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT2345

G79 **NATIONAL AIR COLLEGE**
Target **3760 GLENN CURTIS RD**
Property **SAN DIEGO, CA**

CA RGA LUST **S114658794**
N/A

Site 4 of 7 in cluster G

Actual: RGA LUST:
409 ft.
Focus Map:
1

2002	NATIONAL AIR COLLEGE	3760 GLENN CURTIS RD
2001	NATIONAL AIR COLLEGE	3760 GLENN CURTIS RD
2000	NATIONAL AIR COLLEGE	3760 GLENN CURTIS RD
1998	NATIONAL AIR COLLEGE	3760 GLENN CURTIS RD
1997	NATIONAL AIR COLLEGE	3760 GLENN CURTIS RD
1996	NATIONAL AIR COLLEGE	3760 GLENN CURTIS RD
1995	NATIONAL AIR COLLEGE	3760 GLENN CURTIS RD
1994	NATIONAL AIR COLLEGE	3760 GLENN CURTIS RD
1993	NATIONAL AIR COLLEGE	3760 GLENN CURTIS RD

G80 **NATIONAL AIR COLLEGE**
Target **3760 GLENN CURTISS RD**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S113015696**
N/A

Site 5 of 7 in cluster G

Actual: HAZNET:
409 ft.
Focus Map:
1

Facility Name: NATIONAL AIR COLLEGE
envid: S113015696
Year: 2017
GEPAID: CAD982401325
Contact: GREG MADARIAGA/PRESIDENT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE (Continued)

S113015696

Telephone: 8582794595
Mailing Name: Not reported
Mailing Address: 3760 GLEN CURTIS RD
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAT000613976
TSD County: Orange
Waste Category: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Tons: 0.01668
Cat Decode: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S113015696
Year: 2016
GEPAID: CAD982401325
Contact: GREG MADARIAGA/PRESIDENT
Telephone: 8582794595
Mailing Name: Not reported
Mailing Address: 3760 GLEN CURTIS RD
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAT000613976
TSD County: Orange
Waste Category: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Tons: 0.07506
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113015696
Year: 2011
GEPAID: CAD982401325
Contact: OSCAR MADARIAGA
Telephone: 8582794595
Mailing Name: Not reported
Mailing Address: 3760 GLEN CURTIS RD
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAT000613976
TSD County: Not reported
Waste Category: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Disposal Method: Not reported
Tons: 0.18765
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113015696
Year: 2011
GEPAID: CAD982401325
Contact: OSCAR MADARIAGA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE (Continued)

S113015696

Telephone: 8582794595
Mailing Name: Not reported
Mailing Address: 3760 GLEN CURTIS RD
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAT000613976
TSD County: Not reported
Waste Category: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Disposal Method: Not reported
Tons: 0.18765
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113015696
Year: 2010
GEPAID: CAD982401325
Contact: OSCAR MADARIAGA
Telephone: 8582794595
Mailing Name: Not reported
Mailing Address: 3760 GLEN CURTIS RD
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAT000613976
TSD County: Not reported
Waste Category: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.03336
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
13 additional CA_HAZNET: record(s) in the EDR Site Report.

G81 **SORBI AIRCRAFT MAINTENANCE INC**
Target **3760 GLENN CURTISS RD HNGR 19**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S121019341**
N/A

Site 6 of 7 in cluster G

Actual: HAZNET:
409 ft. Facility Name: SORBI AIRCRAFT MAINTENANCE INC
Focus Map: envid: S121019341
1 Year: 2016
GEPAID: CAL000400721
Contact: FRED SORBI
Telephone: 8582770312
Mailing Name: Not reported
Mailing Address: 3873 KEARNY VILLA ROAD
Mailing City,St,Zip: SAN DIEGO, CA 92123
Gen County: San Diego
TSD EPA ID: CAL000330453
TSD County: Los Angeles
Waste Category: Other organic solids
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SORBI AIRCRAFT MAINTENANCE INC (Continued)

S121019341

Tons: 0.125
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

**G82
Target
Property**

**NATIONAL AIR COLLEGE INTERNATIONAL
3760 GLEN CURTISS RD B
SAN DIEGO, CA 92123**

CA San Diego Co. HMMD

**S119096149
N/A**

Site 7 of 7 in cluster G

**Actual:
409 ft.**

**Focus Map:
1**

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: cal000430734
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 858-279-4595
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 07/04/2018
Facility Owner: Not reported
Facility Mailing Address: 3760 Glenn Curtiss Rd Ste B, San Diego, CA 92123
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-002358
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 5444215
Return To Compliance Date: 2016-02-19T00:00:00.000
Nov: Yes
Violation Classification: Class I
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T22:02:34.000
Inspection Date: 2016-02-19T09:07:00.000
Violation Code: 3010001 Unified Program Facility (UPF) permit not obtained for the generation of hazardous waste. HSC 25404.1; SDCC 68.905

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-002358
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE INTERNATIONAL (Continued)

S119096149

Inspection Number: 5444215
Return To Compliance Date: 2016-03-21T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T22:02:34.000
Inspection Date: 2016-02-19T09:07:00.000
Violation Code: 1010001 HMBP not established/ implemented. HSC 25505(a) and 25507(a)

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-002358
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5853435
Return To Compliance Date: 2018-03-22T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T22:02:34.000
Inspection Date: 2018-03-22T14:05:00.000
Violation Code: HMD1005 Emergency contact not provided or current in CERS. HSC 25508.1(f); SDCC 68.904(b)

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-002358
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5853435
Return To Compliance Date: 2018-04-20T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T22:02:34.000
Inspection Date: 2018-03-22T14:05:00.000
Violation Code: 1020002 Initial &/or annual employee training not conducted in safety procedures for a hazardous material release or threatened release &/or employee training records not available or not maintained for 3 years. HSC 25505(a)(4); 19 CCR 2659(b)

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-002358
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 5444215
Return To Compliance Date: 2016-03-02T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE INTERNATIONAL (Continued)

S119096149

Container/Tank Id: Not reported
Last Update: 2018-10-25T22:02:34.000
Inspection Date: 2016-02-19T09:07:00.000
Violation Code: 3010002 Failed to obtain and/or maintain an active EPA ID. 22 CCR 66262.12

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-002358
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5853435
Return To Compliance Date: 2018-03-22T00:00:00.000
Nov: Yes
Violation Classification: Class I
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T22:02:34.000
Inspection Date: 2018-03-22T14:05:00.000
Violation Code: 1010001 Failed to establish and implement a HMBP. HSC 25505(a) and 25507(a)

Waste and Materials:

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080794
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-28T02:37:00.000
Chemical Name: WASTE 221 USED OIL
Common Name: Used Oil
Case Number: Not reported

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080795
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-28T02:37:00.000
Chemical Name: Waste 121 Stoddard Solvent
Common Name: Waste Stoddard Solvent
Case Number: Not reported

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080796
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-28T02:37:00.000
Chemical Name: Waste 213 Waste Fuel
Common Name: Waste Fuel
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATIONAL AIR COLLEGE INTERNATIONAL (Continued)

S119096149

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0176464
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T22:02:34.000
Chemical Name: Gasoline
Common Name: Gasoline
Case Number: 86290-81-5

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0151256
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T22:02:34.000
Chemical Name: WASTE 221 USED OIL
Common Name: Used Oil
Case Number: Not reported

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0151257
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T22:02:34.000
Chemical Name: Waste 121 Stoddard Solvent
Common Name: Waste Stoddard Solvent
Case Number: Not reported

Record ID: DEH2016-HUPFP-002358
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0151258
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T22:02:34.000
Chemical Name: Waste 213 Waste Fuel
Common Name: Waste Fuel
Case Number: Not reported

I83 **CRITICAL AIR MEDICINE INC**
Target **3717 JOHN J MONTGOMERY DR HANGAR 110**
Property **SAN DIEGO, CA 92123**

FINDS **1023336266**
N/A

Site 1 of 6 in cluster I

Actual:
415 ft.

FINDS:

Focus Map:
1

Registry ID: 110066313741

Environmental Interest/Information System
STATE MASTER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CRITICAL AIR MEDICINE INC (Continued)

1023336266

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

**I84
Target
Property**

**CRITICAL AIR MEDICINE INC
3717 JOHN J MONTGOMERY DR
SAN DIEGO, CA 92123**

CA San Diego Co. HMMD

**S109279052
N/A**

Site 2 of 6 in cluster I

**Actual:
415 ft.**

**Focus Map:
1**

HMMD SAN DIEGO:
Permit Number: 208457
Business Type: 6HK70
EPA Id Number: Not reported
APN: 421-290-11-00
Last HMMD Inspection: 06/02/2011
Facility Telephone: 858-571-5973
Permit Status: OPEN
Permit Expiration: 12/31/2012
Date Last Updated: 11/02/2012
Facility Owner: CRITICAL AIR MEDICINE INC
Facility Mailing Address: PO BOX 23699
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92193
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 208457
Update Date: 11/02/2012
Case Number: Not reported
Name: AIR, COMPRESSED
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 208457
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 208457
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN GAS
Other Information: Not reported
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CRITICAL AIR MEDICINE INC (Continued)

S109279052

Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Violations Active Permits:

Permit Number: 208457
Update Date: 11/02/2012
Inspection Date: 08/22/2007
Violation Code: 6HV1013
Violation: HMBP NOT AVAILABLE FOR REVIEW
Violation Citation: Copy of HMBP not onsite for inspector's review. 25505(e)
Activity: ACTIVE

Permit Number: 208457
Update Date: 11/02/2012
Inspection Date: 08/22/2007
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 208457
Business Type: 6HK70
EPA Id Number: Not reported
APN: 421-290-11-00
Last HMMD Inspection: 06/02/2011
Facility Telephone: 858-571-5973
Permit Status: OPEN
Permit Expiration: 12/31/2012
Date Last Updated: 11/02/2012
Facility Owner: CRITICAL AIR MEDICINE INC
Facility Mailing Address: PO BOX 23699
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92193
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: N
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 208457
Update Date: 11/02/2012
Case Number: Not reported
Name: AIR, COMPRESSED
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 208457
Update Date: 11/02/2012
Case Number: 7727-37-9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CRITICAL AIR MEDICINE INC (Continued)

S109279052

Name: NITROGEN GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 208457
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Violations Active Permits:

Permit Number: 208457
Update Date: 11/02/2012
Inspection Date: 08/22/2007
Violation Code: 6HV1013
Violation: HMBP NOT AVAILABLE FOR REVIEW
Violation Citation: Copy of HMBP not onsite for inspector's review. 25505(e)
Activity: ACTIVE

Permit Number: 208457
Update Date: 11/02/2012
Inspection Date: 08/22/2007
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

I85
Target
Property
OKAZAKI CHIROPRACTIC
8665 GIBBS DR
SAN DIEGO, CA 92123

CA San Diego Co. HMMD
S104564883
N/A

Site 3 of 6 in cluster I

Actual:
412 ft.
Focus Map:
1
HMMD SAN DIEGO:
Permit Number: 203363
Business Type: 6HK15
EPA Id Number: Not reported
APN: 421-290-11-00
Last HMMD Inspection: 12/27/2005
Facility Telephone: 858-514-8320
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: MICHIIHIRO OKAZAKI
Facility Mailing Address: 8665 GIBBS DR #140
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OKAZAKI CHIROPRACTIC (Continued)

S104564883

Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 203363
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 541 PHOTOCHEM/PHOTOPROC WASTE
Other Information: HAULER: SOUTHWEST IMAGING INC
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 203363
Business Type: 6HK15
EPA Id Number: Not reported
APN: 421-290-11-00
Last HMMD Inspection: 12/27/2005
Facility Telephone: 858-514-8320
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: MICHIHIRO OKAZAKI
Facility Mailing Address: 8665 GIBBS DR #140
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 203363
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 541 PHOTOCHEM/PHOTOPROC WASTE
Other Information: HAULER: SOUTHWEST IMAGING INC
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

I86
Target
Property

TRM RCO
8665 GIBBS DRIVE-SUITE 100
THERMAL, CA 92123

CA HIST UST
U001573245
N/A

Site 4 of 6 in cluster I

Actual:
412 ft.
Focus Map:
1

HIST UST:

File Number: 0001F671
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0001F671.pdf>
Region: STATE
Facility ID: 00000068502
Facility Type: Other
Other Type: STANDBY ENGINE GENER
Contact Name: MATT KING
Telephone: 6192935271
Owner Name: FEDERAL AVIATION ADMINISTRATIO
Owner Address: 8665 GIBBS DRIVE-SUITE 100
Owner City,St,Zip: SAN DIEGO, CA 92123
Total Tanks: 0001

Tank Num: 001
Container Num: A275
Year Installed: Not reported
Tank Capacity: 00000080
Tank Used for: WASTE
Type of Fuel: 1
Container Construction Thickness: X
Leak Detection: Stock Inventor

[Click here for Geo Tracker PDF:](#)

I87
Target
Property

FAA PDS SMO
8665 GIBBS DR SUITE 101
SAN DIEGO, CA 92123

CA HAZNET
S112836677
N/A

Site 5 of 6 in cluster I

Actual:
412 ft.
Focus Map:
1

HAZNET:

Facility Name: FAA PDS SMO
envid: S112836677
Year: 2004
GEPAID: CA9690590188
Contact: WINSTON SLOAN
Telephone: 8585375514
Mailing Name: Not reported
Mailing Address: 9175 KEARNY VILLA RD
Mailing City,St,Zip: SAN DIEGO, CA 921267099
Gen County: Not reported
TSD EPA ID: CAT080033681
TSD County: Not reported
Waste Category: Other organic solids
Disposal Method: Recycler
Tons: 0.2
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112836677
Year: 2004
GEPAID: CA9690590188

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FAA PDS SMO (Continued)

S112836677

Contact: WINSTON SLOAN
Telephone: 8585375514
Mailing Name: Not reported
Mailing Address: 9175 KEARNY VILLA RD
Mailing City,St,Zip: SAN DIEGO, CA 921267099
Gen County: Not reported
TSD EPA ID: CAT080033681
TSD County: Not reported
Waste Category: Latex waste
Disposal Method: Recycler
Tons: 0.22
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112836677
Year: 1998
GEPAID: CA9690590188
Contact: FAA PACIFIC DESERT SMO
Telephone: 6195575029
Mailing Name: Not reported
Mailing Address: 9175 KEARNY VILLA RD
Mailing City,St,Zip: SAN DIEGO, CA 921267099
Gen County: Not reported
TSD EPA ID: CAT080013352
TSD County: Not reported
Waste Category: Waste oil and mixed oil
Disposal Method: Recycler
Tons: .0625
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112836677
Year: 1998
GEPAID: CA9690590188
Contact: FAA PACIFIC DESERT SMO
Telephone: 6195575029
Mailing Name: Not reported
Mailing Address: 9175 KEARNY VILLA RD
Mailing City,St,Zip: SAN DIEGO, CA 921267099
Gen County: Not reported
TSD EPA ID: CAT080013352
TSD County: Not reported
Waste Category: Aqueous solution with total organic residues 10 percent or more
Disposal Method: Recycler
Tons: .2293
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112836677
Year: 1998
GEPAID: CA9690590188
Contact: FAA PACIFIC DESERT SMO
Telephone: 6195575029
Mailing Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FAA PDS SMO (Continued)

S112836677

Mailing Address: 9175 KEARNY VILLA RD
Mailing City,St,Zip: SAN DIEGO, CA 921267099
Gen County: Not reported
TSD EPA ID: CAD000088252
TSD County: Not reported
Waste Category: Unspecified organic liquid mixture
Disposal Method: Transfer Station
Tons: .2085
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
15 additional CA_HAZNET: record(s) in the EDR Site Report.

I88 **FAA PDS SMO**
Target **8665 GIBBS DR SUITE 101**
Property **SAN DIEGO, CA 92123**

FINDS **1008152411**
N/A

Site 6 of 6 in cluster I

Actual:
412 ft.

FINDS:

Focus Map:
1

Registry ID: 110018951017

Environmental Interest/Information System

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART)
provides California with information on hazardous waste shipments for
generators, transporters, and treatment, storage, and disposal
facilities.

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

J89 **MISSION BAY VORTAC**
Target **8575 GIBBS DRIVE SUITE 101**
Property **SAN DIEGO, CA 92123**

CA San Diego Co. HMMD **S106060863**
CA HIST UST **N/A**

Site 1 of 18 in cluster J

Actual:
412 ft.

HMMD SAN DIEGO:

Focus Map:
1

Permit Number: 111559
Business Type: 6HK03
EPA Id Number: Not reported
APN: 421-290-11-00
Last HMMD Inspection: Not reported
Facility Telephone: 619-293-5271
Permit Status: INAC
Permit Expiration: 03/31/2002
Date Last Updated: 11/02/2012
Facility Owner: FEDERAL AVIATION ADMINISTRATIO
Facility Mailing Address: 8575 GIB GIBBS DR #101
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY VORTAC (Continued)

S106060863

UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 111559 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 111559
Tank Type: UNKNOWN
Additional Id: 1
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: NONE
Remove Close Date: Not reported
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

HIST UST:

File Number: 0002B2B2
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002B2B2.pdf>
Region: Not reported
Facility ID: Not reported
Facility Type: Not reported
Other Type: Not reported
Contact Name: Not reported
Telephone: Not reported
Owner Name: Not reported
Owner Address: Not reported
Owner City,St,Zip: Not reported
Total Tanks: Not reported

Tank Num: Not reported
Container Num: Not reported
Year Installed: Not reported
Tank Capacity: Not reported
Tank Used for: Not reported
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: Not reported

Tank Num: Not reported
Container Num: Not reported
Year Installed: Not reported
Tank Capacity: Not reported
Tank Used for: Not reported
Type of Fuel: Not reported
Container Construction Thickness: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY VORTAC (Continued)

S106060863

Leak Detection: Not reported

Tank Num: Not reported

Container Num: Not reported

Year Installed: Not reported

Tank Capacity: Not reported

Tank Used for: Not reported

Type of Fuel: Not reported

Container Construction Thickness: Not reported

Leak Detection: Not reported

Tank Num: Not reported

Container Num: Not reported

Year Installed: Not reported

Tank Capacity: Not reported

Tank Used for: Not reported

Type of Fuel: Not reported

Container Construction Thickness: Not reported

Leak Detection: Not reported

Tank Num: Not reported

Container Num: Not reported

Year Installed: Not reported

Tank Capacity: Not reported

Tank Used for: Not reported

Type of Fuel: Not reported

Container Construction Thickness: Not reported

Leak Detection: Not reported

Tank Num: Not reported

Container Num: Not reported

Year Installed: Not reported

Tank Capacity: Not reported

Tank Used for: Not reported

Type of Fuel: Not reported

Container Construction Thickness: Not reported

Leak Detection: Not reported

Tank Num: Not reported

Container Num: Not reported

Year Installed: Not reported

Tank Capacity: Not reported

Tank Used for: Not reported

Type of Fuel: Not reported

Container Construction Thickness: Not reported

Leak Detection: Not reported

[Click here for Geo Tracker PDF:](#)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

J90 **OASIS SPORTS MEDICAL GRP INC**
Target **8575 GIBBS DR STE 110**
Property **SAN DIEGO, CA 92123**

RCRA-SQG **1000685928**
FINDS **CAD983628900**
ECHO

Site 2 of 18 in cluster J

Actual:
412 ft.

RCRA-SQG:

Date form received by agency: 04/01/1992

Focus Map:
1

Facility name:

OASIS SPORTS MEDICAL GRP INC

Facility address:

8575 GIBBS DR STE 110

SAN DIEGO, CA 92123

EPA ID:

CAD983628900

Contact:

GAY CORAM

Contact address:

8575 GIBBS DR STE 110

SAN DIEGO, CA 92123

Contact country:

US

Contact telephone:

619-571-0606

Contact email:

Not reported

EPA Region:

09

Classification:

Small Small Quantity Generator

Description:

Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name:

GARY M LOSSE MD

Owner/operator address:

8575 GIBBS DR STE 110

SAN DIEGO, CA 92123

Owner/operator country:

Not reported

Owner/operator telephone:

619-571-0606

Owner/operator email:

Not reported

Owner/operator fax:

Not reported

Owner/operator extension:

Not reported

Legal status:

Private

Owner/Operator Type:

Owner

Owner/Op start date:

Not reported

Owner/Op end date:

Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No

Mixed waste (haz. and radioactive): No

Recycler of hazardous waste: No

Transporter of hazardous waste: No

Treater, storer or disposer of HW: No

Underground injection activity: No

On-site burner exemption: No

Furnace exemption: No

Used oil fuel burner: No

Used oil processor: No

User oil refiner: No

Used oil fuel marketer to burner: No

Used oil Specification marketer: No

Used oil transfer facility: No

Used oil transporter: No

Violation Status:

No violations found

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

OASIS SPORTS MEDICAL GRP INC (Continued)

1000685928

FINDS:

Registry ID: 110002872856

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000685928
Registry ID: 110002872856
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002872856>

J91
Target
Property

MISSION BAY VORTAC
8575 GIBBS DRIVE, SUITE 101
SAME, CA 92123

CA HIST UST
U001573222
N/A

Site 3 of 18 in cluster J

Actual:
412 ft.

Focus Map:
1

HIST UST:

File Number: Not reported
URL: Not reported
Region: STATE
Facility ID: 00000058839
Facility Type: Other
Other Type: STANDBY POWER
Contact Name: Not reported
Telephone: 6192935271
Owner Name: FEDERAL AVIATION ADMINISTRATIO
Owner Address: 8575 GIBBS DRIVE, SUITE 101
Owner City,St,Zip: SAN DIEGO, CA 92123
Total Tanks: 0001

Tank Num: 001
Container Num: 1
Year Installed: Not reported
Tank Capacity: 00001000
Tank Used for: PRODUCT
Type of Fuel: UNLEADED
Container Construction Thickness: Not reported
Leak Detection: None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

J92
Target
Property

IMPERIAL VOR
8575 GIBBS DRIVE, SUITE 101
SAME, CA 92123

CA HIST UST
U001573212
N/A

Site 4 of 18 in cluster J

Actual:
412 ft.
Focus Map:
1

HIST UST:

File Number:	Not reported
URL:	Not reported
Region:	STATE
Facility ID:	00000058694
Facility Type:	Other
Other Type:	STANDBY POWER
Contact Name:	Not reported
Telephone:	6192935271
Owner Name:	FEDERAL AVIATION ADMINISTRATIO
Owner Address:	8575 GIBBS DRIVE, SUITE 101
Owner City,St,Zip:	SAN DIEGO, CA 92123
Total Tanks:	0001
Tank Num:	001
Container Num:	1
Year Installed:	Not reported
Tank Capacity:	00000515
Tank Used for:	PRODUCT
Type of Fuel:	UNLEADED
Container Construction Thickness:	Not reported
Leak Detection:	None

J93
Target
Property

SEAL BEACH VORIAC
8575 GIBBS DRIVE, SUITE 101
SAME, CA 92123

CA HIST UST
U001573240
N/A

Site 5 of 18 in cluster J

Actual:
412 ft.
Focus Map:
1

HIST UST:

File Number:	Not reported
URL:	Not reported
Region:	STATE
Facility ID:	00000058816
Facility Type:	Other
Other Type:	STANDBY POWER
Contact Name:	Not reported
Telephone:	6192935271
Owner Name:	FEDERAL AVIATION ADMINISTRATIO
Owner Address:	8575 GIBBS DRIVE, SUITE 101
Owner City,St,Zip:	SAN DIEGO, CA 92123
Total Tanks:	0001
Tank Num:	001
Container Num:	1
Year Installed:	Not reported
Tank Capacity:	00000515
Tank Used for:	PRODUCT
Type of Fuel:	UNLEADED
Container Construction Thickness:	Not reported
Leak Detection:	None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

J94
Target
Property

POGGI VORTAC
8575 GIBBS DRIVE, SUITE 101
SAME, CA 92123

CA HIST UST
U001573227
N/A

Site 6 of 18 in cluster J

Actual:
412 ft.
Focus Map:
1

HIST UST:

File Number:	Not reported
URL:	Not reported
Region:	STATE
Facility ID:	00000058838
Facility Type:	Other
Other Type:	Not reported
Contact Name:	Not reported
Telephone:	6192935271
Owner Name:	FEDERAL AVIATION ADMINISTRATIO
Owner Address:	8575 GIBBS DRIVE, SUITE 101
Owner City,St,Zip:	SAN DIEGO, CA 92123
Total Tanks:	0001
Tank Num:	001
Container Num:	1
Year Installed:	Not reported
Tank Capacity:	00000515
Tank Used for:	PRODUCT
Type of Fuel:	UNLEADED
Container Construction Thickness:	Not reported
Leak Detection:	None

J95
Target
Property

BARD VOTAC
8575 GIBBS DRIVE, SUITE 101
SAME, CA 92123

CA HIST UST
U001573198
N/A

Site 7 of 18 in cluster J

Actual:
412 ft.
Focus Map:
1

HIST UST:

File Number:	Not reported
URL:	Not reported
Region:	STATE
Facility ID:	00000058817
Facility Type:	Other
Other Type:	STANDBY POWER
Contact Name:	Not reported
Telephone:	6192935271
Owner Name:	FEDERAL AVIATION ADMINISTRATIO
Owner Address:	8575 GIBBS DRIVE, SUITE 101
Owner City,St,Zip:	SAN DIEGO, CA 92123
Total Tanks:	0001
Tank Num:	001
Container Num:	1
Year Installed:	Not reported
Tank Capacity:	00000515
Tank Used for:	PRODUCT
Type of Fuel:	UNLEADED
Container Construction Thickness:	Not reported
Leak Detection:	None

J96	OASIS SPORTS MEDICAL GROUP
Target	8575 GIBBS DR
Property	SAN DIEGO, CA 92123

CA San Diego Co. HMMD S106066493
N/A

Site 8 of 18 in cluster J

Actual:	HMMD SAN DIEGO:	
412 ft.	Permit Number:	150659
Focus Map:	Business Type:	6HK10
1	EPA Id Number:	CAD983628900
	APN:	421-290-11-00
	Last HMMD Inspection:	08/26/1994
	Facility Telephone:	858-571-0606
	Permit Status:	INAC
	Permit Expiration:	01/31/1996
	Date Last Updated:	11/02/2012
	Facility Owner:	OASIS SPORTS MEDICAL GROUP, INC
	Facility Mailing Address:	8575 GIBBS DR 110
	Facility Mailing City:	SAN DIEGO
	Facility Mailing State:	CA
	Facility Mailing Zip:	92123-1783
	UST Owner:	Not reported
	Handle Regulated Hazmat:	Not reported
	Own Or Operate UST:	Not reported
	Subject To APSA:	Not reported
	Generate Haz Waste:	Y
	Treat Haz Waste:	Not reported
	Generate Medical Waste:	Not reported

J97	GARDEN GROVE RADAR
Target	8575 GIBBS DR STE 101
Property	SAN DIEGO, CA 92123

CA HIST UST U001573210
N/A

Site 9 of 18 in cluster J

Actual:	HIST UST:	
412 ft.	File Number:	Not reported
Focus Map:	URL:	Not reported
1	Region:	STATE
	Facility ID:	00000058697
	Facility Type:	Other
	Other Type:	STANDBY POWER
	Contact Name:	Not reported
	Telephone:	6192935271
	Owner Name:	FEDERAL AVIATION ADMINISTRATION
	Owner Address:	8575 GIBBS DRIVE, SUITE 101
	Owner City,St,Zip:	SAN DIEGO, CA 92123
	Total Tanks:	0001
	Tank Num:	001
	Container Num:	1
	Year Installed:	Not reported
	Tank Capacity:	00006000
	Tank Used for:	PRODUCT
	Type of Fuel:	DIESEL
	Container Construction Thickness:	Not reported
	Leak Detection:	None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

J98
Target
Property

BARD VOTAC
8575 GIBBS DR 101
SAN DIEGO, CA 92123

CA SWEEPS UST
S106923096
N/A

Site 10 of 18 in cluster J

Actual:
412 ft.

Focus Map:
1

SWEEPS UST:

Status:	Not reported
Comp Number:	11559
Number:	Not reported
Board Of Equalization:	44-012890
Referral Date:	Not reported
Action Date:	Not reported
Created Date:	Not reported
Owner Tank Id:	Not reported
SWRCB Tank Id:	37-000-011559-000001
Tank Status:	Not reported
Capacity:	1000
Active Date:	Not reported
Tank Use:	M.V. FUEL
STG:	PRODUCT
Content:	REG UNLEADED
Number Of Tanks:	1

J99
Target
Property

ADVANCED AIRCRAFT SERVICE
8622 GIBBS DR
SAN DIEGO, CA 92123

CA San Diego Co. HMMD
S104745125
N/A

Site 11 of 18 in cluster J

Actual:
409 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number:	Not reported
Business Type:	Not reported
EPA Id Number:	CAL000300323
APN:	Not reported
Last HMMD Inspection:	Not reported
Facility Telephone:	858-560-7599
Permit Status:	Permit Renewed
Permit Expiration:	Not reported
Date Last Updated:	04/27/2018
Facility Owner:	Not reported
Facility Mailing Address:	8622 GIBBS DR, SAN DIEGO, CA 92123
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
UST Owner:	N
Handle Regulated Hazmat:	Not reported
Own Or Operate UST:	Not reported
Subject To APSA:	Not reported
Generate Haz Waste:	Y
Treat Haz Waste:	N
Generate Medical Waste:	Not reported

Inspection Violation:

Record ID:	DEH2006-HUPFP-206305
Permit Status:	Permit Renewed
Active Permit:	Y
Facility Id Number:	37-000-206305
Program Element:	Hazardous Materials Release Response Plans
Inspection Type:	Routine

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ADVANCED AIRCRAFT SERVICE (Continued)

S104745125

Inspection Number: 5880516
Return To Compliance Date: 2018-05-17T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T22:36:02.000
Inspection Date: 2018-04-23T14:17:00.000
Violation Code: 1020002 Initial &/or annual employee training not conducted in safety procedures for a hazardous material release or threatened release &/or employee training records not available or not maintained for 3 years. HSC 25505(a)(4); 19 CCR 2659(b)

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-206305
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4085718
Return To Compliance Date: 2016-05-11T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T22:36:02.000
Inspection Date: 2013-05-22T12:51:00.000
Violation Code: HMD0226 Did not accumulate waste in container or tank. 66262.34(d)(2)

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-206305
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 5880516
Return To Compliance Date: 2018-05-17T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T22:36:02.000
Inspection Date: 2018-04-23T14:17:00.000
Violation Code: HMD0226 Did not accumulate waste in a container or tank. 22 CCR 66262.34(d)(2); 40 CFR 262.34(d)(2)

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-206305
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 4085718
Return To Compliance Date: 2016-04-07T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ADVANCED AIRCRAFT SERVICE (Continued)

S104745125

Container/Tank Id: Not reported
Last Update: 2018-10-25T22:36:02.000
Inspection Date: 2013-05-22T12:51:00.000
Violation Code: 1010008 Failure to submit inventory reports (Activities, Owner/Operator, Hazardous Materials Descriptions and Map pages, if required. Documentation must be resubmitted (for facilities which exceed EPCRA thresholds) or re-certified (for facilities which do not exceed EPCRA thresholds) by March 1; 19 CCR 4 2729.4(b), 2729.5.

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-206305
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4890132
Return To Compliance Date: 2016-05-11T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T22:36:02.000
Inspection Date: 2016-04-07T16:50:00.000
Violation Code: HMD0226 Did not accumulate waste in a container or tank. (40 CFR 262.34(d)(2).) 22 CCR 66262.34(d)(2)

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-206305
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 5880516
Return To Compliance Date: 2018-05-17T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T22:36:02.000
Inspection Date: 2018-04-23T14:17:00.000
Violation Code: HMD0023 Failed to properly empty container, failed to manage non-empty container, or inner liner removed from a container. 22 CCR 66261.7(b), (d), (e) &/or (r)

Waste and Materials:

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079888
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-03T02:33:29.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: USED OIL
Case Number: Not reported

Record ID: DEH2006-HUPFP-206305

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ADVANCED AIRCRAFT SERVICE (Continued)

S104745125

Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098025
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-03T02:33:29.000
Chemical Name: OXYGEN GAS
Common Name: OXYGEN GAS
Case Number: 7782-44-7

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098026
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-03T02:33:29.000
Chemical Name: Lubricating oils, refined used
Common Name: Lubricating oils
Case Number: 68476-77-7

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079887
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-03T02:33:29.000
Chemical Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Common Name: AQUEOUS PARTS WASHER
Case Number: Not reported

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0180538
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T22:36:02.000
Chemical Name: OXYGEN GAS
Common Name: OXYGEN GAS
Case Number: 7782-44-7

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0180539
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T22:36:02.000
Chemical Name: Lubricating oils, refined used
Common Name: Lubricating oils
Case Number: 68476-77-7

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ADVANCED AIRCRAFT SERVICE (Continued)

S104745125

Child Record Id: DEH2018-HWAST-0155320
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T22:36:02.000
Chemical Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Common Name: AQUEOUS PARTS WASHER
Case Number: Not reported

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0155321
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T22:36:02.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: USED OIL
Case Number: Not reported

Record ID: DEH2006-HUPFP-206305
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0155322
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T22:36:02.000
Chemical Name: oily solids
Common Name: oily solids
Case Number: Not reported

Permit Number: 206305
Business Type: 6HK50
EPA Id Number: CAL000300323
APN: 421-290-11-00
Last HMMD Inspection: 01/18/2011
Facility Telephone: 858-560-7599
Permit Status: OPEN
Permit Expiration: 01/31/2013
Date Last Updated: 11/02/2012
Facility Owner: CARLSBAD AIR SERVICE INC.
Facility Mailing Address: 8622 GIBBS DR
Facility Mailing City: San Diego
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Y
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 206305
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN GAS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ADVANCED AIRCRAFT SERVICE (Continued)

S104745125

Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	206305
Update Date:	11/02/2012
Case Number:	7782-44-7
Name:	OXYGEN GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	206305
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information:	AQUEOUS PARTS WASHER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	206305
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	USED OIL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	206305
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 444 USED BATTERIES
Other Information:	USED LEAD ACID BATTERIES
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	206305
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 888 USED OIL FILTERS
Other Information:	Not reported
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Violations Active Permits:	
Permit Number:	206305
Update Date:	11/02/2012
Inspection Date:	01/18/2011
Violation Code:	6HV0414
Violation:	DID NOT TRAIN EMPLOYEES ANNUALLY
Violation Citation:	Failed to train employees annually. 66265.16(c)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ADVANCED AIRCRAFT SERVICE (Continued)

S104745125

Activity: ACTIVE

Permit Number: 206305
Update Date: 11/02/2012
Inspection Date: 06/24/2009
Violation Code: 6HV1016
Violation: ER RESPONSE PLAN NOT ADEQUATE
Violation Citation: Failure to have an adequate emergency response plan 25504 (b); 2731
Activity: ACTIVE

Permit Number: 206305
Update Date: 11/02/2012
Inspection Date: 06/24/2009
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 206305
Update Date: 11/02/2012
Inspection Date: 08/22/2007
Violation Code: 6HV0149
Violation: NO RECEIPTS (3 YRS) FOR OIL/FUEL FILTERS
Violation Citation: Failed to keep disposal receipts (3 years) for drained used oil filters and/or drained fuel filters. 25250.22 and 66266.130(c)(5)
Activity: ACTIVE

Permit Number: 206305
Update Date: 11/02/2012
Inspection Date: 08/22/2007
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 206305
Update Date: 11/02/2012
Inspection Date: 02/07/2006
Violation Code: 6HV1004
Violation: HMBP NOT SUBMITTED TO HMD
Violation Citation: Hazardous Materials Handler has not submitted a completed Business Plan to the HMMD. HSC 25505(a)
Activity: ACTIVE

Permit Number: 100821
Business Type: 6HK26
EPA Id Number: CAL000039776
APN: 421-290-11-00
Last HMMD Inspection: 12/18/2000
Facility Telephone: 858-277-5346
Permit Status: INAC
Permit Expiration: 12/18/2000
Date Last Updated: 11/02/2012
Facility Owner: AIRNET SYSTEMS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ADVANCED AIRCRAFT SERVICE (Continued)

S104745125

Facility Mailing Address: 8622 GIBBS DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1729
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Permit Number: 138570
Business Type: 6HK26
EPA Id Number: Not reported
APN: 421-290-11-00
Last HMMD Inspection: 03/23/1999
Facility Telephone: 619-277-5346
Permit Status: INAC
Permit Expiration: 03/23/1999
Date Last Updated: 11/02/2012
Facility Owner: AIR NET SYSTEMS
Facility Mailing Address: 8622 GIBBS DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Permit Number: 206305
Business Type: 6HK50
EPA Id Number: CAL000300323
APN: 421-290-11-00
Last HMMD Inspection: 01/18/2011
Facility Telephone: 858-560-7599
Permit Status: OPEN
Permit Expiration: 01/31/2013
Date Last Updated: 11/02/2012
Facility Owner: CARLSBAD AIR SERVICE INC.
Facility Mailing Address: 8622 GIBBS DR
Facility Mailing City: San Diego
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Y
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):
Permit Number: 206305

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ADVANCED AIRCRAFT SERVICE (Continued)

S104745125

Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 206305
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 206305
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: AQUEOUS PARTS WASHER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 206305
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: USED OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 206305
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 444 USED BATTERIES
Other Information: USED LEAD ACID BATTERIES
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 206305
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 206305
Update Date: 11/02/2012
Inspection Date: 01/18/2011

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ADVANCED AIRCRAFT SERVICE (Continued)

S104745125

Violation Code: 6HV0414
Violation: DID NOT TRAIN EMPLOYEES ANNUALLY
Violation Citation: Failed to train employees annually. 66265.16(c)
Activity: ACTIVE

Permit Number: 206305
Update Date: 11/02/2012
Inspection Date: 06/24/2009
Violation Code: 6HV1016
Violation: ER RESPONSE PLAN NOT ADEQUATE
Violation Citation: Failure to have an adequate emergency response plan 25504 (b); 2731
Activity: ACTIVE

Permit Number: 206305
Update Date: 11/02/2012
Inspection Date: 06/24/2009
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 206305
Update Date: 11/02/2012
Inspection Date: 08/22/2007
Violation Code: 6HV0149
Violation: NO RECEIPTS (3 YRS) FOR OIL/FUEL FILTERS
Violation Citation: Failed to keep disposal receipts (3 years) for drained used oil filters and/or drained fuel filters. 25250.22 and 66266.130(c)(5)
Activity: ACTIVE

Permit Number: 206305
Update Date: 11/02/2012
Inspection Date: 08/22/2007
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 206305
Update Date: 11/02/2012
Inspection Date: 02/07/2006
Violation Code: 6HV1004
Violation: HMBP NOT SUBMITTED TO HMD
Violation Citation: Hazardous Materials Handler has not submitted a completed Business Plan to the HMMD. HSC 25505(a)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

J100 SCANDANAVIAN AVIATION ACADEMY, INC
Target 8622 GIBBS DR
Property SAN DIEGO, CA 92123

CA San Diego Co. HMMD S106070979
N/A

Site 12 of 18 in cluster J

Actual:
409 ft.

Focus Map:
1

HMMD SAN DIEGO:
Permit Number: 200892
Business Type: 6HK26
EPA Id Number: CAL000238623
APN: 421-290-11-00
Last HMMD Inspection: 04/16/2004
Facility Telephone: 858-278-5770
Permit Status: INAC
Permit Expiration: 02/28/2006
Date Last Updated: 11/02/2012
Facility Owner: DANIEL GAYET
Facility Mailing Address: 8665 GIBBS DR #110
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Violations Inactive Permits:

Permit Number: 200892
Update Date: 11/02/2012
Inspection Date: 04/16/2004
Violation Code: 6HV0131
Violation: UPF Permit NOT OBTAINED for HAZWASTE
Violation Citation: A Unified Program Facility permit has not been obtained for the generation of hazardous waste. 68.905
Activity: Inactive Permit

Permit Number: 200892
Update Date: 11/02/2012
Inspection Date: 04/16/2004
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: Inactive Permit

Permit Number: 200892
Update Date: 11/02/2012
Inspection Date: 04/16/2004
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31
Activity: Inactive Permit

Permit Number: 200892
Business Type: 6HK26

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SCANDANAVIAN AVIATION ACADEMY, INC (Continued)

S106070979

EPA Id Number: CAL000238623
APN: 421-290-11-00
Last HMMD Inspection: 04/16/2004
Facility Telephone: 858-278-5770
Permit Status: INAC
Permit Expiration: 02/28/2006
Date Last Updated: 11/02/2012
Facility Owner: DANIEL GAYET
Facility Mailing Address: 8665 GIBBS DR #110
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Violations Inactive Permits:

Permit Number: 200892
Update Date: 11/02/2012
Inspection Date: 04/16/2004
Violation Code: 6HV0131
Violation: UPF Permit NOT OBTAINED for HAZWASTE
Violation Citation: A Unified Program Facility permit has not been obtained for the generation of hazardous waste. 68.905
Activity: Inactive Permit

Permit Number: 200892
Update Date: 11/02/2012
Inspection Date: 04/16/2004
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: Inactive Permit

Permit Number: 200892
Update Date: 11/02/2012
Inspection Date: 04/16/2004
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31
Activity: Inactive Permit

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

J101 **ADVANCED AIRCRAFT SERVICE**
Target **8622 GIBBS DR**
Property **SAN DIEGO, CA 92123**

FINDS **1023211459**
 N/A

Site 13 of 18 in cluster J

Actual:
409 ft.

FINDS:

Focus Map:
1

Registry ID: 110064970027

Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

J102 **PACIFIC DIAMOND PETROLEUM INC**
Target **8525 GIBBS DR STE 100**
Property **SAN DIEGO, CA 92123**

EDR Hist Auto **1020253448**
 N/A

Site 14 of 18 in cluster J

Actual:
409 ft.

EDR Hist Auto

Focus Map:
1

Year:	Name:	Type:
1996	PACIFIC DIAMOND PETROLEUM INC	Gasoline Service Stations
1997	PACIFIC DIAMOND PETROLEUM INC	Gasoline Service Stations
1998	PACIFIC DIAMOND PETROLEUM INC	Gasoline Service Stations
2003	PACIFIC DIAMOND PETROLEUM INC	Gasoline Service Stations
2004	PACIFIC DIAMOND PETROLEUM INC	Gasoline Service Stations

J103 **SD CNTY DETENTION FAC. PHARMACY**
Target **8525 GIBBS DR**
Property **SAN DIEGO, CA 92123**

CA San Diego Co. HMMD **S109279969**
 N/A

Site 15 of 18 in cluster J

Actual:
409 ft.

HMMD SAN DIEGO:

Focus Map:
1

Permit Number:	206332
Business Type:	6HK58
EPA Id Number:	CAL000308757
APN:	421-290-11-00
Last HMMD Inspection:	09/01/2011
Facility Telephone:	858-974-5826
Permit Status:	INAC
Permit Expiration:	06/30/2013
Date Last Updated:	11/02/2012
Facility Owner:	SHERIFFS DEPT- MEDICAL SERVICES
Facility Mailing Address:	8525 GIBBS DR #101
Facility Mailing City:	San Diego
Facility Mailing State:	CA
Facility Mailing Zip:	92123
UST Owner:	Not reported
Handle Regulated Hazmat:	Not reported
Own Or Operate UST:	Not reported
Subject To APSA:	Not reported
Generate Haz Waste:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SD CNTY DETENTION FAC. PHARMACY (Continued)

S109279969

Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Violations Inactive Permits:

Permit Number: 206332
Update Date: 11/02/2012
Inspection Date: 12/28/2005
Violation Code: 6HV4201
Violation: NO UPF PERMIT FOR MEDICAL WASTE
Violation Citation: A Unified Program Facility Permit has not been obtained for the generation of medical waste. 117705, 68.905
Activity: Inactive Permit

Permit Number: 206332
Update Date: 11/02/2012
Inspection Date: 09/01/2011
Violation Code: 6HV4204
Violation: WARNING SIGN NOT POSTED
Violation Citation: MW designated accumulation area not posted with an approved and legible biohazardous waste "warning sign" in English and Spanish. 118310
Activity: Inactive Permit

Permit Number: 206332
Update Date: 11/02/2012
Inspection Date: 09/01/2011
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR 262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: Inactive Permit

Permit Number: 206332
Business Type: 6HK58
EPA Id Number: CAL000308757
APN: 421-290-11-00
Last HMMD Inspection: 09/01/2011
Facility Telephone: 858-974-5826
Permit Status: INAC
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: SHERIFFS DEPT- MEDICAL SERVICES
Facility Mailing Address: 8525 GIBBS DR #101
Facility Mailing City: San Diego
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Violations Inactive Permits:

Permit Number: 206332
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SD CNTY DETENTION FAC. PHARMACY (Continued)

S109279969

Inspection Date: 12/28/2005
Violation Code: 6HV4201
Violation: NO UPF PERMIT FOR MEDICAL WASTE
Violation Citation: A Unified Program Facility Permit has not been obtained for the generation of medical waste. 117705, 68.905
Activity: Inactive Permit

Permit Number: 206332
Update Date: 11/02/2012
Inspection Date: 09/01/2011
Violation Code: 6HV4204
Violation: WARNING SIGN NOT POSTED
Violation Citation: MW designated accumulation area not posted with an approved and legible biohazardous waste "warning sign" in English and Spanish. 118310
Activity: Inactive Permit

Permit Number: 206332
Update Date: 11/02/2012
Inspection Date: 09/01/2011
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR 262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: Inactive Permit

Permit Number: 206332
Business Type: 6HK58
EPA Id Number: CAL000308757
APN: 421-290-11-00
Last HMMI Inspection: 09/01/2011
Facility Telephone: 858-974-5826
Permit Status: INAC
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: SHERIFFS DEPT- MEDICAL SERVICES
Facility Mailing Address: 8525 GIBBS DR #101
Facility Mailing City: San Diego
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Violations Inactive Permits:
Permit Number: 206332
Update Date: 11/02/2012
Inspection Date: 12/28/2005
Violation Code: 6HV4201
Violation: NO UPF PERMIT FOR MEDICAL WASTE
Violation Citation: A Unified Program Facility Permit has not been obtained for the generation of medical waste. 117705, 68.905
Activity: Inactive Permit

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SD CNTY DETENTION FAC. PHARMACY (Continued)

S109279969

Permit Number: 206332
Update Date: 11/02/2012
Inspection Date: 09/01/2011
Violation Code: 6HV4204
Violation: WARNING SIGN NOT POSTED
Violation Citation: MW designated accumulation area not posted with an approved and legible biohazardous waste "warning sign" in English and Spanish.
118310
Activity: Inactive Permit

Permit Number: 206332
Update Date: 11/02/2012
Inspection Date: 09/01/2011
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR 262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: Inactive Permit

J104 DETENTION'S FACILITY PHARMACY
Target 8525 GIBBS DR STE 101
Property SAN DIEGO, CA 92123

CA HAZNET S113143393
N/A

Site 16 of 18 in cluster J

Actual:
409 ft.

Focus Map:
1

HAZNET:
Facility Name: DETENTION'S FACILITY PHARMACY
envid: S113143393
Year: 2011
GEPAID: CAL000308757
Contact: ASHLEY CLARK
Telephone: 8589745826
Mailing Name: Not reported
Mailing Address: 8525 GIBBS DR STE 101
Mailing City,St,Zip: SAN DIEGO, CA 921231758
Gen County: Not reported
TSD EPA ID: CAD044429835
TSD County: Not reported
Waste Category: Liquids with pH <= 2
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery (H010-H129) Or (H131-H135)
Tons: 0.004
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113143393
Year: 2011
GEPAID: CAL000308757
Contact: ASHLEY CLARK
Telephone: 8589745826
Mailing Name: Not reported
Mailing Address: 8525 GIBBS DR STE 101
Mailing City,St,Zip: SAN DIEGO, CA 921231758
Gen County: Not reported
TSD EPA ID: CAD044429835
TSD County: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DETENTION'S FACILITY PHARMACY (Continued)

S113143393

Waste Category: Off-specification, aged or surplus organics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.0175
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113143393
Year: 2009
GEPAID: CAL000308757
Contact: ASHLEY CLARK
Telephone: 8589745826
Mailing Name: Not reported
Mailing Address: 8525 GIBBS DR STE 101
Mailing City,St,Zip: SAN DIEGO, CA 921231758
Gen County: Not reported
TSD EPA ID: ARD981057870
TSD County: Not reported
Waste Category: Liquids with halogenated organic compounds >= 1,000 Mg./L
Disposal Method: Fuel Blending Prior To Energy Recovery At Another Site
Tons: 0.01251
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113143393
Year: 2009
GEPAID: CAL000308757
Contact: ASHLEY CLARK
Telephone: 8589745826
Mailing Name: Not reported
Mailing Address: 8525 GIBBS DR STE 101
Mailing City,St,Zip: SAN DIEGO, CA 921231758
Gen County: Not reported
TSD EPA ID: CAD044429835
TSD County: Not reported
Waste Category: Liquids with halogenated organic compounds >= 1,000 Mg./L
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.01251
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113143393
Year: 2009
GEPAID: CAL000308757
Contact: ASHLEY CLARK
Telephone: 8589745826
Mailing Name: Not reported
Mailing Address: 8525 GIBBS DR STE 101
Mailing City,St,Zip: SAN DIEGO, CA 921231758
Gen County: Not reported
TSD EPA ID: CAD044429835
TSD County: Not reported
Waste Category: Off-specification, aged or surplus organics

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DETENTION'S FACILITY PHARMACY (Continued)

S113143393

Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.005
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
additional CA_HAZNET: detail in the EDR Site Report.

J105 **COAST AIRCRAFT SALES INC**
Target **8620 GIBBS DRIVE**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S113037526**
N/A

Site 17 of 18 in cluster J

Actual:
409 ft.

Focus Map:
1

HAZNET:
Facility Name: COAST AIRCRAFT SALES INC
envid: S113037526
Year: 2003
GEPaid: CAL000039776
Contact: PAT WINCHESTER
Telephone: --
Mailing Name: Not reported
Mailing Address: 8620 GIBBS DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAD008302903
TSD County: Not reported
Waste Category: Liquids with halogenated organic compounds >= 1,000 Mg./L
Disposal Method: Recycler
Tons: 0.22
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

J106 **DETENTION'S FACILITY PHARMACY**
Target **8525 GIBBS DR STE 303**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S113104766**
N/A

Site 18 of 18 in cluster J

Actual:
409 ft.

Focus Map:
1

HAZNET:
Facility Name: DETENTION'S FACILITY PHARMACY
envid: S113104766
Year: 2006
GEPaid: CAL000206099
Contact: ASHLEY CLARK/PHARMACIST
Telephone: 8589745826
Mailing Name: Not reported
Mailing Address: 8525 GIBBS DR STE 101
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: UTD981552177
TSD County: Not reported
Waste Category: Pharmaceutical waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DETENTION'S FACILITY PHARMACY (Continued)

S113104766

Disposal Method: Treatment, Incineration
Tons: 0.05
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113104766
Year: 2005
GEPAID: CAL000206099
Contact: ASHLEY CLARK/PHARMACIST
Telephone: 8589745826
Mailing Name: Not reported
Mailing Address: 8525 GIBBS DR STE 101
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: UTD981552177
TSD County: Not reported
Waste Category: Pharmaceutical waste
Disposal Method: Treatment, Incineration
Tons: 0.24
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113104766
Year: 2004
GEPAID: CAL000206099
Contact: ASHLEY CLARK/PHARMACIST
Telephone: 8589745826
Mailing Name: Not reported
Mailing Address: 8525 GIBBS DR STE 101
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: UTD981552177
TSD County: Not reported
Waste Category: Pharmaceutical waste
Disposal Method: Treatment, Incineration
Tons: 0.33
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113104766
Year: 2003
GEPAID: CAL000206099
Contact: ASHLEY CLARK/PHARMACIST
Telephone: 8589745826
Mailing Name: Not reported
Mailing Address: 8525 GIBBS DR STE 101
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: UTD981552177
TSD County: Not reported
Waste Category: Pharmaceutical waste
Disposal Method: Treatment, Incineration
Tons: 0.27
Cat Decode: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DETENTION'S FACILITY PHARMACY (Continued)

S113104766

Method Decode: Not reported
Facility County: San Diego

envid: S113104766
Year: 2002
GEPAID: CAL000206099
Contact: ASHLEY CLARK/PHARMACIST
Telephone: 8589745826
Mailing Name: Not reported
Mailing Address: 8525 GIBBS DR STE 101
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAD050806850
TSD County: Not reported
Waste Category: Pharmaceutical waste
Disposal Method: Transfer Station
Tons: 0.02
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
2 additional CA_HAZNET: record(s) in the EDR Site Report.

K107
Target
Property

FOUR POINTS BY SHERATION HOTEL
8110 AERO DR
SAN DIEGO, CA 92123

CA San Diego Co. HMMD
CA HAZNET

S117311383
N/A

Site 1 of 2 in cluster K

Actual: HMMD SAN DIEGO:
397 ft.
Focus Map:
1

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: Not reported
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 8582778888
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 04/14/2018
Facility Owner: Not reported
Facility Mailing Address: 8110 Aero Dr, San Diego, CA 92123
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: N
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:
Record ID: DEH2017-HUPFP-004078
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-004078

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FOUR POINTS BY SHERATION HOTEL (Continued)

S117311383

Program Element: Hazardous Materials Release Response Plans
Inspection Type: Initial Inspection
Inspection Number: 5872190
Return To Compliance Date: 2017-12-21T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T20:09:38.000
Inspection Date: 2017-08-29T11:52:00.000
Violation Code: 1010001 Failed to establish and implement a HMBP. HSC 25505(a) and 25507(a)

Record ID: DEH2017-HUPFP-004078
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-004078
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Initial Inspection
Inspection Number: 5872190
Return To Compliance Date: Not reported
Nov: Not reported
Violation Classification: Not reported
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T20:09:38.000
Inspection Date: 2017-08-29T11:52:00.000
Violation Code: HMD0000 HAZARDOUS MATERIALS REQUIREMENTS

Record ID: DEH2017-HUPFP-004078
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-004078
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Initial Inspection
Inspection Number: 5872190
Return To Compliance Date: 2017-12-21T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T20:09:38.000
Inspection Date: 2017-08-29T11:52:00.000
Violation Code: 1010002 HMBP not submitted to the CUPA in CERS. HSC 25508(a)(1)(A); 27 CCR 15188(a),(b),(d)

Record ID: DEH2017-HUPFP-004078
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-004078
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Initial Inspection
Inspection Number: 5872190
Return To Compliance Date: 2017-12-21T00:00:00.000
Nov: Yes
Violation Classification: Class I
Underground Storage Tank Id: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FOUR POINTS BY SHERATION HOTEL (Continued)

S117311383

Container/Tank Id: Not reported
Last Update: 2018-10-25T20:09:38.000
Inspection Date: 2017-08-29T11:52:00.000
Violation Code: HMD1001 Unified Program Facility permit not obtained for hazardous materials. SDCC 68.905; 68.906, 68.907

Record ID: DEH2017-HUPFP-004078
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-004078
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Initial Inspection
Inspection Number: 5872190
Return To Compliance Date: 2017-12-21T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T20:09:38.000
Inspection Date: 2017-08-29T11:52:00.000
Violation Code: 1020002 Initial &/or annual employee training not conducted in safety procedures for a hazardous material release or threatened release &/or employee training records not available or not maintained for 3 years. HSC 25505(a)(4); 19 CCR 2659(b)

Waste and Materials:

Record ID: DEH2017-HUPFP-004078
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0164116
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T20:09:38.000
Chemical Name: Diesel Fuel No. 2
Common Name: Diesel Fuel
Case Number: 68476-34-6

HAZNET:

Facility Name: FOUR POINTS BY SHERATION HOTEL
envid: S117311383
Year: 2013
GEPAID: CAL000385498
Contact: LUZ BURNI
Telephone: 6196963797
Mailing Name: Not reported
Mailing Address: 8110 AERO DR STE 2000
Mailing City,St,Zip: SAN DIEGO, CA 921231715
Gen County: San Diego
TSD EPA ID: CAD028409019
TSD County: Los Angeles
Waste Category: Not reported
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.417
Cat Decode: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FOUR POINTS BY SHERATON HOTEL (Continued)

S117311383

Method Decode: Not reported
Facility County: Not reported

K108 **FOUR POINTS BY SHERATON**
Target **8110 AERO DR**
Property **SAN DIEGO, CA 92123**

CA UST **U004275524**
N/A

Site 2 of 2 in cluster K

Actual: **397 ft.** **UST:**
Focus Map: **1** **Facility ID:** 37-000-004078
Permitting Agency: San Diego County Department of Environmental Health
Latitude: 32.8146
Longitude: -117.14122

L109 **GIBBS FLYING SERVICE INC**
Target **8906 AERO DR**
Property **SAN DIEGO, CA**

CA RGA LUST **S114627087**
N/A

Site 1 of 14 in cluster L

Actual: **419 ft.** **RGALUST:**
Focus Map: **1**
2007 GIBBS FLYING SERVICE INC 8906 AERO DR
2006 GIBBS FLYING SERVICE INC 8906 AERO DR
2005 GIBBS FLYING SERVICE INC 8906 AERO DR

L110 **GIBBS FLYING SERVICE INC**
Target **8906 AERO DR MNTGRY FLD**
Property **SAN DIEGO, CA 92123**

EDR Hist Auto **1020447900**
N/A

Site 2 of 14 in cluster L

Actual: **419 ft.** **EDR Hist Auto**
Focus Map: **1**

Year:	Name:	Type:
1985	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1986	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1987	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1988	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1989	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1990	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1991	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1992	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1993	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1994	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1995	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1996	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1997	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1998	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1998	GIBBS FLITE CENTER INC	Gasoline Service Stations
1999	GIBBS FLYING SERVICE INC	Gasoline Service Stations
1999	GIBBS FLITE CENTER INC	Gasoline Service Stations
2000	GIBBS FLITE CENTER INC	Gasoline Service Stations
2000	GIBBS FLYING SERVICE INC	Gasoline Service Stations
2001	GIBBS FLYING SERVICE INC	Gasoline Service Stations

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

1020447900

2002	GIBBS FLYING SERVICE INC	Gasoline Service Stations
2003	GIBBS FLYING SERVICE INC	Gasoline Service Stations
2004	GIBBS FLYING SERVICE INC	Gasoline Service Stations
2005	GIBBS FLYING SERVICE INC	Gasoline Service Stations
2006	GIBBS FLYING SERVICE INC	Gasoline Service Stations
2007	GIBBS FLYING SERVICE INC	Gasoline Service Stations

L111 **GIBBS SERVICE CENTER**
Target **8906 AERO DR**
Property **SAN DIEGO, CA 92123**

CA LUST **S100732062**
CA CPS-SLIC **N/A**
CA AST
CA San Diego Co. HMMD
CA HIST CORTESE

Site 3 of 14 in cluster L

Actual: LUST REG 9:
419 ft. Region: 9
Focus Map: Status: Case Closed
1 Case Number: 9UT196
 Local Case: H21283-001
 Substance: 0
 Qty Leaked: 0
 Abate Method: Not reported
 Local Agency: San Diego
 How Found: Tank Closure
 How Stopped: Close Tank
 Source: Tank
 Cause: Corrosion
 Lead Agency: Local Agency
 Case Type: Soil only
 Date Found: 10/20/1986
 Date Stopped: 10/20/1986
 Confirm Date: / /
 Submit Workplan: Not reported
 Prelim Assess: / /
 Desc Pollution: Not reported
 Remed Plan: / /
 Remed Action: Not reported
 Began Monitor: Not reported
 Release Date: 10/20/1986
 Enforce Date: Not reported
 Closed Date: 11/5/86
 Enforce Type: Not reported
 Pilot Program: LOP
 Basin Number: 907.11
 GW Depth: Not reported
 Beneficial Use: Not reported
 NPDES Number: Not reported
 Priority: Low priority. Priority ranking can change over time.
 File Dispn: File discarded, case closed
 Interim Remedial Actions: Yes
 Cleanup and Abatement order Number: Not reported
 Waste Discharge Requirement Number: Not reported

CPS-SLIC:
Region: STATE
Facility Status: **Completed - Case Closed**
Status Date: 11/05/1986
Global Id: T0607300735

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS SERVICE CENTER (Continued)

S100732062

Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H21283-001
Latitude: 32.8098591
Longitude: -117.1379922
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: 9UT196
File Location: Local Agency
Potential Media Affected: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

AST:

Certified Unified Program Agencies: Not reported
Owner: CITY OF SAN DIEGO
Total Gallons: Not reported
CERSID: 10390132
Facility ID: 37-000-121283
Business Name: GIBBS FLYING SERVICE INC
Phone: 858-277-0162
Fax: 858-277-0854
Mailing Address: 8906 AERO DR
Mailing Address City: SAN DIEGO
Mailing Address State: CA
Mailing Address Zip Code: Not reported
Operator Name: GIBBS FLYING SERVICE INC
Operator Phone: 858-277-0162
Owner Phone: 858-573-1440
Owner Mail Address: 3750 John J Montgomery Drive
Owner State: CA
Owner Zip Code: 92123
Owner Country: United States
Property Owner Name: CITY OF SAN DIEGO
Property Owner Phone: 858-573-1440
Property Owner Mailing Address: 3750 John J Montgomery Drive
Property Owner City: San Diego
Property Owner Stat : CA
Property Owner Zip Code: 92123
Property Owner Country: United States
EPAID: CAL000049163

HMMD SAN DIEGO:

Permit Number: 129540
Business Type: 6HK70
EPA Id Number: CAL000358675
APN: 421-290-11-00
Last HMMD Inspection: 04/18/2011
Facility Telephone: 858-277-3311
Permit Status: OPEN
Permit Expiration: 12/31/2012
Date Last Updated: 11/02/2012
Facility Owner: GIBBS SERVICE CENTER, INC
Facility Mailing Address: 8906 AERO DR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS SERVICE CENTER (Continued)

S100732062

Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-2204
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 129540
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OILS, LUBRICATING
Other Information: MOTOR
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 129540
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN,02, 99%, COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 129540
Update Date: 11/02/2012
Case Number: Not reported
Name: SOLVENT 142-66
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: REACTIVE

Permit Number: 129540
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: AQUEOUS PARTS WASHER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 129540
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 214 UNSPEC SOLVENT MIXTURE
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 129540

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS SERVICE CENTER (Continued)

S100732062

Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: WASTE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 129540
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY ABSORBENT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 129540
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: USED OIL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 129540
Update Date: 11/02/2012
Inspection Date: 09/18/2009
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 129540
Business Type: 6HK70
EPA Id Number: CAL000358675
APN: 421-290-11-00
Last HMMD Inspection: 04/18/2011
Facility Telephone: 858-277-3311
Permit Status: OPEN
Permit Expiration: 12/31/2012
Date Last Updated: 11/02/2012
Facility Owner: GIBBS SERVICE CENTER, INC
Facility Mailing Address: 8906 AERO DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-2204
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS SERVICE CENTER (Continued)

S100732062

Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 129540
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OILS, LUBRICATING
Other Information: MOTOR
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 129540
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN,02, 99%, COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 129540
Update Date: 11/02/2012
Case Number: Not reported
Name: SOLVENT 142-66
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: REACTIVE

Permit Number: 129540
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: AQUEOUS PARTS WASHER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 129540
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 214 UNSPEC SOLVENT MIXTURE
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 129540
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: WASTE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS SERVICE CENTER (Continued)

S100732062

Permit Number: 129540
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY ABSORBENT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 129540
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: USED OIL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 129540
Update Date: 11/02/2012
Inspection Date: 09/18/2009
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT196

L112 **FLYING R AVIATION**
Target **8906 AERO DR**
Property **SAN DIEGO, CA 92123**

CA San Diego Co. HMMD **S106064758**
N/A

Site 4 of 14 in cluster L

Actual: HMMD SAN DIEGO:
419 ft. Permit Number: 135962
Focus Map: Business Type: 6HK26
1 EPA Id Number: Not reported
APN: DEH-135962
Last HMMD Inspection: 07/02/1999
Facility Telephone: 858-268-4894
Permit Status: INAC
Permit Expiration: 02/28/2000
Date Last Updated: 11/02/2012
Facility Owner: KEITH ROLLER
Facility Mailing Address: 8904 AERO DR BOX B
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FLYING R AVIATION (Continued)

S106064758

UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

L113 **GIBBS FLYING SERVICE INC**
Target **8906 AERO DR**
Property **SAN DIEGO, CA 92123**

FINDS **1023210378**
N/A

Site 5 of 14 in cluster L

Actual:
419 ft.

FINDS:

Focus Map:
1

Registry ID: 110064957943
Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

L114 **ARMED FORCES AERO CLUB**
Target **8906 AERO DR**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S113118612**
N/A

Site 6 of 14 in cluster L

Actual:
419 ft.

HAZNET:

Focus Map:
1

Facility Name: ARMED FORCES AERO CLUB
envid: S113118612
Year: 2010
GEPAID: CAL000249882
Contact: DAVID BILLINGS TREASURER
Telephone: 8588742322
Mailing Name: Not reported
Mailing Address: PO BOX 23417
Mailing City,St,Zip: SAN DIEGO, CA 921933417
Gen County: Not reported
TSD EPA ID: CAD093459485
TSD County: Not reported
Waste Category: Unspecified solvent mixture
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.03
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113118612
Year: 2010
GEPAID: CAL000249882
Contact: DAVID BILLINGS TREASURER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ARMED FORCES AERO CLUB (Continued)

S113118612

Telephone: 8588742322
Mailing Name: Not reported
Mailing Address: PO BOX 23417
Mailing City,St,Zip: SAN DIEGO, CA 921933417
Gen County: Not reported
TSD EPA ID: TXD077603371
TSD County: Not reported
Waste Category: Unspecified solvent mixture
Disposal Method: Fuel Blending Prior To Energy Recovery At Another Site
Tons: 0.06
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113118612
Year: 2010
GEPAID: CAL000249882
Contact: DAVID BILLINGS TREASURER
Telephone: 8588742322
Mailing Name: Not reported
Mailing Address: PO BOX 23417
Mailing City,St,Zip: SAN DIEGO, CA 921933417
Gen County: Not reported
TSD EPA ID: CAT000613976
TSD County: Not reported
Waste Category: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.02919
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113118612
Year: 2010
GEPAID: CAL000249882
Contact: DAVID BILLINGS TREASURER
Telephone: 8588742322
Mailing Name: Not reported
Mailing Address: PO BOX 23417
Mailing City,St,Zip: SAN DIEGO, CA 921933417
Gen County: Not reported
TSD EPA ID: CAD093459485
TSD County: Not reported
Waste Category: Unspecified solvent mixture
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.03
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113118612
Year: 2010
GEPAID: CAL000249882
Contact: DAVID BILLINGS TREASURER
Telephone: 8588742322

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ARMED FORCES AERO CLUB (Continued)

S113118612

Mailing Name: Not reported
Mailing Address: PO BOX 23417
Mailing City,St,Zip: SAN DIEGO, CA 921933417
Gen County: Not reported
TSD EPA ID: CAT000613976
TSD County: Not reported
Waste Category: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.02919
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
9 additional CA_HAZNET: record(s) in the EDR Site Report.

L115
Target
Property

GIBBS FLYING SERVICE, INC.
8906 AERO DRIVE
SAN DIEGO, CA

CA RGA LUST **S114627088**
N/A

Site 7 of 14 in cluster L

Actual:
419 ft.

RGA LUST:

Focus Map:
1

1994	GIBBS FLYING SERVICE, INC.	8906 AERO DRIVE
1993	GIBBS FLYING SERVICE, INC.	8906 AERO DRIVE
1992	GIBBS FLYING SERVICE, INC.	8906 AERO DRIVE

L116
Target
Property

GIBBS SERVICE CENTER
8906 AERO DR
SAN DIEGO, CA 92123

FINDS **1023281514**
N/A

Site 8 of 14 in cluster L

Actual:
419 ft.

FINDS:

Focus Map:
1

Registry ID: 110065721543
Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

L117
Target
Property

GIBBS FLYING SERVICE
8906 AERO DR
SAN DIEGO, CA

CA RGA LUST

S114627090
N/A

Site 9 of 14 in cluster L

Actual:
419 ft.

RGALUST:

2004 GIBBS FLYING SERVICE 8906 AERO DR
2003 GIBBS FLYING SERVICE 8906 AERO DR

Focus Map:
1

L118
Target
Property

GIBBS FLYING SERVICE INC
8906 AERO DRIVE
SAN DIEGO, CA 92123

CA HAZNET

S113041865
N/A

Site 10 of 14 in cluster L

Actual:
419 ft.

HAZNET:

Focus Map:
1

Facility Name: GIBBS FLYING SERVICE INC
envid: S113041865
Year: 2017
GEPAID: CAL000049163
Contact: WILLIAM E. GIBBS
Telephone: 8582770162
Mailing Name: Not reported
Mailing Address: 8906 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921232204
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Liquids with chromium (VI) >= 500 Mg./L
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.07
Cat Decode: Liquids with chromium (VI) >= 500 Mg./L
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S113041865
Year: 2017
GEPAID: CAL000049163
Contact: WILLIAM E. GIBBS
Telephone: 8582770162
Mailing Name: Not reported
Mailing Address: 8906 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921232204
Gen County: San Diego
TSD EPA ID: NVT330010000
TSD County: 99
Waste Category: Other inorganic solid waste
Disposal Method: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Tons: 0.3175
Cat Decode: Other inorganic solid waste
Method Decode: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

S113041865

Facility County: Include On-Site Treatment And/Or Stabilization)
San Diego

envid: S113041865
Year: 2017
GEPAID: CAL000049163
Contact: WILLIAM E. GIBBS
Telephone: 8582770162
Mailing Name: Not reported
Mailing Address: 8906 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921232204
Gen County: San Diego
TSD EPA ID: NVT330010000
TSD County: 99
Waste Category: Off-specification, aged or surplus inorganics
Disposal Method: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Tons: 0.06255
Cat Decode: Off-specification, aged or surplus inorganics
Method Decode: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Facility County: San Diego

envid: S113041865
Year: 2017
GEPAID: CAL000049163
Contact: WILLIAM E. GIBBS
Telephone: 8582770162
Mailing Name: Not reported
Mailing Address: 8906 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921232204
Gen County: San Diego
TSD EPA ID: NMD002208627
TSD County: 99
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.931
Cat Decode: Off-specification, aged or surplus organics
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S113041865
Year: 2017
GEPAID: CAL000049163
Contact: WILLIAM E. GIBBS
Telephone: 8582770162
Mailing Name: Not reported
Mailing Address: 8906 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921232204
Gen County: San Diego
TSD EPA ID: NVT330010000
TSD County: 99
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration, Organics Recovery Ect

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

S113041865

Tons: 0.36
Cat Decode: Off-specification, aged or surplus organics
Method Decode: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
24 additional CA_HAZNET: record(s) in the EDR Site Report.

L119 **GIBBS FLYING SERVICE INC**
Target **8906 AERO DR**
Property **SAN DIEGO, CA 92123**

CA SAN DIEGO CO. SAM
CA UST
CA San Diego Co. HMMD
CA SWEEPS UST

U003789725
N/A

Site 11 of 14 in cluster L

Actual: SAN DIEGO CO. SAM:
419 ft. Case Number: H21283-001
Focus Map: Agency: DEH Site Assessment & Mitigation
1 **Funding:** **Private - VAP**
Facility Type: Soils Only
Facility Status: Closed Case
Date: 11/5/1986
Date Began: 10/22/1986

UST:
Facility ID: 37-000-121283
Permitting Agency: San Diego County Department of Environmental Health
Latitude: 32.8146
Longitude: -117.14122

HMMD SAN DIEGO:
Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000049163
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 858-277-0162
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 03/06/2018
Facility Owner: Not reported
Facility Mailing Address: 8906 AERO DR, SAN DIEGO, CA 92123-2204
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: Y
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:
Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

U003789725

Facility Id Number: 37-000-121283
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5301694
Return To Compliance Date: 2016-01-27T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:06:27.000
Inspection Date: 2015-09-18T11:18:00.000
Violation Code: 1010002 HMBP not submitted to the CUPA in CERS. HSC 25508(a)(1)(A);
HSC 25404(e)(4); 27 CCR 15188(a), (d)

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121283
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5965625
Return To Compliance Date: Not reported
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T22:06:27.000
Inspection Date: 2018-09-07T15:06:24.000
Violation Code: 1010008 HMBP not certified annually as complete and accurate in CERS.
HSC 25508(a)(1)(A), 25508.2, 19 CCR 2654(b)

UST DTL:

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121283
Facility Type (Ust Facility): Other
Tank Owner Name: GIBBS FLYING SERVICE INC
Tankid: 26936
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Aviation Fueling
Piping System Type: Pressure
Last Updated: 2018-10-26T22:06:27.000
Tank Capacityin Gallons: 12000
Tank Contents: Jet Fuel
Type Of Tank: Double Wall

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121283
Facility Type (Ust Facility): Other
Tank Owner Name: GIBBS FLYING SERVICE INC
Tankid: 26937
Tank Status: Active
Date Ust Permanently Closed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

U003789725

Tank Use: Aviation Fueling
Piping System Type: Pressure
Last Updated: 2018-10-26T22:06:27.000
Tank Capacityin Gallons: 12000
Tank Contents: Aviation Gas
Type Of Tank: Double Wall

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121283
Facility Type (Ust Facility): Other
Tank Owner Name: GIBBS FLYING SERVICE INC
Tankid: 26938
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Conventional Suction
Last Updated: 2018-10-26T22:06:27.000
Tank Capacityin Gallons: 2000
Tank Contents: Regular Unleaded
Type Of Tank: Double Wall

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121283
Facility Type (Ust Facility): Other
Tank Owner Name: GIBBS FLYING SERVICE INC
Tankid: 26939
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Conventional Suction
Last Updated: 2018-10-26T22:06:27.000
Tank Capacityin Gallons: 2000
Tank Contents: Diesel
Type Of Tank: Double Wall

Waste and Materials:

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0157823
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T22:06:27.000
Chemical Name: DIESEL FUEL
Common Name: DIESEL
Case Number: 68476346

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0133396
Trade Secret: N
Hazardous Material Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

U003789725

Last Updated:	2018-10-26T22:06:27.000
Chemical Name:	ELTHYLENE GLYCOL - USED
Common Name:	ANITFREEZE COOLANT
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-121283
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0070640
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-02-25T02:31:26.000
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL
Common Name:	WASTE OIL
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-121283
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0088401
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-02-25T02:31:26.000
Chemical Name:	DIESEL FUEL
Common Name:	DIESEL
Case Number:	68476346
Record ID:	DEH2002-HUPFP-121283
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0088402
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-02-25T02:31:26.000
Chemical Name:	AVIATION TURBINE JET FUEL
Common Name:	JET A
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-121283
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0088403
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-02-25T02:31:26.000
Chemical Name:	AVIATION GASOLINE
Common Name:	AVGAS 100 LL
Case Number:	64741-66-8
Record ID:	DEH2002-HUPFP-121283
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0088404
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-02-25T02:31:26.000
Chemical Name:	Aviation Turbine Jet Fuel

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

U003789725

Common Name:	Jet A
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-121283
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0088405
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-02-25T02:31:26.000
Chemical Name:	AVIATION GASOLINE
Common Name:	AVGAS 100 LL
Case Number:	64741-66-8
Record ID:	DEH2002-HUPFP-121283
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0070637
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-02-25T02:31:26.000
Chemical Name:	USED SPILL PAD
Common Name:	SPILL PADS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-121283
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0070638
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-02-25T02:31:26.000
Chemical Name:	WASTE 888 USED OIL FILTERS
Common Name:	USED OIL FILTERS / GASOLINE FUEL FILTERS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-121283
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0070639
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-02-25T02:31:26.000
Chemical Name:	ELTHYLENE GLYCOL - USED
Common Name:	ANITFREEZE COOLANT
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-121283
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0133394
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T22:06:27.000
Chemical Name:	USED SPILL PAD
Common Name:	SPILL PADS
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

U003789725

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0157824
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T22:06:27.000
Chemical Name: AVIATION TURBINE JET FUEL
Common Name: JET A
Case Number: Not reported

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0157825
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T22:06:27.000
Chemical Name: AVIATION GASOLINE
Common Name: AVGAS 100 LL
Case Number: 64741-66-8

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0157826
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T22:06:27.000
Chemical Name: Aviation Turbine Jet Fuel
Common Name: Jet A
Case Number: Not reported

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0133395
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T22:06:27.000
Chemical Name: WASTE 888 USED OIL FILTERS
Common Name: USED OIL FILTERS / GASOLINE FUEL FILTERS
Case Number: Not reported

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0157827
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T22:06:27.000
Chemical Name: AVIATION GASOLINE
Common Name: AVGAS 100 LL
Case Number: 64741-66-8

Record ID: DEH2002-HUPFP-121283
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

U003789725

Active Permit: Y
Child Record Id: DEH2017-HWAST-0133397
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T22:06:27.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: WASTE OIL
Case Number: Not reported

Permit Number: 121283
Business Type: 6HK29
EPA Id Number: CAL000049163
APN: 421-290-11-00
Last HMMD Inspection: 09/29/2011
Facility Telephone: 858-277-0162
Permit Status: OPEN
Permit Expiration: 03/31/2013
Date Last Updated: 11/02/2012
Facility Owner: GIBBS FLYING SERVICE INC
Facility Mailing Address: 8906 AERO DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-2204
UST Owner: GIBBS FLYING SERVICE INC
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Y
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 121283
Update Date: 11/02/2012
Case Number: Not reported
Name: AVIATION FUEL
Other Information: UNDERGROUND TANK 121283 T002
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 121283
Update Date: 11/02/2012
Case Number: 68476346000
Name: DIESEL
Other Information: UNDERGROUND TANK 121283 T004
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 121283
Update Date: 11/02/2012
Case Number: Not reported
Name: JET A
Other Information: UNDERGROUND TANK 121283 T001
Material Waste: Material
Hazardous Categories 1: FIRE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

U003789725

Hazardous Categories 2: Not reported

Permit Number: 121283
Update Date: 11/02/2012
Case Number: 8006-61-9
Name: REGULAR UNLEADED
Other Information: UNDERGROUND TANK 121283 T003
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 121283
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: WASTE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121283
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: GASOLINE FUEL FILTERS / SPILL PADS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121283
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: USED OIL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 121283
Update Date: 11/02/2012
Inspection Date: 09/30/2008
Violation Code: 6HV3255
Violation: SPILL CONTAIN. NOT DRY/IN GOOD CONDITION
Violation Citation: Spill container is not in good condition and/or liquid free.
2635(b)(1), 2636(a)(1)
Activity: ACTIVE

Permit Number: 121283
Update Date: 11/02/2012
Inspection Date: 09/30/2008
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional.
2630, 2641(j), 2632
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

U003789725

Permit Number: 121283
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available.
25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121283
Update Date: 11/02/2012
Inspection Date: 09/08/2009
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional.
2630, 2641(j), 2632
Activity: ACTIVE

Permit Number: 121283
Update Date: 11/02/2012
Inspection Date: 09/08/2009
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional.
2630, 2641(j), 2632
Activity: ACTIVE

Permit Number: 121283
Update Date: 11/02/2012
Inspection Date: 09/08/2009
Violation Code: 6HV0307
Violation: ILLEGAL DISPOSAL OF UNIVERSAL WASTE
Violation Citation: Disposal of universal waste to an unauthorized point. 25189.5(a);
SQH:66273.11(a); LQH: 66273.31(a)
Activity: ACTIVE

Permit Number: 121283
Update Date: 11/02/2012
Inspection Date: 09/08/2009
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR
262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: ACTIVE

Permit Number: 121283
Update Date: 11/02/2012
Inspection Date: 09/21/2005
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional.
2630, 2641(j), 2632
Activity: ACTIVE

Permit Number: 121283
Update Date: 11/02/2012
Inspection Date: 09/21/2005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

U003789725

Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 121283 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121283
Tank Type: DOUBLE WALL
Additional Id: 5 JET FUEL; RT5206
Capacity Gallons: 12000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1986-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 99
UST Monitor Method: OTHER - BLIND REMARK REQUIRED

UST Name: UNDERGROUND TANK 121283 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 121283
Tank Type: DOUBLE WALL
Additional Id: 6 AV GAS; RT5206
Capacity Gallons: 12000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1986-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 99
UST Monitor Method: OTHER - BLIND REMARK REQUIRED

UST Name: UNDERGROUND TANK 121283 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 121283
Tank Type: DOUBLE WALL
Additional Id: 7 UNLEADED
Capacity Gallons: 2000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1986-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 99
UST Monitor Method: OTHER - BLIND REMARK REQUIRED

UST Name: UNDERGROUND TANK 121283 T004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

U003789725

Last Update: 2012-11-02 14:17:38
Permit Number: 121283
Tank Type: DOUBLE WALL
Additional Id: 8 DIESEL; RT5206
Capacity Gallons: 2000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1986-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 99
UST Monitor Method: OTHER - BLIND REMARK REQUIRED

SWEEPS UST:

Status: Active
Comp Number: 21283
Number: 9
Board Of Equalization: Not reported
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021283-000001
Tank Status: A
Capacity: 12000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: JET FUEL
Number Of Tanks: 4

Status: Active
Comp Number: 21283
Number: 9
Board Of Equalization: Not reported
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021283-000002
Tank Status: A
Capacity: 12000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: AVIA. GAS
Number Of Tanks: Not reported

Status: Active
Comp Number: 21283
Number: 9
Board Of Equalization: Not reported
Referral Date: Not reported
Action Date: 06-26-92

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBBS FLYING SERVICE INC (Continued)

U003789725

Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021283-000003
Tank Status: A
Capacity: 2000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: REG UNLEADED
Number Of Tanks: Not reported

Status: Active
Comp Number: 21283
Number: 9
Board Of Equalization: Not reported
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021283-000004
Tank Status: A
Capacity: 2000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: Not reported

L120
Target
Property

GIBBS FLYING SERVICE, INC.
8906 AERO DR
SAN DIEGO, CA

CA RGA LUST **S114627089**
N/A

Site 12 of 14 in cluster L

Actual: RGA LUST:
419 ft.
Focus Map:
1

2001	GIBBS FLYING SERVICE, INC.	8906 AERO DR
2000	GIBBS FLYING SERVICE, INC.	8906 AERO DR
1998	GIBBS FLYING SERVICE, INC.	8906 AERO DR
1997	GIBBS FLYING SERVICE, INC.	8906 AERO DR
1996	GIBBS FLYING SERVICE, INC.	8906 AERO DR
1995	GIBBS FLYING SERVICE, INC.	8906 AERO DR

M121
Target
Property

WATKINS CONTRACTING INC
8690 AERO DR STE M327
SAN DIEGO, CA 92123

FTTS **1009525783**
HIST FTTS **N/A**

Site 1 of 3 in cluster M

Actual: FTTS INSP:
409 ft.
Focus Map:
1

Inspection Number: 199911179ST02 2
Region: 09
Inspection Date: 11/17/99
Inspector: JPELINKA
Violation occurred: No
Investigation Type: AHERA, Enforcement, SEE Conducted
Investigation Reason: Neutral Scheme, Region

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WATKINS CONTRACTING INC (Continued)

1009525783

Legislation Code: TSCA
Facility Function: User

HIST FTTS INSP:

Inspection Number: 199911179ST02 2
Region: 09
Inspection Date: Not reported
Inspector: JPELINKA
Violation occurred: No
Investigation Type: AHERA, Enforcement, SEE Conducted
Investigation Reason: Neutral Scheme, Region
Legislation Code: TSCA
Facility Function: User

M122
Target
Property
VAKSHOUR JAFAR
8690 AERO DR STE 119
SAN DIEGO, CA 92123

EDR Hist Cleaner
1018508913
N/A

Site 2 of 3 in cluster M

Actual:
409 ft.
EDR Hist Cleaner

Focus Map:
1

Year:	Name:	Type:
2009	VAKSHOUR JAFAR	Garment Pressing And Cleaners' Agents
2010	VAKSHOUR JAFAR	Garment Pressing And Cleaners' Agents
2011	VAKSHOUR JAFAR	Garment Pressing And Cleaners' Agents
2012	VAKSHOUR JAFAR	Garment Pressing And Cleaners' Agents
2013	VAKSHOUR JAFAR	Garment Pressing And Cleaners' Agents
2014	VAKSHOUR JAFAR	Garment Pressing And Cleaners' Agents

M123
Target
Property
WATKINS CONTRACTING INCORPORATED
8690 AERO DRIVE SUITE M327
SAN DIEGO, CA 92123

FINDS
1005622625
N/A

Site 3 of 3 in cluster M

Actual:
409 ft.
FINDS:

Focus Map:
1

Registry ID: 110011642892

Environmental Interest/Information System

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

N124 **CLEAN HARBORS ENVIRONMENTAL SERVICES INC**
Target **9225 AERO DR**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S112971954**
N/A

Site 1 of 5 in cluster N

Actual:
422 ft.

Focus Map:
1

HAZNET:

Facility Name: CLEAN HARBORS ENVIRONMENTAL SERVICES INC
envid: S112971954
Year: 2008
GEPAID: CAC002633049
Contact: SCOTT DOUGLAS
Telephone: 8585473138
Mailing Name: Not reported
Mailing Address: 9369 DOWDY DR STE G
Mailing City,St,Zip: SAN DIEGO, CA 921264300
Gen County: Not reported
TSD EPA ID: TXD055141378
TSD County: Not reported
Waste Category: Contaminated soil from site clean-up
Disposal Method: Incineration--Thermal Destruction Other Than Use As A Fuel
Tons: 0.1
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112971954
Year: 2008
GEPAID: CAC002633049
Contact: SCOTT DOUGLAS
Telephone: 8585473138
Mailing Name: Not reported
Mailing Address: 9369 DOWDY DR STE G
Mailing City,St,Zip: SAN DIEGO, CA 921264300
Gen County: Not reported
TSD EPA ID: UTD981552177
TSD County: Not reported
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Incineration--Thermal Destruction Other Than Use As A Fuel
Tons: 0.125
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112971954
Year: 2008
GEPAID: CAC002633049
Contact: SCOTT DOUGLAS
Telephone: 8585473138
Mailing Name: Not reported
Mailing Address: 9369 DOWDY DR STE G
Mailing City,St,Zip: SAN DIEGO, CA 921264300
Gen County: Not reported
TSD EPA ID: TXD982290140
TSD County: Not reported
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery (H010-H129) Or (H131-H135)
Tons: 0.065

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CLEAN HARBORS ENVIRONMENTAL SERVICES INC (Continued)

S112971954

Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112971954
Year: 2008
GEPAID: CAC002633049
Contact: SCOTT DOUGLAS
Telephone: 8585473138
Mailing Name: Not reported
Mailing Address: 9369 DOWDY DR STE G
Mailing City,St,Zip: SAN DIEGO, CA 921264300
Gen County: Not reported
TSD EPA ID: TXD055141378
TSD County: Not reported
Waste Category: Unspecified organic liquid mixture
Disposal Method: Incineration--Thermal Destruction Other Than Use As A Fuel
Tons: 0.465
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

N125 **SDCTY POLICE EASTERN GARAGE**
Target **9225 AERO DR**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S113025974**
N/A

Site 2 of 5 in cluster N

Actual:
422 ft.
Focus Map:
1

HAZNET:
Facility Name: SDCTY POLICE EASTERN GARAGE
envid: S113025974
Year: 2017
GEPAID: CAL000012920
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Unspecified oil-containing waste
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.005
Cat Decode: Unspecified oil-containing waste
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S113025974
Year: 2017
GEPAID: CAL000012920
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY POLICE EASTERN GARAGE (Continued)

S113025974

Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Oil/water separation sludge
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.02085
Cat Decode: Oil/water separation sludge
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S113025974
Year: 2016
GEPAID: CAL000012920
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Unspecified oil-containing waste
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.0492
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113025974
Year: 2016
GEPAID: CAL000012920
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT
Mailing City,St,Zip: SAN DIEGO, CA 921231636
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.0294
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113025974
Year: 2015
GEPAID: CAL000012920
Contact: JOY NEWMAN
Telephone: 8585731204
Mailing Name: Not reported
Mailing Address: 9601 RIDGEHAVEN CT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY POLICE EASTERN GARAGE (Continued)

S113025974

Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD008364432
TSD County: Los Angeles
Waste Category: Waste oil and mixed oil
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.038
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
97 additional CA_HAZNET: record(s) in the EDR Site Report.

N126 **SDCTY-PUBLIC WORKS DEPT, EASTERN POLICE SUBSTATION**
Target **9225 AERO DR**
Property **SAN DIEGO, CA 92123**

FINDS **1016714252**
N/A

Site 3 of 5 in cluster N

Actual:
422 ft.

FINDS:

Focus Map:
1

Registry ID: 110057054583
Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

N127 **SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTA**
Target **9225 AERO DR**
Property **SAN DIEGO, CA 92123**

CA HAULERS
CA San Diego Co. HMMD
CA SWEEPS UST

S104745371
N/A

Site 4 of 5 in cluster N

Actual:
422 ft.

HAULERS:

Focus Map:
1

Facility ID: 1306457
Facility Phone: (858) 495-7959
Business Email Address: Not reported
Contact Person: Louie Barragan, Tom Hughes, GENE MANLEY
Mailing Address: 9225 Aero Dr
Mailing City: San Diego
Mailing State: CA
Mailing Zip: 92123-2413
Mailing County: San Diego
Mailing Phone: (858) 495-7959
Waste Tire Permit Summary: No Permit record for this business.

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000012920
APN: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Last HMMD Inspection: Not reported
Facility Telephone: (619) 527-6021
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 05/05/2018
Facility Owner: Not reported
Facility Mailing Address: 2740 Caminito Chollas, SAN DIEGO, CA 92105
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: Y
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-101877
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 4954451
Return To Compliance Date: 2013-12-11T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 16110
Container/Tank Id: Not reported
Last Update: 2018-10-25T05:35:59.000
Inspection Date: 2013-11-12T15:25:00.000
Violation Code: 2030036 Failure of the overfill prevention system to meet one of the following requirements: 1. Alert the transfer operator when the tank is 90 percent full by restricting the flow into the tank or triggering an audible and visual alarm; or 2. Restrict delivery of flow to the tank at least 30 minutes before the tank overfills, provided the restriction occurs when the tank is filled to no more than 95 percent of capacity; and activate an audible alarm at least five minutes before the tank overfills; or 3. Provide positive shut-off of flow to the tank when the tank is filled to no more than 95 percent of capacity; or 4. Provide positive shut-off of flow to the tank so that none of the fittings located on the top of the tank are exposed to product due to overfilling. 23 CCR 16 2635(b)(2), 2665.

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-101877
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 4955878
Return To Compliance Date: 2015-05-15T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 16110
Container/Tank Id: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Last Update: 2018-10-25T05:35:59.000
Inspection Date: 2014-11-14T09:55:00.000
Violation Code: 2030054 Failure to comply with one or more of the following: maintain the spill bucket in good condition, containment free of debris/liquid, and/or to remove the contents of the spill bucket when a release/leak/spill was observed. 23 CCR 16 2635(b), 2715(c)(2).

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-101877
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5176652
Return To Compliance Date: 2015-12-04T00:00:00.000
Nov: Yes
Violation Classification: CLASS I
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T05:35:59.000
Inspection Date: 2015-11-10T14:01:00.000
Violation Code: HMD1001 Unified Program Facility permit not obtained for hazardous materials. SDCC 68.905

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-101877
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 4954451
Return To Compliance Date: 2013-12-11T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 16111
Container/Tank Id: Not reported
Last Update: 2018-10-25T05:35:59.000
Inspection Date: 2013-11-12T15:25:00.000
Violation Code: 2030054 Failure to comply with one or more of the following: maintain the spill bucket in good condition, containment free of debris/liquid, and/or to remove the contents of the spill bucket when a release/leak/spill was observed. 23 CCR 16 2635(b), 2715(c)(2).

UST DTL:

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-101877
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: SDCTY-INTERNAL OPERATIONS DEPT
Tankid: 16109
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2018-10-25T05:35:59.000
Tank Capacityin Gallons: 10000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Tank Contents: Regular Unleaded
Type Of Tank: Double Wall

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-101877
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: SDCTY-INTERNAL OPERATIONS DEPT
Tankid: 16110
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Hazardous Waste (includes used oil)
Piping System Type: Gravity
Last Updated: 2018-10-25T05:35:59.000
Tank Capacityin Gallons: 1000
Tank Contents: Used Oil
Type Of Tank: Double Wall

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-101877
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: SDCTY-INTERNAL OPERATIONS DEPT
Tankid: 16111
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Other
Piping System Type: Conventional Suction
Last Updated: 2018-10-25T05:35:59.000
Tank Capacityin Gallons: 1000
Tank Contents: Other Petroleum
Type Of Tank: Double Wall

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-101877
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: SDCTY-INTERNAL OPERATIONS DEPT
Tankid: 16112
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2018-10-25T05:35:59.000
Tank Capacityin Gallons: 10000
Tank Contents: Regular Unleaded
Type Of Tank: Double Wall

Waste and Materials:
Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0168900
Trade Secret: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Waste Oily Absorbents
Common Name:	Waste Oily Absorbents
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0168901
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Waste Antifreeze
Common Name:	Waste Antifreeze
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0168902
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Water Containing Gasoline
Common Name:	Water Containing Gasoline
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0168903
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Waste Sand Blasting Media
Common Name:	Waste Bead Blast
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0168904
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Waste Brake Fluid
Common Name:	Waste Brake Fluid
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0168905
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T05:35:59.000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Chemical Name:	Waste Oil - UST
Common Name:	Waste Oil - UST
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0168906
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Water Containing Oil
Common Name:	Water Containing Oil
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0195718
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Motor Oil - UST
Common Name:	Motor Oil - UST
Case Number:	64742-58-1
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0195719
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Diesel Fuel
Common Name:	Diesel
Case Number:	68476-34-6
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0195720
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Gasoline - UST #1
Common Name:	Gasoline - UST #1
Case Number:	8006-61-9
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0195721
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Lubricating Oil
Common Name:	Lubricating Oil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Case Number:	64742-58-1
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0195722
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Acetylene
Common Name:	Acetylene
Case Number:	74-86-2
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0195723
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Oxygen
Common Name:	Oxygen
Case Number:	7782-44-7
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0195724
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-10-25T05:35:59.000
Chemical Name:	Gasoline - UST #2
Common Name:	Gasoline - UST #2
Case Number:	8006-61-9
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0159082
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-11-15T02:30:18.000
Chemical Name:	UST MOTOR OIL101877 T003
Common Name:	UST MOTOR OIL101877 T003
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-101877
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0159083
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-11-15T02:30:18.000
Chemical Name:	DIESEL FUEL
Common Name:	DIESEL
Case Number:	68476-34-6

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0159084
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-11-15T02:30:18.000
Chemical Name: UST REGULAR UNLEADED GASOLINE 101877 T001 T004
Common Name: UST REGULAR UNLEADED GASOLINE 101877 T001 T004
Case Number: Not reported

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0159085
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-11-15T02:30:18.000
Chemical Name: LUBRICATING OIL
Common Name: LUBRICATING OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0159086
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-11-15T02:30:18.000
Chemical Name: Oxygen
Common Name: Oxygen
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0134916
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-11-15T02:30:18.000
Chemical Name: WASTE OILY ABSORBENTS
Common Name: WASTE OILY ABSORBENTS
Case Number: Not reported

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0134917
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-11-15T02:30:18.000
Chemical Name: WASTE ANTIFREEZE
Common Name: WASTE ANTIFREEZE
Case Number: Not reported

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Active Permit: Y
Child Record Id: DEH2017-HWAST-0134918
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-11-15T02:30:18.000
Chemical Name: WATER CONTAMINATED WITH GASOLINE
Common Name: WATER CONTAMINATED WITH GASOLINE
Case Number: Not reported

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0134919
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-11-15T02:30:18.000
Chemical Name: WASTE BEAD BLAST WITH LEAD
Common Name: WASTE BEAD BLAST WITH LEAD
Case Number: Not reported

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0134920
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-11-15T02:30:18.000
Chemical Name: WASTE BRAKE FLUID
Common Name: WASTE BRAKE FLUID
Case Number: Not reported

Record ID: DEH2002-HUPFP-101877
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0134921
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-11-15T02:30:18.000
Chemical Name: UST WASTE OILS
Common Name: UST WASTE OILS
Case Number: Not reported

Permit Number: 101877
Business Type: 6HK24
EPA Id Number: CAL000012920
APN: 421-030-54-00
Last HMMD Inspection: 11/17/2011
Facility Telephone: 858-495-7959
Permit Status: OPEN
Permit Expiration: 08/31/2013
Date Last Updated: 11/02/2012
Facility Owner: SDCTY-FLEET SERVICES
Facility Mailing Address: 3940 FEDERAL BL
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92102

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

UST Owner: CITY OF SAN DIEGO POLICE
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 101877
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL
Other Information: BACK-UP GENERATOR
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: MOTOR OIL
Other Information: UNDERGROUND TANK 101877 T003
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: REGULAR UNLEADED
Other Information: UNDERGROUND TANK 101877 T001
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: REGULAR UNLEADED
Other Information: UNDERGROUND TANK 101877 T004
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Other Information:	AQUEOUS PARTS WASHER 2 UNITS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG
Other Information:	WATER IN GASOLINE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information:	BEAD BLAST WASTE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	WASTE OIL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information:	WASTE ANTIFREEZE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information:	WASTE BRAKE FLUID
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 FLAMMABLE SOLIDS
Other Information:	GASOLINE / BENZENE SOILIDS
Material Waste:	Waste
Hazardous Categories 1:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: OILY DEBRIS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 444 USED BATTERIES
Other Information: BATTERY SYSTEMS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: CONSOLIDATED: CENTRAL P.D - GAS & OIL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 11/06/2008
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available.
25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 11/06/2008
Violation Code: 6HV3193
Violation: NO TRAINING/RECORD INCOMPLETE-NOT ONSITE
Violation Citation: Facility employee(s) are not trained, training records are incomplete,
and/or not onsite. 2715(f)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/14/2003
Violation Code: 6HV3112
Violation: 2NDRY CONT TEST NOT DONE (6/36 MOS.)
Violation Citation: Secondary containment testing not conducted at 6months/36 months.
25284.1; 2637(a)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/14/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/14/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/14/2003
Violation Code: 6HV3256
Violation: NO FUNCTIONAL DRAIN BOX/BACKUP
Violation Citation: Fill box drain not functional and backup system is not available.
2635(b)(1)(C)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/05/2004
Violation Code: 6HV3152
Violation: ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation: All maintenance/monitoring/calibration/ repair records not available.
25293; 2712 (b)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/05/2004
Violation Code: 6HV3255
Violation: SPILL CONTAIN. NOT DRY//IN GOOD CONDITION
Violation Citation: Spill container is not in good condition and/or liquid free.
2635(b)(1), 2636(a)(1)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/05/2004
Violation Code: 6HV3255
Violation: SPILL CONTAIN. NOT DRY//IN GOOD CONDITION
Violation Citation: Spill container is not in good condition and/or liquid free.
2635(b)(1), 2636(a)(1)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/05/2004
Violation Code: 6HV0215
Violation: OIL FILTERS IMPROPERLY MANAGED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Violation Citation: Used oil filters not properly drained, stored, or labeled prior to transport for the purpose of metal reclamation. CCR 66266.130
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 11/03/2009
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional. 2630, 2641(j), 2632
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 11/08/2007
Violation Code: 6HV3258
Violation: SENSORS NOT AT LOW POINT OR ADEQUATELY
Violation Citation: Sensors not placed adequately and/or at low point in sumps. 2641(a), 25291(a)(7)(C)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/11/2005
Violation Code: 6HV3114
Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA
Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/11/2005
Violation Code: 6HV3115
Violation: NO 2NDARY CONTAINMT. TEST/REPAIRS
Violation Citation: Secondary containment testing not completed (passed) for all components &/or repairs to secondary containment components not completed. 25284.1, 25291(a)(2); 2637
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/11/2005
Violation Code: 6HV3413
Violation: NO PUMP SHUT-DOWN/STOP FLOW FOR UDC LEAK
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):OPTION 2: No pump shut-down or stop of flow at dispenser for UDC leak. 2636(f)(5)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/11/2005
Violation Code: 6HV3413
Violation: NO PUMP SHUT-DOWN/STOP FLOW FOR UDC LEAK
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

(UDC):OPTION 2: No pump shut-down or stop of flow at dispenser for UDC
leak. 2636(f)(5)

Activity: ACTIVE

Permit Number: 101877

Update Date: 11/02/2012

Inspection Date: 10/11/2005

Violation Code: 6HV1006

Violation: HMBP: INVENTORY INADEQUATE

Violation Citation: Business Plan inventory does not list all hazardous materials on site
in disclosable quantities. HSC 25504(a),25503.5

Activity: ACTIVE

Permit Number: 101877

Update Date: 11/02/2012

Inspection Date: 10/24/2006

Violation Code: 6HV3263

Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL

Violation Citation: Monitoring system components &/or devices are not all functional.
2630, 2641(j), 2632

Activity: ACTIVE

Permit Number: 101877

Update Date: 11/02/2012

Inspection Date: 10/24/2006

Violation Code: 6HV3263

Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL

Violation Citation: Monitoring system components &/or devices are not all functional.
2630, 2641(j), 2632

Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 101877 T001

Last Update: 2012-11-02 14:17:38

Permit Number: 101877

Tank Type: DOUBLE WALL

Additional Id: RT1108, RT2512, RT4165, RT4709

Capacity Gallons: 10000

UST Contents: REGULAR UNLEADED

Other Content Info: REGULAR UNLEADED

Reg Status: ACTIVE

Remove Close Date: Not reported

Year Installed: 1987-01-01 00:00:00

Pipe Type: DOUBLE WALL

Delivery System: PRESSURE

Monitor Code: 31A

UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ DRY TANK ANNULAR; POSITIVE SHUT-OFF &
FAILSAFE, 3.0LLD; UDC W/ POSITIVE SHUT-OFF

UST Name: UNDERGROUND TANK 101877 T002

Last Update: 2012-11-02 14:17:38

Permit Number: 101877

Tank Type: DOUBLE WALL

Additional Id: RT1108, RT2512, RT5405

Capacity Gallons: 1000

UST Contents: Not reported

Other Content Info: WASTE OIL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1987-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: GRAVITY
Monitor Code: 21
UST Monitor Method: DW TANK DW SUCTION AND/ OR GRAVITY PIPING WITH INTERSTITIAL MONITORS: INTERSTITIAL.

UST Name: UNDERGROUND TANK 101877 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 101877
Tank Type: DOUBLE WALL
Additional Id: RT1108, RT3433, RT5405
Capacity Gallons: 1000
UST Contents: Not reported
Other Content Info: MOTOR OIL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1987-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 21
UST Monitor Method: DW TANK DW SUCTION AND/ OR GRAVITY PIPING WITH INTERSTITIAL MONITORS: INTERSTITIAL.

UST Name: UNDERGROUND TANK 101877 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 101877
Tank Type: DOUBLE WALL
Additional Id: RT1108, RT2512, RT4165, RT4709
Capacity Gallons: 10000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1987-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 31A
UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ DRY TANK ANNULAR; POSITIVE SHUT-OFF & FAILSAFE, 3.0 LLD; UDC W/ POSITIVE SHUT-OFF

UST Name: UNDERGROUND TANK 101877 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 101877
Tank Type: DOUBLE WALL
Additional Id: AT4968
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 2004-01-29 00:00:00
Year Installed: 1987-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 21

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

UST Monitor Method: DW TANK DW SUCTION AND/ OR GRAVITY PIPING WITH INTERSTITIAL MONITORS: INTERSTITIAL.

UST Name: UNDERGROUND TANK 101877 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 101877
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 10000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1988-01-04 00:00:00
Year Installed: 1981-01-01 00:00:00
Pipe Type: LINED TRENCH
Delivery System: PRESSURE
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

Permit Number: 101877
Business Type: 6HK24
EPA Id Number: CAL000012920
APN: 421-030-54-00
Last HMMI Inspection: 11/17/2011
Facility Telephone: 858-495-7959
Permit Status: OPEN
Permit Expiration: 08/31/2013
Date Last Updated: 11/02/2012
Facility Owner: SDCTY-FLEET SERVICES
Facility Mailing Address: 3940 FEDERAL BL
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92102
UST Owner: CITY OF SAN DIEGO POLICE
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 101877
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL
Other Information: BACK-UP GENERATOR
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: MOTOR OIL
Other Information: UNDERGROUND TANK 101877 T003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: REGULAR UNLEADED
Other Information: UNDERGROUND TANK 101877 T001
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: REGULAR UNLEADED
Other Information: UNDERGROUND TANK 101877 T004
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG
Other Information: AQUEOUS PARTS WASHER 2 UNITS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG
Other Information: WATER IN GASOLINE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 101877
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information: BEAD BLAST WASTE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	WASTE OIL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information:	WASTE ANTIFREEZE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information:	WASTE BRAKE FLUID
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 FLAMMABLE SOLIDS
Other Information:	GASOLINE / BENZENE SOILS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information:	OILY DEBRIS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 444 USED BATTERIES
Other Information:	BATTERY SYSTEMS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	101877
Update Date:	11/02/2012
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Name: WASTE 888 USED OIL FILTERS
Other Information: CONSOLIDATED: CENTRAL P.D - GAS & OIL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 11/06/2008
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available.
25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 11/06/2008
Violation Code: 6HV3193
Violation: NO TRAINING/RECORD INCOMPLETE-NOT ONSITE
Violation Citation: Facility employee(s) are not trained, training records are incomplete,
and/or not onsite. 2715(f)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/14/2003
Violation Code: 6HV3112
Violation: 2NDRY CONT TEST NOT DONE (6/36 MOS.)
Violation Citation: Secondary containment testing not conducted at 6months/36 months.
25284.1; 2637(a)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/14/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/14/2003
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/14/2003
Violation Code: 6HV3256
Violation: NO FUNCTIONAL DRAIN BOX/BACKUP
Violation Citation: Fill box drain not functional and backup system is not available.
2635(b)(1)(C)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/05/2004
Violation Code: 6HV3152
Violation: ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation: All maintenance/monitoring/calibration/ repair records not available.
25293; 2712 (b)

Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/05/2004
Violation Code: 6HV3255
Violation: SPILL CONTAIN. NOT DRY//IN GOOD CONDITION
Violation Citation: Spill container is not in good condition and/or liquid free.
2635(b)(1), 2636(a)(1)

Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/05/2004
Violation Code: 6HV3255
Violation: SPILL CONTAIN. NOT DRY//IN GOOD CONDITION
Violation Citation: Spill container is not in good condition and/or liquid free.
2635(b)(1), 2636(a)(1)

Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/05/2004
Violation Code: 6HV0215
Violation: OIL FILTERS IMPROPERLY MANAGED
Violation Citation: Used oil filters not properly drained, stored, or labeled prior to
transport for the purpose of metal reclamation. CCR 66266.130

Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 11/03/2009
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional.
2630, 2641(j), 2632

Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 11/08/2007
Violation Code: 6HV3258
Violation: SENSORS NOT AT LOW POINT OR ADEQUATELY
Violation Citation: Sensors not placed adequately and/or at low point in sumps. 2641(a),
25291(a)(7)(C)

Activity: ACTIVE

Permit Number: 101877

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Update Date: 11/02/2012
Inspection Date: 10/11/2005
Violation Code: 6HV3114
Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA
Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/11/2005
Violation Code: 6HV3115
Violation: NO 2NDARY CONTAINMT. TEST/REPAIRS
Violation Citation: Secondary containment testing not completed (passed) for all components &/or repairs to secondary containment components not completed. 25284.1, 25291(a)(2); 2637
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/11/2005
Violation Code: 6HV3413
Violation: NO PUMP SHUT-DOWN/STOP FLOW FOR UDC LEAK
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):OPTION 2: No pump shut-down or stop of flow at dispenser for UDC leak. 2636(f)(5)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/11/2005
Violation Code: 6HV3413
Violation: NO PUMP SHUT-DOWN/STOP FLOW FOR UDC LEAK
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):OPTION 2: No pump shut-down or stop of flow at dispenser for UDC leak. 2636(f)(5)
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/11/2005
Violation Code: 6HV1006
Violation: HMBP: INVENTORY INADEQUATE
Violation Citation: Business Plan inventory does not list all hazardous materials on site in disclosable quantities. HSC 25504(a),25503.5
Activity: ACTIVE

Permit Number: 101877
Update Date: 11/02/2012
Inspection Date: 10/24/2006
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional. 2630, 2641(j), 2632
Activity: ACTIVE

Permit Number: 101877

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Update Date: 11/02/2012
Inspection Date: 10/24/2006
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional.
2630, 2641(j), 2632
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 101877 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 101877
Tank Type: DOUBLE WALL
Additional Id: RT1108, RT2512, RT4165, RT4709
Capacity Gallons: 10000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1987-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 31A
UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ DRY TANK ANNULAR; POSITIVE SHUT-OFF & FAILSAFE, 3.0LLD; UDC W/ POSITIVE SHUT-OFF

UST Name: UNDERGROUND TANK 101877 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 101877
Tank Type: DOUBLE WALL
Additional Id: RT1108, RT2512, RT5405
Capacity Gallons: 1000
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1987-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: GRAVITY
Monitor Code: 21
UST Monitor Method: DW TANK DW SUCTION AND/ OR GRAVITY PIPING WITH INTERSTITIAL MONITORS: INTERSTITIAL.

UST Name: UNDERGROUND TANK 101877 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 101877
Tank Type: DOUBLE WALL
Additional Id: RT1108, RT3433, RT5405
Capacity Gallons: 1000
UST Contents: Not reported
Other Content Info: MOTOR OIL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1987-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 21

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

UST Monitor Method: DW TANK DW SUCTION AND/ OR GRAVITY PIPING WITH INTERSTITIAL MONITORS: INTERSTITIAL.

UST Name: UNDERGROUND TANK 101877 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 101877
Tank Type: DOUBLE WALL
Additional Id: RT1108, RT2512, RT4165, RT4709
Capacity Gallons: 10000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1987-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 31A
UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ DRY TANK ANNULAR; POSITIVE SHUT-OFF & FAILSAFE, 3.0 LLD; UDC W/ POSITIVE SHUT-OFF

UST Name: UNDERGROUND TANK 101877 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 101877
Tank Type: DOUBLE WALL
Additional Id: AT4968
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 2004-01-29 00:00:00
Year Installed: 1987-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 21
UST Monitor Method: DW TANK DW SUCTION AND/ OR GRAVITY PIPING WITH INTERSTITIAL MONITORS: INTERSTITIAL.

UST Name: UNDERGROUND TANK 101877 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 101877
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 10000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1988-01-04 00:00:00
Year Installed: 1981-01-01 00:00:00
Pipe Type: LINED TRENCH
Delivery System: PRESSURE
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

SWEEPS UST:

Status: Active

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Comp Number: 1877
Number: 9
Board Of Equalization: 44-021633
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-001877-000001
Tank Status: A
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: REG UNLEADED
Number Of Tanks: 5

Status: Active
Comp Number: 1877
Number: 9
Board Of Equalization: 44-021633
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-001877-000002
Tank Status: A
Capacity: 1000
Active Date: Not reported
Tank Use: PETROLEUM
STG: W
Content: Not reported
Number Of Tanks: Not reported

Status: Active
Comp Number: 1877
Number: 9
Board Of Equalization: 44-021633
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-001877-000003
Tank Status: A
Capacity: 1000
Active Date: Not reported
Tank Use: OIL
STG: W
Content: Not reported
Number Of Tanks: Not reported

Status: Active
Comp Number: 1877
Number: 9
Board Of Equalization: 44-021633
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FLEET OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

S104745371

Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-001877-000004
Tank Status: A
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: REG UNLEADED
Number Of Tanks: Not reported

Status: Active
Comp Number: 1877
Number: 9
Board Of Equalization: 44-021633
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-001877-000005
Tank Status: A
Capacity: 550
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 1877
Number: Not reported
Board Of Equalization: 44-021633
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-001877-000006
Tank Status: Not reported
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: REG UNLEADED
Number Of Tanks: 1

N128 SDCTY-INTERNAL OPERATIONS DEPT, EASTERN POLICE SUB
Target 9225 AERO DR
Property SAN DIEGO, CA 92123

CA UST U004261880
N/A

Site 5 of 5 in cluster N

Actual:
422 ft.

UST:

Focus Map:
1

Facility ID: 37-000-101877
Permitting Agency: San Diego County Department of Environme
Latitude: 32.8098
Longitude: -117.12914

Facility ID: 37-000-101877
Permitting Agency: San Diego County Department of Environmental Health

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-INTERNAL OPERATIONS DEPT, EASTERN POLICE SUBSTATION (Continued)

U004261880

Latitude: 32.8098
Longitude: -117.12914

O129 **POLICE DEPARTMENT**
Target **9265 AERO DR**
Property **SAN DIEGO, CA 92123**

CA HIST UST **U001573228**
N/A

Site 1 of 3 in cluster O

Actual: HIST UST:
422 ft. File Number: 0002AF53
Focus Map: URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002AF53.pdf>
1 Region: STATE
Facility ID: 00000024477
Facility Type: Gas Station
Other Type: Not reported
Contact Name: BUDDY CARROLL, SR, EQUIP.RPR,S
Telephone: 6192365867
Owner Name: CITY OF SAN DIEGO
Owner Address: 1222 FIRST AVE.
Owner City,St,Zip: SAN DIEGO, CA 92101
Total Tanks: 0001

Tank Num: 001
Container Num: 1
Year Installed: 1981
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: UNLEADED
Container Construction Thickness: Not reported
Leak Detection: None

[Click here for Geo Tracker PDF:](#)

O130 **SAN DIEGO POLICE GARAGE EAST**
Target **9265 AERO DR**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S113012121**
N/A

Site 2 of 3 in cluster O

Actual: HAZNET:
422 ft. Facility Name: SAN DIEGO POLICE GARAGE EAST
Focus Map: envd: S113012121
1 Year: 1993
GEPAID: CAD982009193
Contact: RELOCATED 2/19/88
Telephone: 0000000000
Mailing Name: Not reported
Mailing Address: 9265 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAT080013352
TSD County: Not reported
Waste Category: Oil/water separation sludge
Disposal Method: Recycler
Tons: 3.75300000000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAN DIEGO POLICE GARAGE EAST (Continued)

S113012121

Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

O131 **POLICE TRAFFIC DIVISION**
Target **9265 AERO DR**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S112904598**
N/A

Site 3 of 3 in cluster O

Actual:
422 ft.

Focus Map:
1

HAZNET:

Facility Name: POLICE TRAFFIC DIVISION
envid: S112904598
Year: 1999
GEPaid: CAC002215929
Contact: CITY OF SAN DIEGO
Telephone: 6195312966
Mailing Name: Not reported
Mailing Address: 1401 BROADWAY
Mailing City,St,Zip: SAN DIEGO, CA 921010000
Gen County: Not reported
TSD EPA ID: CAD050806850
TSD County: Not reported
Waste Category: Household waste
Disposal Method: Transfer Station
Tons: .4500
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112904598
Year: 1999
GEPaid: CAC002215929
Contact: CITY OF SAN DIEGO
Telephone: 6195312966
Mailing Name: Not reported
Mailing Address: 1401 BROADWAY
Mailing City,St,Zip: SAN DIEGO, CA 921010000
Gen County: Not reported
TSD EPA ID: CAD050806850
TSD County: Not reported
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Transfer Station
Tons: .2000
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

P132 **SDCTY/ENGINEERING MTLs TEST**
Target **9515 AERO DR**
Property **SAN DIEGO, CA 92123**

CA HAZNET **S113094050**
 N/A

Site 1 of 2 in cluster P

Actual:
414 ft.

Focus Map:
1

HAZNET:

Facility Name: SDCTY/ENGINEERING MTLs TEST
envid: S113094050
Year: 2008
GEPAID: CAL000177991
Contact: EARL LOKERS/SR CIVIL ENGR.
Telephone: 8586273276
Mailing Name: Not reported
Mailing Address: 9601 Ridgehaven Ct Ste 320
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAD044429835
TSD County: Not reported
Waste Category: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.25
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113094050
Year: 2008
GEPAID: CAL000177991
Contact: EARL LOKERS/SR CIVIL ENGR.
Telephone: 8586273276
Mailing Name: Not reported
Mailing Address: 9601 Ridgehaven Ct Ste 320
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAD044429835
TSD County: Not reported
Waste Category: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.25
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113094050
Year: 2008
GEPAID: CAL000177991
Contact: EARL LOKERS/SR CIVIL ENGR.
Telephone: 8586273276
Mailing Name: Not reported
Mailing Address: 9601 Ridgehaven Ct Ste 320
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAD044429835
TSD County: Not reported
Waste Category: Hydrocarbon solvents (benzene, hexane, Stoddard, Etc.)
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY/ENGINEERING MTLs TEST (Continued)

S113094050

(H010-H129) Or (H131-H135)
Tons: 0.25
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113094050
Year: 2008
GEPAID: CAL000177991
Contact: EARL LOKERS/SR CIVIL ENGR.
Telephone: 8586273276
Mailing Name: Not reported
Mailing Address: 9601 Ridgehaven Ct Ste 320
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAD044429835
TSD County: Not reported
Waste Category: Halogenated solvents (chloroforms, methyl chloride, perchloroethylene, etc)
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.45
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113094050
Year: 2008
GEPAID: CAL000177991
Contact: EARL LOKERS/SR CIVIL ENGR.
Telephone: 8586273276
Mailing Name: Not reported
Mailing Address: 9601 Ridgehaven Ct Ste 320
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAD044429835
TSD County: Not reported
Waste Category: Halogenated solvents (chloroforms, methyl chloride, perchloroethylene, etc)
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.45
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access 23 additional CA_HAZNET: record(s) in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

P133 SDCTY-ENG/MAT TEST LAB
Target 9515 AERO DR
Property SAN DIEGO, CA 92123

CA San Diego Co. HMMD S103677123
N/A

Site 2 of 2 in cluster P

Actual:
414 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number: 134485
Business Type: 6HK66
EPA Id Number: CAL000177991
APN: 421-030-57-00
Last HMMD Inspection: 03/05/2008
Facility Telephone: 858-627-3279
Permit Status: INAC
Permit Expiration: 07/31/2008
Date Last Updated: 11/02/2012
Facility Owner: CITY OF SAN DIEGO
Facility Mailing Address: 9491 AERO DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Violations Inactive Permits:

Permit Number: 134485
Update Date: 11/02/2012
Inspection Date: 07/01/2003
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: Inactive Permit

Permit Number: 134485
Update Date: 11/02/2012
Inspection Date: 07/01/2003
Violation Code: 6HV0402
Violation: TRAINING PROGRAM NOT ADEQUATE
Violation Citation: Personnel training is not adequate to ensure compliance with hazardous waste regulations. CCR 66265.16(a)&(b)
Activity: Inactive Permit

Permit Number: 134485
Update Date: 11/02/2012
Inspection Date: 07/15/2005
Violation Code: 6HV1003
Violation: HMBP NOT AMENDED W/IN 30 DAYS
Violation Citation: Business plan was not amended within 30 days for a 100% quantity increase, new disclosable materials or a change in business info. HSC 25505
Activity: Inactive Permit

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

134
Target
Property
ARC OF SAN DIEGO, ARC ENTERPRISES
9575 AERO DR
SAN DIEGO, CA 92123

CA San Diego Co. HMMD
CA HAZNET

S112974776
N/A

Actual:
362 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: Not reported
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: (858) 571-4369
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 07/25/2018
Facility Owner: Not reported
Facility Mailing Address: 9575 Aero Drive, SAN DIEGO, CA 92102
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: N
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2012-HUPFP-216497
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216497
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5913865
Return To Compliance Date: 2018-05-09T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T06:07:26.000
Inspection Date: 2018-05-07T14:03:00.000
Violation Code: 1020002 Initial &/or annual employee training not conducted in safety procedures for a hazardous material release or threatened release &/or employee training records not available or not maintained for 3 years. HSC 25505(a)(4); 19 CCR 2659(b)

Record ID: DEH2012-HUPFP-216497
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216497
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5497176
Return To Compliance Date: 2016-05-25T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T06:07:26.000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ARC OF SAN DIEGO, ARC ENTERPRISES (Continued)

S112974776

Inspection Date: 2016-05-25T13:14:00.000
Violation Code: 1010001 HMBP not established/ implemented. HSC 25505(a) and 25507(a)

Record ID: DEH2012-HUPFP-216497
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-216497
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5497176
Return To Compliance Date: 2016-06-11T00:00:00.000
Nov: Yes
Violation Classification: Class I
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T06:07:26.000
Inspection Date: 2016-05-25T13:14:00.000
Violation Code: HMD1001 Unified Program Facility permit not obtained for hazardous materials. SDCC 68.905

Waste and Materials:

Record ID: DEH2012-HUPFP-216497
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0103313
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-07-19T02:31:41.000
Chemical Name: Propane- Liquefied Petroleum Gas (lpg)
Common Name: Propane Spares
Case Number: 74-98-6

Record ID: DEH2012-HUPFP-216497
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0182961
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T06:07:26.000
Chemical Name: Propane
Common Name: Liquefied Petroleum Gas (lpg)
Case Number: 74-98-6

Permit Number: 216497
Business Type: 6HK70
EPA Id Number: Not reported
APN: 421-030-58-02
Last HMMD Inspection: 05/16/2012
Facility Telephone: 858-571-4369
Permit Status: OPEN
Permit Expiration: 09/30/2013
Date Last Updated: 11/02/2012
Facility Owner: THE ARC OF SAN DIEGO
Facility Mailing Address: 3030 MARKET ST
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ARC OF SAN DIEGO, ARC ENTERPRISES (Continued)

S112974776

Facility Mailing Zip: 92102
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 216497
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 216497
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 213 HYDROCARBON SOLVENTS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

HAZNET:

Facility Name: THE ARC OF SAN DIEGO
envid: S112974776
Year: 2016
GEPAID: CAC002858200
Contact: KATHRYN PHIN
Telephone: 8585762600
Mailing Name: Not reported
Mailing Address: 9575 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 92123
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Other inorganic solid waste
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.034
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112974776
Year: 2009
GEPAID: CAC002637519
Contact: PAUL CULLER
Telephone: 8587153780
Mailing Name: Not reported
Mailing Address: 9575 AERO DR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ARC OF SAN DIEGO, ARC ENTERPRISES (Continued)

S112974776

Mailing City,St,Zip: SAN DIEGO, CA 921231803
Gen County: Not reported
TSD EPA ID: CAD980675276
TSD County: Not reported
Waste Category: Latex waste
Disposal Method: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Tons: 0.55
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112974776
Year: 2009
GEPAID: CAC002637519
Contact: PAUL CULLER
Telephone: 8587153780
Mailing Name: Not reported
Mailing Address: 9575 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921231803
Gen County: Not reported
TSD EPA ID: TXD055141378
TSD County: Not reported
Waste Category: Off-specification, aged or surplus inorganics
Disposal Method: Incineration--Thermal Destruction Other Than Use As A Fuel
Tons: 0.055
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112974776
Year: 2009
GEPAID: CAC002637519
Contact: PAUL CULLER
Telephone: 8587153780
Mailing Name: Not reported
Mailing Address: 9575 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921231803
Gen County: Not reported
TSD EPA ID: CAD044429835
TSD County: Not reported
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.1
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S112974776
Year: 2009
GEPAID: CAC002637519
Contact: PAUL CULLER
Telephone: 8587153780
Mailing Name: Not reported
Mailing Address: 9575 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921231803

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ARC OF SAN DIEGO, ARC ENTERPRISES (Continued)

S112974776

Gen County: Not reported
TSD EPA ID: CAD044429835
TSD County: Not reported
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Not reported
Tons: 0.09
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
1 additional CA_HAZNET: record(s) in the EDR Site Report.

135
ESE
< 1/8
0.001 mi.
6 ft.

**SDCTY-FIRE-RESCUE DEPT, FIRE COMMUNICATIONS CENTER
3750 KEARNY VILLA RD
SAN DIEGO, CA 92123**

**CA UST U003789860
CA SWEEPS UST N/A**

**Actual:
395 ft.
Focus Map:
1**

UST:
Facility ID: H26616
Permitting Agency: SAN DIEGO COUNTY
Latitude: 32.8120945
Longitude: -117.1496799

Facility ID: 37-000-126616
Permitting Agency: San Diego County Department of Environmental Health
Latitude: 32.81073
Longitude: -117.15064

SWEEPS UST:
Status: Active
Comp Number: 26616
Number: 9
Board Of Equalization: 44-023732
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-026616-000001
Tank Status: A
Capacity: 4000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

Q136
West
< 1/8
0.002 mi.
8 ft.
Site 1 of 3 in cluster Q

CA San Diego Co. HMMD
CA SWEEPS UST
CA HAZNET
S104745894
N/A

Actual:
403 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000403763
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 858-277-0312
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 07/06/2018
Facility Owner: Not reported
Facility Mailing Address: 3873 KEARNY VILLA RD, SAN DIEGO, CA 92123
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4099101
Return To Compliance Date: 2014-12-10T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T19:39:55.000
Inspection Date: 2014-11-26T00:00:00.000
Violation Code: 3020001 Failure to ensure employees are familiar with the handling and compliance of hazardous waste regulations and emergency response. 22 CCR 12 66262.34(d)(2); 40 CFR 1 262.34(d)(5)(iii)

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5547463
Return To Compliance Date: 2016-08-18T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPIDERS AIRCRAFT SERVICE INC (Continued)

S104745894

Last Update: 2018-10-26T19:39:55.000
Inspection Date: 2016-08-09T16:37:00.000
Violation Code: 1020002 Initial and/or annual employee training not conducted for hazardous materials management and/or employee training records not available or not maintained for 3 years. HSC 25505(a)(4)

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4099101
Return To Compliance Date: 2014-12-10T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T19:39:55.000
Inspection Date: 2014-11-26T00:00:00.000
Violation Code: 3030017 Failure to properly close hazardous waste containers when not in active use.; 22 CCR 12 66262.34(d)(2); 40 CFR 1 265.173.

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 5547463
Return To Compliance Date: 2016-08-18T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T19:39:55.000
Inspection Date: 2016-08-09T16:37:00.000
Violation Code: 3010010 Failed to maintain uniform hazardous waste manifest, consolidated manifest, or bills of lading copies for 3 years. HSC 25160.2(b)(3), 25185(a)(4); 22 CCR 66262.40(a)

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5547463
Return To Compliance Date: 2016-08-09T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T19:39:55.000
Inspection Date: 2016-08-09T16:37:00.000
Violation Code: 1010008 HMBP not certified annually as complete and accurate in CERS. HSC 25508.2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPIDERS AIRCRAFT SERVICE INC (Continued)

S104745894

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4099101
Return To Compliance Date: 2014-12-10T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T19:39:55.000
Inspection Date: 2014-11-26T00:00:00.000
Violation Code: HMD0226 Did not accumulate waste in container or tank. 66262.34(d)(2).

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4099101
Return To Compliance Date: 2014-12-26T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T19:39:55.000
Inspection Date: 2014-11-26T00:00:00.000
Violation Code: 3030004 Failure to properly handle, manage, label, and recycle used oil and fuel filters.; 22 CCR 16 66266.130.

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4099101
Return To Compliance Date: 2014-11-26T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T19:39:55.000
Inspection Date: 2014-11-26T00:00:00.000
Violation Code: 3010010 Failure to maintain uniform hazardous waste manifest, consolidated manifest, or bills of lading copies for three years.; 22 CCR 12 66262.40(a).

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Program Element: Hazardous Waste Generator
Inspection Type: Routine

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPIDERS AIRCRAFT SERVICE INC (Continued)

S104745894

Inspection Number: 4099101
Return To Compliance Date: 2014-12-24T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T19:39:55.000
Inspection Date: 2014-11-26T00:00:00.000
Violation Code: 3010022 Failure to post, next to the telephone, Emergency Information (SQG) containing the location of emergency equipment, contact names and numbers. 22 CFR 12 66262.34(d)(2); 40 CFR 1 262.34(d)(5)(ii)

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4099101
Return To Compliance Date: 2014-11-26T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T19:39:55.000
Inspection Date: 2014-11-26T00:00:00.000
Violation Code: 3030007 Failure to properly label hazardous waste accumulation containers with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.; 22 CCR 12 66262.34(f).

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 5547463
Return To Compliance Date: 2016-08-09T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-26T19:39:55.000
Inspection Date: 2016-08-09T16:37:00.000
Violation Code: 3030015 Failed to accumulate or store hazardous waste in a lined/compatible container. (40 CFR 262.34(d)(2); 265.172) 22 CCR 66262.34(d)(2)

UST DTL:

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Facility Type (Ust Facility): Not reported
Tank Owner Name: Fred Sorbi

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPIDERS AIRCRAFT SERVICE INC (Continued)

S104745894

Tankid: 18102
Tank Status: Removed
Date Ust Permanently Closed: 11/08/1986
Tank Use: Not reported
Piping System Type: Not reported
Last Updated: 2018-10-26T19:39:55.000
Tank Capacityin Gallons: 550
Tank Contents: Not reported
Type Of Tank: 95

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104244
Facility Type (Ust Facility): Not reported
Tank Owner Name: Fred Sorbi
Tankid: 18101
Tank Status: Removed
Date Ust Permanently Closed: 11/08/1986
Tank Use: 04
Piping System Type: Not reported
Last Updated: 2018-10-26T19:39:55.000
Tank Capacityin Gallons: 250
Tank Contents: Not reported
Type Of Tank: 95

Waste and Materials:

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0091699
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-16T08:47:29.000
Chemical Name: WASTE OIL
Common Name: WASTE OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0091700
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-16T08:47:29.000
Chemical Name: BEAD BLASTER WASTE
Common Name: BEAD BLASTER WASTE
Case Number: Not reported

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0091701
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-16T08:47:29.000
Chemical Name: OILY ABSORBENT & RAGS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPIDERS AIRCRAFT SERVICE INC (Continued)

S104745894

Common Name: OILY ABSORBENT & RAGS
Case Number: Not reported

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0123760
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-23T02:31:55.000
Chemical Name: WASTE OIL
Common Name: WASTE OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0123761
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-23T02:31:55.000
Chemical Name: BEAD BLASTER WASTE
Common Name: BEAD BLASTER WASTE
Case Number: Not reported

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0123762
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-23T02:31:55.000
Chemical Name: OILY ABSORBENT & RAGS
Common Name: OILY ABSORBENT & RAGS
Case Number: Not reported

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0166283
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:39:55.000
Chemical Name: WASTE OIL
Common Name: WASTE OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0166284
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:39:55.000
Chemical Name: BEAD BLASTER WASTE
Common Name: BEAD BLASTER WASTE
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPIDERS AIRCRAFT SERVICE INC (Continued)

S104745894

Record ID: DEH2002-HUPFP-104244
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0166285
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:39:55.000
Chemical Name: OILY ABSORBENT & RAGS
Common Name: OILY ABSORBENT & RAGS
Case Number: Not reported

Permit Number: 104244
Business Type: 6HK26
EPA Id Number: CAD002804847
APN: 421-290-11-00
Last HMMD Inspection: 07/23/2012
Facility Telephone: 858-277-0312
Permit Status: OPEN
Permit Expiration: 05/31/2013
Date Last Updated: 11/02/2012
Facility Owner: BHC CORP
Facility Mailing Address: 3873 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1701
UST Owner: SPIDERS AIRCRAFT SERVICE INC
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 104244
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN 02, 99%, COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 104244
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: PARTS WASHER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 104244
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information: SANDBLAST

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPIDERS AIRCRAFT SERVICE INC (Continued)

S104745894

Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 104244
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: USED OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 104244
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 444 USED BATTERIES
Other Information: EL CAJON BATT SPEC
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 104244
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 104244
Update Date: 11/02/2012
Inspection Date: 07/23/2012
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank.
66262.34(f)
Activity: ACTIVE

Permit Number: 104244
Update Date: 11/02/2012
Inspection Date: 07/23/2012
Violation Code: 6HV0228
Violation: CONTAINER NOT KEPT CLOSED
Violation Citation: Failed to keep container closed. CFR 265.173
Activity: ACTIVE

Permit Number: 104244
Update Date: 11/02/2012
Inspection Date: 07/23/2012
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR
262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPIDERS AIRCRAFT SERVICE INC (Continued)

S104745894

UST:

UST Name: UNDERGROUND TANK 104244 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 104244
Tank Type: UNKNOWN
Additional Id: 2
Capacity Gallons: 250
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1986-11-08 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 104244 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 104244
Tank Type: UNKNOWN
Additional Id: 1
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: SEE FILE FOR CONTENTS
Reg Status: REMOVED
Remove Close Date: 1986-11-08 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

SWEEPS UST:

Status: Active
Comp Number: 4244
Number: 9
Board Of Equalization: 44-022016
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: Not reported
Tank Status: Not reported
Capacity: Not reported
Active Date: Not reported
Tank Use: Not reported
STG: Not reported
Content: Not reported
Number Of Tanks: Not reported

HAZNET:

Facility Name: SORBI AIRCRAFT MAINTENANCE INC DBA SPIDERS AIRCRAFT SERVICES INC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SPIDERS AIRCRAFT SERVICE INC (Continued)

S104745894

envid: S104745894
Year: 2016
GEPAID: CAL000394192
Contact: FRED SORBI
Telephone: 8582770312
Mailing Name: Not reported
Mailing Address: 3873 KEARNY VILLA RD
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: AZD081705402
TSD County: 99
Waste Category: Other inorganic solid waste
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.5
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

R137 **MONTGOMERY FIELD ATCT**
ESE **4298 PONDEROSA AV**
< 1/8 **SAN DIEGO, CA 92123**

CA LUST
CA SAN DIEGO CO. SAM
CA San Diego Co. HMMD

S105035994
N/A

0.004 mi.
22 ft.

Site 1 of 3 in cluster R

Actual: SAN DIEGO CO. SAM:
431 ft. Case Number: H21302-001
Focus Map: Agency: CA Regional Water Quality Control Board
1 **Funding:** **LOP - State Fund**
Facility Type: Soils Only
Facility Status: Preliminary Assessment
Date: 9/7/2003
Date Began: 7/23/1998

HMMD SAN DIEGO:
Permit Number: 121302
Business Type: 6HK52
EPA Id Number: CA000294911
APN: 421-290-11-00
Last HMMD Inspection: 12/08/2010
Facility Telephone: 858-292-7247
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: FEDERAL AVIATION ADMIN
Facility Mailing Address: 9175 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92126-7009
UST Owner: FEDERAL AVIATION ADMIN
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Y
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Inventory Active Permits (not SQG Medical):

Permit Number: 121302
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL OIL NO. 2
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 241 TANK BOTTOM WASTE
Other Information: OILY WATER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information: ORGANICS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information: WASTE ANTIFREEZE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: OILY ABSORBENT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Case Number: Not reported
Name: WASTE 444 USED BATTERIES
Other Information: POWERSTRIDE BATTERY
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 551 LABORATORY WASTE CHEMICALS
Other Information: FLAMMABLE LIQUIDS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV0226
Violation: HW NOT ACCUMULATED IN TANK/CONTAINER
Violation Citation: Did not accumulate waste in container or tank. 66262.34 (d)(2)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank.
66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained
onsite to document proper disposal of hazardous waste. CCR 66262.40(a)
& 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days &
are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0217
Violation: HAZMAT CON. NOT REPACKAGED WI 96 HRS.
Violation Citation: Failed to repackage damaged/deteriorated hazardous material container
within 96 hours. 25124(b)(3)(B) & 66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank.
66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0228
Violation: CONTAINER NOT KEPT CLOSED
Violation Citation: Failed to keep container closed. CFR 265.173
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0234
Violation: FACILITY NOT OPERATED TO MINIM. RELEASE
Violation Citation: Did not maintain &/or operate facility to prevent release or fire. CFR 265.31

Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 121302 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: SINGLE WALL
Additional Id: 1 DIESEL
Capacity Gallons: 1000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1998-07-23 00:00:00
Year Installed: Not reported
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 121302 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: UNKNOWN
Additional Id: AT0000
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1993-02-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 121302 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: UNKNOWN
Additional Id: AT0000
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1993-02-17 00:00:00
Year Installed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 121302 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: DOUBLE WALL
Additional Id: AT4193
Capacity Gallons: 3000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1998-10-26 00:00:00
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

Permit Number: 121302
Business Type: 6HK52
EPA Id Number: CA000294911
APN: 421-290-11-00
Last HMMD Inspection: 12/08/2010
Facility Telephone: 858-292-7247
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: FEDERAL AVIATION ADMIN
Facility Mailing Address: 9175 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92126-7009
UST Owner: FEDERAL AVIATION ADMIN
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: N
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 121302
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL OIL NO. 2
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	Not reported
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	121302
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 241 TANK BOTTOM WASTE
Other Information:	OILY WATER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	121302
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	ORGANICS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	121302
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information:	WASTE ANTIFREEZE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	121302
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information:	OILY ABSORBENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	121302
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 444 USED BATTERIES
Other Information:	POWERSTRIDE BATTERY
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	121302
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 551 LABORATORY WASTE CHEMICALS
Other Information:	FLAMMABLE LIQUIDS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV0226
Violation: HW NOT ACCUMULATED IN TANK/CONTAINER
Violation Citation: Did not accumulate waste in container or tank. 66262.34 (d)(2)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0216
Violation: HAZMATs WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0217
Violation: HAZMAT CON. NOT REPACKAGED WI 96 HRS.
Violation Citation: Failed to repackage damaged/deteriorated hazardous material container within 96 hours. 25124(b)(3)(B) & 66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0228
Violation: CONTAINER NOT KEPT CLOSED
Violation Citation: Failed to keep container closed. CFR 265.173
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0234
Violation: FACILITY NOT OPERATED TO MINIM. RELEASE
Violation Citation: Did not maintain &/or operate facility to prevent release or fire. CFR 265.31
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

UST:

UST Name: UNDERGROUND TANK 121302 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: SINGLE WALL
Additional Id: 1 DIESEL
Capacity Gallons: 1000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1998-07-23 00:00:00
Year Installed: Not reported
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 121302 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: UNKNOWN
Additional Id: AT0000
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1993-02-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 121302 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: UNKNOWN
Additional Id: AT0000
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1993-02-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 121302 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: DOUBLE WALL
Additional Id: AT4193

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Capacity Gallons: 3000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1998-10-26 00:00:00
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

Permit Number: 121302
Business Type: 6HK52
EPA Id Number: CA000294911
APN: 421-290-11-00
Last HMMD Inspection: 12/08/2010
Facility Telephone: 858-292-7247
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: FEDERAL AVIATION ADMIN
Facility Mailing Address: 9175 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92126-7009
UST Owner: FEDERAL AVIATION ADMIN
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: N
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 121302
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL OIL NO. 2
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 241 TANK BOTTOM WASTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Other Information:	OILY WATER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	121302
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	ORGANICS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	121302
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information:	WASTE ANTIFREEZE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	121302
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information:	OILY ABSORBENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	121302
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 444 USED BATTERIES
Other Information:	POWERSTRIDE BATTERY
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	121302
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 551 LABORATORY WASTE CHEMICALS
Other Information:	FLAMMABLE LIQUIDS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	121302
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 888 USED OIL FILTERS
Other Information:	Not reported
Material Waste:	Waste
Hazardous Categories 1:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV0226
Violation: HW NOT ACCUMULATED IN TANK/CONTAINER
Violation Citation: Did not accumulate waste in container or tank. 66262.34 (d)(2)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0217
Violation: HAZMAT CON. NOT REPACKAGED WI 96 HRS.
Violation Citation: Failed to repackage damaged/deteriorated hazardous material container within 96 hours. 25124(b)(3)(B) & 66262.34(f)

Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)

Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0228
Violation: CONTAINER NOT KEPT CLOSED
Violation Citation: Failed to keep container closed. CFR 265.173

Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174

Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0234
Violation: FACILITY NOT OPERATED TO MINIM. RELEASE
Violation Citation: Did not maintain &/or operate facility to prevent release or fire. CFR 265.31

Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 121302 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: SINGLE WALL
Additional Id: 1 DIESEL
Capacity Gallons: 1000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1998-07-23 00:00:00
Year Installed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 121302 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: UNKNOWN
Additional Id: AT0000
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1993-02-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 121302 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: UNKNOWN
Additional Id: AT0000
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1993-02-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 121302 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: DOUBLE WALL
Additional Id: AT4193
Capacity Gallons: 3000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1998-10-26 00:00:00
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Permit Number: 121302
Business Type: 6HK52
EPA Id Number: CA000294911
APN: 421-290-11-00
Last HMMI Inspection: 12/08/2010
Facility Telephone: 858-292-7247
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: FEDERAL AVIATION ADMIN
Facility Mailing Address: 9175 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92126-7009
UST Owner: FEDERAL AVIATION ADMIN
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 121302
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL OIL NO. 2
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 241 TANK BOTTOM WASTE
Other Information: OILY WATER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information: ORGANICS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information: WASTE ANTIFREEZE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: OILY ABSORBENT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 444 USED BATTERIES
Other Information: POWERSTRIDE BATTERY
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 551 LABORATORY WASTE CHEMICALS
Other Information: FLAMMABLE LIQUIDS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 121302
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 121302

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV0226
Violation: HW NOT ACCUMULATED IN TANK/CONTAINER
Violation Citation: Did not accumulate waste in container or tank. 66262.34 (d)(2)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 10/16/2008
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0217
Violation: HAZMAT CON. NOT REPACKAGED WI 96 HRS.
Violation Citation: Failed to repackage damaged/deteriorated hazardous material container within 96 hours. 25124(b)(3)(B) & 66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank.
66262.34(f)
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0228
Violation: CONTAINER NOT KEPT CLOSED
Violation Citation: Failed to keep container closed. CFR 265.173
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 121302
Update Date: 11/02/2012
Inspection Date: 01/18/2007
Violation Code: 6HV0234
Violation: FACILITY NOT OPERATED TO MINIM. RELEASE
Violation Citation: Did not maintain &/or operate facility to prevent release or fire. CFR
265.31
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 121302 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: SINGLE WALL
Additional Id: 1 DIESEL
Capacity Gallons: 1000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1998-07-23 00:00:00
Year Installed: Not reported
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR
WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 121302 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: UNKNOWN
Additional Id: AT0000
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

S105035994

Reg Status: REMOVED
Remove Close Date: 1993-02-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 121302 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: UNKNOWN
Additional Id: AT0000
Capacity Gallons: 550
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1993-02-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 121302 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 121302
Tank Type: DOUBLE WALL
Additional Id: AT4193
Capacity Gallons: 3000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1998-10-26 00:00:00
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

R138 MONTGOMERY FIELD ATCT
ESE 4298 PONDEROSA AV
< 1/8 SAN DIEGO, CA 92123
0.004 mi.
22 ft. Site 2 of 3 in cluster R

CA LUST U001573224
CA San Diego Co. HMMD N/A
CA SWEEPS UST
CA HIST UST
CA HIST CORTESE
CA SAN DIEGO CO LOP

Actual:
431 ft.

Focus Map:
1

LUST:
Lead Agency: SAN DIEGO RWQCB (REGION 9)
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607302461
Global Id: T0607302461
Latitude: 32.8202618
Longitude: -117.1325061

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

U001573224

Status: Completed - Case Closed
Status Date: 04/05/2011
Case Worker: SM
RB Case Number: 9UT3693
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H21302-001
Potential Media Affect: Soil
Potential Contaminants of Concern: Diesel
Site History: The Montgomery Field Air Control Tower had an Underground Storage Tank (UST) removed in 1998. The surrounding soil was found to be contaminated with petroleum hydrocarbons. There is a potentially complete exposure pathway for inhalation due to vapor intrusion into the adjacent building. For further information please see Additional Site Assessment Report for Montgomery Field air Traffic Control Tower dated April 2, 2008, under the Site Documents tab.

LUST:

Global Id: T0607302461
Contact Type: Regional Board Caseworker
Contact Name: SEAN MCCLAIN
Organization Name: SAN DIEGO RWQCB (REGION 9)
Address: 2375 NORTHSIDE DRIVE, SUITE 100
City: SAN DIEGO
Email: sean.mcclain@waterboards.ca.gov
Phone Number: 6195213374

LUST:

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 06/28/2007
Action: 13267 Requirement - #R9-2007-102

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 09/14/2007
Action: Verbal Enforcement

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 08/23/2007
Action: Verbal Enforcement

Global Id: T0607302461
Action Type: Other
Date: 07/29/1998
Action: Leak Reported

Global Id: T0607302461
Action Type: RESPONSE
Date: 01/30/2007
Action: Monitoring Report - Quarterly

Global Id: T0607302461
Action Type: RESPONSE
Date: 10/01/2007
Action: Soil and Water Investigation Workplan

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

U001573224

Global Id: T0607302461
Action Type: RESPONSE
Date: 03/01/2008
Action: Corrective Action Plan / Remedial Action Plan

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 12/01/2008
Action: Staff Letter

Global Id: T0607302461
Action Type: RESPONSE
Date: 09/30/2007
Action: Other Workplan

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 03/18/2010
Action: File review

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 05/10/2011
Action: Closure/No Further Action Letter

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 03/28/2011
Action: Notification - Fee Title Owners Notice

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 03/28/2011
Action: Notification - Public Notice of Case Closure

Global Id: T0607302461
Action Type: RESPONSE
Date: 01/30/2011
Action: Other Report / Document

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 10/26/2007
Action: Verbal Enforcement

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 08/30/2007
Action: Verbal Enforcement

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 09/24/2007
Action: Verbal Enforcement

Global Id: T0607302461
Action Type: Other

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

U001573224

Date:	07/23/1998
Action:	Leak Began
Global Id:	T0607302461
Action Type:	ENFORCEMENT
Date:	05/23/2007
Action:	Verbal Enforcement
Global Id:	T0607302461
Action Type:	ENFORCEMENT
Date:	01/25/2007
Action:	Staff Letter
Global Id:	T0607302461
Action Type:	ENFORCEMENT
Date:	06/27/2007
Action:	Verbal Enforcement
Global Id:	T0607302461
Action Type:	ENFORCEMENT
Date:	12/04/2006
Action:	Referral to Regional Board
Global Id:	T0607302461
Action Type:	ENFORCEMENT
Date:	06/25/2007
Action:	Verbal Enforcement
Global Id:	T0607302461
Action Type:	ENFORCEMENT
Date:	05/25/2007
Action:	Verbal Enforcement
Global Id:	T0607302461
Action Type:	ENFORCEMENT
Date:	05/31/2007
Action:	Verbal Enforcement
Global Id:	T0607302461
Action Type:	ENFORCEMENT
Date:	03/07/2007
Action:	Verbal Enforcement
Global Id:	T0607302461
Action Type:	ENFORCEMENT
Date:	03/08/2007
Action:	Verbal Enforcement
Global Id:	T0607302461
Action Type:	ENFORCEMENT
Date:	03/29/2007
Action:	Verbal Enforcement
Global Id:	T0607302461
Action Type:	ENFORCEMENT
Date:	10/01/2007
Action:	Verbal Enforcement

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

U001573224

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 05/02/2007
Action: Verbal Enforcement

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 08/10/2007
Action: Verbal Enforcement

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 01/15/2008
Action: Site Visit / Inspection / Sampling

Global Id: T0607302461
Action Type: Other
Date: 07/23/1998
Action: Leak Discovery

Global Id: T0607302461
Action Type: Other
Date: 07/29/1998
Action: Leak Stopped

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 02/06/2007
Action: Verbal Enforcement

Global Id: T0607302461
Action Type: ENFORCEMENT
Date: 11/28/2007
Action: Verbal Enforcement

LUST:

Global Id: T0607302461
Status: Completed - Case Closed
Status Date: 04/05/2010

Global Id: T0607302461
Status: Completed - Case Closed
Status Date: 04/05/2011

Global Id: T0607302461
Status: Open - Case Begin Date
Status Date: 07/23/1998

Global Id: T0607302461
Status: Open - Site Assessment
Status Date: 07/23/1998

Global Id: T0607302461
Status: Open - Site Assessment
Status Date: 09/04/2007

Global Id: T0607302461

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

U001573224

Status: Open - Verification Monitoring
Status Date: 04/05/2010

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000294911
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 858-292-7247
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 06/07/2018
Facility Owner: Not reported
Facility Mailing Address: 9175 Kearny Villa Road, SAN DIEGO, CA 92126
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121302
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 6023970
Return To Compliance Date: 2018-10-19T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-19T14:55:58.000
Inspection Date: 2018-10-19T14:55:57.000
Violation Code: 1010008 HMBP not certified annually as complete and accurate in CERS.
HSC 25508(a)(1)(A), 25508.2, 19 CCR 2654(b)

UST DTL:

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121302
Facility Type (Ust Facility): Not reported
Tank Owner Name: FEDERAL AVIATION ADMINISTRATION
Tankid: 26960
Tank Status: Removed
Date Ust Permanently Closed: 07/23/1998
Tank Use: 01
Piping System Type: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

U001573224

Last Updated: 2018-06-07T02:32:14.000
Tank Capacityin Gallons: 1000
Tank Contents: Diesel
Type Of Tank: 01

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121302
Facility Type (Ust Facility): Not reported
Tank Owner Name: FEDERAL AVIATION ADMINISTRATION
Tankid: 26962
Tank Status: Removed
Date Ust Permanently Closed: 02/17/1993
Tank Use: 01
Piping System Type: Not reported
Last Updated: 2018-06-07T02:32:14.000
Tank Capacityin Gallons: 550
Tank Contents: Diesel
Type Of Tank: 95

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121302
Facility Type (Ust Facility): Not reported
Tank Owner Name: FEDERAL AVIATION ADMINISTRATION
Tankid: 26963
Tank Status: Removed
Date Ust Permanently Closed: 10/26/1998
Tank Use: 01
Piping System Type: 02
Last Updated: 2018-06-07T02:32:14.000
Tank Capacityin Gallons: 3000
Tank Contents: Diesel
Type Of Tank: 02

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121302
Facility Type (Ust Facility): Not reported
Tank Owner Name: FEDERAL AVIATION ADMINISTRATION
Tankid: 26961
Tank Status: Removed
Date Ust Permanently Closed: 02/17/1993
Tank Use: 01
Piping System Type: Not reported
Last Updated: 2018-06-07T02:32:14.000
Tank Capacityin Gallons: 550
Tank Contents: Diesel
Type Of Tank: 95

Waste and Materials:

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

U001573224

Child Record Id: DEH2016-HCHEM-0117031
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-01-20T00:00:00.000
Chemical Name: DIESEL FUEL OIL NO. 2
Common Name: DIESEL FUEL OIL NO. 2
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0117032
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-01-20T00:00:00.000
Chemical Name: Propane
Common Name: Liquefied Petroleum Gas (lpg)
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0098404
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-01-20T00:00:00.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: USED OIL & MIXED OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0098405
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-01-20T00:00:00.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: OILY ABSORBENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0098406
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-01-20T00:00:00.000
Chemical Name: WASTE 342 ORGANIC LIQUIDS W/METALS
Common Name: USED ANTIFREEZE
Case Number: Not reported

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0138894
Trade Secret: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

U001573224

Hazardous Material Type: Pure
Last Updated: 2018-06-07T02:32:14.000
Chemical Name: DIESEL FUEL OIL NO. 2
Common Name: DIESEL FUEL OIL NO. 2
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0138895
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-07T02:32:14.000
Chemical Name: Propane
Common Name: Liquefied Petroleum Gas (lpg)
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0117742
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-07T02:32:14.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: USED OIL & MIXED OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0117743
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-07T02:32:14.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: OILY ABSORBENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-121302
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0117744
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-07T02:32:14.000
Chemical Name: WASTE 342 ORGANIC LIQUIDS W/METALS
Common Name: USED ANTIFREEZE
Case Number: Not reported

SWEEPS UST:

Status: Active
Comp Number: 21302
Number: 9
Board Of Equalization: 44-003165
Referral Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

U001573224

Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021302-000001
Tank Status: A
Capacity: 1000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: 1

HIST UST:

File Number: 0002B2C8
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002B2C8.pdf>
Region: STATE
Facility ID: 00000059099
Facility Type: Other
Other Type: AIRPORT
Contact Name: MATTHEW KING
Telephone: 6192775601
Owner Name: FEDERAL AVIATION ADMINISTRATIO
Owner Address: 8575 GIBBS DRIVE, SUITE 101
Owner City,St,Zip: SAN DIEGO, CA 92123
Total Tanks: 0001

Tank Num: 001
Container Num: 1
Year Installed: Not reported
Tank Capacity: 00000500
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: Not reported
Leak Detection: None

[Click here for Geo Tracker PDF:](#)

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT3693

SAN DIEGO CO LOP:

Record ID: DEH1998-LSAM-H21302-001
Record Status: Completed
Opened Date: 07/29/1998
Parcel Number: 421-290-11-00
Case Type: LOP - Local Oversight Program
Historical Name: MONTGOMERY FIELD
SWRCB Global ID: T0607302461
Funding: S - LOP State Fund
Lead Agency: RWQCB
Lead Agency Date: 12/04/2006
Census Tract: 85.11
Community: San Diego

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MONTGOMERY FIELD ATCT (Continued)

U001573224

Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 C 3
Latitude: 32.8145972
Longitude: -117.1412173
X MapCoord: 6287850.143
Y MapCoord: 1877338.887

Q139
NNE
< 1/8
0.007 mi.
38 ft.

SDCTY-FIRE STATION #28
3880 KEARNY VILLA RD
SAN DIEGO, CA 92123
Site 2 of 3 in cluster Q

CA UST
CA San Diego Co. HMMD
CA SWEEPS UST

U003941549
N/A

Actual:
403 ft.
Focus Map:
1

UST:
Facility ID: H21297
Permitting Agency: SAN DIEGO COUNTY
Latitude: 32.813254
Longitude: -117.1493705

Facility ID: 37-000-121297
Permitting Agency: San Diego County Department of Environmental Health
Latitude: 32.8123
Longitude: -117.15036

HMMD SAN DIEGO:
Permit Number: 121297
Business Type: 6HK23
EPA Id Number: CAL000067508
APN: 421-290-09-00
Last HMMD Inspection: 03/02/2012
Facility Telephone: 858-573-1367
Permit Status: OPEN
Permit Expiration: 09/30/2013
Date Last Updated: 11/02/2012
Facility Owner: CITY OF SAN DIEGO
Facility Mailing Address: 3870 KEARNY VILLA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: CITY OF SAN DIEGO FIRE REPAIR
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):
Permit Number: 121297
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL
Other Information: UNDERGROUND TANK 121297 T002
Material Waste: Material
Hazardous Categories 1: FIRE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE STATION #28 (Continued)

U003941549

Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 121297
Update Date: 11/02/2012
Inspection Date: 03/13/2007
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or
DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 121297
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV3267
Violation: DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation: Dispenser containment not adequately monitored. 2636(f)(1) or
(f)(5)(A)
Activity: ACTIVE

Permit Number: 121297
Update Date: 11/02/2012
Inspection Date: 03/07/2008
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or
DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 121297
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 121297
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV3261
Violation: DISPENSER CONTAINMENT NOT DRY
Violation Citation: Dispenser containment not free of liquid. 2631(d)(4)
Activity: ACTIVE

Permit Number: 121297
Update Date: 11/02/2012
Inspection Date: 03/10/2004
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized
point (ground, storm drain, sewer system, trash, or air). HSC
25189.5(a) or 25189(d)
Activity: ACTIVE

Permit Number: 121297

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE STATION #28 (Continued)

U003941549

Update Date: 11/02/2012
Inspection Date: 03/02/2012
Violation Code: 6HV3267
Violation: DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation: Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity: ACTIVE

Permit Number: 121297
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV3257
Violation: 2NDRY CONTAINMENT NOT LIQUID FREE
Violation Citation: Secondary containment system components not liquid free. 2631(d)(4)
Activity: ACTIVE

Permit Number: 121297
Update Date: 11/02/2012
Inspection Date: 03/14/2006
Violation Code: 6HV3267
Violation: DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation: Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 121297 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121297
Tank Type: SINGLE WALL
Additional Id: 000001
Capacity Gallons: 280
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1992-03-24 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY MONTHLY, TANK TEST BIENNIALLY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 121297 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 121297
Tank Type: DOUBLE WALL
Additional Id: NT1616/RT1749/RT4184
Capacity Gallons: 1000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1992-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 21

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SDCTY-FIRE STATION #28 (Continued)

U003941549

UST Monitor Method: DW TANK DW SUCTION AND/ OR GRAVITY PIPING WITH INTERSTITIAL MONITORS: INTERSTITIAL.

SWEEPS UST:

Status: Active
Comp Number: 21297
Number: 9
Board Of Equalization: 44-023517
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021297-000002
Tank Status: A
Capacity: 1000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: 1

**Q140
NNE
< 1/8
0.007 mi.
38 ft.**

**FIRE STATION 28
3880 KEARNY VILLA RD
SAN DIEGO, CA 92123

Site 3 of 3 in cluster Q**

**CA HIST UST U001573209
N/A**

**Actual:
403 ft.**

**Focus Map:
1**

HIST UST:

File Number: 0002AF80
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002AF80.pdf>
Region: STATE
Facility ID: 00000000280
Facility Type: Other
Other Type: FIRE STATION
Contact Name: Not reported
Telephone: 6192366855
Owner Name: CITY OF SAN DIEGO FIRE DEPT
Owner Address: 1222 1ST AV
Owner City,St,Zip: SAN DIEGO, CA 92101
Total Tanks: 0001

Tank Num: 001
Container Num: 2801
Year Installed: 1958
Tank Capacity: 00000285
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: 12
Leak Detection: Visual, Stock Inventor

Click here for Geo Tracker PDF:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

S141
East
< 1/8
0.013 mi.
70 ft.
PROGENY SYSTEMS
4217 PONDEROSA AVE STE H
SAN DIEGO, CA 92123
Site 1 of 6 in cluster S

CA SAN DIEGO CO. SAM
CA CPS-SLIC
CA San Diego Co. HMM
CA HAZNET

S104752715
N/A

Actual:
431 ft.

Focus Map:
1

SAN DIEGO CO. SAM:

Case Number: H31343-002
Agency: DEH Site Assessment & Mitigation
Funding: Private - VAP
Facility Type: Soils Only
Facility Status: Closed Case
Date: 3/28/2006
Date Began: Not reported

Case Number: H31343-001
Agency: DEH Site Assessment & Mitigation
Funding: Private - VAP
Facility Type: Soils Only
Facility Status: Closed Case
Date: 2/10/1998
Date Began: Not reported

CPS-SLIC:

Region: STATE
Facility Status: Completed - Case Closed
Status Date: 02/10/1998
Global Id: T0608158316
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H31343-001
Latitude: 32.818477
Longitude: -117.132483
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Soil
Potential Contaminants of Concern: * Chlorinated Hydrocarbons
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

Region: STATE
Facility Status: Completed - Case Closed
Status Date: 03/28/2006
Global Id: T06019753982
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H31343-002
Latitude: 32.818477
Longitude: -117.132483
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PROGENY SYSTEMS (Continued)

S104752715

[Click here to access the California GeoTracker records for this facility:](#)

HMMD SAN DIEGO:

Permit Number: 131343
Business Type: 6HK36
EPA Id Number: CAL000055362
APN: 369-170-20-00
Last HMMD Inspection: 06/30/1998
Facility Telephone: 858-565-6631
Permit Status: INAC
Permit Expiration: 06/30/1998
Date Last Updated: 11/02/2012
Facility Owner: HUMPHREY INC
Facility Mailing Address: 9212 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

HAZNET:

Facility Name: PROGENY SYSTEMS
envid: S104752715
Year: 2017
GEPAID: CAL000371399
Contact: ANNE NGUYEN
Telephone: 8587151203
Mailing Name: Not reported
Mailing Address: 4217 PONDEROSA AVE STE H
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.017
Cat Decode: Off-specification, aged or surplus organics
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S104752715
Year: 2017
GEPAID: CAL000371399
Contact: ANNE NGUYEN
Telephone: 8587151203
Mailing Name: Not reported
Mailing Address: 4217 PONDEROSA AVE STE H
Mailing City,St,Zip: SAN DIEGO, CA 921230000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PROGENY SYSTEMS (Continued)

S104752715

Gen County: San Diego
TSD EPA ID: NMD002208627
TSD County: 99
Waste Category: Waste oil and mixed oil
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Tons: 0.1482
Cat Decode: Waste oil and mixed oil
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S104752715
Year: 2017
GEPAID: CAL000371399
Contact: ANNE NGUYEN
Telephone: 8587151203
Mailing Name: Not reported
Mailing Address: 4217 PONDEROSA AVE STE H
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: NMD002208627
TSD County: 99
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Tons: 0.0185
Cat Decode: Off-specification, aged or surplus organics
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S104752715
Year: 2017
GEPAID: CAL000371399
Contact: ANNE NGUYEN
Telephone: 8587151203
Mailing Name: Not reported
Mailing Address: 4217 PONDEROSA AVE STE H
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: NMD002208627
TSD County: 99
Waste Category: Laboratory waste chemicals
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Tons: 0.0715
Cat Decode: Laboratory waste chemicals
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S104752715
Year: 2015
GEPAID: CAL000371399
Contact: ANNE NGUYEN
Telephone: 8587151203

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PROGENY SYSTEMS (Continued)

S104752715

Mailing Name: Not reported
Mailing Address: 4217 PONDEROSA AVE STE H
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: San Diego
TSD EPA ID: NVT330010000
TSD County: 99
Waste Category: Waste oil and mixed oil
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 0.152
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
2 additional CA_HAZNET: record(s) in the EDR Site Report.

S142
East
< 1/8
0.013 mi.
70 ft.

LEIDOS
4211 PONDEROSA AVE
SAN DIEGO, CA 92123
Site 2 of 6 in cluster S

RCRA-SQG **1004675501**
FINDS **CAR000073643**

Actual:
431 ft.

Focus Map:
1

RCRA-SQG:
Date form received by agency:09/19/2013
Facility name: LEIDOS
Facility address: 4211 PONDEROSA AVE
SAN DIEGO, CA 92123
EPA ID: CAR000073643
Mailing address: 10260 CAMPUS POINT DR
MAIL STOP E3 Y
SAN DIEGO, CA 92121
Contact: JEFF KING
Contact address: 10260 CAMPUS POINT DR MAIL STOP E3 Y
SAN DIEGO, CA 92121
Contact country: US
Contact telephone: 858-826-3686
Contact email: JEFFREY.L.KING@LEIDOS.COM
EPA Region: 09
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:
Owner/operator name: LEIDOS
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEIDOS (Continued)

1004675501

Owner/Op start date: 09/28/2013
Owner/Op end date: Not reported

Owner/operator name: LEIDOS
Owner/operator address: 10260 CAMPUS POINT DR MAIL STOP E3 Y
SAN DIEGO, CA 92121
Owner/operator country: US
Owner/operator telephone: 858-826-3686
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 09/28/2013
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: 221
. Waste name: Waste oil and mixed oil

. Waste code: 223
. Waste name: Unspecified oil-containing waste

. Waste code: 352
. Waste name: Other organic solids

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D035
. Waste name: METHYL ETHYL KETONE

Historical Generators:

Date form received by agency: 05/24/2000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEIDOS (Continued)

1004675501

Site name: SAIL
Classification: Small Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002
. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D008
. Waste name: LEAD

Violation Status: No violations found

FINDS:

Registry ID: 110055868057

Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

R143 MAXWELL LABORATORIES INC
East 4241 PONDEROSA AVE
< 1/8 SAN DIEGO, CA 92123
0.017 mi.
92 ft. Site 3 of 3 in cluster R

RCRA NonGen / NLR 1000436167
FINDS CAD981684160
ECHO

Actual: 432 ft.
Focus Map: 1
RCRA NonGen / NLR:
Date form received by agency: 07/07/1988
Facility name: MAXWELL LABORATORIES INC
Facility address: 4241 PONDEROSA AVE
SAN DIEGO, CA 92123
EPA ID: CAD981684160
Mailing address: 8888 BALBOA AVE
SAN DIEGO, CA 92123
Contact: DEAN CHARLES
Contact address: 8888 BALBOA AVE
SAN DIEGO, CA 92123
Contact country: US
Contact telephone: 619-279-5100
Contact email: Not reported
EPA Region: 09

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAXWELL LABORATORIES INC (Continued)

1000436167

Land type: Private
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: MAXWELL LABORATORIES
Owner/operator address: 888 BALBOA AVE
SAN DIEGO, CA 92123
Owner/operator country: Not reported
Owner/operator telephone: 619-279-5100
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Facility Has Received Notices of Violations:

Regulation violated: FR - 262.50-60
Area of violation: Generators - General
Date violation determined: 12/12/1986
Date achieved compliance: 12/12/1991
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 12/12/1986
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Generators - General
Date achieved compliance: 12/12/1991

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAXWELL LABORATORIES INC (Continued)

1000436167

Evaluation lead agency: State Contractor/Grantee

Evaluation date: 12/12/1986
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State Contractor/Grantee

FINDS:

Registry ID: 110002751503

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000436167
Registry ID: 110002751503
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002751503>

S144
East
< 1/8
0.018 mi.
93 ft.

NUVASIVE
4223 PONDEROSA AVE C
SAN DIEGO, CA 92123

CA San Diego Co. HMMD
CA HIST UST
CA HAZNET

S106061863
N/A

Site 3 of 6 in cluster S

Actual:
432 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000419190
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: (858) 909-1800
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 10/07/2017
Facility Owner: Not reported
Facility Mailing Address: 7475 Lusk Boulevard, San Diego, CA 92121
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NUVASIVE (Continued)

S106061863

Waste and Materials:

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0092712
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-09-21T02:31:19.000
Chemical Name: Lubricating oils, used
Common Name: Used lubricating oils
Case Number: Not reported

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0153045
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-07T02:32:48.000
Chemical Name: Argon Compressed
Common Name: Argon Compressed
Case Number: 7440-37-1

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0153046
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-07T02:32:48.000
Chemical Name: Diesel Fuel
Common Name: Diesel Fuel
Case Number: 68334-30-5

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0153047
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-07T02:32:48.000
Chemical Name: Titanium
Common Name: Titanium
Case Number: 7440-32-6

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131326
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-07T02:32:48.000
Chemical Name: Titanium and Vacuum Water
Common Name: Titanium and Vacuum Water
Case Number: Not reported

Record ID: DEH2016-HUPFP-002797

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NUVASIVE (Continued)

S106061863

Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131327
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-07T02:32:48.000
Chemical Name: Vacuum Pump Oil Filter Grease Cartridges
Common Name: Vacuum Pump Oil Filter Grease Cartridges
Case Number: Not reported

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131328
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-07T02:32:48.000
Chemical Name: Dry Mixed 3D printer waste
Common Name: Dry Mixed 3D printer waste
Case Number: Not reported

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131329
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-07T02:32:48.000
Chemical Name: Lubricating oils, used
Common Name: Used lubricating oils
Case Number: Not reported

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0193085
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T20:16:46.000
Chemical Name: Argon Compressed
Common Name: Argon Compressed
Case Number: 7440-37-1

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0193086
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T20:16:46.000
Chemical Name: Diesel Fuel
Common Name: Diesel Fuel
Case Number: 68334-30-5

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NUVASIVE (Continued)

S106061863

Child Record Id: DEH2018-HCHEM-0193087
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T20:16:46.000
Chemical Name: Paraffin oils (petroleum), catalytic dewaxed light
Common Name: Swiss cutting oil
Case Number: 64742-71-8

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0166893
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T20:16:46.000
Chemical Name: Titanium and Vacuum Water
Common Name: Titanium and Vacuum Water
Case Number: Not reported

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0166894
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T20:16:46.000
Chemical Name: Vacuum Pump Oil Filter Grease Cartridges
Common Name: Vacuum Pump Oil Filter Grease Cartridges
Case Number: Not reported

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0166895
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T20:16:46.000
Chemical Name: Dry Mixed 3D printer waste
Common Name: Dry Mixed 3D printer waste
Case Number: Not reported

Record ID: DEH2016-HUPFP-002797
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0166896
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T20:16:46.000
Chemical Name: Lubricating oils, used
Common Name: Used lubricating oils
Case Number: Not reported

Permit Number: 121381
Business Type: 6HK03
EPA Id Number: Not reported
APN: 369-170-20-00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NUVASIVE (Continued)

S106061863

Last HMMD Inspection: 10/10/1989
Facility Telephone: 619-560-7667
Permit Status: INAC
Permit Expiration: 10/10/1989
Date Last Updated: 11/02/2012
Facility Owner: MADISON SQUARE PARTNERSHIP
Facility Mailing Address: 4223 PON PONDEROSA AV #A
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 121381 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121381
Tank Type: UNKNOWN
Additional Id: 1
Capacity Gallons: 2000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1990-11-10 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 01
UST Monitor Method: SW TANK SW SUCTION PIPE W/ SIRS: SIR DATA ANALYSIS MONTHLY, TANK TEST BIENNIALY, PIPE TEST TRIENNIALY

HIST UST:

File Number: 0002EFBF
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002EFBF.pdf>
Region: Not reported
Facility ID: Not reported
Facility Type: Not reported
Other Type: Not reported
Contact Name: Not reported
Telephone: Not reported
Owner Name: Not reported
Owner Address: Not reported
Owner City,St,Zip: Not reported
Total Tanks: Not reported

Tank Num: Not reported
Container Num: Not reported
Year Installed: Not reported
Tank Capacity: Not reported
Tank Used for: Not reported
Type of Fuel: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NUVASIVE (Continued)

S106061863

Container Construction Thickness: Not reported
Leak Detection: Not reported

[Click here for Geo Tracker PDF:](#)

HAZNET:

Facility Name: NUVASIVE INCORPORATED
envid: S106061863
Year: 2017
GEPAID: CAL000419190
Contact: ALYSSA PIMENTEL
Telephone: 8583205287
Mailing Name: Not reported
Mailing Address: 7475 LUSK BLVD
Mailing City,St,Zip: SAN DIEGO, CA 921215707
Gen County: San Diego
TSD EPA ID: CAD980675276
TSD County: Kern
Waste Category: Unspecified oil-containing waste
Disposal Method: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Tons: 0.08
Cat Decode: Unspecified oil-containing waste
Method Decode: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Facility County: San Diego

S145
East
< 1/8
0.018 mi.
93 ft.

MADISON SQUARE PARTNERSHIP
4223 PONDEROSA AVE STE A
SAN DIEGO, CA 92123

CA HIST UST **U001573219**
N/A

Site 4 of 6 in cluster S

Actual:
432 ft.

Focus Map:
1

HIST UST:
File Number: Not reported
URL: Not reported
Region: STATE
Facility ID: 00000004492
Facility Type: Other
Other Type: Not reported
Contact Name: GARY BOSSTICK
Telephone: 6195600734
Owner Name: MADISON SQUARE PARTNERSHIP
Owner Address: 4223 PONDEROSA SUITE A
Owner City,St,Zip: SAN DIEGO, CA 92123
Total Tanks: 0001

Tank Num: 001
Container Num: 1
Year Installed: Not reported
Tank Capacity: 00002000
Tank Used for: PRODUCT
Type of Fuel: UNLEADED
Container Construction Thickness: Not reported
Leak Detection: Pressure Test

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

S146
East
< 1/8
0.018 mi.
93 ft.
MADISON SQUARE PARTNERSHIP
4223 PONDEROSA AVE A
SAN DIEGO, CA 92123
Site 5 of 6 in cluster S

CA SWEEPS UST
S106928986
N/A

Actual:
432 ft.
Focus Map:
1
SWEEPS UST:
Status: Not reported
Comp Number: 21381
Number: Not reported
Board Of Equalization: 44-023556
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021381-000001
Tank Status: Not reported
Capacity: 2000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: REG UNLEADED
Number Of Tanks: 1

S147
East
< 1/8
0.018 mi.
93 ft.
SUPERSHUTTLE
4229 PONDEROSA AVE
SAN DIEGO, CA 92123
Site 6 of 6 in cluster S

RCRA-SQG
FINDS
ECHO
1000218104
CAD982498644

Actual:
432 ft.
Focus Map:
1
RCRA-SQG:
Date form received by agency: 02/08/1990
Facility name: SUPERSHUTTLE
Facility address: 4229 PONDEROSA AVE
SAN DIEGO, CA 92123
EPA ID: CAD982498644
Mailing address: PONDEROSA AVE
SAN DIEGO, CA 92123
Contact: ENVIRONMENTAL MANAGER
Contact address: 4229 PONDEROSA AVE
SAN DIEGO, CA 92123
Contact country: US
Contact telephone: 619-278-5825
Contact email: Not reported
EPA Region: 09
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:
Owner/operator name: SHUTTLE EXPRESS PARTNERS
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUPERSHUTTLE (Continued)

1000218104

Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999

Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

FINDS:

Registry ID: 110002832622

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000218104

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUPERSHUTTLE (Continued)

1000218104

Registry ID: 110002832622
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002832622>

T148
East
< 1/8
0.023 mi.
122 ft.
7-ELEVEN INC #32606
9609 AERO DR
SAN DIEGO, CA 92123
Site 1 of 3 in cluster T

CA UST **U003937271**
N/A

Actual: 382 ft.
Focus Map: 1
UST:
Facility ID: 37-000-138191
Permitting Agency: San Diego County Department of Environmental Health
Latitude: 32.80785
Longitude: -117.12193

Facility ID: H38191
Permitting Agency: SAN DIEGO COUNTY
Latitude: 32.8092009
Longitude: -117.120579

149
South
< 1/8
0.023 mi.
122 ft.
LEVEL 3 COMMUNICATIONS, LLC - SNDACAGL
8929 AERO DR
SAN DIEGO, CA 92123

CA AST **A100421781**
N/A

Actual: 413 ft.
Focus Map: 1
AST:
Certified Unified Program Agencies: Not reported
Owner: Level 3 Communications, LLC
Total Gallons: Not reported
CERSID: 10390189
Facility ID: 37-000-104466
Business Name: Level 3 Communications
Phone: 720-888-1000
Fax: Not reported
Mailing Address: 1025 ELDORADO BL 43C-325
Mailing Address City: BROOMFIELD
Mailing Address State: CO
Mailing Address Zip Code: Not reported
Operator Name: LEVEL 3 COMMUNICATIONS - SNDACAGL
Operator Phone: 720-888-0676
Owner Phone: 720-888-1000
Owner Mail Address: 1025 Eldorado Boulevard, Environmental Management 43C-325
Owner State: CO
Owner Zip Code: 80021
Owner Country: United States
Property Owner Name: Level 3 Communications
Property Owner Phone: Not reported
Property Owner Mailing Address: 1025 Eldorado Blvd
Property Owner City: Broomfield
Property Owner Stat : CO
Property Owner Zip Code: 80021
Property Owner Country: United States
EPAID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

L150
South
< 1/8
0.023 mi.
123 ft.
AEROVAULT VENTURE, LP
8875 AERO DR
SAN DIEGO, CA 92123
Site 13 of 14 in cluster L

CA AST
CA San Diego Co. HMMD
CA HIST UST
U001573235
N/A

Actual:
420 ft.

Focus Map:
1

AST:
Certified Unified Program Agencies: Not reported
Owner: AEROVAULT VENTURE L P
Total Gallons: Not reported
CERSID: 10390648
Facility ID: 37-000-208432
Business Name: AEROVAULT VENTURE, LP
Phone: 858-204-7126
Fax: Not reported
Mailing Address: 9339 Genesee Ave Ste. 130
Mailing Address City: San Diego
Mailing Address State: CA
Mailing Address Zip Code: 92121
Operator Name: AEROVAULT VENTURE, LP
Operator Phone: 858-204-7126
Owner Phone: 858-242-1155
Owner Mail Address: 9339 Genesee Ave Ste. 130
Owner State: CA
Owner Zip Code: 92121
Owner Country: United States
Property Owner Name: AEROVAULT VENTURE L P
Property Owner Phone: Not reported
Property Owner Mailing Address: 6011 BRISTOL PKWY
Property Owner City: CULVER CITY
Property Owner Stat : CA
Property Owner Zip Code: 90230
Property Owner Country: United States
EPAID: Not reported

HMMD SAN DIEGO:
Permit Number: 208432
Business Type: 6HK18
EPA Id Number: Not reported
APN: 421-300-03-00
Last HMMD Inspection: 04/26/2012
Facility Telephone: 858-204-7126
Permit Status: OPEN
Permit Expiration: 04/30/2013
Date Last Updated: 11/02/2012
Facility Owner: AEROVAULT VENTURE, LP
Facility Mailing Address: 6011 BRISTOL PY
Facility Mailing City: Culver City
Facility Mailing State: CA
Facility Mailing Zip: 90230
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AEROVAULT VENTURE, LP (Continued)

U001573235

Permit Number: 208432
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL
Other Information: UNDERGROUND TANK 121288 T002
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Violations Active Permits:

Permit Number: 208432
Update Date: 11/02/2012
Inspection Date: 04/26/2012
Violation Code: 6HV1012
Violation: SPCC PLAN NOT PREPARED
Violation Citation: Spill Prevention Countermeasures & Control Plan not prepared as required. 25270.5 (c)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 121288 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 208432
Tank Type: OTHER
Additional Id: ET0033, RT4917
Capacity Gallons: 4000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: EXEMPT
Remove Close Date: Not reported
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 24
UST Monitor Method: VISUAL MONITORING: DAILY (MINIMUM) LOG OF INSPECTIONS

Permit Number: 208432
Business Type: 6HK18
EPA Id Number: Not reported
APN: 421-300-03-00
Last HMMD Inspection: 04/26/2012
Facility Telephone: 858-204-7126
Permit Status: OPEN
Permit Expiration: 04/30/2013
Date Last Updated: 11/02/2012
Facility Owner: AEROVAULT VENTURE, LP
Facility Mailing Address: 6011 BRISTOL PY
Facility Mailing City: Culver City
Facility Mailing State: CA
Facility Mailing Zip: 90230
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: N
Subject To APSA: Not reported
Generate Haz Waste: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AEROVAULT VENTURE, LP (Continued)

U001573235

Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 208432
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL
Other Information: UNDERGROUND TANK 121288 T002
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Violations Active Permits:

Permit Number: 208432
Update Date: 11/02/2012
Inspection Date: 04/26/2012
Violation Code: 6HV1012
Violation: SPCC PLAN NOT PREPARED
Violation Citation: Spill Prevention Countermeasures & Control Plan not prepared as required. 25270.5 (c)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 121288 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 208432
Tank Type: OTHER
Additional Id: ET0033, RT4917
Capacity Gallons: 4000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: EXEMPT
Remove Close Date: Not reported
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 24
UST Monitor Method: VISUAL MONITORING: DAILY (MINIMUM) LOG OF INSPECTIONS

Permit Number: 121288
Business Type: 6HK19
EPA Id Number: CAC001317384
APN: 421-300-03-00
Last HMMD Inspection: 06/23/2003
Facility Telephone: 858-654-6900
Permit Status: INAC
Permit Expiration: 06/30/2004
Date Last Updated: 11/02/2012
Facility Owner: BANK OF AMERICA N T & SA
Facility Mailing Address: 450 B ST, STE 1410
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92101-8001
UST Owner: BANK OF AMERICA N T & SA
Handle Regulated Hazmat: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AEROVAULT VENTURE, LP (Continued)

U001573235

Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Violations Inactive Permits:

Permit Number: 121288
Update Date: 11/02/2012
Inspection Date: 06/23/2003
Violation Code: 6HV0402
Violation: TRAINING PROGRAM NOT ADEQUATE
Violation Citation: Personnel training is not adequate to ensure compliance with hazardous waste regulations. CCR 66265.16(a)&(b)
Activity: Inactive Permit

UST:

UST Name: UNDERGROUND TANK 121288 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121288
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 4000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: CLOSED
Remove Close Date: 1999-07-26 00:00:00
Year Installed: 1980-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: SUCTION
Monitor Code: 11
UST Monitor Method: SW TANK SW SUCTION PIPE W/ CERTIFIED ATG: IN-TANK TEST MONTHLY, PIPE TEST TRIENNIALY

UST Name: UNDERGROUND TANK 121288 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 121288
Tank Type: OTHER
Additional Id: ET0033
Capacity Gallons: 4000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: EXEMPT
Remove Close Date: Not reported
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 24
UST Monitor Method: VISUAL MONITORING: DAILY (MINIMUM) LOG OF INSPECTIONS

Permit Number: 205011
Business Type: 6HK70
EPA Id Number: Not reported
APN: 421-300-03-00
Last HMMI Inspection: 02/22/2007
Facility Telephone: 858-499-0220

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AEROVAULT VENTURE, LP (Continued)

U001573235

Permit Status: INAC
Permit Expiration: 08/31/2007
Date Last Updated: 11/02/2012
Facility Owner: LBA REALITY FUND-HOLDING CO. ILLC
Facility Mailing Address: 2101 CAMINO VIDA ROBLE #A
Facility Mailing City: CARLSBAD
Facility Mailing State: CA
Facility Mailing Zip: 92009
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Violations Inactive Permits:

Permit Number: 205011
Update Date: 11/02/2012
Inspection Date: 03/09/2005
Violation Code: 6HV1002
Violation: HMBP NOT ESTABLISHED/IMPLEMENTED.
Violation Citation: Hazardous materials handler has not established/implemented a business plan. HSC 25503.5(a)
Activity: Inactive Permit

Permit Number: 205011
Update Date: 11/02/2012
Inspection Date: 02/22/2007
Violation Code: 6HV1002
Violation: HMBP NOT ESTABLISHED/IMPLEMENTED.
Violation Citation: Hazardous materials handler has not established/implemented a business plan. HSC 25503.5(a)
Activity: Inactive Permit

Permit Number: 205011
Update Date: 11/02/2012
Inspection Date: 02/22/2007
Violation Code: 6HV0132
Violation: EPA ID NUMBER NOT OBTAINED/MAINTAINED
Violation Citation: Generator of hazardous waste has not obtained/maintained an EPA identification number. CCR 66262.12(a)
Activity: Inactive Permit

UST:

UST Name: UNDERGROUND TANK 121288 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 205011
Tank Type: OTHER
Additional Id: ET0033
Capacity Gallons: 4000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: EXEMPT
Remove Close Date: Not reported
Year Installed: Not reported
Pipe Type: DOUBLE WALL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AEROVAULT VENTURE, LP (Continued)

U001573235

Delivery System: SUCTION
Monitor Code: 24
UST Monitor Method: VISUAL MONITORING: DAILY (MINIMUM) LOG OF INSPECTIONS

Permit Number: 208432
Business Type: 6HK18
EPA Id Number: Not reported
APN: 421-300-03-00
Last HMMD Inspection: 04/26/2012
Facility Telephone: 858-204-7126
Permit Status: OPEN
Permit Expiration: 04/30/2013
Date Last Updated: 11/02/2012
Facility Owner: AEROVAULT VENTURE, LP
Facility Mailing Address: 6011 BRISTOL PY
Facility Mailing City: Culver City
Facility Mailing State: CA
Facility Mailing Zip: 90230
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 208432
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL
Other Information: UNDERGROUND TANK 121288 T002
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Violations Active Permits:

Permit Number: 208432
Update Date: 11/02/2012
Inspection Date: 04/26/2012
Violation Code: 6HV1012
Violation: SPCC PLAN NOT PREPARED
Violation Citation: Spill Prevention Countermeasures & Control Plan not prepared as required. 25270.5 (c)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 121288 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 208432
Tank Type: OTHER
Additional Id: ET0033, RT4917
Capacity Gallons: 4000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: EXEMPT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AEROVAULT VENTURE, LP (Continued)

U001573235

Remove Close Date: Not reported
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: SUCTION
Monitor Code: 24
UST Monitor Method: VISUAL MONITORING: DAILY (MINIMUM) LOG OF INSPECTIONS

HIST UST:

File Number: Not reported
URL: Not reported
Region: STATE
Facility ID: 00000016566
Facility Type: Other
Other Type: BANKING - CASH VAULT
Contact Name: JACK MOSHGAT
Telephone: 6192309832
Owner Name: BANK OF AMERICA N. T. & S. A.
Owner Address: 8875 AERO DRIVE
Owner City,St,Zip: SAN DIEGO, CA 92123
Total Tanks: 0001

Tank Num: 001
Container Num: 1
Year Installed: 1980
Tank Capacity: 00004000
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor, Sensor Instrument

L151
South
< 1/8
0.023 mi.
123 ft.

SAN DIEGO CENTRAL CASH VAULT
8875 AERO DR 4062
SAN DIEGO, CA 92123
Site 14 of 14 in cluster L

CA SWEEPS UST **S106931786**
N/A

Actual:
420 ft.

Focus Map:
1

SWEEPS UST:
Status: Active
Comp Number: 21288
Number: 9
Board Of Equalization: 44-023515
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021288-000001
Tank Status: A
Capacity: 4000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U152 **3-D INDUSTRIES, INC**
East **9630 AERO DR**
< 1/8 **SAN DIEGO, CA 92123**
0.025 mi.
133 ft. **Site 1 of 2 in cluster U**

RCRA-SQG **1000119926**
FINDS **CAD981386097**
ECHO

Actual:
398 ft.

RCRA-SQG:

Date form received by agency:09/01/1996

Focus Map:
1

Facility name: 3-D INDUSTRIES, INC

Facility address: 9630 AERO DR
SAN DIEGO, CA 92123

EPA ID: CAD981386097

Contact: Not reported

Contact address: Not reported

Contact country: US

Contact telephone: Not reported

Contact email: Not reported

EPA Region: 09

Land type: Facility is not located on Indian land. Additional information is not known.

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: NOT REQUIRED

Owner/operator address: NOT REQUIRED

Owner/operator country: NOT REQUIRED, ME 99999

Owner/operator telephone: Not reported

Owner/operator email: 415-555-1212

Owner/operator fax: Not reported

Owner/operator extension: Not reported

Legal status: Private

Owner/Operator Type: Operator

Owner/Op start date: Not reported

Owner/Op end date: Not reported

Owner/operator name: D C PRICE

Owner/operator address: NOT REQUIRED

Owner/operator country: NOT REQUIRED, ME 99999

Owner/operator telephone: Not reported

Owner/operator email: 415-555-1212

Owner/operator fax: Not reported

Owner/operator extension: Not reported

Legal status: Private

Owner/Operator Type: Owner

Owner/Op start date: Not reported

Owner/Op end date: Not reported

Handler Activities Summary:

U.S. Importer of hazardous waste: No

Mixed waste (haz. and radioactive): No

Recycler of hazardous waste: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3-D INDUSTRIES, INC (Continued)

1000119926

Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 02/11/1986
Site name: 3-D INDUSTRIES, INC
Classification: Large Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 02/18/1992
Date achieved compliance: 02/18/1997
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 01/22/1991
Date achieved compliance: 02/18/1992
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 02/18/1992
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 02/18/1997
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 01/22/1991
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

3-D INDUSTRIES, INC (Continued)

1000119926

Area of violation: Generators - General
Date achieved compliance: 02/18/1992
Evaluation lead agency: State Contractor/Grantee

FINDS:

Registry ID: 110002689323

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000119926
Registry ID: 110002689323
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002689323>

U153
East
< 1/8
0.025 mi.
133 ft.

J. BITTLE AMERICAN, INC.
9630 AERO DR
SAN DIEGO, CA 92123

Site 2 of 2 in cluster U

CA LUST
CA SAN DIEGO CO. SAM
CA San Diego Co. HMMD
CA SWEEPS UST
CA HIST CORTESE
CA SAN DIEGO CO LOP

S102423438
N/A

Actual:
398 ft.

Focus Map:
1

LUST REG 9:

Region: 9
Status: Case Closed
Case Number: 9UT1679
Local Case: H00011-001
Substance: Gasoline
Qty Leaked: 0
Abate Method: Excavate and Dispose - remove contaminated soil and dispose in approved site
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Tank
Cause: Corrosion
Lead Agency: Local Agency
Case Type: Aquifer affected
Date Found: 05/01/1990
Date Stopped: 05/01/1990
Confirm Date: 05/01/1990
Submit Workplan: Not reported
Prelim Assess: 08/02/1993
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 05/01/1990

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

J. BITTLE AMERICAN, INC. (Continued)

S102423438

Enforce Date: Not reported
Closed Date: 2/1/94
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: 6'
Beneficial Use: Municipal groundwater use
NPDES Number: Not reported
Priority: Low priority. Priority ranking can change over time.
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

LUST:

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607300495
Global Id: T0607300495
Latitude: 32.8084282
Longitude: -117.1212506
Status: Completed - Case Closed
Status Date: 02/01/1994
Case Worker: Not reported
RB Case Number: 9UT1679
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H00011-001
Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:

Global Id: T0607300495
Action Type: Other
Date: 05/01/1990
Action: Leak Reported

Global Id: T0607300495
Action Type: Other
Date: 05/01/1990
Action: Leak Began

Global Id: T0607300495
Action Type: Other
Date: 05/01/1990
Action: Leak Discovery

Global Id: T0607300495
Action Type: ENFORCEMENT
Date: 05/03/1990
Action: Notice of Responsibility

Global Id: T0607300495
Action Type: Other
Date: 05/01/1990
Action: Leak Stopped

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

J. BITTLE AMERICAN, INC. (Continued)

S102423438

LUST:

Global Id: T0607300495
Status: Completed - Case Closed
Status Date: 02/01/1994

Global Id: T0607300495
Status: Open - Case Begin Date
Status Date: 05/01/1990

SAN DIEGO CO. SAM:

Case Number: H00011-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: Soils Only
Facility Status: Closed Case
Date: 2/1/1994
Date Began: 5/1/1990

HMMD SAN DIEGO:

Permit Number: 100011
Business Type: Not reported
EPA Id Number: CAD981386097
APN: 421-350-09-00
Last HMMD Inspection: 01/27/1993
Facility Telephone: 858-560-2030
Permit Status: INAC
Permit Expiration: Not reported
Date Last Updated: 11/02/2012
Facility Owner: J BITTLE
Facility Mailing Address: 9630 AERO DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1806
UST Owner: INTERNATIONAL IRON PRODUCTS
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 100011 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 100011
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 1000
UST Contents: LEADED
Other Content Info: LEADED
Reg Status: REMOVED
Remove Close Date: 1990-01-05 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

J. BITTLE AMERICAN, INC. (Continued)

S102423438

Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALLY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 100011 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 100011
Tank Type: SINGLE WALL
Additional Id: 2
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1990-01-05 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALLY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

SWEEPS UST:

Status: Active
Comp Number: 11
Number: 9
Board Of Equalization: 44-021516
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: Not reported
Tank Status: Not reported
Capacity: Not reported
Active Date: Not reported
Tank Use: Not reported
STG: Not reported
Content: Not reported
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 11
Number: Not reported
Board Of Equalization: 44-021516
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000011-000001
Tank Status: Not reported
Capacity: 1000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: LEADED
Number Of Tanks: 2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

J. BITTLE AMERICAN, INC. (Continued)

S102423438

Status: Not reported
Comp Number: 11
Number: Not reported
Board Of Equalization: 44-021516
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000011-000002
Tank Status: Not reported
Capacity: 1000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: REG UNLEADED
Number Of Tanks: Not reported

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT1679

SAN DIEGO CO LOP:

Record ID: DEH1990-LSAM-H00011-001
Record Status: Completed
Opened Date: 05/01/1990
Parcel Number: 421-350-09-00
Case Type: LOP - Local Oversight Program
Historical Name: 3D INDUSTRIES
SWRCB Global ID: T0607300495
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 05/01/1990
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 F 4
Latitude: 32.8088352
Longitude: -117.1217822
X MapCoord: 6293802.535
Y MapCoord: 1875215.594

V154
South
< 1/8
0.026 mi.
137 ft.

ACTION INSTRUMENTS CO INC
8601 AERO DR
SAN DIEGO, CA 92123
Site 1 of 6 in cluster V

RCRA-SQG **1000259525**
FINDS **CAD056586738**
ECHO

Actual:
408 ft.

Focus Map:
1

RCRA-SQG:
Date form received by agency: 09/01/1996
Facility name: ACTION INSTRUMENTS CO INC
Facility address: 8601 AERO DR
SAN DIEGO, CA 92123

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ACTION INSTRUMENTS CO INC (Continued)

1000259525

EPA ID: CAD056586738
Contact: Not reported
Contact address: Not reported
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 09
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: ACTION INSTRUMENTS CO INC
Owner/operator address: NOT REQUIRED
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ACTION INSTRUMENTS CO INC (Continued)

1000259525

Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 09/04/1980
Site name: ACTION INSTRUMENTS CO INC
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110002650934

Environmental Interest/Information System

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000259525
Registry ID: 110002650934
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002650934>

V155
South
< 1/8
0.026 mi.
137 ft.
PRIII/BROADSTONE KEARNY MESA LLC
8601 AERO DR
SAN DIEGO, CA 92123
Site 2 of 6 in cluster V

CA CPS-SLIC
CA San Diego Co. HMM
CA HAZNET
S103674537
N/A

Actual: 408 ft.
Focus Map: 1
CPS-SLIC:
Region: STATE
Facility Status: Completed - Case Closed
Status Date: 11/13/2015
Global Id: T10000004281
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H39802-001
Latitude: 32.808973017507
Longitude: -117.140951156616
Case Type: Cleanup Program Site
Case Worker: JC
Local Agency: SAN DIEGO COUNTY LOP
RB Case Number: Not reported
File Location: Local Agency

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIII/BROADSTONE KEARNY MESA LLC (Continued)

S103674537

Potential Media Affected: Not reported

Potential Contaminants of Concern: Not reported

Site History: Comments: Alliance Realty Partners, LLC (Alliance) applied to the Department of Environmental Health (DEH) Voluntary Assistance Program (VAP) to seek DEH concurrence with the results of the human health risk analysis and approval of a Property Mitigation Plan (PMP). DEH concurrence was needed in order to meet the requirements of the City of San Diego MND/Development Permit for the proposed mixed-use project. Site development included construction of slab-on-grade three- and four-story wood-framed buildings, housing 360 residential apartments and approximately 5,000 square feet of retail space, surrounding a four-story above-grade parking structure. Pre-existing on-site buildings were demolished and associated utilities were removed to accommodate redevelopment. Remedial grading was conducted to accommodate site drainage and to adjust the existing expansive clay soil. Remedial grading consisted of over-excavating the upper 4 to 5 feet of native soil and mixing it with approximately 23,000 cubic yards (cy) of clean imported soil, which elevated the pre-existing grade by approximately 4 feet. In the Phase 1 dated November 8, 1999, ATC identified historical degreaser usage by Eurotherm (Action Instruments) in the 8589 and 8601 Aero Drive buildings from before 1982 until 1994. ATC inferred that 1,1,1-Trichloroethane (1,1,1-TCA) and Methylene chloride may have been used during degreasing operations. Based on historical degreaser usage, ATC recommended conducting a soil gas survey to assess for potential presence of VOCs in known former degreasing locations and hazardous materials storage areas at the 8589 and 8601 Aero Drive buildings, and the hazardous waste storage area in the southwest corner of the site. On November 23, 2004, N&M collected soil vapor samples at a depth of 2.5 feet bgs at fifteen locations at the 8601 Aero Drive building. The soil vapor sampling locations were located at indoor manufacturing areas and suspected outdoor hazardous materials storage locations. VOCs were detected at low concentrations in all fifteen samples. N&M concluded that low VOC concentrations in soil vapor did not suggest that these chemicals were present in on-site soil at elevated concentrations, and that the presence of VOCs in shallow soil vapor was possibly due to regional soil or groundwater contamination from one or more sources in the site vicinity. N&M made no recommendation for further assessment. On July 8, 2005, soil gas samples were collected at depths ranging from 2 to 5 feet bgs at ten locations (SV1 through SV10). Freon 113 was detected in six samples at concentrations ranging from 2.3 to 40 i%g/l. Tetrachloroethene (PCE) was detected at a concentration of 788 micrograms per cubic meter (i%g/m3) in a duplicate sample analyzed at a stationary laboratory. On June 28, 2012, Tetra Tech installed eleven soil gas sampling locations (SG-1 through SG-11) at depths of approximately 5 feet bgs within open areas of the site. Freon 113 was detected in all 11 soil gas sample locations at concentrations ranging from 0.27 to 69 i%g/l. Benzene was detected in 10 sample locations at concentrations ranging from 0.02 to 0.06 i%g/l, which exceeded the residential CHHSL of 0.036 i%g/l. PCE was detected at one location at the laboratory method detection limit of 0.02 i%g/l, which does not exceed the residential CHHSL of 0.18 i%g/l. 1,1-dichloroethane (1,1-DCA) was also detected at one location at a concentration of 0.14 i%g/l. No CHHSL exists for 1,1-DCA. Cursorory vapor risk modeling performed by Tetra Tech for the highest benzene concentration at the site indicated an incremental cancer risk of

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIII/BROADSTONE KEARNY MESA LLC (Continued)

S103674537

10-9 and a hazard index of 10-5, which is less than regulatory thresholds of 10-6 and 1, respectively. As part of a Phase II Assessment, dated September 18, 2012, Langan collected soil vapor samples at depths ranging from three to five feet bgs at nine locations inside and outside the 8589, 8593, and 8601 Aero Drive buildings. PCE was not detected at concentrations exceeding residential or commercial CHHSLs. Benzene concentrations exceeded residential or commercial CHHSLs at three locations at the site. No benzene source was identified from a review of historical data. Langan conducted a human health risk evaluation for soil gas and groundwater. For indoor air inhalation via the vapor intrusion pathway, the total cancer risk was estimated at 6.8 ~ 10-8 and the chronic risk was estimated at 3.2 ~ 10-4. These risks are considered acceptable for residential receptors. Based on relatively low concentrations of PCE and benzene in soil vapor, depth to groundwater, and expected attenuation of contaminant concentration with increasing depth, Langan concluded that regional groundwater is unlikely to be impacted by concentrations of soil vapor at the site. The PMP was approved by DEH in a letter to Alliance on October 4, 2012. Over-excavation of the upper five feet of native soil was performed during remedial grading activities for geotechnical purposes. Over-excavated areas were screened for VOC impacts. Soil was screened during utility trenching whenever trench depths extended deeper than the over-excavated depths. Post-excavation confirmation soil sampling was conducted in the bottoms and sidewalls of excavations and in soil stockpiles to verify complete removal of impacted soil and to characterize suspect soil stockpiles. On May 3, 2013, approximately 5 to 10 cubic yards (cy) of concrete, asphalt, and soil construction debris was temporarily imported by American Wrecking from their 22nd and Commercial Street project in San Diego and placed on a concrete slab. The 5-10 cy debris stockpile was removed from the site by American Wrecking on May 15, 2013. On November 7, 2013, a hydraulic fluid release occurred near the southwest corner of the site during utility trench excavation. The segregated stockpiles, totaling less than 5 cy, were removed from the site on December 14, 2013 by Perrault Corporation. Soil was disposed of at Thermal Remediation Solutions in Azusa, California. On November 8, 2013, Langan was informed of a diesel release west of the parking structure. Alliance informed Langan that the spill of approximately 20 to 30 gallons of diesel had occurred approximately two weeks previously. Impacted soil was excavated to a depth of 3 feet bgs. One sample was collected from the soil stockpile and submitted for waste profile laboratory analysis. The approximately 15 cy segregated stockpile was removed from the site on December 14, 2013 by Perrault Corporation. Soil was disposed of at Thermal Remediation Solutions in Azusa, California. On August 6, 2014, Langan observed a chemical odor and elevated PID readings emanating from soil excavated from a joint utility trench near the southeast entrance of the site. Alliance indicated that the source of the suspected impacts was a small amount of diesel fuel (approximately one to two gallons) that spilled onto the soil while the utility contractor was refueling equipment. Step-out sampling was conducted, until bottom and sidewall samples confirmed that no TPH was present in residual soil at concentrations exceeding laboratory method detection limits. A total of 5 cy of soil was placed in two segregated stockpiles as a result of confirmation sampling activities. Based on available laboratory analytical results, the soil was classified as non-hazardous and disposed of at

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIII/BROADSTONE KEARNY MESA LLC (Continued)

S103674537

EDCO Disposal Corporation in Lemon Grove, California, or its sister site, SANCO, in Lemon Grove, California. These facilities accept construction debris, including non-hazardous soil, for disposal. Approximately 23,000 cubic yards of soil was required for geotechnical remedial grading at the Site and to raise the overall grade by five feet across the site. Native soil from a site at Thorn Street and Fifth Avenue in San Diego was properly tested and used at the Kearny Mesa Site. In the Closure Report, it was concluded that impacted soil was appropriately handled and properly disposed of at a state-approved waste management facility. Approximately 35 cubic yards of impacted soil was disposed of during construction activities. As a result of these activities, no further soil management activities were recommended with respect to the environmental conditions at the site. DEH concurs that No Further Action is required at the Site.

[Click here to access the California GeoTracker records for this facility:](#)

HMMD SAN DIEGO:

Permit Number: 100029
Business Type: 6HK36
EPA Id Number: CAD056586738
APN: 421-050-10-00
Last HMMD Inspection: 06/18/2002
Facility Telephone: 858-279-5726
Permit Status: INAC
Permit Expiration: 01/31/2003
Date Last Updated: 11/02/2012
Facility Owner: ACTION INSTRUMENTS INC
Facility Mailing Address: 8601 AERO DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1724
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

HAZNET:

Facility Name: PRIII/BROADSTONE KEARNY MESA LLC
envid: S103674537
Year: 2013
GEPAID: CAC002734337
Contact: MIKE YANICELLI
Telephone: 8583829247
Mailing Name: Not reported
Mailing Address: 915 CAMINO DEL MAR
Mailing City, St, Zip: DEL MAR, CA 92014
Gen County: San Diego
TSD EPA ID: AZC950823111
TSD County: 99
Waste Category: Not reported
Disposal Method: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PRIII/BROADSTONE KEARNY MESA LLC (Continued)

S103674537

Include On-Site Treatment And/Or Stabilization)
Tons: 4.4
Cat Decode: Not reported
Method Decode: Not reported
Facility County: Not reported

V156
South
< 1/8
0.029 mi.
153 ft.
8575 AERO DR
8575 AERO DR
SAN DIEGO, CA 92123
Site 3 of 6 in cluster V

RCRA-SQG
CA ENVIROSTOR
CA VCP
CA HIST UST
CA DEED
1000355113
CAD008232829

Actual: RCRA-SQG:
408 ft. Date form received by agency:05/10/2002
Focus Map: Facility name: 8575 AERO DR
1 Facility address: 8575 AERO DR
SAN DIEGO, CA 92123
EPA ID: CAD008232829
Mailing address: 2811 GREEN MOUNTAIN LN
ESCONDIDO, CA 92025-7549
Contact: TERRY L MULLIS
Contact address: 2811 GREEN MOUNTAIN LN
ESCONDIDO, CA 92025-7549
Contact country: US
Contact telephone: 760-781-5511
Contact email: Not reported
EPA Region: 09
Land type: Private
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:
Owner/operator name: JOE H MOORE
Owner/operator address: 401 W BROADWAY STE 2300
SAN DIEGO, CA 92101
Owner/operator country: Not reported
Owner/operator telephone: 619-685-6413
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:
U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8575 AERO DR (Continued)

1000355113

Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency:05/10/2002

Site name: 8575 AERO DR

Classification: Large Quantity Generator

. Waste code: D000
. Waste name: Not Defined

. Waste code: D008
. Waste name: LEAD

. Waste code: F006
. Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

Date form received by agency:03/01/2002

Site name: AERO DRIVE

Classification: Large Quantity Generator

. Waste code: D008
. Waste name: LEAD

. Waste code: F006
. Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

Date form received by agency:10/12/2000

Site name: MOORE PRINTED CIRCUITS, INC

Classification: Large Quantity Generator

Date form received by agency:03/04/1999

Site name: MOORE PRINTED CIRCUITS, INC

Classification: Large Quantity Generator

Date form received by agency:09/01/1996

Site name: 8575 AERO DR

Classification: Large Quantity Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8575 AERO DR (Continued)

1000355113

Date form received by agency:02/26/1996
Site name: MOORE PRINTED CIRCUITS,INC.
Classification: Large Quantity Generator

Date form received by agency:03/28/1994
Site name: MOORE PRINTED CIRCUITS INC
Classification: Large Quantity Generator

Date form received by agency:02/28/1992
Site name: MOORE PRINTED CIRCUITS
Classification: Large Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 06/03/1994
Date achieved compliance: 06/03/1999
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 05/13/1993
Date achieved compliance: 06/03/1994
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 04/15/1992
Date achieved compliance: 05/13/1993
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.50-60
Area of violation: Generators - General

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8575 AERO DR (Continued)

1000355113

Date violation determined: 10/19/1988
Date achieved compliance: 01/01/1989
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 06/03/1994
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 06/03/1999
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 05/13/1993
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 06/03/1994
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 04/15/1992
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 05/13/1993
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 10/19/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 01/01/1989
Evaluation lead agency: State

ENVIROSTOR:

Facility ID: 71002149
Status: Certified O&M - Land Use Restrictions Only
Status Date: 10/20/2010
Site Code: 550325
Site Type: Voluntary Cleanup
Site Type Detailed: Voluntary Cleanup
Acres: 1
NPL: NO
Regulatory Agencies: SMBRP
Lead Agency: SMBRP
Program Manager: Joe Hwong
Supervisor: Shahir Haddad
Division Branch: Southern California Schools & Brownfields Outreach
Assembly: 79
Senate: 39
Special Program: Voluntary Cleanup Program
Restricted Use: YES
Site Mgmt Req: NONE SPECIFIED
Funding: Responsible Party

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8575 AERO DR (Continued)

1000355113

Latitude: 32.80886
Longitude: -117.1428
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: NONE SPECIFIED
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: CAD008232829
Alias Type: EPA Identification Number
Alias Name: 110000478965
Alias Type: EPA (FRS #)
Alias Name: 401098
Alias Type: Project Code (Site Code)
Alias Name: 401727
Alias Type: Project Code (Site Code)
Alias Name: 550325
Alias Type: Project Code (Site Code)
Alias Name: 71002149
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 09/06/2018
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Land Use Restriction - Site Inspection/Visit
Completed Date: 12/02/2014
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: California Land Reuse and Revitalization Agreement
Completed Date: 04/12/2018
Comments: Copy of fully executed CLRRRA Agreement for Winchester/Temecula sent to S. Wayne Rosenbaum, Environmental Law Group office, on 4/13/18.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: No Further Action Letter
Completed Date: 07/30/2005
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Inspections/Visit (Non LUR)
Completed Date: 02/01/2004
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * LUC Inspection Complete
Completed Date: 06/19/2006
Comments: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8575 AERO DR (Continued)

1000355113

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Land Use Restriction
Completed Date: 06/30/2005
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Corrective Action Completion Determination
Completed Date: 07/30/2005
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * LUC Inspection Complete
Completed Date: 05/18/2008
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Phase I Verification
Completed Date: 01/01/2002
Comments: Inspection report sent on 1/1/2002

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * LUC Inspection Complete
Completed Date: 06/15/2007
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Consent Agreement
Completed Date: 11/22/2002
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Remedy Selection and Statement of Basis
Completed Date: 02/04/2005
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Land Use Restriction - Site Inspection/Visit
Completed Date: 10/09/2012
Comments: Completed

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Endangerment Assessment Report
Completed Date: 07/30/2004
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Corrective Measures Study Report

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8575 AERO DR (Continued)

1000355113

Completed Date: 02/04/2005
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Remedial Action Completion Report
Completed Date: 04/21/2005
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Endangerment Assessment Workplan
Completed Date: 10/02/2003
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Land Use Restriction Monitoring Report
Completed Date: 06/29/2017
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 01/18/2019
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 12/21/2018
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Land Use Restriction - Site Inspection/Visit
Completed Date: 02/19/2015
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 12/03/2014
Comments: Not reported

Future Area Name: PROJECT WIDE
Future Sub Area Name: Not reported
Future Document Type: Operations and Maintenance Plan
Future Due Date: 2019
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Public Participation Plan / Community Relations Plan
Schedule Due Date: 09/13/2018
Schedule Revised Date: Not reported
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Site Characterization Report

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8575 AERO DR (Continued)

1000355113

Schedule Due Date: 08/14/2018
Schedule Revised Date: Not reported
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Remedial Action Plan
Schedule Due Date: 03/15/2019
Schedule Revised Date: Not reported
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: CEQA - Responsible Agency Review
Schedule Due Date: 01/14/2019
Schedule Revised Date: Not reported
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Certification
Schedule Due Date: 01/25/2019
Schedule Revised Date: Not reported
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Land Use Restriction
Schedule Due Date: 05/25/2019
Schedule Revised Date: Not reported

VCP:

Facility ID: 71002149
Site Type: Voluntary Cleanup
Site Type Detail: Voluntary Cleanup
Site Mgmt. Req.: NONE SPECIFIED
Acres: 1
National Priorities List: NO
Cleanup Oversight Agencies: SMBRP
Lead Agency: SMBRP
Lead Agency Description: DTSC - Site Cleanup Program
Project Manager: Joe Hwong
Supervisor: Shahir Haddad
Division Branch: Southern California Schools & Brownfields Outreach
Site Code: 550325
Assembly: 79
Senate: 39
Special Programs Code: Voluntary Cleanup Program
Status: Certified O&M - Land Use Restrictions Only
Status Date: 10/20/2010
Restricted Use: YES
Funding: Responsible Party
Lat/Long: 32.80886 / -117.1428
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: NONE SPECIFIED
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: CAD008232829
Alias Type: EPA Identification Number
Alias Name: 110000478965
Alias Type: EPA (FRS #)
Alias Name: 401098
Alias Type: Project Code (Site Code)
Alias Name: 401727

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8575 AERO DR (Continued)

1000355113

Alias Type: Project Code (Site Code)
Alias Name: 550325
Alias Type: Project Code (Site Code)
Alias Name: 71002149
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 09/06/2018
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Land Use Restriction - Site Inspection/Visit
Completed Date: 12/02/2014
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: California Land Reuse and Revitalization Agreement
Completed Date: 04/12/2018
Comments: Copy of fully executed CLRRRA Agreement for WinchesterTemecula sent to S. Wayne Rosenbaum, Environmental Law Group office, on 4/13/18.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: No Further Action Letter
Completed Date: 07/30/2005
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Inspections/Visit (Non LUR)
Completed Date: 02/01/2004
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * LUC Inspection Complete
Completed Date: 06/19/2006
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Land Use Restriction
Completed Date: 06/30/2005
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Corrective Action Completion Determination
Completed Date: 07/30/2005
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8575 AERO DR (Continued)

1000355113

Completed Document Type: * LUC Inspection Complete
Completed Date: 05/18/2008
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Phase I Verification
Completed Date: 01/01/2002
Comments: Inspection report sent on 1/1/2002

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * LUC Inspection Complete
Completed Date: 06/15/2007
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Consent Agreement
Completed Date: 11/22/2002
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Remedy Selection and Statement of Basis
Completed Date: 02/04/2005
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Land Use Restriction - Site Inspection/Visit
Completed Date: 10/09/2012
Comments: Completed

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Endangerment Assessment Report
Completed Date: 07/30/2004
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Corrective Measures Study Report
Completed Date: 02/04/2005
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Remedial Action Completion Report
Completed Date: 04/21/2005
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Endangerment Assessment Workplan
Completed Date: 10/02/2003
Comments: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8575 AERO DR (Continued)

1000355113

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Land Use Restriction Monitoring Report
Completed Date: 06/29/2017
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 01/18/2019
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 12/21/2018
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Land Use Restriction - Site Inspection/Visit
Completed Date: 02/19/2015
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 12/03/2014
Comments: Not reported

Future Area Name: PROJECT WIDE
Future Sub Area Name: Not reported
Future Document Type: Operations and Maintenance Plan
Future Due Date: 2019
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Public Participation Plan / Community Relations Plan
Schedule Due Date: 09/13/2018
Schedule Revised Date: Not reported
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Site Characterization Report
Schedule Due Date: 08/14/2018
Schedule Revised Date: Not reported
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Remedial Action Plan
Schedule Due Date: 03/15/2019
Schedule Revised Date: Not reported
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: CEQA - Responsible Agency Review
Schedule Due Date: 01/14/2019
Schedule Revised Date: Not reported
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Certification

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8575 AERO DR (Continued)

1000355113

Schedule Due Date: 01/25/2019
Schedule Revised Date: Not reported
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Land Use Restriction
Schedule Due Date: 05/25/2019
Schedule Revised Date: Not reported

HIST UST:

File Number: Not reported
URL: Not reported
Region: STATE
Facility ID: 00000054619
Facility Type: Other
Other Type: P.C.BD. MANUFACTURER
Contact Name: Not reported
Telephone: 6192788000
Owner Name: MOORE ELECTRO ASSEMBLY, INC.
Owner Address: 8575 AERO DRIVE
Owner City,St,Zip: SAN DIEGO, CA 92123
Total Tanks: 0004

Tank Num: 001
Container Num: B-01
Year Installed: 1983
Tank Capacity: 00000412
Tank Used for: WASTE
Type of Fuel: Not reported
Container Construction Thickness: 12
Leak Detection: None

Tank Num: 002
Container Num: B-101
Year Installed: Not reported
Tank Capacity: 00000185
Tank Used for: Not reported
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: Not reported

Tank Num: 003
Container Num: R-01
Year Installed: 1983
Tank Capacity: 00000206
Tank Used for: WASTE
Type of Fuel: Not reported
Container Construction Thickness: 12
Leak Detection: None

Tank Num: 004
Container Num: R-01
Year Installed: Not reported
Tank Capacity: 00000185
Tank Used for: Not reported
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

8575 AERO DR (Continued)

1000355113

DEED:

Envirostor ID: 71002149
Area: PROJECT WIDE
Sub Area: Not reported
Site Type: VOLUNTARY CLEANUP
Status: CERTIFIED O&M - LAND USE RESTRICTIONS ONLY
Agency: Not reported
Covenant Uploaded: Not reported
Deed Date(s): 06/30/2005
File Name: Envirostor Land Use Restrictions

V157
South
< 1/8
0.029 mi.
153 ft.

MOORE PRINTED CIRCUITS
8575 AERO DR
SAN DIEGO, CA 92123
Site 4 of 6 in cluster V

CA SAN DIEGO CO. SAM
CA HIST UST
FTTS
HIST FTTS
CA SAN DIEGO CO LOP

1009518533
N/A

Actual:
408 ft.

SAN DIEGO CO. SAM:

Focus Map:
1

Case Number: 109462-001
Agency: CA Department of Toxic Substance Control
Funding: Non Billable
Facility Type: Soils Only
Facility Status: Remedial Action (Clean-Up)
Date: 1/13/2005
Date Began: 12/24/2004

HIST UST:

File Number: 0002F066
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002F066.pdf>
Region: Not reported
Facility ID: Not reported
Facility Type: Not reported
Other Type: Not reported
Contact Name: Not reported
Telephone: Not reported
Owner Name: Not reported
Owner Address: Not reported
Owner City,St,Zip: Not reported
Total Tanks: Not reported

Tank Num: Not reported
Container Num: Not reported
Year Installed: Not reported
Tank Capacity: Not reported
Tank Used for: Not reported
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: Not reported

[Click here for Geo Tracker PDF:](#)

FTTS:

Case Number: Not reported
Docket Number: EPCRA09-98-0018
Complaint Issue Date: 09/30/98
Abatement Amount: 0.0000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOORE PRINTED CIRCUITS (Continued)

1009518533

Proposed Penalty: 5000.0000
Final Assessment: 2250.0000
Final Order Date: 12/15/98
Close Date: / /
Violations(s): EPCRA, Nonreporting/Failure to RPT to EPA

FTTS INSP:

Inspection Number: 1998040710567 1
Region: 09
Inspection Date: 04/07/98
Inspector: GGHOLSON
Violation occurred: Yes
Investigation Type: EPCRA, Enforcement, Federal Conducted
Investigation Reason: Neutral Scheme, Region
Legislation Code: EPCRA
Facility Function: Manufacturer

HIST FTTS INSP:

Inspection Number: 1998040710567 1
Region: 09
Inspection Date: Not reported
Inspector: GGHOLSON
Violation occurred: Yes
Investigation Type: EPCRA, Enforcement, Federal Conducted
Investigation Reason: Neutral Scheme, Region
Legislation Code: EPCRA
Facility Function: Manufacturer

SAN DIEGO CO LOP:

Record ID: DEH2005-LSAM-109462-001
Record Status: Completed
Opened Date: 01/07/2005
Parcel Number: 421-050-09-00
Case Type: Not reported
Historical Name: MOORE PRINTED CIRCUITS
SWRCB Global ID: Not reported
Funding: N - Non-Billable
Lead Agency: DTSC
Lead Agency Date: 12/24/2004
Census Tract: 92.01
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 C 4
Latitude: 32.8088608
Longitude: -117.1428861
X MapCoord: 6287319.626
Y MapCoord: 1875282.697

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

V158
South
< 1/8
0.029 mi.
153 ft.
NATURESCAPE SERVICES INC
8575 AERO DR
SAN DIEGO, CA 92123
Site 5 of 6 in cluster V

CA San Diego Co. HMMD
CA SWEEPS UST
CA PEST LIC
1001480641
N/A

Actual:
408 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number: 109462
Business Type: 6HK36
EPA Id Number: CAD008232829
APN: 421-050-09-00
Last HMMD Inspection: 12/20/1999
Facility Telephone: 278-8000
Permit Status: INAC
Permit Expiration: 12/31/2000
Date Last Updated: 11/02/2012
Facility Owner: MOORE PRINTED CIRCUITS INC.
Facility Mailing Address: 6740 NANCY RIDGE DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92121-2230
UST Owner: MOORE ELECTRO ASSEMBLY INC
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Y
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 109462 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 109462
Tank Type: UNKNOWN
Additional Id: B-01
Capacity Gallons: 175
UST Contents: Not reported
Other Content Info: SEE FILE FOR CONTENTS
Reg Status: EXEMPT
Remove Close Date: Not reported
Year Installed: 1983-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 109462 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 109462
Tank Type: UNKNOWN
Additional Id: B-101
Capacity Gallons: 0
UST Contents: Not reported
Other Content Info: SEE FILE FOR CONTENTS
Reg Status: EXEMPT
Remove Close Date: Not reported
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATURESCAPE SERVICES INC (Continued)

1001480641

Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 109462 T003

Last Update: 2012-11-02 14:17:38

Permit Number: 109462

Tank Type: UNKNOWN

Additional Id: R-01

Capacity Gallons: 206

UST Contents: Not reported

Other Content Info: SEE FILE FOR CONTENTS

Reg Status: EXEMPT

Remove Close Date: Not reported

Year Installed: 1983-01-01 00:00:00

Pipe Type: Not reported

Delivery System: Not reported

Monitor Code: 90

UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 109462 T004

Last Update: 2012-11-02 14:17:38

Permit Number: 109462

Tank Type: UNKNOWN

Additional Id: R-01

Capacity Gallons: 0

UST Contents: Not reported

Other Content Info: SEE FILE FOR CONTENTS

Reg Status: EXEMPT

Remove Close Date: Not reported

Year Installed: Not reported

Pipe Type: Not reported

Delivery System: Not reported

Monitor Code: 90

UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

SWEEPS UST:

Status: Active

Comp Number: 9462

Number: 9

Board Of Equalization: 44-022439

Referral Date: Not reported

Action Date: 06-26-92

Created Date: 02-29-88

Owner Tank Id: Not reported

SWRCB Tank Id: 37-000-009462-000001

Tank Status: A

Capacity: 175

Active Date: Not reported

Tank Use: CHEMICAL

STG: W

Content: Not reported

Number Of Tanks: 4

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NATURESCAPE SERVICES INC (Continued)

1001480641

Status: Active
Comp Number: 9462
Number: 9
Board Of Equalization: 44-022439
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-009462-000002
Tank Status: A
Capacity: Not reported
Active Date: Not reported
Tank Use: CHEMICAL
STG: P
Content: Not reported
Number Of Tanks: Not reported

Status: Active
Comp Number: 9462
Number: 9
Board Of Equalization: 44-022439
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-009462-000003
Tank Status: A
Capacity: 206
Active Date: Not reported
Tank Use: CHEMICAL
STG: W
Content: Not reported
Number Of Tanks: Not reported

Status: Active
Comp Number: 9462
Number: 9
Board Of Equalization: 44-022439
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-009462-000004
Tank Status: A
Capacity: Not reported
Active Date: Not reported
Tank Use: CHEMICAL
STG: P
Content: Not reported
Number Of Tanks: Not reported

PEST LIC:

Facility Type: MGB
Categories: Not reported
License No: 41417
Issued or Renewed Date: 04/09/2018
Expiration Date: 12/31/2019

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

V159 **ON SITE DRAPERY CLEANING**
South **8555 AERO DR**
< 1/8 **SAN DIEGO, CA 92123**
0.029 mi.
153 ft. **Site 6 of 6 in cluster V**

EDR Hist Cleaner **1020053732**
N/A

Actual: EDR Hist Cleaner
406 ft.

Focus Map: Year: Name: Type:
1 1992 ON SITE DRAPERY CLEANING Drycleaning Plants, Except Rugs, NEC
1993 ON SITE DRAPERY CLEANING Drycleaning Plants, Except Rugs, NEC

W160 **LORAL INSTRUMENTATION**
South **8401 AERO DR**
< 1/8 **SAN DIEGO, CA 92123**
0.037 mi.
196 ft. **Site 1 of 2 in cluster W**

RCRA-SQG **1000147906**
CA San Diego Co. HMM **CAD118589092**
FINDS
ECHO

Actual: RCRA-SQG:
403 ft.

Focus Map: Date form received by agency: 08/21/1986
1 Facility name: LORAL INSTRUMENTATION
Facility address: 8401 AERO DR
SAN DIEGO, CA 92123
EPA ID: CAD118589092
Mailing address: AERO DR
SAN DIEGO, CA 92123
Contact: ENVIRONMENTAL MANAGER
Contact address: 8401 AERO DR
SAN DIEGO, CA 92123
Contact country: US
Contact telephone: 619-560-5888
Contact email: Not reported
EPA Region: 09
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: LORAL CORP GREMLIN ASSOC
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LORAL INSTRUMENTATION (Continued)

1000147906

Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

HMMD SAN DIEGO:

Permit Number: 114766
Business Type: Not reported
EPA Id Number: CAD118589092
APN: 421-040-11-00
Last HMMD Inspection: 01/25/1991
Facility Telephone: 858-560-5888
Permit Status: INAC
Permit Expiration: 01/25/1991
Date Last Updated: 11/02/2012
Facility Owner: LORAL CORPORATION
Facility Mailing Address: 8401 AERO DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1720
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Permit Number: 128541
Business Type: Not reported
EPA Id Number: Not reported
APN: 421-040-11-00
Last HMMD Inspection: 06/08/1990
Facility Telephone: 858-292-0500
Permit Status: INAC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LORAL INSTRUMENTATION (Continued)

1000147906

Permit Expiration: 06/08/1990
Date Last Updated: 11/02/2012
Facility Owner: SCITEQ ELECTRONICS INC
Facility Mailing Address: 8401 AERO DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1720
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

FINDS:

Registry ID: 110009532782

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000147906
Registry ID: 110009532782
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110009532782>

W161
South
< 1/8
0.037 mi.
196 ft.

GREMLIN INDUSTRIES INC
8401 AERO DRIVE
SAN DIEGO, CA 92123

RCRA-SQG 1000300822
CAD064475478

Site 2 of 2 in cluster W

Actual:
403 ft.

Focus Map:
1

RCRA-SQG:
Date form received by agency: 09/01/1996
Facility name: GREMLIN INDUSTRIES INC
Facility address: 8401 AERO DRIVE
SAN DIEGO, CA 92123
EPA ID: CAD064475478
Contact: Not reported
Contact address: Not reported
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 09
Land type: Facility is not located on Indian land. Additional information is not known.
Classification: Small Small Quantity Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GREMLIN INDUSTRIES INC (Continued)

1000300822

Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: SEGA ENTERPRISES INC
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 10/08/1980
Site name: GREMLIN INDUSTRIES INC
Classification: Large Quantity Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GREMLIN INDUSTRIES INC (Continued)

1000300822

Facility Has Received Notices of Violations:

Regulation violated: F - 268.7
Area of violation: LDR - General
Date violation determined: 12/15/1988
Date achieved compliance: 12/28/1988
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 262.50-60
Area of violation: Generators - General
Date violation determined: 12/15/1988
Date achieved compliance: 12/28/1988
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 12/15/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: LDR - General
Date achieved compliance: 12/28/1988
Evaluation lead agency: State

Evaluation date: 12/15/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 12/28/1988
Evaluation lead agency: State

162
South
< 1/8
0.040 mi.
210 ft.

C P KELCO
8225 AERO DR
SAN DIEGO, CA 92123

RCRA-SQG 1000984882
CA San Diego Co. HMMD CAD981695380
CA HAZNET
NY MANIFEST

Actual:
411 ft.

Focus Map:
1

RCRA-SQG:
Date form received by agency: 11/03/2004
Facility name: C P KELCO
Facility address: 8225 AERO DR
SAN DIEGO, CA 92123
EPA ID: CAD981695380
Mailing address: 8355 AERO DR
SAN DIEGO, CA 92123
Contact: ART O CASEY
Contact address: 8355 AERO DR

1000984882

Contact country:	US
Contact telephone:	858-467-6482
Contact email:	ART.CASEY@CPKELCO.COM
EPA Region:	09
Classification:	Small Small Quantity Generator
Description:	Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name:	CP KELCO
Owner/operator address:	Not reported
	Not reported
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Operator
Owner/Op start date:	09/30/2000
Owner/Op end date:	Not reported

Owner/operator name:	HUBER EQUITY CORP
Owner/operator address:	1209 ORANGE ST WILMINGTON, DE 19801
Owner/operator country:	US
Owner/operator telephone:	Not reported
Owner/operator email:	Not reported
Owner/operator fax:	Not reported
Owner/operator extension:	Not reported
Legal status:	Private
Owner/Operator Type:	Owner
Owner/Op start date:	09/30/2004
Owner/Op end date:	Not reported

Handler Activities Summary:

U.S. importer of hazardous waste:	No
Mixed waste (haz. and radioactive):	No
Recycler of hazardous waste:	No
Transporter of hazardous waste:	No
Treater, storer or disposer of HW:	No
Underground injection activity:	No
On-site burner exemption:	No
Furnace exemption:	No
Used oil fuel burner:	No
Used oil processor:	No
User oil refiner:	No
Used oil fuel marketer to burner:	No
Used oil Specification marketer:	No
Used oil transfer facility:	No
Used oil transporter:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

- . Waste code: D003
- . Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BE WASTE GUNPOWDER.

- . Waste code: D008
- . Waste name: LEAD

- . Waste code: D009
- . Waste name: MERCURY

- . Waste code: D022
- . Waste name: CHLOROFORM

- . Waste code: D038
- . Waste name: PYRIDINE

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Historical Generators:

Date form received by agency:10/23/2000

Site name: C P KELCO APS

Classification: Small Quantity Generator

. Waste code: D001

. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002

. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D003

. Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BE WASTE GUNPOWDER.

. Waste code: D008

. Waste name: LEAD

. Waste code: D022

. Waste name: CHLOROFORM

. Waste code: D038

. Waste name: PYRIDINE

Violation Status: No violations found

HMMD SAN DIEGO:

Permit Number: Not reported

Business Type: Not reported

EPA Id Number: CAD981695380

APN: Not reported

Last HMMD Inspection: Not reported

Facility Telephone: 858-292-4900

Permit Status: Permit Renewed

Permit Expiration: Not reported

Date Last Updated: 04/18/2018

Facility Owner: Not reported

Facility Mailing Address: 8225 AERO DR, SAN DIEGO, CA 92123

Facility Mailing City: Not reported

Facility Mailing State: Not reported

Facility Mailing Zip: Not reported

UST Owner: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-204343
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4091678
Return To Compliance Date: 2013-04-24T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-04-18T00:00:00.000
Inspection Date: 2013-03-27T13:09:00.000
Violation Code: 3030010 Failure to dispose of hazardous waste within 180 days (or 270 if waste is transported over 200 miles) for the generator who generates less than 1000 kilogram per month, but more than 100 kilograms per month.; 22 CCR 12 66262.34(d).

Waste and Materials:

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0172437
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-04-18T02:32:07.000
Chemical Name: NITROGEN GAS
Common Name: COMPRESSED NITROGEN
Case Number: 7727-37-9

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0172438
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-04-18T02:32:07.000
Chemical Name: AIR, COMPRESSED
Common Name: AIR, COMPRESSED
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0172439
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-04-18T02:32:07.000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Chemical Name:	NITROGEN
Common Name:	Nitrogen, Liquid
Case Number:	7727-37-9
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0172440
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-04-18T02:32:07.000
Chemical Name:	ISOPROPYL ALCOHOL 99%
Common Name:	ISOPROPYL ALCOHOL 99%
Case Number:	67-63-0
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0172434
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-04-18T02:32:07.000
Chemical Name:	NEXGUARD (R) 22350
Common Name:	WATER TREATMENT CHEMICALS
Case Number:	Not reported
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0172435
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-04-18T02:32:07.000
Chemical Name:	CALCIUM CHLORIDE SOLUTION 39%
Common Name:	CALCIUM CHLORIDE SOLUTION 39%
Case Number:	Not reported
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0172436
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-04-18T02:32:07.000
Chemical Name:	MONARCH PERFORM 46918
Common Name:	Cleaning Product
Case Number:	Not reported
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0172441
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-04-18T02:32:07.000
Chemical Name:	Hydrogen
Common Name:	Hydrogen Gas, Compressed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Case Number:	1333-74-0
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0172442
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-04-18T02:32:07.000
Chemical Name:	Helium
Common Name:	Helium, Compressed Gas
Case Number:	7440-59-7
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0172443
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-04-18T02:32:07.000
Chemical Name:	Argon Compressed
Common Name:	Argon Compressed
Case Number:	7440-37-1
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0146455
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-04-18T02:32:07.000
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL
Common Name:	WASTE 221 WASTE OIL & MIXED OIL
Case Number:	Not reported
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0146456
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-04-18T02:32:07.000
Chemical Name:	WASTE 551 LABORATORY WASTE IPA
Common Name:	WASTE 551 LABORATORY WASTE IPA
Case Number:	Not reported
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0146457
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-04-18T02:32:07.000
Chemical Name:	WASTE 551 Basic Waste Lab Packed
Common Name:	WASTE 551 Basic Waste Lab Packed
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0146458
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-18T02:32:07.000
Chemical Name: WASTE 791 Acidic Waste Lab Packed
Common Name: WASTE 791 Acidic Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0146459
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-18T02:32:07.000
Chemical Name: WASTE 551 Flammable/Aerosols Waste Lab Packed
Common Name: WASTE 551 Flammable/Aerosols Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0146460
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-18T02:32:07.000
Chemical Name: WASTE 551 Toxic Waste Lab Packed
Common Name: WASTE 551 Toxic Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0146461
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-18T02:32:07.000
Chemical Name: WASTE 331 Non-RCRA Waste Lab Packed
Common Name: WASTE 331 Non-RCRA Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0134909
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: NEXGUARD (R) 22350
Common Name: WATER TREATMENT CHEMICALS
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Active Permit: Y
Child Record Id: DEH2017-HCHEM-0134910
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: CALCIUM CHLORIDE SOLUTION 39%
Common Name: CALCIUM CHLORIDE SOLUTION 39%
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0134911
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: ACETYLENE GAS
Common Name: ACETYLENE GAS
Case Number: 74-86-2

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0134912
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: MONARCH PERFORM 46918
Common Name: Cleaning Product
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0134913
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: NITROGEN GAS
Common Name: COMPRESSED NITROGEN
Case Number: 7727-37-9

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0134914
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: AIR, COMPRESSED
Common Name: AIR, COMPRESSED
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0134915

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-04-28T02:34:43.000
Chemical Name:	NITROGEN
Common Name:	Nitrogen, Liquid
Case Number:	7727-37-9
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0134916
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-04-28T02:34:43.000
Chemical Name:	ISOPROPYL ALCOHOL 99%
Common Name:	ISOPROPYL ALCOHOL 99%
Case Number:	67-63-0
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0134917
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-04-28T02:34:43.000
Chemical Name:	Hydrogen
Common Name:	Hydrogen Gas, Compressed
Case Number:	1333-74-0
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0134918
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-04-28T02:34:43.000
Chemical Name:	Helium
Common Name:	Helium, Compressed Gas
Case Number:	7440-59-7
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0134919
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-04-28T02:34:43.000
Chemical Name:	Argon Compressed
Common Name:	Argon Compressed
Case Number:	7440-37-1
Record ID:	DEH2004-HUPFP-204343
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0134920
Trade Secret:	N
Hazardous Material Type:	Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Last Updated: 2017-04-28T02:34:43.000
Chemical Name: Propane
Common Name: Liquefied Petroleum Gas (lpg)
Case Number: 74-98-6

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0112844
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: WASTE 221 WASTE OIL & MIXED OIL
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0112845
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: WASTE 551 LABORATORY WASTE IPA
Common Name: WASTE 551 LABORATORY WASTE IPA
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0112846
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: WASTE 551 Basic Waste Lab Packed
Common Name: WASTE 551 Basic Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0112847
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: WASTE 791 Acidic Waste Lab Packed
Common Name: WASTE 791 Acidic Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0112848
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: WASTE 551 Flammable/Aerosols Waste Lab Packed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Common Name: WASTE 551 Flammable/Aerosols Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0112849
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: WASTE 551 Toxic Waste Lab Packed
Common Name: WASTE 551 Toxic Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0112850
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-28T02:34:43.000
Chemical Name: WASTE 331 Non-RCRA Waste Lab Packed
Common Name: WASTE 331 Non-RCRA Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088902
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: NEXGUARD (R) 22350
Common Name: WATER TREATMENT CHEMICALS
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088903
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: CALCIUM CHLORIDE SOLUTION 39%
Common Name: CALCIUM CHLORIDE SOLUTION 39%
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088904
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: ACETYLENE GAS
Common Name: ACETYLENE GAS
Case Number: 74-86-2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088905
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: MONARCH PERFORM 46918
Common Name: Cleaning Product
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088906
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: NITROGEN GAS
Common Name: COMPRESSED NITROGEN
Case Number: 7727-37-9

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088907
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: AIR, COMPRESSED
Common Name: AIR, COMPRESSED
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088908
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: NITROGEN
Common Name: Nitrogen, Liquid
Case Number: 7727-37-9

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088909
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: ISOPROPYL ALCOHOL 99%
Common Name: ISOPROPYL ALCOHOL 99%
Case Number: 67-63-0

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088910
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: Hydrogen
Common Name: Hydrogen Gas, Compressed
Case Number: 1333-74-0

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088911
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: Helium
Common Name: Helium, Compressed Gas
Case Number: 7440-59-7

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088912
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: Argon Compressed
Common Name: Argon Compressed
Case Number: 7440-37-1

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088913
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: Propane
Common Name: Liquefied Petroleum Gas (lpg)
Case Number: 74-98-6

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0070967
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: WASTE 221 WASTE OIL & MIXED OIL
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0070968

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: WASTE 551 LABORATORY WASTE IPA
Common Name: WASTE 551 LABORATORY WASTE IPA
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0070969
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: WASTE 551 Basic Waste Lab Packed
Common Name: WASTE 551 Basic Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0070970
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: WASTE 791 Acidic Waste Lab Packed
Common Name: WASTE 791 Acidic Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0070971
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: WASTE 551 Flammable/Aerosols Waste Lab Packed
Common Name: WASTE 551 Flammable/Aerosols Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0070972
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-04-06T02:32:26.000
Chemical Name: WASTE 551 Toxic Waste Lab Packed
Common Name: WASTE 551 Toxic Waste Lab Packed
Case Number: Not reported

Record ID: DEH2004-HUPFP-204343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0070973
Trade Secret: N
Hazardous Material Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Last Updated: 2016-04-06T02:32:26.000
Chemical Name: WASTE 331 Non-RCRA Waste Lab Packed
Common Name: WASTE 331 Non-RCRA Waste Lab Packed
Case Number: Not reported

Permit Number: 100026
Business Type: 6HK67
EPA Id Number: CAD981695380
APN: 421-040-01-00
Last HMMD Inspection: 06/17/2003
Facility Telephone: 858-292-4900
Permit Status: INAC
Permit Expiration: 01/31/2005
Date Last Updated: 11/02/2012
Facility Owner: CP KELCO
Facility Mailing Address: 8355 AERO DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1718
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Permit Number: 204343
Business Type: 6HK67
EPA Id Number: CAD981695380
APN: 421-040-01-00
Last HMMD Inspection: 04/15/2011
Facility Telephone: 858-292-4900
Permit Status: OPEN
Permit Expiration: 04/30/2013
Date Last Updated: 11/02/2012
Facility Owner: HUBER EQUITY CORP
Facility Mailing Address: 8225 AERO DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Y
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 204343
Update Date: 11/02/2012
Case Number: 74-86-2
Name: ACETYLENE GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 204343
Update Date: 11/02/2012
Case Number: Not reported
Name: AIR, COMPRESSED
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 204343
Update Date: 11/02/2012
Case Number: Not reported
Name: ARGON GAS & CARBON DIOXIDE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 204343
Update Date: 11/02/2012
Case Number: Not reported
Name: CALCIUM CHLORIDE SOLUTION
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 204343
Update Date: 11/02/2012
Case Number: 124-38-9
Name: CARBON DIOXIDE GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 204343
Update Date: 11/02/2012
Case Number: Not reported
Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Material Waste: Not reported
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 204343
Update Date: 11/02/2012
Case Number: 67-63-0
Name: ISOPROPYL ALCOHOL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 204343

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Update Date:	11/02/2012
Case Number:	Not reported
Name:	MONARCH PERFORM 46918
Other Information:	MIXED ACIDS
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	204343
Update Date:	11/02/2012
Case Number:	Not reported
Name:	NEXGUARD (R) 22350
Other Information:	WATER TREATMENT CHEMICALS
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	204343
Update Date:	11/02/2012
Case Number:	7727-37-9
Name:	NITROGEN GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	204343
Update Date:	11/02/2012
Case Number:	7727-37-9
Name:	NITROGEN GAS
Other Information:	COMPRESSED
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	204343
Update Date:	11/02/2012
Case Number:	25322-68-3
Name:	POLYETHYLENE GLYCOL
Other Information:	DOW PEG 300 MACROGOL
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	204343
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 214 UNSPEC SOLVENT MIXTURE
Other Information:	HEXANE, IPA, CHLOROFORM
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	204343
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Other Information: USED OIL W/SOAP
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 204343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information: FLAMM LIQUID TOLUENE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 204343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 551 LABORATORY WASTE CHEMICALS
Other Information: ETHYDIUM BROMIDE/ LAB PACKS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 204343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 551 LABORATORY WASTE CHEMICALS
Other Information: RUBBING ALCOHOL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 204343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 791 LIQUIDS WITH PH <OR= 2
Other Information: FLAMMABLE CORROSIVE LIQUIDS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 204343
Update Date: 11/02/2012
Inspection Date: 11/04/2004
Violation Code: 6HV1002
Violation: HMBP NOT ESTABISHED/IMPLEMENTED.
Violation Citation: Hazardous materials handler has not established/implemented a business plan. HSC 25503.5(a)
Activity: ACTIVE

Permit Number: 204343
Update Date: 11/02/2012
Inspection Date: 06/29/2009
Violation Code: 6HV4309
Violation: SQG:MWMP OR EQUIV NOT ONSITE
Violation Citation: Medical Waste Management Plan or equivalent information not onsite for

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Activity: review (SQG). 117945
ACTIVE

Permit Number: 204343
Update Date: 11/02/2012
Inspection Date: 06/29/2009
Violation Code: 6HV1016
Violation: ER RESPONSE PLAN NOT ADEQUATE
Violation Citation: Failure to have an adequate emergency response plan 25504 (b); 2731
Activity: ACTIVE

Permit Number: 204343
Update Date: 11/02/2012
Inspection Date: 11/15/2007
Violation Code: 6HV1013
Violation: HMBP NOT AVAILABLE FOR REVIEW
Violation Citation: Copy of HMBP not onsite for inspector's review. 25505(e)
Activity: ACTIVE

Permit Number: 204343
Update Date: 11/02/2012
Inspection Date: 11/15/2007
Violation Code: 6HV0221
Violation: DID NOT COMPLY W/SATELLITE REGS.
Violation Citation: Failed to comply with satellite regulations. 66262.34(e)
Activity: ACTIVE

Permit Number: 204343
Update Date: 11/02/2012
Inspection Date: 11/15/2007
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

HAZNET:

Facility Name: CPKELCO RESEARCH & DEVELOPMENT SITE
envid: 1000984882
Year: 2017
GEPAID: CAD981695380
Contact: JOHN M SWAZEY
Telephone: 8584676640
Mailing Name: Not reported
Mailing Address: 8225 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921231718
Gen County: San Diego
TSD EPA ID: NED981723513
TSD County: 99
Waste Category: Laboratory waste chemicals
Disposal Method: Incineration--Thermal Destruction Other Than Use As A Fuel
Tons: 0.22935
Cat Decode: Laboratory waste chemicals
Method Decode: Incineration--Thermal Destruction Other Than Use As A Fuel
Facility County: San Diego

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

envid: 1000984882
Year: 2017
GEPAID: CAD981695380
Contact: JOHN M SWAZEY
Telephone: 8584676640
Mailing Name: Not reported
Mailing Address: 8225 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921231718
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Not reported
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: Not reported
Cat Decode: Not reported
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Facility County: San Diego

envid: 1000984882
Year: 2017
GEPAID: CAD981695380
Contact: JOHN M SWAZEY
Telephone: 8584676640
Mailing Name: Not reported
Mailing Address: 8225 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921231718
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Laboratory waste chemicals
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.6575
Cat Decode: Laboratory waste chemicals
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Facility County: San Diego

envid: 1000984882
Year: 2017
GEPAID: CAD981695380
Contact: JOHN M SWAZEY
Telephone: 8584676640
Mailing Name: Not reported
Mailing Address: 8225 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921231718
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.235
Cat Decode: Off-specification, aged or surplus organics
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Facility County: (H010-H129) Or (H131-H135)
San Diego

envid: 1000984882
Year: 2017
GEPAID: CAD981695380
Contact: JOHN M SWAZEY
Telephone: 8584676640
Mailing Name: Not reported
Mailing Address: 8225 AERO DR
Mailing City,St,Zip: SAN DIEGO, CA 921231718
Gen County: San Diego
TSD EPA ID: UTD981552177
TSD County: 99
Waste Category: Laboratory waste chemicals
Disposal Method: Incineration--Thermal Destruction Other Than Use As A Fuel
Tons: 0.023
Cat Decode: Laboratory waste chemicals
Method Decode: Incineration--Thermal Destruction Other Than Use As A Fuel
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
405 additional CA_HAZNET: record(s) in the EDR Site Report.

NY MANIFEST:

Country: USA
EPA ID: CAD981695380
Facility Status: Not reported
Location Address 1: 8225 AERO DRIVE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: SAN DIEGO
Location State: CA
Location Zip: 92123
Location Zip 4: Not reported

NY MANIFEST:

EPAID: CAD981695380
Mailing Name: KELCO
Mailing Contact: KELCO
Mailing Address 1: 8225 AERO DRIVE
Mailing Address 2: Not reported
Mailing City: SAN DIEGO
Mailing State: CA
Mailing Zip: 92123
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 6192924900

NY MANIFEST:

Document ID: NYA6090831
Manifest Status: K
seq: Not reported
Year: 1988
Trans1 State ID: 808185
Trans2 State ID: 74488B-NY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C P KELCO (Continued)

1000984882

Generator Ship Date: 07/15/1988
Trans1 Recv Date: 07/15/1988
Trans2 Recv Date: 07/25/1988
TSD Site Recv Date: 08/05/1988
Part A Recv Date: 08/04/1988
Part B Recv Date: 08/15/1988
Generator EPA ID: CAD981695380
Trans1 EPA ID: NYD980769947
Trans2 EPA ID: NYD980769947
TSDF ID 1: NYD000632372
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code: D002 - NON-LISTED CORROSIVE WASTES
Waste Code: Not reported
Waste Code: Not reported
Waste Code: Not reported
Waste Code: Not reported
Waste Code: Not reported
Quantity: 00025
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100
Waste Code: D004 - ARSENIC 5.0 MG/L TCLP
Waste Code: Not reported
Waste Code: Not reported
Waste Code: Not reported
Waste Code: Not reported
Quantity: 00025
Units: P - Pounds
Number of Containers: 001
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 100

[Click this hyperlink](#) while viewing on your computer to access
-1 additional NY MANIFEST: record(s) in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

X163
NNE
< 1/8
0.040 mi.
213 ft.
KYOCERA AMERICA INC
8611 BALBOA AVE
SAN DIEGO, CA 92123
Site 1 of 5 in cluster X

CA SWEEPS UST
S100938431
N/A

Actual:
422 ft.

Focus Map:
1

SWEEPS UST:

Status:	Active
Comp Number:	62
Number:	9
Board Of Equalization:	44-021522
Referral Date:	Not reported
Action Date:	06-26-92
Created Date:	02-29-88
Owner Tank Id:	Not reported
SWRCB Tank Id:	Not reported
Tank Status:	Not reported
Capacity:	Not reported
Active Date:	Not reported
Tank Use:	Not reported
STG:	Not reported
Content:	Not reported
Number Of Tanks:	Not reported
Status:	Not reported
Comp Number:	62
Number:	Not reported
Board Of Equalization:	44-021522
Referral Date:	Not reported
Action Date:	Not reported
Created Date:	Not reported
Owner Tank Id:	Not reported
SWRCB Tank Id:	37-000-000062-000001
Tank Status:	Not reported
Capacity:	1000
Active Date:	Not reported
Tank Use:	M.V. FUEL
STG:	PRODUCT
Content:	LEADED
Number Of Tanks:	3
Status:	Not reported
Comp Number:	62
Number:	Not reported
Board Of Equalization:	44-021522
Referral Date:	Not reported
Action Date:	Not reported
Created Date:	Not reported
Owner Tank Id:	Not reported
SWRCB Tank Id:	37-000-000062-000002
Tank Status:	Not reported
Capacity:	7500
Active Date:	Not reported
Tank Use:	OIL
STG:	PRODUCT
Content:	Not reported
Number Of Tanks:	Not reported
Status:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA AMERICA INC (Continued)

S100938431

Comp Number: 62
Number: Not reported
Board Of Equalization: 44-021522
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000062-000003
Tank Status: Not reported
Capacity: 7500
Active Date: Not reported
Tank Use: OIL
STG: WASTE
Content: Not reported
Number Of Tanks: Not reported

X164 KYOCERA INTERNATIONAL, INC.
NNE 8611 BALBOA AVE.
< 1/8 SAN DIEGO, CA 92123
0.040 mi.
213 ft. Site 2 of 5 in cluster X

Actual:
422 ft.
Focus Map:
1

RCRA-LQG 1000169014
CA LUST 92123KYCRM8611B
CA SAN DIEGO CO. SAM
CA CPS-SLIC
CA AST
CA San Diego Co. HMMD
CA HIST UST
TRIS
ICIS
US AIRS
FINDS
ECHO
CA EMI
CA Financial Assurance
CA ICE
CA HIST CORTESE
CA NPDES
CA WDS
CA SAN DIEGO CO LOP

RCRA-LQG:

Date form received by agency: 06/27/2016
Facility name: KYOCERA INTERNATIONAL, INC.
Facility address: 8611 BALBOA AVE.
SAN DIEGO, CA 92123
EPA ID: CAD047896097
Mailing address: BALBOA AVE.
SAN DIEGO, CA 92123
Contact: KATHRYN M PHIN
Contact address: BALBOA AVE.
SAN DIEGO, CA 92123
Contact country: US
Contact telephone: 858-576-2600
Telephone ext.: 2707
Contact email: KATHRYN.PHIN@KYOCERA.COM
EPA Region: 09
Land type: Private
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name: KYOCERA INTERNATIONAL, INC.
Owner/operator address: BALBOA AVE.
SAN DIEGO, CA 92123
Owner/operator country: US
Owner/operator telephone: 858-576-2600
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 07/01/2016
Owner/Op end date: Not reported

Owner/operator name: KYOCERA AMERICA, INC
Owner/operator address: BALBOA AVE
SAN DIEGO, CA 92123
Owner/operator country: Not reported
Owner/operator telephone: 858-576-2777
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 03/01/1975
Owner/Op end date: Not reported

Owner/operator name: KYOCERA INTERNATIONAL, INC.
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 07/01/2016
Owner/Op end date: Not reported

Owner/operator name: KYOCERA AMERICA, INC
Owner/operator address: BALBOA AVE
SAN DIEGO, CA 92123
Owner/operator country: Not reported
Owner/operator telephone: 858-576-2777
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 03/01/1975
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

- . Waste code: 132
- . Waste name: Aqueous solution w/metals (< restricted levels and see waste code 121 for a list of metals)

- . Waste code: 171
- . Waste name: Metal sludge (see 121)

- . Waste code: 181
- . Waste name: Other inorganic solid waste

- . Waste code: 214
- . Waste name: Unspecified solvent mixture

- . Waste code: 331
- . Waste name: Off-specification, aged, or surplus organics

- . Waste code: 352
- . Waste name: Other organic solids

- . Waste code: 711
- . Waste name: Liquids with cyanides > 1000 mg/l

- . Waste code: 726
- . Waste name: Liquids with nickel > 134 mg/l

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
- . Waste code: D003
- . Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.
- . Waste code: D005
- . Waste name: BARIUM
- . Waste code: D006
- . Waste name: CADMIUM
- . Waste code: D008
- . Waste name: LEAD
- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F006
- . Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.
- . Waste code: F007
- . Waste name: SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS
- . Waste code: F008
- . Waste name: PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.
- . Waste code: F009
- . Waste name: SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

Historical Generators:

Date form received by agency: 02/16/2016

Site name: KYOCERA AMERICA, INC.

Classification: Large Quantity Generator

. Waste code: 122

. Waste name: Alkaline solution without metals (pH > 12.5)

. Waste code: 132

. Waste name: Aqueous solution w/metals (< restricted levels and see waste code 121 for a list of metals)

. Waste code: 171

. Waste name: Metal sludge (see 121)

. Waste code: 181

. Waste name: Other inorganic solid waste

. Waste code: 214

. Waste name: Unspecified solvent mixture

. Waste code: 331

. Waste name: Off-specification, aged, or surplus organics

. Waste code: 352

. Waste name: Other organic solids

. Waste code: 711

. Waste name: Liquids with cyanides > 1000 mg/l

. Waste code: 792

. Waste name: Liquids with pH < 2 with metals

. Waste code: D001

. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSLEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002

. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D003

. Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.

. Waste code: D006
. Waste name: CADMIUM

. Waste code: D008
. Waste name: LEAD

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F006
. Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

. Waste code: F007
. Waste name: SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS

. Waste code: F008
. Waste name: PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

. Waste code: F009
. Waste name: SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

Date form received by agency: 03/01/2014

Site name: KYOCERA AMERICA, INC

Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002
. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D003
. Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.

. Waste code: D006
. Waste name: CADMIUM

. Waste code: D008
. Waste name: LEAD

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F006
. Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

. Waste code: F007
. Waste name: SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS

. Waste code: F008
. Waste name: PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

. Waste code: F009
. Waste name: SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

Date form received by agency:03/01/2012

Site name: KYOCERA AMERICA, INC

Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002

. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D003

. Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.

. Waste code: D006

. Waste name: CADMIUM

. Waste code: D008

. Waste name: LEAD

. Waste code: D035

. Waste name: METHYL ETHYL KETONE

. Waste code: F003

. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005

. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F006

. Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

- . Waste code: F007
- . Waste name: SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS

- . Waste code: F008
- . Waste name: PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

- . Waste code: F009
- . Waste name: SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

Date form received by agency: 03/01/2010

Site name: KYOCERA AMERICA, INC

Classification: Large Quantity Generator

- . Waste code: 122
- . Waste name: Alkaline solution without metals (pH > 12.5)

- . Waste code: 131
- . Waste name: Aqueous solution (2 < pH < 12.5) containing reactive anions (azide, bromate, chlorate, cyanide, fluoride, hypochlorite, nitrite, perchlorate, and sulfide anions)

- . Waste code: 132
- . Waste name: Aqueous solution w/metals (< restricted levels and see waste code 121 for a list of metals)

- . Waste code: 171
- . Waste name: Metal sludge (see 121)

- . Waste code: 181
- . Waste name: Other inorganic solid waste

- . Waste code: 212
- . Waste name: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)

- . Waste code: 214
- . Waste name: Unspecified solvent mixture

- . Waste code: 221
- . Waste name: Waste oil and mixed oil

- . Waste code: 223
- . Waste name: Unspecified oil-containing waste

- . Waste code: 331
- . Waste name: Off-specification, aged, or surplus organics

- . Waste code: 352
- . Waste name: Other organic solids

- . Waste code: 461

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

- . Waste name: Degreasing sludge
- . Waste code: 711
- . Waste name: Liquids with cyanides > 1000 mg/l
- . Waste code: 726
- . Waste name: Liquids with nickel > 134 mg/l
- . Waste code: 791
- . Waste name: Liquids with pH < 2
- . Waste code: 792
- . Waste name: Liquids with pH < 2 with metals
- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
- . Waste code: D003
- . Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.
- . Waste code: D006
- . Waste name: CADMIUM
- . Waste code: D008
- . Waste name: LEAD
- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F006
. Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

. Waste code: F007
. Waste name: SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS

. Waste code: F008
. Waste name: PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

. Waste code: F009
. Waste name: SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

Date form received by agency: 02/29/2008

Site name: KYOCERA AMERICA, INC

Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002
. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D008
. Waste name: LEAD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F006
- . Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.
- . Waste code: F007
- . Waste name: SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS
- . Waste code: F008
- . Waste name: PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.
- . Waste code: F009
- . Waste name: SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

Date form received by agency: 02/28/2006

Site name: KYOCERA AMERICA, INC.

Classification: Large Quantity Generator

- . Waste code: 122
- . Waste name: Alkaline solution without metals (pH > 12.5)
- . Waste code: 132
- . Waste name: Aqueous solution w/metals (< restricted levels and see waste code 121 for a list of metals)
- . Waste code: 141
- . Waste name: Off-specification, aged, or surplus inorganics
- . Waste code: 151
- . Waste name: Asbestos-containing waste
- . Waste code: 171
- . Waste name: Metal sludge (see 121)
- . Waste code: 181
- . Waste name: Other inorganic solid waste
- . Waste code: 212
- . Waste name: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

- . Waste code: 214
- . Waste name: Unspecified solvent mixture

- . Waste code: 223
- . Waste name: Unspecified oil-containing waste

- . Waste code: 331
- . Waste name: Off-specification, aged, or surplus organics

- . Waste code: 343
- . Waste name: Unspecified organic liquid mixture

- . Waste code: 352
- . Waste name: Other organic solids

- . Waste code: 711
- . Waste name: Liquids with cyanides > 1000 mg/l

- . Waste code: 726
- . Waste name: Liquids with nickel > 134 mg/l

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

- . Waste code: D008
- . Waste name: LEAD

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F006
- . Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM;

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

(2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

. Waste code: F007
. Waste name: SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS

. Waste code: F009
. Waste name: SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

Date form received by agency: 01/29/2004

Site name: KYOCERA AMERICA, INC.

Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002
. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D008
. Waste name: LEAD

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F006
. Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

ALUMINUM.

- . Waste code: F009
- . Waste name: SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

Date form received by agency: 02/27/2002

Site name: KYOCERA AMERICA, INC.

Classification: Large Quantity Generator

- . Waste code: 171
- . Waste name: Metal sludge (see 121)
- . Waste code: 181
- . Waste name: Other inorganic solid waste
- . Waste code: 212
- . Waste name: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)
- . Waste code: 214
- . Waste name: Unspecified solvent mixture
- . Waste code: 223
- . Waste name: Unspecified oil-containing waste
- . Waste code: 331
- . Waste name: Off-specification, aged, or surplus organics
- . Waste code: 343
- . Waste name: Unspecified organic liquid mixture
- . Waste code: 352
- . Waste name: Other organic solids
- . Waste code: 711
- . Waste name: Liquids with cyanides > 1000 mg/l
- . Waste code: 791
- . Waste name: Liquids with pH < 2
- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

- . Waste code: D008
- . Waste name: LEAD

- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F006
- . Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

Date form received by agency:10/12/2000
Site name: KYOCERA AMERICA, INC.
Classification: Large Quantity Generator

Date form received by agency:03/04/1999
Site name: KYOCERA AMERICA, INC.
Classification: Large Quantity Generator

Date form received by agency:09/01/1996
Site name: KYOCERA INTERNATIONAL INC
Classification: Large Quantity Generator

Date form received by agency:03/27/1996
Site name: KYOCERA AMERICA, INC.
Classification: Large Quantity Generator

Date form received by agency:03/31/1994
Site name: KYOCERA AMERICA, INC
Classification: Large Quantity Generator

Date form received by agency:02/24/1992
Site name: KYOCERA AMERICA, INC.
Classification: Large Quantity Generator

Date form received by agency:04/13/1990
Site name: KYOCERA AMERICA, INC.
Classification: Large Quantity Generator

Date form received by agency:08/18/1980
Site name: KYOCERA INTERNATIONAL INC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Classification: Large Quantity Generator

Biennial Reports:

Last Biennial Reporting Year: 2017

Annual Waste Handled:

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Amount (Lbs): 43875.8

Waste code: D002
Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

Amount (Lbs): 248897.2

Waste code: D003
Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.

Amount (Lbs): 175

Waste code: D006
Waste name: CADMIUM
Amount (Lbs): 606

Waste code: D008
Waste name: LEAD
Amount (Lbs): 4528.6

Waste code: F003
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Amount (Lbs): 38187.8

Waste code: F006
Waste name: WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

Amount (Lbs): 1820

Waste code: F007

Waste name: SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS

Amount (Lbs): 34445.4

Waste code: F008

Waste name: PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

Amount (Lbs): 175

Waste code: F009

Waste name: SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS WHERE CYANIDES ARE USED IN THE PROCESS.

Amount (Lbs): 69015.8

Facility Has Received Notices of Violations:

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 01/06/2010
Date achieved compliance: 02/01/2010
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 01/06/2010
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 06/21/2005
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: INITIAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 09/14/2007
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 06/21/2005
Date achieved compliance: 04/28/2009
Violation lead agency: State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Enforcement action: FINAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 12/12/2008
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: 1400000
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Manifest
Date violation determined: 06/21/2005
Date achieved compliance: 04/28/2009
Violation lead agency: State

Enforcement action: INITIAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 09/14/2007
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 06/21/2005
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/28/2005
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Manifest
Date violation determined: 06/21/2005
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: FINAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 12/12/2008
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: 1400000
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 06/21/2005
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Enforcement action date: 06/28/2005
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 06/21/2005
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: FINAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 12/12/2008
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: 1400000
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 06/21/2005
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: INITIAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 09/14/2007
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Manifest
Date violation determined: 06/21/2005
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/28/2005
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 06/21/2005
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: INITIAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 09/14/2007

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 06/21/2005
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: FINAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 12/12/2008
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: 1400000
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 06/21/2005
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/28/2005
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 10/16/2003
Date achieved compliance: 06/25/2004
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 10/17/2003
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 10/16/2003
Date achieved compliance: 06/25/2004
Violation lead agency: State
Enforcement action: FINAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 12/12/2008
Enf. disposition status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: 1400000
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 10/16/2003
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: REFERRAL TO ATTORNEY GENERAL
Enforcement action date: 12/30/2004
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 10/16/2003
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 10/17/2003
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 10/16/2003
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: REFERRAL TO ATTORNEY GENERAL
Enforcement action date: 12/30/2004
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Manifest
Date violation determined: 10/16/2003
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: FINAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 12/12/2008
Enf. disposition status: Not reported
Enf. disp. status date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: 1400000
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 10/16/2003
Date achieved compliance: 06/25/2004
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 10/17/2003
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: LDR - General
Date violation determined: 10/16/2003
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: INITIAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 09/14/2007
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 10/16/2003
Date achieved compliance: 06/25/2004
Violation lead agency: State
Enforcement action: INITIAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 09/14/2007
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Manifest
Date violation determined: 10/16/2003
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: INITIAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 09/14/2007
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 10/16/2003
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: INITIAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 09/14/2007
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 10/16/2003
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: FINAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 12/12/2008
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: 1400000
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Manifest
Date violation determined: 10/16/2003
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: REFERRAL TO ATTORNEY GENERAL
Enforcement action date: 12/30/2004
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 10/16/2003
Date achieved compliance: 06/25/2004
Violation lead agency: State
Enforcement action: REFERRAL TO ATTORNEY GENERAL
Enforcement action date: 12/30/2004
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 10/16/2003
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 10/17/2003
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Manifest
Date violation determined: 10/16/2003
Date achieved compliance: 04/28/2009
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 10/17/2003
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 10/16/2003
Date achieved compliance: 06/25/2004
Violation lead agency: State
Enforcement action: INITIAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 09/14/2007
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 10/16/2003
Date achieved compliance: 06/25/2004
Violation lead agency: State
Enforcement action: FINAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY
Enforcement action date: 12/12/2008
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: 1400000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: LDR - General

Date violation determined: 10/16/2003

Date achieved compliance: 04/28/2009

Violation lead agency: State

Enforcement action: FINAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY

Enforcement action date: 12/12/2008

Enf. disposition status: Not reported

Enf. disp. status date: Not reported

Enforcement lead agency: State

Proposed penalty amount: Not reported

Final penalty amount: 1400000

Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: Generators - Pre-transport

Date violation determined: 10/16/2003

Date achieved compliance: 06/25/2004

Violation lead agency: State

Enforcement action: REFERRAL TO ATTORNEY GENERAL

Enforcement action date: 12/30/2004

Enf. disposition status: Not reported

Enf. disp. status date: Not reported

Enforcement lead agency: State

Proposed penalty amount: Not reported

Final penalty amount: Not reported

Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: Generators - General

Date violation determined: 05/19/2003

Date achieved compliance: 08/04/2003

Violation lead agency: State

Enforcement action: INITIAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY

Enforcement action date: 09/14/2007

Enf. disposition status: Not reported

Enf. disp. status date: Not reported

Enforcement lead agency: State

Proposed penalty amount: Not reported

Final penalty amount: Not reported

Paid penalty amount: Not reported

Regulation violated: Not reported

Area of violation: Generators - General

Date violation determined: 05/19/2003

Date achieved compliance: 08/04/2003

Violation lead agency: State

Enforcement action: FINAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY

Enforcement action date: 12/12/2008

Enf. disposition status: Not reported

Enf. disp. status date: Not reported

Enforcement lead agency: State

Proposed penalty amount: Not reported

Final penalty amount: 1400000

Paid penalty amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Regulation violated: Not reported
Area of violation: Generators - Pre-transport
Date violation determined: 05/19/2003
Date achieved compliance: 07/26/2003
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 05/28/2003
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 05/19/2003
Date achieved compliance: 08/04/2003
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 05/28/2003
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 05/19/2003
Date achieved compliance: 08/04/2003
Violation lead agency: State
Enforcement action: REFERRAL TO ATTORNEY GENERAL
Enforcement action date: 12/30/2004
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 05/25/1994
Date achieved compliance: 05/25/1999
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Area of violation: Generators - General
Date violation determined: 04/28/1993
Date achieved compliance: 05/25/1994
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 10/09/1991
Date achieved compliance: 04/28/1993
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 06/24/1986
Date achieved compliance: 08/15/1986
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 04/27/2015
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 01/06/2010
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 02/01/2010
Evaluation lead agency: State

Evaluation date: 04/28/2009
Evaluation: NOT A SIGNIFICANT NON-COMPLIER
Area of violation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 08/08/2007
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 06/21/2005
Evaluation: FOLLOW-UP INSPECTION
Area of violation: Generators - General
Date achieved compliance: 04/28/2009
Evaluation lead agency: State

Evaluation date: 06/21/2005
Evaluation: FOLLOW-UP INSPECTION
Area of violation: Generators - Pre-transport
Date achieved compliance: 04/28/2009
Evaluation lead agency: State

Evaluation date: 06/21/2005
Evaluation: FOLLOW-UP INSPECTION
Area of violation: LDR - General
Date achieved compliance: 04/28/2009
Evaluation lead agency: State

Evaluation date: 06/21/2005
Evaluation: FOLLOW-UP INSPECTION
Area of violation: Generators - Manifest
Date achieved compliance: 04/28/2009
Evaluation lead agency: State

Evaluation date: 10/16/2003
Evaluation: FOLLOW-UP INSPECTION
Area of violation: LDR - General
Date achieved compliance: 04/28/2009
Evaluation lead agency: State

Evaluation date: 10/16/2003
Evaluation: SIGNIFICANT NON-COMPLIER
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 10/16/2003
Evaluation: FOLLOW-UP INSPECTION
Area of violation: Generators - Pre-transport
Date achieved compliance: 06/25/2004
Evaluation lead agency: State

Evaluation date: 10/16/2003
Evaluation: FOLLOW-UP INSPECTION
Area of violation: Generators - Manifest
Date achieved compliance: 04/28/2009
Evaluation lead agency: State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Evaluation date:	10/16/2003
Evaluation:	FOLLOW-UP INSPECTION
Area of violation:	Generators - General
Date achieved compliance:	04/28/2009
Evaluation lead agency:	State
Evaluation date:	10/16/2003
Evaluation:	FOLLOW-UP INSPECTION
Area of violation:	Generators - General
Date achieved compliance:	06/25/2004
Evaluation lead agency:	State
Evaluation date:	08/04/2003
Evaluation:	NOT A SIGNIFICANT NON-COMPLIER
Area of violation:	Not reported
Date achieved compliance:	Not reported
Evaluation lead agency:	State
Evaluation date:	05/19/2003
Evaluation:	SIGNIFICANT NON-COMPLIER
Area of violation:	Not reported
Date achieved compliance:	Not reported
Evaluation lead agency:	State
Evaluation date:	05/19/2003
Evaluation:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation:	Generators - Pre-transport
Date achieved compliance:	07/26/2003
Evaluation lead agency:	State
Evaluation date:	05/19/2003
Evaluation:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation:	Generators - General
Date achieved compliance:	08/04/2003
Evaluation lead agency:	State
Evaluation date:	05/25/1994
Evaluation:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation:	Generators - General
Date achieved compliance:	05/25/1999
Evaluation lead agency:	State Contractor/Grantee
Evaluation date:	04/28/1993
Evaluation:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation:	Generators - General
Date achieved compliance:	05/25/1994
Evaluation lead agency:	State Contractor/Grantee
Evaluation date:	10/09/1991
Evaluation:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation:	Generators - General
Date achieved compliance:	04/28/1993
Evaluation lead agency:	State Contractor/Grantee
Evaluation date:	06/24/1986
Evaluation:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Date achieved compliance: Not reported
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 06/24/1986
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Generators - General
Date achieved compliance: 08/15/1986
Evaluation lead agency: State Contractor/Grantee

LUST REG 9:

Region: 9
Status: Case Closed
Case Number: 9UT1458
Local Case: H00062-001
Substance: Gasoline
Qty Leaked: Not reported
Abate Method: Excavate and Dispose - remove contaminated soil and dispose in approved site
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Tank
Cause: Structure Failure
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 06/01/1989
Date Stopped: 06/01/1989
Confirm Date: 06/01/1989
Submit Workplan: 6/26/89
Prelim Assess: / /
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 06/26/1989
Enforce Date: Not reported
Closed Date: 1/29/93
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: Not reported
Beneficial Use: Beneficial groundwater use other than Municipal use
NPDES Number: Not reported
Priority: Low priority. Priority ranking can change over time.
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

LUST:

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607300283
Global Id: T0607300283
Latitude: 32.81998
Longitude: -117.141948
Status: Completed - Case Closed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Status Date: 02/15/1993
Case Worker: Not reported
RB Case Number: 9UT1458
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H00062-001
Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:

Global Id: T0607300283
Action Type: Other
Date: 06/01/1989
Action: Leak Reported

Global Id: T0607300283
Action Type: Other
Date: 06/01/1989
Action: Leak Began

Global Id: T0607300283
Action Type: Other
Date: 06/01/1989
Action: Leak Discovery

Global Id: T0607300283
Action Type: ENFORCEMENT
Date: 06/27/1989
Action: Notice of Responsibility

Global Id: T0607300283
Action Type: Other
Date: 06/01/1989
Action: Leak Stopped

LUST:

Global Id: T0607300283
Status: Completed - Case Closed
Status Date: 02/15/1993

Global Id: T0607300283
Status: Open - Case Begin Date
Status Date: 06/01/1989

SAN DIEGO CO. SAM:

Case Number: H00062-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: Soils Only
Facility Status: Closed Case
Date: 2/15/1993
Date Began: 6/1/1989

Case Number: H00062-002
Agency: DEH Site Assessment & Mitigation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Funding: Private - VAP
Facility Type: Drinking Water Aquifer Impacted
Facility Status: Closed Case
Date: 8/20/1993
Date Began: 5/3/1991

CPS-SLIC:
Region: STATE
Facility Status: Completed - Case Closed
Status Date: 08/20/1993
Global Id: T0608123224
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H00062-002
Latitude: 32.820035
Longitude: -117.141931
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Aquifer used for drinking water supply
Potential Contaminants of Concern: Not reported
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

AST:
Certified Unified Program Agencies: San Diego
Owner: KYOCERA AMERICA INC
Total Gallons: 1500
CERSID: Not reported
Facility ID: Not reported
Business Name: Not reported
Phone: Not reported
Fax: Not reported
Mailing Address: Not reported
Mailing Address City: Not reported
Mailing Address State: Not reported
Mailing Address Zip Code: Not reported
Operator Name: Not reported
Operator Phone: Not reported
Owner Phone: Not reported
Owner Mail Address: Not reported
Owner State: Not reported
Owner Zip Code: Not reported
Owner Country: Not reported
Property Owner Name: Not reported
Property Owner Phone: Not reported
Property Owner Mailing Address: Not reported
Property Owner City: Not reported
Property Owner Stat : Not reported
Property Owner Zip Code: Not reported
Property Owner Country: Not reported
EPAID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

HMMD SAN DIEGO:

Permit Number: 212047
Business Type: 6HK35
EPA Id Number: CAR000207639
APN: 369-140-22-00
Last HMMD Inspection: 06/07/2012
Facility Telephone: 858-576-2600
Permit Status: OPEN
Permit Expiration: 11/30/2012
Date Last Updated: 11/02/2012
Facility Owner: KYOCERA SOLAR, INC
Facility Mailing Address: 8611 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 212047
Update Date: 11/02/2012
Case Number: 67-64-1
Name: ACETONE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 212047
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 171 METAL SLUDGE
Other Information: WASTE SOLID W/LEAD
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 212047
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: VACUUM PUMP OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 212047
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: WASTE SOLID WITH FLAMABLE LIQUID
Material Waste: Waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 212047
Update Date: 11/02/2012
Inspection Date: 08/09/2010
Violation Code: 6HV1002
Violation: HMBP NOT ESTABLISHED/IMPLEMENTED.
Violation Citation: Hazardous materials handler has not established/implemented a business plan. HSC 25503.5(a)
Activity: ACTIVE

Permit Number: 212047
Update Date: 11/02/2012
Inspection Date: 06/07/2012
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAD047896097
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 858-576-2600
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 07/07/2018
Facility Owner: Not reported
Facility Mailing Address: 8611 BALBOA AV, SAN DIEGO, CA 92123-1580
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Y
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100062
Program Element: Hazardous Waste Generator
Inspection Type: Site Investigation
Inspection Number: 5481152
Return To Compliance Date: 2016-05-24T00:00:00.000
Nov: Yes
Violation Classification: Class I
Underground Storage Tank Id: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Container/Tank Id: Not reported
Last Update: 2018-10-25T16:04:16.000
Inspection Date: 2016-05-24T09:58:00.000
Violation Code: 3050002 Failed to properly dispose of hazardous waste at an authorized facility. HSC 25189.5(a); 25189(c),(d); 25189.2(c)

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100062
Program Element: Hazardous Waste Treatment
Inspection Type: Routine
Inspection Number: 5125868
Return To Compliance Date: Not reported
Nov: Not reported
Violation Classification: Not reported
Underground Storage Tank Id: Not reported
Container/Tank Id: 00
Last Update: 2018-10-25T16:04:16.000
Inspection Date: 2015-04-27T00:00:00.000
Violation Code: HMD1751 PBR notification not renewed/filed annually (due by January 1). 67450.3(c)(1).

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100062
Program Element: Hazardous Waste Treatment
Inspection Type: Routine
Inspection Number: 5125868
Return To Compliance Date: Not reported
Nov: Not reported
Violation Classification: Not reported
Underground Storage Tank Id: Not reported
Container/Tank Id: 00
Last Update: 2018-10-25T16:04:16.000
Inspection Date: 2015-04-27T00:00:00.000
Violation Code: HMD1746 Financial assurance not obtained, not updated annually or inadequate for sum of closure cost estimates using appropriate mechanism (i.e. trust fund, surety bond, insurance, self-certification) showing each unit's estimated closure costs. 67450.13; 66265.143.

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100062
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5125868
Return To Compliance Date: 2015-05-11T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T16:04:16.000
Inspection Date: 2015-04-27T00:00:00.000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Violation Code: 1010008 Failure to annually review and electronically certify that the business plan is complete, accurate, and up-to-date. For facilities with inventory that exceed EPCRA thresholds; failure to submit inventory reports (Activities, Owner/Operator, Hazardous Materials Descriptions and Map pages HSC 6.95 25508.2 / 19 CCR 4 2729.5(c)

UST DTL:

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100062
Facility Type (Ust Facility): Not reported
Tank Owner Name: KYOCERA INTERNATIONAL INC
Tankid: 15561
Tank Status: Removed
Date Ust Permanently Closed: 01/06/1989
Tank Use: 01
Piping System Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Tank Capacityin Gallons: 1000
Tank Contents: 02
Type Of Tank: 01

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100062
Facility Type (Ust Facility): Not reported
Tank Owner Name: KYOCERA INTERNATIONAL INC
Tankid: 15562
Tank Status: Removed
Date Ust Permanently Closed: 08/05/1991
Tank Use: 04
Piping System Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Tank Capacityin Gallons: 7500
Tank Contents: Not reported
Type Of Tank: 95

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100062
Facility Type (Ust Facility): Not reported
Tank Owner Name: KYOCERA INTERNATIONAL INC
Tankid: 15564
Tank Status: Removed
Date Ust Permanently Closed: 06/24/1997
Tank Use: 04
Piping System Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Tank Capacityin Gallons: 550
Tank Contents: Not reported
Type Of Tank: 95

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Active Permit: Y
Facility Id Number: 37-000-100062
Facility Type (Ust Facility): Not reported
Tank Owner Name: KYOCERA INTERNATIONAL INC
Tankid: 15563
Tank Status: Removed
Date Ust Permanently Closed: 08/05/1991
Tank Use: 04
Piping System Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Tank Capacityin Gallons: 7500
Tank Contents: Not reported
Type Of Tank: 95

Waste and Materials:

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140728
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: NICKEL SULFAMATE 70%, NICKEL BROMATE 7%
Common Name: NICKEL SULFAMATE SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140728
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: NITROGEN 95%, HYDROGEN 5%, COMPRESSED AIR
Common Name: MIXED GAS (NITROGEN 95%, HYDROGEN 5%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140738
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: HYDROGEN
Common Name: HYDROGEN
Case Number: 1333-74-0

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119331
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: Waste AT905
Common Name: Lead Solution

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140704
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: DIETHYLENE GLYCOL 48%, FR 40 XD
Common Name: GLYCOL FR-40 XD
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140705
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: POTASSIUM GOLD CYANIDE 1%, ARSENIC TRIOXIDE 0.1%
Common Name: GOLD STRIKE SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140707
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: MICRO 90 CLEANER
Common Name: MICRO 90 CLEANER
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140708
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: TUNGSTEN POWDER
Common Name: TUNGSTEN POWDER
Case Number: 7440-33-7

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140709
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: SODIUM HYDROXIDE 10%
Common Name: ALKALINE CLEANER (ENPREP 114)
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140710
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: SODIUM CYANIDE
Common Name: SODIUM CYANIDE
Case Number: 143-33-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140711
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: SODIUM HYDROXIDE 15%
Common Name: ALKALINE CLEANER (C-4000, Na OH Bath)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140712
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS:
Common Name: ACETYLENE
Case Number: 74-86-2

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140713
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: NITROGEN 29%, HELIUM 71%, COMPRESSED AIR
Common Name: MIXED GAS (Nitrogen 29%, Helium 71%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140715
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: NITROGEN, LIQUID
Common Name: NITROGEN, LIQUID
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0153615
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T16:04:16.000
Chemical Name:	Waste Flammable wipes with Lead Conductive Paste
Common Name:	Waste IPA wipes with Lead
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0179144
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-25T16:04:16.000
Chemical Name:	CPE-1000 CLEANER
Common Name:	CPE-1000 CLEANER
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0153604
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T16:04:16.000
Chemical Name:	WASTE 211 HALOGENATED SOLVENTS
Common Name:	LENIUM GS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0128310
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-02-01T01:00:02.000
Chemical Name:	DIETHYLENE GLYCOL 48%, FR 40 XD
Common Name:	GLYCOL FR-40 XD
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0128311
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-02-01T01:00:02.000
Chemical Name:	POTASSIUM GOLD CYANIDE 1%, ARSENIC TRIOXIDE 0.1%
Common Name:	GOLD STRIKE SOLUTION
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0128312

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: HELIUM
Common Name: HELIUM
Case Number: 7440-59-7

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128313
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: MICRO 90 CLEANER
Common Name: MICRO 90 CLEANER
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128314
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: TUNGSTEN POWDER
Common Name: TUNGSTEN POWDER
Case Number: 7440-33-7

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128315
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: SODIUM HYDROXIDE 10%
Common Name: ALKALINE CLEANER (ENPREP 114)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128316
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: SODIUM CYANIDE
Common Name: SODIUM CYANIDE
Case Number: 143-33-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128317
Trade Secret: N
Hazardous Material Type: Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Last Updated: 2017-02-01T01:00:02.000
Chemical Name: SODIUM HYDROXIDE 15%
Common Name: ALKALINE CLEANER (C-4000, Na OH Bath)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128318
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS:
Common Name: ACETYLENE
Case Number: 74-86-2

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128319
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: NITROGEN 29%, HELIUM 71%, COMPRESSED AIR
Common Name: MIXED GAS (Nitrogen 29%, Helium 71%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128320
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: NITRIC ACID 30-40%, SULFAMIC ACID 1-5%
Common Name: PC-1125
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128321
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: NITROGEN, LIQUID
Common Name: NITROGEN, LIQUID
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128322
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: HELIUM 71%, NITROGEN 16%, CO2 8%, CO 4%

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Common Name: MIXED GAS (HELIUM 71%, NITROGEN 16%, CO2 8%, CO 4%, HYDROGEN 1%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128323
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: D-LIMONENE, 98%
Common Name: ZEP BIG ORANGE
Case Number: 5989-27-5

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128324
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: DIOCTYL PHTHALATE
Common Name: DIOCTYL PHTHALATE
Case Number: 117-81-7

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128325
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: AMMONIUM CHLORIDE 10%
Common Name: ENPLATE PC-455
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128326
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: ETHYLENE GLYCOL, 99%
Common Name: ETHYLENE GLYCOL, 99%
Case Number: 107-21-1

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128327
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: HYDROCHLORIC ACID, (38-40% CONC)
Common Name: HYDROCHLORIC ACID, (38-40% CONC)
Case Number: 7647-01-0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128328
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: NICKEL POTASSIUM CYANIDE, 20%
Common Name: LIQUID NICKEL, SOL-V-SALT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128329
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: POTASSIUM CYANIDE 70%
Common Name: ACR 9025 GOLD STRIPPER
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128330
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: BUTYL ACETATE, 99%
Common Name: n-BUTYL ACETATE, 99%
Case Number: 123-86-4

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128331
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Common Name: PROPANE, LIQUID
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128332
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: NITRIC ACID 46%, SODIUM NITRATE 2%
Common Name: NICKEL STRIPPING SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128333
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: 2-BUTOXYETHOXY ETHYL ACETATE
Common Name: 2-BUTOXYETHOXY ETHYL ACETATE
Case Number: 124-17-4

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128334
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: NICKEL SULFAMATE 70%, NICKEL BROMATE 7%
Common Name: NICKEL SULFAMATE SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128335
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: NITROGEN 95%, HYDROGEN 5%, COMPRESSED AIR
Common Name: MIXED GAS (NITROGEN 95%, HYDROGEN 5%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128336
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: POTASSIUM FERRICYANIDE 5%, POTASSIUM HYDROXIDE 5%
Common Name: POTASSIUM FERRICYANIDE SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128337
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: SODIUM HYPOCHLORITE
Common Name: SODIUM HYPOCHLORITE
Case Number: 7681-52-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128338

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: SODIUM CYANIDE SOLUTION 10%
Common Name: SODIUM CYANIDE SOLUTION
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128339
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: NITRIC ACID
Common Name: NITRIC ACID (67-68%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128340
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: SODIUM HYDROXIDE, LIQUID 50%
Common Name: CAUSTIC SODA
Case Number: 1310-73-2

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128341
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: ARGON LIQUID
Common Name: ARGON LIQUID
Case Number: 7440-37-1

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128342
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: POTASSIUM CYANIDE
Common Name: POTASSIUM CYANIDE
Case Number: 151-50-8

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128343
Trade Secret: N
Hazardous Material Type: Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Last Updated: 2017-02-01T01:00:02.000
Chemical Name: SODIUM BROMIDE 3-10%: THRU NIC C-50
Common Name: THRU NI C-50
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128344
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: HYDROGEN
Common Name: HYDROGEN
Case Number: 1333-74-0

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128345
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: NICKEL CHLORIDE, 49%
Common Name: NICKEL CHLORIDE SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128346
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: CARBON DIOXIDE
Common Name: CARBON DIOXIDE
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128347
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: AMMONIUM HYDROGEN FLUORIDE 9%, HCl 38%
Common Name: AMMONIUM HYDROGEN FLUORIDE (9%, HCl 38%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128348
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: POTASSIUM GOLD CYANIDE 1%

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Common Name: GOLD PLATING SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128349
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: CPE-1000 CLEANER
Common Name: CPE-1000 CLEANER
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128350
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: ISOPROPYL ALCOHOL OR 2-PROPANOL (CH₃)₂CHOH,99%
Common Name: Isopropyl Alcohol
Case Number: 67-63-0

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128351
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: DIESEL FUEL
Common Name: DIESEL FUEL
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128352
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: OAKITE 61B SOLUTION
Common Name: ALKALINE CLEANER (OAKITE 61B SOLUTION)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128353
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: NICKEL POTASSIUM CYANIDE 1%, POTASSIUM CYANIDE 5%
Common Name: POTASSIUM NICKEL CYANIDE SOLUTION
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128354
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: SODIUM HYDROXIDE 70%
Common Name: ENPREP 114E
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128355
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: HYDROGEN, H2, 99% LIQUID GAS, (2300LBS)
Common Name: HYDROGEN, LIQUID
Case Number: 1333-74-0

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128356
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: COPPER SULFATE, SOLUTION
Common Name: COPPER SULFATE, SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128357
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: OXYGEN, O2: COMPRESSED GAS
Common Name: OXYGEN, O2: COMPRESSED GAS
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128358
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: AMMONIUM CITRATE DIBASIC 1.6%, KCI 13.5%
Common Name: ACTIVATOR AT-905
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128359
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: Nickel Sulfamate
Common Name: Nickel Sulfamate
Case Number: 13770-89-3

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128360
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: DIBUTYL PHTHALATE
Common Name: DIBUTYL PHTHALATE
Case Number: 84-74-2

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128361
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: ARGON, AR; COMPRESSED GAS
Common Name: ARGON, COMPRESSED GAS
Case Number: 7440-37-1

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128362
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: POTASSIUM CYANIDE 1-6%
Common Name: POTASSIUM CYANIDE SOLUTIONS (6%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128363
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: METHANE10%, ARGON 90%
Common Name: Mixed Gas, P-10
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128364

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: N-PROPYL BROMIDE 95%
Common Name: LENIUM GS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128365
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: Enstrip Au-78
Common Name: Enstrip Au-78
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128366
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: Nickel Chloride
Common Name: Nickel Solution
Case Number: 7718-54-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128367
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: Enstrip Au-78
Common Name: Enstrip Au-78
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128368
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: CERAMIC TAPE (w/ LEAD)
Common Name: CERAMIC TAPE (w/ LEAD)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128369
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Last Updated: 2017-02-01T01:00:02.000
Chemical Name: NATURAL GAS ENGINE OIL- SAE 40
Common Name: LUBRICATING MOTOR OIL
Case Number: 8042-47-5

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128370
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: PWM 5935M
Common Name: PWM 5935M
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128371
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: Not reported
Common Name: ISOCIL RW 1.5
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128372
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: SULFURIC ACID, 93%
Common Name: SULFURIC ACID, 93%
Case Number: 7664-93-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128373
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: Not reported
Common Name: Bromax
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128374
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Common Name: Katon WT 1.5%
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128375
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: Diesel Fuel No. 2
Common Name: Diesel Fuel No. 2
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0128376
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-02-01T01:00:02.000
Chemical Name: Urea 32.5%
Common Name: Urea
Case Number: 57-13-6

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107051
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)*
Common Name: TUNGSTON PASTE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107052
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION
Common Name: RINSE WATER CONTAINING CYANIDE COMPOUNDS, TREATMENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107053
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE 711 LIQUIDS W CYANIDES - R
Common Name: POTASSIUM CYANIDE SOLUTIONS
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107054
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE 132 AQUEOUS SOL'N WITH METALS
Common Name: NICKEL SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107055
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE 791 LIQUIDS WITH PH <OR= 2
Common Name: LIQUIDS W/ PH =<2 W/ METALS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107056
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE 133 AQUEOUS SOL'N W/ 10% ORG RESID
Common Name: ETHYLENE GLYCOL
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107057
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE 711 LIQUIDS W CYANIDES - R
Common Name: POTASSIUM FERRICYANIDE SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107058
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE 711 LIQUIDS W CYANIDES - R*
Common Name: SODIUM CYANIDE SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0107059
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-02-01T01:00:18.000
Chemical Name:	WASTE 122 ALKALINE SOL'N W/OUT METALS
Common Name:	ALKALINE CLEANER (C-4000)
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0107060
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-02-01T01:00:18.000
Chemical Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER)*
Common Name:	CERAMIC TAPE (w/ LEAD)
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0107061
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-02-01T01:00:18.000
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL
Common Name:	Waste Oil & Mixed Oil (FURNACE/COMPRSR/VACUUM)
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0107062
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-02-01T01:00:18.000
Chemical Name:	WASTE 132 AQUEOUS SOL'N WITH METALS*
Common Name:	RINSE WATER CONTAINING NICKEL COMPOUNTS, TREATMENT
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0107063
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-02-01T01:00:18.000
Chemical Name:	WASTE 211 HALOGENATED SOLVENTS
Common Name:	LENIUM GS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0107064

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE 132 AQUEOUS SOL'N WITH METALS*
Common Name: NICKEL SULFAMATE SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107065
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE 132 AQUEOUS SOL'N WITH METALS*
Common Name: NICKEL STRIPPING SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107066
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE 214 OXYGENATED SOLVENTS (IPA 95%, BUTYL ACETATE 2.5%, ACETONE 2.5%)
Common Name: Flammable Liquids, Mixed
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107067
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Common Name: FILTERS W/ NICKEL SOLIDS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107068
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: WASTE Nickel Hydroxide Filter Cake
Common Name: Nickel Hydroxide Filter Cake
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107069
Trade Secret: N
Hazardous Material Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Last Updated: 2017-02-01T01:00:18.000
Chemical Name: Nickel Chloride Solutions
Common Name: Nickel Chloride Solutions
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107070
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: Waste Enprep 114
Common Name: Waste Enprep 114
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107071
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: Waste HYDROCHLORIC ACID SOLUTION (12-13%)
Common Name: Waste HYDROCHLORIC ACID SOLUTION (12-13%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107072
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: Waste Enstrip Au-78
Common Name: Waste Enstrip Au-78
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107073
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: Waste AT905
Common Name: Lead Solution
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107074
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: Waste Flammable wipes with Lead Conductive Paste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Common Name: Waste IPA wipes with Lead
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107075
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: Waste Butyl Acetate Ink with Tungsten
Common Name: Waste Butyl Acetate Ink with Tungsten
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107076
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: Used Oily Debris
Common Name: Used Oily Debris
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107077
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: ISOPROPYL ALCOHOL WASTE
Common Name: Waste IPA
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107078
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: Used Oil
Common Name: Used OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107079
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-02-01T01:00:18.000
Chemical Name: Oily Solids
Common Name: Waste Oily Solids
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140716
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: HELIUM 71%, NITROGEN 16%, CO2 8%, CO 4%
Common Name: MIXED GAS (HELIUM 71%, NITROGEN 16%, CO2 8%, CO 4%, HYDROGEN 1%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140720
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: ETHYLENE GLYCOL, 99%
Common Name: ETHYLENE GLYCOL, 99%
Case Number: 107-21-1

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140722
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: NICKEL POTASSIUM CYANIDE, 20%
Common Name: LIQUID NICKEL, SOL-V-SALT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140723
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: POTASSIUM CYANIDE 70%
Common Name: ACR 9025 GOLD STRIPPER
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140724
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: BUTYL ACETATE, 99%
Common Name: n-BUTYL ACETATE, 99%
Case Number: 123-86-4

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140725
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Common Name: PROPANE, LIQUID
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140726
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: NITRIC ACID 46%, SODIUM NITRATE 2%
Common Name: NICKEL STRIPPING SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140727
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: 2-BUTOXYETHOXY ETHYL ACETATE
Common Name: 2-BUTOXYETHOXY ETHYL ACETATE
Case Number: 124-17-4

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140730
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: POTASSIUM FERRICYANIDE 5%, POTASSIUM HYDROXIDE 5%
Common Name: POTASSIUM FERRICYANIDE SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140731
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: SODIUM HYPOCHLORITE
Common Name: SODIUM HYPOCHLORITE
Case Number: 7681-52-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140732

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: SODIUM CYANIDE SOLUTION 10%
Common Name: SODIUM CYANIDE SOLUTION
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140734
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: SODIUM HYDROXIDE, LIQUID 50%
Common Name: CAUSTIC SODA
Case Number: 1310-73-2

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140735
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: ARGON LIQUID
Common Name: ARGON LIQUID
Case Number: 7440-37-1

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140736
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: POTASSIUM CYANIDE
Common Name: POTASSIUM CYANIDE
Case Number: 151-50-8

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140737
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: SODIUM BROMIDE 3-10%: THRU NIC C-50
Common Name: THRU NI C-50
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140739
Trade Secret: N
Hazardous Material Type: Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Last Updated: 2018-01-31T00:35:56.000
Chemical Name: NICKEL CHLORIDE, 49%
Common Name: NICKEL CHLORIDE SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140740
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: CARBON DIOXIDE
Common Name: CARBON DIOXIDE
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140741
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: AMMONIUM HYDROGEN FLUORIDE 9%, HCl 38%
Common Name: AMMONIUM HYDROGEN FLUORIDE (9%, HCl 38%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140742
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: POTASSIUM GOLD CYANIDE 1%
Common Name: GOLD PLATING SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140743
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: CPE-1000 CLEANER
Common Name: CPE-1000 CLEANER
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140744
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: ISOPROPYL ALCOHOL OR 2-PROPANOL (CH₃)₂CHOH,99%

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Common Name:	Isopropyl Alcohol
Case Number:	67-63-0
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0140745
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-01-31T00:35:56.000
Chemical Name:	DIESEL FUEL
Common Name:	DIESEL FUEL
Case Number:	68476-34-6
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0140746
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-01-31T00:35:56.000
Chemical Name:	OAKITE 61B SOLUTION
Common Name:	ALKALINE CLEANER (OAKITE 61B SOLUTION)
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0140747
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-01-31T00:35:56.000
Chemical Name:	NICKEL POTASSIUM CYANIDE 1%, POTASSIUM CYANIDE 5%
Common Name:	POTASSIUM NICKEL CYANIDE SOLUTION
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0140748
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-01-31T00:35:56.000
Chemical Name:	SODIUM HYDROXIDE 70%
Common Name:	ENPREP 114E
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0140749
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-01-31T00:35:56.000
Chemical Name:	HYDROGEN, H2, 99% LIQUID GAS, (2300LBS)
Common Name:	HYDROGEN, LIQUID
Case Number:	1333-74-0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140750
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: COPPER SULFATE, SOLUTION
Common Name: COPPER SULFATE, SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140751
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: OXYGEN, 02: COMPRESSED GAS
Common Name: OXYGEN, 02: COMPRESSED GAS
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140752
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: AMMONIUM CITRATE DIBASIC 1.6%, KCI 13.5%
Common Name: ACTIVATOR AT-905
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140753
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: Nickel Sulfamate
Common Name: Nickel Sulfamate
Case Number: 13770-89-3

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140754
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: DIBUTYL PHTHALATE
Common Name: DIBUTYL PHTHALATE
Case Number: 84-74-2

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140755
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: ARGON, AR; COMPRESSED GAS
Common Name: ARGON, COMPRESSED GAS
Case Number: 7440-37-1

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140756
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: POTASSIUM CYANIDE 1-6%
Common Name: POTASSIUM CYANIDE SOLUTIONS (6%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140757
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: METHANE10%, ARGON 90%
Common Name: Mixed Gas, P-10
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140758
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: N-PROPYL BROMIDE 95%
Common Name: LENIUM GS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140759
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: Enstrip Au-78
Common Name: Enstrip Au-78
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140760

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: Nickel Chloride
Common Name: Nickel Solution
Case Number: 7718-54-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140761
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: Enstrip Au-78
Common Name: Enstrip Au-78
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140762
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: CERAMIC TAPE (w/ LEAD)
Common Name: CERAMIC TAPE (w/ LEAD)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140763
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: NATURAL GAS ENGINE OIL- SAE 40
Common Name: LUBRICATING MOTOR OIL
Case Number: 8042-47-5

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140765
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: Not reported
Common Name: ISOCIL RW 1.5
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140766
Trade Secret: N
Hazardous Material Type: Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Last Updated: 2018-01-31T00:35:56.000
Chemical Name: SULFURIC ACID, 93%
Common Name: SULFURIC ACID, 93%
Case Number: 7664-93-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140767
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: Not reported
Common Name: Bromax
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140768
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: Not reported
Common Name: Katon WT 1.5%
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140769
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: Diesel Fuel No. 2
Common Name: Diesel Fuel No. 2
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140770
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: Urea 32.5%
Common Name: Urea
Case Number: 57-13-6

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119309
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)*

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Common Name: TUNGSTON PASTE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119310
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION
Common Name: RINSE WATER CONTAINING CYANIDE COMPOUNDS, TREATMENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119311
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 711 LIQUIDS W CYANIDES - R
Common Name: POTASSIUM CYANIDE SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119312
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 132 AQUEOUS SOL'N WITH METALS
Common Name: NICKEL SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119313
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 791 LIQUIDS WITH PH <OR= 2
Common Name: LIQUIDS W/ PH =<2 W/ METALS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119314
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 133 AQUEOUS SOL'N W/ 10% ORG RESID
Common Name: ETHYLENE GLYCOL
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119315
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 711 LIQUIDS W CYANIDES - R
Common Name: POTASSIUM FERRICYANIDE SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119316
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 711 LIQUIDS W CYANIDES - R*
Common Name: SODIUM CYANIDE SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119317
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 122 ALKALINE SOL'N W/OUT METALS
Common Name: ALKALINE CLEANER (C-4000)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119318
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)*
Common Name: CERAMIC TAPE (w/ LEAD)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119319
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: Waste Oil & Mixed Oil (FURNACE/COMPRSR/VACUUM)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Active Permit: Y
Child Record Id: DEH2017-HWAST-0119320
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 132 AQUEOUS SOL'N WITH METALS*
Common Name: RINSE WATER CONTAINING NICKEL COMPOUNTS, TREATMENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119321
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 211 HALOGENATED SOLVENTS
Common Name: LENIUM GS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119322
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 132 AQUEOUS SOL'N WITH METALS*
Common Name: NICKEL SULFAMATE SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119323
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 132 AQUEOUS SOL'N WITH METALS*
Common Name: NICKEL STRIPPING SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119324
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 214 OXYGENATED SOLVENTS (IPA 95%, BUTYL ACETATE 2.5%, ACETONE 2.5%)
Common Name: Flammable Liquids, Mixed
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119325

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Common Name: FILTERS W/ NICKEL SOLIDS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119326
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: WASTE Nickel Hydroxide Filter Cake
Common Name: Nickel Hydroxide Filter Cake
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119327
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: Nickel Chloride Solutions
Common Name: Nickel Chloride Solutions
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119328
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: Waste Enprep 114
Common Name: Waste Enprep 114
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119329
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: Waste HYDROCHLORIC ACID SOLUTION (12-13%)
Common Name: Waste HYDROCHLORIC ACID SOLUTION (12-13%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119330
Trade Secret: N
Hazardous Material Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Last Updated: 2018-01-31T00:35:59.000
Chemical Name: Waste Enstrip Au-78
Common Name: Waste Enstrip Au-78
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119332
Trade Secret: N

Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: Waste Flammable wipes with Lead Conductive Paste
Common Name: Waste IPA wipes with Lead
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119333
Trade Secret: N

Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: Waste Butyl Acetate Ink with Tungsten
Common Name: Waste Butyl Acetate Ink with Tungsten
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119334
Trade Secret: N

Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: Used Oily Debris
Common Name: Used Oily Debris
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119335
Trade Secret: N

Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: ISOPROPYL ALCOHOL WASTE
Common Name: Waste IPA
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119337
Trade Secret: N

Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: Oily Solids

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Common Name: Waste Oily Solids
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140714
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: NITRIC ACID 30-40%, SULFAMIC ACID 1-5%
Common Name: PC-1125
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140717
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: D-LIMONENE, 98%
Common Name: ZEP BIG ORANGE
Case Number: 5989-27-5

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140718
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: DIOCTYL PHTHALATE
Common Name: DIOCTYL PHTHALATE
Case Number: 117-81-7

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140719
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: AMMONIUM CHLORIDE 10%
Common Name: ENPLATE PC-455
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179107
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: DIETHYLENE GLYCOL 48%, FR 40 XD
Common Name: GLYCOL FR-40 XD
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179108
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: POTASSIUM GOLD CYANIDE 1%, ARSENIC TRIOXIDE 0.1%
Common Name: GOLD STRIKE SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179109
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: HELIUM
Common Name: HELIUM
Case Number: 7440-59-7

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179110
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: MICRO 90 CLEANER
Common Name: MICRO 90 CLEANER
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179111
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: TUNGSTEN POWDER
Common Name: TUNGSTEN POWDER
Case Number: 7440-33-7

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179112
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: SODIUM CYANIDE
Common Name: SODIUM CYANIDE
Case Number: 143-33-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179113
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: SODIUM HYDROXIDE 15%
Common Name: ALKALINE CLEANER (C-4000, Na OH Bath)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179114
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: NITROGEN 29%, HELIUM 71%, COMPRESSED AIR
Common Name: MIXED GAS (Nitrogen 29%, Helium 71%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179115
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: NITRIC ACID 30-40%, SULFAMIC ACID 1-5%
Common Name: PC-1125
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179116
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: NITROGEN, LIQUID
Common Name: NITROGEN, LIQUID
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179117
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: HELIUM 71%, NITROGEN 16%, CO2 8%, CO 4%
Common Name: MIXED GAS (HELIUM 71%, NITROGEN 16%, CO2 8%, CO 4%, HYDROGEN 1%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179119

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-10-25T16:04:16.000
Chemical Name:	DIOCTYL PHTHALATE
Common Name:	DIOCTYL PHTHALATE
Case Number:	117-81-7
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0179121
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-10-25T16:04:16.000
Chemical Name:	ETHYLENE GLYCOL, 99%
Common Name:	ETHYLENE GLYCOL, 99%
Case Number:	107-21-1
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0179122
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-10-25T16:04:16.000
Chemical Name:	HYDROCHLORIC ACID, (38-40% CONC)
Common Name:	HYDROCHLORIC ACID, (38-40% CONC)
Case Number:	7647-01-0
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0179123
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-25T16:04:16.000
Chemical Name:	NICKEL POTASSIUM CYANIDE, 20%
Common Name:	LIQUID NICKEL, SOL-V-SALT
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0179124
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-25T16:04:16.000
Chemical Name:	POTASSIUM CYANIDE 70%
Common Name:	ACR 9025 GOLD STRIPPER
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100062
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0179125
Trade Secret:	N
Hazardous Material Type:	Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Last Updated: 2018-10-25T16:04:16.000
Chemical Name: BUTYL ACETATE, 99%
Common Name: n-BUTYL ACETATE, 99%
Case Number: 123-86-4

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179126
Trade Secret: N

Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Common Name: PROPANE, LIQUID
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179127
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: NITRIC ACID 46%, SODIUM NITRATE 2%
Common Name: NICKEL STRIPPING SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179128
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: 2-BUTOXYETHOXY ETHYL ACETATE
Common Name: 2-BUTOXYETHOXY ETHYL ACETATE
Case Number: 124-17-4

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179129
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: NICKEL SULFAMATE 70%, NICKEL BROMATE 7%
Common Name: NICKEL SULFAMATE SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179130
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: NITROGEN 95%, HYDROGEN 5%, COMPRESSED AIR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Common Name: MIXED GAS (NITROGEN 95%, HYDROGEN 5%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179133
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: SODIUM CYANIDE SOLUTION 10%
Common Name: SODIUM CYANIDE SOLUTION
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179134
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: NITRIC ACID
Common Name: NITRIC ACID (67-68%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179135
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: SODIUM HYDROXIDE, LIQUID 50%
Common Name: CAUSTIC SODA
Case Number: 1310-73-2

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179136
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: ARGON LIQUID
Common Name: ARGON LIQUID
Case Number: 7440-37-1

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179137
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: POTASSIUM CYANIDE
Common Name: POTASSIUM CYANIDE
Case Number: 151-50-8

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179138
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: SODIUM BROMIDE 3-10% THRU NIC C-50
Common Name: THRU NI C-50
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179139
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: HYDROGEN
Common Name: HYDROGEN
Case Number: 1333-74-0

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179140
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: NICKEL CHLORIDE, 49%
Common Name: NICKEL CHLORIDE SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179141
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: CARBON DIOXIDE
Common Name: CARBON DIOXIDE
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179142
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: AMMONIUM HYDROGEN FLUORIDE 9%, HCl 38%
Common Name: AMMONIUM HYDROGEN FLUORIDE (9%, HCl 38%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179145
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: ISOPROPYL ALCOHOL OR 2-PROPANOL (CH₃)₂CHOH,99%
Common Name: Isopropyl Alcohol
Case Number: 67-63-0

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179150
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: HYDROGEN, H₂, 99% LIQUID GAS, (2300LBS)
Common Name: HYDROGEN, LIQUID
Case Number: 1333-74-0

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179151
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: COPPER SULFATE, SOLUTION
Common Name: COPPER SULFATE, SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179152
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: OXYGEN, O₂: COMPRESSED GAS
Common Name: OXYGEN, O₂: COMPRESSED GAS
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179153
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: AMMONIUM CITRATE DIBASIC 1.6%, KCI 13.5%
Common Name: ACTIVATOR AT-905
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179154

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Nickel Sulfamate
Common Name: Nickel Sulfamate
Case Number: 13770-89-3

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179155
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: DIBUTYL PHTHALATE
Common Name: DIBUTYL PHTHALATE
Case Number: 84-74-2

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179156
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: ARGON, AR; COMPRESSED GAS
Common Name: ARGON, COMPRESSED GAS
Case Number: 7440-37-1

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179157
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: POTASSIUM CYANIDE 1-6%
Common Name: POTASSIUM CYANIDE SOLUTIONS (6%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179158
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: METHANE10%, ARGON 90%
Common Name: Mixed Gas, P-10
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179159
Trade Secret: N
Hazardous Material Type: Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Last Updated: 2018-10-25T16:04:16.000
Chemical Name: N-PROPYL BROMIDE 95%
Common Name: LENIUM GS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179160
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Enstrip Au-78
Common Name: Enstrip Au-78
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179161
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Nickel Chloride
Common Name: Nickel Solution
Case Number: 7718-54-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179162
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: CERAMIC TAPE (w/ LEAD)
Common Name: CERAMIC TAPE (w/ LEAD)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179163
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: NATURAL GAS ENGINE OIL- SAE 40
Common Name: LUBRICATING MOTOR OIL
Case Number: 8042-47-5

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179164
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: PWM 5935M

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Common Name: PWM 5935M
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179165
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Diesel Fuel No. 2
Common Name: Diesel Fuel No. 2
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179166
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Urea 32.5%
Common Name: Urea
Case Number: 57-13-6

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153592
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)*
Common Name: TUNGSTON PASTE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153593
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION
Common Name: RINSE WATER CONTAINING CYANIDE COMPOUNDS, TREATMENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153594
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 711 LIQUIDS W CYANIDES - R
Common Name: POTASSIUM CYANIDE SOLUTIONS
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153595
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 132 AQUEOUS SOL'N WITH METALS
Common Name: NICKEL SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153596
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 791 LIQUIDS WITH PH <OR= 2
Common Name: LIQUIDS W/ PH =<2 W/ METALS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153597
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 133 AQUEOUS SOL'N W/ 10% ORG RESID
Common Name: ETHYLENE GLYCOL
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153598
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 711 LIQUIDS W CYANIDES - R
Common Name: POTASSIUM FERRICYANIDE SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153599
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 711 LIQUIDS W CYANIDES - R*
Common Name: SODIUM CYANIDE SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Active Permit: Y
Child Record Id: DEH2018-HWAST-0153600
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 122 ALKALINE SOL'N W/OUT METALS
Common Name: ALKALINE CLEANER (C-4000)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153601
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)*
Common Name: CERAMIC TAPE (w/ LEAD)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153602
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: Waste Oil & Mixed Oil (FURNACE/COMPRSR/VACUUM)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153603
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 132 AQUEOUS SOL'N WITH METALS*
Common Name: RINSE WATER CONTAINING NICKEL COMPOUNDS, TREATMENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153605
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 132 AQUEOUS SOL'N WITH METALS*
Common Name: NICKEL SULFAMATE SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153606

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 132 AQUEOUS SOL'N WITH METALS*
Common Name: NICKEL STRIPPING SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153607
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 214 OXYGENATED SOLVENTS (IPA 95%, BUTYL ACETATE 2.5%, ACETONE 2.5%)
Common Name: Flammable Liquids, Mixed
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153608
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Common Name: FILTERS W/ NICKEL SOLIDS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153609
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: WASTE Nickel Hydroxide Filter Cake
Common Name: Nickel Hydroxide Filter Cake
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153610
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Nickel Chloride Solutions
Common Name: Nickel Chloride Solutions
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153611
Trade Secret: N
Hazardous Material Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Waste Enprep 114
Common Name: Waste Enprep 114
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153612
Trade Secret: N

Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Waste HYDROCHLORIC ACID SOLUTION (12-13%)
Common Name: Waste HYDROCHLORIC ACID SOLUTION (12-13%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153613
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Waste Enstrip Au-78
Common Name: Waste Enstrip Au-78
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153614
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Waste AT905
Common Name: Lead Solution
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153616
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Waste Butyl Acetate Ink with Tungsten
Common Name: Waste Butyl Acetate Ink with Tungsten
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153617
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Used Oily Debris

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Common Name: Used Oily Debris
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153618
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: ISOPROPYL ALCOHOL WASTE
Common Name: Waste IPA
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153619
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Used Oil
Common Name: Used OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0153620
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: Oily Solids
Common Name: Waste Oily Solids
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179118
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: D-LIMONENE, 98%
Common Name: ZEP BIG ORANGE
Case Number: 5989-27-5

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179120
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: AMMONIUM CHLORIDE 10%
Common Name: ENPLATE PC-455
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179131
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: POTASSIUM FERRICYANIDE 5%, POTASSIUM HYDROXIDE 5%
Common Name: POTASSIUM FERRICYANIDE SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179132
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: SODIUM HYPOCHLORITE
Common Name: SODIUM HYPOCHLORITE
Case Number: 7681-52-9

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179143
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: POTASSIUM GOLD CYANIDE 1%
Common Name: GOLD PLATING SOLUTIONS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179146
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: DIESEL FUEL
Common Name: DIESEL FUEL
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179147
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: OAKITE 61B SOLUTION
Common Name: ALKALINE CLEANER (OAKITE 61B SOLUTION)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179148
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: NICKEL POTASSIUM CYANIDE 1%, POTASSIUM CYANIDE 5%
Common Name: POTASSIUM NICKEL CYANIDE SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0179149
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-25T16:04:16.000
Chemical Name: SODIUM HYDROXIDE 70%
Common Name: ENPREP 114E
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140721
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: HYDROCHLORIC ACID, (38-40% CONC)
Common Name: HYDROCHLORIC ACID, (38-40% CONC)
Case Number: 7647-01-0

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0119336
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-01-31T00:35:59.000
Chemical Name: Used Oil
Common Name: Used OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140706
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: HELIUM
Common Name: HELIUM
Case Number: 7440-59-7

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140733

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: NITRIC ACID
Common Name: NITRIC ACID (67-68%)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100062
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0140764
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-01-31T00:35:56.000
Chemical Name: PWM 5935M
Common Name: PWM 5935M
Case Number: Not reported

Permit Number: 134447
Business Type: 6HK52
EPA Id Number: CAD047896097
APN: 369-140-17-00
Last HMMD Inspection: 05/10/2011
Facility Telephone: 858-576-6839
Permit Status: OPEN
Permit Expiration: 10/31/2013
Date Last Updated: 11/02/2012
Facility Owner: KYOCERA AMERICA INC
Facility Mailing Address: 8611 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: N
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: 12% SODIUM HYPOCHLORITE
Other Information: WATER TREATMENT CHEMICALS
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: REACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING: MOTOR OIL
Other Information: NATURAL GAS ENGINE OIL- SAE 40
Material Waste: Material
Hazardous Categories 1: FIRE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 2: Not reported

Permit Number: 134447
Update Date: 11/02/2012
Case Number: 7664-93-9
Name: SULFURIC ACID, 93%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: TRIDENT 6137 COOLING TREATMENT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: NATURAL GAS ENGINE OIL- SAE 40
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: OILY RAGS / FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 06/30/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)

Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 11/23/2004
Violation Code: 6HV0131
Violation: UPF Permit NOT OBTAINED for HAZWASTE
Violation Citation: A Unified Program Facility permit has not been obtained for the generation of hazardous waste. 68.905
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 11/23/2004
Violation Code: 6HV1001
Violation: NO UPF PERMIT FOR HAZMATS
Violation Citation: A Unified Program Facility permit has not been obtained for hazardous materials. 68.905
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 05/18/2006
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 05/18/2006
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 100062
Business Type: 6HK36
EPA Id Number: CAD047896097
APN: 369-140-17-00
Last HMMD Inspection: 06/08/2012
Facility Telephone: 858-576-2707
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: KYOCERA AMERICA INC
Facility Mailing Address: 8611 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1580
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 124-17-4
Name: 2-BUTOXYETHOXY ETHYL ACETATE
Other Information: Not reported
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 67-64-1
Name: ACETONE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 74-86-2
Name: ACETYLENE, C₂H₂, 99%, COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 8052-41-3
Name: ALIPHATIC HYDROCARBONS, 100%: STODDARD SOLVENT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: AMMONIUM CHLORIDE 10%
Other Information: ENPLATE PC-455
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: AMMONIUM CITRATE DIBASIC 1.6%, KCI 13.5%
Other Information: ACTIVATOR AT-905
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: AMMONIUM HYDROGEN FLUORIDE 9%, HCI 38%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 1336-21-6
Name: AMMONIUM HYDROXIDE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: AMMONIUM HYDROXIDE 1%
Other Information: PALLADIUM SOLUTION
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7440-37-1
Name: ARGON LIQUID
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: CRYOGENIC

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7440-37-1
Name: ARGON, AR; COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 123-86-4
Name: BUTYL ACETATE, 99%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 124-38-9
Name: CARBON DIOXIDE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Material Waste: Not reported
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 132259-10-0
Name: COMPRESSED AIR, BREATHING GRADE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 132259-10-0
Name: COMPRESSED AIR, INDUSTRIAL GRADE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7758-99-8
Name: COPPER SULFATE, SOLUTION
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: CPE-1000 CLEANER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 84-74-2
Name: DIBUTYL PHTHALATE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL
Other Information: Not reported
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	DIETHYLENE GLYCOL 48%, FR 40 XD
Other Information:	GLYCOL FR-40 XD
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	111-46-6
Name:	DIETHYLENE GLYCOL: HYDRAULIC FLUID
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	117-81-7
Name:	DIOCTYL PHTHALATE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	5989-27-5
Name:	D-LIMONENE, 98%
Other Information:	ZEP BIG ORANGE
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	107-21-1
Name:	ETHYLENE GLYCOL, 99%
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7440-59-7
Name:	HELIUM
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: HELIUM 71%, NITROGEN 16%, CO2 8%, CO 4%
Other Information: MIXED GAS
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7647-01-0
Name: HYDROCHLORIC ACID 10-50% IN WATER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7647-01-0
Name: HYDROCHLORIC ACID SOLUTION (12-13%)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7647-01-0
Name: HYDROCHLORIC ACID, (38-40% CONC)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 1333-74-0
Name: HYDROGEN
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 1333-74-0
Name: HYDROGEN, H2, 99% LIQUID GAS, (2300LBS)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 67-63-0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Name: ISOPROPYL ALCOHOL OR 2-PROPANOL (CH₃)₂CHOH,99%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: MIXTURE
Name: METHANE10%, ARGON 90%
Other Information: P10
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: MICRO 90 CLEANER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: MIXTURE
Name: NICKEL CHLORIDE - 21-48% IN H₂O
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: MIXTURE
Name: NICKEL CHLORIDE, 37% HYDROCHLORIC
Other Information: ACID, 15% BALANCE WATER NICKEL BATH
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: NICKEL CHLORIDE, 49%
Other Information: NICKEL CHLORIDE SOLUTION
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: NICKEL POTASSIUM CYANIDE 1%, POTASSIUM CYANIDE 5%
Other Information: SOLUTION
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: NICKEL POTASSIUM CYANIDE, 20%
Other Information: LIQUID NICKEL, SOL-V-SALT
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: NICKEL SOLUTIONS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 100062
Update Date: 11/02/2012
Case Number: MIXTURE
Name: NICKEL SULFAMATE 55%, NICKEL BROMIDE
Other Information: 10% - NICKEL BATH
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: NICKEL SULFAMATE 70%, NICKEL BROMATE 7%
Other Information: NICKEL SULFAMATE SOLUTION
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 100062
Update Date: 11/02/2012
Case Number: MIXTURE
Name: NICKEL SULFATE 9-12%, SODIUM HYPOPHOSPHATE
Other Information: 11-14%, SODIUM HYDROXIDE 5-6% IN
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7697-37-2
Name: NITRIC ACID (67-68%)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: EXTREMELY HAZARDOUS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Permit Number:	100062
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	NITRIC ACID 30-40%, SULFAMIC ACID 1-5%
Other Information:	PC-1125
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	NITRIC ACID 41-85% IN WATER
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	NITRIC ACID 46%, SODIUM NITRATE 2%
Other Information:	NICKEL STRIPPING SOLUTION
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	NITROGEN 29%, HELIUM 71%, COMPRESSED AIR
Other Information:	MIXED GAS
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	NITROGEN 29%, HELIUM 73%
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	NITROGEN 95%, HYDROGEN 5%, COMPRESSED AIR
Other Information:	MIXED GAS
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7727-37-9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Name: NITROGEN, COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN, LIQUID
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: CRYOGENIC

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: N-PROPYL BROMIDE 95%
Other Information: LENIUM GS
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: OAKITE 61B SOLUTION
Other Information: ALKALINE CLEANER
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN, 02: COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 151-50-8
Name: POTASSIUM CYANIDE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: EXTREMELY HAZARDOUS

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: POTASSIUM CYANIDE 1-6%
Other Information: Not reported
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: POTASSIUM CYANIDE 70%
Other Information: ACR 9025 GOLD STRIPPER
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: POTASSIUM CYANIDE 80%, NICKEL
Other Information: COMPOUNDS AS NI 5%, NON-HAZ 15%:LIQUID NICKEL
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: POTASSIUM FERRICYANIDE 5%, POTASSIUM HYDROXIDE 5%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: POTASSIUM GOLD CYANIDE 1%
Other Information: GOLD PLATING SOLUTIONS
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: POTASSIUM GOLD CYANIDE 1%, ARSENIC TRIOXIDE 0.1%
Other Information: GOLD STRIKE SOLUTION
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7647-15-6
Name:	SODIUM BROMIDE 3-10%: THRU NIC C-50
Other Information:	THRU NI C-50
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	CHRONIC
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	143-33-9
Name:	SODIUM CYANIDE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	EXTREMELY HAZARDOUS
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	SODIUM CYANIDE 9%, POTASSIUM CYANIDE 1%
Other Information:	SODIUM CYANIDE SOLUTION
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	SODIUM CYANIDE SOLUTION 10%
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	EXTREMELY HAZARDOUS
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	SODIUM HYDROXIDE <70%: ENPREP 114E
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	1310-73-2
Name:	SODIUM HYDROXIDE 10%
Other Information:	ENPREP 114 ALKALINE CLEANER
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	1310-73-2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Name: SODIUM HYDROXIDE 15%
Other Information: C400 ALKALINE CLEANER
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 1310-73-2
Name: SODIUM HYDROXIDE 70%
Other Information: ENPREP 114E
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: MIXTURE
Name: SODIUM HYDROXIDE BATH - <1=27%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 1310-73-2
Name: SODIUM HYDROXIDE, LIQUID 50%
Other Information: CAUSTIC SODA, LIQUID 50%
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: MIXTURE
Name: SODIUM HYDROXIDE-55%, SODIUM METASILICATE-30%,
Other Information: IN WATER
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7681-52-9
Name: SODIUM HYPOCHLORITE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 8052-41-3
Name: STODDARD SOLVENT
Other Information: MINERAL SPIRITS, NAPHTHA SAFETY SOLVENT
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7664-93-9
Name:	SULFURIC ACID 10%
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7664-93-9
Name:	SULFURIC ACID 2-12% AQUEOUS SOLUTION
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7664-93-9
Name:	SULFURIC ACID, 93%
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	EXTREMELY HAZARDOUS
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7440-33-7
Name:	TUNGSTEN POWDER
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 121 ALKALINE SOL'N WITH METALS
Other Information:	ALKALINE SOLUTION W/METALS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 122 ALKALINE SOL'N W/OUT METALS
Other Information:	C400 ALKALINE CLEANER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 122 ALKALINE SOL'N W/OUT METALS
Other Information:	FERRIC CYANIDE, SODIUM SILICATE SOLUTION
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION
Other Information:	RESIN BEADS /W CN
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION
Other Information:	RINSE WATER CONTAINING CYANIDE COMPOUNDS, TREATMENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 132 AQUEOUS SOL'N WITH METALS
Other Information:	LEAD SOLUTION
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 132 AQUEOUS SOL'N WITH METALS
Other Information:	NICKEL SOLUTIONS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 132 AQUEOUS SOL'N WITH METALS*
Other Information:	NICKEL STRIPPING SOLUTION
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Name:	WASTE 132 AQUEOUS SOL'N WITH METALS*
Other Information:	NICKEL SULFAMATE SOLUTIONS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 132 AQUEOUS SOL'N WITH METALS*
Other Information:	RINSE WATER CONTAINING NICKEL COMPOUNTS, TREATMENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 132 AQUEOUS SOL'N WITH METALS**
Other Information:	SULFURIC ACID SOLUTION, SURFACE PREP
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 133 AQUEOUS SOL'N W/ 10% ORG RESID
Other Information:	ETHYLENE GLYCOL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 171 METAL SLUDGE
Other Information:	FLTR CK(NCKL/LEAD)COPPER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 172 METAL DUST & MACHINING WASTE
Other Information:	LAP OIL & GRIT (181)
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information:	BERYLLIUM OXIDE, MOLYBDEBUN
Material Waste:	Waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information: FILTERS W/NICKEL SOL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)*
Other Information: CERAMIC TAPE (W/LEAD)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)*
Other Information: SOLDER & LEAD (D008), CD
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)*
Other Information: TUNGSTON PASTE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 211 HALOGENATED SOLVENTS
Other Information: LENIUM GS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 212 OXYGENATED SOLVENTS
Other Information: IPA 95%, BUTYL ACETATE 2.5%, ACETONE 2.5%
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 214 UNSPEC SOLVENT MIXTURE
Other Information: IPA,ACETONE, XYLENE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 214 UNSPEC SOLVENT MIXTURE
Other Information: SOLIDS W/FLAM LIQ (IPA)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: FURNACE/COMPRSR/VACUUM
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY DEBRIS, RAGS, NON-RCRA
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information: AEROSOLS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information: SODIUM HYDROXIDE W/ CN, CORR. SOLID
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS*
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: FLAMMABLE DEBRIS W/ INK (F003)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: IPA W/ LEAD DEBRIS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 151-50-8
Name: WASTE 711 LIQUIDS W CYANIDES - R
Other Information: POTASSIUM CYANIDE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 711 LIQUIDS W CYANIDES - R
Other Information: POTASSIUM FERRICYANIDE SODIUM SILICATE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 711 LIQUIDS W CYANIDES - R*
Other Information: POTASSIUM/SODIUM CYANIDE, PLATING (F007)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 711 LIQUIDS W CYANIDES - R*
Other Information: SODIUM CYANIDE SOLUTION
Material Waste: Waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 726 LIQUIDS W NICKEL - R
Other Information: NICKEL SULFATE/ MONO ETHANOL AMINE SOLUTION
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 791 LIQUIDS WITH PH <OR= 2
Other Information: LIQUIDS W/ PH =<2 W/ METALS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 1330-20-7
Name: XYLENE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Violations Active Permits:

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 02/03/2005
Violation Code: 6HV0133
Violation: MANIFEST COPY NOT SENT TO DTSC
Violation Citation: Generator of hazardous waste has not sent the appropriate copy of the manifest to DTSC/Cal-EPA. CCR 66262.23(a)(4)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 02/03/2005
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 02/03/2005
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 02/03/2005
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 02/03/2005
Violation Code: 6HV0404
Violation: SPILL CONTROL EQUIPMT NOT AVAILABLE
Violation Citation: Spill or fire control equipment is not available and/or not maintained. CCR 66265.32(c),(d)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 01/06/2010
Violation Code: 6HV1013
Violation: HMBP NOT AVAILABLE FOR REVIEW
Violation Citation: Copy of HMBP not onsite for inspector's review. 25505(e)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 01/06/2010
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 01/06/2010
Violation Code: 6HV0235
Violation: WASTE NOT ACCUMULATED IN CONTAINER/TANK
Violation Citation: Did not accumulate waste in container or tank. 66262.34(a)(1)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 01/06/2010
Violation Code: 6HV1604
Violation: 2ND. CONTAINMENT NOT KEPT EMPTY
Violation Citation: Secondary containment not kept empty. 66265.196(b)(c), 66265.194(c)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 01/06/2010
Violation Code: 6HV1605
Violation: NO DAILY TANK INSPECTION/LOG

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Violation Citation: Failed to inspect and/or document daily HW tank system inspections.
66265.195 (c)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 100062 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 100062
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 1000
UST Contents: LEADED
Other Content Info: LEADED
Reg Status: REMOVED
Remove Close Date: 1989-01-06 00:00:00
Year Installed: 1960-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 100062 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 100062
Tank Type: UNKNOWN
Additional Id: AT2260
Capacity Gallons: 7500
UST Contents: Not reported
Other Content Info: GASOLINE & WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1991-08-05 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 100062 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 100062
Tank Type: UNKNOWN
Additional Id: AT2260
Capacity Gallons: 7500
UST Contents: Not reported
Other Content Info: GASOLINE & WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1991-08-05 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 100062 T004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Last Update: 2012-11-02 14:17:38
Permit Number: 100062
Tank Type: UNKNOWN
Additional Id: AT3877
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1997-06-24 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

Permit Number: 212047
Business Type: 6HK35
EPA Id Number: CAR000207639
APN: 369-140-22-00
Last HMMD Inspection: 06/07/2012
Facility Telephone: 858-576-2600
Permit Status: OPEN
Permit Expiration: 11/30/2012
Date Last Updated: 11/02/2012
Facility Owner: KYOCERA SOLAR, INC
Facility Mailing Address: 8611 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 212047
Update Date: 11/02/2012
Case Number: 67-64-1
Name: ACETONE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 212047
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 171 METAL SLUDGE
Other Information: WASTE SOLID W/LEAD
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Permit Number: 212047
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: VACUUM PUMP OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 212047
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: WASTE SOLID WITH FLAMABLE LIQUID
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 212047
Update Date: 11/02/2012
Inspection Date: 08/09/2010
Violation Code: 6HV1002
Violation: HMBP NOT ESTABLISHED/IMPLEMENTED.
Violation Citation: Hazardous materials handler has not established/implemented a business plan. HSC 25503.5(a)
Activity: ACTIVE

Permit Number: 212047
Update Date: 11/02/2012
Inspection Date: 06/07/2012
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Permit Number: 214012
Business Type: 6HK70
EPA Id Number: CAL000360436
APN: 369-140-22-00
Last HMMD Inspection: 02/07/2011
Facility Telephone: 858-882-2000
Permit Status: OPEN
Permit Expiration: 05/31/2013
Date Last Updated: 11/02/2012
Facility Owner: KYOCERA COMMUNICATIONS, INC
Facility Mailing Address: 9520 TOWNE CENTRE DR
Facility Mailing City: San Diego
Facility Mailing State: CA
Facility Mailing Zip: 92121
UST Owner: Not reported
Handle Regulated Hazmat: N
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 214012
Update Date: 11/02/2012
Case Number: 9005-65-6
Name: SIMULANT FLUID V3.1
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 214012
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG
Other Information: GLYCOL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 214012
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG
Other Information: LAB TEST WATER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 214012
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: ALCOHOL & LEAD WIPES
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134447
Business Type: 6HK52
EPA Id Number: CAD047896097
APN: 369-140-17-00
Last HMMD Inspection: 05/10/2011
Facility Telephone: 858-576-6839
Permit Status: OPEN
Permit Expiration: 10/31/2013
Date Last Updated: 11/02/2012
Facility Owner: KYOCERA AMERICA INC
Facility Mailing Address: 8611 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Subject To APSA: N
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: 12% SODIUM HYPOCHLORITE
Other Information: WATER TREATMENT CHEMICALS
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: REACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING: MOTOR OIL
Other Information: NATURAL GAS ENGINE OIL- SAE 40
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 134447
Update Date: 11/02/2012
Case Number: 7664-93-9
Name: SULFURIC ACID, 93%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: TRIDENT 6137 COOLING TREATMENT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: NATURAL GAS ENGINE OIL- SAE 40
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: OILY RAGS / FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 06/30/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 11/23/2004
Violation Code: 6HV0131
Violation: UPF Permit NOT OBTAINED for HAZWASTE
Violation Citation: A Unified Program Facility permit has not been obtained for the generation of hazardous waste. 68.905
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 11/23/2004
Violation Code: 6HV1001
Violation: NO UPF PERMIT FOR HAZMATS
Violation Citation: A Unified Program Facility permit has not been obtained for hazardous materials. 68.905
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 05/18/2006
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 05/18/2006
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 134447
Business Type: 6HK52
EPA Id Number: CAD047896097
APN: 369-140-17-00
Last HMMD Inspection: 05/10/2011
Facility Telephone: 858-576-6839

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Permit Status: OPEN
Permit Expiration: 10/31/2013
Date Last Updated: 11/02/2012
Facility Owner: KYOCERA AMERICA INC
Facility Mailing Address: 8611 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Y
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: 12% SODIUM HYPOCHLORITE
Other Information: WATER TREATMENT CHEMICALS
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: REACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING: MOTOR OIL
Other Information: NATURAL GAS ENGINE OIL- SAE 40
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 134447
Update Date: 11/02/2012
Case Number: 7664-93-9
Name: SULFURIC ACID, 93%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: TRIDENT 6137 COOLING TREATMENT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: NATURAL GAS ENGINE OIL- SAE 40

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: OILY RAGS / FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 06/30/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 11/23/2004
Violation Code: 6HV0131
Violation: UPF Permit NOT OBTAINED for HAZWASTE
Violation Citation: A Unified Program Facility permit has not been obtained for the generation of hazardous waste. 68.905
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 11/23/2004
Violation Code: 6HV1001
Violation: NO UPF PERMIT FOR HAZMATS
Violation Citation: A Unified Program Facility permit has not been obtained for hazardous materials. 68.905
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 05/18/2006
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 05/18/2006
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

onsite to document proper disposal of hazardous waste. CCR 66262.40(a)
& 25160.2(b)(3)

Activity: ACTIVE

Permit Number: 134447
Business Type: 6HK52
EPA Id Number: CAD047896097
APN: 369-140-17-00
Last HMMD Inspection: 05/10/2011
Facility Telephone: 858-576-6839
Permit Status: OPEN
Permit Expiration: 10/31/2013
Date Last Updated: 11/02/2012
Facility Owner: KYOCERA AMERICA INC
Facility Mailing Address: 8611 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: 12% SODIUM HYPOCHLORITE
Other Information: WATER TREATMENT CHEMICALS
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: REACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING: MOTOR OIL
Other Information: NATURAL GAS ENGINE OIL- SAE 40
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 134447
Update Date: 11/02/2012
Case Number: 7664-93-9
Name: SULFURIC ACID, 93%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Name: TRIDENT 6137 COOLING TREATMENT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: NATURAL GAS ENGINE OIL- SAE 40
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134447
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: OILY RAGS / FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 06/30/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 11/23/2004
Violation Code: 6HV0131
Violation: UPF Permit NOT OBTAINED for HAZWASTE
Violation Citation: A Unified Program Facility permit has not been obtained for the generation of hazardous waste. 68.905
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 11/23/2004
Violation Code: 6HV1001
Violation: NO UPF PERMIT FOR HAZMATS
Violation Citation: A Unified Program Facility permit has not been obtained for hazardous materials. 68.905
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 05/18/2006
Violation Code: 6HV1014

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Permit Number: 134447
Update Date: 11/02/2012
Inspection Date: 05/18/2006
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 100062
Business Type: 6HK36
EPA Id Number: CAD047896097
APN: 369-140-17-00
Last HMMD Inspection: 06/08/2012
Facility Telephone: 858-576-2707
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: KYOCERA AMERICA INC
Facility Mailing Address: 8611 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1580
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 124-17-4
Name: 2-BUTOXYETHOXY ETHYL ACETATE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 67-64-1
Name: ACETONE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100062

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Update Date:	11/02/2012
Case Number:	74-86-2
Name:	ACETYLENE, C2H2, 99%, COMPRESSED GAS:
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	PRESSURE RELEASE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	8052-41-3
Name:	ALIPHATIC HYDROCARBONS, 100%: STODDARD SOLVENT
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	CHRONIC
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	AMMONIUM CHLORIDE 10%
Other Information:	ENPLATE PC-455
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	AMMONIUM CITRATE DIBASIC 1.6%, KCI 13.5%
Other Information:	ACTIVATOR AT-905
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	AMMONIUM HYDROGEN FLUORIDE 9%, HCI 38%
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	1336-21-6
Name:	AMMONIUM HYDROXIDE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	AMMONIUM HYDROXIDE 1%

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Other Information:	PALLADIUM SOLUTION
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7440-37-1
Name:	ARGON LIQUID
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	CRYOGENIC
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7440-37-1
Name:	ARGON, AR; COMPRESSED GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	123-86-4
Name:	BUTYL ACETATE, 99%
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	124-38-9
Name:	CARBON DIOXIDE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information:	BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Material Waste:	Not reported
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	132259-10-0
Name:	COMPRESSED AIR, BREATHING GRADE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	132259-10-0
Name:	COMPRESSED AIR, INDUSTRIAL GRADE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7758-99-8
Name:	COPPER SULFATE, SOLUTION
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	CHRONIC
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	CPE-1000 CLEANER
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	84-74-2
Name:	DIBUTYL PHTHALATE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	68476-34-6
Name:	DIESEL FUEL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	DIETHYLENE GLYCOL 48%, FR 40 XD
Other Information:	GLYCOL FR-40 XD
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Update Date:	11/02/2012
Case Number:	111-46-6
Name:	DIETHYLENE GLYCOL: HYDRAULIC FLUID
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	117-81-7
Name:	DIOCTYL PHTHALATE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	5989-27-5
Name:	D-LIMONENE, 98%
Other Information:	ZEP BIG ORANGE
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	107-21-1
Name:	ETHYLENE GLYCOL, 99%
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7440-59-7
Name:	HELIUM
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	HELIUM 71%, NITROGEN 16%, CO2 8%, CO 4%
Other Information:	MIXED GAS
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7647-01-0
Name:	HYDROCHLORIC ACID 10-50% IN WATER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7647-01-0
Name: HYDROCHLORIC ACID SOLUTION (12-13%)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7647-01-0
Name: HYDROCHLORIC ACID, (38-40% CONC)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 1333-74-0
Name: HYDROGEN
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 1333-74-0
Name: HYDROGEN, H2, 99% LIQUID GAS, (2300LBS)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 67-63-0
Name: ISOPROPYL ALCOHOL OR 2-PROPANOL (CH3)2CHOH,99%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: MIXTURE
Name: METHANE10%, ARGON 90%
Other Information: P10
Material Waste: Material
Hazardous Categories 1: FIRE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: MICRO 90 CLEANER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: MIXTURE
Name: NICKEL CHLORIDE - 21-48% IN H2O
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: MIXTURE
Name: NICKEL CHLORIDE, 37% HYDROCHLORIC
Other Information: ACID, 15% BALANCE WATER NICKEL BATH
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: NICKEL CHLORIDE, 49%
Other Information: NICKEL CHLORIDE SOLUTION
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: NICKEL POTASSIUM CYANIDE 1%, POTASSIUM CYANIDE 5%
Other Information: SOLUTION
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: NICKEL POTASSIUM CYANIDE, 20%
Other Information: LIQUID NICKEL, SOL-V-SALT
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Update Date:	11/02/2012
Case Number:	Not reported
Name:	NICKEL SOLUTIONS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	CHRONIC
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	NICKEL SULFAMATE 55%, NICKEL BROMIDE
Other Information:	10% - NICKEL BATH
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	NICKEL SULFAMATE 70%, NICKEL BROMATE 7%
Other Information:	NICKEL SULFAMATE SOLUTION
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	CHRONIC
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	NICKEL SULFATE 9-12%, SODIUM HYPOPHOSPHATE
Other Information:	11-14%, SODIUM HYDROXIDE 5-6% IN
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7697-37-2
Name:	NITRIC ACID (67-68%)
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	EXTREMELY HAZARDOUS
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	NITRIC ACID 30-40%, SULFAMIC ACID 1-5%
Other Information:	PC-1125
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	NITRIC ACID 41-85% IN WATER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	NITRIC ACID 46%, SODIUM NITRATE 2%
Other Information:	NICKEL STRIPPING SOLUTION
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	NITROGEN 29%, HELIUM 71%, COMPRESSED AIR
Other Information:	MIXED GAS
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	NITROGEN 29%, HELIUM 73%
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	NITROGEN 95%, HYDROGEN 5%, COMPRESSED AIR
Other Information:	MIXED GAS
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7727-37-9
Name:	NITROGEN, COMPRESSED GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7727-37-9
Name:	NITROGEN, LIQUID
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 2:	CRYOGENIC
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	N-PROPYL BROMIDE 95%
Other Information:	LENIUM GS
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	OAKITE 61B SOLUTION
Other Information:	ALKALINE CLEANER
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7782-44-7
Name:	OXYGEN, 02: COMPRESSED GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	PRESSURE RELEASE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	151-50-8
Name:	POTASSIUM CYANIDE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	EXTREMELY HAZARDOUS
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	POTASSIUM CYANIDE 1-6%
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	POTASSIUM CYANIDE 70%
Other Information:	ACR 9025 GOLD STRIPPER
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	ACUTE
Permit Number:	100062

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Update Date: 11/02/2012
Case Number: Not reported
Name: POTASSIUM CYANIDE 80%, NICKEL
Other Information: COMPOUNDS AS NI 5%, NON-HAZ 15%:LIQUID NICKEL
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: POTASSIUM FERRICYANIDE 5%, POTASSIUM HYDROXIDE 5%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: POTASSIUM GOLD CYANIDE 1%
Other Information: GOLD PLATING SOLUTIONS
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: POTASSIUM GOLD CYANIDE 1%, ARSENIC TRIOXIDE 0.1%
Other Information: GOLD STRIKE SOLUTION
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7647-15-6
Name: SODIUM BROMIDE 3-10%: THRU NIC C-50
Other Information: THRU NI C-50
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 143-33-9
Name: SODIUM CYANIDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	EXTREMELY HAZARDOUS
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	SODIUM CYANIDE 9%, POTASSIUM CYANIDE 1%
Other Information:	SODIUM CYANIDE SOLUTION
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	ACUTE
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	SODIUM CYANIDE SOLUTION 10%
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	EXTREMELY HAZARDOUS
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	SODIUM HYDROXIDE <70%: ENPREP 114E
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	1310-73-2
Name:	SODIUM HYDROXIDE 10%
Other Information:	ENPREP 114 ALKALINE CLEANER
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	1310-73-2
Name:	SODIUM HYDROXIDE 15%
Other Information:	C400 ALKALINE CLEANER
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	1310-73-2
Name:	SODIUM HYDROXIDE 70%
Other Information:	ENPREP 114E
Material Waste:	Material
Hazardous Categories 1:	ACUTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: MIXTURE
Name: SODIUM HYDROXIDE BATH - </=27%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 1310-73-2
Name: SODIUM HYDROXIDE, LIQUID 50%
Other Information: CAUSTIC SODA, LIQUID 50%
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: MIXTURE
Name: SODIUM HYDROXIDE-55%, SODIUM METASILICATE-30%,
Other Information: IN WATER
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7681-52-9
Name: SODIUM HYPOCHLORITE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 8052-41-3
Name: STODDARD SOLVENT
Other Information: MINERAL SPIRITS, NAPHTHA SAFETY SOLVENT
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 7664-93-9
Name: SULFURIC ACID 10%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100062

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Update Date:	11/02/2012
Case Number:	7664-93-9
Name:	SULFURIC ACID 2-12% AQUEOUS SOLUTION
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7664-93-9
Name:	SULFURIC ACID, 93%
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	EXTREMELY HAZARDOUS
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	7440-33-7
Name:	TUNGSTEN POWDER
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 121 ALKALINE SOL'N WITH METALS
Other Information:	ALKALINE SOLUTION W/METALS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 122 ALKALINE SOL'N W/OUT METALS
Other Information:	C400 ALKALINE CLEANER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 122 ALKALINE SOL'N W/OUT METALS
Other Information:	FERRIC CYANIDE, SODIUM SILICATE SOLUTION
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Other Information:	RESIN BEADS /W CN
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 131 AQUEOUS SOL'N W/REACTIVE ANION
Other Information:	RINSE WATER CONTAINING CYANIDE COMPOUNDS, TREATMENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 132 AQUEOUS SOL'N WITH METALS
Other Information:	LEAD SOLUTION
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 132 AQUEOUS SOL'N WITH METALS
Other Information:	NICKEL SOLUTIONS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 132 AQUEOUS SOL'N WITH METALS*
Other Information:	NICKEL STRIPPING SOLUTION
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 132 AQUEOUS SOL'N WITH METALS*
Other Information:	NICKEL SULFAMATE SOLUTIONS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 132 AQUEOUS SOL'N WITH METALS*
Other Information:	RINSE WATER CONTAINING NICKEL COMPOUNTS, TREATMENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 132 AQUEOUS SOL'N WITH METALS**
Other Information: SULFURIC ACID SOLUTION, SURFACE PREP
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 133 AQUEOUS SOL'N W/ 10% ORG RESID
Other Information: ETHYLENE GLYCOL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 171 METAL SLUDGE
Other Information: FLTR CK(NCKL/LEAD)COPPER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 172 METAL DUST & MACHINING WASTE
Other Information: LAP OIL & GRIT (181)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information: BERYLLIUM OXIDE, MOLYBDEBUN
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information: FILTERS W/NICKEL SOL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)*
Other Information: CERAMIC TAPE (W/LEAD)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)*
Other Information: SOLDER & LEAD (D008), CD
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)*
Other Information: TUNGSTON PASTE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 211 HALOGENATED SOLVENTS
Other Information: LENIUM GS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 212 OXYGENATED SOLVENTS
Other Information: IPA 95%, BUTYL ACETATE 2.5%, ACETONE 2.5%
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 214 UNSPEC SOLVENT MIXTURE
Other Information: IPA, ACETONE, XYLENE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 214 UNSPEC SOLVENT MIXTURE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Other Information:	SOLIDS W/FLAM LIQ (IPA)
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	FURNACE/COMPRSR/VACUUM
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information:	OILY DEBRIS, RAGS, NON-RCRA
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	AEROSOLS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	SODIUM HYDROXIDE W/ CN, CORR. SOLID
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS*
Other Information:	Not reported
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100062
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information:	FLAMMABLE DEBRIS W/ INK (F003)
Material Waste:	Waste
Hazardous Categories 1:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: IPA W/ LEAD DEBRIS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 151-50-8
Name: WASTE 711 LIQUIDS W CYANIDES - R
Other Information: POTASSIUM CYANIDE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 711 LIQUIDS W CYANIDES - R
Other Information: POTASSIUM FERRICYANIDE SODIUM SILICATE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 711 LIQUIDS W CYANIDES - R*
Other Information: POTASSIUM/SODIUM CYANIDE, PLATING (F007)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 711 LIQUIDS W CYANIDES - R*
Other Information: SODIUM CYANIDE SOLUTION
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 726 LIQUIDS W NICKEL - R
Other Information: NICKEL SULFATE/ MONO ETHANOL AMINE SOLUTION
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 791 LIQUIDS WITH PH <OR= 2
Other Information: LIQUIDS W/ PH =<2 W/ METALS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100062
Update Date: 11/02/2012
Case Number: 1330-20-7
Name: XYLENE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Violations Active Permits:

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 02/03/2005
Violation Code: 6HV0133
Violation: MANIFEST COPY NOT SENT TO DTSC
Violation Citation: Generator of hazardous waste has not sent the appropriate copy of the manifest to DTSC/Cal-EPA. CCR 66262.23(a)(4)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 02/03/2005
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 02/03/2005
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 02/03/2005
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Inspection Date: 02/03/2005
Violation Code: 6HV0404
Violation: SPILL CONTROL EQUIPMT NOT AVAILABLE
Violation Citation: Spill or fire control equipment is not available and/or not maintained. CCR 66265.32(c),(d)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 01/06/2010
Violation Code: 6HV1013
Violation: HMBP NOT AVAILABLE FOR REVIEW
Violation Citation: Copy of HMBP not onsite for inspector's review. 25505(e)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 01/06/2010
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 01/06/2010
Violation Code: 6HV0235
Violation: WASTE NOT ACCUMULATED IN CONTAINER/TANK
Violation Citation: Did not accumulate waste in container or tank. 66262.34(a)(1)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 01/06/2010
Violation Code: 6HV1604
Violation: 2ND. CONTAINMENT NOT KEPT EMPTY
Violation Citation: Secondary containment not kept empty. 66265.196(b)(c), 66265.194(c)
Activity: ACTIVE

Permit Number: 100062
Update Date: 11/02/2012
Inspection Date: 01/06/2010
Violation Code: 6HV1605
Violation: NO DAILY TANK INSPECTION/LOG
Violation Citation: Failed to inspect and/or document daily HW tank system inspections. 66265.195 (c)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 100062 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 100062
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 1000
UST Contents: LEADED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Other Content Info: LEADED
Reg Status: REMOVED
Remove Close Date: 1989-01-06 00:00:00
Year Installed: 1960-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 100062 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 100062
Tank Type: UNKNOWN
Additional Id: AT2260
Capacity Gallons: 7500
UST Contents: Not reported
Other Content Info: GASOLINE & WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1991-08-05 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 100062 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 100062
Tank Type: UNKNOWN
Additional Id: AT2260
Capacity Gallons: 7500
UST Contents: Not reported
Other Content Info: GASOLINE & WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1991-08-05 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 100062 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 100062
Tank Type: UNKNOWN
Additional Id: AT3877
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1997-06-24 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

HIST UST:

File Number: 0002B611
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002B611.pdf>
Region: STATE
Facility ID: 00000054264
Facility Type: Other
Other Type: MANUFACTURING
Contact Name: GENE LYONS
Telephone: 6195762600
Owner Name: KYOCERA INTERNATIONAL, INC.
Owner Address: 8611 BALBOA AVE.
Owner City,St,Zip: SAN DIEGO, CA 92123
Total Tanks: 0001

Tank Num: 001
Container Num: 1
Year Installed: 1976
Tank Capacity: 00000610
Tank Used for: WASTE
Type of Fuel: Not reported
Container Construction Thickness: 3 1/2
Leak Detection: Visual

Click here for Geo Tracker PDF:

TRIS:

[Click this hyperlink](#) while viewing on your computer to access
1 additional US_TRIS: record(s) in the EDR Site Report.

ICIS:

Enforcement Action ID: CASDSA00000607300009000009
FRS ID: 110010061333
Action Name: KYOCERA AMERICA INC 0607300009000009
Facility Name: KYOCERA AMERICA INC
Facility Address: 8611 BALBOA
SAN DIEGO, CA 92123
Enforcement Action Type: Notice of Violation
Facility County: SAN DIEGO
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: 4931
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.82083
Longitude in Decimal Degrees: -117.14228
Permit Type Desc: Not reported
Program System Acronym: CASDS00000607300009
Facility NAICS Code: 334413
Tribal Land Code: Not reported
Enforcement Action ID: 09-2000-0251

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

FRS ID: 110010061333
Action Name: KYOCERA AMERICA
Facility Name: KYOCERA AMERICA
Facility Address: 8611 BALBOA AVE
SAN DIEGO, CA 92123
Enforcement Action Type: EPCRA 325 Action For Penalty
Facility County: SAN DIEGO
Program System Acronym: ICIS
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: 325
Facility SIC Code: 3471
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.82092
Longitude in Decimal Degrees: -117.142501
Permit Type Desc: Not reported
Program System Acronym: 29258
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: 09-1993-0030
FRS ID: 110010061333
Action Name: KYOCERA AMERICA INCORPORATED
Facility Name: KYOCERA AMERICA
Facility Address: 8611 BALBOA AVE
SAN DIEGO, CA 92123
Enforcement Action Type: Civil Judicial Action
Facility County: SAN DIEGO
Program System Acronym: ICIS
Enforcement Action Forum Desc: Judicial
EA Type Code: CIV
Facility SIC Code: 3471
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.82092
Longitude in Decimal Degrees: -117.142501
Permit Type Desc: Not reported
Program System Acronym: 29258
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Fed Facility:	No
NAIC Code:	Not reported
SIC Code:	3471
Facility Name:	KYOCERA AMERICA INC
Address:	8611 BALBOA AVE
Tribal Indicator:	N
Fed Facility:	No
NAIC Code:	Not reported
SIC Code:	3471
Facility Name:	KYOCERA AMERICA INC
Address:	8611 BALBOA AVE
Tribal Indicator:	N
Fed Facility:	No
NAIC Code:	Not reported
SIC Code:	3471
Facility Name:	KYOCERA AMERICA INC
Address:	8611 BALBOA AVE
Tribal Indicator:	N
Fed Facility:	No
NAIC Code:	Not reported
SIC Code:	3471
Facility Name:	KYOCERA AMERICA INC
Address:	8611 BALBOA AVE
Tribal Indicator:	N
Fed Facility:	No
NAIC Code:	Not reported
SIC Code:	3471
Facility Name:	KYOCERA AMERICA INC
Address:	8611 BALBOA AVE
Tribal Indicator:	N
Fed Facility:	No
NAIC Code:	Not reported
SIC Code:	3471
Facility Name:	KYOCERA AMERICA INC
Address:	8611 BALBOA AVE
Tribal Indicator:	N
Fed Facility:	No
NAIC Code:	Not reported
SIC Code:	3471
Facility Name:	KYOCERA AMERICA INC
Address:	8611 BALBOA AVE
Tribal Indicator:	N
Fed Facility:	No
NAIC Code:	Not reported
SIC Code:	3471
Facility Name:	KYOCERA AMERICA INC
Address:	8611 BALBOA AVE
Tribal Indicator:	N
Fed Facility:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

Facility Name: KYOCERA AMERICA INC
Address: 8611 BALBOA AVE
Tribal Indicator: N
Fed Facility: No
NAIC Code: Not reported
SIC Code: 3471

US AIRS (AFS):
Envid: 1000169014
Region Code: 09
County Code: CA073
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
D and B Number: Not reported
Facility Site Name: KYOCERA AMERICA INC
Primary SIC Code: 4931
NAICS Code: 334413
Default Air Classification Code: SMI
Facility Type of Ownership Code: POF
Air CMS Category Code: OTH
HPV Status: Not reported

US AIRS (AFS):
Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: Not reported
Activity Status Date: 1998-06-23 00:00:00
Activity Group: Case File
Activity Type: Case File
Activity Status: Resolved

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1992-03-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1993-01-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1994-02-08 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1995-03-07 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1996-03-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1998-03-04 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1999-02-02 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2000-03-16 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2002-02-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Activity Status:	Not reported
Region Code:	09
Programmatic ID:	AIR CASDS0000607300009
Facility Registry ID:	110010061333
Air Operating Status Code:	OPR
Default Air Classification Code:	SMI
Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	2004-02-03 00:00:00
Activity Status Date:	Not reported
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Not reported
Region Code:	09
Programmatic ID:	AIR CASDS0000607300009
Facility Registry ID:	110010061333
Air Operating Status Code:	OPR
Default Air Classification Code:	SMI
Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	2006-11-21 00:00:00
Activity Status Date:	Not reported
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Not reported
Region Code:	09
Programmatic ID:	AIR CASDS0000607300009
Facility Registry ID:	110010061333
Air Operating Status Code:	OPR
Default Air Classification Code:	SMI
Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	2007-08-07 00:00:00
Activity Status Date:	Not reported
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Not reported
Region Code:	09
Programmatic ID:	AIR CASDS0000607300009
Facility Registry ID:	110010061333
Air Operating Status Code:	OPR
Default Air Classification Code:	SMI
Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	2008-01-18 00:00:00
Activity Status Date:	Not reported
Activity Group:	Compliance Monitoring
Activity Type:	Inspection/Evaluation
Activity Status:	Not reported
Region Code:	09
Programmatic ID:	AIR CASDS0000607300009
Facility Registry ID:	110010061333
Air Operating Status Code:	OPR
Default Air Classification Code:	SMI
Air Program:	State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date:	2009-01-14 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2010-01-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2010-11-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-06-16 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2012-03-01 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2012-08-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2014-05-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1998-03-13 00:00:00
Activity Status Date: 1998-03-13 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Informal
Activity Status: Achieved

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: Title V Permits
Activity Date: 1998-03-04 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: Title V Permits
Activity Date: 1999-02-02 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: Title V Permits
Activity Date: 2000-03-16 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: Title V Permits
Activity Date: 2002-02-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: Title V Permits
Activity Date: 2002-04-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: Title V Permits
Activity Date: 2003-10-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: Title V Permits
Activity Date: 2004-02-03 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: Title V Permits
Activity Date: 2005-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: Title V Permits
Activity Date: 2005-09-16 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 09
Programmatic ID: AIR CASDS0000607300009
Facility Registry ID: 110010061333
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: Title V Permits
Activity Date: 2006-02-10 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

FINDS:

Registry ID: 110010061333

Environmental Interest/Information System

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

NCDB (National Compliance Data Base) supports implementation of the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

AIR SYNTHETIC MINOR

TSCA SUBMITTER

US EPA TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

HAZARDOUS AIR POLLUTANT MAJOR

US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

OSHA ESTABLISHMENT

US Emissions & Generation Resource Database (EGRID) contains data on emissions and resource mix for virtually every power plant and company that generates electricity in the United States.

HAZARDOUS WASTE BIENNIAL REPORTER

STATE MASTER

ELECTRIC GENERATOR

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

it Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000169014
Registry ID: 110010061333
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110010061333>

EMI:

Year: 1990
County Code: 37
Air Basin: SD
Facility ID: 7504
Air District Name: SD
SIC Code: 4931
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 91
Reactive Organic Gases Tons/Yr: 8
Carbon Monoxide Emissions Tons/Yr: 45
NOX - Oxides of Nitrogen Tons/Yr: 42
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smlr Tons/Yr: 1

Year: 1990
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3674
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 54
Reactive Organic Gases Tons/Yr: 39
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 1
SOX - Oxides of Sulphur Tons/Yr: 1
Particulate Matter Tons/Yr: 13
Part. Matter 10 Micrometers and Smlr Tons/Yr: 7

Year: 1993
County Code: 37
Air Basin: SD
Facility ID: 7504
Air District Name: SD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

SIC Code: 4931
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 96
Reactive Organic Gases Tons/Yr: 9
Carbon Monoxide Emissions Tons/Yr: 46
NOX - Oxides of Nitrogen Tons/Yr: 46
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smllr Tons/Yr1

Year: 1995
County Code: 37
Air Basin: SD
Facility ID: 7504
Air District Name: SD
SIC Code: 4931
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 96
Reactive Organic Gases Tons/Yr: 9
Carbon Monoxide Emissions Tons/Yr: 46
NOX - Oxides of Nitrogen Tons/Yr: 46
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smllr Tons/Yr1

Year: 1995
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3674
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 27
Reactive Organic Gases Tons/Yr: 19
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr0

Year: 1996
County Code: 37
Air Basin: SD
Facility ID: 7504
Air District Name: SD
SIC Code: 4931
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 43
Reactive Organic Gases Tons/Yr: 4

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Carbon Monoxide Emissions Tons/Yr: 50
NOX - Oxides of Nitrogen Tons/Yr: 36
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smllr Tons/Yr1

Year: 1996
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3674
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 27
Reactive Organic Gases Tons/Yr: 19
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr0

Year: 1997
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3674
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 27
Reactive Organic Gases Tons/Yr: 19
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr0

Year: 1997
County Code: 37
Air Basin: SD
Facility ID: 7504
Air District Name: SD
SIC Code: 4931
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 173
Reactive Organic Gases Tons/Yr: 40
Carbon Monoxide Emissions Tons/Yr: 48
NOX - Oxides of Nitrogen Tons/Yr: 34
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 6
Part. Matter 10 Micrometers and Smllr Tons/Yr6

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Year: 1998
County Code: 37
Air Basin: SD
Facility ID: 7504
Air District Name: SD
SIC Code: 4931
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 133
Reactive Organic Gases Tons/Yr: 31
Carbon Monoxide Emissions Tons/Yr: 43
NOX - Oxides of Nitrogen Tons/Yr: 28
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 6
Part. Matter 10 Micrometers and Smlr Tons/Yr: 6

Year: 1999
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 154
Reactive Organic Gases Tons/Yr: 38
Carbon Monoxide Emissions Tons/Yr: 37
NOX - Oxides of Nitrogen Tons/Yr: 29
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 5
Part. Matter 10 Micrometers and Smlr Tons/Yr: 5

Year: 1999
County Code: 37
Air Basin: SD
Facility ID: 7504
Air District Name: SD
SIC Code: 4931
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 133
Reactive Organic Gases Tons/Yr: 31
Carbon Monoxide Emissions Tons/Yr: 43
NOX - Oxides of Nitrogen Tons/Yr: 28
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 6
Part. Matter 10 Micrometers and Smlr Tons/Yr: 6

Year: 2000
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 237
Reactive Organic Gases Tons/Yr: 21
Carbon Monoxide Emissions Tons/Yr: 49
NOX - Oxides of Nitrogen Tons/Yr: 41
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 2
Part. Matter 10 Micrometers and Smlr Tons/Yr2

Year: 2001
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Y
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 237
Reactive Organic Gases Tons/Yr: 21
Carbon Monoxide Emissions Tons/Yr: 49
NOX - Oxides of Nitrogen Tons/Yr: 41
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 2
Part. Matter 10 Micrometers and Smlr Tons/Yr2

Year: 2002
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Y
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 176
Reactive Organic Gases Tons/Yr: 15
Carbon Monoxide Emissions Tons/Yr: 37
NOX - Oxides of Nitrogen Tons/Yr: 28
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smlr Tons/Yr1

Year: 2003
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 186
Reactive Organic Gases Tons/Yr: 18
Carbon Monoxide Emissions Tons/Yr: 41

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

NOX - Oxides of Nitrogen Tons/Yr: 27
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smlr Tons/Yr: 1

Year: 2004
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Y
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 185.740155
Reactive Organic Gases Tons/Yr: 17.5081515
Carbon Monoxide Emissions Tons/Yr: 41.178478
NOX - Oxides of Nitrogen Tons/Yr: 27.11345
SOX - Oxides of Sulphur Tons/Yr: 0.080141
Particulate Matter Tons/Yr: 1.3262245
Part. Matter 10 Micrometers and Smlr Tons/Yr: 1.3262245

Year: 2005
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 191.99428
Reactive Organic Gases Tons/Yr: 18.4936
Carbon Monoxide Emissions Tons/Yr: 43.47
NOX - Oxides of Nitrogen Tons/Yr: 26.05
SOX - Oxides of Sulphur Tons/Yr: .05672
Particulate Matter Tons/Yr: 1.341960141999538212
Part. Matter 10 Micrometers and Smlr Tons/Yr: 1.33425

Year: 2006
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 187.88510063
Reactive Organic Gases Tons/Yr: 17.49493671
Carbon Monoxide Emissions Tons/Yr: 51.31312432
NOX - Oxides of Nitrogen Tons/Yr: 20.44
SOX - Oxides of Sulphur Tons/Yr: .0575324
Particulate Matter Tons/Yr: 1.323149784
Part. Matter 10 Micrometers and Smlr Tons/Yr: 1.323149784

Year: 2007

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 175.662969
Reactive Organic Gases Tons/Yr: 16.572901
Carbon Monoxide Emissions Tons/Yr: 50.1913
NOX - Oxides of Nitrogen Tons/Yr: 18.37604
SOX - Oxides of Sulphur Tons/Yr: .048731
Particulate Matter Tons/Yr: 1.260432
Part. Matter 10 Micrometers and Smlr Tons/Yr: 1.260432

Year: 2008
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 169.048658
Reactive Organic Gases Tons/Yr: 16.508552
Carbon Monoxide Emissions Tons/Yr: 46.87497
NOX - Oxides of Nitrogen Tons/Yr: 17.27942
SOX - Oxides of Sulphur Tons/Yr: .045779
Particulate Matter Tons/Yr: 1.180594
Part. Matter 10 Micrometers and Smlr Tons/Yr: 1.180594

Year: 2009
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 169.11000000000001
Reactive Organic Gases Tons/Yr: 16.579999999999998
Carbon Monoxide Emissions Tons/Yr: 46.890000000000001
NOX - Oxides of Nitrogen Tons/Yr: 17.300000000000001
SOX - Oxides of Sulphur Tons/Yr: 8.000000000000002E-2
Particulate Matter Tons/Yr: 1.23
Part. Matter 10 Micrometers and Smlr Tons/Yr: 1.23

Year: 2010
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 169.04865799999999
Reactive Organic Gases Tons/Yr: 16.508552000000002
Carbon Monoxide Emissions Tons/Yr: 46.874969999999998
NOX - Oxides of Nitrogen Tons/Yr: 17.279419999999998
SOX - Oxides of Sulphur Tons/Yr: 0.045779
Particulate Matter Tons/Yr: 1.1805939999999999
Part. Matter 10 Micrometers and Smlr Tons/Yr: 1.1805939999999999

Year: 2011
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 178.15
Reactive Organic Gases Tons/Yr: 16.76
Carbon Monoxide Emissions Tons/Yr: 48.93
NOX - Oxides of Nitrogen Tons/Yr: 18.38
SOX - Oxides of Sulphur Tons/Yr: 0.09
Particulate Matter Tons/Yr: 1.27
Part. Matter 10 Micrometers and Smlr Tons/Yr: 1.27

Year: 2012
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 137.96
Reactive Organic Gases Tons/Yr: 15.09
Carbon Monoxide Emissions Tons/Yr: 34.59
NOX - Oxides of Nitrogen Tons/Yr: 15.96
SOX - Oxides of Sulphur Tons/Yr: 0.08
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smlr Tons/Yr: 1

Year: 2013
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 137.96
Reactive Organic Gases Tons/Yr: 15.09
Carbon Monoxide Emissions Tons/Yr: 34.59
NOX - Oxides of Nitrogen Tons/Yr: 15.96

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

SOX - Oxides of Sulphur Tons/Yr: 0.08
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0.7907522

Year: 2014
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 13.724343
Reactive Organic Gases Tons/Yr: 4.0641968
Carbon Monoxide Emissions Tons/Yr: 6.75957
NOX - Oxides of Nitrogen Tons/Yr: 1.87589
SOX - Oxides of Sulphur Tons/Yr: 0.03737398
Particulate Matter Tons/Yr: 0.7908472
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0.7907522

Year: 2015
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 13.724343
Reactive Organic Gases Tons/Yr: 4.0641968
Carbon Monoxide Emissions Tons/Yr: 6.75957
NOX - Oxides of Nitrogen Tons/Yr: 1.87589
SOX - Oxides of Sulphur Tons/Yr: 0.03737398
Particulate Matter Tons/Yr: 0.7908472
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0.7907522

Year: 2016
County Code: 37
Air Basin: SD
Facility ID: 2631
Air District Name: SD
SIC Code: 3469
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 13.724343
Reactive Organic Gases Tons/Yr: 4.0641968
Carbon Monoxide Emissions Tons/Yr: 6.75957
NOX - Oxides of Nitrogen Tons/Yr: 1.87589
SOX - Oxides of Sulphur Tons/Yr: 0.03737398
Particulate Matter Tons/Yr: 0.7908472
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0.7907522

CA Financial Assurance 1:

EPA ID Number:

CAD047896097

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Sudden Amount1:	Not reported
Non Sudden Amount1:	Not reported
Closure Mechanism:	TA
Closure Amount:	\$0.00
Post Closure Mechanism:	Not reported
Post Closure Amount:	Not reported
Corrective Action Mechanism:	Not reported
Corrective Action Amount:	Not reported
Sudden Mechanism Type:	Not reported
Sudden Mechanism Amount:	Not reported
Non Sudden Mechanism Type:	Not reported
Non Sudden Mechanism Amount:	Not reported
O and M Mechanism Type:	Not reported
O and M Amount:	Not reported
Closure Mechanism Date of Mechanism:	Not reported
Closure Mechanism Renewal Date:	Not reported
Closure Mechanism Provider:	US Bank (successor trustee to Union Bank)
Postclosure Mechanism Date of Mechanism:	Not reported
Postclosure Mechanism Renewal Date:	Not reported
Postclosure Mechanism Provider:	Not reported
O and M Mechanism Date of Mechanism:	Not reported
O and M Mechanism Renewal Date:	Not reported
O and M Mechanism Provider:	Not reported
Corrective Action Mechanism Date of Mechanism:	Not reported
Corrective Action Mechanism Renewal Date:	Not reported
Corrective Action Mechanism Provider:	Not reported
Sudden Mechanism Date of Mechanism:	Not reported
Sudden Mechanism Renewal Date:	Not reported
Sudden Mechanism Provider:	Not reported
Non-Sudden Mechanism Date of Mechanism:	Not reported
Non-Sudden Mechanism Renewal Date:	Not reported
Non-Sudden Mechanism Provider:	Not reported
Date Entered into EnviroStor:	Not reported
Authorization Type:	PBR
Comments:	No Activity w/DTSC; CUPA site; no trust on file but we received trust acct statements

ICE:

Envirostor ID:	3000666
EPA ID:	CAD047896097
Site Type:	INSPECTION
Facility Status:	No Action

Enforcement:

Action Type:	Final Civil / Judicial Action (610)
Action Date:	12/12/2008
Action Type:	Initial Civil Filing AG (510)
Action Date:	09/14/2007

Inspection:

Action Type:	Follow-up Inspection - Generator
Action Date:	06/21/2005
Violation Class:	Class 1, Class 2
RTC Date:	04/28/2009
Action Type:	Follow-up Inspection - Generator
Action Date:	10/16/2003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Violation Class: Class 1, Class 2
RTC Date: 04/28/2009

Action Type: Compliance Evaluation Inspection - Generator
Action Date: 05/19/2003
Violation Class: Class 1, Minor
RTC Date: 08/04/2003

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT1458

NPDES:

Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported
Order Number: Not reported
WDID: 9 37NEC000723
Regulatory Measure Type: Industrial
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Terminated
Status Date: 11/03/2017
Operator Name: Kyocera America Inc
Operator Address: 8611 Balboa Ave
Operator City: San Diego
Operator State: California
Operator Zip: 92123

NPDES as of 03/2018:

NPDES Number: Not reported
Status: Not reported
Agency Number: Not reported
Region: 9
Regulatory Measure ID: 218152
Order Number: Not reported
Regulatory Measure Type: Industrial
Place ID: Not reported
WDID: 9 37NEC000723
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Termination Date Of Regulatory Measure: Not reported
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Received Date: 09/24/2015
Processed Date: 03/06/1992
Status: Active
Status Date: 02/07/2017
Place Size: 19
Place Size Unit: Acres
Contact: Roger Blankenship
Contact Title: Not reported
Contact Phone: 619-576-2600
Contact Phone Ext: Not reported
Contact Email: roger.blankenship@kyocera.com
Operator Name: Kyocera America Inc
Operator Address: 8611 Balboa Ave
Operator City: San Diego
Operator State: California
Operator Zip: 92123
Operator Contact: Kathryn Phin
Operator Contact Title: Not reported
Operator Contact Phone: 619-576-2600
Operator Contact Phone Ext: 2707
Operator Contact Email: kathryn.phin@kyocera.com
Operator Type: Private Business
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: California
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: 619-576-2600
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported
Constype Recons Ind: Not reported
Constype Residential Ind: Not reported
Constype Transport Ind: Not reported
Constype Utility Description: Not reported
Constype Utility Ind: Not reported
Constype Water Sewer Ind: Not reported
Dir Discharge Uswater Ind: N
Receiving Water Name: San Diego River
Certifier: Kathryn Phin

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Certifier Title:	EHS Manager
Certification Date:	04-OCT-16
Primary Sic:	3674-Semiconductors and Related Devices
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	CAS000001
Status:	Terminated
Agency Number:	0
Region:	9
Regulatory Measure ID:	218152
Order Number:	97-03-DWQ
Regulatory Measure Type:	Enrollee
Place ID:	Not reported
WDID:	9 37NEC000723
Program Type:	Industrial
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	03/06/1992
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	11/03/2017
Discharge Name:	Kyocera America Inc
Discharge Address:	8611 Balboa Ave
Discharge City:	San Diego
Discharge State:	California
Discharge Zip:	92123
Received Date:	Not reported
Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

Facility Status:	Terminated
NPDES Number:	CAS000001
Region:	9
Agency Number:	0
Regulatory Measure ID:	218152
Place ID:	Not reported
Order Number:	97-03-DWQ
WDID:	9 37NEC000723
Regulatory Measure Type:	Enrollee
Program Type:	Industrial
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	03/06/1992
Termination Date Of Regulatory Measure:	11/03/2017
Expiration Date Of Regulatory Measure:	Not reported
Discharge Address:	8611 Balboa Ave
Discharge Name:	Kyocera America Inc
Discharge City:	San Diego
Discharge State:	California
Discharge Zip:	92123
Status:	Not reported
Status Date:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported

NPDES as of 03/2018:

NPDES Number:	Not reported
Status:	Not reported
Agency Number:	Not reported
Region:	9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Regulatory Measure ID: 218152
Order Number: Not reported
Regulatory Measure Type: Industrial
Place ID: Not reported
WDID: 9 37NEC000723
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Received Date: 09/24/2015
Processed Date: 03/06/1992
Status: Active
Status Date: 02/07/2017
Place Size: 19
Place Size Unit: Acres
Contact: Roger Blankenship
Contact Title: Not reported
Contact Phone: 619-576-2600
Contact Phone Ext: Not reported
Contact Email: roger.blankenship@kyocera.com
Operator Name: Kyocera America Inc
Operator Address: 8611 Balboa Ave
Operator City: San Diego
Operator State: California
Operator Zip: 92123
Operator Contact: Kathryn Phin
Operator Contact Title: Not reported
Operator Contact Phone: 619-576-2600
Operator Contact Phone Ext: 2707
Operator Contact Email: kathryn.phin@kyocera.com
Operator Type: Private Business
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: California
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: 619-576-2600
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	N
Receiving Water Name:	San Diego River
Certifier:	Kathryn Phin
Certifier Title:	EHS Manager
Certification Date:	04-OCT-16
Primary Sic:	3674-Semiconductors and Related Devices
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	CAS000001
Status:	Terminated
Agency Number:	0
Region:	9
Regulatory Measure ID:	218152
Order Number:	97-03-DWQ
Regulatory Measure Type:	Enrollee
Place ID:	Not reported
WDID:	9 37NEC000723
Program Type:	Industrial
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	03/06/1992
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	11/03/2017
Discharge Name:	Kyocera America Inc
Discharge Address:	8611 Balboa Ave
Discharge City:	San Diego
Discharge State:	California
Discharge Zip:	92123
Received Date:	Not reported
Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

WDS:

Facility ID:	San Diego 371000295
Facility Type:	Industrial - Facility that treats and/or disposes of liquid or semisolid wastes from any servicing, producing, manufacturing or processing operation of whatever nature, including mining, gravel washing, geothermal operations, air conditioning, ship building and repairing, oil production, storage and disposal operations, water pumping.
Facility Status:	Active - Any facility with a continuous or seasonal discharge that is under Waste Discharge Requirements.
NPDES Number:	CAS000001 The 1st 2 characters designate the state. The remaining 7 are assigned by the Regional Board
Subregion:	9
Facility Telephone:	Not reported
Facility Contact:	Not reported
Agency Name:	KYOCERA AMERICA INC.
Agency Address:	8611 BALBOA AVE
Agency City,St,Zip:	SAN DIEGO 92123
Agency Contact:	Not reported
Agency Telephone:	Not reported
Agency Type:	Private
SIC Code:	0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL, INC. (Continued)

1000169014

SIC Code 2: Not reported
Primary Waste Type: Not reported
Primary Waste: Not reported
Waste Type2: Not reported
Waste2: Not reported
Primary Waste Type: Not reported
Secondary Waste: Not reported
Secondary Waste Type: Not reported
Design Flow: 0
Baseline Flow: 0
Reclamation: Not reported
POTW: Not reported
Treat To Water: Minor Threat to Water Quality. A violation of a regional board order should cause a relatively minor impairment of beneficial uses compared to a major or minor threat. Not: All nurds without a TTWQ will be considered a minor threat to water quality unless coded at a higher Level. A Zero (0) may be used to code those NURDS that are found to represent no threat to water quality.
Complexity: Category C - Facilities having no waste treatment systems, such as cooling water dischargers or those who must comply through best management practices, facilities with passive waste treatment and disposal systems, such as septic systems with subsurface disposal, or dischargers having waste storage systems with land disposal such as dairy waste ponds.

SAN DIEGO CO LOP:

Record ID: DEH1989-LSAM-H00062-001
Record Status: Completed
Opened Date: 06/01/1989
Parcel Number: 369-140-17-00
Case Type: LOP - Local Oversight Program
Historical Name: KYOCERA AMERICA INC
SWRCB Global ID: T0607300283
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 06/01/1989
Census Tract: Not reported
Community: Not reported
Jurisdiction: Not reported
Watershed Basin Number: Not reported
Water Purveyor: Not reported
Fire Agency: Not reported
Thomas Bros Map Page Grid: Not reported
Latitude: Not reported
Longitude: Not reported
X MapCoord: Not reported
Y MapCoord: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

X165
NNE
< 1/8
0.040 mi.
213 ft.

KYOCERA CO-GEN
8611 BALBOA AVE
SAN DIEGO, CA 92123

Site 3 of 5 in cluster X

CA AST **A100421537**
N/A

Actual:
422 ft.

AST:

Focus Map:
1

Certified Unified Program Agencies: Not reported
Owner: KYOCERA AMERICA INC
Total Gallons: Not reported
CERSID: 10390144
Facility ID: 37-000-134447
Business Name: KYOCERA CO-GEN
Phone: 858-576-2600
Fax: Not reported
Mailing Address: 8611 BALBOA AV
Mailing Address City: SAN DIEGO
Mailing Address State: CA
Mailing Address Zip Code: 92123
Operator Name: KYOCERA AMERICA INC
Operator Phone: 858-576-2600
Owner Phone: 858-576-2600
Owner Mail Address: 8611 BALBOA AVE
Owner State: CA
Owner Zip Code: 92123
Owner Country: United States
Property Owner Name: KYOCERA AMERICA INC
Property Owner Phone: Not reported
Property Owner Mailing Address: 8611 BALBOA AVE
Property Owner City: SAN DIEGO
Property Owner Stat : CA
Property Owner Zip Code: 92123
Property Owner Country: United States
EPAID: CAD047896097

X166
NNE
< 1/8
0.040 mi.
213 ft.

KYOCERA INTERNATIONAL INC
8611 BALBOA AVE
SAN DIEGO, CA 92123

Site 4 of 5 in cluster X

CA HAZNET **S119085776**
CA HWP **N/A**
CA NPDES

Actual:
422 ft.

HAZNET:

Focus Map:
1

Facility Name: KYOCERA INTERNATIONAL INC
envid: S119085776
Year: 2017
GEPAID: CAD047896097
Contact: ROGER BLANKENSHIP
Telephone: 8585762777
Mailing Name: Not reported
Mailing Address: 8611 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921231501
Gen County: San Diego
TSD EPA ID: NVT330010000
TSD County: 99
Waste Category: Liquids with nickel >= 134 Mg./L
Disposal Method: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Tons: 0.77145
Cat Decode: Liquids with nickel >= 134 Mg./L
Method Decode: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL INC (Continued)

S119085776

Include On-Site Treatment And/Or Stabilization)
Facility County: San Diego

envid: S119085776
Year: 2017
GEPAID: CAD047896097
Contact: ROGER BLANKENSHIP
Telephone: 8585762777
Mailing Name: Not reported
Mailing Address: 8611 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921231501
Gen County: San Diego
TSD EPA ID: NMD002208627
TSD County: 99
Waste Category: Other inorganic solid waste
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Tons: 0.1575
Cat Decode: Other inorganic solid waste
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S119085776
Year: 2017
GEPAID: CAD047896097
Contact: ROGER BLANKENSHIP
Telephone: 8585762777
Mailing Name: Not reported
Mailing Address: 8611 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921231501
Gen County: San Diego
TSD EPA ID: NVT330010000
TSD County: 99
Waste Category: Off-specification, aged or surplus inorganics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Tons: 0.4
Cat Decode: Off-specification, aged or surplus inorganics
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S119085776
Year: 2017
GEPAID: CAD047896097
Contact: ROGER BLANKENSHIP
Telephone: 8585762777
Mailing Name: Not reported
Mailing Address: 8611 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921231501
Gen County: San Diego
TSD EPA ID: NMD002208627
TSD County: 99
Waste Category: Other organic solids
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Recovery
(H010-H129) Or (H131-H135)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL INC (Continued)

S119085776

Tons: 3.083
Cat Decode: Other organic solids
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S119085776
Year: 2017
GEPAID: CAD047896097
Contact: ROGER BLANKENSHIP
Telephone: 8585762777
Mailing Name: Not reported
Mailing Address: 8611 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921231501
Gen County: San Diego
TSD EPA ID: NMD002208627
TSD County: 99
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)

Tons: 0.186
Cat Decode: Off-specification, aged or surplus organics
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access 585 additional CA_HAZNET: record(s) in the EDR Site Report.

HWP:

EPA Id: CAD047896097
Cleanup Status: CLOSED
Latitude: 32.82001
Longitude: -117.1421
Facility Type: Historical - Non-Operating
Facility Size: Not reported
Team: MICHAEL CHOE
Supervisor: Not reported
Site Code: Not reported
Assembly District: 77
Senate District: 39
Public Information Officer: Not reported
Public Information Officer: Not reported

Activities:

EPA Id: CAD047896097
Facility Type: Historical - Non-Operating
Unit Names: Unit 1
Event Description: New Operating Permit - APPLICATION PART A RECEIVED
Actual Date: 03/13/2009

EPA Id: CAD047896097
Facility Type: Historical - Non-Operating
Unit Names: Unit 1
Event Description: New Operating Permit - DTSC MEETING WITH APPLICANT
Actual Date: 11/12/2010

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL INC (Continued)

S119085776

EPA Id: CAD047896097
Facility Type: Historical - Non-Operating
Unit Names: Unit 1
Event Description: New Operating Permit - CALL-IN LETTER ISSUED
Actual Date: 12/02/2008

EPA Id: CAD047896097
Facility Type: Historical - Non-Operating
Unit Names: Unit 1
Event Description: New Operating Permit - RESPONSE TO 1ST NOD RECEIVED
Actual Date: 10/22/2011

EPA Id: CAD047896097
Facility Type: Historical - Non-Operating
Unit Names: Unit 1
Event Description: New Operating Permit - FINAL PERMIT - WITHDRAWAL REQUEST ACKNOWLEDGED
Actual Date: 04/13/2012

EPA Id: CAD047896097
Facility Type: Historical - Non-Operating
Unit Names: Unit 1
Event Description: New Operating Permit - FINAL PERMIT - WITHDRAWAL REQUEST RECEIVED
Actual Date: 01/31/2012

EPA Id: CAD047896097
Facility Type: Historical - Non-Operating
Unit Names: Unit 1
Event Description: New Operating Permit - INITIAL ADMINISTRATIVE REVIEW COMPLETED
Actual Date: 04/12/2009

EPA Id: CAD047896097
Facility Type: Historical - Non-Operating
Unit Names: Unit 1
Event Description: New Operating Permit - APPLICATION PART B RECEIVED
Actual Date: 03/13/2009

Closure:
EPA Id: CAD047896097
Facility Type: Historical - Non-Operating
Unit Names: Unit 1
Event Description: Closure Administrative - ISSUE CLOSURE VERIFICATION
Actual Date: 04/13/2012

Alias:
EPA Id: CAD047896097
Facility Type: Historical - Non-Operating
Alias Type: FRS
Alias: 110010061333

NPDES:
Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL INC (Continued)

S119085776

Place ID: Not reported
Order Number: Not reported
WDID: 9 37NEC002357
Regulatory Measure Type: Industrial
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Active
Status Date: 08/03/2016
Operator Name: Kyocera International Inc
Operator Address: 8611 Balboa Ave
Operator City: San Diego
Operator State: California
Operator Zip: 92123

NPDES as of 03/2018:

NPDES Number: CAS000001
Status: Active
Agency Number: 0
Region: 9
Regulatory Measure ID: 474551
Order Number: 97-03-DWQ
Regulatory Measure Type: Enrollee
Place ID: Not reported
WDID: 9 37NEC002357
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 08/03/2016
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Kyocera International Inc
Discharge Address: 8611 Balboa Ave
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92123
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported
Contact: Not reported
Contact Title: Not reported
Contact Phone: Not reported
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL INC (Continued)

S119085776

Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	Not reported
Status:	Not reported
Agency Number:	Not reported
Region:	9
Regulatory Measure ID:	474551
Order Number:	Not reported
Regulatory Measure Type:	Industrial
Place ID:	Not reported
WDID:	9 37NEC002357
Program Type:	Not reported
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Not reported
Discharge Address:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL INC (Continued)

S119085776

Discharge City:	Not reported
Discharge State:	Not reported
Discharge Zip:	Not reported
Received Date:	07/11/2016
Processed Date:	08/03/2016
Status:	Active
Status Date:	08/03/2016
Place Size:	19
Place Size Unit:	Acres
Contact:	Kathryn Phin
Contact Title:	Environmental, Health and Safety Manager
Contact Phone:	858-576-2707
Contact Phone Ext:	Not reported
Contact Email:	kathryn.phin@kyocera.com
Operator Name:	Kyocera International Inc
Operator Address:	8611 Balboa Ave
Operator City:	San Diego
Operator State:	California
Operator Zip:	92123
Operator Contact:	Kathryn Phin
Operator Contact Title:	Environmental, Health and Safety Manager
Operator Contact Phone:	858-576-2707
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	kathryn.phin@kyocera.com
Operator Type:	Private Business
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	California
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Kathryn Phin
Certifier Title:	EHS Manager
Certification Date:	11-JUL-16
Primary Sic:	3674-Semiconductors and Related Devices

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL INC (Continued)

S119085776

Secondary Sic: Not reported
Tertiary Sic: Not reported

Facility Status: Active
NPDES Number: CAS000001
Region: 9
Agency Number: 0
Regulatory Measure ID: 474551
Place ID: Not reported
Order Number: 97-03-DWQ
WDID: 9 37NEC002357
Regulatory Measure Type: Enrollee
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 08/03/2016
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: 8611 Balboa Ave
Discharge Name: Kyocera International Inc
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92123
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

NPDES as of 03/2018:

NPDES Number: CAS000001
Status: Active
Agency Number: 0
Region: 9
Regulatory Measure ID: 474551
Order Number: 97-03-DWQ
Regulatory Measure Type: Enrollee
Place ID: Not reported
WDID: 9 37NEC002357
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 08/03/2016
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Kyocera International Inc
Discharge Address: 8611 Balboa Ave
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92123
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported
Contact: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL INC (Continued)

S119085776

Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	Not reported
Status:	Not reported
Agency Number:	Not reported
Region:	9
Regulatory Measure ID:	474551
Order Number:	Not reported
Regulatory Measure Type:	Industrial

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL INC (Continued)

S119085776

Place ID:	Not reported
WDID:	9 37NEC002357
Program Type:	Not reported
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Not reported
Discharge Address:	Not reported
Discharge City:	Not reported
Discharge State:	Not reported
Discharge Zip:	Not reported
Received Date:	07/11/2016
Processed Date:	08/03/2016
Status:	Active
Status Date:	08/03/2016
Place Size:	19
Place Size Unit:	Acres
Contact:	Kathryn Phin
Contact Title:	Environmental, Health and Safety Manager
Contact Phone:	858-576-2707
Contact Phone Ext:	Not reported
Contact Email:	kathryn.phin@kyocera.com
Operator Name:	Kyocera International Inc
Operator Address:	8611 Balboa Ave
Operator City:	San Diego
Operator State:	California
Operator Zip:	92123
Operator Contact:	Kathryn Phin
Operator Contact Title:	Environmental, Health and Safety Manager
Operator Contact Phone:	858-576-2707
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	kathryn.phin@kyocera.com
Operator Type:	Private Business
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	California
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA INTERNATIONAL INC (Continued)

S119085776

Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Kathryn Phin
Certifier Title:	EHS Manager
Certification Date:	11-JUL-16
Primary Sic:	3674-Semiconductors and Related Devices
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

X167
NNE
< 1/8
0.040 mi.
213 ft.

KYOCERA SOLAR INC
8611 BALBOA AVE
SAN DIEGO, CA 92123

RCRA NonGen / NLR **1014387282**
CA HAZNET **CAR000207639**

Site 5 of 5 in cluster X

Actual:
422 ft.

RCRA NonGen / NLR:

Focus Map:
1

Date form received by agency: 05/30/2013
Facility name: KYOCERA SOLAR INC
Facility address: 8611 BALBOA AVE
KSI
SAN DIEGO, CA 92123
EPA ID: CAR000207639
Contact: ROGER BLANKENSHIP
Contact address: 8611 BALBOA AVE KSI
SAN DIEGO, CA 92123
Contact country: US
Contact telephone: 858-576-2777
Contact email: ROGER.BLANKENSHIP@KYOCERA.COM
EPA Region: 09
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: KYOCERA AMERICA INC
Owner/operator address: 8611 BALBOA AVE
SAN DIEGO, CA 92123
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 03/14/1975
Owner/Op end date: Not reported

Owner/operator name: KYOCERA AMERICA INC
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA SOLAR INC (Continued)

1014387282

Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 03/14/1975
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 03/14/2012
Site name: KYOCERA SOLAR INC
Classification: Small Quantity Generator

. Waste code: 181
. Waste name: Other inorganic solid waste

. Waste code: 352
. Waste name: Other organic solids

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D008
. Waste name: LEAD

Date form received by agency: 04/19/2010
Site name: KYOCERA SOLAR INC
Classification: Large Quantity Generator

. Waste code: 181
. Waste name: Other inorganic solid waste

. Waste code: 214
. Waste name: Unspecified solvent mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA SOLAR INC (Continued)

1014387282

- . Waste code: 221
- . Waste name: Waste oil and mixed oil

- . Waste code: 352
- . Waste name: Other organic solids

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D008
- . Waste name: LEAD

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

HAZNET:

Facility Name: KYOCERA SOLAR INC
envid: 1014387282
Year: 2013
GEPAID: CAR000207639
Contact: KEITH SHELLKOPF/TRAINING MGR
Telephone: 8585762600
Mailing Name: Not reported
Mailing Address: 8611 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921231501
Gen County: San Diego
TSD EPA ID: NMD002208627
TSD County: 99
Waste Category: Not reported
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.5
Cat Decode: Not reported
Method Decode: Not reported
Facility County: Not reported

envid: 1014387282
Year: 2013
GEPAID: CAR000207639
Contact: KEITH SHELLKOPF/TRAINING MGR
Telephone: 8585762600

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA SOLAR INC (Continued)

1014387282

Mailing Name: Not reported
Mailing Address: 8611 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921231501
Gen County: San Diego
TSD EPA ID: NVT330010000
TSD County: 99
Waste Category: Not reported
Disposal Method: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Tons: 8.5852
Cat Decode: Not reported
Method Decode: Not reported
Facility County: Not reported

envid: 1014387282
Year: 2012
GEPAID: CAR000207639
Contact: KEITH SHELLKOPF/TRAINING MGR
Telephone: 8585762600
Mailing Name: Not reported
Mailing Address: 8611 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921231501
Gen County: San Diego
TSD EPA ID: NMD002208627
TSD County: 99
Waste Category: Not reported
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.198
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1014387282
Year: 2012
GEPAID: CAR000207639
Contact: KEITH SHELLKOPF/TRAINING MGR
Telephone: 8585762600
Mailing Name: Not reported
Mailing Address: 8611 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921231501
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Not reported
Disposal Method: Not reported
Tons: 0.019
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1014387282
Year: 2012
GEPAID: CAR000207639
Contact: KEITH SHELLKOPF/TRAINING MGR
Telephone: 8585762600
Mailing Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KYOCERA SOLAR INC (Continued)

1014387282

Mailing Address: 8611 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921231501
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Not reported
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.03
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
16 additional CA_HAZNET: record(s) in the EDR Site Report.

168
East
< 1/8
0.046 mi.
241 ft.

CASTLE ACCESS
9606 AERO DR STE 1900
SAN DIEGO, CA 92123

CA AST A100418499
N/A

Actual:
419 ft.

Focus Map:
1

AST:
Certified Unified Program Agencies: Not reported
Owner: Castle Access DBA redIT
Total Gallons: Not reported
CERSID: 10390246
Facility ID: 37-000-102254
Business Name: CASTLE ACCESS
Phone: 858-836-0200
Fax: Not reported
Mailing Address: 9606 AERO DR #1900
Mailing Address City: SAN DIEGO
Mailing Address State: CA
Mailing Address Zip Code: 92123
Operator Name: CASTLE ACCESS INC
Operator Phone: 858-836-0200
Owner Phone: 8588360200
Owner Mail Address: 9606 AERO DR 1900
Owner State: CA
Owner Zip Code: 92123
Owner Country: United States
Property Owner Name: Not reported
Property Owner Phone: Not reported
Property Owner Mailing Address: Not reported
Property Owner City: Not reported
Property Owner Stat : Not reported
Property Owner Zip Code: Not reported
Property Owner Country: Not reported
EPAID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

Y169 **SUNDSTRAND POWER SYSTEMS**
NNW **8975 BALBOA AVENUE**
< 1/8 **SAN DIEGO, CA 92123**
0.046 mi.
242 ft. **Site 1 of 2 in cluster Y**

RCRA-LQG **1007199411**
FINDS **CAD981439128**

Actual:
427 ft.

RCRA-LQG:

Date form received by agency:02/24/1992

Focus Map:
1

Facility name: SUNDSTRAND POWER SYSTEMS

Facility address: 8975 BALBOA AVENUE

SAN DIEGO, CA 92123

EPA ID: CAD981439128

Mailing address: P.O. BOX 85757

SAN DIEGO, CA 92186-5757

Contact: RONALD A MILLER

Contact address: Not reported

Not reported

Contact country: US

Contact telephone: 619-627-6669

Telephone ext.: 6669

Contact email: Not reported

EPA Region: 09

Classification: Large Quantity Generator

Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Handler Activities Summary:

U.S. importer of hazardous waste: No

Mixed waste (haz. and radioactive): No

Recycler of hazardous waste: No

Transporter of hazardous waste: No

Treater, storer or disposer of HW: No

Underground injection activity: No

On-site burner exemption: No

Furnace exemption: No

Used oil fuel burner: No

Used oil processor: No

User oil refiner: No

Used oil fuel marketer to burner: No

Used oil Specification marketer: No

Used oil transfer facility: No

Used oil transporter: No

Historical Generators:

Date form received by agency:04/02/1990

Site name: SUSTRAND POWER SYSTEMS

Classification: Large Quantity Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNDSTRAND POWER SYSTEMS (Continued)

1007199411

Violation Status: No violations found

FINDS:

Registry ID: 110055868743

Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

Y170 JACK HENRY & ASSOCIATES
NNW 8975 BALBOA AVE
< 1/8 SAN DIEGO, CA 92123
0.046 mi.
242 ft. Site 2 of 2 in cluster Y

CA AST A100421083
N/A

Actual:
427 ft.

AST:

Focus Map:
1

Certified Unified Program Agencies: Not reported
Owner: JACK HENRY& ASSOCIATES INC
Total Gallons: Not reported
CERSID: 10390471
Facility ID: 37-000-204282
Business Name: Jack Henry
Phone: 619-542-6700
Fax: Not reported
Mailing Address: 8975 BALBOA AV
Mailing Address City: SAN DIEGO
Mailing Address State: CA
Mailing Address Zip Code: 92123
Operator Name: JACK HENRY& ASSOCIATES INC
Operator Phone: 619-542-6700
Owner Phone: 417-235-8406
Owner Mail Address: 663 W HIGHWAY 60
Owner State: MO
Owner Zip Code: 65708
Owner Country: United States
Property Owner Name: JACK HENRY& ASSOCIATES INC
Property Owner Phone: Not reported
Property Owner Mailing Address: 663 W HIGHWAY 60
Property Owner City: MONETT
Property Owner Stat : MO
Property Owner Zip Code: 65708
Property Owner Country: United States
EPAID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

171
East
< 1/8
0.053 mi.
280 ft.

SAN DIEGO COUNTY MEDICAL SOCIE
3702 RUFFIN RD
SAN DIEGO, CA 92123

CA San Diego Co. HMMD
CA SWEEPS UST
CA HIST UST

U001573236
N/A

Actual:
424 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number: 121299
Business Type: 6HK03
EPA Id Number: Not reported
APN: 421-350-01-00
Last HMMD Inspection: Not reported
Facility Telephone: 619-565-8888
Permit Status: INAC
Permit Expiration: 11/30/2002
Date Last Updated: 11/02/2012
Facility Owner: SAN DIEGO COUNTY MEDICAL SOCIE
Facility Mailing Address: P.O. BOX 0 5
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 121299 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121299
Tank Type: UNKNOWN
Additional Id: 1
Capacity Gallons: 110
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1986-11-08 00:00:00
Year Installed: 1973-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

SWEEPS UST:

Status: Not reported
Comp Number: 21299
Number: Not reported
Board Of Equalization: 44-023518
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021299-000001
Tank Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAN DIEGO COUNTY MEDICAL SOCIE (Continued)

U001573236

Capacity: 110
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: 1

HIST UST:

File Number: 0002F25A
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002F25A.pdf>
Region: STATE
Facility ID: 00000038799
Facility Type: Other
Other Type: OFFICE BUILDING
Contact Name: DAVID KNETZER
Telephone: 6195658888
Owner Name: SAN DIEGO COUNTY MEDICAL SOCIE
Owner Address: 3702 RUFFIN ROAD
Owner City,St,Zip: SAN DIEGO, CA 92123
Total Tanks: 0001

Tank Num: 001
Container Num: 1
Year Installed: 1973
Tank Capacity: 00000110
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: Not reported
Leak Detection: None

[Click here for Geo Tracker PDF:](#)

172
SSW
< 1/8
0.054 mi.
287 ft.

E & R TRANSMISSION A PARTNERS
3587 RUFFIN RD UNIT 117
SAN DIEGO, CA 92123

EDR Hist Auto 1022167388
N/A

Actual:
414 ft.

EDR Hist Auto

Focus Map:
1

Year:	Name:	Type:
2002	E & R TRANSMISSION A PARTNERS	Automotive Transmission Repair Shops
2003	E & R TRANSMISSION A PARTNERS	Automotive Transmission Repair Shops
2004	E & R TRANSMISSION A PARTNERS	Automotive Transmission Repair Shops
2005	E & R TRANSMISSION A PARTNERS	Automotive Transmission Repair Shops

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

173
South
< 1/8
0.055 mi.
290 ft.

SHARP HEALTH CARE (DATA CENTER)
3571 CORPORATE CT
SAN DIEGO, CA 92123

CA AST S106063406
CA San Diego Co. HMMD N/A

Actual:
408 ft.

Focus Map:
1

AST:

Certified Unified Program Agencies: Not reported
Owner: SHARP HEALTHCARE
Total Gallons: Not reported
CERSID: 10390252
Facility ID: 37-000-132031
Business Name: SHARP HEALTH CARE (DATA CENTER)
Phone: 858-627-5108
Fax: (858)576-0238
Mailing Address: 3571 CORPORATE CT
Mailing Address City: SAN DIEGO
Mailing Address State: CA
Mailing Address Zip Code: Not reported
Operator Name: SHARP HEALTH CARE
Operator Phone: 858-627-5108
Owner Phone: (858) 625-0055
Owner Mail Address: 3571 CORPORATE CT
Owner State: CA
Owner Zip Code: 92123
Owner Country: United States
Property Owner Name: S D B C-I
Property Owner Phone: Not reported
Property Owner Mailing Address: 103 N 3RD AVE
Property Owner City: HAILEY
Property Owner Stat : ID
Property Owner Zip Code: 83333
Property Owner Country: United States
EPAID: Not reported

HMMD SAN DIEGO:

Permit Number: 132031
Business Type: 6HK70
EPA Id Number: Not reported
APN: 421-360-03-00
Last HMMD Inspection: 07/24/2012
Facility Telephone: 858-627-5108
Permit Status: OPEN
Permit Expiration: 08/31/2013
Date Last Updated: 11/02/2012
Facility Owner: SHARP HEALTHCARE
Facility Mailing Address: 3571 CORPORATE CT #C
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-2415
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Y
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHARP HEALTH CARE (DATA CENTER) (Continued)

S106063406

Permit Number: 132031
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL OIL NO. 2
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 132031
Update Date: 11/02/2012
Case Number: 7664-93-9
Name: SULFURIC ACID, LEAD ACID BATTERIES
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: EXTREMELY HAZARDOUS

Violations Active Permits:

Permit Number: 132031
Update Date: 11/02/2012
Inspection Date: 10/08/2010
Violation Code: 6HV1012
Violation: SPCC PLAN NOT PREPARED
Violation Citation: Spill Prevention Countermeasures & Control Plan not prepared as required. 25270.5 (c)
Activity: ACTIVE

Permit Number: 132031
Update Date: 11/02/2012
Inspection Date: 07/24/2012
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Permit Number: 132031
Update Date: 11/02/2012
Inspection Date: 02/08/2006
Violation Code: 6HV4260
Violation: TRANSPORT: NO LQHE/REGISTRATION
Violation Citation: Transportation of medical waste without State Hauler Registration or without a limited-quantity hauling exemption from County HMMD. 118025
Activity: ACTIVE

Permit Number: 132031
Update Date: 11/02/2012
Inspection Date: 02/08/2006
Violation Code: 6HV4309
Violation: SQG:MWMP OR EQUIV NOT ONSITE
Violation Citation: Medical Waste Management Plan or equivalent information not onsite for review (SQG). 117945
Activity: ACTIVE

Permit Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHARP HEALTH CARE (DATA CENTER) (Continued)

S106063406

Business Type: Not reported
EPA Id Number: Not reported
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 858-627-5108
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 07/19/2018
Facility Owner: Not reported
Facility Mailing Address: 3571 CORPORATE CT #C, SAN DIEGO, CA 92123-2415
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: N
Treat Haz Waste: N
Generate Medical Waste: Not reported

Waste and Materials:

Record ID: DEH2002-HUPFP-132031
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0150854
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:33:21.000
Chemical Name: DIESEL FUEL OIL NO. 2
Common Name: DIESEL FUEL OIL NO. 2
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-132031
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0150855
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:33:21.000
Chemical Name: LEAD ACID BATTERIES
Common Name: LEAD ACID BATTERIES
Case Number: 7664-93-9

Record ID: DEH2002-HUPFP-132031
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0189371
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-31T01:03:16.000
Chemical Name: DIESEL FUEL OIL NO. 2
Common Name: DIESEL FUEL OIL NO. 2
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-132031
Permit Status: Permit Renewed
Active Permit: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHARP HEALTH CARE (DATA CENTER) (Continued)

S106063406

Child Record Id: DEH2018-HCHEM-0189372
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-31T01:03:16.000
Chemical Name: LEAD ACID BATTERIES
Common Name: LEAD ACID BATTERIES
Case Number: 7664-93-9

Record ID: DEH2002-HUPFP-132031
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0189373
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-31T01:03:16.000
Chemical Name: Propane
Common Name: Liquefied Petroleum Gas (lpg)
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-132031
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0150856
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:33:21.000
Chemical Name: Propane
Common Name: Liquefied Petroleum Gas (lpg)
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-132031
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0102616
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-07-23T02:32:46.000
Chemical Name: DIESEL FUEL OIL NO. 2
Common Name: DIESEL FUEL OIL NO. 2
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-132031
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0102617
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-07-23T02:32:46.000
Chemical Name: LEAD ACID BATTERIES
Common Name: LEAD ACID BATTERIES
Case Number: 7664-93-9

Record ID: DEH2002-HUPFP-132031
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0102618
Trade Secret: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHARP HEALTH CARE (DATA CENTER) (Continued)

S106063406

Hazardous Material Type: Pure
Last Updated: 2016-07-23T02:32:46.000
Chemical Name: Propane
Common Name: Liquefied Petroleum Gas (lpg)
Case Number: 74-98-6

T174
East
< 1/8
0.060 mi.
316 ft.
WEB SERVICE CO INC
9645 AERO DR
SAN DIEGO, CA 92123
Site 2 of 3 in cluster T

EDR Hist Cleaner **1018628471**
N/A

Actual: EDR Hist Cleaner
371 ft.

Focus Map: Year: Name: Type:
1 2012 WASH MULTIFAMILY LDRY SYSTEMS Laundry And Drycleaner Agents

T175
East
< 1/8
0.060 mi.
316 ft.
CALIFORNIA METER SERVICE
9645 AERO DR
SAN DIEGO, CA 92123
Site 3 of 3 in cluster T

RCRA-SQG **1000252237**
CA San Diego Co. HMM **CAD981463656**
FINDS
ECHO
CA HAZNET

Actual: RCRA-SQG:
371 ft. Date form received by agency: 04/01/1986
Focus Map: Facility name: CALIFORNIA METER SERVICE
1 Facility address: 9645 AERO DR
SAN DIEGO, CA 92123

EPA ID: CAD981463656
Mailing address: AERO DR
SAN DIEGO, CA 92123
Contact: ENVIRONMENTAL MANAGER
Contact address: 9645 AERO DR
SAN DIEGO, CA 92123
Contact country: US
Contact telephone: 619-279-1234
Contact email: Not reported
EPA Region: 09
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:
Owner/operator name: CALIF METER SERVICE
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CALIFORNIA METER SERVICE (Continued)

1000252237

Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

HMMD SAN DIEGO:

Permit Number: 103942
Business Type: Not reported
EPA Id Number: CAD981463656
APN: 421-400-28-00
Last HMMD Inspection: 06/16/1992
Facility Telephone: Not reported
Permit Status: INAC
Permit Expiration: 06/16/1992
Date Last Updated: 11/02/2012
Facility Owner: Not reported
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CALIFORNIA METER SERVICE (Continued)

1000252237

Generate Medical Waste: Not reported

FINDS:

Registry ID: 110002716286

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000252237
Registry ID: 110002716286
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002716286>

HAZNET:

Facility Name: AERO DRIVE SELF STORAGE
envid: 1000252237
Year: 2016
GEPAID: CAC002868884
Contact: PAUL DIEGO
Telephone: 9498512211
Mailing Name: Not reported
Mailing Address: 9645 AERO DR.
Mailing City,St,Zip: SAN DIEGO, CA 92123
Gen County: San Diego
TSD EPA ID: CAD009007626
TSD County: Los Angeles
Waste Category: Asbestos containing waste
Disposal Method: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Tons: 9.2
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

176
NNE
< 1/8
0.064 mi.
336 ft.

LOCKHEED MARTIN MARINE SYSTEMS
3853 CALLE FORTUNADA
SAN DIEGO, CA 92123

CA San Diego Co. HMMD 1008372109
RCRA NonGen / NLR CAR000162909
CA HAZNET

Actual:
421 ft.
Focus Map:
1

HMMD SAN DIEGO:
Permit Number: 205189
Business Type: 6HK35
EPA Id Number: CAR000162909
APN: 421-370-03-00
Last HMMD Inspection: 07/27/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LOCKHEED MARTIN MARINE SYSTEMS (Continued)

1008372109

Facility Telephone: 858-569-8540
Permit Status: OPEN
Permit Expiration: 01/31/2013
Date Last Updated: 11/02/2012
Facility Owner: LOCKHEED MARTIN SERVICES INC
Facility Mailing Address: 3853 CALLE FORTUNADA
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 205189
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OILS, LUBRICATING
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 205189
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 112 ACID SOL'N W/OUT METALS - R
Other Information: NITRIC ACID
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 205189
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information: EMPTY RESIN CANS / AEROSOLS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 205189
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 205189
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LOCKHEED MARTIN MARINE SYSTEMS (Continued)

1008372109

Other Information: OILY WATER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 205189
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 551 LABORATORY WASTE CHEMICALS
Other Information: LAB PACKS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 205189
Update Date: 11/02/2012
Case Number: 7647-01-0
Name: WASTE 791 LIQUIDS WITH PH <OR= 2
Other Information: HYDROCHLORIC ACID
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 205189
Update Date: 11/02/2012
Inspection Date: 09/15/2010
Violation Code: 6HV1013
Violation: HMBP NOT AVAILABLE FOR REVIEW
Violation Citation: Copy of HMBP not onsite for inspector's review. 25505(e)
Activity: ACTIVE

RCRA NonGen / NLR:

Date form received by agency: 11/26/2012
Facility name: LOCKHEED MARTIN MARINE SYSTEMS
Facility address: 3853 CALLE FORTUNADA
SAN DIEGO, CA 92123
EPA ID: CAR000162909
Mailing address: 4297 PACIFIC HWY
SAN DIEGO, CA 92110
Contact: GARY MORREAL
Contact address: 4297 PACIFIC HWY
SAN DIEGO, CA 92110
Contact country: US
Contact telephone: 619-542-3128
Contact email: GARY.MORREAL@LMCO.COM
EPA Region: 09
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: LOCKHEED MARTIN MARINE SYSTEMS
Owner/operator address: Not reported
Not reported
Owner/operator country: US

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LOCKHEED MARTIN MARINE SYSTEMS (Continued)

1008372109

Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 07/17/1987
Owner/Op end date: Not reported

Owner/operator name: LOCKHEED MARTIN TECHNOLOGY SERVICES
Owner/operator address: 2339 W ROUTE 70
CHERRY HILL, NJ 08358

Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 06/30/1995
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 05/18/2005

Site name: LOCKHEED MARTIN MARINE SYSTEMS
Classification: Small Quantity Generator

. Waste code: D001

. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002

. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LOCKHEED MARTIN MARINE SYSTEMS (Continued)

1008372109

CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D007
. Waste name: CHROMIUM

. Waste code: D009
. Waste name: MERCURY

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

HAZNET:

Facility Name: LOCKHEED MARTIN MARINE SYSTEMS
envid: 1008372109
Year: 2012
GEPAID: CAR000162909
Contact: GARY MORREAL
Telephone: 6195423128
Mailing Name: Not reported
Mailing Address: PO BOX 82596
Mailing City,St,Zip: SAN DIEGO, CA 921380000
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Not reported
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.0055
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1008372109
Year: 2012
GEPAID: CAR000162909
Contact: GARY MORREAL
Telephone: 6195423128
Mailing Name: Not reported
Mailing Address: PO BOX 82596
Mailing City,St,Zip: SAN DIEGO, CA 921380000
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LOCKHEED MARTIN MARINE SYSTEMS (Continued)

1008372109

Waste Category: Not reported
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.014
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1008372109
Year: 2012
GEPAID: CAR000162909
Contact: GARY MORREAL
Telephone: 6195423128
Mailing Name: Not reported
Mailing Address: PO BOX 82596
Mailing City,St,Zip: SAN DIEGO, CA 921380000
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Not reported
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.208
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1008372109
Year: 2012
GEPAID: CAR000162909
Contact: GARY MORREAL
Telephone: 6195423128
Mailing Name: Not reported
Mailing Address: PO BOX 82596
Mailing City,St,Zip: SAN DIEGO, CA 921380000
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Not reported
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.003
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1008372109
Year: 2012
GEPAID: CAR000162909
Contact: GARY MORREAL
Telephone: 6195423128
Mailing Name: Not reported
Mailing Address: PO BOX 82596
Mailing City,St,Zip: SAN DIEGO, CA 921380000
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LOCKHEED MARTIN MARINE SYSTEMS (Continued)

1008372109

Waste Category: Not reported
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.0575
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
45 additional CA_HAZNET: record(s) in the EDR Site Report.

177
NNE
< 1/8
0.070 mi.
370 ft.

MAXWELL TECHNOLOGIES, INC.
3912 CALLE FORTUNADA
SAN DIEGO, CA 92123

RCRA-LQG 1000139874
FINDS CAD981394455
ECHO

Actual:
423 ft.

Focus Map:
1

RCRA-LQG:
Date form received by agency:09/07/2016
Facility name: MAXWELL TECHNOLOGIES, INC.
Facility address: 3912 CALLE FORTUNADA
SAN DIEGO, CA 92123
EPA ID: CAD981394455
Mailing address: CALLE FORTUNADA
SAN DIEGO, CA 92123
Contact: DEAN CHARLES
Contact address: CALLE FORTUNADA
SAN DIEGO, CA 92123
Contact country: US
Contact telephone: 858-705-2635
Contact email: DCHARLES@MAXWELL.COM
EPA Region: 09
Land type: Private
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:
Owner/operator name: MAXWELL TECHNOLOGIES, INC.
Owner/operator address: Not reported
Not reported
Owner/operator country: Not reported
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAXWELL TECHNOLOGIES, INC. (Continued)

1000139874

Owner/Operator Type: Operator
Owner/Op start date: 04/01/2011
Owner/Op end date: Not reported

Owner/operator name: CALLE FORTUNADA INVESTMENT GROUP, LLC
Owner/operator address: HILTON HEAD ROAD, SUITE 320
EL CAJON, CA 92019
Owner/operator country: US
Owner/operator telephone: 619-562-6300
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 08/01/1995
Owner/Op end date: Not reported

Owner/operator name: COHU INC ELECTRONICS DIV
Owner/operator address: 3912 CALLE FORTUNADA
SAN DIEGO, CA 92123
Owner/operator country: Not reported
Owner/operator telephone: 858-277-6700
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAXWELL TECHNOLOGIES, INC. (Continued)

1000139874

Used oil transfer facility: No
Used oil transporter: No

. Waste code: 135
. Waste name: Unspecified aqueous solution

. Waste code: 181
. Waste name: Other inorganic solid waste

. Waste code: 214
. Waste name: Unspecified solvent mixture

. Waste code: 343
. Waste name: Unspecified organic liquid mixture

. Waste code: 352
. Waste name: Other organic solids

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSLEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002
. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D003
. Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BE WASTE GUNPOWDER.

. Waste code: D007
. Waste name: CHROMIUM

. Waste code: D008
. Waste name: LEAD

. Waste code: D011
. Waste name: SILVER

. Waste code: D018
. Waste name: BENZENE

. Waste code: D022
. Waste name: CHLOROFORM

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAXWELL TECHNOLOGIES, INC. (Continued)

1000139874

- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: U003
- . Waste name: ACETONITRILE (I,T)

Historical Generators:

Date form received by agency: 04/11/2011

Site name: MAXWELL TECHNOLOGIES INC

Classification: Small Quantity Generator

- . Waste code: 122
- . Waste name: Alkaline solution without metals (pH > 12.5)

- . Waste code: 181
- . Waste name: Other inorganic solid waste

- . Waste code: 214
- . Waste name: Unspecified solvent mixture

- . Waste code: 223
- . Waste name: Unspecified oil-containing waste

- . Waste code: 343
- . Waste name: Unspecified organic liquid mixture

- . Waste code: 352
- . Waste name: Other organic solids

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAXWELL TECHNOLOGIES, INC. (Continued)

1000139874

WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
- . Waste code: D003
- . Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.
- . Waste code: D007
- . Waste name: CHROMIUM
- . Waste code: D008
- . Waste name: LEAD
- . Waste code: D011
- . Waste name: SILVER
- . Waste code: D022
- . Waste name: CHLOROFORM
- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: U003
- . Waste name: ACETONITRILE (I,T)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAXWELL TECHNOLOGIES, INC. (Continued)

1000139874

Date form received by agency: 05/09/2000
Site name: COHU INC ELECTRONICS DIV
Classification: Small Quantity Generator

Waste code: D008
Waste name: LEAD

Waste code: U002
Waste name: ACETONE (I)

Biennial Reports:

Last Biennial Reporting Year: 2017

Annual Waste Handled:

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Amount (Lbs): 8212.5

Waste code: D018
Waste name: BENZENE
Amount (Lbs): 1237.5

Waste code: D035
Waste name: METHYL ETHYL KETONE
Amount (Lbs): 1237.5

Waste code: F003
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Amount (Lbs): 1237.5

Waste code: F005
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Amount (Lbs): 1237.5

Violation Status: No violations found

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAXWELL TECHNOLOGIES, INC. (Continued)

1000139874

Evaluation Action Summary:

Evaluation date: 05/07/2004
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State Contractor/Grantee

FINDS:

Registry ID: 110002692462

Environmental Interest/Information System

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

US EPA TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000139874
Registry ID: 110002692462
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002692462>

**Z178
NW
< 1/8
0.073 mi.
383 ft.**

**SUNSET MOTORS
3888 KEARNY MESA RD
SAN DIEGO, CA 92111
Site 1 of 9 in cluster Z**

**CA LUST
CA SAN DIEGO CO. SAM
CA San Diego Co. HMMD
CA SWEEPS UST
CA HIST UST
CA HIST CORTESE
CA SAN DIEGO CO LOP**

**S102423709
N/A**

**Actual:
402 ft.**

**Focus Map:
1**

LUST REG 9:

Region: 9
Status: Case Closed
Case Number: 9UT978
Local Case: H15307-001
Substance: Gasoline
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Tank
Cause: Corrosion
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 06/16/1988
Date Stopped: 06/16/1988
Confirm Date: 06/16/1988

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNSET MOTORS (Continued)

S102423709

Submit Workplan: Not reported
Prelim Assess: 06/27/1988
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 06/27/1988
Enforce Date: Not reported
Closed Date: 3/2/89
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: Not reported
GW Depth: Not reported
Beneficial Use: Not reported
NPDES Number: Not reported
Priority: Low priority. Priority ranking can change over time.
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

LUST:

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607303212
Global Id: T0607303212
Latitude: 32.8144388903678
Longitude: -117.15204014484
Status: Completed - Case Closed
Status Date: 03/02/1989
Case Worker: Not reported
RB Case Number: 9UT978
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H15307-001
Potential Media Affect: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

LUST:

Global Id: T0607303212
Status: Completed - Case Closed
Status Date: 03/02/1989

Global Id: T0607303212
Status: Open - Case Begin Date
Status Date: 06/29/1988

SAN DIEGO CO. SAM:

Case Number: H15307-001
Agency: DEH Site Assessment & Mitigation
Funding: **LOP - State Fund**
Facility Type: Soils Only
Facility Status: Closed Case
Date: 3/2/1989
Date Began: 6/16/1988

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNSET MOTORS (Continued)

S102423709

HMMD SAN DIEGO:

Permit Number: 115307
Business Type: 6HK03
EPA Id Number: Not reported
APN: 356-362-30-00
Last HMMD Inspection: Not reported
Facility Telephone: 619-283-7161
Permit Status: INAC
Permit Expiration: 03/31/2002
Date Last Updated: 11/02/2012
Facility Owner: AERO PROPERTIES
Facility Mailing Address: P O BOX 20008
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92120-
UST Owner: AERO PROPERTIES
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 115307 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 115307
Tank Type: UNKNOWN
Additional Id: 1
Capacity Gallons: 10000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1988-06-16 00:00:00
Year Installed: 1977-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 115307 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 115307
Tank Type: UNKNOWN
Additional Id: 2
Capacity Gallons: 10000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1988-06-16 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNSET MOTORS (Continued)

S102423709

SWEEPS UST:

Status: Not reported
Comp Number: 15307
Number: Not reported
Board Of Equalization: 44-022913
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-015307-000001
Tank Status: Not reported
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: 2

Status: Not reported
Comp Number: 15307
Number: Not reported
Board Of Equalization: 44-022913
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-015307-000002
Tank Status: Not reported
Capacity: Not reported
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: REG UNLEADED
Number Of Tanks: Not reported

HIST UST:

File Number: 0002AB10
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002AB10.pdf>
Region: Not reported
Facility ID: Not reported
Facility Type: Not reported
Other Type: Not reported
Contact Name: Not reported
Telephone: Not reported
Owner Name: Not reported
Owner Address: Not reported
Owner City,St,Zip: Not reported
Total Tanks: Not reported

Tank Num: Not reported
Container Num: Not reported
Year Installed: Not reported
Tank Capacity: Not reported
Tank Used for: Not reported
Type of Fuel: Not reported
Container Construction Thickness: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SUNSET MOTORS (Continued)

S102423709

Leak Detection: Not reported

Tank Num: Not reported
Container Num: Not reported
Year Installed: Not reported
Tank Capacity: Not reported
Tank Used for: Not reported
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: Not reported

[Click here for Geo Tracker PDF:](#)

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT978

SAN DIEGO CO LOP:

Record ID: DEH1988-LSAM-H15307-001
Record Status: Completed
Opened Date: 06/16/1988
Parcel Number: 356-362-30-00
Case Type: LOP - Local Oversight Program
Historical Name: LEASEWAY TRANSPORTATION
SWRCB Global ID: T0607303212
Funding: S - LOP State Fund
Lead Agency: DEH/SAM
Lead Agency Date: 06/29/1988
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 3
Latitude: 32.8141617
Longitude: -117.1519416
X MapCoord: 6284501.973
Y MapCoord: 1877146.970

Z179 PHD CORP
NW 3888 KEARNEY MESA RD
< 1/8 SAN DIEGO, CA 92111
0.073 mi.
383 ft. Site 2 of 9 in cluster Z

CA HIST UST 1000109310
RCRA NonGen / NLR CAD981162381
FINDS
ECHO

Actual: HIST UST:
402 ft. File Number: Not reported
Focus Map: URL: Not reported
1 Region: STATE
Facility ID: 00000067630
Facility Type: Other
Other Type: TRANSPORTATION & LEA
Contact Name: Not reported
Telephone: 6192837161

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PHD CORP (Continued)

1000109310

Owner Name: AERO PROPERTIES C/O RICKEL INC
Owner Address: 4540 KEARNY VILLA ROAD #205
Owner City,St,Zip: SAN DIEGO, CA 92123
Total Tanks: 0001

Tank Num: 001
Container Num: 1
Year Installed: 1971
Tank Capacity: 00001000
Tank Used for: WASTE
Type of Fuel: 2
Container Construction Thickness: X
Leak Detection: None

Tank Num: 001
Container Num: 1
Year Installed: 1976
Tank Capacity: 00010000
Tank Used for: WASTE
Type of Fuel: 4
Container Construction Thickness: X
Leak Detection: None

RCRA NonGen / NLR:

Date form received by agency: 11/06/1985
Facility name: PHD CORP
Facility address: 3888 KEARNEY MESA RD
SAN DIEGO, CA 92111
EPA ID: CAD981162381
Mailing address: P O BOX 20008
SAN DIEGO, CA 92120
Contact: ENVIRONMENTAL MANAGER
Contact address: 3888 KEARNEY MESA RD
SAN DIEGO, CA 92111
Contact country: US
Contact telephone: 619-283-7161
Contact email: Not reported
EPA Region: 09
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: LEASEWAY TRANSPORTATION CORP
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PHD CORP (Continued)

1000109310

Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

FINDS:

Registry ID: 110002679058

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000109310
Registry ID: 110002679058
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002679058>

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

Z180
NW
< 1/8
0.073 mi.
383 ft.
LEASEWAY TRANSPORTATION
3888 KEARNY MESA RD
SAN DIEGO, CA 92111
Site 3 of 9 in cluster Z

CA HIST UST
U001572913
N/A

Actual:
402 ft.
Focus Map:
1

HIST UST:

File Number: 0002B657
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002B657.pdf>
Region: STATE
Facility ID: 00000010272
Facility Type: Other
Other Type: CAR & TRUCK LEASR &
Contact Name: BOB WRAAMANN
Telephone: 6192837161
Owner Name: LEASEWAY TRANSPORTATION
Owner Address: 4285 CAMINO DEL RIO SO.
Owner City,St,Zip: SAN DIEGO, CA 92108
Total Tanks: 0002

Tank Num: 001
Container Num: 1
Year Installed: 1977
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: 1/4
Leak Detection: Stock Inventor

Tank Num: 002
Container Num: 2
Year Installed: Not reported
Tank Capacity: 00000000
Tank Used for: PRODUCT
Type of Fuel: UNLEADED
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

[Click here for Geo Tracker PDF:](#)

181
NNW
< 1/8
0.075 mi.
394 ft.
WAVETEK
9045 BALBOA AVE
SAN DIEGO, CA 92123

RCRA-SQG
FINDS
ECHO
1000223735
CAD009568205

Actual:
429 ft.
Focus Map:
1

RCRA-SQG:

Date form received by agency:09/01/1996
Facility name: WAVETEK
Facility address: 9045 BALBOA AVE
SAN DIEGO, CA 92123
EPA ID: CAD009568205
Mailing address: PO BOX 651
SAN DIEGO, CA 92112
Contact: Not reported
Contact address: Not reported
Not reported
Contact country: US
Contact telephone: Not reported
Contact email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WAVETEK (Continued)

1000223735

EPA Region: 09
Land type: Facility is not located on Indian land. Additional information is not known.
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: WAVETEK
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 08/18/1980
Site name: WAVETEK

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WAVETEK (Continued)

1000223735

Classification: Large Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 07/05/1994
Date achieved compliance: 07/05/1999
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 07/20/1993
Date achieved compliance: 07/05/1994
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 07/20/1992
Date achieved compliance: 07/20/1993
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 262.50-60
Area of violation: Generators - General
Date violation determined: 07/17/1987
Date achieved compliance: 01/29/1992
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 07/17/1987
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WAVETEK (Continued)

1000223735

Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 07/05/1994
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 07/05/1999
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 07/20/1993
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 07/05/1994
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 07/20/1992
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 07/20/1993
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 07/17/1987
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 01/29/1992
Evaluation lead agency: State

Evaluation date: 07/17/1987
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

FINDS:

Registry ID: 110002637120

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000223735
Registry ID: 110002637120
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002637120>

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AA182 HAWTHORNE MACHINERY CO
WNW 4200 KEARNY MESA ROAD
< 1/8 SAN DIEGO, CA 92111
0.079 mi.
417 ft. Site 1 of 2 in cluster AA

RCRA-LQG 1007198914
CA SAN DIEGO CO. SAM CAD064127160
CA San Diego Co. HMMD
CA SWEEPS UST

Actual:
409 ft.

RCRA-LQG:

Date form received by agency:01/15/1992

Focus Map:
1

Facility name: HAWTHORNE MACHINERY CO

Facility address: 4200 KEARNY MESA ROAD

SAN DIEGO, CA 92111

EPA ID: CAD064127160

Mailing address: P.O. BOX 708

SAN DIEGO, CA 92112

Contact: JERRY L BAILEY

Contact address: Not reported

Not reported

Contact country: US

Contact telephone: 619-674-7029

Contact email: Not reported

EPA Region: 09

Classification: Large Quantity Generator

Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Handler Activities Summary:

U.S. importer of hazardous waste: No

Mixed waste (haz. and radioactive): No

Recycler of hazardous waste: No

Transporter of hazardous waste: No

Treater, storer or disposer of HW: No

Underground injection activity: No

On-site burner exemption: No

Furnace exemption: No

Used oil fuel burner: No

Used oil processor: No

User oil refiner: No

Used oil fuel marketer to burner: No

Used oil Specification marketer: No

Used oil transfer facility: No

Used oil transporter: No

Historical Generators:

Date form received by agency:03/16/1990

Site name: HAWTHORNE MACHINERY CO

Classification: Large Quantity Generator

Violation Status: No violations found

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HAWTHORNE MACHINERY CO (Continued)

1007198914

SAN DIEGO CO. SAM:

Case Number: H02728-001
Agency: DEH Site Assessment & Mitigation
Funding: **Non Billable**
Facility Type: Failed Integrity Test
Facility Status: Closed Case
Date: 2/16/1988
Date Began: 12/1/1987

Case Number: H02728-002
Agency: DEH Site Assessment & Mitigation
Funding: **Non Billable**
Facility Type: Failed Integrity Test
Facility Status: Closed Case
Date: 9/19/1991
Date Began: 12/5/1988

Case Number: H02728-003
Agency: DEH Site Assessment & Mitigation
Funding: **LOP - State Fund**
Facility Type: Soils Only
Facility Status: Closed Case
Date: 10/3/1991
Date Began: 6/29/1990

Case Number: H02728-004
Agency: DEH Site Assessment & Mitigation
Funding: **Non Billable**
Facility Type: Failed Integrity Test
Facility Status: Closed Case
Date: 7/29/1991
Date Began: 1/13/1989

Case Number: H02728-005
Agency: DEH Site Assessment & Mitigation
Funding: **Non Billable**
Facility Type: Failed Integrity Test
Facility Status: Closed Case
Date: 9/12/1991
Date Began: 3/26/1990

Case Number: H02728-006
Agency: DEH Site Assessment & Mitigation
Funding: **Private - For Non-LOP Tank**
Facility Type: Soils Only
Facility Status: Closed Case
Date: 2/19/1992
Date Began: 1/21/1992

Case Number: H02728-007
Agency: DEH Site Assessment & Mitigation
Funding: **LOP - Federal Fund**
Facility Type: Soils Only
Facility Status: Closed Case
Date: 9/21/1992
Date Began: 4/7/1992

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HAWTHORNE MACHINERY CO (Continued)

1007198914

HMMD SAN DIEGO:

Permit Number: 102728
Business Type: 6HK07
EPA Id Number: CAD064127160
APN: 356-230-29-00
Last HMMD Inspection: 07/31/1990
Facility Telephone: 277-2260
Permit Status: INAC
Permit Expiration: 07/31/1990
Date Last Updated: 11/02/2012
Facility Owner: J T HAWTHORNE
Facility Mailing Address: P O BOX 708
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92112-4125
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 102728 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: UNKNOWN
Additional Id: 10
Capacity Gallons: 7500
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1990-08-01 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: UNKNOWN
Additional Id: 11
Capacity Gallons: 6000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1992-07-04 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HAWTHORNE MACHINERY CO (Continued)

1007198914

UST Name: UNDERGROUND TANK 102728 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: UNKNOWN
Additional Id: 12
Capacity Gallons: 2000
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1990-06-29 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: SINGLE WALL
Additional Id: 005 HYDROCARBON BASED OILS
Capacity Gallons: 3000
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1990-08-01 00:00:00
Year Installed: 1973-01-01 00:00:00
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: SINGLE WALL
Additional Id: 006 PARAFFINS
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1990-05-22 00:00:00
Year Installed: 1968-01-01 00:00:00
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T007
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: SINGLE WALL
Additional Id: 007 SOLVENT
Capacity Gallons: 550

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HAWTHORNE MACHINERY CO (Continued)

1007198914

UST Contents: Not reported
Other Content Info: SOLVENT
Reg Status: REMOVED
Remove Close Date: 1990-05-22 00:00:00
Year Installed: 1968-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T008
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: SINGLE WALL
Additional Id: 008 SOLVENT
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: SOLVENT
Reg Status: REMOVED
Remove Close Date: 1990-05-22 00:00:00
Year Installed: 1968-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T009
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: UNKNOWN
Additional Id: 009 SOLVENT
Capacity Gallons: 500
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1990-06-29 00:00:00
Year Installed: 1968-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T010
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: SINGLE WALL
Additional Id: 010
Capacity Gallons: 7500
UST Contents: Not reported
Other Content Info: SEE FILE FOR CONTENTS
Reg Status: REMOVED
Remove Close Date: 1990-05-22 00:00:00
Year Installed: 1975-01-01 00:00:00
Pipe Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HAWTHORNE MACHINERY CO (Continued)

1007198914

Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T011
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: SINGLE WALL
Additional Id: 011
Capacity Gallons: 750
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1992-07-04 00:00:00
Year Installed: 1968-01-01 00:00:00
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T012
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: SINGLE WALL
Additional Id: 012
Capacity Gallons: 4500
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1990-05-22 00:00:00
Year Installed: 1968-01-01 00:00:00
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T013
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: SINGLE WALL
Additional Id: 013 HYDROCARBON BASED OILS
Capacity Gallons: 1000
UST Contents: Not reported
Other Content Info: LUBE OIL
Reg Status: REMOVED
Remove Close Date: 1990-06-29 00:00:00
Year Installed: 1973-01-01 00:00:00
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T014

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HAWTHORNE MACHINERY CO (Continued)

1007198914

Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: UNKNOWN
Additional Id: 014 HYDROCARBON BASED OILS
Capacity Gallons: 3000
UST Contents: Not reported
Other Content Info: MOTOR OIL
Reg Status: REMOVED
Remove Close Date: 1990-08-01 00:00:00
Year Installed: 1972-01-01 00:00:00
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T015
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: SINGLE WALL
Additional Id: 015 HYDROCARBON BASED OILS
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: MOTOR OIL
Reg Status: REMOVED
Remove Close Date: 1990-08-01 00:00:00
Year Installed: 1972-01-01 00:00:00
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T016
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: SINGLE WALL
Additional Id: 016 PARAFFINS
Capacity Gallons: 280
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1990-06-29 00:00:00
Year Installed: 1972-01-01 00:00:00
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T018
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: SINGLE WALL
Additional Id: 018
Capacity Gallons: 500
UST Contents: LEADED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HAWTHORNE MACHINERY CO (Continued)

1007198914

Other Content Info: LEADED
Reg Status: REMOVED
Remove Close Date: 1990-06-29 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: SUCTION
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102728 T019
Last Update: 2012-11-02 14:17:38
Permit Number: 102728
Tank Type: UNKNOWN
Additional Id: AT2572
Capacity Gallons: 280
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1992-07-04 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

SWEEPS UST:

Status: Active
Comp Number: 2728
Number: 9
Board Of Equalization: 44-021729
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002728-000002
Tank Status: A
Capacity: 6000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: REG UNLEADED
Number Of Tanks: 2

Status: Active
Comp Number: 2728
Number: 9
Board Of Equalization: 44-021729
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002728-000011
Tank Status: A
Capacity: 750

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HAWTHORNE MACHINERY CO (Continued)

1007198914

Active Date:	Not reported
Tank Use:	M.V. FUEL
STG:	P
Content:	OTHER
Number Of Tanks:	Not reported
Status:	Not reported
Comp Number:	2728
Number:	Not reported
Board Of Equalization:	44-021729
Referral Date:	Not reported
Action Date:	Not reported
Created Date:	Not reported
Owner Tank Id:	Not reported
SWRCB Tank Id:	37-000-002728-000001
Tank Status:	Not reported
Capacity:	7500
Active Date:	Not reported
Tank Use:	M.V. FUEL
STG:	PRODUCT
Content:	OTHER
Number Of Tanks:	14
Status:	Not reported
Comp Number:	2728
Number:	Not reported
Board Of Equalization:	44-021729
Referral Date:	Not reported
Action Date:	Not reported
Created Date:	Not reported
Owner Tank Id:	Not reported
SWRCB Tank Id:	37-000-002728-000003
Tank Status:	Not reported
Capacity:	2000
Active Date:	Not reported
Tank Use:	PETROLEUM
STG:	WASTE
Content:	Not reported
Number Of Tanks:	Not reported
Status:	Not reported
Comp Number:	2728
Number:	Not reported
Board Of Equalization:	44-021729
Referral Date:	Not reported
Action Date:	Not reported
Created Date:	Not reported
Owner Tank Id:	Not reported
SWRCB Tank Id:	37-000-002728-000005
Tank Status:	Not reported
Capacity:	3000
Active Date:	Not reported
Tank Use:	PETROLEUM
STG:	PRODUCT
Content:	Not reported
Number Of Tanks:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HAWTHORNE MACHINERY CO (Continued)

1007198914

Status: Not reported
Comp Number: 2728
Number: Not reported
Board Of Equalization: 44-021729
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002728-000006
Tank Status: Not reported
Capacity: 550
Active Date: Not reported
Tank Use: PETROLEUM
STG: PRODUCT
Content: Not reported
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 2728
Number: Not reported
Board Of Equalization: 44-021729
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002728-000007
Tank Status: Not reported
Capacity: 550
Active Date: Not reported
Tank Use: CHEMICAL
STG: WASTE
Content: Not reported
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 2728
Number: Not reported
Board Of Equalization: 44-021729
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002728-000008
Tank Status: Not reported
Capacity: 550
Active Date: Not reported
Tank Use: CHEMICAL
STG: WASTE
Content: Not reported
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 2728
Number: Not reported
Board Of Equalization: 44-021729
Referral Date: Not reported
Action Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HAWTHORNE MACHINERY CO (Continued)

1007198914

Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002728-000009
Tank Status: Not reported
Capacity: 500
Active Date: Not reported
Tank Use: PETROLEUM
STG: WASTE
Content: Not reported
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 2728
Number: Not reported
Board Of Equalization: 44-021729
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002728-000010
Tank Status: Not reported
Capacity: 7500
Active Date: Not reported
Tank Use: UNKNOWN
STG: PRODUCT
Content: Not reported
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 2728
Number: Not reported
Board Of Equalization: 44-021729
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002728-000012
Tank Status: Not reported
Capacity: 4500
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 2728
Number: Not reported
Board Of Equalization: 44-021729
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002728-000013
Tank Status: Not reported
Capacity: 1000
Active Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HAWTHORNE MACHINERY CO (Continued)

1007198914

Tank Use:	OIL
STG:	PRODUCT
Content:	Not reported
Number Of Tanks:	Not reported
Status:	Not reported
Comp Number:	2728
Number:	Not reported
Board Of Equalization:	44-021729
Referral Date:	Not reported
Action Date:	Not reported
Created Date:	Not reported
Owner Tank Id:	Not reported
SWRCB Tank Id:	37-000-002728-000014
Tank Status:	Not reported
Capacity:	3000
Active Date:	Not reported
Tank Use:	OIL
STG:	PRODUCT
Content:	Not reported
Number Of Tanks:	Not reported
Status:	Not reported
Comp Number:	2728
Number:	Not reported
Board Of Equalization:	44-021729
Referral Date:	Not reported
Action Date:	Not reported
Created Date:	Not reported
Owner Tank Id:	Not reported
SWRCB Tank Id:	37-000-002728-000015
Tank Status:	Not reported
Capacity:	550
Active Date:	Not reported
Tank Use:	OIL
STG:	PRODUCT
Content:	Not reported
Number Of Tanks:	Not reported
Status:	Not reported
Comp Number:	2728
Number:	Not reported
Board Of Equalization:	44-021729
Referral Date:	Not reported
Action Date:	Not reported
Created Date:	Not reported
Owner Tank Id:	Not reported
SWRCB Tank Id:	37-000-002728-000016
Tank Status:	Not reported
Capacity:	280
Active Date:	Not reported
Tank Use:	PETROLEUM
STG:	PRODUCT
Content:	Not reported
Number Of Tanks:	Not reported
Status:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HAWTHORNE MACHINERY CO (Continued)

1007198914

Comp Number: 2728
Number: Not reported
Board Of Equalization: 44-021729
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002728-000018
Tank Status: Not reported
Capacity: 500
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: LEADED
Number Of Tanks: Not reported

AA183 STAPLES THE OFFICE SUPERSTORE #0266
WNW 4200 KEARNY MESA RD
< 1/8 SAN DIEGO, CA 92111
0.079 mi.
417 ft. Site 2 of 2 in cluster AA

CA LUST 1000409853
CA CPS-SLIC N/A
CA San Diego Co. HMMD
CA HIST CORTESE
CA SAN DIEGO CO LOP

Actual: LUST REG 9:
409 ft. Region: 9
Focus Map: Status: Case Closed
1 Case Number: 9UT1723
Local Case: H02728-003
Substance: Gasoline
Qty Leaked: 0
Abate Method: EDIT
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Unknown
Cause: Unknown
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 05/22/1990
Date Stopped: 05/22/1990
Confirm Date: 05/22/1990
Submit Workplan: Not reported
Prelim Assess: / /
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 05/22/1990
Enforce Date: Not reported
Closed Date: 10/14/91
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: 100'
Beneficial Use: Not reported
NPDES Number: Not reported
Priority: 1C
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STAPLES THE OFFICE SUPERSTORE #0266 (Continued)

1000409853

Cleanup and Abatement order Number: Not reported

Waste Discharge Requirement Number: Not reported

Region: 9
Status: Case Closed
Case Number: 9UT2210
Local Case: H02728-007
Substance: Gasoline
Qty Leaked: 0
Abate Method: No Action Required - incident is minor, requiring no remedial action
Local Agency: San Diego
How Found: Other Means
How Stopped: Other Means
Source: Unknown
Cause: Unknown
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 04/07/1992
Date Stopped: 04/07/1992
Confirm Date: 04/07/1992
Submit Workplan: 4/21/92
Prelim Assess: / /
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 04/07/1992
Enforce Date: Not reported
Closed Date: 9/21/92
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: 100'
Beneficial Use: Not reported
NPDES Number: Not reported
Priority: Low priority. Priority ranking can change over time.
File Dispn: File discarded, case closed
Interim Remedial Actions: No
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

Region: 9
Status: Case Closed
Case Number: 9UT2883
Local Case: H02728-006
Substance: 0
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Not reported
How Stopped: Not reported
Source: Not reported
Cause: Not reported
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 01/21/1992
Date Stopped: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STAPLES THE OFFICE SUPERSTORE #0266 (Continued)

1000409853

Confirm Date: / /
Submit Workplan: Not reported
Prelim Assess: / /
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 09/27/1994
Enforce Date: Not reported
Closed Date: 2/19/92
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: 100'
Beneficial Use: Municipal groundwater use
NPDES Number: Not reported
Priority: Low priority. Priority ranking can change over time.
File Disp: Administratively opened on database, however no file physically exists
Interim Remedial Actions: Not reported
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

LUST:

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607301645
Global Id: T0607301645
Latitude: 32.8184043446817
Longitude: -117.149869966006
Status: Completed - Case Closed
Status Date: 02/19/1992
Case Worker: Not reported
RB Case Number: 9UT2883
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H02728-006
Potential Media Affect: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

LUST:

Global Id: T0607301645
Status: Completed - Case Closed
Status Date: 02/19/1992

Global Id: T0607301645
Status: Open - Case Begin Date
Status Date: 01/21/1992

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607300521
Global Id: T0607300521
Latitude: 32.8185990993588
Longitude: -117.149844216537
Status: Completed - Case Closed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STAPLES THE OFFICE SUPERSTORE #0266 (Continued)

1000409853

Status Date: 10/03/1991
Case Worker: Not reported
RB Case Number: 9UT1723
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H02728-003
Potential Media Affect: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

LUST:

Global Id: T0607300521
Action Type: ENFORCEMENT
Date: 09/23/1991
Action: Closure/No Further Action Letter

LUST:

Global Id: T0607300521
Status: Completed - Case Closed
Status Date: 10/03/1991

Global Id: T0607300521
Status: Open - Case Begin Date
Status Date: 06/29/1990

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607300976
Global Id: T0607300976
Latitude: 32.818162318055
Longitude: -117.149970446033
Status: Completed - Case Closed
Status Date: 09/21/1992
Case Worker: Not reported
RB Case Number: 9UT2210
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H02728-007
Potential Media Affect: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

LUST:

Global Id: T0607300976
Action Type: ENFORCEMENT
Date: 04/07/1992
Action: Notice of Responsibility

LUST:

Global Id: T0607300976
Status: Completed - Case Closed
Status Date: 09/21/1992

Global Id: T0607300976
Status: Open - Case Begin Date
Status Date: 04/07/1992

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STAPLES THE OFFICE SUPERSTORE #0266 (Continued)

1000409853

CPS-SLIC:

Region: STATE
Facility Status: **Completed - Case Closed**
Status Date: 09/19/1991
Global Id: T0608126644
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H02728-002
Latitude: 32.8188006885164
Longitude: -117.150052335515
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Under Investigation
Potential Contaminants of Concern: Waste Oil / Motor / Hydraulic / Lubricating
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

Region: STATE
Facility Status: **Completed - Case Closed**
Status Date: 07/29/1991
Global Id: T0608190244
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H02728-004
Latitude: 32.8189052788145
Longitude: -117.150395657941
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Under Investigation
Potential Contaminants of Concern: Gasoline
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

Region: STATE
Facility Status: **Completed - Case Closed**
Status Date: 02/16/1988
Global Id: T0608114274
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H02728-001
Latitude: 32.8188492489016
Longitude: -117.149867799567
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STAPLES THE OFFICE SUPERSTORE #0266 (Continued)

1000409853

[Click here to access the California GeoTracker records for this facility:](#)

Region:	STATE
Facility Status:	Completed - Case Closed
Status Date:	09/12/1991
Global Id:	T0608131812
Lead Agency:	SAN DIEGO COUNTY LOP
Lead Agency Case Number:	H02728-005
Latitude:	32.8189557703943
Longitude:	-117.150112417062
Case Type:	Cleanup Program Site
Case Worker:	Not reported
Local Agency:	Not reported
RB Case Number:	Not reported
File Location:	Local Agency
Potential Media Affected:	Under Investigation
Potential Contaminants of Concern:	Diesel
Site History:	Not reported

[Click here to access the California GeoTracker records for this facility:](#)

HMMD SAN DIEGO:

Permit Number:	Not reported
Business Type:	Not reported
EPA Id Number:	CAL000390753
APN:	Not reported
Last HMMD Inspection:	Not reported
Facility Telephone:	858-279-0355
Permit Status:	Permit Renewed
Permit Expiration:	Not reported
Date Last Updated:	05/11/2018
Facility Owner:	Not reported
Facility Mailing Address:	500 Staples Drive, Framingham, MA 01702
Facility Mailing City:	Not reported
Facility Mailing State:	Not reported
Facility Mailing Zip:	Not reported
UST Owner:	N
Handle Regulated Hazmat:	Not reported
Own Or Operate UST:	Not reported
Subject To APSA:	Not reported
Generate Haz Waste:	Y
Treat Haz Waste:	N
Generate Medical Waste:	Not reported

Waste and Materials:

Record ID:	DEH2016-HUPFP-002377
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0111219
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-03-04T02:04:42.000
Chemical Name:	AF: Aerosols, Flammables and combustibles
Common Name:	AF: Aerosols, Flammables and combustibles
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STAPLES THE OFFICE SUPERSTORE #0266 (Continued)

1000409853

Record ID: DEH2016-HUPFP-002377
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111220
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-03-04T02:04:42.000
Chemical Name: OX: Oxidizers
Common Name: OX: Oxidizers
Case Number: Not reported

Record ID: DEH2016-HUPFP-002377
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111221
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-03-04T02:04:42.000
Chemical Name: CA: Corrosive Acids
Common Name: CA: Corrosive Acids
Case Number: Not reported

Record ID: DEH2016-HUPFP-002377
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111222
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-03-04T02:04:42.000
Chemical Name: CB: Corrosive Bases
Common Name: CB: Corrosive Bases
Case Number: Not reported

Record ID: DEH2016-HUPFP-002377
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111223
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-03-04T02:04:42.000
Chemical Name: ST: State Regulated/Toxic
Common Name: ST: State Regulated/Toxic
Case Number: Not reported

Record ID: DEH2016-HUPFP-002377
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0121077
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-05-11T02:31:01.000
Chemical Name: AF: Aerosols, Flammables and combustibles
Common Name: AF: Aerosols, Flammables and combustibles
Case Number: Not reported

Record ID: DEH2016-HUPFP-002377
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STAPLES THE OFFICE SUPERSTORE #0266 (Continued)

1000409853

Active Permit: Y
Child Record Id: DEH2017-HWAST-0121078
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-05-11T02:31:01.000
Chemical Name: OX: Oxidizers
Common Name: OX: Oxidizers
Case Number: Not reported

Record ID: DEH2016-HUPFP-002377
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0121079
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-05-11T02:31:01.000
Chemical Name: CA: Corrosive Acids
Common Name: CA: Corrosive Acids
Case Number: Not reported

Record ID: DEH2016-HUPFP-002377
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0121080
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-05-11T02:31:01.000
Chemical Name: CB: Corrosive Bases
Common Name: CB: Corrosive Bases
Case Number: Not reported

Record ID: DEH2016-HUPFP-002377
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0121081
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-05-11T02:31:01.000
Chemical Name: ST: State Regulated/Toxic
Common Name: ST: State Regulated/Toxic
Case Number: Not reported

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT2883

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT2210

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STAPLES THE OFFICE SUPERSTORE #0266 (Continued)

1000409853

Reg Id: 9UT1723

SAN DIEGO CO LOP:

Record ID: DEH1990-LSAM-H02728-003
Record Status: Completed
Opened Date: 06/29/1990
Parcel Number: 356-230-29-00
Case Type: LOP - Local Oversight Program
Historical Name: HAWTHORNE MACHINERY
SWRCB Global ID: T0607300521
Funding: S - LOP State Fund
Lead Agency: DEH/SAM
Lead Agency Date: 06/29/1990
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 3
Latitude: 32.8186314
Longitude: -117.1501278
X MapCoord: 6285127.878
Y MapCoord: 1878914.167

Record ID: DEH1992-LSAM-H02728-007
Record Status: Completed
Opened Date: 04/07/1992
Parcel Number: 356-230-29-00
Case Type: LOP - Local Oversight Program
Historical Name: HAWTHORNE MACHINERY
SWRCB Global ID: T0607300976
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 04/09/1992
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 3
Latitude: 32.8186314
Longitude: -117.1501278
X MapCoord: 6285127.878
Y MapCoord: 1878914.167

Record ID: DEH1987-LSAM-H02728-001
Record Status: Completed
Opened Date: 12/01/1987
Parcel Number: 356-230-29-00
Case Type: Not reported
Historical Name: HAWTHORNE MACHINERY
SWRCB Global ID: T0608114274
Funding: N - Non-Billable
Lead Agency: DEH/SAM
Lead Agency Date: 12/01/1987

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STAPLES THE OFFICE SUPERSTORE #0266 (Continued)

1000409853

Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 3
Latitude: 32.8186314
Longitude: -117.1501278
X MapCoord: 6285127.878
Y MapCoord: 1878914.167

Record ID: DEH1988-LSAM-H02728-002
Record Status: Completed
Opened Date: 12/20/1988
Parcel Number: 356-230-29-00
Case Type: Not reported
Historical Name: HAWTHORNE MACHINERY CO
SWRCB Global ID: T0608126644
Funding: N - Non-Billable
Lead Agency: DEH/SAM
Lead Agency Date: 12/05/1988
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 3
Latitude: 32.8186314
Longitude: -117.1501278
X MapCoord: 6285127.878
Y MapCoord: 1878914.167

Record ID: DEH1989-LSAM-H02728-004
Record Status: Completed
Opened Date: 01/13/1989
Parcel Number: 356-230-29-00
Case Type: Not reported
Historical Name: HAWTHORNE MACHINERY
SWRCB Global ID: T0608190244
Funding: N - Non-Billable
Lead Agency: DEH/SAM
Lead Agency Date: 01/13/1989
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 3
Latitude: 32.8186314
Longitude: -117.1501278
X MapCoord: 6285127.878
Y MapCoord: 1878914.167

Record ID: DEH1990-LSAM-H02728-005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STAPLES THE OFFICE SUPERSTORE #0266 (Continued)

1000409853

Record Status: Completed
Opened Date: 03/26/1990
Parcel Number: 356-230-29-00
Case Type: Not reported
Historical Name: HAWTHORNE MACHINERY
SWRCB Global ID: T0608131812
Funding: N - Non-Billable
Lead Agency: DEH/SAM
Lead Agency Date: 03/30/1990
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 3
Latitude: 32.8186314
Longitude: -117.1501278
X MapCoord: 6285127.878
Y MapCoord: 1878914.167

**184
SSW
< 1/8
0.082 mi.
432 ft.**

**BOSTON SCIENTIFIC - SAN DIEGO
3574 RUFFIN ROAD
SAN DIEGO, CA 92123**

**RCRA-LQG 1001195314
FINDS CAR000018804
ECHO**

**Actual:
413 ft.
Focus Map:
1**

RCRA-LQG:
Date form received by agency: 01/23/2008
Facility name: BOSTON SCIENTIFIC - SAN DIEGO
Facility address: 3574 RUFFIN ROAD
SAN DIEGO, CA 92123
EPA ID: CAR000018804
Contact: KIM RACINE
Contact address: Not reported
Not reported
Contact country: US
Contact telephone: 510-624-1458
Contact email: RACINEK@BSCI.COM
EPA Region: 09
Land type: Private
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:
Owner/operator name: H.G. FENTON COMPANY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOSTON SCIENTIFIC - SAN DIEGO (Continued)

1001195314

Owner/operator address: 7577 MISSION VALLEY ROAD
SAN DIEGO, CA 92108
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 01/01/1994
Owner/Op end date: Not reported

Owner/operator name: BOSTON SCIENTIFIC
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 04/01/2001
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOSTON SCIENTIFIC - SAN DIEGO (Continued)

1001195314

THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

- . Waste code: D003
- . Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.

- . Waste code: D005
- . Waste name: BARIUM

- . Waste code: D007
- . Waste name: CHROMIUM

- . Waste code: D008
- . Waste name: LEAD

- . Waste code: D009
- . Waste name: MERCURY

- . Waste code: D011
- . Waste name: SILVER

- . Waste code: D022
- . Waste name: CHLOROFORM

- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE

- . Waste code: D040
- . Waste name: TRICHLOROETHYLENE

- . Waste code: F002
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOSTON SCIENTIFIC - SAN DIEGO (Continued)

1001195314

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: U002
- . Waste name: ACETONE (I)

- . Waste code: U080
- . Waste name: METHANE, DICHLORO-

- . Waste code: U112
- . Waste name: ACETIC ACID ETHYL ESTER (I)

- . Waste code: U115
- . Waste name: ETHYLENE OXIDE (I,T)

- . Waste code: U220
- . Waste name: BENZENE, METHYL-

Historical Generators:

Date form received by agency:02/03/2006

Site name: BOSTON SCIENTIFIC - SAN DIEGO

Classification: Small Quantity Generator

Date form received by agency:02/03/2006

Site name: BOSTON SCIENTIFIC - SAN DIEGO

Classification: Large Quantity Generator

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSLEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

- . Waste code: D007
- . Waste name: CHROMIUM

- . Waste code: D009
- . Waste name: MERCURY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOSTON SCIENTIFIC - SAN DIEGO (Continued)

1001195314

- . Waste code: D018
- . Waste name: BENZENE

- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE

- . Waste code: D039
- . Waste name: TETRACHLOROETHYLENE

- . Waste code: F002
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F024
- . Waste name: PROCESS WASTES, INCLUDING BUT NOT LIMITED TO, DISTILLATION RESIDUES, HEAVY ENDS, TARS, AND REACTOR CLEAN-OUT WASTES, FROM THE PRODUCTION OF CERTAIN CHLORINATED ALIPHATIC HYDROCARBONS BY FREE RADICAL CATALYZED PROCESSES. THESE CHLORINATED ALIPHATIC HYDROCARBONS ARE THOSE HAVING CARBON CHAIN LENGTHS RANGING FROM ONE TO AND INCLUDING FIVE, WITH VARYING AMOUNTS AND POSITIONS OF CHLORINE SUBSTITUTION. (THIS LISTING DOES NOT INCLUDE WASTEWATERS, WASTEWATER TREATMENT SLUDGES, SPENT CATALYSTS, AND WASTES LISTED IN SECTION 261.31 OR SECTION 261.32).

- . Waste code: LABP
- . Waste name: LAB PACK

- . Waste code: P002
- . Waste name: ACETAMIDE, N-(AMINOTHIOXOMETHYL)-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOSTON SCIENTIFIC - SAN DIEGO (Continued)

1001195314

- . Waste code: P098
- . Waste name: POTASSIUM CYANIDE

- . Waste code: U122
- . Waste name: FORMALDEHYDE

- . Waste code: U134
- . Waste name: HYDROFLUORIC ACID (C,T)

- . Waste code: U219
- . Waste name: THIOUREA

Date form received by agency: 02/04/2004

Site name: BOSTON SCIENTIFIC

Classification: Small Quantity Generator

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

- . Waste code: D007
- . Waste name: CHROMIUM

- . Waste code: D011
- . Waste name: SILVER

- . Waste code: D019
- . Waste name: CARBON TETRACHLORIDE

- . Waste code: D039
- . Waste name: TETRACHLOROETHYLENE

- . Waste code: F002
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOSTON SCIENTIFIC - SAN DIEGO (Continued)

1001195314

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: U057
- . Waste name: CYCLOHEXANONE (I)
- . Waste code: U122
- . Waste name: FORMALDEHYDE
- Date form received by agency: 02/16/2002
- Site name: BSC-IVT
- Classification: Large Quantity Generator
- . Waste code: 135
- . Waste name: Unspecified aqueous solution
- . Waste code: 181
- . Waste name: Other inorganic solid waste
- . Waste code: 211
- . Waste name: Halogenated solvents (chloroform, methyl chloride, perchloroethylene, etc.)
- . Waste code: 212
- . Waste name: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)
- . Waste code: 331
- . Waste name: Off-specification, aged, or surplus organics
- . Waste code: 343
- . Waste name: Unspecified organic liquid mixture
- . Waste code: 551
- . Waste name: Laboratory waste chemicals
- . Waste code: 741
- . Waste name: Liquids with halogenated organic compounds > 1000 mg/l
- . Waste code: 792

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOSTON SCIENTIFIC - SAN DIEGO (Continued)

1001195314

- . Waste name: Liquids with pH < 2 with metals
- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
- . Waste code: D007
- . Waste name: CHROMIUM
- . Waste code: D009
- . Waste name: MERCURY
- . Waste code: D011
- . Waste name: SILVER
- . Waste code: D019
- . Waste name: CARBON TETRACHLORIDE
- . Waste code: F001
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE, AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F002
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOSTON SCIENTIFIC - SAN DIEGO (Continued)

1001195314

MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 07/23/2001

Site name: BOSTON SCIENTIFIC I V T

Classification: Small Quantity Generator

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
- . Waste code: D007
- . Waste name: CHROMIUM
- . Waste code: D011
- . Waste name: SILVER
- . Waste code: D019
- . Waste name: CARBON TETRACHLORIDE
- . Waste code: D022
- . Waste name: CHLOROFORM
- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: F002
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOSTON SCIENTIFIC - SAN DIEGO (Continued)

1001195314

Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

Evaluation Action Summary:

Evaluation date: 07/02/2003
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State Contractor/Grantee

FINDS:

Registry ID: 110002916756

Environmental Interest/Information System

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

HAZARDOUS WASTE BIENNIAL REPORTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1001195314
Registry ID: 110002916756
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002916756>

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

Z185
NW
< 1/8
0.084 mi.
444 ft.
KEARNY MESA 76, LLC.
3860 KEARNY MESA RD A
SAN DIEGO, CA 92111
Site 4 of 9 in cluster Z

CA LUST
CA San Diego Co. HMMD
CA SWEEPS UST
CA EMI
CA HAZNET
S103472124
N/A

Actual:
403 ft.

Focus Map:
1

LUSTR REG 9:
Region: 9
Status: Case Closed
Case Number: 9UT3716
Local Case: H15306-001
Substance: Unleaded Gasoline
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Other Means
How Stopped: Other Means
Source: Unknown
Cause: Unknown
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 09/01/1998
Date Stopped: 09/01/1998
Confirm Date: / /
Submit Workplan: Not reported
Prelim Assess: 03/27/1998
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 09/01/1998
Enforce Date: 9/3/98
Closed Date: 3/17/99
Enforce Type: SEL
Pilot Program: LOP
Basin Number: 907.11
GW Depth: Not reported
Beneficial Use: MUNBU
NPDES Number: Not reported
Priority: 2B
File Disp: Administratively opened on database, however no file physically exists
Interim Remedial Actions: Not reported
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000408795
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 818-206-5700
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 02/07/2018
Facility Owner: Not reported
Facility Mailing Address: 29501 Canwood St Suite #200, AGOURA HILLS, CA 91031
Facility Mailing City: Not reported
Facility Mailing State: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Facility Mailing Zip: Not reported
UST Owner: Y
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217190
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5062413
Return To Compliance Date: Not reported
Nov: Not reported
Violation Classification: Not reported
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T23:44:37.000
Inspection Date: 2013-06-05T17:20:00.000
Violation Code: 2030012 Failure to comply with one or more of the following: provide training to facility employee(s) responsible for proper operation and maintenance every 12 months and/or train new employee(s) who are responsible for proper operation and maintenance within 30-days of hire and/or to have at least one employee present during operating hours that has been trained in the proper operation and maintenance of the UST system. 23 CCR 16 2715(c)(6), 2715(f)

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217190
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5419180
Return To Compliance Date: 2016-05-26T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T23:44:37.000
Inspection Date: 2016-05-03T14:05:00.000
Violation Code: 1010006 HMBP not updated to reflect inventory changes or facility information. HSC 25508.1(a-e)

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217190
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5062342
Return To Compliance Date: Not reported
Nov: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Violation Classification: Not reported
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T23:44:37.000
Inspection Date: 2014-06-03T16:54:00.000
Violation Code: 2030012 Failure to comply with one or more of the following: provide training to facility employee(s) responsible for proper operation and maintenance every 12 months and/or train new employee(s) who are responsible for proper operation and maintenance within 30-days of hire and/or to have at least one employee present during operating hours that has been trained in the proper operation and maintenance of the UST system. 23 CCR 16 2715(c)(6), 2715(f)

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217190
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5419180
Return To Compliance Date: 2016-05-26T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 23815
Container/Tank Id: Not reported
Last Update: 2018-10-25T23:44:37.000
Inspection Date: 2016-05-03T14:05:00.000
Violation Code: 2030013 Failure to comply with one or more of the designated operator monthly inspection requirements: failed to inspect the monthly alarm history report; attach a copy of the alarm history; failed to inspect for the presence of liquid or debris in the spill container/spill bucket and under dispenser containment; failed to inspect the under dispenser containment to ensure that monitoring equipment is placed in the proper position; failure to inspect for liquid or debris in the containment sump where an alarm occurred or for which there is no record of a service visit; or failure to check that all testing and maintenance has been completed and documented. 23 CCR 2715

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217190
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5419180
Return To Compliance Date: 2016-05-26T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T23:44:37.000
Inspection Date: 2016-05-03T14:05:00.000
Violation Code: 1010005 Site map not submitted in CERS or not sufficient. HSC 25505(a)(2) and 25508(a)(1)(A)

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Active Permit: Y
Facility Id Number: 37-000-217190
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5646896
Return To Compliance Date: 2017-05-25T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 23815
Container/Tank Id: Not reported
Last Update: 2018-10-25T23:44:37.000
Inspection Date: 2017-05-04T13:20:00.000
Violation Code: 2030052 (RD) Option 3: Failure to monitor pressurized pipe containing motor vehicle fuel at least hourly at any pressure and either perform 0.2 gallon per hour monthly line integrity test or perform 0.1 gallon per hour annual line integrity test. 23 CCR 2641(a), 2643

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217190
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5878989
Return To Compliance Date: 2018-05-04T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 23818
Container/Tank Id: Not reported
Last Update: 2018-10-25T23:44:37.000
Inspection Date: 2018-05-02T12:02:00.000
Violation Code: 2030013 Failure to comply with one or more of the following designated operator (DO) monthly inspection requirements: Be performed by an ICC certified DO. Inspect monthly alarm history report, check that alarms are documented and responded to appropriately, and attach a copy. Inspect for the presence of liquid/debris in spill containers. Inspect for the presence of liquid/debris in under dispenser containment (UDC) and ensure that the monitoring equipment is positioned correctly. Inspect for liquid or debris in containment sumps where an alarm occurred with no service visit. Check that all testing and maintenance has been completed and documented. Verify that all facility employees have been trained in accordance with 23 CCR 2715(f)(2), 2715(c)

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217190
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5419180
Return To Compliance Date: 2016-05-13T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 23815
Container/Tank Id: Not reported
Last Update: 2018-10-25T23:44:37.000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Inspection Date: 2016-05-03T14:05:00.000
Violation Code: 2060020 (RP) Failure to comply with one or more of the following:
failure to install a spill bucket, have a functional drain valve or
other method for the removal of liquid from the spill bucket/spill
container, and/or be resistant to galvanic corrosion. 23 CCR 2635(b),
2665

UST DTL:

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217190
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: KEARNY MESA 76, LLC.
Tankid: 23818
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2018-10-25T23:44:37.000
Tank Capacityin Gallons: 8000
Tank Contents: Diesel
Type Of Tank: Single Wall

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217190
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: KEARNY MESA 76, LLC.
Tankid: 23815
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2018-10-25T23:44:37.000
Tank Capacityin Gallons: 12000
Tank Contents: Regular Unleaded
Type Of Tank: Single Wall

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217190
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: KEARNY MESA 76, LLC.
Tankid: 23816
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2018-10-25T23:44:37.000
Tank Capacityin Gallons: 12000
Tank Contents: Midgrade Unleaded
Type Of Tank: Single Wall

Record ID: DEH2012-HUPFP-217190

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217190
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: KEARNY MESA 76, LLC.
Tankid: 23817
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2018-10-25T23:44:37.000
Tank Capacity in Gallons: 12000
Tank Contents: Premium Unleaded
Type Of Tank: Single Wall

Waste and Materials:

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0168712
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T23:44:37.000
Chemical Name: Gasoline
Common Name: Gasoline
Case Number: 86290-81-5

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0124274
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:44:11.000
Chemical Name: PROPANE 99%, COMPRESSED LIQUIFIED GAS
Common Name: PROPANE 99%, COMPRESSED LIQUIFIED GAS
Case Number: 74-98-6

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0124275
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:44:11.000
Chemical Name: Carbon Dioxide
Common Name: Carbon Dioxide
Case Number: 124-38-9

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0124276
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:44:11.000
Chemical Name: Diesel Fuel No. 2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Common Name:	Diesel Fuel No. 2	
Case Number:	68476-34-6	
Record ID:	DEH2012-HUPFP-217190	
Permit Status:	Permit Renewed	
Active Permit:	Y	
Child Record Id:	DEH2016-HCHEM-0124277	
Trade Secret:	N	
Hazardous Material Type:	Pure	
Last Updated:	2017-10-23T20:44:11.000	
Chemical Name:	Gasoline	
Common Name:	Gasoline	
Case Number:	86290-81-5	
Record ID:	DEH2012-HUPFP-217190	
Permit Status:	Permit Renewed	
Active Permit:	Y	
Child Record Id:	DEH2016-HWAST-0103762	
Trade Secret:	N	
Hazardous Material Type:	Not reported	
Last Updated:	2017-10-23T20:44:11.000	
Chemical Name:	WASTE FLAMMABLE LIQUID	
Common Name:	WASTE FLAMMABLE LIQUID	
Case Number:	Not reported	
Record ID:	DEH2012-HUPFP-217190	
Permit Status:	Permit Renewed	
Active Permit:	Y	
Child Record Id:	DEH2018-HCHEM-0168709	
Trade Secret:	N	
Hazardous Material Type:	Pure	
Last Updated:	2018-10-25T23:44:37.000	
Chemical Name:	PROPANE 99%, COMPRESSED	LIQUIFIED GAS
Common Name:	PROPANE 99%, COMPRESSED	LIQUIFIED GAS
Case Number:	74-98-6	
Record ID:	DEH2012-HUPFP-217190	
Permit Status:	Permit Renewed	
Active Permit:	Y	
Child Record Id:	DEH2018-HCHEM-0168710	
Trade Secret:	N	
Hazardous Material Type:	Pure	
Last Updated:	2018-10-25T23:44:37.000	
Chemical Name:	Carbon Dioxide	
Common Name:	Carbon Dioxide	
Case Number:	124-38-9	
Record ID:	DEH2012-HUPFP-217190	
Permit Status:	Permit Renewed	
Active Permit:	Y	
Child Record Id:	DEH2018-HCHEM-0168711	
Trade Secret:	N	
Hazardous Material Type:	Pure	
Last Updated:	2018-10-25T23:44:37.000	
Chemical Name:	Diesel Fuel No. 2	
Common Name:	Diesel Fuel No. 2	
Case Number:	68476-34-6	

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Record ID: DEH2012-HUPFP-217190
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0142886
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T23:44:37.000
Chemical Name: WASTE FLAMMABLE LIQUID
Common Name: WASTE FLAMMABLE LIQUID
Case Number: Not reported

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000377709
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 800-871-0773
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 06/28/2018
Facility Owner: Not reported
Facility Mailing Address: 1815 19th Street, Sacramento, CA 95811
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: Y
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217250
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5831695
Return To Compliance Date: 2017-12-27T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 2012-NT-2544-2
Container/Tank Id: Not reported
Last Update: 2018-10-25T21:19:04.000
Inspection Date: 2017-12-08T10:48:00.000
Violation Code: 2030025 (RD) Failure of the line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements: Monitored at least hourly. with the capability of detecting a release of 3.0 gallons per hour leak at 10 p.s.i.g. and restrict or shut off the flow of product through the piping when a leak is detected. 23 CCR 2636(f)(2)

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Active Permit: Y
Facility Id Number: 37-000-217250
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5831695
Return To Compliance Date: 2018-02-01T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 2012-NT-2544-1
Container/Tank Id: Not reported
Last Update: 2018-10-25T21:19:04.000
Inspection Date: 2017-12-08T10:48:00.000
Violation Code: 2030013 Failure to comply with one or more of the following designated operator (DO) monthly inspection requirements: Be performed by an ICC certified DO. Inspect monthly alarm history report, check that alarms are documented and responded to appropriately, and attach a copy. Inspect for the presence of liquid/debris in spill containers. Inspect for the presence of liquid/debris in under dispenser containment (UDC) and ensure that the monitoring equipment is positioned correctly. Inspect for liquid or debris in containment sumps where an alarm occurred with no service visit. Check that all testing and maintenance has been completed and documented. Verify that all facility employees have been trained in accordance with 23 CCR 2715(f)(2), 2715(c)

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217250
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5194698
Return To Compliance Date: Not reported
Nov: Not reported
Violation Classification: Not reported
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T21:19:04.000
Inspection Date: 2015-12-08T12:00:00.000
Violation Code: 2010004 The owner/operator has failed to comply with one or more of the following: to maintain a copy of the designated operator monthly inspections for the last 12 months and/or maintain a list of trained employees on-site or off-site at a readily available location, if approved by the CUPA. 23 CCR 2715

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217250
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5194698
Return To Compliance Date: 2016-02-05T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 2012-NT-2544-1
Container/Tank Id: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Last Update: 2018-10-25T21:19:04.000
Inspection Date: 2015-12-08T12:00:00.000
Violation Code: 2030013 Failure to comply with one or more of the designated operator monthly inspection requirements: failed to inspect the monthly alarm history report; attach a copy of the alarm history; failed to inspect for the presence of liquid or debris in the spill container/spill bucket and under dispenser containment; failed to inspect the under dispenser containment to ensure that monitoring equipment is placed in the proper position; failure to inspect for liquid or debris in the containment sump where an alarm occurred or for which there is no record of a service visit; or failure to check that all testing and maintenance has been completed and documented. 23 CCR 2715

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217250
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5543644
Return To Compliance Date: 2016-12-28T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 2012-NT-2544-1
Container/Tank Id: Not reported
Last Update: 2018-10-25T21:19:04.000
Inspection Date: 2016-12-08T11:26:00.000
Violation Code: 2060020 (RP) Failure to comply with one or more of the following: failure to install a spill bucket, have a functional drain valve or other method for the removal of liquid from the spill bucket/spill container, and/or be resistant to galvanic corrosion. 23 CCR 2635(b), 2665

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217250
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5194698
Return To Compliance Date: Not reported
Nov: Not reported
Violation Classification: Not reported
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T21:19:04.000
Inspection Date: 2015-12-08T12:00:00.000
Violation Code: 2030011 Failure to submit statement of UST compliance and/or Designated Operator current certification. 23 CCR 2715(a), 2715(b)

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217250
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5831695

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Return To Compliance Date: Not reported
Nov: Not reported
Violation Classification: Not reported
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T21:19:04.000
Inspection Date: 2017-12-08T10:48:00.000
Violation Code: 2010012 Failure to maintain UST records of monitoring, testing, repairing, and closure in sufficient detail to enable the CUPA to determine whether the UST systems are in compliance. HSC 6.7 25293

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217250
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 5194698
Return To Compliance Date: 2016-02-03T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T21:19:04.000
Inspection Date: 2015-12-08T12:00:00.000
Violation Code: 3010002 Failed to obtain and/or maintain an active EPA ID. 22 CCR 66262.12

UST DTL:

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217250
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: Propel Fuels, Inc.
Tankid: 2012-NT-2544-2
Tank Status: SEE FILE
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2018-10-25T21:19:04.000
Tank Capacityin Gallons: 4000
Tank Contents: Other Petroleum
Type Of Tank: Double Wall

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-217250
Facility Type (Ust Facility): Motor Vehicle Fueling
Tank Owner Name: Propel Fuels, Inc.
Tankid: 2012-NT-2544-1
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2018-10-25T21:19:04.000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Tank Capacity in Gallons: 8000
Tank Contents: Ethanol
Type Of Tank: Double Wall

Waste and Materials:

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0187227
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-28T00:48:30.000
Chemical Name: NExBTL Renewable Diesel
Common Name: HPR Diesel
Case Number: Not reported

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0187228
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-28T00:48:30.000
Chemical Name: Ethanol Gasoline - E85
Common Name: Ethanol Gasoline - E85
Case Number: 64-17-5

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0162090
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-28T00:48:30.000
Chemical Name: Not reported
Common Name: Unspecified Liquid Waste
Case Number: Not reported

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0162091
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-28T00:48:30.000
Chemical Name: Not reported
Common Name: Unspecified Solid Waste
Case Number: Not reported

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0105472
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-12-08T00:31:06.000
Chemical Name: NExBTL Renewable Diesel

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Common Name:	HPR Diesel
Case Number:	Not reported
Record ID:	DEH2012-HUPFP-217250
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0105473
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2016-12-08T00:31:06.000
Chemical Name:	Ethanol Gasoline - E85
Common Name:	Ethanol Gasoline - E85
Case Number:	64-17-5
Record ID:	DEH2012-HUPFP-217250
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0087042
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-12-08T00:31:06.000
Chemical Name:	Not reported
Common Name:	Unspecified Liquid Waste
Case Number:	Not reported
Record ID:	DEH2012-HUPFP-217250
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0087043
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-12-08T00:31:06.000
Chemical Name:	Not reported
Common Name:	Unspecified Solid Waste
Case Number:	Not reported
Record ID:	DEH2012-HUPFP-217250
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0191339
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-25T21:19:04.000
Chemical Name:	NExBTL Renewable Diesel
Common Name:	HPR Diesel
Case Number:	Not reported
Record ID:	DEH2012-HUPFP-217250
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0191340
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-25T21:19:04.000
Chemical Name:	Ethanol Gasoline - E85
Common Name:	Ethanol Gasoline - E85
Case Number:	64-17-5

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0165652
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T21:19:04.000
Chemical Name: Not reported
Common Name: Unspecified Liquid Waste
Case Number: Not reported

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0165653
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T21:19:04.000
Chemical Name: Not reported
Common Name: Unspecified Solid Waste
Case Number: Not reported

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0144968
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-07T00:54:09.000
Chemical Name: NExBTL Renewable Diesel
Common Name: HPR Diesel
Case Number: Not reported

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0144969
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-07T00:54:09.000
Chemical Name: Ethanol Gasoline - E85
Common Name: Ethanol Gasoline - E85
Case Number: 64-17-5

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0123624
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-07T00:54:09.000
Chemical Name: Not reported
Common Name: Unspecified Liquid Waste
Case Number: Not reported

Record ID: DEH2012-HUPFP-217250
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Active Permit: Y
Child Record Id: DEH2017-HWAST-0123625
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-07T00:54:09.000
Chemical Name: Not reported
Common Name: Unspecified Solid Waste
Case Number: Not reported

SWEEPS UST:

Status: Active
Comp Number: 15306
Number: 9
Board Of Equalization: 44-000074
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-015306-000001
Tank Status: A
Capacity: 12000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: REG UNLEADED
Number Of Tanks: 4

Status: Active
Comp Number: 15306
Number: 9
Board Of Equalization: 44-000074
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-015306-000002
Tank Status: A
Capacity: 12000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: LEADED
Number Of Tanks: Not reported

Status: Active
Comp Number: 15306
Number: 9
Board Of Equalization: 44-000074
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-015306-000003
Tank Status: A
Capacity: 12000
Active Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Tank Use: M.V. FUEL
STG: P
Content: LEADED
Number Of Tanks: Not reported

Status: Active
Comp Number: 15306
Number: 9
Board Of Equalization: 44-000074
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-015306-000004
Tank Status: A
Capacity: 8000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: Not reported

EMI:

Year: 2000
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 2
Reactive Organic Gases Tons/Yr: 2
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2001
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 2
Reactive Organic Gases Tons/Yr: 2
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Year: 2002
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 2
Reactive Organic Gases Tons/Yr: 2
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0

Year: 2003
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 2
Reactive Organic Gases Tons/Yr: 2
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0

Year: 2004
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 2.1230566
Reactive Organic Gases Tons/Yr: 2.1230566
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0

Year: 2005
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 2.1230566
Reactive Organic Gases Tons/Yr: 2.1230566
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2006
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.08
Reactive Organic Gases Tons/Yr: 3.08
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2007
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.08
Reactive Organic Gases Tons/Yr: 3.08
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2008
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.08
Reactive Organic Gases Tons/Yr: 3.08
Carbon Monoxide Emissions Tons/Yr: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2009
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.0800000000000001
Reactive Organic Gases Tons/Yr: 3.0800000000000001
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2010
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.0800000000000001
Reactive Organic Gases Tons/Yr: 3.0800000000000001
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2011
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.08
Reactive Organic Gases Tons/Yr: 3.08
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.08
Reactive Organic Gases Tons/Yr: 3.08
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2013
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.08
Reactive Organic Gases Tons/Yr: 3.08
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2014
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.08
Reactive Organic Gases Tons/Yr: 3.08
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2015
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.08
Reactive Organic Gases Tons/Yr: 3.08
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0

Year: 2016
County Code: 37
Air Basin: SD
Facility ID: 1351
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.08
Reactive Organic Gases Tons/Yr: 3.08
Carbon Monoxide Emissions Tons/Yr: Not reported
NOX - Oxides of Nitrogen Tons/Yr: Not reported
SOX - Oxides of Sulphur Tons/Yr: Not reported
Particulate Matter Tons/Yr: Not reported
Part. Matter 10 Micrometers and Smllr Tons/Yr: Not reported

HAZNET:

Facility Name: KEARNY MESA 76 LLC #851649
envid: S103472124
Year: 2017
GEPAID: CAL000408795
Contact: LISA THOMPSON
Telephone: 8182065700
Mailing Name: Not reported
Mailing Address: 3860 KEARNY MESA RD.
Mailing City,St,Zip: SAN DIEGO, CA 921110000
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Tons: 0.275
Cat Decode: Aqueous solution with total organic residues less than 10 percent
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

envid: S103472124
Year: 2017
GEPAID: CAL000408795
Contact: LISA THOMPSON
Telephone: 8182065700
Mailing Name: Not reported
Mailing Address: 3860 KEARNY MESA RD.
Mailing City,St,Zip: SAN DIEGO, CA 921110000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Gen County: San Diego
TSD EPA ID: CAT000646117
TSD County: Kings
Waste Category: Other inorganic solid waste
Disposal Method: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Tons: 4.25
Cat Decode: Other inorganic solid waste
Method Decode: Landfill Or Surface Impoundment That Will Be Closed As Landfill(To Include On-Site Treatment And/Or Stabilization)
Facility County: San Diego

envid: S103472124
Year: 2017
GEPAID: CAL000408795
Contact: LISA THOMPSON
Telephone: 8182065700
Mailing Name: Not reported
Mailing Address: 3860 KEARNY MESA RD.
Mailing City,St,Zip: SAN DIEGO, CA 921110000
Gen County: San Diego
TSD EPA ID: CAT080013352
TSD County: Los Angeles
Waste Category: Unspecified oil-containing waste
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration, Organics Recovery Ect
Tons: 0.35445
Cat Decode: Unspecified oil-containing waste
Method Decode: Other Recovery Of Reclamation For Reuse Including Acid Regeneration, Organics Recovery Ect
Facility County: San Diego

envid: S103472124
Year: 2015
GEPAID: CAL000377709
Contact: JENNIFER BETZ
Telephone: 8478880276
Mailing Name: Not reported
Mailing Address: 2496 TECHNOLOGY DR
Mailing City,St,Zip: ELGIN, IL 60124
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Not reported
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: Not reported
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S103472124
Year: 2015
GEPAID: CAL000377709
Contact: JENNIFER BETZ
Telephone: 8478880276
Mailing Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

S103472124

Mailing Address: 2496 TECHNOLOGY DR
Mailing City,St,Zip: ELGIN, IL 60124
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.405
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access additional CA_HAZNET: detail in the EDR Site Report.

**Z186
NW
< 1/8
0.084 mi.
444 ft.**

**KEARNY MESA SHELL SERVICE
3860 KEARNY MESA RD
SAN DIEGO, CA
Site 5 of 9 in cluster Z**

**EDR Hist Auto 1008997364
N/A**

**Actual:
403 ft.**

EDR Hist Auto

**Focus Map:
1**

Year:	Name:	Type:
1966	GRAGO S DICK SHELL SERVICE	GASOLINE STATIONS
1969	SHED JAMES W	Gasoline Service Stations
1970	SHED JAMES W	Gasoline Service Stations
1971	SHED JAMES W	Gasoline Service Stations
1972	SHED JAMES W	Gasoline Service Stations
1973	SHED JAMES W	Gasoline Service Stations
1974	SHED JAMES W	Gasoline Service Stations
1975	SHED JAMES W	Gasoline Service Stations
1996	KEARNY MESA SHELL	Gasoline Service Stations
1997	KEARNY MESA SHELL	Gasoline Service Stations
1998	KEARNY MESA SHELL	Gasoline Service Stations
2000	KEARNY MESA SHELL	Gasoline Service Stations
2001	KEARNY MESA SHELL	Gasoline Service Stations
2002	KEARNY MESA SHELL	Gasoline Service Stations
2003	KEARNY MESA SHELL	Gasoline Service Stations
2006	NEW WEST PETROLEUM	Gasoline Service Stations, NEC
2007	NEW WEST PETROLEUM	Gasoline Service Stations, NEC
2008	NEW WEST PETROLEUM	Gasoline Service Stations, NEC

**Z187
NW
< 1/8
0.084 mi.
444 ft.**

**PROPEL BIOFUELS 76
3860 KEARNY MESA ROAD
SAN DIEGO, CA 92111
Site 6 of 9 in cluster Z**

**CA LUST S113099507
CA HAZNET N/A
CA SAN DIEGO CO LOP**

**Actual:
403 ft.**

LUST:

**Focus Map:
1**

Lead Agency: SAN DIEGO RWQCB (REGION 9)
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T10000004590
Global Id: T10000004590
Latitude: 32.8139504779357

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PROPEL BIOFUELS 76 (Continued)

S113099507

Longitude: -117.152194976807
Status: Open - Site Assessment
Status Date: 02/08/2013
Case Worker: CQC
RB Case Number: Not reported
Local Agency: Not reported
File Location: Local Agency
Local Case Number: Not reported
Potential Media Affect: Soil, Under Investigation
Potential Contaminants of Concern: Diesel, Gasoline
Site History: An unauthorized release of petroleum fuel wastes from a leaking underground storage tank (UST) system.

LUST:

Global Id: T10000004590
Contact Type: Regional Board Caseworker
Contact Name: CHARLES Q. CHENG
Organization Name: SAN DIEGO RWQCB (REGION 9)
Address: 2375 NORTHSIDE DRIVE, SUITE 100
City: SAN DIEGO
Email: charles.cheng@waterboards.ca.gov
Phone Number: 6195213359

LUST:

Global Id: T10000004590
Action Type: ENFORCEMENT
Date: 12/30/2016
Action: Technical Correspondence / Assistance / Other

Global Id: T10000004590
Action Type: Other
Date: 01/16/2013
Action: Leak Stopped

Global Id: T10000004590
Action Type: ENFORCEMENT
Date: 05/11/2016
Action: Verbal Communication

Global Id: T10000004590
Action Type: ENFORCEMENT
Date: 10/06/2016
Action: Staff Letter

Global Id: T10000004590
Action Type: ENFORCEMENT
Date: 02/10/2017
Action: Technical Correspondence / Assistance / Other

Global Id: T10000004590
Action Type: ENFORCEMENT
Date: 06/29/2015
Action: Technical Correspondence / Assistance / Other

Global Id: T10000004590
Action Type: ENFORCEMENT
Date: 12/21/2016

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PROPEL BIOFUELS 76 (Continued)

S113099507

Action:	Verbal Communication
Global Id:	T10000004590
Action Type:	ENFORCEMENT
Date:	01/23/2017
Action:	Technical Correspondence / Assistance / Other
Global Id:	T10000004590
Action Type:	ENFORCEMENT
Date:	06/24/2016
Action:	Technical Correspondence / Assistance / Other
Global Id:	T10000004590
Action Type:	Other
Date:	01/31/2013
Action:	Leak Reported
Global Id:	T10000004590
Action Type:	RESPONSE
Date:	09/20/2017
Action:	Site Investigation - Regulator Responded
Global Id:	T10000004590
Action Type:	RESPONSE
Date:	09/01/2017
Action:	Site Investigation Workplan - Regulator Responded
Global Id:	T10000004590
Action Type:	RESPONSE
Date:	11/17/2017
Action:	Soil and Water Investigation Workplan - Regulator Responded
Global Id:	T10000004590
Action Type:	RESPONSE
Date:	09/01/2017
Action:	Site Investigation Workplan - Regulator Responded
Global Id:	T10000004590
Action Type:	ENFORCEMENT
Date:	02/15/2017
Action:	Technical Correspondence / Assistance / Other
Global Id:	T10000004590
Action Type:	ENFORCEMENT
Date:	06/13/2017
Action:	Technical Correspondence / Assistance / Other
Global Id:	T10000004590
Action Type:	RESPONSE
Date:	07/22/2013
Action:	Other Report / Document
Global Id:	T10000004590
Action Type:	ENFORCEMENT
Date:	07/01/2013
Action:	Referral to Regional Board

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PROPEL BIOFUELS 76 (Continued)

S113099507

Global Id: T10000004590
Action Type: ENFORCEMENT
Date: 11/17/2017
Action: Technical Correspondence / Assistance / Other - #11/17/2017

Global Id: T10000004590
Action Type: ENFORCEMENT
Date: 03/08/2013
Action: Notice of Responsibility

Global Id: T10000004590
Action Type: ENFORCEMENT
Date: 06/20/2014
Action: Technical Correspondence / Assistance / Other

Global Id: T10000004590
Action Type: ENFORCEMENT
Date: 07/19/2018
Action: Technical Correspondence / Assistance / Other

Global Id: T10000004590
Action Type: ENFORCEMENT
Date: 08/07/2018
Action: Technical Correspondence / Assistance / Other

Global Id: T10000004590
Action Type: ENFORCEMENT
Date: 09/27/2017
Action: Technical Correspondence / Assistance / Other

Global Id: T10000004590
Action Type: Other
Date: 01/16/2013
Action: Leak Began

Global Id: T10000004590
Action Type: Other
Date: 01/16/2013
Action: Leak Discovery

LUST:
Global Id: T10000004590
Status: Open - Case Begin Date
Status Date: 01/16/2013

Global Id: T10000004590
Status: Open - Site Assessment
Status Date: 02/08/2013

HAZNET:
Facility Name: NEW WEST PETROLEUM SD2 # 1032
envid: S113099507
Year: 2009
GEPAID: CAL000189846
Contact: BOB LACKNER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PROPEL BIOFUELS 76 (Continued)

S113099507

Telephone: 9164430890
Mailing Name: Not reported
Mailing Address: 1831 16TH ST
Mailing City,St,Zip: SACRAMENTO, CA 958116606
Gen County: Not reported
TSD EPA ID: CAT080013352
TSD County: Not reported
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 0.105
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113099507
Year: 2009
GEPAID: CAL000189846
Contact: BOB LACKNER
Telephone: 9164430890
Mailing Name: Not reported
Mailing Address: 1831 16TH ST
Mailing City,St,Zip: SACRAMENTO, CA 958116606
Gen County: Not reported
TSD EPA ID: CAT080013352
TSD County: Not reported
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 0.105
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113099507
Year: 2007
GEPAID: CAL000189846
Contact: M GARCIA, RETAIL TEAM LEADER
Telephone: 9164430890
Mailing Name: Not reported
Mailing Address: 1831 16TH ST
Mailing City,St,Zip: SACRAMENTO, CA 958146606
Gen County: Not reported
TSD EPA ID: CAT080013352
TSD County: Not reported
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 0.02
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113099507
Year: 2007
GEPAID: CAL000189846
Contact: M GARCIA, RETAIL TEAM LEADER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PROPEL BIOFUELS 76 (Continued)

S113099507

Telephone: 9164430890
Mailing Name: Not reported
Mailing Address: 1831 16TH ST
Mailing City,St,Zip: SACRAMENTO, CA 958146606
Gen County: Not reported
TSD EPA ID: CAT080013352
TSD County: Not reported
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 0.02
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: S113099507
Year: 2006
GEPaid: CAL000189846
Contact: FOAD NADERZAD OPERATIONS MGR
Telephone: 9164430890
Mailing Name: Not reported
Mailing Address: 1831 16TH ST
Mailing City,St,Zip: SACRAMENTO, CA 958146606
Gen County: Not reported
TSD EPA ID: CAT080013352
TSD County: Not reported
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Recycler
Tons: 0.22
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
7 additional CA_HAZNET: record(s) in the EDR Site Report.

SAN DIEGO CO LOP:

Record ID: DEH2013-LSAM-000161
Record Status: Completed
Opened Date: 02/08/2013
Parcel Number: 356-362-30-00
Case Type: LOP - Local Oversight Program
Historical Name: Propel Biofuels 76
SWRCB Global ID: T10000004590
Funding: S - LOP State Fund
Lead Agency: RWQCB
Lead Agency Date: 07/01/2013
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: CWA CITY OF SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 3
Latitude: 32.8141617
Longitude: -117.1519416
X MapCoord: 6284501.973

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PROPEL BIOFUELS 76 (Continued)

S113099507

Y MapCoord: 1877146.970

**Z188
NW
< 1/8
0.084 mi.
444 ft.**

**KEARNY MESA 76, LLC.
3860 KEARNY MESA RD
SAN DIEGO, CA 92111
Site 7 of 9 in cluster Z**

**CA SAN DIEGO CO. SAM
CA UST
CA San Diego Co. HMMD
CA SAN DIEGO CO LOP**

**U003789507
N/A**

**Actual:
403 ft.**

SAN DIEGO CO. SAM:

Case Number: H15306-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: Soils Only
Facility Status: Closed Case
Date: 3/18/1999
Date Began: 3/27/1998

**Focus Map:
1**

UST:

Facility ID: 37-000-217190
Permitting Agency: San Diego County Department of Environmental Health
Latitude: 32.81416
Longitude: -117.15194

Facility ID: 37-000-217250
Permitting Agency: San Diego County Department of Environmental Health
Latitude: 32.81416
Longitude: -117.15194

Facility ID: H15306
Permitting Agency: SAN DIEGO COUNTY
Latitude: 32.815511
Longitude: -117.150593

HMMD SAN DIEGO:

Permit Number: 115306
Business Type: 6HK28
EPA Id Number: CAL000189845
APN: 356-362-30-00
Last HMMD Inspection: 06/18/2008
Facility Telephone: 858-571-0069
Permit Status: INAC
Permit Expiration: 04/30/2009
Date Last Updated: 11/02/2012
Facility Owner: NEW WEST PETROLEUM SD 2, INC.
Facility Mailing Address: 1831 SIXTEENTH ST
Facility Mailing City: SACRAMENTO
Facility Mailing State: CA
Facility Mailing Zip: 95814-
UST Owner: NEW WEST PETROLEUM LLC
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Violations Inactive Permits:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

U003789507

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 03/03/2003
Violation Code: 6HV1006
Violation: HMBP: INVENTORY INADEQUATE
Violation Citation: Business Plan inventory does not list all hazardous materials on site in disclosable quantities. HSC 25504(a), 25503.5
Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 03/03/2003
Violation Code: 6HV3107
Violation: MONITORING PROCEDURES NOT AVAIL/TO HMD
Violation Citation: Monitoring procedures not available/complete/submitted to HMD 2632(b)& (d), 2634(d), 2641(h), 2711(a)(9)
Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 03/03/2003
Violation Code: 6HV3109
Violation: NO SCALED PLOT PLAN AVAIL/TO HMD
Violation Citation: Scaled Plot plan showing tank, piping & equipment location not available/complete/submitted to HMD. 2711(a)(8), 2632(d)(1) (C)
Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 03/03/2003
Violation Code: 6HV3158
Violation: ALL OPERATING CONDITIONS NOT MET
Violation Citation: All permit operating conditions not met. 25284; 2712
Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 03/03/2003
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional. 2630, 2641(j), 2632
Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 03/03/2003
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional. 2630, 2641(j), 2632
Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 01/27/2004
Violation Code: 6HV3266

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

U003789507

Violation: DISP. CONT. NOT INSTALLED
Violation Citation: Under dispenser containment not installed. Required by December 31, 2003. 2636(h)
Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 01/27/2004
Violation Code: 6HV3266
Violation: DISP. CONT. NOT INSTALLED
Violation Citation: Under dispenser containment not installed. Required by December 31, 2003. 2636(h)
Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 01/27/2004
Violation Code: 6HV3266
Violation: DISP. CONT. NOT INSTALLED
Violation Citation: Under dispenser containment not installed. Required by December 31, 2003. 2636(h)
Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 01/27/2004
Violation Code: 6HV3266
Violation: DISP. CONT. NOT INSTALLED
Violation Citation: Under dispenser containment not installed. Required by December 31, 2003. 2636(h)
Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 05/09/2005
Violation Code: 6HV1002
Violation: HMBP NOT ESTABLISHED/IMPLEMENTED.
Violation Citation: Hazardous materials handler has not established/implemented a business plan. HSC 25503.5(a)
Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 05/09/2005
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 05/09/2005
Violation Code: 6HV3501
Violation: NO MONTHLY 0.2 GPH TANK GAUGING TEST
Violation Citation: SINGLE WALLED TANKS:OPTION 1: Monthly 0.2 gallon per hour tank gauging test not performed. 2643(b)(1)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

U003789507

Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 05/09/2005
Violation Code: 6HV3501
Violation: NO MONTHLY 0.2 GPH TANK GAUGING TEST
Violation Citation: SINGLE WALLED TANKS:OPTION 1: Monthly 0.2 gallon per hour tank gauging test not performed. 2643(b)(1)

Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 05/09/2005
Violation Code: 6HV3501
Violation: NO MONTHLY 0.2 GPH TANK GAUGING TEST
Violation Citation: SINGLE WALLED TANKS:OPTION 1: Monthly 0.2 gallon per hour tank gauging test not performed. 2643(b)(1)

Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 05/09/2005
Violation Code: 6HV3501
Violation: NO MONTHLY 0.2 GPH TANK GAUGING TEST
Violation Citation: SINGLE WALLED TANKS:OPTION 1: Monthly 0.2 gallon per hour tank gauging test not performed. 2643(b)(1)

Activity: Inactive Permit

Permit Number: 115306
Update Date: 11/02/2012
Inspection Date: 05/07/2007
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)

Activity: Inactive Permit

UST:

UST Name: UNDERGROUND TANK 115306 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 115306
Tank Type: SINGLE WALL
Additional Id: RT0844, RT2564
Capacity Gallons: 12000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1983-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: PRESSURE
Monitor Code: 13
UST Monitor Method: SW TANK W/ CERT ATG SW PRESSURE PIPE W/ SHUTOFF LLD + CERT ATG: IN-TANK TEST MONTHLY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 115306 T002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

U003789507

Last Update: 2012-11-02 14:17:38
Permit Number: 115306
Tank Type: SINGLE WALL
Additional Id: RT0844, RT2564
Capacity Gallons: 12000
UST Contents: MIDGRADE UNLEADED
Other Content Info: MIDGRADE UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1983-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: PRESSURE
Monitor Code: 13
UST Monitor Method: SW TANK W/ CERT ATG SW PRESSURE PIPE W/ SHUTOFF LLD + CERT ATG:
IN-TANK TEST MONTHLY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 115306 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 115306
Tank Type: SINGLE WALL
Additional Id: RT0844, RT2564
Capacity Gallons: 12000
UST Contents: PREMIUM UNLEADED
Other Content Info: PREMIUM UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1983-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: PRESSURE
Monitor Code: 13
UST Monitor Method: SW TANK W/ CERT ATG SW PRESSURE PIPE W/ SHUTOFF LLD + CERT ATG:
IN-TANK TEST MONTHLY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 115306 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 115306
Tank Type: SINGLE WALL
Additional Id: RT0844, RT2564
Capacity Gallons: 8000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: Not reported
Pipe Type: SINGLE WALL
Delivery System: PRESSURE
Monitor Code: 13
UST Monitor Method: SW TANK W/ CERT ATG SW PRESSURE PIPE W/ SHUTOFF LLD + CERT ATG:
IN-TANK TEST MONTHLY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

SAN DIEGO CO LOP:

Record ID: DEH1998-LSAM-H15306-001
Record Status: Completed
Opened Date: 09/01/1998
Parcel Number: 356-362-30-00
Case Type: LOP - Local Oversight Program

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA 76, LLC. (Continued)

U003789507

Historical Name: SHELL SERVICE STATION
SWRCB Global ID: T0607302484
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 09/03/1998
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 3
Latitude: 32.8141617
Longitude: -117.1519416
X MapCoord: 6284501.973
Y MapCoord: 1877146.970

**Z189
NW
< 1/8
0.084 mi.
444 ft.**

**SHELL OIL SERV STATION SAN DIEGO
3860 KEARNEY MESA
SAN DIEGO, CA 92117
Site 8 of 9 in cluster Z**

**RCRA-SQG
CA HIST UST
FINDS
ECHO**

**1000287988
CAD980695597**

**Actual:
403 ft.**

RCRA-SQG:

Date form received by agency: 09/01/1996

**Focus Map:
1**

Facility name: SHELL OIL SERV STATION SAN DIEGO
Facility address: 3860 KEARNEY MESA
SAN DIEGO, CA 92117

EPA ID: CAD980695597
Mailing address: PO BOX 4848
ANAHEIM, CA 92803

Contact: Not reported
Contact address: Not reported
Not reported

Contact country: US
Contact telephone: Not reported
Contact email: Not reported

EPA Region: 09

Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: SHELL OIL CO
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999

Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported

Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private

Owner/Operator Type: Owner
Owner/Op start date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL SERV STATION SAN DIEGO (Continued)

1000287988

Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999

Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 12/02/1982
Site name: SHELL OIL SERV STATION SAN DIEGO
Classification: Large Quantity Generator

Violation Status: No violations found

HIST UST:

File Number: 0002F31A
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002F31A.pdf>
Region: STATE
Facility ID: 00000056810
Facility Type: Gas Station
Other Type: Not reported
Contact Name: Not reported
Telephone: 6195710547
Owner Name: SHELL OIL COMPANY
Owner Address: P.O. BOX 4848
Owner City, St, Zip: ANAHEIM, CA 92803
Total Tanks: 0003

Tank Num: 001
Container Num: 1
Year Installed: 1983
Tank Capacity: 00012000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SHELL OIL SERV STATION SAN DIEGO (Continued)

1000287988

Tank Used for: PRODUCT
Type of Fuel: UNLEADED
Container Construction Thickness: 1/4
Leak Detection: Stock Inventor, Groundwater Monitoring Well, 10

Tank Num: 002
Container Num: 2
Year Installed: 1983
Tank Capacity: 00012000
Tank Used for: PRODUCT
Type of Fuel: REGULAR
Container Construction Thickness: 1/4
Leak Detection: Stock Inventor, Groundwater Monitoring Well, 10

Tank Num: 003
Container Num: 3
Year Installed: 1983
Tank Capacity: 00012000
Tank Used for: PRODUCT
Type of Fuel: PREMIUM
Container Construction Thickness: 1/4
Leak Detection: Stock Inventor, Groundwater Monitoring Well, 10

Click here for Geo Tracker PDF:

FINDS:

Registry ID: 110002670832

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000287988
Registry ID: 110002670832
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002670832>

**Z190
NW
< 1/8
0.084 mi.
444 ft.**

**KEARNY MESA EXXON
3860 KEARNY MESA RD
SAN DIEGO, CA 92111
Site 9 of 9 in cluster Z**

**CA LUST S103817970
CA HIST CORTESE N/A**

**Actual:
403 ft.
Focus Map:
1**

LUST:
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607302484
Global Id: T0607302484

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA EXXON (Continued)

S103817970

Latitude: 32.8140303377395
Longitude: -117.152328930164
Status: Completed - Case Closed
Status Date: 03/18/1999
Case Worker: Not reported
RB Case Number: 9UT3716
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H15306-001
Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:

Global Id: T0607302484
Action Type: Other
Date: 09/01/1998
Action: Leak Reported

Global Id: T0607302484
Action Type: ENFORCEMENT
Date: 03/15/1999
Action: Closure/No Further Action Letter - #H15306-001

Global Id: T0607302484
Action Type: Other
Date: 03/27/1998
Action: Leak Began

Global Id: T0607302484
Action Type: Other
Date: 03/27/1998
Action: Leak Discovery

Global Id: T0607302484
Action Type: ENFORCEMENT
Date: 09/09/1998
Action: Notice of Responsibility

Global Id: T0607302484
Action Type: Other
Date: 03/27/1998
Action: Leak Stopped

LUST:

Global Id: T0607302484
Status: Completed - Case Closed
Status Date: 03/18/1999

Global Id: T0607302484
Status: Open - Case Begin Date
Status Date: 03/27/1998

HIST CORTESE:

Region: CORTESE
Facility County Code: 37

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KEARNY MESA EXXON (Continued)

S103817970

Reg By: LTNKA
Reg Id: 9UT3716

**191
NNW
< 1/8
0.086 mi.
452 ft.**

**ULTRASIGNS, INC
9025 BALBOA AVENUE SUITE 150
SAN DIEGO, CA 92123**

**RCRA-SQG 1012175731
CAL000289019**

**Actual:
429 ft.**

RCRA-SQG:

Date form received by agency: 04/28/2008

**Focus Map:
1**

Facility name: ULTRASIGNS, INC
Facility address: 9025 BALBOA AVENUE SUITE 150
SAN DIEGO, CA 92123

EPA ID: CAL000289019
Contact: JEFF C SINNOTT
Contact address: Not reported
Not reported
Contact country: US
Contact telephone: 858-569-1400
Telephone ext.: 4128
Contact email: JSINNOTT@ULTRASIGNS.COM
EPA Region: 09

Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: 9025 BALBOA, INC
Owner/operator address: 9025 BALBOA AVE SUITE 100
SAN DIEGO, CA 92123

Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 11/01/2004
Owner/Op end date: Not reported

Owner/operator name: ULTRASIGNS, INC
Owner/operator address: Not reported
Not reported

Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 11/01/2004
Owner/Op end date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ULTRASIGNS, INC (Continued)

1012175731

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D009
. Waste name: MERCURY

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

192
NNW
< 1/8
0.087 mi.
459 ft.

SCIENTIFIC ATLANTA GPD
8911 BLABOA AVE
SAN DIEGO, CA 92123

RCRA-SQG
CA San Diego Co. HMMD
FINDS
ECHO

1000208797
CAD000144626

Actual:
425 ft.

Focus Map:
1

RCRA-SQG:

Date form received by agency: 06/03/1987

Facility name: SCIENTIFIC ATLANTA GPD

Facility address: 8911 BLABOA AVE
SAN DIEGO, CA 92123

EPA ID: CAD000144626

Contact: KENETH DAVIS

Contact address: 8911 BLABOA AVE
SAN DIEGO, CA 92123

Contact country: US

Contact telephone: 619-268-7243

Contact email: Not reported

EPA Region: 09

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: SCIENTIFIC ATLANTA

Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999

Owner/operator country: Not reported

Owner/operator telephone: 415-555-1212

Owner/operator email: Not reported

Owner/operator fax: Not reported

Owner/operator extension: Not reported

Legal status: Private

Owner/Operator Type: Owner

Owner/Op start date: Not reported

Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED

Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999

Owner/operator country: Not reported

Owner/operator telephone: 415-555-1212

Owner/operator email: Not reported

Owner/operator fax: Not reported

Owner/operator extension: Not reported

Legal status: Private

Owner/Operator Type: Operator

Owner/Op start date: Not reported

Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No

Mixed waste (haz. and radioactive): No

Recycler of hazardous waste: No

Transporter of hazardous waste: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SCIENTIFIC ATLANTA GPD (Continued)

1000208797

Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

HMMD SAN DIEGO:

Permit Number: 109894
Business Type: Not reported
EPA Id Number: CAX000144626
APN: 369-150-06-00
Last HMMD Inspection: 10/18/1988
Facility Telephone: 858-268-7243
Permit Status: INAC
Permit Expiration: 10/18/1988
Date Last Updated: 11/02/2012
Facility Owner: SCIENTIFIC ATLANTA
Facility Mailing Address: P O BOX 23575
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92193-3575
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

FINDS:

Registry ID: 110002626677

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000208797
Registry ID: 110002626677
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002626677>

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

193
West
< 1/8
0.087 mi.
460 ft.

ECONO LUBE N TUNE & BRAKES #163
7979 AERO DR
SAN DIEGO, CA

CA AST **A100345713**
N/A

Actual:
404 ft.

AST:

Focus Map:
1

Certified Unified Program Agencies: San Diego
Owner: CHRISTOPHER SANCHEZ
Total Gallons: 1350
CERSID: Not reported
Facility ID: Not reported
Business Name: Not reported
Phone: Not reported
Fax: Not reported
Mailing Address: Not reported
Mailing Address City: Not reported
Mailing Address State: Not reported
Mailing Address Zip Code: Not reported
Operator Name: Not reported
Operator Phone: Not reported
Owner Phone: Not reported
Owner Mail Address: Not reported
Owner State: Not reported
Owner Zip Code: Not reported
Owner Country: Not reported
Property Owner Name: Not reported
Property Owner Phone: Not reported
Property Owner Mailing Address: Not reported
Property Owner City: Not reported
Property Owner Stat : Not reported
Property Owner Zip Code: Not reported
Property Owner Country: Not reported
EPAID: Not reported

AB194
NNW
< 1/8
0.088 mi.
465 ft.

SAN DIEGO PORSCHE RESTORATIONS
8861 BALBOA AVE
SAN DIEGO, CA
Site 1 of 2 in cluster AB

EDR Hist Auto **1008996965**
N/A

Actual:
425 ft.

EDR Hist Auto

Focus Map:
1

Year:	Name:	Type:
1980	SAN DIEGO PORSCHE RESTORATIONS	A T S AUTOMATIC
1980	GENTLE BEN ENTERPRISES	A T S AUTOMATIC
1980	SCHIEBEL AUTOMOTIVE ENG	A T S AUTOMATIC
1984	SCHIEBEL AUTOMOTIVE ENG	A T S AUTOMATIC
1984	SAN DIEGO PORSCHE RESTORATIONS	A T S AUTOMATIC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AC195
WNW
< 1/8
0.101 mi.
532 ft.
HIPP MARINE SERVICES INC
4070 KEARNY MESA RD
SAN DIEGO, CA 92111
Site 1 of 2 in cluster AC

CA LUST
S100726145
CA SAN DIEGO CO. SAM
CA San Diego Co. HMM
CA HIST CORTESE
CA SAN DIEGO CO LOP
N/A

Actual:
406 ft.

Focus Map:
1

LUST:

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607301653
Global Id: T0607301653
Latitude: 32.815562
Longitude: -117.151235
Status: Completed - Case Closed
Status Date: 02/28/1997
Case Worker: Not reported
RB Case Number: 9UT2891
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H03121-001
Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:

Global Id: T0607301653
Action Type: Other
Date: 08/08/1994
Action: Leak Reported

Global Id: T0607301653
Action Type: ENFORCEMENT
Date: 02/11/1997
Action: Closure/No Further Action Letter - #H03121-001

Global Id: T0607301653
Action Type: Other
Date: 08/08/1994
Action: Leak Began

Global Id: T0607301653
Action Type: Other
Date: 08/08/1994
Action: Leak Discovery

Global Id: T0607301653
Action Type: ENFORCEMENT
Date: 08/30/1994
Action: Notice of Responsibility

Global Id: T0607301653
Action Type: Other
Date: 08/08/1994
Action: Leak Stopped

LUST:

Global Id: T0607301653
Status: Completed - Case Closed
Status Date: 02/28/1997

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HIPP MARINE SERVICES INC (Continued)

S100726145

Global Id: T0607301653
Status: Open - Case Begin Date
Status Date: 08/08/1994

SAN DIEGO CO. SAM:

Case Number: H03121-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: Soils Only
Facility Status: Closed Case
Date: 2/28/1997
Date Began: 8/8/1994

HMMD SAN DIEGO:

Permit Number: 103121
Business Type: 6HK33
EPA Id Number: CAL000173926
APN: 356-362-03-00
Last HMMD Inspection: 10/27/2009
Facility Telephone: 858-541-2960
Permit Status: OPEN
Permit Expiration: 10/31/2013
Date Last Updated: 11/02/2012
Facility Owner: RICHARD C. HIPP
Facility Mailing Address: 4070 KEARNY MESA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92111-3730
UST Owner: EUGENE W LUNI
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 103121
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING : 4 CYCLE ENGINE,
Other Information: 2 CYCLE OUTBOARD GEAR LUBE
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 103121
Update Date: 11/02/2012
Case Number: 13100-58-3
Name: POTASSIUM HYDROXIDE, 5% : HEAVY DUTY CLEANER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 103121

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HIPP MARINE SERVICES INC (Continued)

S100726145

Update Date: 11/02/2012
Case Number: 68476-85-7
Name: PROPANE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 103121
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: PARTS WASHER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103121
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: WASTE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103121
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information: GASOLINE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103121
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 103121
Update Date: 11/02/2012
Inspection Date: 10/27/2009
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR 262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 103121 T001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HIPP MARINE SERVICES INC (Continued)

S100726145

Last Update: 2012-11-02 14:17:38
Permit Number: 103121
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 2000
UST Contents: LEADED
Other Content Info: LEADED
Reg Status: REMOVED
Remove Close Date: 1994-08-08 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT2891

SAN DIEGO CO LOP:

Record ID: DEH1994-LSAM-H03121-001
Record Status: Completed
Opened Date: 08/08/1994
Parcel Number: 356-362-03-00
Case Type: LOP - Local Oversight Program
Historical Name: GEMINI MOVING SPECIALISTS
SWRCB Global ID: T0607301653
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 08/10/1994
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Thomas Bros Map Page Grid: 1249 B 3
Latitude: 32.8155694
Longitude: -117.1512929
X MapCoord: 6284760.535
Y MapCoord: 1877714.297

AC196 GEMINI MOVING SPECIALISTS
WNW 4070 KEARNY MESA RD
< 1/8 SAN DIEGO, CA 92111
0.101 mi.
532 ft. Site 2 of 2 in cluster AC

CA LUST S102430682
CA SWEEPS UST N/A

Actual: 406 ft. LUST REG 9:
Region: 9
Focus Map: 1 Status: Case Closed
Case Number: 9UT2891
Local Case: H03121-001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GEMINI MOVING SPECIALISTS (Continued)

S102430682

Substance: Unleaded Gasoline
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Tank
Cause: Corrosion
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 08/08/1994
Date Stopped: 08/08/1994
Confirm Date: 08/12/1994
Submit Workplan: Not reported
Prelim Assess: 08/08/1994
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 08/08/1994
Enforce Date: 8/30/94
Closed Date: 2/27/97
Enforce Type: SEL
Pilot Program: LOP
Basin Number: 907.11
GW Depth: >65'
Beneficial Use: MUNBU
NPDES Number: Not reported
Priority: 3B
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

SWEEPS UST:

Status: Active
Comp Number: 3121
Number: 9
Board Of Equalization: 44-021799
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-003121-000001
Tank Status: A
Capacity: 2000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: W
Content: LEADED
Number Of Tanks: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

AD197 **AMERICAN OIL CO** **EDR Hist Auto** **1008998380**
WNW **3833 CONVOY ST** **N/A**
< 1/8 **SAN DIEGO, CA**
0.103 mi.
544 ft. **Site 1 of 2 in cluster AD**

Actual: EDR Hist Auto
406 ft.

Focus Map:	Year:	Name:	Type:
1	1966	AMERICAN OIL CO	GASOLINE STATIONS
	1970	BENNETT S AMERICAN SERVICE	GASOLINE STATIONS
	1975	THRIFTY OIL CO	GASOLINE STATIONS
	1985	MY MECHANIC	General Automotive Repair Shops
	1986	MY MECHANIC	General Automotive Repair Shops
	1986	TEAM AUTOMOTIVE	General Automotive Repair Shops
	1987	TEAM AUTOMOTIVE	General Automotive Repair Shops
	1987	MY MECHANIC	General Automotive Repair Shops

AD198 **MY MECHANIC** **CA LUST** **S100728715**
WNW **3833 CONVOY ST** **CA SAN DIEGO CO. SAM** **N/A**
< 1/8 **SAN DIEGO, CA 92111** **CA San Diego Co. HMMD**
0.103 mi. **CA HIST CORTESE**
544 ft. **Site 2 of 2 in cluster AD** **CA SAN DIEGO CO LOP**

Actual: LUST REG 9:
406 ft.

Focus Map: 1

Region:	9
Status:	Case Closed
Case Number:	9UT2884
Local Case:	H12601-001
Substance:	Gasoline
Qty Leaked:	0
Abate Method:	Not reported
Local Agency:	San Diego
How Found:	Not reported
How Stopped:	Not reported
Source:	Not reported
Cause:	Not reported
Lead Agency:	Local Agency
Case Type:	Soil only
Date Found:	06/29/1987
Date Stopped:	/ /
Confirm Date:	/ /
Submit Workplan:	Not reported
Prelim Assess:	/ /
Desc Pollution:	Not reported
Remed Plan:	/ /
Remed Action:	Not reported
Began Monitor:	Not reported
Release Date:	06/29/1987
Enforce Date:	Not reported
Closed Date:	6/30/87
Enforce Type:	Not reported
Pilot Program:	LOP
Basin Number:	Not reported
GW Depth:	Not reported
Beneficial Use:	Not reported
NPDES Number:	Not reported
Priority:	Low priority. Priority ranking can change over time.
File Dispn:	Administratively opened on database, however no file physically exists
Interim Remedial Actions:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MY MECHANIC (Continued)

S100728715

Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

LUST:

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607301646
Global Id: T0607301646
Latitude: 32.8133543497897
Longitude: -117.152255900525
Status: Completed - Case Closed
Status Date: 06/30/1987
Case Worker: KH
RB Case Number: 9UT2884
Local Agency: SAN DIEGO COUNTY LOP
File Location: Local Agency
Local Case Number: H12601-001
Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:

Global Id: T0607301646
Contact Type: Local Agency Caseworker
Contact Name: KEVIN HEATON
Organization Name: SAN DIEGO COUNTY LOP
Address: P.O. Box 129261
City: San Diego
Email: kevin.heaton@sdcounty.ca.gov
Phone Number: Not reported

LUST:

Global Id: T0607301646
Action Type: Other
Date: 06/29/1987
Action: Leak Reported

Global Id: T0607301646
Action Type: Other
Date: 06/29/1987
Action: Leak Began

Global Id: T0607301646
Action Type: Other
Date: 06/29/1987
Action: Leak Discovery

LUST:

Global Id: T0607301646
Status: Completed - Case Closed
Status Date: 06/30/1987

Global Id: T0607301646
Status: Open - Case Begin Date
Status Date: 06/29/1987

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MY MECHANIC (Continued)

S100728715

SAN DIEGO CO. SAM:

Case Number: H12601-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - State Fund
Facility Type: Soils Only
Facility Status: Closed Case
Date: 6/30/1987
Date Began: 6/29/1987

HMMD SAN DIEGO:

Permit Number: 112601
Business Type: Not reported
EPA Id Number: Not reported
APN: 356-362-28-00
Last HMMD Inspection: Not reported
Facility Telephone: Not reported
Permit Status: INAC
Permit Expiration: Not reported
Date Last Updated: 11/02/2012
Facility Owner: MY MECHANIC
Facility Mailing Address: 3833 CONVOY ST
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92111-3721
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT2884

SAN DIEGO CO LOP:

Record ID: DEH1987-LSAM-H12601-001
Record Status: Completed
Opened Date: 06/29/1987
Parcel Number: 356-362-28-00
Case Type: LOP - Local Oversight Program
Historical Name: SOCOR PROPERTIES
SWRCB Global ID: T0607301646
Funding: S - LOP State Fund
Lead Agency: DEH/SAM
Lead Agency Date: 06/29/1987
Census Tract: 85.11
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MY MECHANIC (Continued)

S100728715

Thomas Bros Map Page Grid: 1249 B 3
Latitude: 32.8147639
Longitude: -117.1525077
X MapCoord: 6284363.267
Y MapCoord: 1877422.762

AE199 **TELEDYNE RYAN ELECTRONICS**
NNE **8650 BALBOA AVE**
< 1/8 **SAN DIEGO, CA 92123**
0.104 mi.
548 ft. **Site 1 of 3 in cluster AE**

Actual:
419 ft.

Focus Map:
1

SEMS-ARCHIVE **1000201835**
CORRACTS **CAD990833014**
RCRA-TSDF
RCRA-SQG
CA ENVIROSTOR
CA SAN DIEGO CO. SAM
CA San Diego Co. HMMD
2020 COR ACTION
CA HAZNET
CA HIST CORTESE
CA SAN DIEGO CO LOP
CA CIWQS

SEMS Archive:

Site ID: 0902621
EPA ID: CAD990833014
Cong District: 41
FIPS Code: 06073
FF: N
NPL: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information
Latitude: 32.822222
Longitude: -117.139167

SEMS Archive Detail:

Region: 09
Site ID: 0902621
EPA ID: CAD990833014
Site Name: TELEDYNE RYAN ELECTRONICS CO
NPL: N
FF: N
OU: 00
Action Code: VS
Action Name: ARCH SITE
SEQ: 1
Start Date: Not reported
Finish Date: 1989-01-18 05:00:00
Qual: Not reported
Current Action Lead: EPA Perf In-Hse

Region: 09
Site ID: 0902621
EPA ID: CAD990833014
Site Name: TELEDYNE RYAN ELECTRONICS CO
NPL: N
FF: N
OU: 00
Action Code: DS
Action Name: DISCVRY
SEQ: 1
Start Date: 1980-08-01 04:00:00
Finish Date: 1980-08-01 04:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Qual: Not reported
Current Action Lead: EPA Perf

Region: 09
Site ID: 0902621
EPA ID: CAD990833014
Site Name: TELEDYNE RYAN ELECTRONICS CO
NPL: N
FF: N
OU: 00
Action Code: PA
Action Name: PA
SEQ: 1
Start Date: Not reported
Finish Date: 1989-01-18 05:00:00
Qual: N
Current Action Lead: EPA Perf

Region: 09
Site ID: 0902621
EPA ID: CAD990833014
Site Name: TELEDYNE RYAN ELECTRONICS CO
NPL: N
FF: N
OU: 00
Action Code: PA
Action Name: PA
SEQ: 2
Start Date: 1985-01-01 06:00:00
Finish Date: 1985-02-01 06:00:00
Qual: L
Current Action Lead: St Perf

CORRACTS:

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20170928
Action: CA200 - RFI Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20160602
Action: CA340 - CMS Report Received
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: Not reported

Schedule end date: Not reported

EPA ID: CAD990833014

EPA Region: 9

Area Name: ENTIRE FACILITY

Actual Date: 20160418

Action: CA190 - RFI Report Received

NAICS Code(s): 332999 334412 334412 334511

All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: Not reported

Schedule end date: Not reported

EPA ID: CAD990833014

EPA Region: 9

Area Name: ENTIRE FACILITY

Actual Date: 20160121

Action: CA300 - CMS Workplan Approved

NAICS Code(s): 332999 334412 334412 334511

All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: 20160220

Schedule end date: Not reported

EPA ID: CAD990833014

EPA Region: 9

Area Name: ENTIRE FACILITY

Actual Date: 20151117

Action: CA150 - RFI Workplan Approved

NAICS Code(s): 332999 334412 334412 334511

All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: 20151211

Schedule end date: Not reported

EPA ID: CAD990833014

EPA Region: 9

Area Name: ENTIRE FACILITY

Actual Date: 20151023

Action: CA120 - RFI Workplan Modification Requested By Agency

NAICS Code(s): 332999 334412 334412 334511

All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: 20150925

Schedule end date: Not reported

EPA ID: CAD990833014

EPA Region: 9

Area Name: ENTIRE FACILITY

Actual Date: 20151023

Action: CA140 - RFI Workplan Notice Of Deficiency Issued

NAICS Code(s): 332999 334412 334412 334511

All Other Miscellaneous Fabricated Metal Product Manufacturing

Bare Printed Circuit Board Manufacturing

Bare Printed Circuit Board Manufacturing

Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: 20150925

Schedule end date: Not reported

EPA ID: CAD990833014

EPA Region: 9

Area Name: ENTIRE FACILITY

Actual Date: 20150903

Action: CA200 - RFI Approved

NAICS Code(s): 332999 334412 334412 334511

All Other Miscellaneous Fabricated Metal Product Manufacturing

Bare Printed Circuit Board Manufacturing

Bare Printed Circuit Board Manufacturing

Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: Not reported

Schedule end date: Not reported

EPA ID: CAD990833014

EPA Region: 9

Area Name: ENTIRE FACILITY

Actual Date: 20150727

Action: CA110 - RFI Workplan Received

NAICS Code(s): 332999 334412 334412 334511

All Other Miscellaneous Fabricated Metal Product Manufacturing

Bare Printed Circuit Board Manufacturing

Bare Printed Circuit Board Manufacturing

Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: 20150731

Schedule end date: Not reported

EPA ID: CAD990833014

EPA Region: 9

Area Name: ENTIRE FACILITY

Actual Date: 20150622

Action: CA260 - CMS Workplan Received

NAICS Code(s): 332999 334412 334412 334511

All Other Miscellaneous Fabricated Metal Product Manufacturing

Bare Printed Circuit Board Manufacturing

Bare Printed Circuit Board Manufacturing

Search, Detection, Navigation, Guidance, Aeronautical, and Nautical

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

System and Instrument Manufacturing

Original schedule date: Not reported

Schedule end date: Not reported

EPA ID: CAD990833014

EPA Region: 9

Area Name: ENTIRE FACILITY

Actual Date: 20150416

Action: CA350 - CMS Approved

NAICS Code(s): 332999 334412 334412 334511

All Other Miscellaneous Fabricated Metal Product Manufacturing

Bare Printed Circuit Board Manufacturing

Bare Printed Circuit Board Manufacturing

Search, Detection, Navigation, Guidance, Aeronautical, and Nautical

System and Instrument Manufacturing

Original schedule date: Not reported

Schedule end date: Not reported

EPA ID: CAD990833014

EPA Region: 9

Area Name: ENTIRE FACILITY

Actual Date: 20140919

Action: CA340 - CMS Report Received

NAICS Code(s): 332999 334412 334412 334511

All Other Miscellaneous Fabricated Metal Product Manufacturing

Bare Printed Circuit Board Manufacturing

Bare Printed Circuit Board Manufacturing

Search, Detection, Navigation, Guidance, Aeronautical, and Nautical

System and Instrument Manufacturing

Original schedule date: 20140930

Schedule end date: Not reported

EPA ID: CAD990833014

EPA Region: 9

Area Name: ENTIRE FACILITY

Actual Date: 20140213

Action: CA300 - CMS Workplan Approved

NAICS Code(s): 332999 334412 334412 334511

All Other Miscellaneous Fabricated Metal Product Manufacturing

Bare Printed Circuit Board Manufacturing

Bare Printed Circuit Board Manufacturing

Search, Detection, Navigation, Guidance, Aeronautical, and Nautical

System and Instrument Manufacturing

Original schedule date: Not reported

Schedule end date: Not reported

EPA ID: CAD990833014

EPA Region: 9

Area Name: ENTIRE FACILITY

Actual Date: 20140213

Action: CA350 - CMS Approved

NAICS Code(s): 332999 334412 334412 334511

All Other Miscellaneous Fabricated Metal Product Manufacturing

Bare Printed Circuit Board Manufacturing

Bare Printed Circuit Board Manufacturing

Search, Detection, Navigation, Guidance, Aeronautical, and Nautical

System and Instrument Manufacturing

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20140106
Action: CA340 - CMS Report Received
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20131126
Action: CA180 - RFI Supplemental Implementation Begun
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20131108
Action: CA260 - CMS Workplan Received
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20130212
Action: CA300 - CMS Workplan Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: 20130222

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20130129
Action: CA200 - RFI Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: 20130217

Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20130129
Action: CA200 - RFI Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: 20130217

Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20130128
Action: CA200 - RFI Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: 20130227

Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20130118
Action: CA200 - RFI Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: 20130217

Schedule end date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20121018
Action: CA270 - CMS Workplan Modification Requested By Agency
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: 20120828
Schedule end date: 20121030

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20120629
Action: CA260 - CMS Workplan Received
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20120430
Action: CA200 - RFI Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: 20120530
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20120320
Action: CA190 - RFI Report Received
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20110303
Action: CA190 - RFI Report Received
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: 20110422
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20091109
Action: CA190 - RFI Report Received
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: 20100517
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20091006
Action: CA200 - RFI Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: 20091018
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: SOILS
Actual Date: 20080919
Action: CA750YE - Migration of Contaminated Groundwater under Control, Yes,
Migration of Contaminated Groundwater Under Control has been verified
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

EPA Region: 9
Area Name: GROUNDWATER BELOW EXISTING MANUFACTURING
Actual Date: 20080919
Action: CA750YE - Migration of Contaminated Groundwater under Control, Yes,
Migration of Contaminated Groundwater Under Control has been verified
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20080919
Action: CA750YE - Migration of Contaminated Groundwater under Control, Yes,
Migration of Contaminated Groundwater Under Control has been verified
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: 20080919
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: GROUNDWATER BELOW EXISTING MANUFACTURING
Actual Date: 20020314
Action: CA150 - RFI Workplan Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: GROUNDWATER BELOW EXISTING MANUFACTURING
Actual Date: 20020314
Action: CA150 - RFI Workplan Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

EPA ID: CAD990833014
EPA Region: 9
Area Name: GROUNDWATER BELOW EXISTING MANUFACTURING
Actual Date: 20010927
Action: CA110 - RFI Workplan Received
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: SOILS
Actual Date: 20010629
Action: CA100 - RFI Imposition
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20000515
Action: CA750IN - Migration of Contaminated Groundwater under Control, More
information is needed to make a determination
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: 20000515
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20000515
Action: CA725YE - Current Human Exposures Under Control, Yes, Current Human
Exposures Under Control has been verified
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: 20000614
Schedule end date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

EPA ID: CAD990833014
EPA Region: 9
Area Name: SOILS
Actual Date: 20000330
Action: CA340 - CMS Report Received
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 19990505
Action: CA725IN - Current Human Exposures Under Control, More information is
needed to make a determination
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: 19990505
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 19971201
Action: CA550RC
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: 19971201
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: SOILS
Actual Date: 19971201
Action: CA550 - Certification Of Remedy Completion Or Construction Completion
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

EPA ID: CAD990833014
EPA Region: 9
Area Name: SOILS
Actual Date: 19971001
Action: CA500 - CMI Workplan Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: SOILS
Actual Date: 19970825
Action: CA400 - Date For Remedy Selection (CM Imposed)
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: SOILS
Actual Date: 19970825
Action: CA350 - CMS Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 19970825
Action: CA400 - Date For Remedy Selection (CM Imposed)
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing
Original schedule date: 19970825
Schedule end date: Not reported

EPA ID: CAD990833014

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

EPA Region: 9
Area Name: SOILS
Actual Date: 19970423
Action: CA200 - RFI Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 19960430
Action: CA150 - RFI Workplan Approved
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 19960412
Action: CA050 - RFA Completed
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: 19960412
Schedule end date: Not reported

EPA ID: CAD990833014
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 19960412
Action: CA070YE - RFA Determination Of Need For An RFI, RFI is Necessary
NAICS Code(s): 332999 334412 334412 334511
All Other Miscellaneous Fabricated Metal Product Manufacturing
Bare Printed Circuit Board Manufacturing
Bare Printed Circuit Board Manufacturing
Search, Detection, Navigation, Guidance, Aeronautical, and Nautical
System and Instrument Manufacturing

Original schedule date: 19960412
Schedule end date: Not reported

RCRA-TSDF:

Date form received by agency:09/01/1996

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Facility name: TELEDYNE RYAN ELECTRONICS
Facility address: 8650 BALBOA AVE
SAN DIEGO, CA 92123
EPA ID: CAD990833014
Mailing address: 8650 BALBOA AVENUE
SAN DIEGO, CA 92123
Contact: Not reported
Contact address: Not reported
Not reported
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 09
Land type: Facility is not located on Indian land. Additional information is not known.
Classification: TSDF
Description: Handler is engaged in the treatment, storage or disposal of hazardous waste

Owner/Operator Summary:

Owner/operator name: TELEDYNE RYAN ELECTRONICS
Owner/operator address: 8650 BALBOA AVENUE
SAN DIEGO, CA 92123
Owner/operator country: Not reported
Owner/operator telephone: 714-291-7311
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: TELEDYNE RYAN ELECTRONICS
Owner/operator address: 8650 BALBOA AVENUE
SAN DIEGO, CA 92123
Owner/operator country: Not reported
Owner/operator telephone: 714-291-7311
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency:09/01/1996
Site name: TELEDYNE RYAN ELECTRONICS
Classification: Small Quantity Generator

Date form received by agency:02/29/1996
Site name: TELEDYNE RYAN ELECTRONICS
Classification: Large Quantity Generator

Date form received by agency:03/24/1992
Site name: TELEDYNE RYAN ELECTRONICS
Classification: Large Quantity Generator

Date form received by agency:04/13/1990
Site name: TELEDYNE RYAN ELECTRONICS
Classification: Large Quantity Generator

Date form received by agency:08/18/1980
Site name: TELEDYNE RYAN ELECTRONICS
Classification: Large Quantity Generator

Corrective Action Summary:

Event date: 02/01/1985
Event: PA OR CERCLA INSPECTION

Event date: 01/18/1989
Event: CA PRIORITIZATION-LOW CA PRIORITY

Event date: 01/18/1989
Event: NCAPS RANKING/PRIORITY

Event date: 01/18/1989
Event: PA OR CERCLA INSPECTION

Event date: 01/18/1989
Event: LEAD AGENCY DETERMINATION

Event date: 06/28/1990
Event: PA OR CERCLA INSPECTION

Event date: 01/01/1996
Event: INVESTIGATION IMPOSITION

Event date: 04/12/1996
Event: DETERMINATION OF NEED FOR AN INVESTIGATION-INVESTIGATION IS NECESSARY

Event date: 04/12/1996
Event: RFA COMPLETED-ASSESSMENT WAS A RFA

Event date: 04/12/1996

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Event:	RFA COMPLETED
Event date:	04/30/1996
Event:	INVESTIGATION WORKPLAN APPROVED
Event date:	04/23/1997
Event:	INVESTIGATION COMPLETE
Event date:	08/25/1997
Event:	REMEDY DECISION
Event date:	08/25/1997
Event:	CMS COMPLETE
Event date:	08/25/1997
Event:	REMEDY DECISION
Event date:	10/01/1997
Event:	CMI WORKPLAN APPROVED
Event date:	12/01/1997
Event:	REMEDY CONSTRUCTION
Event date:	12/01/1997
Event:	REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
Event date:	05/05/1999
Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-MORE INFORMATION NEEDED
Event date:	05/05/1999
Event:	RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED
Event date:	05/05/1999
Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-MORE INFORMATION NEEDED
Event date:	03/30/2000
Event:	CMS REPORT RECEIVED
Event date:	05/15/2000
Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	05/15/2000
Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	05/15/2000
Event:	RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED
Event date:	05/15/2000
Event:	RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED
Event date:	06/29/2001
Event:	INVESTIGATION IMPOSITION
Event date:	09/27/2001
Event:	INVESTIGATION WORKPLAN RECEIVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Event date:	03/14/2002
Event:	INVESTIGATION WORKPLAN APPROVED
Event date:	03/14/2002
Event:	INVESTIGATION WORKPLAN APPROVED
Event date:	03/10/2005
Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	09/19/2008
Event:	RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	09/19/2008
Event:	RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	10/06/2009
Event:	INVESTIGATION COMPLETE
Event date:	11/09/2009
Event:	INVESTIGATION REPORT RECEIVED
Event date:	06/07/2010
Event:	REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
Event date:	03/03/2011
Event:	INVESTIGATION REPORT RECEIVED
Event date:	03/20/2012
Event:	INVESTIGATION REPORT RECEIVED
Event date:	04/30/2012
Event:	INVESTIGATION COMPLETE
Event date:	06/29/2012
Event:	CMS WORKPLAN RECEIVED
Event date:	10/18/2012
Event:	CMS WORKPLAN MODIFICATION REQ BY AGENCY
Event date:	01/18/2013
Event:	INVESTIGATION COMPLETE
Event date:	01/28/2013
Event:	INVESTIGATION COMPLETE
Event date:	01/29/2013
Event:	INVESTIGATION COMPLETE
Event date:	01/29/2013
Event:	INVESTIGATION COMPLETE
Event date:	02/12/2013
Event:	CMS WORKPLAN APPROVED
Event date:	11/08/2013
Event:	CMS WORKPLAN RECEIVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Event date:	11/26/2013
Event:	INVESTIGATION IMPLEMENTATION BEGUN
Event date:	01/06/2014
Event:	CMS REPORT RECEIVED
Event date:	02/13/2014
Event:	CMS COMPLETE
Event date:	02/13/2014
Event:	CMS WORKPLAN APPROVED
Event date:	09/19/2014
Event:	CMS REPORT RECEIVED
Event date:	04/16/2015
Event:	CMS COMPLETE
Event date:	06/22/2015
Event:	CMS WORKPLAN RECEIVED
Event date:	07/27/2015
Event:	INVESTIGATION WORKPLAN RECEIVED
Event date:	09/03/2015
Event:	INVESTIGATION COMPLETE
Event date:	10/23/2015
Event:	INVESTIGATION WORKPLAN NOTICE OF DEFICIENCY ISSUED
Event date:	10/23/2015
Event:	INVESTIGATION WORKPLAN MODIFICATION REQ BY AGENCY
Event date:	11/17/2015
Event:	INVESTIGATION WORKPLAN APPROVED
Event date:	01/21/2016
Event:	CMS WORKPLAN APPROVED
Event date:	04/18/2016
Event:	INVESTIGATION REPORT RECEIVED
Event date:	06/02/2016
Event:	CMS REPORT RECEIVED
Event date:	09/28/2017
Event:	INVESTIGATION COMPLETE

Facility Has Received Notices of Violations:

Regulation violated:	FR - 262.10-12.A
Area of violation:	Generators - General
Date violation determined:	10/15/1993
Date achieved compliance:	09/15/1994
Violation lead agency:	State
Enforcement action:	Not reported
Enforcement action date:	Not reported
Enf. disposition status:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 10/22/1992
Date achieved compliance: 10/15/1993
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 09/10/1991
Date achieved compliance: 10/22/1992
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 270
Area of violation: TSD - General
Date violation determined: 04/19/1990
Date achieved compliance: 06/29/1990
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/01/1990
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 268.7
Area of violation: LDR - General
Date violation determined: 07/14/1988
Date achieved compliance: 12/05/1989
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 268 ALL
Area of violation: LDR - General
Date violation determined: 07/14/1988
Date achieved compliance: 12/05/1989
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 270
Area of violation: TSD - General
Date violation determined: 07/14/1988
Date achieved compliance: 12/05/1989
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 08/30/1988
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 264.140-150.H
Area of violation: TSD - Financial Requirements
Date violation determined: 07/12/1988
Date achieved compliance: 12/01/1988
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 08/03/1988
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:
Evaluation date: 09/15/1994
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 10/15/1993
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Date achieved compliance: 09/15/1994
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 10/22/1992
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 10/15/1993
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 09/10/1991
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 10/22/1992
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 05/09/1990
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 04/19/1990
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 06/29/1990
Evaluation lead agency: State

Evaluation date: 07/14/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: LDR - General
Date achieved compliance: 12/05/1989
Evaluation lead agency: State

Evaluation date: 07/14/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 12/05/1989
Evaluation lead agency: State

Evaluation date: 07/12/1988
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: TSD - Financial Requirements
Date achieved compliance: 12/01/1988
Evaluation lead agency: State

Evaluation date: 09/30/1987
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

RCRA-SQG:

Date form received by agency: 09/01/1996
Facility name: TELEDYNE RYAN ELECTRONICS
Facility address: 8650 BALBOA AVE
SAN DIEGO, CA 92123
EPA ID: CAD990833014
Mailing address: 8650 BALBOA AVENUE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

SAN DIEGO, CA 92123
Contact: Not reported
Contact address: Not reported
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 09
Land type: Facility is not located on Indian land. Additional information is not known.
Classification: TSDF
Description: Handler is engaged in the treatment, storage or disposal of hazardous waste

Owner/Operator Summary:

Owner/operator name: TELEDYNE RYAN ELECTRONICS
Owner/operator address: 8650 BALBOA AVENUE
SAN DIEGO, CA 92123
Owner/operator country: Not reported
Owner/operator telephone: 714-291-7311
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: TELEDYNE RYAN ELECTRONICS
Owner/operator address: 8650 BALBOA AVENUE
SAN DIEGO, CA 92123
Owner/operator country: Not reported
Owner/operator telephone: 714-291-7311
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. Importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Historical Generators:

Date form received by agency:09/01/1996

Site name: TELEDYNE RYAN ELECTRONICS

Classification: Small Quantity Generator

Date form received by agency:02/29/1996

Site name: TELEDYNE RYAN ELECTRONICS

Classification: Large Quantity Generator

Date form received by agency:03/24/1992

Site name: TELEDYNE RYAN ELECTRONICS

Classification: Large Quantity Generator

Date form received by agency:04/13/1990

Site name: TELEDYNE RYAN ELECTRONICS

Classification: Large Quantity Generator

Date form received by agency:08/18/1980

Site name: TELEDYNE RYAN ELECTRONICS

Classification: Large Quantity Generator

Corrective Action Summary:

Event date: 02/01/1985

Event: PA OR CERCLA INSPECTION

Event date: 01/18/1989

Event: CA PRIORITIZATION-LOW CA PRIORITY

Event date: 01/18/1989

Event: NCAPS RANKING/PRIORITY

Event date: 01/18/1989

Event: PA OR CERCLA INSPECTION

Event date: 01/18/1989

Event: LEAD AGENCY DETERMINATION

Event date: 06/28/1990

Event: PA OR CERCLA INSPECTION

Event date: 01/01/1996

Event: INVESTIGATION IMPOSITION

Event date: 04/12/1996

Event: DETERMINATION OF NEED FOR AN INVESTIGATION-INVESTIGATION IS NECESSARY

Event date: 04/12/1996

Event: RFA COMPLETED-ASSESSMENT WAS A RFA

Event date: 04/12/1996

Event: RFA COMPLETED

Event date: 04/30/1996

Event: INVESTIGATION WORKPLAN APPROVED

Event date: 04/23/1997

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Event:	INVESTIGATION COMPLETE
Event date:	08/25/1997
Event:	REMEDY DECISION
Event date:	08/25/1997
Event:	CMS COMPLETE
Event date:	08/25/1997
Event:	REMEDY DECISION
Event date:	10/01/1997
Event:	CMI WORKPLAN APPROVED
Event date:	12/01/1997
Event:	REMEDY CONSTRUCTION
Event date:	12/01/1997
Event:	REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
Event date:	05/05/1999
Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-MORE INFORMATION NEEDED
Event date:	05/05/1999
Event:	RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED
Event date:	05/05/1999
Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-MORE INFORMATION NEEDED
Event date:	03/30/2000
Event:	CMS REPORT RECEIVED
Event date:	05/15/2000
Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	05/15/2000
Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	05/15/2000
Event:	RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED
Event date:	05/15/2000
Event:	RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED
Event date:	06/29/2001
Event:	INVESTIGATION IMPOSITION
Event date:	09/27/2001
Event:	INVESTIGATION WORKPLAN RECEIVED
Event date:	03/14/2002
Event:	INVESTIGATION WORKPLAN APPROVED
Event date:	03/14/2002
Event:	INVESTIGATION WORKPLAN APPROVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Event date:	03/10/2005
Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	09/19/2008
Event:	RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	09/19/2008
Event:	RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	10/06/2009
Event:	INVESTIGATION COMPLETE
Event date:	11/09/2009
Event:	INVESTIGATION REPORT RECEIVED
Event date:	06/07/2010
Event:	REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
Event date:	03/03/2011
Event:	INVESTIGATION REPORT RECEIVED
Event date:	03/20/2012
Event:	INVESTIGATION REPORT RECEIVED
Event date:	04/30/2012
Event:	INVESTIGATION COMPLETE
Event date:	06/29/2012
Event:	CMS WORKPLAN RECEIVED
Event date:	10/18/2012
Event:	CMS WORKPLAN MODIFICATION REQ BY AGENCY
Event date:	01/18/2013
Event:	INVESTIGATION COMPLETE
Event date:	01/28/2013
Event:	INVESTIGATION COMPLETE
Event date:	01/29/2013
Event:	INVESTIGATION COMPLETE
Event date:	01/29/2013
Event:	INVESTIGATION COMPLETE
Event date:	02/12/2013
Event:	CMS WORKPLAN APPROVED
Event date:	11/08/2013
Event:	CMS WORKPLAN RECEIVED
Event date:	11/26/2013
Event:	INVESTIGATION IMPLEMENTATION BEGUN
Event date:	01/06/2014
Event:	CMS REPORT RECEIVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Event date:	02/13/2014
Event:	CMS COMPLETE
Event date:	02/13/2014
Event:	CMS WORKPLAN APPROVED
Event date:	09/19/2014
Event:	CMS REPORT RECEIVED
Event date:	04/16/2015
Event:	CMS COMPLETE
Event date:	06/22/2015
Event:	CMS WORKPLAN RECEIVED
Event date:	07/27/2015
Event:	INVESTIGATION WORKPLAN RECEIVED
Event date:	09/03/2015
Event:	INVESTIGATION COMPLETE
Event date:	10/23/2015
Event:	INVESTIGATION WORKPLAN NOTICE OF DEFICIENCY ISSUED
Event date:	10/23/2015
Event:	INVESTIGATION WORKPLAN MODIFICATION REQ BY AGENCY
Event date:	11/17/2015
Event:	INVESTIGATION WORKPLAN APPROVED
Event date:	01/21/2016
Event:	CMS WORKPLAN APPROVED
Event date:	04/18/2016
Event:	INVESTIGATION REPORT RECEIVED
Event date:	06/02/2016
Event:	CMS REPORT RECEIVED
Event date:	09/28/2017
Event:	INVESTIGATION COMPLETE

Facility Has Received Notices of Violations:

Regulation violated:	FR - 262.10-12.A
Area of violation:	Generators - General
Date violation determined:	10/15/1993
Date achieved compliance:	09/15/1994
Violation lead agency:	State
Enforcement action:	Not reported
Enforcement action date:	Not reported
Enf. disposition status:	Not reported
Enf. disp. status date:	Not reported
Enforcement lead agency:	Not reported
Proposed penalty amount:	Not reported
Final penalty amount:	Not reported
Paid penalty amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 10/22/1992
Date achieved compliance: 10/15/1993
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 09/10/1991
Date achieved compliance: 10/22/1992
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 270
Area of violation: TSD - General
Date violation determined: 04/19/1990
Date achieved compliance: 06/29/1990
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 06/01/1990
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 268.7
Area of violation: LDR - General
Date violation determined: 07/14/1988
Date achieved compliance: 12/05/1989
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 268 ALL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Area of violation: LDR - General
Date violation determined: 07/14/1988
Date achieved compliance: 12/05/1989
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 270
Area of violation: TSD - General
Date violation determined: 07/14/1988
Date achieved compliance: 12/05/1989
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 08/30/1988
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 264.140-150.H
Area of violation: TSD - Financial Requirements
Date violation determined: 07/12/1988
Date achieved compliance: 12/01/1988
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 08/03/1988
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:
Evaluation date: 09/15/1994
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 10/15/1993
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 09/15/1994
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 10/22/1992
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Date achieved compliance: 10/15/1993
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 09/10/1991
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 10/22/1992
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 05/09/1990
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 04/19/1990
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 06/29/1990
Evaluation lead agency: State

Evaluation date: 07/14/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: LDR - General
Date achieved compliance: 12/05/1989
Evaluation lead agency: State

Evaluation date: 07/14/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 12/05/1989
Evaluation lead agency: State

Evaluation date: 07/12/1988
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: TSD - Financial Requirements
Date achieved compliance: 12/01/1988
Evaluation lead agency: State

Evaluation date: 09/30/1987
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

ENVIROSTOR:

Facility ID: 37360090
Status: Refer: RCRA
Status Date: 04/25/1995
Site Code: 400285
Site Type: Historical
Site Type Detailed: * Historical
Acres: Not reported
NPL: NO
Regulatory Agencies: NONE SPECIFIED
Lead Agency: NONE SPECIFIED
Program Manager: Not reported
Supervisor: * Mmonroy

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Division Branch: Cleanup Cypress
Assembly: 77
Senate: 39
Special Program: * RCRA 3012 - Past Haz Waste Disp Inven Site
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: Not reported
Latitude: 32.82160
Longitude: -117.1409
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: * HALOGENATED SOLVENTS * CONTAMINATED SOIL * ACID SOLUTION 2>PH WITH METALS * ALKALINE SOLUTION WITHOUT METALS * UNSPECIFIED SOLVENT MIXTURES Cyanide (free)

Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED

Alias Name: CAD990833014
Alias Type: EPA Identification Number
Alias Name: 110000610134
Alias Type: EPA (FRS #)
Alias Name: 400285
Alias Type: Project Code (Site Code)
Alias Name: 37360090
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 04/25/1995
Comments: CLOSURE PLAN APPROVAL ON PROCESS. LISTED AS REG 4 RCRA FACILITY SUBMITTED REVISED CP ON 01/07/94. NFA FOR SITE MITIGATION OPERATIONS.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Assessment Report
Completed Date: 04/27/1984
Comments: PRELIM ASSESS DONE RCRA 3012

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * Discovery
Completed Date: 10/12/1983
Comments: FACILITY IDENTIFIED ID FROM ERRIS

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * Discovery
Completed Date: 03/22/1983
Comments: FACILITY IDENTIFIED ID VIA EPA PRINTOUT

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Schedule Due Date: Not reported
Schedule Revised Date: Not reported

Facility ID: 80001516
Status: Active
Status Date: 01/01/2008
Site Code: 400285
Site Type: Corrective Action
Site Type Detailed: Corrective Action
Acres: 18
NPL: NO
Regulatory Agencies: SMBRP
Lead Agency: WM
Program Manager: Christine Brown
Supervisor: Ju-Tseng Liu
Division Branch: Cleanup Cypress
Assembly: 77
Senate: 39
Special Program: Not reported
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: Not reported
Latitude: 32.82160
Longitude: -117.1409
APN: 3691402200
Past Use: AEROSPACE MANUFACTURING/MAINTENANCE, HAZARDOUS WASTE STORAGE -

TANKS/CONTAINERS

Potential COC: Freon 113 Tetrachloroethylene (PCE 1,1,1-Trichloroethane (TCA
Trichloroethylene (TCE Carbon tetrachloride 1,4-Dioxane

Confirmed COC: Freon 113 Tetrachloroethylene (PCE 1,1,1-Trichloroethane (TCA
1,4-Dioxane Carbon tetrachloride Trichloroethylene (TCE

Potential Description: OTH, SOIL, SV

Alias Name: 3691402200
Alias Type: APN
Alias Name: CAD990833014
Alias Type: EPA Identification Number
Alias Name: 110000610134
Alias Type: EPA (FRS #)
Alias Name: 400285
Alias Type: Project Code (Site Code)
Alias Name: 37360090
Alias Type: Envirostor ID Number
Alias Name: 80001516
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RCRA Facility Assessment Report
Completed Date: 04/12/1996
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 09/25/2009
Comments: annual cost estimate 2009-2010

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Consent Order
Completed Date: 06/29/2001
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * Other Instrument
Completed Date: 03/14/1996
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * Other Instrument
Completed Date: 09/28/1984
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Consent Order
Completed Date: 12/01/1995
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 11/19/2010
Comments: annual 2010-2011 cost estimate for DTSC oversight costs.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Workplan
Completed Date: 08/05/2005
Comments: work part of ongoing RFI.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Workplan
Completed Date: 09/12/2007
Comments: part of ongoing RFI.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Workplan
Completed Date: 02/25/2008
Comments: part of ongoing RFI.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 09/19/2008
Comments: Environmental Indicator for Groundwater met.

Completed Area Name: Sites With No Operable Unit
Completed Sub Area Name: SOILS
Completed Document Type: Remedy Constructed: Operating Properly & Successfully

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Completed Date: 12/01/1997
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Workplan
Completed Date: 04/30/1996
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Assessment Report
Completed Date: 01/18/1989
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Assessment Report
Completed Date: 06/28/1990
Comments: Not reported

Completed Area Name: Sites With No Operable Unit
Completed Sub Area Name: SOILS
Completed Document Type: Corrective Measure Implementation Workplan
Completed Date: 10/01/1997
Comments: Not reported

Completed Area Name: Sites With No Operable Unit
Completed Sub Area Name: SOILS
Completed Document Type: Corrective Measures Study Report
Completed Date: 08/25/1997
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Assessment Report
Completed Date: 02/01/1985
Comments: Not reported

Completed Area Name: Sites With No Operable Unit
Completed Sub Area Name: SOILS
Completed Document Type: RFI Report
Completed Date: 04/23/1997
Comments: Not reported

Completed Area Name: Sites With No Operable Unit
Completed Sub Area Name: GROUNDWATER BELOW EXISTING MANUFACTURING
Completed Document Type: RFI Workplan
Completed Date: 03/14/2002
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Report
Completed Date: 10/06/2009
Comments: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Report
Completed Date: 01/28/2013
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Report
Completed Date: 04/30/2012
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Report
Completed Date: 09/03/2015
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Remedy Constructed: Operating Properly & Successfully
Completed Date: 02/25/2010
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Corrective Measures Study Workplan
Completed Date: 02/12/2013
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Report
Completed Date: 01/18/2013
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Report
Completed Date: 01/29/2013
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Report
Completed Date: 01/29/2013
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 08/31/2013
Comments: field oversight completed

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Completed Date: 11/06/2013
Comments: geology review completed on 11/6/2013

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Corrective Measures Study Workplan
Completed Date: 02/13/2014
Comments: review was completed by geologist on 2/13/2014

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 11/26/2013
Comments: field work lasted 2 days

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Corrective Measures Study Report
Completed Date: 02/13/2014
Comments: review was completed by geologist on 2/13/2014

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 04/22/2014
Comments: e-comments sent to facility on 4/22/2014

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 08/04/2014
Comments: completed

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Corrective Measures Study Report
Completed Date: 04/16/2015
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 11/19/2014
Comments: completed.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 02/06/2015
Comments: geologist completed review on 2/6/2015.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Corrective Measures Study Workplan
Completed Date: 01/21/2016
Comments: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Workplan
Completed Date: 11/17/2015
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: RFI Report
Completed Date: 09/28/2017
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 04/20/2017
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Monitoring Report
Completed Date: 03/01/2018
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Groundwater Migration Controlled
Completed Date: 05/15/2000
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Human Exposure Controlled
Completed Date: 05/05/1999
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Remedy Construction Complete
Completed Date: 12/01/1997
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Corrective Action Oversight Cost Recovery Estimate
Completed Date: 03/16/2012
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Groundwater Migration Controlled
Completed Date: 09/19/2008
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * Remedy Selected

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Completed Date: 08/25/1997
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Human Exposure Controlled
Completed Date: 05/15/2000
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 10/23/2012
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 08/08/2016
Comments: Not reported

Completed Area Name: Sites With No Operable Unit
Completed Sub Area Name: SOILS
Completed Document Type: Remedy Selection and Statement of Basis
Completed Date: 08/25/1997
Comments: Not reported

Future Area Name: PROJECT WIDE
Future Sub Area Name: Not reported
Future Document Type: Remedy Selection and Statement of Basis
Future Due Date: 2022
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Community Profile
Schedule Due Date: 06/09/2017
Schedule Revised Date: Not reported
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Corrective Measures Study Report
Schedule Due Date: 07/30/2017
Schedule Revised Date: 10/28/2019
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Land Use Restriction
Schedule Due Date: 12/18/2016
Schedule Revised Date: Not reported

SAN DIEGO CO. SAM:

Case Number: H00047-001
Agency: CA Department of Toxic Substance Control
Funding: **Non Billable**
Facility Type: GW With No Beneficial Use Designation
Facility Status: Preliminary Assessment
Date: 1/28/1997
Date Began: 11/19/1996

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000255507
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: (858) 522-2500
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 04/18/2018
Facility Owner: Not reported
Facility Mailing Address: 8650 Balboa Ave, San Diego, CA 92123
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Waste and Materials:

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0160529
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-04-18T02:31:47.000
Chemical Name: PROPANE
Common Name: LIQUIDIFIED PROPANE GAS (LPG)
Case Number: 74-98-6

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0160530
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-04-18T02:31:47.000
Chemical Name: SULFURIC ACID
Common Name: LEAD ACID BATTERIES
Case Number: 7664-93-9

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0160531
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-04-18T02:31:47.000
Chemical Name: Cooling tower water treatment
Common Name: All Organic Inhibitor Concentrated
Case Number: 6419-19-8

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0160532
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-04-18T02:31:47.000
Chemical Name: Oil, Hydro Light Naph Dist
Common Name: Oil, Hydro Light Naph Dist
Case Number: 64742-53-6

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0160533
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-04-18T02:31:47.000
Chemical Name: Acetylene
Common Name: Acetylene
Case Number: 74-86-2

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0160534
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-04-18T02:31:47.000
Chemical Name: Oxygen
Common Name: Oxygen
Case Number: 7782-44-7

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0135994
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-18T02:31:47.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: WASTE ALCOHOL WIPES & SEALANT
Case Number: Not reported

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0135995
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-18T02:31:47.000
Chemical Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name: WASTE PAINT, PETROLEUM DISTILLATES, AEROSOLS
Case Number: Not reported

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Active Permit: Y
Child Record Id: DEH2017-HWAST-0135996
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-18T02:31:47.000
Chemical Name: Waste Oil, Hydro Light Naph Dist
Common Name: Waste Oil, Hydro Light Naph Dist
Case Number: Not reported

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0135997
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-18T02:31:47.000
Chemical Name: Waste Corrosive Liquid, Basic
Common Name: Waste Corrosive Liquid, Basic
Case Number: Not reported

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0135998
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-18T02:31:47.000
Chemical Name: Waste Ethylene Glycol
Common Name: Waste Ethylene Glycol
Case Number: Not reported

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0135999
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-18T02:31:47.000
Chemical Name: Waste Flammable Liquids
Common Name: Waste Flammable Liquids
Case Number: Not reported

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0195640
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-09-26T00:36:38.000
Chemical Name: PROPANE
Common Name: LIQUIDIFIED PROPANE GAS (LPG)
Case Number: 74-98-6

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0195641

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-09-26T00:36:38.000
Chemical Name: SULFURIC ACID
Common Name: LEAD ACID BATTERIES
Case Number: 7664-93-9

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0195642
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-09-26T00:36:38.000
Chemical Name: Cooling tower water treatment
Common Name: All Organic Inhibitor Concentrated
Case Number: 6419-19-8

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0195643
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-09-26T00:36:38.000
Chemical Name: Oil, Hydro Light Naph Dist
Common Name: Oil, Hydro Light Naph Dist
Case Number: 64742-53-6

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0195644
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-09-26T00:36:38.000
Chemical Name: Acetylene
Common Name: Acetylene
Case Number: 74-86-2

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0195645
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-09-26T00:36:38.000
Chemical Name: Oxygen
Common Name: Oxygen
Case Number: 7782-44-7

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0168822
Trade Secret: N
Hazardous Material Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Last Updated:	2018-09-26T00:36:39.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name:	WASTE ALCOHOL WIPES & SEALANT
Case Number:	Not reported
Record ID:	DEH2014-HUPFP-001488
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0168823
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-09-26T00:36:39.000
Chemical Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name:	WASTE PAINT, PETROLEUM DISTILLATES, AEROSOLS
Case Number:	Not reported
Record ID:	DEH2014-HUPFP-001488
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0168824
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-09-26T00:36:39.000
Chemical Name:	Waste Oil, Hydro Light Naph Dist
Common Name:	Waste Oil, Hydro Light Naph Dist
Case Number:	Not reported
Record ID:	DEH2014-HUPFP-001488
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0168825
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-09-26T00:36:39.000
Chemical Name:	Waste Corrosive Liquid, Basic
Common Name:	Waste Corrosive Liquid, Basic
Case Number:	Not reported
Record ID:	DEH2014-HUPFP-001488
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0168826
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-09-26T00:36:39.000
Chemical Name:	Waste Ethylene Glycol
Common Name:	Waste Ethylene Glycol
Case Number:	Not reported
Record ID:	DEH2014-HUPFP-001488
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0168827
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-09-26T00:36:39.000
Chemical Name:	Waste Flammable Liquids

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Common Name: Waste Flammable Liquids
Case Number: Not reported

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0117686
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-04-07T08:32:13.000
Chemical Name: PROPANE
Common Name: LIQUIDIFIED PROPANE GAS (LPG)
Case Number: 74-98-6

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0117687
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-04-07T08:32:13.000
Chemical Name: SULFURIC ACID
Common Name: LEAD ACID BATTERIES
Case Number: 7664-93-9

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0117688
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-04-07T08:32:13.000
Chemical Name: Cooling tower water treatment
Common Name: All Organic Inhibitor Concentrated
Case Number: 6419-19-8

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0117689
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-04-07T08:32:13.000
Chemical Name: Oil, Hydro Light Naph Dist
Common Name: Oil, Hydro Light Naph Dist
Case Number: 64742-53-6

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0117690
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-04-07T08:32:13.000
Chemical Name: Acetylene
Common Name: Acetylene
Case Number: 74-86-2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0117691
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-04-07T08:32:13.000
Chemical Name: Oxygen
Common Name: Oxygen
Case Number: 7782-44-7

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0099078
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-07T08:32:13.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: WASTE ALCOHOL WIPES & SEALANT
Case Number: Not reported

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0099079
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-07T08:32:13.000
Chemical Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name: WASTE PAINT, PETROLEUM DISTILLATES, AEROSOLS
Case Number: Not reported

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0099080
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-07T08:32:13.000
Chemical Name: Waste Oil, Hydro Light Naph Dist
Common Name: Waste Oil, Hydro Light Naph Dist
Case Number: Not reported

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0099081
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-07T08:32:13.000
Chemical Name: Waste Corrosive Liquid, Basic
Common Name: Waste Corrosive Liquid, Basic
Case Number: Not reported

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Active Permit: Y
Child Record Id: DEH2016-HWAST-0099082
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-07T08:32:13.000
Chemical Name: Waste Ethylene Glycol
Common Name: Waste Ethylene Glycol
Case Number: Not reported

Record ID: DEH2014-HUPFP-001488
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0099083
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-04-07T08:32:13.000
Chemical Name: Waste Flammable Liquids
Common Name: Waste Flammable Liquids
Case Number: Not reported

Permit Number: 100047
Business Type: 6HK36
EPA Id Number: CAD990833014
APN: 369-140-22-00
Last HMMD Inspection: 03/01/1996
Facility Telephone: 858-560-6400
Permit Status: INAC
Permit Expiration: 03/01/1996
Date Last Updated: 11/02/2012
Facility Owner: TELEDYNE INC
Facility Mailing Address: 8650 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1502
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Permit Number: 103848
Business Type: Not reported
EPA Id Number: Not reported
APN: 369-140-22-00
Last HMMD Inspection: Not reported
Facility Telephone: Not reported
Permit Status: INAC
Permit Expiration: Not reported
Date Last Updated: 11/02/2012
Facility Owner: Not reported
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

2020 COR ACTION:

EPA ID: CAD990833014
Region: 9
Action: Remedy Construction

HAZNET:

Facility Name: TELEDYNE RYAN ELECTRONICS
envid: 1000201835
Year: 1998
GEPaid: CAD990833014
Contact: TELEDYNE RYAN ELECTRONICS
Telephone: 2163530710
Mailing Name: Not reported
Mailing Address: 8650 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAD000088252
TSD County: Not reported
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Transfer Station
Tons: 1.1000
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1000201835
Year: 1998
GEPaid: CAD990833014
Contact: TELEDYNE RYAN ELECTRONICS
Telephone: 2163530710
Mailing Name: Not reported
Mailing Address: 8650 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAD000088252
TSD County: Not reported
Waste Category: Other organic solids
Disposal Method: Transfer Station
Tons: .4000
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1000201835
Year: 1997
GEPaid: CAD990833014
Contact: TELEDYNE RYAN ELECTRONICS
Telephone: 2163530710

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

Mailing Name: Not reported
Mailing Address: 8650 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAT000646117
TSD County: Not reported
Waste Category: Other inorganic solid waste
Disposal Method: Disposal, Land Fill
Tons: 25.2840
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1000201835
Year: 1997
GEPAID: CAD990833014
Contact: TELEDYNE RYAN ELECTRONICS
Telephone: 2163530710
Mailing Name: Not reported
Mailing Address: 8650 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAD008364432
TSD County: Not reported
Waste Category: Aqueous solution with total organic residues less than 10 percent
Disposal Method: Treatment, Tank
Tons: 4.2784
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1000201835
Year: 1996
GEPAID: CAD990833014
Contact: TELEDYNE RYAN ELECTRONICS
Telephone: 2163530710
Mailing Name: Not reported
Mailing Address: 8650 BALBOA AVE
Mailing City,St,Zip: SAN DIEGO, CA 921230000
Gen County: Not reported
TSD EPA ID: CAD000633164
TSD County: Not reported
Waste Category: Other inorganic solid waste
Disposal Method: Treatment, Tank
Tons: 28.6552
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
40 additional CA_HAZNET: record(s) in the EDR Site Report.

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: CALSI
Reg Id: 37360090

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

1000201835

SAN DIEGO CO LOP:

Record ID:	DEH1997-LSAM-H00047-001
Record Status:	Completed
Opened Date:	01/23/1997
Parcel Number:	369-140-22-00
Case Type:	Not reported
Historical Name:	TELDYNE RYAN ELECTRONICS
SWRCB Global ID:	Not reported
Funding:	N - Non-Billable
Lead Agency:	DTSC
Lead Agency Date:	01/28/1997
Census Tract:	85.11
Community:	San Diego
Jurisdiction:	SAN DIEGO
Watershed Basin Number:	907.11
Water Purveyor:	SAN DIEGO
Fire Agency:	SAN DIEGO
Thomas Bros Map Page Grid:	1249 C 2
Latitude:	32.8216078
Longitude:	-117.1409340
X MapCoord:	6287985.652
Y MapCoord:	1879897.381

CIWQS:

Agency:	Teledyne Ryan Electronics
Agency Address:	8650 Balboa Ave, San Diego, CA 92123
Place/Project Type:	Industrial - Search, Detection, Navigation, Guidance, Aeronautical, and Nautical Systems and Instruments
SIC/NAICS:	3812
Region:	9
Program:	INDSTW
Regulatory Measure Status:	Terminated
Regulatory Measure Type:	Storm water industrial
Order Number:	2014-0057-DWQ
WDID:	9 371003800
NPDES Number:	CAS000001
Adoption Date:	Not reported
Effective Date:	04/03/1992
Termination Date:	Not reported
Expiration/Review Date:	Not reported
Design Flow:	Not reported
Major/Minor:	Not reported
Complexity:	Not reported
TTWQ:	Not reported
Enforcement Actions within 5 years:	0
Violations within 5 years:	0
Latitude:	32.821
Longitude:	-117.1424

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AE200 **DIGITAL DEVELOPMENT CORP**
NNE **8650 BALBOA AVE**
< 1/8 **SAN DIEGO, CA 92123**
0.104 mi.
548 ft. **Site 2 of 3 in cluster AE**

RCRA-SQG **1000264292**
FINDS **CAD008248452**
ECHO

Actual:
419 ft.

RCRA-SQG:

Date form received by agency:06/30/1980

Focus Map:
1

Facility name: DIGITAL DEVELOPMENT CORP

Facility address: 8650 BALBOA AVE
SAN DIEGO, CA 92123

EPA ID: CAD008248452

Mailing address: PO BOX 23447
SAN DIEGO, CA 92123

Contact: ENVIRONMENTAL MANAGER

Contact address: 8650 BALBOA AVE
SAN DIEGO, CA 92123

Contact country: US

Contact telephone: 619-278-9920

Contact email: Not reported

EPA Region: 09

Classification: Small Small Quantity Generator

Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: LOUREY W A
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999

Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212

Owner/operator email: Not reported

Owner/operator fax: Not reported

Owner/operator extension: Not reported

Legal status: Private

Owner/Operator Type: Owner

Owner/Op start date: Not reported

Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999

Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212

Owner/operator email: Not reported

Owner/operator fax: Not reported

Owner/operator extension: Not reported

Legal status: Private

Owner/Operator Type: Operator

Owner/Op start date: Not reported

Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No

Mixed waste (haz. and radioactive): No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DIGITAL DEVELOPMENT CORP (Continued)

1000264292

Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

FINDS:

Registry ID: 110000610134

Environmental Interest/Information System

US EPA TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000264292
Registry ID: 110000610134
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110000610134>

AE201
NNE
< 1/8
0.104 mi.
548 ft.
Site 3 of 3 in cluster AE

TELEDYNE RYAN ELECTRONICS
8650 BALBOA AVE
SAN DIEGO, CA 92123

CA HWP
CA NPDES
S103953891
N/A

Actual:
419 ft.
Focus Map:
1

HWP:
EPA Id: CAD990833014
Cleanup Status: UNDERGOING CLOSURE
Latitude: 32.82160
Longitude: -117.1409
Facility Type: Historical - Non-Operating
Facility Size: Not reported
Team: Not reported
Supervisor: Not reported
Site Code: 400285

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

S103953891

Assembly District: 77
Senate District: 39
Public Information Officer: Not reported
Public Information Officer: Not reported

Activities:

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: New Operating Permit - PUBLIC COMMENT (BEGIN)
Actual Date: 02/29/1984

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: New Operating Permit - APPLICATION PART B RECEIVED
Actual Date: 05/09/1983

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: New Operating Permit - APPLICATION PART A RECEIVED
Actual Date: 11/19/1980

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: New Operating Permit - FINAL PERMIT (EFFECTIVE)
Actual Date: 08/27/1984

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: New Operating Permit - FINAL PERMIT
Actual Date: 08/27/1984

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: New Operating Permit - FINAL PERMIT (EXPIRES)
Actual Date: 08/27/1989

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: New Operating Permit - CALL-IN LETTER ISSUED
Actual Date: 11/15/1982

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: New Operating Permit - PERMIT TERMINATED - TERMINATION APPROVED
Actual Date: 09/05/1989

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: New Operating Permit - PERMIT TERMINATED - TERMINATION RECEIVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

S103953891

Actual Date: 06/22/1989

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: New Operating Permit - ADMINISTRATIVE REVIEW APPROVED
Actual Date: 04/06/1981

Closure:

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: Closure - Needs Review - RECEIVE CLOSURE CERTIFICATION
Actual Date: 06/13/1996

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: Closure - Needs Review - ISSUE CLOSURE VERIFICATION
Actual Date: 09/30/1999

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: Closure - Needs Review - CLOSURE PLAN APPROVED
Actual Date: 06/22/1995

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Unit Names: CONTAIN1, TANKSTR1
Event Description: Referred for closure to other agency - REFERRED FOR CLOSURE TO OTHER AGENCY
Actual Date: 10/01/1999

Alias:

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Alias Type: FRS
Alias: 110000610134

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Alias Type: Envirostor ID Number
Alias: 37360090

EPA Id: CAD990833014
Facility Type: Historical - Non-Operating
Alias Type: Project Code (Site Code)
Alias: 400285

NPDES:

Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

S103953891

Place ID: Not reported
Order Number: Not reported
WDID: 9 371003800
Regulatory Measure Type: Industrial
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Terminated
Status Date: 04/03/1992
Operator Name: Teledyne Ryan Electronics
Operator Address: 8650 Balboa Ave
Operator City: San Diego
Operator State: California
Operator Zip: 92123

NPDES as of 03/2018:

NPDES Number: Not reported
Status: Not reported
Agency Number: Not reported
Region: 9
Regulatory Measure ID: 290990
Order Number: Not reported
Regulatory Measure Type: Industrial
Place ID: Not reported
WDID: 9 371003800
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Received Date: 05/09/2008
Processed Date: 04/03/1992
Status: Terminated
Status Date: 04/03/1992
Place Size: 29
Place Size Unit: Acres
Contact: Jackie Sparrey Mchugh
Contact Title: Not reported
Contact Phone: 619-560-6400
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Teledyne Ryan Electronics
Operator Address: 8650 Balboa Ave
Operator City: San Diego
Operator State: California
Operator Zip: 92123

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE RYAN ELECTRONICS (Continued)

S103953891

Operator Contact: Jackie Sparrey Mchugh
Operator Contact Title: Not reported
Operator Contact Phone: 619-560-6400
Operator Contact Phone Ext: Not reported
Operator Contact Email: Not reported
Operator Type: Private Business
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: California
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: 619-560-6400
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported
Constype Recons Ind: Not reported
Constype Residential Ind: Not reported
Constype Transport Ind: Not reported
Constype Utility Description: Not reported
Constype Utility Ind: Not reported
Constype Water Sewer Ind: Not reported
Dir Discharge Uswater Ind: Not reported
Receiving Water Name: San Diego River
Certifier: Not reported
Certifier Title: Not reported
Certification Date: Not reported
Primary Sic: 3812-Search, Detection, Navigation, Guidance, Aeronautical, and
Nautical Systems and Instruments
Secondary Sic: Not reported
Tertiary Sic: Not reported

AF202 **CUBIC DEFENSE APPLICATIONS, INC.**
NE **9233 BALBOA AVE**
< 1/8 **SAN DIEGO, CA 92123**
0.105 mi.
554 ft. **Site 1 of 10 in cluster AF**

RCRA-LQG **1000246402**
CAD008382293

Actual: RCRA-LQG:
432 ft. Date form received by agency: 03/16/2012
Focus Map: Facility name: CUBIC DEFENSE APPLICATIONS, INC.
1 Facility address: 9233 BALBOA AVE
SAN DIEGO, CA 92123
EPA ID: CAD008382293
Mailing address: PO BOX 85587
SAN DIEGO, CA 92186-5587
Contact: RICHARD B RADOMSKI

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

Contact address: PO BOX 85587
SAN DIEGO, CA 92186-5587
Contact country: US
Contact telephone: 858-505-2716
Contact email: RICK.RADOMSKI@CUBIC.COM
EPA Region: 09
Land type: Private
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name: CUBIC CORPORATION
Owner/operator address: BALBOA AVE
SAN DIEGO, CA 92123
Owner/operator country: Not reported
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 01/01/1962
Owner/Op end date: Not reported

Owner/operator name: WALTER J ZABLE
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: CUBIC DEFENSE APPLICATIONS
Owner/operator address: BALBOA AVE
SAN DIEGO, CA 92123
Owner/operator country: Not reported
Owner/operator telephone: 858-505-2716
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

Owner/Operator Type: Operator
Owner/Op start date: 01/01/1962
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: 122
. Waste name: Alkaline solution without metals (pH > 12.5)

. Waste code: 135
. Waste name: Unspecified aqueous solution

. Waste code: 141
. Waste name: Off-specification, aged, or surplus inorganics

. Waste code: 181
. Waste name: Other inorganic solid waste

. Waste code: 331
. Waste name: Off-specification, aged, or surplus organics

. Waste code: 343
. Waste name: Unspecified organic liquid mixture

. Waste code: 352
. Waste name: Other organic solids

. Waste code: 551
. Waste name: Laboratory waste chemicals

. Waste code: 791
. Waste name: Liquids with pH < 2

. Waste code: 792
. Waste name: Liquids with pH < 2 with metals

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
- . Waste code: D003
- . Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.
- . Waste code: D007
- . Waste name: CHROMIUM
- . Waste code: D008
- . Waste name: LEAD
- . Waste code: D010
- . Waste name: SELENIUM
- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: U002
- . Waste name: ACETONE (I)
- . Waste code: U080
- . Waste name: METHANE, DICHLORO-
- . Waste code: U122
- . Waste name: FORMALDEHYDE
- . Waste code: U123
- . Waste name: FORMIC ACID (C,T)
- . Waste code: U220
- . Waste name: BENZENE, METHYL-
- . Waste code: U239
- . Waste name: BENZENE, DIMETHYL- (I,T)

Historical Generators:

Date form received by agency: 05/27/2010
Site name: CUBIC DEFENSE APPLICATIONS, INC.
Classification: Large Quantity Generator

- . Waste code: 181
- . Waste name: Other inorganic solid waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

- . Waste code: 331
- . Waste name: Off-specification, aged, or surplus organics

- . Waste code: 343
- . Waste name: Unspecified organic liquid mixture

- . Waste code: 352
- . Waste name: Other organic solids

- . Waste code: 551
- . Waste name: Laboratory waste chemicals

- . Waste code: 791
- . Waste name: Liquids with pH < 2

- . Waste code: 792
- . Waste name: Liquids with pH < 2 with metals

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSLEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

- . Waste code: D003
- . Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.

- . Waste code: D007
- . Waste name: CHROMIUM

- . Waste code: D008
- . Waste name: LEAD

- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: U122
. Waste name: FORMALDEHYDE

. Waste code: U138
. Waste name: METHANE, IODO-

. Waste code: U239
. Waste name: BENZENE, DIMETHYL- (I,T)

Date form received by agency:02/28/2008

Site name: CUBIC DEFENSE APPLICATIONS, INC.

Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002
. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D007
. Waste name: CHROMIUM

. Waste code: D008
. Waste name: LEAD

. Waste code: D035
. Waste name: METHYL ETHYL KETONE

Date form received by agency:02/20/2005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

Site name:	CUBIC DEFENSE APPLICATIONS, INC.
Classification:	Large Quantity Generator
. Waste code:	121
. Waste name:	Alkaline solution (pH >12.5) with metals (antimony, arsenic, barium, beryllium, cadmium, chromium, cobalt, copper, lead, mercury, molybdenum, nickel, selenium, silver, thallium, vanadium, and zinc)
. Waste code:	134
. Waste name:	Aqueous solution with <10% total organic residues
. Waste code:	141
. Waste name:	Off-specification, aged, or surplus inorganics
. Waste code:	172
. Waste name:	Metal dust (see 121) and machining waste
. Waste code:	181
. Waste name:	Other inorganic solid waste
. Waste code:	212
. Waste name:	Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)
. Waste code:	214
. Waste name:	Unspecified solvent mixture
. Waste code:	221
. Waste name:	Waste oil and mixed oil
. Waste code:	331
. Waste name:	Off-specification, aged, or surplus organics
. Waste code:	343
. Waste name:	Unspecified organic liquid mixture
. Waste code:	352
. Waste name:	Other organic solids
. Waste code:	512
. Waste name:	Other empty containers 30 gallons or more
. Waste code:	513
. Waste name:	Empty containers less than 30 gallons
. Waste code:	541
. Waste name:	Photochemicals / photo processing waste
. Waste code:	551
. Waste name:	Laboratory waste chemicals
. Waste code:	726
. Waste name:	Liquids with nickel > 134 mg/l
. Waste code:	791
. Waste name:	Liquids with pH < 2
. Waste code:	D001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002

. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D003

. Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.

. Waste code: D007

. Waste name: CHROMIUM

. Waste code: D008

. Waste name: LEAD

. Waste code: D009

. Waste name: MERCURY

. Waste code: D035

. Waste name: METHYL ETHYL KETONE

. Waste code: U151

. Waste name: MERCURY

Date form received by agency:02/26/2004

Site name: CUBIC DEFENSE APPLICATIONS, INC.

Classification: Large Quantity Generator

. Waste code: D001

. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002

. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

- . Waste code: D003
- . Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.

- . Waste code: D007
- . Waste name: CHROMIUM

- . Waste code: D008
- . Waste name: LEAD

- . Waste code: D018
- . Waste name: BENZENE

- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE

- . Waste code: F002
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 02/28/2002

Site name: CUBIC DEFENSE SYSTEMS, INC.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

Classification:	Large Quantity Generator
. Waste code:	121
. Waste name:	Alkaline solution (pH >12.5) with metals (antimony, arsenic, barium, beryllium, cadmium, chromium, cobalt, copper, lead, mercury, molybdenum, nickel, selenium, silver, thallium, vanadium, and zinc)
. Waste code:	122
. Waste name:	Alkaline solution without metals (pH > 12.5)
. Waste code:	131
. Waste name:	Aqueous solution (2 < pH < 12.5) containing reactive anions (azide, bromate, chlorate, cyanide, fluoride, hypochlorite, nitrite, perchlorate, and sulfide anions)
. Waste code:	134
. Waste name:	Aqueous solution with <10% total organic residues
. Waste code:	141
. Waste name:	Off-specification, aged, or surplus inorganics
. Waste code:	214
. Waste name:	Unspecified solvent mixture
. Waste code:	221
. Waste name:	Waste oil and mixed oil
. Waste code:	261
. Waste name:	Polychlorinated biphenyls and material containing PCB's
. Waste code:	272
. Waste name:	Polymeric resin waste
. Waste code:	331
. Waste name:	Off-specification, aged, or surplus organics
. Waste code:	352
. Waste name:	Other organic solids
. Waste code:	541
. Waste name:	Photochemicals / photo processing waste
. Waste code:	725
. Waste name:	Liquids with mercury > 20 mg/l
. Waste code:	726
. Waste name:	Liquids with nickel > 134 mg/l
. Waste code:	791
. Waste name:	Liquids with pH < 2
. Waste code:	D001
. Waste name:	IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
- . Waste code: D003
- . Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.
- . Waste code: D007
- . Waste name: CHROMIUM
- . Waste code: D008
- . Waste name: LEAD
- . Waste code: D009
- . Waste name: MERCURY
- . Waste code: D018
- . Waste name: BENZENE
- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: D039
- . Waste name: TETRACHLOROETHYLENE
- . Waste code: F001
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE, AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

MIXTURES.

. Waste code: F005
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency:10/12/2000
Site name: CUBIC DEFENSE SYSTEMS
Classification: Large Quantity Generator

Date form received by agency:03/04/1999
Site name: CUBIC DEFENSE SYSTEMS
Classification: Large Quantity Generator

Date form received by agency:03/19/1998
Site name: CUBIC CORP
Classification: Large Quantity Generator

Date form received by agency:09/01/1996
Site name: CUBIC CORP
Classification: Large Quantity Generator

Date form received by agency:03/28/1996
Site name: CUBIC DEFENSE SYSTEMS, INC.
Classification: Large Quantity Generator

Date form received by agency:03/30/1994
Site name: CUBIC DEFENSE SYSTEMS INC.
Classification: Large Quantity Generator

Date form received by agency:04/06/1992
Site name: CUBIC DEFENSE SYSTEMS, INC.
Classification: Large Quantity Generator

Date form received by agency:05/16/1990
Site name: CUBIC CORPORATION
Classification: Large Quantity Generator

Date form received by agency:08/18/1980
Site name: CUBIC CORP
Classification: Large Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 02/21/2008
Date achieved compliance: 03/17/2008
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 02/21/2008
Enf. disposition status: Not reported
Enf. disp. status date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 07/24/2003
Date achieved compliance: 08/27/2003
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 03/30/1994
Date achieved compliance: 03/30/1999
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:
Evaluation date: 02/21/2008
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 03/17/2008
Evaluation lead agency: State

Evaluation date: 07/24/2003
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 08/27/2003
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 03/30/1994
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 03/30/1999
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 03/30/1993
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 08/27/2003
Evaluation lead agency: State Contractor/Grantee

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC. (Continued)

1000246402

Evaluation date: 01/29/1992
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 08/27/2003
Evaluation lead agency: State Contractor/Grantee

**AF203
NE
< 1/8
0.105 mi.
554 ft.**

**CUBIC CORPORATION
9233 BALBOA AVE
SAN DIEGO, CA 92123**

**CA SWEEPS UST
CA HIST UST
CA EMI**

**U001572305
N/A**

Site 2 of 10 in cluster AF

**Actual:
432 ft.**

SWEEPS UST:

**Focus Map:
1**

Status: Active
Comp Number: 70
Number: 9
Board Of Equalization: Not reported
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000070-000002
Tank Status: A
Capacity: 500
Active Date: Not reported
Tank Use: UNKNOWN
STG: W
Content: Not reported
Number Of Tanks: 1

Status: Not reported
Comp Number: 70
Number: Not reported
Board Of Equalization: Not reported
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000070-000001
Tank Status: Not reported
Capacity: 10000
Active Date: Not reported
Tank Use: UNKNOWN
STG: PRODUCT
Content: Not reported
Number Of Tanks: 1

HIST UST:

File Number: Not reported
URL: Not reported
Region: STATE
Facility ID: 00000014328
Facility Type: Other
Other Type: ELECTRONICS
Contact Name: Not reported
Telephone: 6192776780
Owner Name: CUBIC CORPORATION
Owner Address: 9333 BALBOA AVENUE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC CORPORATION (Continued)

U001572305

Owner City,St,Zip: SAN DIEGO, CA 92075
Total Tanks: 0002

Tank Num: 001
Container Num: 1
Year Installed: 1962
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: Visual

Tank Num: 002
Container Num: 2
Year Installed: 1962
Tank Capacity: 00000500
Tank Used for: WASTE
Type of Fuel: Not reported
Container Construction Thickness: 4
Leak Detection: Visual

EMI:

Year: 1999
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 2
Reactive Organic Gases Tons/Yr: 1
Carbon Monoxide Emissions Tons/Yr: 5
NOX - Oxides of Nitrogen Tons/Yr: 6
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0

Year: 2000
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 2
Reactive Organic Gases Tons/Yr: 1
Carbon Monoxide Emissions Tons/Yr: 5
NOX - Oxides of Nitrogen Tons/Yr: 6
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0

Year: 2001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC CORPORATION (Continued)

U001572305

County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 2
Reactive Organic Gases Tons/Yr: 1
Carbon Monoxide Emissions Tons/Yr: 5
NOX - Oxides of Nitrogen Tons/Yr: 6
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2002
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 2
Reactive Organic Gases Tons/Yr: 1
Carbon Monoxide Emissions Tons/Yr: 5
NOX - Oxides of Nitrogen Tons/Yr: 6
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2003
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0
Reactive Organic Gases Tons/Yr: 0
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 1
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2004
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC CORPORATION (Continued)

U001572305

Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.438662097
Reactive Organic Gases Tons/Yr: 0.409359847
Carbon Monoxide Emissions Tons/Yr: 0.44664
NOX - Oxides of Nitrogen Tons/Yr: 0.532897
SOX - Oxides of Sulphur Tons/Yr: 0.0031983
Particulate Matter Tons/Yr: 0.0405118
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.0405118

AF204
NE
< 1/8
0.105 mi.
554 ft.

CUBIC DEFENSE APPLICATIONS, INC
9233 BALBOA AV
SAN DIEGO, CA 92123
Site 3 of 10 in cluster AF

CA SAN DIEGO CO. SAM
CA CPS-SLIC
CA San Diego Co. HMM
CA HIST UST
CA EMI

S104744871
N/A

Actual:
432 ft.

Focus Map:
1

SAN DIEGO CO. SAM:
Case Number: H00070-001
Agency: DEH Site Assessment & Mitigation
Funding: Private - VAP
Facility Type: Drinking Water Aquifer Impacted
Facility Status: Closed Case
Date: 10/5/1992
Date Began: 11/19/1987

CPS-SLIC:
Region: STATE
Facility Status: Completed - Case Closed
Status Date: 10/05/1992
Global Id: T0608107991
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H00070-001
Latitude: 32.821069
Longitude: -117.130982
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Aquifer used for drinking water supply
Potential Contaminants of Concern: * Chlorinated Hydrocarbons
Site History: Not reported

Click here to access the California GeoTracker records for this facility:

Region: STATE
Facility Status: Open - Active
Status Date: 11/14/2018
Global Id: T10000012319
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: DEH2018-LSAM-000521
Latitude: 32.82198
Longitude: -117.13108
Case Type: Cleanup Program Site
Case Worker: JC
Local Agency: SAN DIEGO COUNTY LOP
RB Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

File Location: Not reported
Potential Media Affected: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAD008382293
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 858 277-6780
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 06/20/2018
Facility Owner: Not reported
Facility Mailing Address: 9333 BALBOA AVE MS 2-6, SAN DIEGO, CA 92123
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

UST DTL:

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100070
Facility Type (Ust Facility): Not reported
Tank Owner Name: CUBIC DEFENSE APPLICATIONS, INC
Tankid: 15569
Tank Status: Closed In Place
Date Ust Permanently Closed: 11/08/1986
Tank Use: Not reported
Piping System Type: Not reported
Last Updated: 2018-10-05T02:14:26.000
Tank Capacityin Gallons: 10000
Tank Contents: Not reported
Type Of Tank: 95

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100070
Facility Type (Ust Facility): Not reported
Tank Owner Name: CUBIC DEFENSE APPLICATIONS, INC
Tankid: 15570
Tank Status: Exempt
Date Ust Permanently Closed: Not reported
Tank Use: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Piping System Type: Not reported
Last Updated: 2018-10-05T02:14:26.000
Tank Capacityin Gallons: 500
Tank Contents: Not reported
Type Of Tank: 95

Waste and Materials:

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177903
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: ARGON, AR, 75%: CARBON DIOXIDEC02, 25%
Common Name: COMPRESSED GASES MIXTURE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152474
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE FLOORING W/ WOOD CONTAINING ASBESTOS
Common Name: ASBESTOS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177909
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: HALON 1301
Common Name: HALON 1301
Case Number: 75-63-8

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177910
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: HELIUM, HE 99%, COMPRESSED GASES :
Common Name: HELIUM, HE 99%, COMPRESSED GASES :
Case Number: 7440-59-7

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177911
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Last Updated: 2018-10-05T02:14:23.000
Chemical Name: ISOPROPYL ALCOHOL, 2-PROPANOL, CH3 2CHOH,99%
Common Name: ISOPROPYL ALCOHOL, 2-PROPANOL, CH3 2CHOH,99%
Case Number: 67-63-0

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177913
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: MISC. POWDER COATING POWDER
Common Name: MISC. POWDER COATING POWDER
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177920
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: Tin & Lead Solder
Common Name: Solder
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152466
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE PAINT RELATED MATERIALS
Common Name: WASTE PAINT, FLAMMABLES (331)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152467
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE POWDER COAT BOOTH FILTERS
Common Name: WASTE POWDER COAT BOOTH FILTERS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152468
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE CORROSIVE LIQUID, BASIC, ORGANIC, WITH LEAD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Common Name: WASTE ULTRASONIC GUN CLEANING SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098623
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: ARGON, AR, 75%: CARBON DIOXIDE C02, 25%
Common Name: COMPRESSED GASES MIXTURE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098624
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS
Common Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS
Case Number: 74-86-2

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098625
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: BLANK AMMUNITION
Common Name: BLANK AMMUNITION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098626
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: CARBON DIOXIDE, C02,99%, LIQUIFIED COMPRESSED GAS.
Common Name: CARBON DIOXIDE, C02,99%, LIQUIFIED COMPRESSED GAS.
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098627
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: DIESEL FUEL
Common Name: DIESEL FUEL
Case Number: 68476-34-6

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098628
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: CHROMIC ACID, OR CHROMIUM TRIOXIDE,
Common Name: H2CRO4, 10% ALODINE SOLUTION
Case Number: 7738-94-5

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098629
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: HALON 1301
Common Name: HALON 1301
Case Number: 75-63-8

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098630
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: HELIUM, HE 99%, COMPRESSED GASES :
Common Name: HELIUM, HE 99%, COMPRESSED GASES :
Case Number: 7440-59-7

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098631
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: ISOPROPYL ALCOHOL, 2-PROPANOL, CH3 2CHOH,99% :
Common Name: ISOPROPYL ALCOHOL, 2-PROPANOL, CH3 2CHOH,99% :
Case Number: 67-63-0

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098632
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: METHYL ETHYL KETONE, 2-BUTANONE, 99%
Common Name: METHYL ETHYL KETONE, 2-BUTANONE, 99%
Case Number: 78-93-3

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098633
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: MISC. POWDER COATING POWDER
Common Name: MISC. POWDER COATING POWDER
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098634
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: NITRIC ACID
Common Name: NITRIC ACID
Case Number: 7697-37-2

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098635
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: NITROGEN, N2, 99% COMPRESSED GAS.
Common Name: NITROGEN, N2, 99% COMPRESSED GAS.
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098636
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: NITROGEN, N2, 99%, LIQUIFIED COMPRESSED GAS.
Common Name: NITROGEN, N2, 99%, LIQUIFIED COMPRESSED GAS.
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098637
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: OXYGEN, O2, 99%, COMPRESSED GAS
Common Name: OXYGEN, O2, 99%, COMPRESSED GAS
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098638

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: PROPANE-COMPRESSED GAS
Common Name: PROPANE-COMPRESSED GAS
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098639
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: Triphosphoric acid, sodium salt (1:5)
Common Name: Sodium tripolyphosphate solution
Case Number: 7758-29-4

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0098640
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: Tin & Lead Solder
Common Name: Solder
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080299
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS(5)
Common Name: AEROSOLS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080300
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS(3)
Common Name: BOOTH FILTERS W/CR
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080301
Trade Secret: N
Hazardous Material Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Last Updated:	2017-06-21T02:34:11.000
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2
Common Name:	CHROMIC/NITRIC ACID (792)
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100070
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0080302
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-21T02:34:11.000
Chemical Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS.
Common Name:	COOLANT, MOP WATER
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100070
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0080303
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-21T02:34:11.000
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2
Common Name:	CORROSIVE ACIDIC ORGANIC
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100070
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0080304
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-21T02:34:11.000
Chemical Name:	WASTE WATER WITH LEAD
Common Name:	SOLDER RINSE (132)
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100070
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0080305
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-21T02:34:11.000
Chemical Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS.
Common Name:	FLAMMABLE, TOXIC, IPA, ROSIN FLUX (343)
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100070
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0080306
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-21T02:34:11.000
Chemical Name:	WASTE LATEX PAINT W/ CR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Common Name: LATEX PAINT(343)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080307
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE 172 METAL DUST & MACHINING WASTE
Common Name: Magnesium or Aluminum dust
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080308
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Common Name: OIL ABSORBANT AND FILTERS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080309
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: RAGS/CONTAINER W/ORG'S
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080310
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE CORROSIVE LIQUID, BASIC
Common Name: WASTE CORROSIVE LIQUID, BASIC
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080311
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE CORROSIVE LIQUID, BASIC, INORGANIC (SODIUM HYDROXIDE)
Common Name: WASTE CORROSIVE LIQUID, BASIC, INORGANIC (SODIUM HYDROXIDE)
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080312
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE MACHINE COOLANT
Common Name: WASTE MACHINE COOLANT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080313
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE METALPHOTO LABEL PRINTING SOLUTION W/Ni
Common Name: WASTE METALPHOTO LABEL PRINTING SOLUTION W/Ni
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080314
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE PAINT RELATED MATERIALS
Common Name: WASTE PAINT, FLAMMABLES (331)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080315
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE POWDER COAT BOOTH FILTERS
Common Name: WASTE POWDER COAT BOOTH FILTERS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0080316
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE SANDBLASTING SAND WITH CR
Common Name: WASTE SANDBLASTING SAND WITH CR
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Active Permit: Y
Child Record Id: DEH2016-HWAST-0080317
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-21T02:34:11.000
Chemical Name: WASTE CORROSIVE LIQUID, BASIC, ORGANIC, WITH LEAD
Common Name: WASTE CORROSIVE LIQUID, BASIC, ORGANIC, WITH LEAD
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177904
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS
Common Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS
Case Number: 74-86-2

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177906
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: CARBON DIOXIDE, C02,99%, LIQUIFIED COMPRESSED GAS.
Common Name: CARBON DIOXIDE, C02,99%, LIQUIFIED COMPRESSED GAS.
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177912
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: METHYL ETHYL KETONE, 2-BUTANONE, 99%
Common Name: METHYL ETHYL KETONE, 2-BUTANONE, 99%
Case Number: 78-93-3

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177914
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: NITRIC ACID
Common Name: NITRIC ACID
Case Number: 7697-37-2

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177915

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: NITROGEN, N2, 99% COMPRESSED GAS.
Common Name: NITROGEN, N2, 99% COMPRESSED GAS.
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177916
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: NITROGEN, N2, 99%, LIQUIFIED COMPRESSED GAS.
Common Name: NITROGEN, N2, 99%, LIQUIFIED COMPRESSED GAS.
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177917
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: OXYGEN, 02, 99%, COMPRESSED GAS
Common Name: OXYGEN, 02, 99%, COMPRESSED GAS
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177918
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: PROPANE-COMPRESSED GAS
Common Name: PROPANE-COMPRESSED GAS
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177919
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: Triphosphoric acid, sodium salt (1:5)
Common Name: Sodium tripolyphosphate solution
Case Number: 7758-29-4

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152455
Trade Secret: N
Hazardous Material Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS(5)
Common Name: AEROSOLS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152456
Trade Secret: N

Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS(3)
Common Name: BOOTH FILTERS W/CR
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152457
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE 791 LIQUIDS WITH PH <OR= 2
Common Name: CHROMIC/NITRIC ACID (792)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152461
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE LATEX PAINT W/ CR
Common Name: LATEX PAINT(343)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152463
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE CORROSIVE LIQUID, BASIC, INORGANIC (SODIUM HYDROXIDE)
Common Name: WASTE CORROSIVE LIQUID, BASIC, INORGANIC (SODIUM HYDROXIDE)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152465
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE METALPHOTO LABEL PRINTING SOLUTION W/Ni

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Common Name: WASTE METALPHOTO LABEL PRINTING SOLUTION W/Ni
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152469
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE FLAMMABLE AMINES
Common Name: EPOXY RESIN ADHESIVE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152470
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE SURPLUS CORROSIVE LIQUIDS W/ AMINES
Common Name: EPOXY RESIN ADHESIVE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152471
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE SURPLUS RESINS
Common Name: RESIN
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152472
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE USED STEEL & PLASTIC DRUMS
Common Name: USED DRUMS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152473
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE FLOORING CONTAINING ASBESTOS
Common Name: ASBESTOS
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177905
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: BLANK AMMUNITION
Common Name: BLANK AMMUNITION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177907
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: DIESEL FUEL
Common Name: DIESEL FUEL
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177908
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-05T02:14:23.000
Chemical Name: CHROMIC ACID, OR CHROMIUM TRIOXIDE,
Common Name: H2CRO4, 10% ALODINE SOLUTION
Case Number: 7738-94-5

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152458
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS.
Common Name: COOLANT, MOP WATER
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152459
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE WATER WITH LEAD
Common Name: SOLDER RINSE (132)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Active Permit: Y
Child Record Id: DEH2018-HWAST-0152460
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS.
Common Name: FLAMMABLE, TOXIC, IPA, ROSIN FLUX (343)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152462
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: RAGS/CONTAINER W/ORG'S
Case Number: Not reported

Record ID: DEH2002-HUPFP-100070
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152464
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-05T02:14:24.000
Chemical Name: WASTE MACHINE COOLANT
Common Name: WASTE MACHINE COOLANT
Case Number: Not reported

Permit Number: 100070
Business Type: 6HK50
EPA Id Number: CAD008382293
APN: 369-163-05-00
Last HMMD Inspection: 12/02/2010
Facility Telephone: 277-6780
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: CUBIC DEFENSE APPLICATIONS, INC
Facility Mailing Address: PO BOX 85587
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92186-5587
UST Owner: CUBIC CORPORATION
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 74-86-2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Name: ACETYLENE, C2H2, 99%, COMPRES-SED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 7440-37-1
Name: ARGON, AR, 75%: CARBON DIOXIDE C02,
Other Information: 25%: COMPRESSED GASES MIXTURE
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: CHRONIC

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 124-38-9
Name: CARBON DIOXIDE, C02, 99%, COMPRESSED GAS.
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 124-38-9
Name: CARBON DIOXIDE, C02,99%, LIQUIFIED COMPRESSED GAS.
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 7738-94-5
Name: CHROMIC ACID, OR CHROMIUM TRIOXIDE,
Other Information: H2CRO4, 10% ALODINE SOLUTION
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100070
Update Date: 11/02/2012
Case Number: MIXTURE
Name: EPOXY POLYAMIDE COATINGS
Other Information: Not reported
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 75-63-8
Name: HALON 1301
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 7440-59-7
Name: HELIUM, HE 99%, COMPRESSED GASES :
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 67-63-0
Name: ISOPROPYL ALCOHOL, 2-PROPANOL, CH3 2CHOH,99% :
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 78-93-3
Name: METHYL ETHYL KETONE, 2-BUTANONE, 99%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 64742-52-5
Name: MINERAL OIL, 80% ; TRIETHANOLAMINE,
Other Information: 10% ; CIMPERIAL 1011, METALWORKING FLUI
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN, N2, 99% COMPRESSED GAS.
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: CHRONIC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN, N2, 99%, LIQUIFIED COMPRESSED GAS.
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: CHRONIC

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN, O2, 99%, COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100070
Update Date: 11/02/2012
Case Number: MIXTURE
Name: PAINT & PRIMERS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 9016-87-9
Name: POLYURETHANE FOAM RESIN
Other Information: INSTAPAK A, POLYMERIC MDI
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: POLYURETHANE FOAM RESIN
Other Information: INSTAPAK B
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE-COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100070
Update Date: 11/02/2012
Case Number: 64-17-5

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Name: VIGON SC200, CLEANER, W/ MODIFIED ALCOHOLS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 121 ALKALINE SOL'N WITH METALS
Other Information: W/PB (343)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 121 ALKALINE SOL'N WITH METALS(2)
Other Information: CORROSIVE, BASIC, SOLDER RINSE (132)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 134 AQUEOUS SOL'N W/LESS 10% ORG
Other Information: NON-RCRA LIQUID
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 172 METAL DUST & MACHINING WASTE
Other Information: MG
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information: AL POWDER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: PUMP OIL, CUTTING OIL MIX
Material Waste: Waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100070
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information:	OIL ABSORBANT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100070
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 291 LATEX WASTE
Other Information:	LATEX PAINT(343)
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100070
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS(3)
Other Information:	BOOTH FILTERS W/CR
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100070
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS(5)
Other Information:	AEROSOLS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100070
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS.
Other Information:	ADHESIVES, PETROLEUM DIST
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100070
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS.
Other Information:	COOLANT, MOP WATER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS.
Other Information: FLAMMABLE, TOXIC, IPA, ROSIN FLUX (343)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: RAGS/CONTAINER W/ORG'S
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 461 PAINT SLUDGE
Other Information: WASTE PAINT, FLAMMABLES (331)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 541 PHOTOCHEM/PHOTOPROC WASTE
Other Information: PHOTOCHEMICALS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 726 LIQUIDS W NICKEL - R
Other Information: NICKEL SULFATE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 791 LIQUIDS WITH PH <OR= 2
Other Information: CHROMIC/NITRIC ACID (792)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Name: WASTE 791 LIQUIDS WITH PH <OR= 2
Other Information: CORROSIVE ACIDIC ORGANIC
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100070
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 792 LIQUIDS W/PH <OR= 2 W/METALS
Other Information: SULFURIC ACID
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 100070
Update Date: 11/02/2012
Inspection Date: 12/02/2010
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 100070
Update Date: 11/02/2012
Inspection Date: 12/02/2010
Violation Code: 6HV0221
Violation: DID NOT COMPLY W/SATELLITE REGS.
Violation Citation: Failed to comply with satellite regulations. 66262.34(e)
Activity: ACTIVE

Permit Number: 100070
Update Date: 11/02/2012
Inspection Date: 12/02/2010
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 100070
Update Date: 11/02/2012
Inspection Date: 12/02/2010
Violation Code: 6HV0235
Violation: WASTE NOT ACCUMULATED IN CONTAINER/TANK
Violation Citation: Did not accumulate waste in container or tank. 66262.34(a)(1)
Activity: ACTIVE

Permit Number: 100070
Update Date: 11/02/2012
Inspection Date: 07/24/2003
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Activity: 66265.173(a)
ACTIVE

Permit Number: 100070
Update Date: 11/02/2012
Inspection Date: 07/24/2003
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)

Activity: ACTIVE

Permit Number: 100070
Update Date: 11/02/2012
Inspection Date: 07/24/2003
Violation Code: 6HV1003
Violation: HMBP NOT AMENDED W/IN 30 DAYS
Violation Citation: Business plan was not amended within 30 days for a 100% quantity increase, new disclosable materials or a change in business info. HSC 25505

Activity: ACTIVE

Permit Number: 100070
Update Date: 11/02/2012
Inspection Date: 02/21/2008
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)

Activity: ACTIVE

Permit Number: 100070
Update Date: 11/02/2012
Inspection Date: 02/21/2008
Violation Code: 6HV0222
Violation: DID NOT PROPERLY LABEL ERM
Violation Citation: Failed to properly label ERM. 25143.9(a)

Activity: ACTIVE

Permit Number: 100070
Update Date: 11/02/2012
Inspection Date: 02/21/2008
Violation Code: 6HV0224
Violation: MISMANAGED EMPTY CONTAINERS >5GALS.
Violation Citation: Failed to mark date on empty container larger than 5 gallons and/or manage it within one year. 66261.7(e) & (f).

Activity: ACTIVE

Permit Number: 100070
Update Date: 11/02/2012
Inspection Date: 02/21/2008
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Activity: ACTIVE

Permit Number: 100070
Update Date: 11/02/2012
Inspection Date: 02/21/2008
Violation Code: 6HV0208
Violation: STORAGE AREA: NO WEEKLY INSPECTION
Violation Citation: Hazardous waste storage area is not being inspected weekly for deteriorated or leaking containers CCR 66265.174
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 100070 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 100070
Tank Type: UNKNOWN
Additional Id: 1
Capacity Gallons: 10000
UST Contents: Not reported
Other Content Info: SEE FILE FOR CONTENTS
Reg Status: CLOSED
Remove Close Date: 1986-11-08 00:00:00
Year Installed: 1962-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 24
UST Monitor Method: VISUAL MONITORING: DAILY (MINIMUM) LOG OF INSPECTIONS

UST Name: UNDERGROUND TANK 100070 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 100070
Tank Type: UNKNOWN
Additional Id: 2
Capacity Gallons: 500
UST Contents: Not reported
Other Content Info: SEE FILE FOR CONTENTS
Reg Status: EXEMPT
Remove Close Date: Not reported
Year Installed: 1962-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 24
UST Monitor Method: VISUAL MONITORING: DAILY (MINIMUM) LOG OF INSPECTIONS

HIST UST:

File Number: 0002B071
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002B071.pdf>
Region: Not reported
Facility ID: Not reported
Facility Type: Not reported
Other Type: Not reported
Contact Name: Not reported
Telephone: Not reported
Owner Name: Not reported
Owner Address: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Owner City,St,Zip: Not reported
Total Tanks: Not reported

Tank Num: Not reported
Container Num: Not reported
Year Installed: Not reported
Tank Capacity: Not reported
Tank Used for: Not reported
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: Not reported

[Click here for Geo Tracker PDF:](#)

EMI:

Year: 2005
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: .3811051
Reactive Organic Gases Tons/Yr: .3509621
Carbon Monoxide Emissions Tons/Yr: .44102
NOX - Oxides of Nitrogen Tons/Yr: .5324
SOX - Oxides of Sulphur Tons/Yr: .0031953
Particulate Matter Tons/Yr: .040194
Part. Matter 10 Micrometers and Smlr Tons/Yr: .040194

Year: 2006
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: .38110462
Reactive Organic Gases Tons/Yr: .35096237
Carbon Monoxide Emissions Tons/Yr: .44102
NOX - Oxides of Nitrogen Tons/Yr: .532397
SOX - Oxides of Sulphur Tons/Yr: .0031983
Particulate Matter Tons/Yr: .0401938
Part. Matter 10 Micrometers and Smlr Tons/Yr: .0401938

Year: 2007
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: .1271506
Reactive Organic Gases Tons/Yr: .106182859
Carbon Monoxide Emissions Tons/Yr: .287
NOX - Oxides of Nitrogen Tons/Yr: .34
SOX - Oxides of Sulphur Tons/Yr: .002125
Particulate Matter Tons/Yr: .02133
Part. Matter 10 Micrometers and Smlr Tons/Yr: .02133

Year: 2008
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: .1271506
Reactive Organic Gases Tons/Yr: .106182859
Carbon Monoxide Emissions Tons/Yr: .287
NOX - Oxides of Nitrogen Tons/Yr: .34
SOX - Oxides of Sulphur Tons/Yr: .002125
Particulate Matter Tons/Yr: .02133
Part. Matter 10 Micrometers and Smlr Tons/Yr: .02133

Year: 2009
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.14999999999999999
Reactive Organic Gases Tons/Yr: 0.129999
Carbon Monoxide Emissions Tons/Yr: 0.28999999999999998
NOX - Oxides of Nitrogen Tons/Yr: 0.35999999999999999
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 2.9999999999999999E-2
Part. Matter 10 Micrometers and Smlr Tons/Yr: 2.9999999999999999E-2

Year: 2010
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.1271506
Reactive Organic Gases Tons/Yr: 0.106182859
Carbon Monoxide Emissions Tons/Yr: 0.28699999999999998
NOX - Oxides of Nitrogen Tons/Yr: 0.34000000000000002
SOX - Oxides of Sulphur Tons/Yr: 2.1250000000000002E-3

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Particulate Matter Tons/Yr: 2.1329999999999998E-2
Part. Matter 10 Micrometers and Smlr Tons/Yr: 2.1329999999999998E-2

Year: 2011
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.15
Reactive Organic Gases Tons/Yr: 0.129999
Carbon Monoxide Emissions Tons/Yr: 0.29
NOX - Oxides of Nitrogen Tons/Yr: 0.36
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0.03
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.03

Year: 2012
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.1
Reactive Organic Gases Tons/Yr: 0.08
Carbon Monoxide Emissions Tons/Yr: 0.21
NOX - Oxides of Nitrogen Tons/Yr: 0.26
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0.02
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.02

Year: 2013
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.1
Reactive Organic Gases Tons/Yr: 0.08
Carbon Monoxide Emissions Tons/Yr: 0.21
NOX - Oxides of Nitrogen Tons/Yr: 0.26
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0.02
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.02

Year: 2014
County Code: 37
Air Basin: SD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CUBIC DEFENSE APPLICATIONS, INC (Continued)

S104744871

Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.08635622
Reactive Organic Gases Tons/Yr: 0.07525589
Carbon Monoxide Emissions Tons/Yr: 0.208
NOX - Oxides of Nitrogen Tons/Yr: 0.24
SOX - Oxides of Sulphur Tons/Yr: 0.00156
Particulate Matter Tons/Yr: 0.01152
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.01152

Year: 2015
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.08635622
Reactive Organic Gases Tons/Yr: 0.07525589
Carbon Monoxide Emissions Tons/Yr: 0.208
NOX - Oxides of Nitrogen Tons/Yr: 0.24
SOX - Oxides of Sulphur Tons/Yr: 0.00156
Particulate Matter Tons/Yr: 0.01152
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.01152

Year: 2016
County Code: 37
Air Basin: SD
Facility ID: 95
Air District Name: SD
SIC Code: 3679
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.08635622
Reactive Organic Gases Tons/Yr: 0.07525589
Carbon Monoxide Emissions Tons/Yr: 0.208
NOX - Oxides of Nitrogen Tons/Yr: 0.24
SOX - Oxides of Sulphur Tons/Yr: 0.00156
Particulate Matter Tons/Yr: 0.01152
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.01152

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AF205
NE
< 1/8
0.112 mi.
591 ft.
NAVAL UNDERSEA WARFARE ENGIN
9284 BALBOA AV
SAN DIEGO, CA 92123
Site 4 of 10 in cluster AF

CA LUST
CA SAN DIEGO CO. SAM
CA San Diego Co. HMMD
S104760988
N/A

Actual:
432 ft.
Focus Map:
1

LUST:
Lead Agency: SAN DIEGO RWQCB (REGION 9)
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T10000005029
Global Id: T10000005029
Latitude: 32.8231716071517
Longitude: -117.130330468261
Status: Completed - Case Closed
Status Date: 04/15/1997
Case Worker: Not reported
RB Case Number: Not reported
Local Agency: Not reported
File Location: Not reported
Local Case Number: Not reported
Potential Media Affect: Soil
Potential Contaminants of Concern: Other Petroleum, Waste Oil / Motor / Hydraulic / Lubricating
Site History: The property originally was operated by the National Aeronautics and Space Administration (NASA) and was used as the government acceptance and test facility for Atlas rocket motor casings built by General Dynamics at their adjacent facility. Various hazardous waste and petroleum and diala oil was used and stored on-site. Numerous above- and below-ground tanks were used to store the material.

LUST:
Global Id: T10000005029
Action Type: Other
Date: 04/27/1990
Action: Leak Reported

Global Id: T10000005029
Action Type: RESPONSE
Date: 02/01/1998
Action: Site Assessment Report

Global Id: T10000005029
Action Type: Other
Date: 04/27/1990
Action: Leak Began

Global Id: T10000005029
Action Type: Other
Date: 04/27/1990
Action: Leak Discovery

LUST:
Global Id: T10000005029
Status: Completed - Case Closed
Status Date: 04/15/1997

Global Id: T10000005029
Status: Open - Case Begin Date
Status Date: 04/23/1990

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NAVAL UNDERSEA WARFARE ENGIN (Continued)

S104760988

Global Id: T10000005029
Status: Open - Site Assessment
Status Date: 04/23/1990

SAN DIEGO CO. SAM:

Case Number: H80042-001
Agency: CA Regional Water Quality Control Board
Funding: Private - VAP
Facility Type: Drinking Water Aquifer Impacted
Facility Status: Closed Case
Date: 4/22/1997
Date Began: 4/27/1990

HMMD SAN DIEGO:

Permit Number: 180042
Business Type: Not reported
EPA Id Number: Not reported
APN: 369-161-05-00
Last HMMD Inspection: Not reported
Facility Telephone: 619-524-6357
Permit Status: INAC
Permit Expiration: Not reported
Date Last Updated: 11/02/2012
Facility Owner: UNITED STATES NAVY
Facility Mailing Address: 9284 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1514
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

AF206 **USNAVY NAVAL UNDERSEA WARFARE ENG STA**
NE **9284 BALBOA AVE B**
< 1/8 **SAN DIEGO, CA 92123**

RCRA-SQG **1000455593**
CA7170090552

0.112 mi.
591 ft.

Site 5 of 10 in cluster AF

Actual:
432 ft.

RCRA-SQG:

Date form received by agency: 09/01/1996
Facility name: USNAVY NAVAL UNDERSEA WARFARE ENG STA
Facility address: 9284 BALBOA AVE B
SAN DIEGO, CA 92123
EPA ID: CA7170090552
Mailing address: P O BOX 113 NAVAL STATION
SAN DIEGO, CA 92136
Contact: Not reported
Contact address: Not reported
Contact country: US
Contact telephone: Not reported
Contact email: Not reported

Focus Map:
1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USNAVY NAVAL UNDERSEA WARFARE ENG STA (Continued)

1000455593

EPA Region: 09
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: US NAVY
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Federal
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Federal
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 10/23/1990
Site name: USNAVY NAVAL UNDERSEA WARFARE ENG STA
Classification: Large Quantity Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

USNAVY NAVAL UNDERSEA WARFARE ENG STA (Continued)

1000455593

Violation Status: No violations found

AG207 SENIOR AEROSPACE JET PRODUCTS
NNW 9106 BALBOA AV
< 1/8 SAN DIEGO, CA 92123
0.113 mi.
598 ft. Site 1 of 3 in cluster AG

CA ENVIROSTOR S105164209
CA AST N/A
CA San Diego Co. HMMD
CA NPDES
CA CIWQS

Actual: 429 ft. ENVIROSTOR:
Focus Map: 1
Facility ID: 71003760
Status: Inactive - Needs Evaluation
Status Date: Not reported
Site Code: Not reported
Site Type: Tiered Permit
Site Type Detailed: Tiered Permit
Acres: Not reported
NPL: NO
Regulatory Agencies: NONE SPECIFIED
Lead Agency: NONE SPECIFIED
Program Manager: Not reported
Supervisor: Not reported
Division Branch: Cleanup Cypress
Assembly: 77
Senate: 39
Special Program: Not reported
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: Not reported
Latitude: 32.82145
Longitude: -117.1433
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: NONE SPECIFIED
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: CAD009569740
Alias Type: EPA Identification Number
Alias Name: 110002637139
Alias Type: EPA (FRS #)
Alias Name: 71003760
Alias Type: Envirostor ID Number

Completed Info:
Completed Area Name: Not reported
Completed Sub Area Name: Not reported
Completed Document Type: Not reported
Completed Date: Not reported
Comments: Not reported

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

AST:

Certified Unified Program Agencies: Not reported
Owner: SENIOR OPERATIONS, LLC
Total Gallons: Not reported
CERSID: 10390267
Facility ID: 37-000-103275
Business Name: SENIOR AEROSPACE JET PRODUCTS
Phone: 858-430-2220
Fax: 858-974-1520
Mailing Address: 9106 BALBOA AVE
Mailing Address City: SAN DIEGO
Mailing Address State: CA
Mailing Address Zip Code: Not reported
Operator Name: SENIOR OPERATIONS JET PRODUCTS
Operator Phone: 858-688-9328
Owner Phone: 630-837-1811
Owner Mail Address: 300 EAST DEVON AVENUE
Owner State: IL
Owner Zip Code: 60103
Owner Country: United States
Property Owner Name: SWEDELIUS JOSEPH B TRUST 10-29-
Property Owner Phone: Not reported
Property Owner Mailing Address: P O BOX 13519
Property Owner City: ARLINGTON
Property Owner Stat : TX
Property Owner Zip Code: 76094
Property Owner Country: United States
EPAID: CAD009569740

Certified Unified Program Agencies: San Diego
Owner: SENIOR OPERATIONS INC
Total Gallons: 1770
CERSID: Not reported
Facility ID: Not reported
Business Name: Not reported
Phone: Not reported
Fax: Not reported
Mailing Address: Not reported
Mailing Address City: Not reported
Mailing Address State: Not reported
Mailing Address Zip Code: Not reported
Operator Name: Not reported
Operator Phone: Not reported
Owner Phone: Not reported
Owner Mail Address: Not reported
Owner State: Not reported
Owner Zip Code: Not reported
Owner Country: Not reported
Property Owner Name: Not reported
Property Owner Phone: Not reported
Property Owner Mailing Address: Not reported
Property Owner City: Not reported
Property Owner Stat : Not reported
Property Owner Zip Code: Not reported
Property Owner Country: Not reported
EPAID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAD009569740
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 858-430-2220
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 06/19/2018
Facility Owner: Not reported
Facility Mailing Address: 9106 BALBOA AV, SAN DIEGO, CA 92123-1512
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Y
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103275
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5582126
Return To Compliance Date: 2017-02-03T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-19T00:00:00.000
Inspection Date: 2017-01-05T13:05:00.000
Violation Code: 1010008 HMBP not certified annually as complete and accurate in CERS.
HSC 25508.2

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103275
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4418914
Return To Compliance Date: 2015-02-18T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-19T00:00:00.000
Inspection Date: 2015-01-06T00:00:00.000
Violation Code: 3010025 Failure to obtain and maintain a written assessment reviewed and certified by an independent, qualified, professional engineer

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

stating the new hazardous waste tank system has sufficient structural integrity, is acceptable for the transferring, storing and treating of hazardous waste, and that the tanks and containment system including the foundation, structural support, seams, connections, and pressure controls (if applicable) are suitably designed and that the tank system has sufficient structural strength, compatibility with the waste(s) to be transferred, stored or treated, and corrosion protection so that it will not collapse, rupture, or fail. This assessment shall be obtained prior to placing the tank system in service, and shall be kept on file at the facility. The tank assessment shall be good for five years. This assessment shall also include, at a minimum, the following information: 22 CCR 15 66265.192(a), 66265.192(h).

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103275
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5582126
Return To Compliance Date: 2017-02-03T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-19T00:00:00.000
Inspection Date: 2017-01-05T13:05:00.000
Violation Code: 1010005 Site map not submitted in CERS or not sufficient. HSC 25505(a)(2) and 25508(a)(1)(A)

Waste and Materials:

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133127
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-03-07T00:58:30.000
Chemical Name: ARGON, AR, 99%, COMPRESSED GAS:
Common Name: ARGON, AR, 99%, COMPRESSED GAS:
Case Number: 7440-37-1

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133128
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-03-07T00:58:30.000
Chemical Name: MOBIL DTE 25 OIL
Common Name: MOBIL DTE 25 OIL
Case Number: 60263-10-0

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Child Record Id: DEH2017-HCHEM-0133129
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-03-07T00:58:30.000
Chemical Name: MOBIL DTE 26 HYDRAULIC OIL
Common Name: MOBIL DTE 26 HYDRAULIC OIL
Case Number: 60264-09-0

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133130
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-03-07T00:58:30.000
Chemical Name: MOBIL DTE 24 OIL
Common Name: MOBIL DTE 24 OIL
Case Number: 60262-30-0

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133131
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-03-07T00:58:30.000
Chemical Name: MINERAL BASE MACHINE OIL WITH ADDITIVES
Common Name: MOBIL DTE HEAVY
Case Number: 60018-90-0

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133132
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-03-07T00:58:30.000
Chemical Name: HELIUM; COMPRESSED GAS
Common Name: HELIUM; COMPRESSED GAS
Case Number: 7440-59-7

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133133
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-03-07T00:58:30.000
Chemical Name: PROPYLENE-COMPRESSED GAS
Common Name: PROPYLENE-COMPRESSED GAS
Case Number: 115-07-1

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133134
Trade Secret: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Hazardous Material Type:	Mixture
Last Updated:	2017-03-07T00:58:30.000
Chemical Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE
Common Name:	ALVANIA GREASE EP2
Case Number:	57052E-8
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133135
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-03-07T00:58:30.000
Chemical Name:	PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Common Name:	PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Case Number:	74-98-6
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133136
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-03-07T00:58:30.000
Chemical Name:	GRAPHITED PETROLEUM OIL
Common Name:	ARROW 17489 FORGING COMPOUND
Case Number:	N/A
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133137
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-03-07T00:58:30.000
Chemical Name:	SUPERKOOL 2153
Common Name:	SUPERKOOL 2153
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133138
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-03-07T00:58:30.000
Chemical Name:	TELLUS OIL 32
Common Name:	TELLUS OIL 32
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133139
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-03-07T00:58:30.000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Chemical Name: MINERAL OIL, 95%: MOBIL DTE OIL HEAVY MEDIUM
Common Name: MINERAL OIL, 95%: MOBIL DTE OIL HEAVY MEDIUM
Case Number: 60016-30-0

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133140
Trade Secret: N
Hazardous Material Type: Mixture

Last Updated: 2017-03-07T00:58:30.000
Chemical Name: MINERAL BASE MACHINE OIL
Common Name: MOBIL DTE LIGHT
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133141
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-03-07T00:58:30.000
Chemical Name: MOBIL VACTRA OIL #2
Common Name: MOBIL VACTRA OIL #2
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133142
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-03-07T00:58:30.000
Chemical Name: NITROGEN; COMPRESSED GAS
Common Name: NITROGEN; COMPRESSED GAS
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133143
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-03-07T00:58:30.000
Chemical Name: ARGON 75% & CARBON DIOXIDE 25% ; COMPRESSED GAS
Common Name: ARGON 75% & CARBON DIOXIDE 25% ; COMPRESSED GAS
Case Number: Not reported

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0133144
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-03-07T00:58:30.000
Chemical Name: ZEP TNT CLEANER
Common Name: ZEP TNT CLEANER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133145
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-03-07T00:58:30.000
Chemical Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Common Name:	CIMGUARD 10 BULK CORROSION PREVENTATIVE
Case Number:	N/A
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133146
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-03-07T00:58:30.000
Chemical Name:	OXYGEN, O2, 99%, COMPRESSED GAS:
Common Name:	OXYGEN, O2, 99%, COMPRESSED GAS:
Case Number:	7782-44-7
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133147
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-03-07T00:58:30.000
Chemical Name:	SYNTHETIC COOLANT
Common Name:	DASCOOL 2005 COOLANT
Case Number:	N/A
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133148
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-03-07T00:58:30.000
Chemical Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE*
Common Name:	MAKINO SPINDLE OIL
Case Number:	N/A
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133149
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-03-07T00:58:30.000
Chemical Name:	MINERAL BASE MACHINE OIL, WITH ADDITIVES
Common Name:	MOBIL DTE MEDIUM
Case Number:	MIXTURE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133150
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-03-07T00:58:30.000
Chemical Name:	MINERAL BASE OIL WITH ADDITIVES
Common Name:	MOBIL VACTRA #2
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0133151
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-03-07T00:58:30.000
Chemical Name:	TRIM SOL COOLANT
Common Name:	TRIM SOL COOLANT
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0111390
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-03-07T00:58:35.000
Chemical Name:	WASTE 172 METAL DUST & MACHINING WASTE
Common Name:	METAL DUST/GRINDING DUST
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0111391
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-03-07T00:58:35.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name:	ABSORBANT PADS W/OIL
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0111392
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-03-07T00:58:35.000
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL
Common Name:	CUTTING OILS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Active Permit: Y
Child Record Id: DEH2017-HWAST-0111393
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-03-07T00:58:35.000
Chemical Name: WASTE 222 OIL/WATER SEPARATION SLUDGE
Common Name: WASTE EVAPORATOR BOTTOM SLUDGE
Case Number: Not reported

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111394
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-03-07T00:58:35.000
Chemical Name: WASTE 461 PAINT SLUDGE
Common Name: WASTE 461 PAINT SLUDGE
Case Number: Not reported

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111395
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-03-07T00:58:35.000
Chemical Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Common Name: WASTE OIL FILTER
Case Number: Not reported

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111396
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-03-07T00:58:35.000
Chemical Name: Oily Water
Common Name: Oily Water
Case Number: Not reported

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177949
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: MOBIL DTE 24 OIL
Common Name: MOBIL DTE 24 OIL
Case Number: 60262-30-0

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177950

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: MINERAL BASE MACHINE OIL WITH ADDITIVES
Common Name: MOBIL DTE HEAVY
Case Number: 60018-90-0

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177952
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: PROPYLENE-COMPRESSED GAS
Common Name: PROPYLENE-COMPRESSED GAS
Case Number: 115-07-1

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177953
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: WASTE 222 OIL/WATER SEPARATION SLUDGE
Common Name: ALVANIA GREASE EP2
Case Number: 57052E-8

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177954
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Common Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177957
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: TELLUS OIL 32
Common Name: TELLUS OIL 32
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177959
Trade Secret: N
Hazardous Material Type: Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Last Updated: 2018-06-19T02:32:23.000
Chemical Name: MINERAL BASE MACHINE OIL
Common Name: MOBIL DTE LIGHT
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177960
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: MOBIL VACTRA OIL #2
Common Name: MOBIL VACTRA OIL #2
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177961
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: NITROGEN; COMPRESSED GAS
Common Name: NITROGEN; COMPRESSED GAS
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177962
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: ARGON 75% & CARBON DIOXIDE 25% ; COMPRESSED GAS
Common Name: ARGON 75% & CARBON DIOXIDE 25% ; COMPRESSED GAS
Case Number: Not reported

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152502
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: ABSORBANT PADS W/OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152503
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Common Name:	CUTTING OILS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0152504
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-06-19T02:32:23.000
Chemical Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE
Common Name:	WASTE EVAPORATOR BOTTOM SLUDGE
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0152505
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-06-19T02:32:23.000
Chemical Name:	WASTE 461 PAINT SLUDGE
Common Name:	WASTE 461 PAINT SLUDGE
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0152506
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-06-19T02:32:23.000
Chemical Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Common Name:	WASTE OIL FILTER
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0152507
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-06-19T02:32:23.000
Chemical Name:	Oily Water
Common Name:	Oily Water
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0177946
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-06-19T02:32:23.000
Chemical Name:	ARGON, AR, 99%, COMPRESSED GAS:
Common Name:	ARGON, AR, 99%, COMPRESSED GAS:
Case Number:	7440-37-1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177947
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: MOBIL DTE 25 OIL
Common Name: MOBIL DTE 25 OIL
Case Number: 60263-10-0

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177948
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: MOBIL DTE 26 HYDRAULIC OIL
Common Name: MOBIL DTE 26 HYDRAULIC OIL
Case Number: 60264-09-0

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177951
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: HELIUM; COMPRESSED GAS
Common Name: HELIUM; COMPRESSED GAS
Case Number: 7440-59-7

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177967
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: WASTE 222 OIL/WATER SEPARATION SLUDGE*
Common Name: MAKINO SPINDLE OIL
Case Number: N/A

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177968
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: MINERAL BASE MACHINE OIL, WITH ADDITIVES
Common Name: MOBIL DTE MEDIUM
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0136088
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-06-20T02:32:17.000
Chemical Name:	ARGON, AR, 99%, COMPRESSED GAS:
Common Name:	ARGON, AR, 99%, COMPRESSED GAS:
Case Number:	7440-37-1
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0136089
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-06-20T02:32:17.000
Chemical Name:	MOBIL DTE 25 OIL
Common Name:	MOBIL DTE 25 OIL
Case Number:	60263-10-0
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0136090
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-06-20T02:32:17.000
Chemical Name:	MOBIL DTE 26 HYDRAULIC OIL
Common Name:	MOBIL DTE 26 HYDRAULIC OIL
Case Number:	60264-09-0
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0136091
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-06-20T02:32:17.000
Chemical Name:	MOBIL DTE 24 OIL
Common Name:	MOBIL DTE 24 OIL
Case Number:	60262-30-0
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0136092
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-06-20T02:32:17.000
Chemical Name:	MINERAL BASE MACHINE OIL WITH ADDITIVES
Common Name:	MOBIL DTE HEAVY
Case Number:	60018-90-0
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0136093

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: HELIUM; COMPRESSED GAS
Common Name: HELIUM; COMPRESSED GAS
Case Number: 7440-59-7

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136094
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: PROPYLENE-COMPRESSED GAS
Common Name: PROPYLENE-COMPRESSED GAS
Case Number: 115-07-1

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136095
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: WASTE 222 OIL/WATER SEPARATION SLUDGE
Common Name: ALVANIA GREASE EP2
Case Number: 57052E-8

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136096
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Common Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136097
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: GRAPHITED PETROLEUM OIL
Common Name: ARROW 17489 FORGING COMPOUND
Case Number: N/A

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136098
Trade Secret: N
Hazardous Material Type: Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Last Updated: 2017-06-20T02:32:17.000
Chemical Name: SUPERKOOL 2153
Common Name: SUPERKOOL 2153
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136099
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: TELLUS OIL 32
Common Name: TELLUS OIL 32
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136100
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: MINERAL OIL, 95%: MOBIL DTE OIL HEAVY MEDIUM
Common Name: MINERAL OIL, 95%: MOBIL DTE OIL HEAVY MEDIUM
Case Number: 60016-30-0

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136101
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: MINERAL BASE MACHINE OIL
Common Name: MOBIL DTE LIGHT
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136102
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: MOBIL VACTRA OIL #2
Common Name: MOBIL VACTRA OIL #2
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136103
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: NITROGEN; COMPRESSED GAS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Common Name: NITROGEN; COMPRESSED GAS
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136104
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: ARGON 75% & CARBON DIOXIDE 25% ; COMPRESSED GAS
Common Name: ARGON 75% & CARBON DIOXIDE 25% ; COMPRESSED GAS
Case Number: Not reported

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136105
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: ZEP TNT CLEANER
Common Name: ZEP TNT CLEANER
Case Number: Not reported

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136106
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Common Name: CIMGUARD 10 BULK CORROSION PREVENTATIVE
Case Number: N/A

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136107
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: OXYGEN, O2, 99%, COMPRESSED GAS:
Common Name: OXYGEN, O2, 99%, COMPRESSED GAS:
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136108
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: SYNTHETIC COOLANT
Common Name: DASCOOL 2005 COOLANT
Case Number: N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136109
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: WASTE 222 OIL/WATER SEPARATION SLUDGE*
Common Name: MAKINO SPINDLE OIL
Case Number: N/A

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136110
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: MINERAL BASE MACHINE OIL, WITH ADDITIVES
Common Name: MOBIL DTE MEDIUM
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136111
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: MINERAL BASE OIL WITH ADDITIVES
Common Name: MOBIL VACTRA #2
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0136112
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: TRIM SOL COOLANT
Common Name: TRIM SOL COOLANT
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0114413
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-06-20T02:32:17.000
Chemical Name: WASTE 172 METAL DUST & MACHINING WASTE
Common Name: METAL DUST/GRINDING DUST
Case Number: Not reported

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0114414
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-20T02:32:17.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name:	ABSORBANT PADS W/OIL
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0114415
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-20T02:32:17.000
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL
Common Name:	CUTTING OILS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0114416
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-20T02:32:17.000
Chemical Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE
Common Name:	WASTE EVAPORATOR BOTTOM SLUDGE
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0114417
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-20T02:32:17.000
Chemical Name:	WASTE 461 PAINT SLUDGE
Common Name:	WASTE 461 PAINT SLUDGE
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0114418
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-20T02:32:17.000
Chemical Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Common Name:	WASTE OIL FILTER
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0114419

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-20T02:32:17.000
Chemical Name:	Oily Water
Common Name:	Oily Water
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0177955
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-06-19T02:32:23.000
Chemical Name:	GRAPHITED PETROLEUM OIL
Common Name:	ARROW 17489 FORGING COMPOUND
Case Number:	N/A
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0177956
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-06-19T02:32:23.000
Chemical Name:	SUPERKOOL 2153
Common Name:	SUPERKOOL 2153
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0177958
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-06-19T02:32:23.000
Chemical Name:	MINERAL OIL, 95%: MOBIL DTE OIL HEAVY MEDIUM
Common Name:	MINERAL OIL, 95%: MOBIL DTE OIL HEAVY MEDIUM
Case Number:	60016-30-0
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0177963
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-06-19T02:32:23.000
Chemical Name:	ZEP TNT CLEANER
Common Name:	ZEP TNT CLEANER
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103275
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0177964
Trade Secret:	N
Hazardous Material Type:	Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Last Updated: 2018-06-19T02:32:23.000
Chemical Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Common Name: CIMGUARD 10 BULK CORROSION PREVENTATIVE
Case Number: N/A

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177965
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: OXYGEN, O2, 99%, COMPRESSED GAS:
Common Name: OXYGEN, O2, 99%, COMPRESSED GAS:
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177966
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: SYNTHETIC COOLANT
Common Name: DASCOOL 2005 COOLANT
Case Number: N/A

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177969
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: MINERAL BASE OIL WITH ADDITIVES
Common Name: MOBIL VACTRA #2
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0177970
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: TRIM SOL COOLANT
Common Name: TRIM SOL COOLANT
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-103275
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0152501
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-19T02:32:23.000
Chemical Name: WASTE 172 METAL DUST & MACHINING WASTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Common Name: METAL DUST/GRINDING DUST
Case Number: Not reported

Permit Number: 103275
Business Type: 6HK35
EPA Id Number: CAD009569740
APN: 369-161-14-00
Last HMMD Inspection: 06/20/2011
Facility Telephone: 858-278-8400
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: SENIOR OPERATIONS INC
Facility Mailing Address: 9106 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1512
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Y
Generate Haz Waste: Y
Treat Haz Waste: Y
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 103275
Update Date: 11/02/2012
Case Number: MIXTURE
Name: ARGON 75% & CARBON DIOXIDE 25% ; COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 7440-37-1
Name: ARGON, AR, 99%, COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: GRAPHITED PETROLEUM OIL
Other Information: ARROW 17489 FORGING COMPOUND
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 7440-59-7
Name: HELIUM; COMPRESSED GAS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	MINERAL BASE MACHINE OIL
Other Information:	MOBIL DTE LIGHT
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	60018-90-0
Name:	MINERAL BASE MACHINE OIL WITH ADDITIVES
Other Information:	MOBIL DTE HEAVY
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	60015-50-0
Name:	MINERAL BASE MACHINE OIL, WITH ADDITIVES
Other Information:	MOBIL DTE MEDIUM
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	60049-40-0
Name:	MINERAL BASE OIL WITH ADDITIVES
Other Information:	SHELL VACTRA #2
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	60016-30-0
Name:	MINERAL OIL, 95%: MOBIL DTE OIL HEAVY MEDIUM
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	60262-30-0
Name:	MOBIL DTE 24 OIL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60263-10-0
Name: MOBIL DTE 25 OIL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60264-09-0
Name: MOBIL DTE 26 HYDRAULIC OIL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN; COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN, O2, 99%, COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 115-07-1
Name: PROPYLENE-COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 103275

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Update Date: 11/02/2012
Case Number: Not reported
Name: SYNTHETIC COOLANT
Other Information: DASCOOL 2005 COOLANT
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 172 METAL DUST & MACHINING WASTE
Other Information: METAL DUST/GRINDING DUST
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: CUTTING OILS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE
Other Information: ALVANIA GREASE EP2
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE
Other Information: EVAPORATOR BOTTOM SLUDGE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE*
Other Information: MAKINO SPINDLE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60051-00-0
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE*

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Other Information:	MOBIL VACTRA OIL #4
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	64741-88-4
Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE*
Other Information:	SUPERKOOL 2153
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE*
Other Information:	TELLUS OIL 32
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information:	CIMGUARD 10 BULK CORROSION PREVENTATIVE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information:	OIL FILTER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information:	ABSORBANT PADS W/OIL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 461 PAINT SLUDGE
Other Information:	AEROSOL
Material Waste:	Waste
Hazardous Categories 1:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: MIXTURE
Name: ZEP TNT CLEANER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Violations Active Permits:

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV1601
Violation: HAZWASTE TANKS W/O P.E. ASSESSMENT
Violation Citation: Failed to obtain a P.E. assessment for hazardous waste tank system. 66265.191(a) or 66265.192(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV1701
Violation: UNAUTH. TREATMENT OF HAZARDOUS WASTE
Violation Citation: Unauthorized treatment of hazardous waste.{All tiers 25201(a) Additionally, CESW/SQT: 25201.5; CEL: 25201.14; CA: 25200.3; PBR:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Activity: 67450.1}
ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0141
Violation: OPERATING TSDF W/O AUTHORIZATION
Violation Citation: Operating a Treatment, Storage, Disposal Facility without receiving written authorization from Cal-EPA. HSC 25201(a)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0143
Violation: TP NOTIFICATION INCOMPLETE/INCORRECT
Violation Citation: TIERED PERMITTING: TP Notification has incomplete or incorrect information. 25201

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0144
Violation: SB14 COMPLIANCE DOCS UNAVAILABLE
Violation Citation: TIERED PERMITTING: SB14 Compliance documentation not available for review. 25244.21, 25244.19, & 67100.3(a), 67100.2(a)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0203
Violation: DAMAGED CONTAINER NOT REPACKAGED
Violation Citation: Hazardous materials in damaged containers have not been repackaged within 96 hours & are now declared hazardous waste. HSC 25124(E)

Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0205
Violation: WASTE CONTAINER: POOR CONDITION
Violation Citation: Failed to transfer hazardous waste from a container that leaked or was in poor condition to another container in good condition. CCR 66265.171
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0208
Violation: STORAGE AREA: NO WEEKLY INSPECTION
Violation Citation: Hazardous waste storage area is not being inspected weekly for deteriorated or leaking containers CCR 66265.174
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0215
Violation: OIL FILTERS IMPROPERLY MANAGED
Violation Citation: Used oil filters not properly drained, stored, or labeled prior to transport for the purpose of metal reclamation. CCR 66266.130
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0402
Violation: TRAINING PROGRAM NOT ADEQUATE
Violation Citation: Personnel training is not adequate to ensure compliance with hazardous waste regulations. CCR 66265.16(a)&(b)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0403
Violation: FACILITY DOESN'T MINIMIZE RELEASE
Violation Citation: Facility is not designed/constructed/operated in a manner which will minimize the release of hazardous waste to the environment. CCR 66265.51
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1601
Violation: HAZWASTE TANKS W/O P.E. ASSESSMENT
Violation Citation: Failed to obtain a P.E. assessment for hazardous waste tank system. 66265.191(a) or 66265.192(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1603
Violation: NO 2ND CONTAINMENT FOR HW TANK
Violation Citation: Failed to provide proper secondary containment and/or leak detection for Hazardous waste tank system. 66265.193(a)
Activity: ACTIVE

Permit Number: 103275

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1604
Violation: 2ND. CONTAINMENT NOT KEPT EMPTY
Violation Citation: Secondary containment not kept empty. 66265.196(b)(c), 66265.194(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1605
Violation: NO DAILY TANK INSPECTION/LOG
Violation Citation: Failed to inspect and/or document daily HW tank system inspections.
66265.195 (c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1608
Violation: NO INITIAL ASSESSMENT FOR 2ND CONTAINMEN
Violation Citation: Failed to complete annual integrity assessment for HW tank system
without secondary containment. 66265.191(a)&(e)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1003
Violation: HMBP NOT AMENDED W/IN 30 DAYS
Violation Citation: Business plan was not amended within 30 days for a 100% quantity
increase, new disclosable materials or a change in business info. HSC
25505
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1006
Violation: HMBP: INVENTORY INADEQUATE
Violation Citation: Business Plan inventory does not list all hazardous materials on site
in disclosable quantities. HSC 25504(a),25503.5
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or
complete information for emergency response agencies. HSC 25509(a)(5)
& 25505(a)(2)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Violation Code: 6HV1011
Violation: TRAINING RECORDS NOT AVAILABLE
Violation Citation: Personnel training records not available. 19 CCR 2732
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1012
Violation: SPCC PLAN NOT PREPARED
Violation Citation: Spill Prevention Countermeasures & Control Plan not prepared as required. 25270.5 (c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0406
Violation: CONT PLAN NOT PREPARED/ONSITE
Violation Citation: Owner/Operator has not prepared an Emergency Contingency Plan, or maintained a copy on site, or submitted a copy to the HMMD. CCR 66265.51(a), 66265.53(a)&(b)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0204
Violation: WASTE CONTAINER:IMPROPER MGMT
Violation Citation: Hazardous waste storage container is not handled or stored in a manner which will prevent leaks or rupture. CCR 66265.173
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0293
Violation: TANK MGMT STANDARDS NOT MET
Violation Citation: TIERED PERMITTING:ALL UNITS-Generator does not meet management standards.
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0208
Violation: STORAGE AREA: NO WEEKLY INSPECTION
Violation Citation: Hazardous waste storage area is not being inspected weekly for deteriorated or leaking containers CCR 66265.174

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0140
Violation: LDR DOCUMENTS NOT AVAILABLE
Violation Citation: Land disposal restriction (LDR) Notification/Certification not provided and/or maintained on site as required. CCR 66268.7(a)(8)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1501
Violation: NOT ALL UNITS IN TP NOTIFICATION
Violation Citation: TIERED PERMITTING: FACILITY WIDE-Not all units under PBR, CA, and CE are properly indicated on Form DTSC 1772. (Add any new units with unit sheets or correct tier on the unit sheet.)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1559
Violation: NO WRITTEN OPERATING INSTRUCTIONS/LOGS
Violation Citation: TIERED PERMITTING-ALL UNITS:No written operating instructions and/or records of the dates, volumes, residual management, and types of wastes treated in the unit.

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1560
Violation: NO WRITTEN INSPECTION SCHEDULE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Violation Citation: TIERED PERMITTING-ALL UNITS:No written inspection schedule (containers-weekly and tanks-daily).
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1561
Violation: NO WRITTEN LOG OF INSPECTIONS CONDUCTED
Violation Citation: TIERED PERMITTING-ALL UNITS:No written inspection log of the inspections conducted.
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1563
Violation: NO 2ND. CONTAINMT:TANKS/CONTAINERS
Violation Citation: TIERED PERMITTING-CA & PBR UNITS:The generator does not have secondary containment for treatment in containers and tanks (due by 1/24/98).
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0192
Violation: IMPROPER RECYCLING ACTIVIES
Violation Citation: TIERED PERMITTING: ONSITE RECYCLING-Activities claimed under the onsite recycling exemption or exclusion are not appropriate
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1571
Violation: RELEASES FROM FAC W/IN LAST 3 YRS
Violation Citation: TIERED PERMITTING:RELEASES-Within the last three years, there were unauthorized or accidental releases to the environment of hazardous waste or hazardous waste constituents from any location at this facility.
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV1705
Violation: TREATMENT VOLUME INCORRECT FOR TIER
Violation Citation: Estimated/actual monthly treatment volume is not appropriate for the indicated tier(s).{CE: 25201.5(a) & (d)(7(C)); CEL: 25201.14(c); CA: 25200.3(b)(1) & (e)(3); PBR: 67450.2(b)(3)(G) & 67450.11}
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV0403
Violation: FACILITY DOESN'T MINIMIZE RELEASE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Violation Citation: Facility is not designed/constructed/operated in a manner which will minimize the release of hazardous waste to the environment. CCR 66265.51

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV1601
Violation: HAZWASTE TANKS W/O P.E. ASSESSMENT
Violation Citation: Failed to obtain a P.E. assessment for hazardous waste tank system. 66265.191(a) or 66265.192(a)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV1603
Violation: NO 2ND CONTAINMENT FOR HW TANK
Violation Citation: Failed to provide proper secondary containment and/or leak detection for Hazardous waste tank system. 66265.193(a)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV1604
Violation: 2ND. CONTAINMENT NOT KEPT EMPTY
Violation Citation: Secondary containment not kept empty. 66265.196(b)(c), 66265.194(c)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/04/2008
Violation Code: 6HV1712
Violation: INADEQ./NO RECORDS OF UNIT INSPECTIONS
Violation Citation: Inadequate or no onsite records/logs of inspections conducted (must include dates, times, name of inspector, observations, and specifics of any needed repairs or corrective actions). (3 years for CE and PBR units, 5 years for CA). {CE: 25201.5(d)(4)&(5), 25201.14(c)(1); CA: 25200.3(c)(5)&(7); PBR: 67450.3(c)(8) & (9)(A) & (D), 66265.73(a)&(b)(1); 66265.15(b) & (d)}

Activity: ACTIVE

Permit Number: 103275
Business Type: 6HK35
EPA Id Number: CAD009569740

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

APN: 369-161-14-00
Last HMMI Inspection: 06/20/2011
Facility Telephone: 858-278-8400
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: SENIOR OPERATIONS INC
Facility Mailing Address: 9106 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1512
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Y
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 103275
Update Date: 11/02/2012
Case Number: MIXTURE
Name: ARGON 75% & CARBON DIOXIDE 25% ; COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 7440-37-1
Name: ARGON, AR, 99%, COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: GRAPHITED PETROLEUM OIL
Other Information: ARROW 17489 FORGING COMPOUND
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 7440-59-7
Name: HELIUM; COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 103275
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Case Number:	Not reported
Name:	MINERAL BASE MACHINE OIL
Other Information:	MOBIL DTE LIGHT
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	60018-90-0
Name:	MINERAL BASE MACHINE OIL WITH ADDITIVES
Other Information:	MOBIL DTE HEAVY
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	60015-50-0
Name:	MINERAL BASE MACHINE OIL, WITH ADDITIVES
Other Information:	MOBIL DTE MEDIUM
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	60049-40-0
Name:	MINERAL BASE OIL WITH ADDITIVES
Other Information:	SHELL VACTRA #2
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	60016-30-0
Name:	MINERAL OIL, 95%: MOBIL DTE OIL HEAVY MEDIUM
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	60262-30-0
Name:	MOBIL DTE 24 OIL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	60263-10-0
Name:	MOBIL DTE 25 OIL
Other Information:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60264-09-0
Name: MOBIL DTE 26 HYDRAULIC OIL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN; COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN, O2, 99%, COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 115-07-1
Name: PROPYLENE-COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: SYNTHETIC COOLANT
Other Information: DASCOOL 2005 COOLANT
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 172 METAL DUST & MACHINING WASTE
Other Information: METAL DUST/GRINDING DUST
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: CUTTING OILS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE
Other Information: ALVANIA GREASE EP2
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE
Other Information: EVAPORATOR BOTTOM SLUDGE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE*
Other Information: MAKINO SPINDLE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60051-00-0
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE*
Other Information: MOBIL VACTRA OIL #4
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 64741-88-4

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE*
Other Information:	SUPERKOOL 2153
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE*
Other Information:	TELLUS OIL 32
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information:	CIMGUARD 10 BULK CORROSION PREVENTATIVE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information:	OIL FILTER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information:	ABSORBANT PADS W/OIL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 461 PAINT SLUDGE
Other Information:	AEROSOL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	ZEP TNT CLEANER
Other Information:	Not reported
Material Waste:	Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Violations Active Permits:

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV1601
Violation: HAZWASTE TANKS W/O P.E. ASSESSMENT
Violation Citation: Failed to obtain a P.E. assessment for hazardous waste tank system. 66265.191(a) or 66265.192(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV1701
Violation: UNAUTH. TREATMENT OF HAZARDOUS WASTE
Violation Citation: Unauthorized treatment of hazardous waste.{All tiers 25201(a) Additionally, CESW/SQT: 25201.5; CEL: 25201.14; CA: 25200.3; PBR: 67450.1}
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0141
Violation: OPERATING TSDF W/O AUTHORIZATION

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Violation Citation: Operating a Treatment, Storage, Disposal Facility without receiving written authorization from Cal-EPA. HSC 25201(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0143
Violation: TP NOTIFICATION INCOMPLETE/INCORRECT
Violation Citation: TIERED PERMITTING: TP Notification has incomplete or incorrect information. 25201
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0144
Violation: SB14 COMPLIANCE DOCS UNAVAILABLE
Violation Citation: TIERED PERMITTING: SB14 Compliance documentation not available for review. 25244.21, 25244.19, & 67100.3(a), 67100.2(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0203
Violation: DAMAGED CONTAINER NOT REPACKAGED
Violation Citation: Hazardous materials in damaged containers have not been repackaged within 96 hours & are now declared hazardous waste. HSC 25124(E)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0205
Violation: WASTE CONTAINER: POOR CONDITION
Violation Citation: Failed to transfer hazardous waste from a container that leaked or was in poor condition to another container in good condition. CCR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Activity: 66265.171
ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0208
Violation: STORAGE AREA: NO WEEKLY INSPECTION
Violation Citation: Hazardous waste storage area is not being inspected weekly for deteriorated or leaking containers CCR 66265.174

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0215
Violation: OIL FILTERS IMPROPERLY MANAGED
Violation Citation: Used oil filters not properly drained, stored, or labeled prior to transport for the purpose of metal reclamation. CCR 66266.130

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0402
Violation: TRAINING PROGRAM NOT ADEQUATE
Violation Citation: Personnel training is not adequate to ensure compliance with hazardous waste regulations. CCR 66265.16(a)&(b)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0403
Violation: FACILITY DOESN'T MINIMIZE RELEASE
Violation Citation: Facility is not designed/constructed/operated in a manner which will minimize the release of hazardous waste to the environment. CCR 66265.51

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1601
Violation: HAZWASTE TANKS W/O P.E. ASSESSMENT
Violation Citation: Failed to obtain a P.E. assessment for hazardous waste tank system. 66265.191(a) or 66265.192(a)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1603
Violation: NO 2ND CONTAINMENT FOR HW TANK
Violation Citation: Failed to provide proper secondary containment and/or leak detection for Hazardous waste tank system. 66265.193(a)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1604
Violation: 2ND. CONTAINMENT NOT KEPT EMPTY
Violation Citation: Secondary containment not kept empty. 66265.196(b)(c), 66265.194(c)

Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1605
Violation: NO DAILY TANK INSPECTION/LOG
Violation Citation: Failed to inspect and/or document daily HW tank system inspections.
66265.195 (c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1608
Violation: NO INITIAL ASSESSMENT FOR 2ND CONTAINMEN
Violation Citation: Failed to complete annual integrity assessment for HW tank system
without secondary containment. 66265.191(a)&(e)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1003
Violation: HMBP NOT AMENDED W/IN 30 DAYS
Violation Citation: Business plan was not amended within 30 days for a 100% quantity
increase, new disclosable materials or a change in business info. HSC
25505
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1006
Violation: HMBP: INVENTORY INADEQUATE
Violation Citation: Business Plan inventory does not list all hazardous materials on site
in disclosable quantities. HSC 25504(a),25503.5
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or
complete information for emergency response agencies. HSC 25509(a)(5)
& 25505(a)(2)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1011
Violation: TRAINING RECORDS NOT AVAILABLE
Violation Citation: Personnel training records not available. 19 CCR 2732
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Inspection Date: 08/05/2003
Violation Code: 6HV1012
Violation: SPCC PLAN NOT PREPARED
Violation Citation: Spill Prevention Countermeasures & Control Plan not prepared as required. 25270.5 (c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0406
Violation: CONT PLAN NOT PREPARED/ONSITE
Violation Citation: Owner/Operator has not prepared an Emergency Contingency Plan, or maintained a copy on site, or submitted a copy to the HMMD. CCR 66265.51(a), 66265.53(a)&(b)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0204
Violation: WASTE CONTAINER:IMPROPER MGMT
Violation Citation: Hazardous waste storage container is not handled or stored in a manner which will prevent leaks or rupture. CCR 66265.173
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0293
Violation: TANK MGMT STANDARDS NOT MET
Violation Citation: TIERED PERMITTING:ALL UNITS-Generator does not meet management standards.
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0208
Violation: STORAGE AREA: NO WEEKLY INSPECTION
Violation Citation: Hazardous waste storage area is not being inspected weekly for deteriorated or leaking containers CCR 66265.174
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0140
Violation: LDR DOCUMENTS NOT AVAILABLE
Violation Citation: Land disposal restriction (LDR) Notification/Certification not provided and/or maintained on site as required. CCR 66268.7(a)(8)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1501
Violation: NOT ALL UNITS IN TP NOTIFICATION
Violation Citation: TIERED PERMITTING: FACILITY WIDE-Not all units under PBR, CA, and CE are properly indicated on Form DTSC 1772. (Add any new units with unit sheets or correct tier on the unit sheet.)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1559
Violation: NO WRITTEN OPERATING INSTRUCTIONS/LOGS
Violation Citation: TIERED PERMITTING-ALL UNITS:No written operating instructions and/or records of the dates, volumes, residual management, and types of wastes treated in the unit.
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1560
Violation: NO WRITTEN INSPECTION SCHEDULE
Violation Citation: TIERED PERMITTING-ALL UNITS:No written inspection schedule (containers-weekly and tanks-daily).
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Violation Code: 6HV1561
Violation: NO WRITTEN LOG OF INSPECTIONS CONDUCTED
Violation Citation: TIERED PERMITTING-ALL UNITS:No written inspection log of the inspections conducted.
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1563
Violation: NO 2ND. CONTAINMT:TANKS/CONTAINERS
Violation Citation: TIERED PERMITTING-CA & PBR UNITS:The generator does not have secondary containment for treatment in containers and tanks (due by 1/24/98).
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0192
Violation: IMPROPER RECYCLING ACTIVIES
Violation Citation: TIERED PERMITTING: ONSITE RECYCLING-Activities claimed under the onsite recycling exemption or exclusion are not appropriate
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1571
Violation: RELEASES FROM FAC W/IN LAST 3 YRS
Violation Citation: TIERED PERMITTING:RELEASES-Within the last three years, there were unauthorized or accidental releases to the environment of hazardous waste or hazardous waste constituents from any location at this facility.
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV1705
Violation: TREATMENT VOLUME INCORRECT FOR TIER
Violation Citation: Estimated/actual monthly treatment volume is not appropriate for the indicated tier(s).{CE: 25201.5(a) & (d)(7(C)); CEL: 25201.14(c); CA: 25200.3(b)(1) & (e)(3); PBR: 67450.2(b)(3)(G) & 67450.11}
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV0403
Violation: FACILITY DOESN'T MINIMIZE RELEASE
Violation Citation: Facility is not designed/constructed/operated in a manner which will minimize the release of hazardous waste to the environment. CCR 66265.51
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Inspection Date: 03/29/2005
Violation Code: 6HV1601
Violation: HAZWASTE TANKS W/O P.E. ASSESSMENT
Violation Citation: Failed to obtain a P.E. assessment for hazardous waste tank system. 66265.191(a) or 66265.192(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV1603
Violation: NO 2ND CONTAINMENT FOR HW TANK
Violation Citation: Failed to provide proper secondary containment and/or leak detection for Hazardous waste tank system. 66265.193(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV1604
Violation: 2ND. CONTAINMENT NOT KEPT EMPTY
Violation Citation: Secondary containment not kept empty. 66265.196(b)(c), 66265.194(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/04/2008
Violation Code: 6HV1712
Violation: INADEQ./NO RECORDS OF UNIT INSPECTIONS
Violation Citation: Inadequate or no onsite records/logs of inspections conducted (must include dates, times, name of inspector, observations, and specifics of any needed repairs or corrective actions). (3 years for CE and PBR units, 5 years for CA). {CE: 25201.5(d)(4)&(5), 25201.14(c)(1); CA: 25200.3(c)(5)&(7); PBR: 67450.3(c)(8) & (9)(A) & (D), 66265.73(a)&(b)(1); 66265.15(b) & (d)}
Activity: ACTIVE

Permit Number: 103275
Business Type: 6HK35
EPA Id Number: CAD009569740
APN: 369-161-14-00
Last HMMD Inspection: 06/20/2011
Facility Telephone: 858-278-8400
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: SENIOR OPERATIONS INC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Facility Mailing Address: 9106 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1512
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Y
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 103275
Update Date: 11/02/2012
Case Number: MIXTURE
Name: ARGON 75% & CARBON DIOXIDE 25% ; COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 7440-37-1
Name: ARGON, AR, 99%, COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: GRAPHITED PETROLEUM OIL
Other Information: ARROW 17489 FORGING COMPOUND
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 7440-59-7
Name: HELIUM; COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: MINERAL BASE MACHINE OIL
Other Information: MOBIL DTE LIGHT
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60018-90-0
Name: MINERAL BASE MACHINE OIL WITH ADDITIVES
Other Information: MOBIL DTE HEAVY
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60015-50-0
Name: MINERAL BASE MACHINE OIL, WITH ADDITIVES
Other Information: MOBIL DTE MEDIUM
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60049-40-0
Name: MINERAL BASE OIL WITH ADDITIVES
Other Information: SHELL VACTRA #2
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60016-30-0
Name: MINERAL OIL, 95%: MOBIL DTE OIL HEAVY MEDIUM
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60262-30-0
Name: MOBIL DTE 24 OIL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60263-10-0
Name: MOBIL DTE 25 OIL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60264-09-0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Name:	MOBIL DTE 26 HYDRAULIC OIL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	7727-37-9
Name:	NITROGEN; COMPRESSED GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	7782-44-7
Name:	OXYGEN, O2, 99%, COMPRESSED GAS:
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	74-98-6
Name:	PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	115-07-1
Name:	PROPYLENE-COMPRESSED GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	SYNTHETIC COOLANT
Other Information:	DASCOOL 2005 COOLANT
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	103275
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 172 METAL DUST & MACHINING WASTE
Other Information:	METAL DUST/GRINDING DUST
Material Waste:	Waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: CUTTING OILS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE
Other Information: ALVANIA GREASE EP2
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE
Other Information: EVAPORATOR BOTTOM SLUDGE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE*
Other Information: MAKINO SPINDLE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 60051-00-0
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE*
Other Information: MOBIL VACTRA OIL #4
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: 64741-88-4
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE*
Other Information: SUPERKOOL 2153
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE*
Other Information: TELLUS OIL 32
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: CIMGUARD 10 BULK CORROSION PREVENTATIVE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OIL FILTER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: ABSORBANT PADS W/OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 461 PAINT SLUDGE
Other Information: AEROSOL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103275
Update Date: 11/02/2012
Case Number: MIXTURE
Name: ZEP TNT CLEANER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Violations Active Permits:

Permit Number: 103275
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Inspection Date: 06/20/2011
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV1601
Violation: HAZWASTE TANKS W/O P.E. ASSESSMENT
Violation Citation: Failed to obtain a P.E. assessment for hazardous waste tank system. 66265.191(a) or 66265.192(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 06/20/2011
Violation Code: 6HV1701
Violation: UNAUTH. TREATMENT OF HAZARDOUS WASTE
Violation Citation: Unauthorized treatment of hazardous waste.{All tiers 25201(a) Additionally, CESW/SQT: 25201.5; CEL: 25201.14; CA: 25200.3; PBR: 67450.1}
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0141
Violation: OPERATING TSDF W/O AUTHORIZATION
Violation Citation: Operating a Treatment, Storage, Disposal Facility without receiving written authorization from Cal-EPA. HSC 25201(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Inspection Date: 08/05/2003
Violation Code: 6HV0143
Violation: TP NOTIFICATION INCOMPLETE/INCORRECT
Violation Citation: TIERED PERMITTING: TP Notification has incomplete or incorrect information. 25201
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0144
Violation: SB14 COMPLIANCE DOCS UNAVAILABLE
Violation Citation: TIERED PERMITTING: SB14 Compliance documentation not available for review. 25244.21, 25244.19, & 67100.3(a), 67100.2(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0203
Violation: DAMAGED CONTAINER NOT REPACKAGED
Violation Citation: Hazardous materials in damaged containers have not been repackaged within 96 hours & are now declared hazardous waste. HSC 25124(E)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0205
Violation: WASTE CONTAINER: POOR CONDITION
Violation Citation: Failed to transfer hazardous waste from a container that leaked or was in poor condition to another container in good condition. CCR 66265.171
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0208
Violation: STORAGE AREA: NO WEEKLY INSPECTION
Violation Citation: Hazardous waste storage area is not being inspected weekly for deteriorated or leaking containers CCR 66265.174
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0215
Violation: OIL FILTERS IMPROPERLY MANAGED
Violation Citation: Used oil filters not properly drained, stored, or labeled prior to transport for the purpose of metal reclamation. CCR 66266.130
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0401

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0402
Violation: TRAINING PROGRAM NOT ADEQUATE
Violation Citation: Personnel training is not adequate to ensure compliance with hazardous waste regulations. CCR 66265.16(a)&(b)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0403
Violation: FACILITY DOESN'T MINIMIZE RELEASE
Violation Citation: Facility is not designed/constructed/operated in a manner which will minimize the release of hazardous waste to the environment. CCR 66265.51
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1601
Violation: HAZWASTE TANKS W/O P.E. ASSESSMENT
Violation Citation: Failed to obtain a P.E. assessment for hazardous waste tank system. 66265.191(a) or 66265.192(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1603
Violation: NO 2ND CONTAINMENT FOR HW TANK
Violation Citation: Failed to provide proper secondary containment and/or leak detection for Hazardous waste tank system. 66265.193(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1604
Violation: 2ND. CONTAINMENT NOT KEPT EMPTY
Violation Citation: Secondary containment not kept empty. 66265.196(b)(c), 66265.194(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1605
Violation: NO DAILY TANK INSPECTION/LOG
Violation Citation: Failed to inspect and/or document daily HW tank system inspections.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Activity: 66265.195 (c)
ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1608
Violation: NO INITIAL ASSESSMENT FOR 2ND CONTAINMEN
Violation Citation: Failed to complete annual integrity assessment for HW tank system without secondary containment. 66265.191(a)&(e)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1003
Violation: HMBP NOT AMENDED W/IN 30 DAYS
Violation Citation: Business plan was not amended within 30 days for a 100% quantity increase, new disclosable materials or a change in business info. HSC 25505

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1006
Violation: HMBP: INVENTORY INADEQUATE
Violation Citation: Business Plan inventory does not list all hazardous materials on site in disclosable quantities. HSC 25504(a),25503.5

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1011
Violation: TRAINING RECORDS NOT AVAILABLE
Violation Citation: Personnel training records not available. 19 CCR 2732

Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1012
Violation: SPCC PLAN NOT PREPARED
Violation Citation: Spill Prevention Countermeasures & Control Plan not prepared as required. 25270.5 (c)

Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0406
Violation: CONT PLAN NOT PREPARED/ONSITE
Violation Citation: Owner/Operator has not prepared an Emergency Contingency Plan, or maintained a copy on site, or submitted a copy to the HMMD. CCR 66265.51(a), 66265.53(a)&(b)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0204
Violation: WASTE CONTAINER:IMPROPER MGMT
Violation Citation: Hazardous waste storage container is not handled or stored in a manner which will prevent leaks or rupture. CCR 66265.173
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0293
Violation: TANK MGMT STANDARDS NOT MET
Violation Citation: TIERED PERMITTING:ALL UNITS-Generator does not meet management standards.
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0208
Violation: STORAGE AREA: NO WEEKLY INSPECTION
Violation Citation: Hazardous waste storage area is not being inspected weekly for deteriorated or leaking containers CCR 66265.174
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0140
Violation: LDR DOCUMENTS NOT AVAILABLE
Violation Citation: Land disposal restriction (LDR) Notification/Certification not provided and/or maintained on site as required. CCR 66268.7(a)(8)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1501
Violation: NOT ALL UNITS IN TP NOTIFICATION
Violation Citation: TIERED PERMITTING: FACILITY WIDE-Not all units under PBR, CA, and CE are properly indicated on Form DTSC 1772. (Add any new units with unit sheets or correct tier on the unit sheet.)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1559
Violation: NO WRITTEN OPERATING INSTRUCTIONS/LOGS
Violation Citation: TIERED PERMITTING-ALL UNITS:No written operating instructions and/or records of the dates, volumes, residual management, and types of wastes treated in the unit.
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1560
Violation: NO WRITTEN INSPECTION SCHEDULE
Violation Citation: TIERED PERMITTING-ALL UNITS:No written inspection schedule (containers-weekly and tanks-daily).
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1561
Violation: NO WRITTEN LOG OF INSPECTIONS CONDUCTED
Violation Citation: TIERED PERMITTING-ALL UNITS:No written inspection log of the inspections conducted.
Activity: ACTIVE

Permit Number: 103275

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1563
Violation: NO 2ND. CONTAINMT:TANKS/CONTAINERS
Violation Citation: TIERED PERMITTING-CA & PBR UNITS:The generator does not have secondary containment for treatment in containers and tanks (due by 1/24/98).
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV0192
Violation: IMPROPER RECYCLING ACTIVIES
Violation Citation: TIERED PERMITTING: ONSITE RECYCLING-Activities claimed under the onsite recycling exemption or exclusion are not appropriate
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 08/05/2003
Violation Code: 6HV1571
Violation: RELEASES FROM FAC W/IN LAST 3 YRS
Violation Citation: TIERED PERMITTING:RELEASES-Within the last three years, there were unauthorized or accidental releases to the environment of hazardous waste or hazardous waste constituents from any location at this facility.
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV1705
Violation: TREATMENT VOLUME INCORRECT FOR TIER
Violation Citation: Estimated/actual monthly treatment volume is not appropriate for the indicated tier(s).{CE: 25201.5(a) & (d)(7(C)); CEL: 25201.14(c); CA: 25200.3(b)(1) & (e)(3); PBR: 67450.2(b)(3)(G) & 67450.11}
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV0403
Violation: FACILITY DOESN'T MINIMIZE RELEASE
Violation Citation: Facility is not designed/constructed/operated in a manner which will minimize the release of hazardous waste to the environment. CCR 66265.51
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV1601
Violation: HAZWASTE TANKS W/O P.E. ASSESSMENT
Violation Citation: Failed to obtain a P.E. assessment for hazardous waste tank system. 66265.191(a) or 66265.192(a)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV1603
Violation: NO 2ND CONTAINMENT FOR HW TANK
Violation Citation: Failed to provide proper secondary containment and/or leak detection for Hazardous waste tank system. 66265.193(a)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV1604
Violation: 2ND. CONTAINMENT NOT KEPT EMPTY
Violation Citation: Secondary containment not kept empty. 66265.196(b)(c), 66265.194(c)
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/29/2005
Violation Code: 6HV0207
Violation: FIRE/EXPLOSION/RELEASE NOT MINIMIZED
Violation Citation: Facility not maintained &/operated to minimize possibility of fire, explosion or release. CCR 66265.31
Activity: ACTIVE

Permit Number: 103275
Update Date: 11/02/2012
Inspection Date: 03/04/2008
Violation Code: 6HV1712
Violation: INADEQ./NO RECORDS OF UNIT INSPECTIONS
Violation Citation: Inadequate or no onsite records/logs of inspections conducted (must include dates, times, name of inspector, observations, and specifics of any needed repairs or corrective actions). (3 years for CE and PBR units, 5 years for CA). {CE: 25201.5(d)(4)&(5), 25201.14(c)(1); CA: 25200.3(c)(5)&(7); PBR: 67450.3(c)(8) & (9)(A) & (D), 66265.73(a)&(b)(1); 66265.15(b) & (d)}
Activity: ACTIVE

NPDES:

Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported
Order Number: Not reported
WDID: 9 371007291
Regulatory Measure Type: Industrial
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Active
Status Date: 10/21/2015
Operator Name: Senior Aerospace Jet Product
Operator Address: 9106 Balboa Ave
Operator City: San Diego
Operator State: California
Operator Zip: 92123

NPDES as of 03/2018:

NPDES Number: Not reported
Status: Not reported
Agency Number: Not reported
Region: 9
Regulatory Measure ID: 218392
Order Number: Not reported
Regulatory Measure Type: Industrial
Place ID: Not reported
WDID: 9 371007291
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Received Date: 05/09/2008
Processed Date: 07/13/1993
Status: Active
Status Date: 10/21/2015
Place Size: 387.76
Place Size Unit: SqFt
Contact: Abel Alcantara
Contact Title: Mgr
Contact Phone: 858-430-2220
Contact Phone Ext: Not reported
Contact Email: aalcantara@jetproducts.com
Operator Name: Senior Aerospace Jet Product
Operator Address: 9106 Balboa Ave
Operator City: San Diego
Operator State: California
Operator Zip: 92123
Operator Contact: Abel Alcantara
Operator Contact Title: Mgr
Operator Contact Phone: 858-430-2220
Operator Contact Phone Ext: Not reported
Operator Contact Email: aalcantara@jetproducts.com
Operator Type: Private Business
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: California
Developer Zip: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	858-740-7538
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	N
Receiving Water Name:	ocean
Certifier:	Jimmy Kenniston
Certifier Title:	Manager
Certification Date:	12-MAY-15
Primary Sic:	3547-Rolling Mill Machinery and Equipment
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	CAS000001
Status:	Active
Agency Number:	0
Region:	9
Regulatory Measure ID:	218392
Order Number:	97-03-DWQ
Regulatory Measure Type:	Enrollee
Place ID:	Not reported
WDID:	9 371007291
Program Type:	Industrial
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	07/13/1993
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Senior Aerospace Jet Product
Discharge Address:	9106 Balboa Ave
Discharge City:	San Diego
Discharge State:	California
Discharge Zip:	92123
Received Date:	Not reported
Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

Facility Status:	Active
NPDES Number:	CAS000001
Region:	9
Agency Number:	0
Regulatory Measure ID:	218392
Place ID:	Not reported
Order Number:	97-03-DWQ

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

WDID: 9 371007291
Regulatory Measure Type: Enrollee
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 07/13/1993
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: 9106 Balboa Ave
Discharge Name: Senior Aerospace Jet Product
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92123
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

NPDES as of 03/2018:

NPDES Number: Not reported
Status: Not reported
Agency Number: Not reported
Region: 9
Regulatory Measure ID: 218392
Order Number: Not reported
Regulatory Measure Type: Industrial
Place ID: Not reported
WDID: 9 371007291
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Received Date: 05/09/2008
Processed Date: 07/13/1993
Status: Active
Status Date: 10/21/2015
Place Size: 387.76
Place Size Unit: SqFt
Contact: Abel Alcantara
Contact Title: Mgr
Contact Phone: 858-430-2220
Contact Phone Ext: Not reported
Contact Email: aalcantara@jetproducts.com
Operator Name: Senior Aerospace Jet Product
Operator Address: 9106 Balboa Ave
Operator City: San Diego
Operator State: California
Operator Zip: 92123
Operator Contact: Abel Alcantara
Operator Contact Title: Mgr

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Operator Contact Phone: 858-430-2220
Operator Contact Phone Ext: Not reported
Operator Contact Email: aalcantara@jetproducts.com
Operator Type: Private Business
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: California
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: 858-740-7538
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported
Constype Recons Ind: Not reported
Constype Residential Ind: Not reported
Constype Transport Ind: Not reported
Constype Utility Description: Not reported
Constype Utility Ind: Not reported
Constype Water Sewer Ind: Not reported
Dir Discharge Uswater Ind: N
Receiving Water Name: ocean
Certifier: Jimmy Kenniston
Certifier Title: Manager
Certification Date: 12-MAY-15
Primary Sic: 3547-Rolling Mill Machinery and Equipment
Secondary Sic: Not reported
Tertiary Sic: Not reported

NPDES Number: CAS000001
Status: Active
Agency Number: 0
Region: 9
Regulatory Measure ID: 218392
Order Number: 97-03-DWQ
Regulatory Measure Type: Enrollee
Place ID: Not reported
WDID: 9 37I007291
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 07/13/1993
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Senior Aerospace Jet Product
Discharge Address: 9106 Balboa Ave
Discharge City: San Diego
Discharge State: California

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

Discharge Zip:	92123
Received Date:	Not reported
Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE JET PRODUCTS (Continued)

S105164209

CIWQS:

Agency: Senior Aerospace Jet Product
Agency Address: 9106 Balboa Ave, San Diego, CA 92123
Place/Project Type: Industrial - Rolling Mill Machinery and Equipment
SIC/NAICS: 3547
Region: 9
Program: INDSTW
Regulatory Measure Status: Active
Regulatory Measure Type: Storm water industrial
Order Number: 2014-0057-DWQ
WDID: 9 371007291
NPDES Number: CAS000001
Adoption Date: Not reported
Effective Date: 07/13/1993
Termination Date: Not reported
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.82223
Longitude: -117.13379

AG208
NNW
< 1/8
0.113 mi.
598 ft.

SENIOR AEROSPACE / JET PRODUCTS
9106 BALBOA AVENUE
SAN DIEGO, CA 92123
Site 2 of 3 in cluster AG

RCRA-LQG 1012176449
CAR009569740

Actual:
429 ft.

Focus Map:
1

RCRA-LQG:

Date form received by agency: 01/03/2008
Facility name: SENIOR AEROSPACE / JET PRODUCTS
Facility address: 9106 BALBOA AVENUE
SAN DIEGO, CA 92123
EPA ID: CAR009569740
Contact: JIMMY KENNISTON
Contact address: Not reported
Not reported
Contact country: US
Contact telephone: 858-430-2220
Contact email: JKENNISTON@JETPRODUCTS.COM
EPA Region: 09
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE / JET PRODUCTS (Continued)

1012176449

Owner/Operator Summary:

Owner/operator name: ALFONSO GALINDO
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 04/04/2004
Owner/Op end date: Not reported

Owner/operator name: SENIOR OPERATIONS, INC
Owner/operator address: 9106 BALBOA AVENUE
SAN DIEGO, CA 92123
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 02/01/1999
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
- . Waste code: D018
- . Waste name: BENZENE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE / JET PRODUCTS (Continued)

1012176449

. Waste code: D039
. Waste name: TETRACHLOROETHYLENE

. Waste code: D040
. Waste name: TRICHLOROETHYLENE

Violation Status: No violations found

AG209 SENIOR AEROSPACE / JET PRODUCTS
NNW 9106 BALBOA AVE
< 1/8 SAN DIEGO, CA 92123
0.113 mi.
598 ft. Site 3 of 3 in cluster AG

RCRA-SQG 1000128765
FINDS CAD009569740
ECHO
CA WDS

Actual:
429 ft.

RCRA-SQG:

Focus Map:
1

Date form received by agency: 04/04/2006
Facility name: SENIOR AEROSPACE/JET PRODUCTS
Facility address: 9106 BALBOA AVE.
SAN DIEGO, CA 92123
EPA ID: CAD009569740
Mailing address: 9601 BALBOA AVE.
SAN DIEGO, CA. 92123
SAN DIEGO, CA 92123
Contact: JIMMY KENNISTON
Contact address: Not reported
Not reported
Contact country: US
Contact telephone: 858-430-2220
Contact email: JKENNISTON@JETPRODUCTS.COM
EPA Region: 09
Land type: Private
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: ALFONSO GALINDO
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 04/04/2004
Owner/Op end date: Not reported

Owner/operator name: SENIOR OPERATIONS, INC.
Owner/operator address: 9106 BALBOA AVE.
SAN DIEGO, CA 92123
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE / JET PRODUCTS (Continued)

1000128765

Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 02/01/1999
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 01/01/2006

Site name: SENIOR AEROSPACE/JET PRODUCTS

Classification: Large Quantity Generator

. Waste code: 213
. Waste name: Hydrocarbon solvents (benzene, hexane, Stoddard, etc.)

. Waste code: 221
. Waste name: Waste oil and mixed oil

. Waste code: 222
. Waste name: Oil/water separation sludge

. Waste code: 223
. Waste name: Unspecified oil-containing waste

. Waste code: 331
. Waste name: Off-specification, aged, or surplus organics

. Waste code: 352
. Waste name: Other organic solids

. Waste code: 741
. Waste name: Liquids with halogenated organic compounds > 1000 mg/l

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE / JET PRODUCTS (Continued)

1000128765

MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D018
. Waste name: BENZENE

. Waste code: D039
. Waste name: TETRACHLOROETHYLENE

. Waste code: D040
. Waste name: TRICHLOROETHYLENE

Date form received by agency: 09/01/1996
Site name: JET PRODUCTS CORPORATION
Classification: Large Quantity Generator

Date form received by agency: 03/18/1981
Site name: JET PRODUCTS CORPORATION
Classification: Large Quantity Generator

Facility Has Received Notices of Violations:

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 08/05/2003
Date achieved compliance: 11/05/2003
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 11/18/1992
Date achieved compliance: 11/18/1997
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 262.10-12.A
Area of violation: Generators - General
Date violation determined: 10/29/1991
Date achieved compliance: 11/18/1992
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE / JET PRODUCTS (Continued)

1000128765

Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 08/05/2003
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 11/05/2003
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 11/18/1992
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 11/18/1997
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 10/29/1991
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 11/18/1992
Evaluation lead agency: State Contractor/Grantee

FINDS:

Registry ID: 110002637139

Environmental Interest/Information System

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

OSHA ESTABLISHMENT

US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

STATE MASTER

HAZARDOUS WASTE BIENNIAL REPORTER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENIOR AEROSPACE / JET PRODUCTS (Continued)

1000128765

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000128765
Registry ID: 110002637139
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002637139>

WDS:

Facility ID: San Diego 37I007291
Facility Type: Industrial - Facility that treats and/or disposes of liquid or semisolid wastes from any servicing, producing, manufacturing or processing operation of whatever nature, including mining, gravel washing, geothermal operations, air conditioning, ship building and repairing, oil production, storage and disposal operations, water pumping.
Facility Status: Active - Any facility with a continuous or seasonal discharge that is under Waste Discharge Requirements.
NPDES Number: CAS000001 The 1st 2 characters designate the state. The remaining 7 are assigned by the Regional Board
Subregion: 9
Facility Telephone: Not reported
Facility Contact: Not reported
Agency Name: JET PRODUCTS CORPORATION
Agency Address: 9106 BALBOA AVE
Agency City,St,Zip: SAN DIEGO 92123
Agency Contact: Not reported
Agency Telephone: Not reported
Agency Type: Private
SIC Code: 0
SIC Code 2: Not reported
Primary Waste Type: Not reported
Primary Waste: Not reported
Waste Type2: Not reported
Waste2: Not reported
Primary Waste Type: Not reported
Secondary Waste: Not reported
Secondary Waste Type: Not reported
Design Flow: 0
Baseline Flow: 0
Reclamation: Not reported
POTW: Not reported
Treat To Water: Minor Threat to Water Quality. A violation of a regional board order should cause a relatively minor impairment of beneficial uses compared to a major or minor threat. Not: All nurds without a TTWQ will be considered a minor threat to water quality unless coded at a higher Level. A Zero (0) may be used to code those NURDS that are found to represent no threat to water quality.
Complexity: Category C - Facilities having no waste treatment systems, such as cooling water dischargers or those who must comply through best management practices, facilities with passive waste treatment and disposal systems, such as septic systems with subsurface disposal, or dischargers having waste storage systems with land disposal such as dairy waste ponds.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AF210
NE
< 1/8
0.115 mi.
605 ft.
BUILDING 1
9244 BALBOA AVE
SAN DIEGO, CA 92123
Site 6 of 10 in cluster AF

CA HIST UST
U001573200
N/A

Actual:
432 ft.

Focus Map:
1

HIST UST:

File Number: Not reported
URL: Not reported
Region: STATE
Facility ID: 00000000914
Facility Type: Other
Other Type: RESEARCH & DEVELOPME
Contact Name: E. KIRBY
Telephone: 6192795100
Owner Name: DEFENSE NUCLEAR AGENCY (OWNER)
Owner Address: 9244 BALBOA AVENUE
Owner City,St,Zip: SAN DIEGO, CA 92123
Total Tanks: 0008

Tank Num: 001
Container Num: A
Year Installed: 1975
Tank Capacity: 00030000
Tank Used for: PRODUCT
Type of Fuel: Not reported
Container Construction Thickness: .365
Leak Detection: Visual, Stock Inventor

Tank Num: 002
Container Num: B
Year Installed: 1975
Tank Capacity: 00030000
Tank Used for: PRODUCT
Type of Fuel: Not reported
Container Construction Thickness: .365
Leak Detection: Visual, Stock Inventor

Tank Num: 003
Container Num: C
Year Installed: 1973
Tank Capacity: 00020000
Tank Used for: PRODUCT
Type of Fuel: Not reported
Container Construction Thickness: .302
Leak Detection: Visual, Stock Inventor

Tank Num: 004
Container Num: D
Year Installed: 1973
Tank Capacity: 00020000
Tank Used for: PRODUCT
Type of Fuel: Not reported
Container Construction Thickness: .302
Leak Detection: Visual, Stock Inventor

Tank Num: 005
Container Num: E
Year Installed: 1973

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUILDING 1 (Continued)

U001573200

Tank Capacity: 00020000
Tank Used for: PRODUCT
Type of Fuel: Not reported
Container Construction Thickness: .302
Leak Detection: Visual, Stock Inventor

Tank Num: 006
Container Num: F
Year Installed: 1969
Tank Capacity: 00020000
Tank Used for: PRODUCT
Type of Fuel: Not reported
Container Construction Thickness: .302
Leak Detection: Visual, Stock Inventor

Tank Num: 007
Container Num: G
Year Installed: 1969
Tank Capacity: 00020000
Tank Used for: PRODUCT
Type of Fuel: Not reported
Container Construction Thickness: .302
Leak Detection: Visual, Stock Inventor

Tank Num: 008
Container Num: H
Year Installed: 1969
Tank Capacity: 00020000
Tank Used for: PRODUCT
Type of Fuel: Not reported
Container Construction Thickness: .302
Leak Detection: Visual, Stock Inventor

AF211 **FORMER MAXWELL TECH INC.**
NE **9244 BALBOA AVENUE**
< 1/8 **SAN DIEGO, CA 92123**
0.115 mi.
605 ft. **Site 7 of 10 in cluster AF**

CA CPS-SLIC **S106519096**
N/A

Actual: SLIC REG 9:
432 ft. Region: 9
Focus Map: Facility Type: Not reported
1 Status: Dead
Sort Code: 20-0294.02
Waste Discharger Id: 9 000294N98
Local Case Num: H02930-001
Responsible Party: MAXWELL TECHNOLOGIES
Category: ENFORCEMENT
Class: SLIC
Order Number: Not reported
File Number: 1
Date Entered: 07/1984
End Date: Not reported
Archive Box #: 928
Archive Box Storage: 3-1-15F
Archive Box Storage Location: Not reported
Remarks: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AF212 **MAXWELL LABORATORIES INC.**
NE **9244 BALBOA AVE**
< 1/8 **SAN DIEGO, CA 92123**
0.115 mi.
605 ft. **Site 8 of 10 in cluster AF**

CA LUST **S100726076**
CA SWEEPS UST **N/A**

Actual:
432 ft.

Focus Map:
1

LUSTR REG 9:

Region: 9
Status: Case Closed
Case Number: 9UT3259
Local Case: H02930-004
Substance: Lubricating Oil
Qty Leaked: 0
Abate Method: Excavate and Dispose - remove contaminated soil and dispose in approved site
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Unknown
Cause: Unknown
Lead Agency: Local Agency
Case Type: Aquifer affected
Date Found: 09/18/1996
Date Stopped: 09/18/1996
Confirm Date: / /
Submit Workplan: Not reported
Prelim Assess: 09/18/1996
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 09/18/1996
Enforce Date: 12/1/93
Closed Date: 5/3/99
Enforce Type: SEL
Pilot Program: LOP
Basin Number: 907.11
GW Depth: 28'
Beneficial Use: MUNBU
NPDES Number: Not reported
Priority: 2B
File Dispn: RETN
Interim Remedial Actions: Not reported
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

Region: 9
Status: Case Closed
Case Number: 9UT3542
Local Case: H02930-003
Substance: PCB's
Qty Leaked: 0
Abate Method: Excavate and Dispose - remove contaminated soil and dispose in approved site
Local Agency: San Diego
How Found: Other Means
How Stopped: Close Tank
Source: Unknown
Cause: Unknown

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAXWELL LABORATORIES INC. (Continued)

S100726076

Lead Agency: Local Agency
Case Type: Aquifer affected
Date Found: 01/27/1994
Date Stopped: 06/14/1995
Confirm Date: / /
Submit Workplan: Not reported
Prelim Assess: 05/12/1994
Desc Pollution: 12/12/97
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 05/10/1994
Enforce Date: 11/25/97
Closed Date: 5/25/00
Enforce Type: SEL
Pilot Program: LOP
Basin Number: 907.11
GW Depth: 6.8
Beneficial Use: MUNBU
NPDES Number: Not reported
Priority: Medium priority
File Dispn: RETN
Interim Remedial Actions: Not reported
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

SWEEPS UST:

Status: Active
Comp Number: 2930
Number: 9
Board Of Equalization: 44-021758
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002930-000001
Tank Status: A
Capacity: 30000
Active Date: Not reported
Tank Use: CHEMICAL
STG: P
Content: Not reported
Number Of Tanks: 8

Status: Active
Comp Number: 2930
Number: 9
Board Of Equalization: 44-021758
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002930-000002
Tank Status: A
Capacity: 30000
Active Date: Not reported
Tank Use: CHEMICAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAXWELL LABORATORIES INC. (Continued)

S100726076

STG: P
Content: Not reported
Number Of Tanks: Not reported

Status: Active
Comp Number: 2930
Number: 9
Board Of Equalization: 44-021758
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002930-000003
Tank Status: A
Capacity: 20000
Active Date: Not reported
Tank Use: CHEMICAL
STG: P
Content: Not reported
Number Of Tanks: Not reported

Status: Active
Comp Number: 2930
Number: 9
Board Of Equalization: 44-021758
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002930-000004
Tank Status: A
Capacity: 20000
Active Date: Not reported
Tank Use: CHEMICAL
STG: P
Content: Not reported
Number Of Tanks: Not reported

Status: Active
Comp Number: 2930
Number: 9
Board Of Equalization: 44-021758
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002930-000005
Tank Status: A
Capacity: 20000
Active Date: Not reported
Tank Use: CHEMICAL
STG: P
Content: Not reported
Number Of Tanks: Not reported

Status: Active
Comp Number: 2930

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAXWELL LABORATORIES INC. (Continued)

S100726076

Number: 9
Board Of Equalization: 44-021758
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002930-000006
Tank Status: A
Capacity: 20000
Active Date: Not reported
Tank Use: CHEMICAL
STG: P
Content: Not reported
Number Of Tanks: Not reported

Status: Active
Comp Number: 2930
Number: 9
Board Of Equalization: 44-021758
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002930-000007
Tank Status: A
Capacity: 20000
Active Date: Not reported
Tank Use: CHEMICAL
STG: P
Content: Not reported
Number Of Tanks: Not reported

Status: Active
Comp Number: 2930
Number: 9
Board Of Equalization: 44-021758
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-002930-000008
Tank Status: A
Capacity: 20000
Active Date: Not reported
Tank Use: CHEMICAL
STG: P
Content: Not reported
Number Of Tanks: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AF213
NE
< 1/8
0.115 mi.
605 ft.
MAXWELL ELECTRONIC COMPONENT G
9244 BALBOA AVENUE
SAN DIEGO, CA 92123
Site 9 of 10 in cluster AF

RCRA-LQG
FINDS
ECHO
1007199447
CAD981456536

Actual:
432 ft.

Focus Map:
1

RCRA-LQG:
Date form received by agency:02/19/1996
Facility name: MAXWELL LABORATORIES, INC.
Facility address: 9244 BALBOA AVE.
SAN DIEGO, CA 92123-1506
EPA ID: CAD981456536
Contact: DEAN CHARLES
Contact address: Not reported
Not reported
Contact country: US
Contact telephone: 619-576-7639
Contact email: Not reported
EPA Region: 09
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency:05/11/1990
Site name: MAXWELL LABORATORIES
Classification: Large Quantity Generator

Violation Status: No violations found

FINDS:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MAXWELL ELECTRONIC COMPONENT G (Continued)

1007199447

Registry ID: 110000887229

Environmental Interest/Information System

AIR EMISSIONS CLASSIFICATION UNKNOWN

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

STATE MASTER

HAZARDOUS WASTE BIENNIAL REPORTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1007199447
Registry ID: 110000887229
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110000887229>

AF214 **DATA DEVICE CORPORATION**
NE **9244 BALBOA AVE**
< 1/8 **SAN DIEGO, CA 92123**
0.115 mi.
605 ft. **Site 10 of 10 in cluster AF**

Actual:
432 ft.
Focus Map:
1

RCRA-SQG **1000436162**
CA LUST **CAD980638050**
CA SAN DIEGO CO. SAM
CA CPS-SLIC
CA San Diego Co. HMD
CA HIST UST
CA EMI
CA HIST CORTESE
CA NPDES
CA SAN DIEGO CO LOP
CA CIWQS

RCRA-SQG:

Date form received by agency: 07/08/2016
Facility name: DATA DEVICE CORPORATION
Facility address: 9244 BALBOA AVE
SAN DIEGO, CA 92123
EPA ID: CAD980638050
Mailing address: BALBOA AVE
SAN DIEGO, CA 92123
Contact: DAVE PHAM
Contact address: BALBOA AVE
SAN DIEGO, CA 92123
Contact country: US
Contact telephone: 858-740-0491
Contact email: PHAM@DDC-WEB.COM
EPA Region: 09

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Land type: Private
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: MAXWELL TECHNOLOGIES, INC.
Owner/operator address: CALLE FORTUNADA
SAN DIEGO, CA 92123
Owner/operator country: US
Owner/operator telephone: 858-503-3300
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 02/01/1965
Owner/Op end date: Not reported

Owner/operator name: 9244 BALBOA BLVD. LLC
Owner/operator address: UPPER NEWPORT PLAZA
NEWPORT BEACH, CA 92660
Owner/operator country: US
Owner/operator telephone: 949-680-8609
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 01/01/1967
Owner/Op end date: Not reported

Owner/operator name: DATA DEVICE CORPORATION
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 04/27/2016
Owner/Op end date: Not reported

Owner/operator name: MAXWELL TECHNOLOGIES, INC.
Owner/operator address: Not reported
Not reported
Owner/operator country: Not reported
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Owner/Operator Type: Operator
Owner/Op start date: 01/01/1965
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: 181
. Waste name: Other inorganic solid waste

. Waste code: 214
. Waste name: Unspecified solvent mixture

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D008
. Waste name: LEAD

. Waste code: D011
. Waste name: SILVER

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Historical Generators:

Date form received by agency: 06/06/2016

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Site name: MAXWELL TECHNOLOGIES, INC.
Classification: Large Quantity Generator

. Waste code: 141
. Waste name: Off-specification, aged, or surplus inorganics

. Waste code: 181
. Waste name: Other inorganic solid waste

. Waste code: 214
. Waste name: Unspecified solvent mixture

. Waste code: 343
. Waste name: Unspecified organic liquid mixture

. Waste code: 741
. Waste name: Liquids with halogenated organic compounds > 1000 mg/l

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSLEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D008
. Waste name: LEAD

. Waste code: D011
. Waste name: SILVER

. Waste code: D018
. Waste name: BENZENE

. Waste code: D022
. Waste name: CHLOROFORM

. Waste code: D035
. Waste name: METHYL ETHYL KETONE

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 05/05/2016

Site name: MAXWELL TECHNOLOGIES INC

Classification: Not a generator, verified

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
- . Waste code: D007
- . Waste name: CHROMIUM
- . Waste code: D008
- . Waste name: LEAD
- . Waste code: D011
- . Waste name: SILVER
- . Waste code: D018
- . Waste name: BENZENE
- . Waste code: D022
- . Waste name: CHLOROFORM
- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Date form received by agency:03/01/2014

Site name: MAXWELL TECHNOLOGIES INC

Classification: Large Quantity Generator

. Waste code: D001

. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D007

. Waste name: CHROMIUM

. Waste code: D008

. Waste name: LEAD

. Waste code: D011

. Waste name: SILVER

. Waste code: D018

. Waste name: BENZENE

. Waste code: D022

. Waste name: CHLOROFORM

. Waste code: D035

. Waste name: METHYL ETHYL KETONE

. Waste code: F003

. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005

. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency:01/12/2008

Site name: MAXWELL TECHNOLOGIES, INC.

Classification: Large Quantity Generator

. Waste code: D001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
- . Waste code: D003
- . Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.
- . Waste code: D008
- . Waste name: LEAD
- . Waste code: D011
- . Waste name: SILVER
- . Waste code: D018
- . Waste name: BENZENE
- . Waste code: D022
- . Waste name: CHLOROFORM
- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 02/21/2006

Site name: MAXWELL TECHNOLOGIES, INC

Classification: Large Quantity Generator

. Waste code: 122
. Waste name: Alkaline solution without metals (pH > 12.5)

. Waste code: 135
. Waste name: Unspecified aqueous solution

. Waste code: 172
. Waste name: Metal dust (see 121) and machining waste

. Waste code: 181
. Waste name: Other inorganic solid waste

. Waste code: 214
. Waste name: Unspecified solvent mixture

. Waste code: 343
. Waste name: Unspecified organic liquid mixture

. Waste code: 352
. Waste name: Other organic solids

. Waste code: 551
. Waste name: Laboratory waste chemicals

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002
. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D003
. Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.

. Waste code: D005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

- . Waste name: BARIUM
 - . Waste code: D006
 - . Waste name: CADMIUM
 - . Waste code: D007
 - . Waste name: CHROMIUM
 - . Waste code: D008
 - . Waste name: LEAD
 - . Waste code: D011
 - . Waste name: SILVER
 - . Waste code: D022
 - . Waste name: CHLOROFORM
 - . Waste code: D035
 - . Waste name: METHYL ETHYL KETONE
 - . Waste code: F003
 - . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
 - . Waste code: F005
 - . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- Date form received by agency:02/21/2006
- Site name: MAXWELL TECHNOLOGIES, INC
- Classification: Small Quantity Generator
- Date form received by agency:02/26/2004
- Site name: MAXWELL TECHNOLOGIES, INC
- Classification: Large Quantity Generator
- . Waste code: D001
 - . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
- . Waste code: D003
- . Waste name: A MATERIAL IS CONSIDERED TO BE A REACTIVE HAZARDOUS WASTE IF IT IS NORMALLY UNSTABLE, REACTS VIOLENTLY WITH WATER, GENERATES TOXIC GASES WHEN EXPOSED TO WATER OR CORROSIVE MATERIALS, OR IF IT IS CAPABLE OF DETONATION OR EXPLOSION WHEN EXPOSED TO HEAT OR A FLAME. ONE EXAMPLE OF SUCH WASTE WOULD BY WASTE GUNPOWDER.
- . Waste code: D004
- . Waste name: ARSENIC
- . Waste code: D006
- . Waste name: CADMIUM
- . Waste code: D007
- . Waste name: CHROMIUM
- . Waste code: D008
- . Waste name: LEAD
- . Waste code: D009
- . Waste name: MERCURY
- . Waste code: D011
- . Waste name: SILVER
- . Waste code: D018
- . Waste name: BENZENE
- . Waste code: D019
- . Waste name: CARBON TETRACHLORIDE
- . Waste code: D022
- . Waste name: CHLOROFORM
- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: P101
- . Waste name: ETHYL CYANIDE

- . Waste code: U019
- . Waste name: BENZENE (I,T)

- . Waste code: U057
- . Waste name: CYCLOHEXANONE (I)

- . Waste code: U117
- . Waste name: ETHANE, 1,1'-OXYBIS-(I)

- . Waste code: U138
- . Waste name: METHANE, IODO-

- . Waste code: U144
- . Waste name: ACETIC ACID, LEAD(2+) SALT

- . Waste code: U151
- . Waste name: MERCURY

- . Waste code: U211
- . Waste name: CARBON TETRACHLORIDE

- . Waste code: U213
- . Waste name: FURAN, TETRAHYDRO-(I)

- . Waste code: U220
- . Waste name: BENZENE, METHYL-

- . Waste code: U226
- . Waste name: ETHANE, 1,1,1-TRICHLORO-

Date form received by agency:09/01/1996

Site name: MAXWELL LABS LASER LAB

Classification: Small Quantity Generator

Date form received by agency:10/13/1981

Site name: MAXWELL LABS LASER LAB

Classification: Large Quantity Generator

Biennial Reports:

Last Biennial Reporting Year: 2017

Annual Waste Handled:

Waste code: D001

Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Amount (Lbs): 6123.6

Waste code: D008
Waste name: LEAD
Amount (Lbs): 575

Waste code: D011
Waste name: SILVER
Amount (Lbs): 765

Waste code: D018
Waste name: BENZENE
Amount (Lbs): 1612.6

Waste code: D022
Waste name: CHLOROFORM
Amount (Lbs): 1612.6

Waste code: D035
Waste name: METHYL ETHYL KETONE
Amount (Lbs): 2448.6

Waste code: F003
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Amount (Lbs): 1612.6

Waste code: F005
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Amount (Lbs): 2448.6

Facility Has Received Notices of Violations:

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 07/21/2005
Date achieved compliance: 10/31/2005
Violation lead agency: State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Enforcement action: WRITTEN INFORMAL
Enforcement action date: 07/21/2005
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 08/13/2003
Date achieved compliance: 08/14/2003
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 08/13/2003
Date achieved compliance: 08/19/2003
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 08/13/2003
Date achieved compliance: 08/28/2003
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:
Evaluation date: 07/21/2005
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 10/31/2005
Evaluation lead agency: Local

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Evaluation date: 08/13/2003
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 08/28/2003
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 08/13/2003
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 08/14/2003
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 08/13/2003
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 08/19/2003
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 12/12/1986
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 12/12/1986
Evaluation: NON-FINANCIAL RECORD REVIEW
Area of violation: Generators - General
Date achieved compliance: 10/31/2005
Evaluation lead agency: State Contractor/Grantee

LUST:

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607302012
Global Id: T0607302012
Latitude: 32.823112
Longitude: -117.131258
Status: Completed - Case Closed
Status Date: 05/03/1999
Case Worker: Not reported
RB Case Number: 9UT3259
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H02930-004
Potential Media Affect: Soil
Potential Contaminants of Concern: Waste Oil / Motor / Hydraulic / Lubricating
Site History: Not reported

LUST:

Global Id: T0607302012
Action Type: Other
Date: 09/18/1996
Action: Leak Reported

Global Id: T0607302012
Action Type: ENFORCEMENT
Date: 03/31/1999
Action: Closure/No Further Action Letter - #H02930-004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Global Id: T0607302012
Action Type: Other
Date: 09/18/1996
Action: Leak Began

Global Id: T0607302012
Action Type: ENFORCEMENT
Date: 10/29/1996
Action: Notice of Responsibility

Global Id: T0607302012
Action Type: Other
Date: 09/18/1996
Action: Leak Discovery

Global Id: T0607302012
Action Type: Other
Date: 09/18/1996
Action: Leak Stopped

LUST:

Global Id: T0607302012
Status: Completed - Case Closed
Status Date: 05/03/1999

Global Id: T0607302012
Status: Open - Case Begin Date
Status Date: 09/18/1996

Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607302311
Global Id: T0607302311
Latitude: 32.823112
Longitude: -117.131258
Status: Completed - Case Closed
Status Date: 05/25/2000
Case Worker: Not reported
RB Case Number: 9UT3542
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H02930-003
Potential Media Affect: Aquifer used for drinking water supply
Potential Contaminants of Concern: Polychlorinated biphenyls (PCBs)
Site History: Not reported

LUST:

Global Id: T0607302311
Action Type: Other
Date: 05/10/1994
Action: Leak Reported

Global Id: T0607302311
Action Type: Other
Date: 01/27/1994
Action: Leak Began

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Global Id: T0607302311
Action Type: ENFORCEMENT
Date: 06/06/1995
Action: Notice of Responsibility

Global Id: T0607302311
Action Type: Other
Date: 01/27/1994
Action: Leak Discovery

Global Id: T0607302311
Action Type: Other
Date: 06/14/1995
Action: Leak Stopped

LUST:

Global Id: T0607302311
Status: Completed - Case Closed
Status Date: 05/25/2000

Global Id: T0607302311
Status: Open - Case Begin Date
Status Date: 01/27/1994

SAN DIEGO CO. SAM:

Case Number: H02930-001
Agency: DEH Site Assessment & Mitigation
Funding: Private - VAP
Facility Type: GW With No Beneficial Use Designation
Facility Status: Closed Case
Date: 5/3/1999
Date Began: 5/18/1990

Case Number: H02930-002
Agency: DEH Site Assessment & Mitigation
Funding: Non Billable
Facility Type: Failed Integrity Test
Facility Status: Closed Case
Date: 9/18/1996
Date Began: 5/3/1991

Case Number: H02930-003
Agency: DEH Site Assessment & Mitigation
Funding: Private - For Non-LOP Tank
Facility Type: Drinking Water Aquifer Impacted
Facility Status: Closed Case
Date: 5/25/2000
Date Began: 1/27/1994

Case Number: H02930-004
Agency: DEH Site Assessment & Mitigation
Funding: LOP - State Fund
Facility Type: Soils Only
Facility Status: Closed Case
Date: 5/3/1999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Date Began: 9/18/1996

CPS-SLIC:

Region: STATE
Facility Status: **Completed - Case Closed**
Status Date: 09/18/1996
Global Id: T0608115110
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H02930-002
Latitude: 32.823193
Longitude: -117.13126
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Under Investigation
Potential Contaminants of Concern: Not reported
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

Region: STATE
Facility Status: **Completed - Case Closed**
Status Date: 05/03/1999
Global Id: T0608163822
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H02930-001
Latitude: 32.823193
Longitude: -117.13126
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Other Groundwater (uses other than drinking water)
Potential Contaminants of Concern: Not reported
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

HMMD SAN DIEGO:

Permit Number: 102930
Business Type: 6HK36
EPA Id Number: CAD980638050
APN: 369-161-11-00
Last HMMD Inspection: 08/05/2011
Facility Telephone: 858-503-3300
Permit Status: OPEN
Permit Expiration: 01/31/2013
Date Last Updated: 11/02/2012
Facility Owner: MAXWELL TECHNOLOGIES, INC.
Facility Mailing Address: 9244 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123-1514

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

UST Owner: DEFENSE NUCLEAR AGENCY (OWNER)
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 102930
Update Date: 11/02/2012
Case Number: 1333-74-0
Name: 5-7% HYDROGEN IN NITROGEN / HYDROGEN 5% NITROGEN 95%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: 75-05-8
Name: ACETONITRILE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: 7440-44-0
Name: ACTIVATED CARBON POWDER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: MIXTURE
Name: AIR
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: 7440-37-1
Name: ARGON, COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: 7440
Name: ARGON, LIQUID

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	CRYOGENIC
Permit Number:	102930
Update Date:	11/02/2012
Case Number:	Not reported
Name:	CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information:	BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Material Waste:	Not reported
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	102930
Update Date:	11/02/2012
Case Number:	75-05-8
Name:	ELECTROLYTE SOLUTION 4500 66% ACETONITRILE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	102930
Update Date:	11/02/2012
Case Number:	7440-59-7
Name:	HELIUM COMPRESSED GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	102930
Update Date:	11/02/2012
Case Number:	1333-74-0
Name:	HYDROGEN, COMPRESSED GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	102930
Update Date:	11/02/2012
Case Number:	67-63-0
Name:	ISOPROPYL ALCOHOL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	102930
Update Date:	11/02/2012
Case Number:	7727-37-9
Name:	NITROGEN, COMPRESSED GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN, LIQUID
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: CRYOGENIC
Hazardous Categories 2: ACUTE

Permit Number: 102930
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OILS, LUBRICATING
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: 9002-84-0
Name: POLYTETRAFLUONETHYLENE
Other Information: TEFLON
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 171 METAL SLUDGE
Other Information: SOLDER DROSS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information: SILVER PASTE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)CARBON
Other Information: HEPA FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 102930

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 212 OXYGENATED SOLVENTS
Other Information: MEK (3430)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: 75-05-8
Name: WASTE 214 UNSPEC SOLVENT MIXTURE
Other Information: ACETONITRILE 99%, ACETONE, IPA, TOULENE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: 2 CETONITRILE DEBRIS (352)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 102930
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 792 LIQUIDS W/PH <OR= 2 W/METALS
Other Information: PHOSPHORIC ACID, HF
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 05/01/2008
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)

Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 05/01/2008
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)

Activity: ACTIVE

Permit Number: 102930

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Update Date: 11/02/2012
Inspection Date: 05/01/2008
Violation Code: 6HV0402
Violation: TRAINING PROGRAM NOT ADEQUATE
Violation Citation: Personnel training is not adequate to ensure compliance with hazardous waste regulations. CCR 66265.16(a)&(b)
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 08/05/2011
Violation Code: 6HV0228
Violation: CONTAINER NOT KEPT CLOSED
Violation Citation: Failed to keep container closed. CFR 265.173
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 08/13/2003
Violation Code: 6HV0133
Violation: MANIFEST COPY NOT SENT TO DTSC
Violation Citation: Generator of hazardous waste has not sent the appropriate copy of the manifest to DTSC/Cal-EPA. CCR 66262.23(a)(4)
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 08/13/2003
Violation Code: 6HV0138
Violation: NO TSDF SIGNED MANIFEST ONSITE
Violation Citation: Generator has not maintained the required signed copy of the hazardous waste manifest from the TSD facility on site for review. CCR 66262.40(a)
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 08/13/2003
Violation Code: 6HV0402
Violation: TRAINING PROGRAM NOT ADEQUATE
Violation Citation: Personnel training is not adequate to ensure compliance with hazardous waste regulations. CCR 66265.16(a)&(b)
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 08/13/2003
Violation Code: 6HV1008
Violation: NO ANNUAL CARC/REPRO TOXIN LIST TO HMD
Violation Citation: Annual carcinogen and reproductive toxin list not submitted to HMD. 68.1113(c)
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 07/21/2005
Violation Code: 6HV0202

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 07/21/2005
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 07/21/2005
Violation Code: 6HV0209
Violation: WASTE ONSITE >90/180/270 DAYS
Violation Citation: Hazardous waste is stored in excess of allowable time period (90 days) without a State permit or written variance. CCR 25201(a) & 66262.34(a)&(c)
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 07/21/2005
Violation Code: 6HV0212
Violation: INCOMPATIBLE WASTE NOT SEPARATED
Violation Citation: Hazardous waste storage container is not adequately separated from nearby incompatible wastes or materials. CCR 66265.177
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 07/21/2005
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 07/21/2005
Violation Code: 6HV0402
Violation: TRAINING PROGRAM NOT ADEQUATE
Violation Citation: Personnel training is not adequate to ensure compliance with hazardous waste regulations. CCR 66265.16(a)&(b)
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 07/21/2005
Violation Code: 6HV1011

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Violation: TRAINING RECORDS NOT AVAILABLE
Violation Citation: Personnel training records not available. 19 CCR 2732
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 07/21/2005
Violation Code: 6HV0138
Violation: NO TSDF SIGNED MANIFEST ONSITE
Violation Citation: Generator has not maintained the required signed copy of the hazardous waste manifest from the TSD facility on site for review. CCR 66262.40(a)
Activity: ACTIVE

Permit Number: 102930
Update Date: 11/02/2012
Inspection Date: 07/21/2005
Violation Code: 6HV1006
Violation: HMBP: INVENTORY INADEQUATE
Violation Citation: Business Plan inventory does not list all hazardous materials on site in disclosable quantities. HSC 25504(a),25503.5
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 102930 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 102930
Tank Type: SINGLE WALL
Additional Id: A PETROLEUM MINERAL OIL
Capacity Gallons: 30000
UST Contents: Not reported
Other Content Info: PETROLEUM MINERAL OIL
Reg Status: REMOVED
Remove Close Date: 1996-09-18 00:00:00
Year Installed: 1975-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102930 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 102930
Tank Type: SINGLE WALL
Additional Id: B PETROLEUM MINERAL OIL
Capacity Gallons: 30000
UST Contents: Not reported
Other Content Info: PETROLEUM MINERAL OIL
Reg Status: REMOVED
Remove Close Date: 1996-09-18 00:00:00
Year Installed: 1975-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

UST Name: UNDERGROUND TANK 102930 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 102930
Tank Type: SINGLE WALL
Additional Id: C PETROLEUM MINERAL OIL
Capacity Gallons: 20000
UST Contents: Not reported
Other Content Info: PETROLEUM MINERAL OIL
Reg Status: REMOVED
Remove Close Date: 1996-09-18 00:00:00
Year Installed: 1973-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102930 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 102930
Tank Type: SINGLE WALL
Additional Id: AT3696 PETROLEUM MINERAL OIL
Capacity Gallons: 20000
UST Contents: Not reported
Other Content Info: PETROLEUM MINERAL OIL
Reg Status: REMOVED
Remove Close Date: 1996-09-18 00:00:00
Year Installed: 1973-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 102930 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 102930
Tank Type: SINGLE WALL
Additional Id: E PETROLEUM MINERAL OIL
Capacity Gallons: 20000
UST Contents: Not reported
Other Content Info: PETROLEUM MINERAL OIL
Reg Status: REMOVED
Remove Close Date: 1996-09-18 00:00:00
Year Installed: 1973-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 102930 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 102930
Tank Type: SINGLE WALL
Additional Id: AT3696 PETROLEUM MINERAL OIL
Capacity Gallons: 20000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

UST Contents: Not reported
Other Content Info: PETROLEUM MINERAL OIL
Reg Status: REMOVED
Remove Close Date: 1996-09-18 00:00:00
Year Installed: 1969-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 102930 T007
Last Update: 2012-11-02 14:17:38
Permit Number: 102930
Tank Type: SINGLE WALL
Additional Id: AT3696 PETROLEUM MINERAL OIL
Capacity Gallons: 20000
UST Contents: Not reported
Other Content Info: PETROLEUM MINERAL OIL
Reg Status: REMOVED
Remove Close Date: 1996-09-18 00:00:00
Year Installed: 1969-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 102930 T008
Last Update: 2012-11-02 14:17:38
Permit Number: 102930
Tank Type: SINGLE WALL
Additional Id: AT3696 PETROLEUM MINERAL OIL
Capacity Gallons: 20000
UST Contents: Not reported
Other Content Info: PETROLEUM MINERAL OIL
Reg Status: REMOVED
Remove Close Date: 1996-09-18 00:00:00
Year Installed: 1969-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 102930 T009
Last Update: 2012-11-02 14:17:38
Permit Number: 102930
Tank Type: SINGLE WALL
Additional Id: AT3440
Capacity Gallons: 2500
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1995-06-14 00:00:00
Year Installed: Not reported
Pipe Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

HIST UST:

File Number: 0002B0D5
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002B0D5.pdf>
Region: Not reported
Facility ID: Not reported
Facility Type: Not reported
Other Type: Not reported
Contact Name: Not reported
Telephone: Not reported
Owner Name: Not reported
Owner Address: Not reported
Owner City,St,Zip: Not reported
Total Tanks: Not reported

Tank Num: Not reported
Container Num: Not reported
Year Installed: Not reported
Tank Capacity: Not reported
Tank Used for: Not reported
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: Not reported

Click here for Geo Tracker PDF:

EMI:

Year: 2000
County Code: 37
Air Basin: SD
Facility ID: 950
Air District Name: SD
SIC Code: 3663
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0
Reactive Organic Gases Tons/Yr: 0
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0

Year: 2001
County Code: 37
Air Basin: SD
Facility ID: 950
Air District Name: SD
SIC Code: 3663
Air District Name: SAN DIEGO COUNTY APCD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0
Reactive Organic Gases Tons/Yr: 0
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0

Year: 2002
County Code: 37
Air Basin: SD
Facility ID: 950
Air District Name: SD
SIC Code: 3663
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0
Reactive Organic Gases Tons/Yr: 0
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0

Year: 2003
County Code: 37
Air Basin: SD
Facility ID: 950
Air District Name: SD
SIC Code: 3663
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0
Reactive Organic Gases Tons/Yr: 0
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0

Year: 2004
County Code: 37
Air Basin: SD
Facility ID: 950
Air District Name: SD
SIC Code: 3663
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.016434
Reactive Organic Gases Tons/Yr: 0.0099
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0.000020715
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0.000020715

Year: 2005
County Code: 37
Air Basin: SD
Facility ID: 950
Air District Name: SD
SIC Code: 3663
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: .016434
Reactive Organic Gases Tons/Yr: .0099
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: .0000360888501742160
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0.000020715

Year: 2006
County Code: 37
Air Basin: SD
Facility ID: 950
Air District Name: SD
SIC Code: 3663
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: .016434
Reactive Organic Gases Tons/Yr: .0099
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: .0000360888501742160
Part. Matter 10 Micrometers and Smllr Tons/Yr: 0.000020715

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT3542

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT3259

NPDES:

Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Order Number: Not reported
WDID: 9 371016199
Regulatory Measure Type: Industrial
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Terminated
Status Date: 05/13/2016
Operator Name: Maxwell Technologies Inc
Operator Address: 9244 Balboa Ave
Operator City: San Diego
Operator State: California
Operator Zip: 92123

NPDES as of 03/2018:

NPDES Number: Not reported
Status: Not reported
Agency Number: Not reported
Region: 9
Regulatory Measure ID: 218768
Order Number: Not reported
Regulatory Measure Type: Industrial
Place ID: Not reported
WDID: 9 371016199
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: 05/13/2016
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Received Date: 05/09/2008
Processed Date: 11/07/2000
Status: Terminated
Status Date: 05/13/2016
Place Size: 3.44
Place Size Unit: Acres
Contact: Dean Charles
Contact Title: Sr Environmental Engineer
Contact Phone: 858-503-3300
Contact Phone Ext: Not reported
Contact Email: dcharles@maxwell.com
Operator Name: Maxwell Technologies Inc
Operator Address: 9244 Balboa Ave
Operator City: San Diego
Operator State: California
Operator Zip: 92123
Operator Contact: Dean Charles

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Operator Contact Title:	Sr Environmental Engineer
Operator Contact Phone:	858-503-3300
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	dcharles@maxwell.com
Operator Type:	Private Business
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	California
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	858-503-3300
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	N
Receiving Water Name:	Murphy Canyon Creek
Certifier:	Everett Wiggins
Certifier Title:	Vice President of Operations
Certification Date:	11-MAY-15
Primary Sic:	3675-Electronic Capacitors
Secondary Sic:	3674-Semiconductors and Related Devices
Tertiary Sic:	Not reported
NPDES Number:	CAS000001
Status:	Terminated
Agency Number:	0
Region:	9
Regulatory Measure ID:	218768
Order Number:	97-03-DWQ
Regulatory Measure Type:	Enrollee
Place ID:	Not reported
WDID:	9 371016199
Program Type:	Industrial
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	11/07/2000
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	05/13/2016
Discharge Name:	Maxwell Technologies Inc
Discharge Address:	9244 Balboa Ave
Discharge City:	San Diego

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Discharge State:	California
Discharge Zip:	92123
Received Date:	Not reported
Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Tertiary Sic: Not reported

Facility Status: Terminated
NPDES Number: CAS000001
Region: 9
Agency Number: 0
Regulatory Measure ID: 218768
Place ID: Not reported
Order Number: 97-03-DWQ
WDID: 9 37I016199
Regulatory Measure Type: Enrollee
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 11/07/2000
Termination Date Of Regulatory Measure: 05/13/2016
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: 9244 Balboa Ave
Discharge Name: Maxwell Technologies Inc
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92123
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

NPDES as of 03/2018:

NPDES Number: Not reported
Status: Not reported
Agency Number: Not reported
Region: 9
Regulatory Measure ID: 218768
Order Number: Not reported
Regulatory Measure Type: Industrial
Place ID: Not reported
WDID: 9 37I016199
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: 05/13/2016
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Received Date: 05/09/2008
Processed Date: 11/07/2000
Status: Terminated
Status Date: 05/13/2016
Place Size: 3.44
Place Size Unit: Acres
Contact: Dean Charles
Contact Title: Sr Environmental Engineer

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Contact Phone:	858-503-3300
Contact Phone Ext:	Not reported
Contact Email:	dcharles@maxwell.com
Operator Name:	Maxwell Technologies Inc
Operator Address:	9244 Balboa Ave
Operator City:	San Diego
Operator State:	California
Operator Zip:	92123
Operator Contact:	Dean Charles
Operator Contact Title:	Sr Environmental Engineer
Operator Contact Phone:	858-503-3300
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	dcharles@maxwell.com
Operator Type:	Private Business
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	California
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	858-503-3300
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	N
Receiving Water Name:	Murphy Canyon Creek
Certifier:	Everett Wiggins
Certifier Title:	Vice President of Operations
Certification Date:	11-MAY-15
Primary Sic:	3675-Electronic Capacitors
Secondary Sic:	3674-Semiconductors and Related Devices
Tertiary Sic:	Not reported
NPDES Number:	CAS000001
Status:	Terminated
Agency Number:	0
Region:	9
Regulatory Measure ID:	218768
Order Number:	97-03-DWQ
Regulatory Measure Type:	Enrollee
Place ID:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

WDID: 9 371016199
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 11/07/2000
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: 05/13/2016
Discharge Name: Maxwell Technologies Inc
Discharge Address: 9244 Balboa Ave
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92123
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported
Contact: Not reported
Contact Title: Not reported
Contact Phone: Not reported
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Contact: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported
Operator Contact Phone Ext: Not reported
Operator Contact Email: Not reported
Operator Type: Not reported
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: Not reported
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: Not reported
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported
Constype Recons Ind: Not reported
Constype Residential Ind: Not reported
Constype Transport Ind: Not reported
Constype Utility Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

SAN DIEGO CO LOP:

Record ID:	DEH1996-LSAM-H02930-004
Record Status:	Completed
Opened Date:	09/18/1996
Parcel Number:	369-161-11-00
Case Type:	LOP - Local Oversight Program
Historical Name:	MAXWELL LABORATORIES
SWRCB Global ID:	T0607302012
Funding:	S - LOP State Fund
Lead Agency:	DEH/SAM
Lead Agency Date:	09/18/1996
Census Tract:	85.11
Community:	San Diego
Jurisdiction:	SAN DIEGO
Watershed Basin Number:	907.11
Water Purveyor:	SAN DIEGO
Fire Agency:	SAN DIEGO
Thomas Bros Map Page Grid:	1249 D 2
Latitude:	32.8231120
Longitude:	-117.1312576
X MapCoord:	6290935.313
Y MapCoord:	1880440.461

Record ID:	DEH1991-LSAM-H02930-002
Record Status:	Completed
Opened Date:	07/22/1991
Parcel Number:	369-161-11-00
Case Type:	Not reported
Historical Name:	MAXWELL LABORATORIES
SWRCB Global ID:	T0608115110
Funding:	N - Non-Billable
Lead Agency:	DEH/SAM
Lead Agency Date:	08/20/1991
Census Tract:	85.11
Community:	San Diego
Jurisdiction:	SAN DIEGO
Watershed Basin Number:	907.11
Water Purveyor:	SAN DIEGO
Fire Agency:	SAN DIEGO
Thomas Bros Map Page Grid:	1249 D 2
Latitude:	32.8231120
Longitude:	-117.1312576
X MapCoord:	6290935.313
Y MapCoord:	1880440.461

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DATA DEVICE CORPORATION (Continued)

1000436162

CIWQS:

Agency: Maxwell Technologies Inc
Agency Address: 9244 Balboa Ave, San Diego, CA 92123
Place/Project Type: Industrial - Electronic Capacitors
SIC/NAICS: Multiple
Region: 9
Program: INDSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water industrial
Order Number: 2014-0057-DWQ
WDID: 9 371016199
NPDES Number: CAS000001
Adoption Date: Not reported
Effective Date: 11/07/2000
Termination Date: 05/13/2016
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.82233
Longitude: -117.13117

AH215
NNW
< 1/8
0.121 mi.
638 ft.
TRICARE OUTPATIENT CLINIC
8808 BALBOA AV
SAN DIEGO, CA 92123
Site 1 of 3 in cluster AH

CA SAN DIEGO CO. SAM
S109118217
N/A

Actual:
425 ft.
Focus Map:
1
SAN DIEGO CO. SAM:
Case Number: H09343-001
Agency: DEH Site Assessment & Mitigation
Funding: **Private - VAP**
Facility Type: Soils Only
Facility Status: Closed Case
Date: 9/16/1987
Date Began: 4/30/1987

AH216
NNW
< 1/8
0.121 mi.
638 ft.
TRICARE OUTPATIENT CLINIC
8808 BALBOA AVE
SAN DIEGO, CA 92123
Site 2 of 3 in cluster AH

RCRA-SQG
CA LUST
CA SWEEPS UST
FINDS
ECHO
CA HAZNET
1000264913
CAD981396419

Actual:
425 ft.
Focus Map:
1
RCRA-SQG:
Date form received by agency: 09/12/1996
Facility name: CEIMIC CORP
Facility address: 8808 BALBOA AVE
SAN DIEGO, CA 92123
EPA ID: CAD981396419
Contact: LARRY FLYNN
Contact address: 8808 BALBOA AVE
SAN DIEGO, CA 92123

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

1000264913

Contact country: US
Contact telephone: 619-637-7400
Contact email: Not reported
EPA Region: 09
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: JOHN F MCGARRY
Owner/operator address: 8808 BALBOA AVE
SAN DIEGO, CA 92123
Owner/operator country: Not reported
Owner/operator telephone: 619-637-7400
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

1000264913

LUST REG 9:

Region: 9
Status: Case Closed
Case Number: 9UT717
Local Case: H09343-001
Substance: Acetone, etc.
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Tank
Cause: Corrosion
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 04/27/1987
Date Stopped: 04/27/1987
Confirm Date: / /
Submit Workplan: Not reported
Prelim Assess: / /
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: 8/28/87
Began Monitor: Not reported
Release Date: 04/27/1987
Enforce Date: Not reported
Closed Date: 5/25/88
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: 5 FT
Beneficial Use: Not reported
NPDES Number: Not reported
Priority: Low priority. Priority ranking can change over time.
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

SWEEPS UST:

Status: Active
Comp Number: 9343
Number: 9
Board Of Equalization: 44-022435
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: Not reported
Tank Status: Not reported
Capacity: Not reported
Active Date: Not reported
Tank Use: Not reported
STG: Not reported
Content: Not reported
Number Of Tanks: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

1000264913

Status: Not reported
Comp Number: 9343
Number: Not reported
Board Of Equalization: 44-022435
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-009343-000001
Tank Status: Not reported
Capacity: 500
Active Date: Not reported
Tank Use: UNKNOWN
STG: PRODUCT
Content: Not reported
Number Of Tanks: 1

FINDS:

Registry ID: 110002693130

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Registry ID: 110055868011

Environmental Interest/Information System

STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000264913
Registry ID: 110002693130
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002693130>

HAZNET:

Facility Name: CEIMIC CORP
envid: 1000264913
Year: 1998
GEPAID: CAD981396419
Contact: Not reported
Telephone: 0000000000
Mailing Name: Not reported
Mailing Address: 16935 W BERNARDO DR STE 239A
Mailing City,St,Zip: SAN DIEGO, CA 921270000
Gen County: Not reported
TSD EPA ID: OHD083377010
TSD County: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

1000264913

Waste Category: Liquids with pH <= 2 with metals
Disposal Method: Not reported
Tons: .1251
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1000264913
Year: 1998
GEPAID: CAD981396419
Contact: Not reported
Telephone: 0000000000
Mailing Name: Not reported
Mailing Address: 16935 W BERNARDO DR STE 239A
Mailing City,St,Zip: SAN DIEGO, CA 921270000
Gen County: Not reported
TSD EPA ID: OHD083377010
TSD County: Not reported
Waste Category: Laboratory waste chemicals
Disposal Method: Not reported
Tons: 2.6864
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1000264913
Year: 1998
GEPAID: CAD981396419
Contact: Not reported
Telephone: 0000000000
Mailing Name: Not reported
Mailing Address: 16935 W BERNARDO DR STE 239A
Mailing City,St,Zip: SAN DIEGO, CA 921270000
Gen County: Not reported
TSD EPA ID: OHD083377010
TSD County: Not reported
Waste Category: Laboratory waste chemicals
Disposal Method: Invalid Code
Tons: 1.7567
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1000264913
Year: 1998
GEPAID: CAD981396419
Contact: Not reported
Telephone: 0000000000
Mailing Name: Not reported
Mailing Address: 16935 W BERNARDO DR STE 239A
Mailing City,St,Zip: SAN DIEGO, CA 921270000
Gen County: Not reported
TSD EPA ID: OHD083377010
TSD County: Not reported
Waste Category: Not reported
Disposal Method: Invalid Code
Tons: .0000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

1000264913

Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

envid: 1000264913
Year: 1998
GEPAID: CAD981396419
Contact: Not reported
Telephone: 0000000000
Mailing Name: Not reported
Mailing Address: 16935 W BERNARDO DR STE 239A
Mailing City,St,Zip: SAN DIEGO, CA 921270000
Gen County: Not reported
TSD EPA ID: OHD083377010
TSD County: Not reported
Waste Category: Not reported
Disposal Method: Not reported
Tons: .1500
Cat Decode: Not reported
Method Decode: Not reported
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
21 additional CA_HAZNET: record(s) in the EDR Site Report.

AH217
NNW
< 1/8
0.121 mi.
638 ft.

TRICARE OUTPATIENT CLINIC
8808 BALBOA AVE
SAN DIEGO, CA 92123

Site 3 of 3 in cluster AH

CA CPS-SLIC S104746754
CA San Diego Co. HMMD N/A
CA HIST CORTESE
CA NPDES
CA CIWQS

Actual:
425 ft.

Focus Map:
1

CPS-SLIC:
Region: STATE
Facility Status: Completed - Case Closed
Status Date: 09/16/1987
Global Id: T0607302983
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H09343-001
Latitude: 32.821453
Longitude: -117.13774
Case Type: Cleanup Program Site
Case Worker: KH
Local Agency: SAN DIEGO COUNTY LOP
RB Case Number: 9UT717
File Location: Local Agency
Potential Media Affected: Soil
Potential Contaminants of Concern: Acetone
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

HMMD SAN DIEGO:

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000320265
APN: Not reported
Last HMMD Inspection: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Facility Telephone: 858-569-6664
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 07/14/2018
Facility Owner: Not reported
Facility Mailing Address: 34580 POWERHOUSE RD, SUITE 200, SAN DIEGO, CA 92134-8200
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

UST DTL:

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-109343
Facility Type (Ust Facility): Not reported
Tank Owner Name: NAVAL MEDICAL CENTER SAN DIEGO
Tankid: 20640
Tank Status: Removed
Date Ust Permanently Closed: 01/12/1987
Tank Use: Not reported
Piping System Type: Not reported
Last Updated: 2018-10-26T21:35:37.000
Tank Capacityin Gallons: 500
Tank Contents: Not reported
Type Of Tank: 95

Waste and Materials:

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131083
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T21:35:37.000
Chemical Name: Ammonia Ethanol
Common Name: Ammonia Ethanol
Case Number: Not reported

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0106496
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-01-21T01:21:05.000
Chemical Name: Waste 901 Biomedical Waste
Common Name: Waste 901 Biomedical Waste
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0106497
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-01-21T01:21:05.000
Chemical Name: Waste 902 Infectious Waste, Sharps
Common Name: Waste 902 Infectious Waste, Sharps
Case Number: Not reported

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0106498
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-01-21T01:21:05.000
Chemical Name: Waste 311 Pharmaceutical Waste
Common Name: Waste 311 Pharmaceutical Waste
Case Number: Not reported

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0106499
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-01-21T01:21:05.000
Chemical Name: Waste Nitrates
Common Name: Silver Nitrate/Potassium Nitrate
Case Number: Not reported

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0106500
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-01-21T01:21:05.000
Chemical Name: Ammonia Ethanol
Common Name: Ammonia Ethanol
Case Number: Not reported

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0106501
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-01-21T01:21:05.000
Chemical Name: Ethyl Alcohol/Isopropanol
Common Name: Purell
Case Number: Not reported

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Active Permit: Y
Child Record Id: DEH2017-HWAST-0131079
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T21:35:37.000
Chemical Name: Waste 901 Biomedical Waste
Common Name: Waste 901 Biomedical Waste
Case Number: Not reported

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131080
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T21:35:37.000
Chemical Name: Waste 902 Infectious Waste, Sharps
Common Name: Waste 902 Infectious Waste, Sharps
Case Number: Not reported

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131081
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T21:35:37.000
Chemical Name: Waste 311 Pharmaceutical Waste
Common Name: Waste 311 Pharmaceutical Waste
Case Number: Not reported

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131082
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T21:35:37.000
Chemical Name: Waste Nitrates
Common Name: Silver Nitrate/Potassium Nitrate
Case Number: Not reported

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131084
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T21:35:37.000
Chemical Name: Ethyl Alcohol/Isopropanol
Common Name: Purell
Case Number: Not reported

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131085

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T21:35:37.000
Chemical Name: Waste Medicine
Common Name: RCRA Pharmaceutical Waste
Case Number: Not reported

Record ID: DEH2002-HUPFP-109343
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131086
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T21:35:37.000
Chemical Name: Methanol
Common Name: Methanol
Case Number: Not reported

Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000314522
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 858-492-3500
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 04/25/2018
Facility Owner: Not reported
Facility Mailing Address: 8808 BALBOA AV #150, SAN DIEGO, CA 92123
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:
Record ID: DEH2011-HUPFP-213703
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-213703
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4091288
Return To Compliance Date: 2015-02-06T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T01:15:01.000
Inspection Date: 2015-02-06T00:00:00.000
Violation Code: HMD0305 Disposed of used oil illegally. HSC 25250.5(a) & 25189.5(a) or 25189(c) or (d) or 25189.2 (c).

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Record ID: DEH2011-HUPFP-213703
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-213703
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 4091288
Return To Compliance Date: 2015-02-11T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T01:15:01.000
Inspection Date: 2015-02-06T00:00:00.000
Violation Code: 1010002 Owner/Operator failed to complete and/or submit a Hazardous Materials Business Plan when storing hazardous materials at or above the thresholds quantities of 55 gallons/500 lbs/200 cubic feet; HSC 6.95 25508(a)1A

Record ID: DEH2011-HUPFP-213703
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-213703
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4091288
Return To Compliance Date: 2015-02-11T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T01:15:01.000
Inspection Date: 2015-02-06T00:00:00.000
Violation Code: 3030010 Failure to dispose of hazardous waste within 180 days (or 270 if waste is transported over 200 miles) for the generator who generates less than 1000 kilogram per month, but more than 100 kilograms per month.; 22 CCR 12 66262.34(d).

Record ID: DEH2011-HUPFP-213703
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-213703
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4091288
Return To Compliance Date: 2015-02-09T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T01:15:01.000
Inspection Date: 2015-02-06T00:00:00.000
Violation Code: 3010010 Failure to maintain uniform hazardous waste manifest, consolidated manifest, or bills of lading copies for three years.; 22 CCR 12 66262.40(a).

Record ID: DEH2011-HUPFP-213703

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-213703
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 4091288
Return To Compliance Date: 2015-02-11T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T01:15:01.000
Inspection Date: 2015-02-06T00:00:00.000
Violation Code: 1010008 Failure to annually review and electronically certify that the business plan is complete, accurate, and up-to-date. For facilities with inventory that exceed EPCRA thresholds; failure to submit inventory reports (Activities, Owner/Operator, Hazardous Materials Descriptions and Map pages HSC 6.95 25508.2 / 19 CCR 4 2729.5(c)

Record ID: DEH2011-HUPFP-213703
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-213703
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 4091288
Return To Compliance Date: 2015-02-11T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-10-25T01:15:01.000
Inspection Date: 2015-02-06T00:00:00.000
Violation Code: 1010005 Failure to complete and/or submit an annotated site map if required by CUPA; HSC 6.95 25505(a)2.

Waste and Materials:

Record ID: DEH2011-HUPFP-213703
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0122287
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T01:15:01.000
Chemical Name: AIR, COMPRESSED
Common Name: MEDICAL AIR, COMPRESSED
Case Number: Not reported

Record ID: DEH2011-HUPFP-213703
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0122288
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-25T01:15:01.000
Chemical Name: OIL, LUBRICATING; MOTOR, ATF
Common Name: MOTOR OIL / ATF

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Case Number:	8002-05-9
Record ID:	DEH2011-HUPFP-213703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0122289
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-10-25T01:15:01.000
Chemical Name:	OXYGEN, 02, 99%, COMPRESSED GAS
Common Name:	MEDICAL OXYGEN, COMPRESSED
Case Number:	7782-44-7
Record ID:	DEH2011-HUPFP-213703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0122290
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-10-25T01:15:01.000
Chemical Name:	DIESEL FUEL #2
Common Name:	DIESEL FUEL
Case Number:	68476-34-6
Record ID:	DEH2011-HUPFP-213703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0122291
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-25T01:15:01.000
Chemical Name:	COOLANT
Common Name:	COOLANT
Case Number:	Not reported
Record ID:	DEH2011-HUPFP-213703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0102276
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T01:15:01.000
Chemical Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Common Name:	WASTE - OILY SOLIDS
Case Number:	Not reported
Record ID:	DEH2011-HUPFP-213703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0102277
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T01:15:01.000
Chemical Name:	WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Common Name:	WASTE - PARTS WASHER SOLUTION
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Record ID:	DEH2011-HUPFP-213703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0102278
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T01:15:01.000
Chemical Name:	WASTE 902 INFECTIOUS WASTE, SHARPS
Common Name:	WASTE - SHARPS
Case Number:	Not reported
Record ID:	DEH2011-HUPFP-213703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0102279
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T01:15:01.000
Chemical Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE
Common Name:	WASTE - CLARIFIER WATER
Case Number:	Not reported
Record ID:	DEH2011-HUPFP-213703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0102280
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T01:15:01.000
Chemical Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name:	WASTE - MIXED FUEL
Case Number:	Not reported
Record ID:	DEH2011-HUPFP-213703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0102281
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T01:15:01.000
Chemical Name:	WASTE 901 INFECTIOUS WASTE, GENERAL
Common Name:	WASTE - RED BAG
Case Number:	Not reported
Record ID:	DEH2011-HUPFP-213703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0102282
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-25T01:15:01.000
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL
Common Name:	WASTE- OIL
Case Number:	Not reported
Record ID:	DEH2011-HUPFP-213703
Permit Status:	Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Active Permit: Y
Child Record Id: DEH2016-HWAST-0102283
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T01:15:01.000
Chemical Name: WASTE- COOLANT
Common Name: WASTE - COOLANT
Case Number: Not reported

Record ID: DEH2011-HUPFP-213703
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0102284
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-25T01:15:01.000
Chemical Name: WASTE - PHARMACEUTICALS
Common Name: WASTE - PHARMACEUTICALS (RCRA / NONRCRA)
Case Number: Not reported

Permit Number: 109343
Business Type: 6HK58
EPA Id Number: CAD982049306
APN: 369-150-18-00
Last HMD Inspection: 08/02/2012
Facility Telephone: 858-569-6664
Permit Status: OPEN
Permit Expiration: 11/30/2012
Date Last Updated: 11/02/2012
Facility Owner: NAVAL MEDICAL CENTER
Facility Mailing Address: 34580 POWERHOUSE RD, SUITE 200
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92134-8200
UST Owner: SOLITRON
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 109343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 311 PHARMACEUTICAL WASTE
Other Information: SPILLS, RETURNS, LQDS, SLDS NON-RCRA
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 109343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 109343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 06/13/2008
Violation Code: 6HV4351
Violation: LQG:MWMP NOT SUBMITTED TO HMD
Violation Citation: Medical Waste Management Plan has not been submitted to County HMD
(Initial Submission/updates)(LQG). 117960, 117970
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 01/09/2006
Violation Code: 6HV4309
Violation: SQG:MWMP OR EQUIV NOT ONSITE
Violation Citation: Medical Waste Management Plan or equivalent information not onsite for
review (SQG). 117945
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 01/09/2006
Violation Code: 6HV4303
Violation: SQG:NO MED WASTE DISPOSAL RECORDS
Violation Citation: Generator did not retain on file disposal receipts and/or tracking
documents for waste shipped offsite for at least 2 years (SQG).
117945(b)
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 01/09/2006
Violation Code: 6HV4205
Violation: MED SOLID WASTE NOT SECURED TO DENY ACCE
Violation Citation: Medical Solid Waste not secured to deny access to unauthorized
persons. 68.1211
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 08/02/2012
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

point (ground, storm drain, sewer system, trash, or air). HSC
25189.5(a) or 25189(d)
Activity: ACTIVE
Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 08/02/2012
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous
waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 109343 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 109343
Tank Type: UNKNOWN
Additional Id: Not reported
Capacity Gallons: 500
UST Contents: Not reported
Other Content Info: SEE FILE FOR CONTENTS
Reg Status: REMOVED
Remove Close Date: 1987-01-12 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING
ALTERNATIVE DURING INSPECTION.

Permit Number: 109343
Business Type: 6HK58
EPA Id Number: CAD982049306
APN: 369-150-18-00
Last HMMD Inspection: 08/02/2012
Facility Telephone: 858-569-6664
Permit Status: OPEN
Permit Expiration: 11/30/2012
Date Last Updated: 11/02/2012
Facility Owner: NAVAL MEDICAL CENTER
Facility Mailing Address: 34580 POWERHOUSE RD, SUITE 200
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92134-8200
UST Owner: SOLITRON
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 109343
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Case Number: Not reported
Name: WASTE 311 PHARMACEUTICAL WASTE
Other Information: SPILLS, RETURNS,LQDS,SLDS NON-RCRA
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 109343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 109343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 06/13/2008
Violation Code: 6HV4351
Violation: LQG:MWMP NOT SUBMITTED TO HMD
Violation Citation: Medical Waste Management Plan has not been submitted to County HMD
(Initial Submission/updates)(LQG). 117960, 117970
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 01/09/2006
Violation Code: 6HV4309
Violation: SQG:MWMP OR EQUIV NOT ONSITE
Violation Citation: Medical Waste Management Plan or equivalent information not onsite for
review (SQG). 117945
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 01/09/2006
Violation Code: 6HV4303
Violation: SQG:NO MED WASTE DISPOSAL RECORDS
Violation Citation: Generator did not retain on file disposal receipts and/or tracking
documents for waste shipped offsite for at least 2 years (SQG).
117945(b)
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 01/09/2006

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Violation Code: 6HV4205
Violation: MED SOLID WASTE NOT SECURED TO DENY ACCE
Violation Citation: Medical Solid Waste not secured to deny access to unauthorized persons. 68.1211
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 08/02/2012
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 08/02/2012
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 109343 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 109343
Tank Type: UNKNOWN
Additional Id: Not reported
Capacity Gallons: 500
UST Contents: Not reported
Other Content Info: SEE FILE FOR CONTENTS
Reg Status: REMOVED
Remove Close Date: 1987-01-12 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

Permit Number: 109343
Business Type: 6HK58
EPA Id Number: CAD982049306
APN: 369-150-18-00
Last HMMD Inspection: 08/02/2012
Facility Telephone: 858-569-6664
Permit Status: OPEN
Permit Expiration: 11/30/2012
Date Last Updated: 11/02/2012
Facility Owner: NAVAL MEDICAL CENTER
Facility Mailing Address: 34580 POWERHOUSE RD, SUITE 200
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Facility Mailing Zip: 92134-8200
UST Owner: SOLITRON
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: N
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 109343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 311 PHARMACEUTICAL WASTE
Other Information: SPILLS, RETURNS,LQDS,SLDS NON-RCRA
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 109343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 109343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 06/13/2008
Violation Code: 6HV4351
Violation: LQG:MWMP NOT SUBMITTED TO HMD
Violation Citation: Medical Waste Management Plan has not been submitted to County HMD
(Initial Submission/updates)(LQG). 117960, 117970
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 01/09/2006
Violation Code: 6HV4309
Violation: SQG:MWMP OR EQUIV NOT ONSITE
Violation Citation: Medical Waste Management Plan or equivalent information not onsite for
review (SQG). 117945
Activity: ACTIVE

Permit Number: 109343

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Update Date: 11/02/2012
Inspection Date: 01/09/2006
Violation Code: 6HV4303
Violation: SQG:NO MED WASTE DISPOSAL RECORDS
Violation Citation: Generator did not retain on file disposal receipts and/or tracking documents for waste shipped offsite for at least 2 years (SQG). 117945(b)
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 01/09/2006
Violation Code: 6HV4205
Violation: MED SOLID WASTE NOT SECURED TO DENY ACCE
Violation Citation: Medical Solid Waste not secured to deny access to unauthorized persons. 68.1211
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 08/02/2012
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)
Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 08/02/2012
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 109343 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 109343
Tank Type: UNKNOWN
Additional Id: Not reported
Capacity Gallons: 500
UST Contents: Not reported
Other Content Info: SEE FILE FOR CONTENTS
Reg Status: REMOVED
Remove Close Date: 1987-01-12 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

Permit Number: 109343

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Business Type: 6HK58
EPA Id Number: CAD982049306
APN: 369-150-18-00
Last HMMD Inspection: 08/02/2012
Facility Telephone: 858-569-6664
Permit Status: OPEN
Permit Expiration: 11/30/2012
Date Last Updated: 11/02/2012
Facility Owner: NAVAL MEDICAL CENTER
Facility Mailing Address: 34580 POWERHOUSE RD, SUITE 200
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92134-8200
UST Owner: SOLITRON
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 109343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 311 PHARMACEUTICAL WASTE
Other Information: SPILLS, RETURNS,LQDS,SLDS NON-RCRA
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 109343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 109343
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 06/13/2008
Violation Code: 6HV4351
Violation: LQG:MWMP NOT SUBMITTED TO HMD
Violation Citation: Medical Waste Management Plan has not been submitted to County HMD
(Initial Submission/updates)(LQG). 117960, 117970

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 01/09/2006
Violation Code: 6HV4309
Violation: SQG:MWMP OR EQUIV NOT ONSITE
Violation Citation: Medical Waste Management Plan or equivalent information not onsite for review (SQG). 117945

Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 01/09/2006
Violation Code: 6HV4303
Violation: SQG:NO MED WASTE DISPOSAL RECORDS
Violation Citation: Generator did not retain on file disposal receipts and/or tracking documents for waste shipped offsite for at least 2 years (SQG). 117945(b)

Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 01/09/2006
Violation Code: 6HV4205
Violation: MED SOLID WASTE NOT SECURED TO DENY ACCE
Violation Citation: Medical Solid Waste not secured to deny access to unauthorized persons. 68.1211

Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 08/02/2012
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)

Activity: ACTIVE

Permit Number: 109343
Update Date: 11/02/2012
Inspection Date: 08/02/2012
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)

Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 109343 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 109343
Tank Type: UNKNOWN
Additional Id: Not reported
Capacity Gallons: 500
UST Contents: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Other Content Info: SEE FILE FOR CONTENTS
Reg Status: REMOVED
Remove Close Date: 1987-01-12 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

Permit Number: 213703
Business Type: 6HK58
EPA Id Number: CAL000314522
APN: 369-150-18-00
Last HMMD Inspection: 05/26/2011
Facility Telephone: 858-492-3600
Permit Status: OPEN
Permit Expiration: 02/28/2013
Date Last Updated: 11/02/2012
Facility Owner: EMERGENCY MEDICAL SERVICE CORP
Facility Mailing Address: 8808 BALBOA AV #150
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Y

Inventory Active Permits (not SQG Medical):

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: AIR, COMPRESSED
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: ACUTE

Permit Number: 213703
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL #2
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 213703
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING; MOTOR, ATF
Other Information: Not reported
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 213703
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN, 02, 99%, COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: PARTS WASHER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: AMBULANCE MOTOR OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 222 OIL/WATER SEPARATION SLUDGE
Other Information: CHECK ONGOING DISPOSAL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY ABSORBENT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information: DIESEL/GAS MIX
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information: ANTIFRZ REC ONSITE TOXGRD
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 444 USED BATTERIES
Other Information: INTERSTATE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: UNCRUSHED
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information: AMBULANCE WASTE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: SHARPS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 213703
Update Date: 11/02/2012
Inspection Date: 05/26/2011
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank.
66262.34(f)
Activity: ACTIVE

Permit Number: 213703
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Inspection Date: 05/26/2011
Violation Code: 6HV0149
Violation: NO RECEIPTS (3 YRS) FOR OIL/FUEL FILTERS
Violation Citation: Failed to keep disposal receipts (3 years) for drained used oil filters and/or drained fuel filters. 25250.22 and 66266.130(c)(5)
Activity: ACTIVE

Permit Number: 139100
Business Type: 6HK58
EPA Id Number: CAL000296094
APN: 369-150-18-00
Last HMMD Inspection: 08/10/2009
Facility Telephone: 858-492-3600
Permit Status: INAC
Permit Expiration: 12/31/2010
Date Last Updated: 11/02/2012
Facility Owner: LAIDLAW MEDICAL TRANSPORTATION
Facility Mailing Address: 8808 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Violations Inactive Permits:

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 01/28/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 01/28/2003
Violation Code: 6HV4205
Violation: MED SOLID WASTE NOT SECURED TO DENY ACCE
Violation Citation: Medical Solid Waste not secured to deny access to unauthorized persons. 68.1211
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 03/13/2006
Violation Code: 6HV4303
Violation: SQG:NO MED WASTE DISPOSAL RECORDS
Violation Citation: Generator did not retain on file disposal receipts and/or tracking documents for waste shipped offsite for at least 2 years (SQG). 117945(b)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 09/26/2007
Violation Code: 6HV1013
Violation: HMBP NOT AVAILABLE FOR REVIEW
Violation Citation: Copy of HMBP not onsite for inspector's review. 25505(e)
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 09/26/2007
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 08/10/2009
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 08/10/2009
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 08/10/2009
Violation Code: 6HV4309
Violation: SQG:MWMP OR EQUIV NOT ONSITE
Violation Citation: Medical Waste Management Plan or equivalent information not onsite for review (SQG). 117945
Activity: Inactive Permit

Permit Number: 139100
Business Type: 6HK58
EPA Id Number: CAL000296094
APN: 369-150-18-00
Last HMMD Inspection: 08/10/2009
Facility Telephone: 858-492-3600
Permit Status: INAC
Permit Expiration: 12/31/2010

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Date Last Updated: 11/02/2012
Facility Owner: LAIDLAW MEDICAL TRANSPORTATION
Facility Mailing Address: 8808 BALBOA AV
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Violations Inactive Permits:

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 01/28/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 01/28/2003
Violation Code: 6HV4205
Violation: MED SOLID WASTE NOT SECURED TO DENY ACCE
Violation Citation: Medical Solid Waste not secured to deny access to unauthorized persons. 68.1211
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 03/13/2006
Violation Code: 6HV4303
Violation: SQG:NO MED WASTE DISPOSAL RECORDS
Violation Citation: Generator did not retain on file disposal receipts and/or tracking documents for waste shipped offsite for at least 2 years (SQG). 117945(b)
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 09/26/2007
Violation Code: 6HV1013
Violation: HMBP NOT AVAILABLE FOR REVIEW
Violation Citation: Copy of HMBP not onsite for inspector's review. 25505(e)
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 09/26/2007
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

onsite to document proper disposal of hazardous waste. CCR 66262.40(a)
& 25160.2(b)(3)
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 08/10/2009
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained
onsite to document proper disposal of hazardous waste. CCR 66262.40(a)
& 25160.2(b)(3)
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 08/10/2009
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank.
66262.34(f)
Activity: Inactive Permit

Permit Number: 139100
Update Date: 11/02/2012
Inspection Date: 08/10/2009
Violation Code: 6HV4309
Violation: SQG:MWMP OR EQUIV NOT ONSITE
Violation Citation: Medical Waste Management Plan or equivalent information not onsite for
review (SQG). 117945
Activity: Inactive Permit

Permit Number: 213703
Business Type: 6HK58
EPA Id Number: CAL000314522
APN: 369-150-18-00
Last HMMD Inspection: 05/26/2011
Facility Telephone: 858-492-3600
Permit Status: OPEN
Permit Expiration: 02/28/2013
Date Last Updated: 11/02/2012
Facility Owner: EMERGENCY MEDICAL SERVICE CORP
Facility Mailing Address: 8808 BALBOA AV #150
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 213703
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Case Number:	Not reported
Name:	AIR, COMPRESSED
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	68476-34-6
Name:	DIESEL FUEL #2
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	CHRONIC
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	8002-05-9
Name:	OIL, LUBRICATING; MOTOR, ATF
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	CHRONIC
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	7782-44-7
Name:	OXYGEN, O2, 99%, COMPRESSED GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	PRESSURE RELEASE
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information:	PARTS WASHER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	AMBULANCE MOTOR OIL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE
Other Information:	CHECK ONGOING DISPOSAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information:	OILY ABSORBENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	DIESEL/GAS MIX
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information:	ANTIFRZ REC ONSITE TOXGRD
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 444 USED BATTERIES
Other Information:	INTERSTATE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 888 USED OIL FILTERS
Other Information:	UNCRUSHED
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information:	AMBULANCE WASTE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: SHARPS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 213703
Update Date: 11/02/2012
Inspection Date: 05/26/2011
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank.
66262.34(f)
Activity: ACTIVE

Permit Number: 213703
Update Date: 11/02/2012
Inspection Date: 05/26/2011
Violation Code: 6HV0149
Violation: NO RECEIPTS (3 YRS) FOR OIL/FUEL FILTERS
Violation Citation: Failed to keep disposal receipts (3 years) for drained used oil
filters and/or drained fuel filters. 25250.22 and 66266.130(c)(5)
Activity: ACTIVE

Permit Number: 213703
Business Type: 6HK58
EPA Id Number: CAL000314522
APN: 369-150-18-00
Last HMMD Inspection: 05/26/2011
Facility Telephone: 858-492-3600
Permit Status: OPEN
Permit Expiration: 02/28/2013
Date Last Updated: 11/02/2012
Facility Owner: EMERGENCY MEDICAL SERVICE CORP
Facility Mailing Address: 8808 BALBOA AV #150
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92123
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 213703
Update Date: 11/02/2012
Case Number: Not reported
Name: AIR, COMPRESSED
Other Information: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	ACUTE
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	68476-34-6
Name:	DIESEL FUEL #2
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	CHRONIC
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	8002-05-9
Name:	OIL, LUBRICATING; MOTOR, ATF
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	CHRONIC
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	7782-44-7
Name:	OXYGEN, O2, 99%, COMPRESSED GAS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	PRESSURE RELEASE
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information:	PARTS WASHER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	AMBULANCE MOTOR OIL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 222 OIL/WATER SEPARATION SLUDGE
Other Information:	CHECK ONGOING DISPOSAL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information:	OILY ABSORBENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	DIESEL/GAS MIX
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information:	ANTIFRZ REC ONSITE TOXGRD
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 444 USED BATTERIES
Other Information:	INTERSTATE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 888 USED OIL FILTERS
Other Information:	UNCRUSHED
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information:	AMBULANCE WASTE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	213703
Update Date:	11/02/2012
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: SHARPS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 213703
Update Date: 11/02/2012
Inspection Date: 05/26/2011
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank.
66262.34(f)
Activity: ACTIVE

Permit Number: 213703
Update Date: 11/02/2012
Inspection Date: 05/26/2011
Violation Code: 6HV0149
Violation: NO RECEIPTS (3 YRS) FOR OIL/FUEL FILTERS
Violation Citation: Failed to keep disposal receipts (3 years) for drained used oil
filters and/or drained fuel filters. 25250.22 and 66266.130(c)(5)
Activity: ACTIVE

HIST CORTESE:

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT717

NPDES:

Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported
Order Number: Not reported
WDID: 9 371019485
Regulatory Measure Type: Industrial
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Active
Status Date: 05/11/2005
Operator Name: American Medical Response West
Operator Address: 1510 Rollins Road

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Operator City: Burlingame
Operator State: California
Operator Zip: 94010
NPDES as of 03/2018:
NPDES Number: CAS000001
Status: Active
Agency Number: 0
Region: 9
Regulatory Measure ID: 291327
Order Number: 97-03-DWQ
Regulatory Measure Type: Enrollee
Place ID: Not reported
WDID: 9 371019485
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 05/11/2005
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: American Medical Response West
Discharge Address: 1510 Rollins Road
Discharge City: Burlingame
Discharge State: California
Discharge Zip: 94010
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported
Contact: Not reported
Contact Title: Not reported
Contact Phone: Not reported
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Contact: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported
Operator Contact Phone Ext: Not reported
Operator Contact Email: Not reported
Operator Type: Not reported
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: Not reported
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: Not reported
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	Not reported
Status:	Not reported
Agency Number:	Not reported
Region:	9
Regulatory Measure ID:	291327
Order Number:	Not reported
Regulatory Measure Type:	Industrial
Place ID:	Not reported
WDID:	9 371019485
Program Type:	Not reported
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Not reported
Discharge Address:	Not reported
Discharge City:	Not reported
Discharge State:	Not reported
Discharge Zip:	Not reported
Received Date:	05/09/2008
Processed Date:	05/11/2005
Status:	Active
Status Date:	05/11/2005
Place Size:	15768
Place Size Unit:	SqFt
Contact:	Joe McKay
Contact Title:	Fleet Supervisor
Contact Phone:	858-492-3561
Contact Phone Ext:	Not reported
Contact Email:	joseph.mckay@amr.net
Operator Name:	American Medical Response West
Operator Address:	1510 Rollins Road
Operator City:	Burlingame
Operator State:	California

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Operator Zip: 94010
Operator Contact: Brian Stites
Operator Contact Title: Regional Fleet Manager
Operator Contact Phone: 951-966-1864
Operator Contact Phone Ext: Not reported
Operator Contact Email: brian.stites@amr.net
Operator Type: Private Business
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: California
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: 858-492-3561
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported
Constype Recons Ind: Not reported
Constype Residential Ind: Not reported
Constype Transport Ind: Not reported
Constype Utility Description: Not reported
Constype Utility Ind: Not reported
Constype Water Sewer Ind: Not reported
Dir Discharge Uswater Ind: N
Receiving Water Name: Pacific Ocean
Certifier: Randy Harrell
Certifier Title: Area Fleet Manager
Certification Date: 29-JUN-15
Primary Sic: 4119-Local Passenger Transportation, NEC
Secondary Sic: Not reported
Tertiary Sic: Not reported

Facility Status: Active
NPDES Number: CAS000001
Region: 9
Agency Number: 0
Regulatory Measure ID: 291327
Place ID: Not reported
Order Number: 97-03-DWQ
WDID: 9 371019485
Regulatory Measure Type: Enrollee
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 05/11/2005
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Discharge Address: 1510 Rollins Road
Discharge Name: American Medical Response West
Discharge City: Burlingame
Discharge State: California
Discharge Zip: 94010
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

NPDES as of 03/2018:

NPDES Number: CAS000001
Status: Active
Agency Number: 0
Region: 9
Regulatory Measure ID: 291327
Order Number: 97-03-DWQ
Regulatory Measure Type: Enrollee
Place ID: Not reported
WDID: 9 371019485
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 05/11/2005
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: American Medical Response West
Discharge Address: 1510 Rollins Road
Discharge City: Burlingame
Discharge State: California
Discharge Zip: 94010
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported
Contact: Not reported
Contact Title: Not reported
Contact Phone: Not reported
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Contact: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported
Operator Contact Phone Ext: Not reported
Operator Contact Email: Not reported
Operator Type: Not reported
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Developer State: Not reported
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: Not reported
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported
Constype Recons Ind: Not reported
Constype Residential Ind: Not reported
Constype Transport Ind: Not reported
Constype Utility Description: Not reported
Constype Utility Ind: Not reported
Constype Water Sewer Ind: Not reported
Dir Discharge Uswater Ind: Not reported
Receiving Water Name: Not reported
Certifier: Not reported
Certifier Title: Not reported
Certification Date: Not reported
Primary Sic: Not reported
Secondary Sic: Not reported
Tertiary Sic: Not reported

NPDES Number: Not reported
Status: Not reported
Agency Number: Not reported
Region: 9
Regulatory Measure ID: 291327
Order Number: Not reported
Regulatory Measure Type: Industrial
Place ID: Not reported
WDID: 9 371019485
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Received Date: 05/09/2008
Processed Date: 05/11/2005
Status: Active
Status Date: 05/11/2005
Place Size: 15768
Place Size Unit: SqFt

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Contact:	Joe McKay
Contact Title:	Fleet Supervisor
Contact Phone:	858-492-3561
Contact Phone Ext:	Not reported
Contact Email:	joseph.mckay@amr.net
Operator Name:	American Medical Response West
Operator Address:	1510 Rollins Road
Operator City:	Burlingame
Operator State:	California
Operator Zip:	94010
Operator Contact:	Brian Stites
Operator Contact Title:	Regional Fleet Manager
Operator Contact Phone:	951-966-1864
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	brian.stites@amr.net
Operator Type:	Private Business
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	California
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	858-492-3561
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	N
Receiving Water Name:	Pacific Ocean
Certifier:	Randy Harrell
Certifier Title:	Area Fleet Manager
Certification Date:	29-JUN-15
Primary Sic:	4119-Local Passenger Transportation, NEC
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

CIWQS:

Agency:	American Medical Response West
Agency Address:	1510 Rollins Road, Burlingame, CA 94010
Place/Project Type:	Industrial - Local Passenger Transportation, NEC
SIC/NAICS:	4119

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRICARE OUTPATIENT CLINIC (Continued)

S104746754

Region: 9
Program: INDSTW
Regulatory Measure Status: Active
Regulatory Measure Type: Storm water industrial
Order Number: 2014-0057-DWQ
WDID: 9 37I019485
NPDES Number: CAS000001
Adoption Date: Not reported
Effective Date: 05/11/2005
Termination Date: Not reported
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.821453
Longitude: -117.13774

AB218 **G D E SYSTEMS INC**
NNW **8804 BALBOA AVE**
< 1/8 **SAN DIEGO, CA 92123**
0.121 mi.
640 ft. **Site 2 of 2 in cluster AB**

RCRA NonGen / NLR **1000214000**
FINDS **CAD982482580**
ECHO

Actual: RCRA NonGen / NLR:
425 ft. Date form received by agency: 11/16/1992
Focus Map: Facility name: G D E SYSTEMS INC
1 Facility address: 8804 BALBOA AVE
SAN DIEGO, CA 92123
EPA ID: CAD982482580
Contact: VAN ANH LE
Contact address: PO BOX 85227 MAIL ZONE 7-24
SAN DIEGO, CA 92186
Contact country: US
Contact telephone: 619-573-7707
Contact email: Not reported
EPA Region: 09
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: G D E SYSTEMS INC
Owner/operator address: P O BOX 85227 M Z 7 24
SAN DIEGO, CA 92186
Owner/operator country: Not reported
Owner/operator telephone: 619-573-7707
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

G D E SYSTEMS INC (Continued)

1000214000

Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

FINDS:

Registry ID: 110002826014

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000214000
Registry ID: 110002826014
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002826014>

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

219
East
< 1/8
0.121 mi.
641 ft.

AEROSPACE SUPPLY INC
3738 RUFFIN RD
SAN DIEGO, CA 92123

CA San Diego Co. HMMD
CA SWEEPS UST

S104745283
N/A

Actual:
404 ft.

Focus Map:
1

HMMD SAN DIEGO:

Permit Number: 101391
Business Type: 6HK20
EPA Id Number: Not reported
APN: 421-370-05-00
Last HMMD Inspection: 10/16/1992
Facility Telephone: Not reported
Permit Status: INAC
Permit Expiration: 10/16/1992
Date Last Updated: 11/02/2012
Facility Owner: Not reported
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 101391 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 101391
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 10000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1991-01-24 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

SWEEPS UST:

Status: Active
Comp Number: 1391
Number: 9
Board Of Equalization: 44-021608
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: Not reported
Tank Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AEROSPACE SUPPLY INC (Continued)

S104745283

Capacity: Not reported
Active Date: Not reported
Tank Use: Not reported
STG: Not reported
Content: Not reported
Number Of Tanks: Not reported

Status: Not reported
Comp Number: 1391
Number: Not reported
Board Of Equalization: 44-021608
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-001391-000001
Tank Status: Not reported
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: 1

220
WNW
< 1/8
0.122 mi.
643 ft.

**BLVO BEESON FLOYD CHEVRON SERVICE
4398 KEARNY MESA RD
SAN DIEGO, CA**

**EDR Hist Auto 1008998250
N/A**

Actual: EDR Hist Auto
412 ft.

Focus Map: 1	Year: Name: Type:
	1966 BEESON FLOYD CHEVRON SERVICE GASOLINE STATIONS
	1969 BEESON FLOYD E Gasoline Service Stations
	1970 BEESON FLOYD E Gasoline Service Stations
	1971 BEESON FLOYD E Gasoline Service Stations

221
South
< 1/8
0.124 mi.
657 ft.

**TELEDYNE ELECTRONIC TECHNOLOGIES
3565 CORPORATE CT
SAN DIEGO, CA 92123**

**RCRA-SQG 1000193749
FINDS CAD981378946
ECHO**

Actual:
409 ft.

Focus Map:
1

RCRA-SQG:
Date form received by agency: 03/21/2000
Facility name: TELEDYNE ELECTRONIC TECHNOLOGIES
Facility address: 3565 CORPORATE CT
SAN DIEGO, CA 92123
EPA ID: CAD981378946
Contact: W JEFF HOGG
Contact address: 3565 CORPORATE CT
SAN DIEGO, CA 92123
Contact country: US
Contact telephone: 858-495-2237
Contact email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE ELECTRONIC TECHNOLOGIES (Continued)

1000193749

EPA Region: 09
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: TELEDYNE TECHNOLOGIES INC
Owner/operator address: 2049 CENTURY PARK E
LOS ANGELES, CA 90067
Owner/operator country: Not reported
Owner/operator telephone: 310-277-3311
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE ELECTRONIC TECHNOLOGIES (Continued)

1000193749

FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
- . Waste code: D008
- . Waste name: LEAD
- . Waste code: F001
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE, AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F002
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TELEDYNE ELECTRONIC TECHNOLOGIES (Continued)

1000193749

THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Violation Status: No violations found

FINDS:

Registry ID: 110002686825

Environmental Interest/Information System

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Registry ID: 110055878037

Environmental Interest/Information System

STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000193749
Registry ID: 110002686825
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002686825>

AI222
South
< 1/8
0.125 mi.
658 ft.

SILTEC SAN DIEGO PACKAGING PLANT
3566 CORPORATE COURT
SAN DIEGO, CA 92123

SEMS-ARCHIVE **1003878012**
CAD086002631

Site 1 of 2 in cluster AI

Actual:
389 ft.
Focus Map:
1

SEMS Archive:
Site ID: 0900278
EPA ID: CAD086002631
Cong District: 41
FIPS Code: 06073
FF: N
NPL: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information
Latitude: 32.801667
Longitude: -117.140000

SEMS Archive Detail:

Region: 09
Site ID: 0900278
EPA ID: CAD086002631
Site Name: SILTEC SAN DIEGO PACKAGING PLANT
NPL: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILTEC SAN DIEGO PACKAGING PLANT (Continued)

1003878012

FF: N
OU: 00
Action Code: VS
Action Name: ARCH SITE
SEQ: 1
Start Date: Not reported
Finish Date: 1996-01-23 05:00:00
Qual: Not reported
Current Action Lead: EPA Perf In-Hse

Region: 09
Site ID: 0900278
EPA ID: CAD086002631
Site Name: SILTEC SAN DIEGO PACKAGING PLANT
NPL: N
FF: N
OU: 00
Action Code: PA
Action Name: PA
SEQ: 1
Start Date: Not reported
Finish Date: 1991-08-23 04:00:00
Qual: D
Current Action Lead: EPA Perf

Region: 09
Site ID: 0900278
EPA ID: CAD086002631
Site Name: SILTEC SAN DIEGO PACKAGING PLANT
NPL: N
FF: N
OU: 00
Action Code: DS
Action Name: DISCVRY
SEQ: 1
Start Date: 1991-01-01 05:00:00
Finish Date: 1991-01-01 05:00:00
Qual: Not reported
Current Action Lead: EPA Perf

AI223
South
< 1/8
0.125 mi.
658 ft.

DELTA GROUP ELECTRONICS INC
3566 CORPORATE COURT
SAN DIEGO, CA 92123

Site 2 of 2 in cluster AI

RCRA NonGen / NLR **1000355008**
FINDS **CAD981666076**
ECHO

Actual:
389 ft.

Focus Map:
1

RCRA NonGen / NLR:
Date form received by agency:08/25/2004
Facility name: DELTA GROUP ELECTRONICS
Facility address: 3566 CORPORATE COURT
SAN DIEGO, CA 92123
EPA ID: CAD981666076
Contact: BILL WEST
Contact address: 3566 CORPORATE COURT
SAN DIEGO, CA 92123
Contact country: US
Contact telephone: 858-569-1681

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DELTA GROUP ELECTRONICS INC (Continued)

1000355008

Contact email: Not reported
EPA Region: 09
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: BILL WEST
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 04/01/2004
Owner/Op end date: Not reported

Owner/operator name: SDBC C/O HILL CO
Owner/operator address: 110 W C ST STE 1402
SAN DIEGO, CA 92101
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 02/01/2000
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DELTA GROUP ELECTRONICS INC (Continued)

1000355008

WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: D039
- . Waste name: TETRACHLOROETHYLENE
- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Historical Generators:

Date form received by agency: 10/07/1996
Site name: NORTHSTAR ELECTRONICS INC
Classification: Small Quantity Generator

Violation Status: No violations found

FINDS:

Registry ID: 110012701950

Environmental Interest/Information System

US EPA TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include;

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DELTA GROUP ELECTRONICS INC (Continued)

1000355008

Incident Tracking, Compliance Assistance, and Compliance Monitoring.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000355008
Registry ID: 110012701950
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110012701950>

224
NE
1/8-1/4
0.158 mi.
832 ft.

Actual:
432 ft.

SOLAR TURBINES INCORPORATED - KEARNY MESA
4200 RUFFIN ROAD
SAN DIEGO, CA 92123

SEMS-ARCHIVE 1015732938
CORRACTS CAT000626549
RCRA-TSDF
RCRA-LQG
US FIN ASSUR
2020 COR ACTION
CA HAZNET
NY MANIFEST

Focus Map:
1

SEMS Archive:

Site ID: 0900274
EPA ID: CAT000626549
Cong District: 41
FIPS Code: 06073
FF: N
NPL: Not on the NPL
Non NPL Status: Deferred to RCRA (Subtitle C)
Latitude: 32.801667
Longitude: -117.140000

SEMS Archive Detail:

Region: 09
Site ID: 0900274
EPA ID: CAT000626549
Site Name: SOLAR TURBINES INC
NPL: N
FF: N
OU: 00
Action Code: VS
Action Name: ARCH SITE
SEQ: 1
Start Date: Not reported
Finish Date: 1996-01-23 05:00:00
Qual: Not reported
Current Action Lead: EPA Perf In-Hse

Region: 09
Site ID: 0900274
EPA ID: CAT000626549
Site Name: SOLAR TURBINES INC
NPL: N
FF: N
OU: 00
Action Code: PA
Action Name: PA
SEQ: 1
Start Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Finish Date: 1991-05-14 04:00:00
Qual: D
Current Action Lead: EPA Perf

Region: 09
Site ID: 0900274
EPA ID: CAT000626549
Site Name: SOLAR TURBINES INC
NPL: N
FF: N
OU: 00
Action Code: DS
Action Name: DISCVRY
SEQ: 1
Start Date: 1988-03-09 05:00:00
Finish Date: 1988-03-09 05:00:00
Qual: Not reported
Current Action Lead: St Perf

CORRACTS:

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20160920
Action: CA350 - CMS Approved
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: 20161020
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20151118
Action: CA340 - CMS Report Received
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: 20151215
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20150130
Action: CA170 - RFI Supplemental Information Deemed Satisfactory
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: 20150301
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20141017
Action: CA160 - RFI Supplemental Information Received
NAICS Code(s): 333611

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: 20141015
Schedule end date: 20141231

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20140904
Action: CA180 - RFI Supplemental Implementation Begun
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20110217
Action: CA170 - RFI Supplemental Information Deemed Satisfactory
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: 20110221
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20100930
Action: CA160 - RFI Supplemental Information Received
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: 20101031
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20100304
Action: CA550RC
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: 20100304
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20100126
Action: CA200 - RFI Approved
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: Not reported
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Actual Date: 20070914
Action: CA750YE - Migration of Contaminated Groundwater under Control, Yes, Migration of Contaminated Groundwater Under Control has been verified
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: 20070914
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20070703
Action: CA190 - RFI Report Received
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: 20090615
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20070124
Action: CA150 - RFI Workplan Approved
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: 20061110
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20050718
Action: CA725YE - Current Human Exposures Under Control, Yes, Current Human Exposures Under Control has been verified
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: 20050718
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20000516
Action: CA725IN - Current Human Exposures Under Control, More information is needed to make a determination
NAICS Code(s): 333611
Turbine and Turbine Generator Set Units Manufacturing
Original schedule date: 20000516
Schedule end date: Not reported

EPA ID: CAT000626549
EPA Region: 9
Area Name: ENTIRE FACILITY
Actual Date: 20000516
Action: CA750IN - Migration of Contaminated Groundwater under Control, More information is needed to make a determination
NAICS Code(s): 333611

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Turbine and Turbine Generator Set Units Manufacturing

Original schedule date: 20000516

Schedule end date: Not reported

RCRA-TSDF:

Date form received by agency: 02/24/2016

Facility name: SOLAR TURBINES INCORPORATED - KEARNY MESA

Facility address: 4200 RUFFIN ROAD
SAN DIEGO, CA 92123

EPA ID: CAT000626549

Mailing address: RUFFIN ROAD
SAN DIEGO, CA 92123

Contact: RUTH G SOKLOW

Contact address: PO BOX 58376
SAN DIEGO, CA 92186

Contact country: US

Contact telephone: 619-544-5394

Contact email: SOKLOW_RUTH_G@SOLARTURBINES.COM

EPA Region: 09

Land type: Private

Classification: TSDF

Description: Handler is engaged in the treatment, storage or disposal of hazardous waste

Classification: Large Quantity Generator

Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name: CATERPILLAR

Owner/operator address: PACIFIC HIGHWAY
SAN DIEGO, CA 92101

Owner/operator country: US

Owner/operator telephone: 619-544-5394

Owner/operator email: Not reported

Owner/operator fax: Not reported

Owner/operator extension: Not reported

Legal status: Private

Owner/Operator Type: Owner

Owner/Op start date: 07/31/1981

Owner/Op end date: Not reported

Owner/operator name: CATERPILLAR

Owner/operator address: Not reported
Not reported

Owner/operator country: Not reported

Owner/operator telephone: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 07/31/1981
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: 122
. Waste name: Alkaline solution without metals (pH > 12.5)

. Waste code: 131
. Waste name: Aqueous solution (2 < pH < 12.5) containing reactive anions (azide, bromate, chlorate, cyanide, fluoride, hypochlorite, nitrite, perchlorate, and sulfide anions)

. Waste code: 141
. Waste name: Off-specification, aged, or surplus inorganics

. Waste code: 181
. Waste name: Other inorganic solid waste

. Waste code: 212
. Waste name: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)

. Waste code: 331
. Waste name: Off-specification, aged, or surplus organics

. Waste code: 352
. Waste name: Other organic solids

. Waste code: 461
. Waste name: Degreasing sludge

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002
. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D007
. Waste name: CHROMIUM

. Waste code: D008
. Waste name: LEAD

. Waste code: D035
. Waste name: METHYL ETHYL KETONE

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Historical Generators:

Date form received by agency:03/01/2014

Site name: SOLAR TURBINES INC - KEARNY MESA

Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
 - . Waste code: D007
 - . Waste name: CHROMIUM
 - . Waste code: D008
 - . Waste name: LEAD
 - . Waste code: D009
 - . Waste name: MERCURY
 - . Waste code: D035
 - . Waste name: METHYL ETHYL KETONE
 - . Waste code: F002
 - . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
 - . Waste code: F003
 - . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
 - . Waste code: F005
 - . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
 - . Waste code: D001
- Date form received by agency: 03/02/2012
Site name: SOLAR TURBINES INCORPORATED - KEARNY MESA
Classification: Large Quantity Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSLEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002

. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D035

. Waste name: METHYL ETHYL KETONE

. Waste code: F003

. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005

. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 09/09/2010

Site name: SOLAR TURBINES INCORPORATED - KEARNY MESA FACILITY

Classification: Large Quantity Generator

. Waste code: 212

. Waste name: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)

. Waste code: 331

. Waste name: Off-specification, aged, or surplus organics

. Waste code: 352

. Waste name: Other organic solids

. Waste code: 461

. Waste name: Degreasing sludge

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D005
- . Waste name: BARIUM

- . Waste code: D007
- . Waste name: CHROMIUM

- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 02/26/2008

Site name: SOLAR TURBINES INCORPORATED - KEARNY MESA FACILITY

Classification: Large Quantity Generator

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D005
- . Waste name: BARIUM

- . Waste code: D007
- . Waste name: CHROMIUM

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 01/23/2006

Site name: SOLAR TURBINES - KEARNY MESA FACILITY

Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D005
. Waste name: BARIUM

. Waste code: D007
. Waste name: CHROMIUM

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency:02/18/2004

Site name: SOLAR TURBINES - KEARNY MESA FACILITY

Classification: Large Quantity Generator

. Waste code: D001

. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D005

. Waste name: BARIUM

. Waste code: D007

. Waste name: CHROMIUM

. Waste code: F003

. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005

. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency:02/22/2002

Site name: SOLAR TURBINES (KEARNY MESA)

Classification: Large Quantity Generator

. Waste code: 141

. Waste name: Off-specification, aged, or surplus inorganics

. Waste code: 181

. Waste name: Other inorganic solid waste

. Waste code: 331

. Waste name: Off-specification, aged, or surplus organics

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

- . Waste code: 343
- . Waste name: Unspecified organic liquid mixture

- . Waste code: 352
- . Waste name: Other organic solids

- . Waste code: 541
- . Waste name: Photochemicals / photo processing waste

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

- . Waste code: D007
- . Waste name: CHROMIUM

- . Waste code: D011
- . Waste name: SILVER

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency:10/12/2000

Site name: SOLAR TURBINES, INC. - KEARNY MESA

Classification: Large Quantity Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Date form received by agency:03/04/1999

Site name: SOLAR TURBINES, INC.

Classification: Large Quantity Generator

Date form received by agency:09/01/1996

Site name: SOLAR TURBINES INC KEARNY MESA FAC

Classification: Large Quantity Generator

Date form received by agency:03/01/1996

Site name: SOLAR TURBINES, INC.

Classification: Large Quantity Generator

Date form received by agency:03/31/1994

Site name: SOLAR TURBINES INC

Classification: Large Quantity Generator

Date form received by agency:02/28/1992

Site name: SOLAR TURBINES INC

Classification: Large Quantity Generator

Date form received by agency:05/18/1990

Site name: SOLAR TURBINES INC

Classification: Large Quantity Generator

Date form received by agency:07/31/1980

Site name: SOLAR TURBINES INC KEARNY MESA FAC

Classification: Large Quantity Generator

Biennial Reports:

Last Biennial Reporting Year: 2017

Annual Waste Handled:

Waste code: D001

Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Amount (Lbs): 27138

Waste code: D002

Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

Amount (Lbs): 1174

Waste code: D007

Waste name: CHROMIUM

Amount (Lbs): 1534

Waste code: D008

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Waste name: LEAD
Amount (Lbs): 40

Waste code: D035
Waste name: METHYL ETHYL KETONE
Amount (Lbs): 24986

Waste code: F003
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Amount (Lbs): 21794

Waste code: F005
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Amount (Lbs): 21794

Corrective Action Summary:

Event date: 05/14/1991
Event: LEAD AGENCY DETERMINATION

Event date: 05/14/1991
Event: PA OR CERCLA INSPECTION

Event date: 05/14/1991
Event: NCAPS RANKING/PRIORITY

Event date: 05/14/1991
Event: CA PRIORITIZATION-LOW CA PRIORITY

Event date: 05/10/1999
Event: RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED

Event date: 05/10/1999
Event: HUMAN EXPOSURES CONTROLLED DETERMINATION-MORE INFORMATION NEEDED

Event date: 05/16/2000
Event: RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED

Event date: 05/16/2000
Event: HUMAN EXPOSURES CONTROLLED DETERMINATION-MORE INFORMATION NEEDED

Event date: 05/16/2000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-MORE INFORMATION NEEDED
Event date:	05/16/2000
Event:	RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED
Event date:	01/22/2001
Event:	RFA COMPLETED-ASSESSMENT WAS A RFA
Event date:	01/22/2001
Event:	CA PRIORITIZATION-LOW CA PRIORITY
Event date:	07/18/2005
Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	07/18/2005
Event:	HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	01/24/2007
Event:	INVESTIGATION WORKPLAN APPROVED
Event date:	07/03/2007
Event:	INVESTIGATION REPORT RECEIVED
Event date:	09/14/2007
Event:	RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	09/14/2007
Event:	RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	01/26/2010
Event:	INVESTIGATION COMPLETE
Event date:	03/04/2010
Event:	REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
Event date:	03/04/2010
Event:	REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
Event date:	09/30/2010
Event:	INVESTIGATION SUPPLEMENTAL INFORMATION RECEIVED
Event date:	02/17/2011
Event:	INVESTIGATION SUPPLEMENTAL INFO DEEMED SATISFACT
Event date:	09/04/2014
Event:	INVESTIGATION IMPLEMENTATION BEGUN
Event date:	10/17/2014
Event:	INVESTIGATION SUPPLEMENTAL INFORMATION RECEIVED
Event date:	01/30/2015
Event:	INVESTIGATION SUPPLEMENTAL INFO DEEMED SATISFACT
Event date:	11/18/2015
Event:	CMS REPORT RECEIVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Event date: 09/20/2016
Event: CMS COMPLETE

Facility Has Received Notices of Violations:

Regulation violated: Not reported
Area of violation: Generators - General
Date violation determined: 11/13/2003
Date achieved compliance: 12/17/2003
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 270
Area of violation: TSD - General
Date violation determined: 01/31/1990
Date achieved compliance: 08/15/1990
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 03/16/1990
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 264.70-77.E
Area of violation: TSD - General
Date violation determined: 01/30/1990
Date achieved compliance: 08/15/1990
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 268 ALL
Area of violation: LDR - General
Date violation determined: 01/30/1990
Date achieved compliance: 08/15/1990
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 268.7
Area of violation: LDR - General
Date violation determined: 01/30/1990
Date achieved compliance: 08/15/1990
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 270
Area of violation: TSD - General
Date violation determined: 01/30/1990
Date achieved compliance: 08/15/1990
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 270
Area of violation: TSD - General
Date violation determined: 01/13/1988
Date achieved compliance: 05/02/1988
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 02/16/1988
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 268 ALL
Area of violation: LDR - General
Date violation determined: 01/13/1988
Date achieved compliance: 05/02/1988
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Paid penalty amount: Not reported

Regulation violated: F - 268.7
Area of violation: LDR - General
Date violation determined: 01/13/1988
Date achieved compliance: 05/02/1988
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 264.70-77.E
Area of violation: TSD - General
Date violation determined: 01/13/1988
Date achieved compliance: 05/02/1988
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 01/20/2015
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 11/13/2003
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 12/17/2003
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 04/28/1994
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 04/08/1993
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 03/08/1993
Evaluation: FINANCIAL RECORD REVIEW

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/06/1992
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 01/31/1990
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: TSD - General
Date achieved compliance: 08/15/1990
Evaluation lead agency: State

Evaluation date: 01/30/1990
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 08/15/1990
Evaluation lead agency: State

Evaluation date: 01/30/1990
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: LDR - General
Date achieved compliance: 08/15/1990
Evaluation lead agency: State

Evaluation date: 01/13/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: LDR - General
Date achieved compliance: 05/02/1988
Evaluation lead agency: State

Evaluation date: 01/13/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 05/02/1988
Evaluation lead agency: State

Evaluation date: 12/30/1987
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

RCRA-LQG:

Date form received by agency: 02/24/2016
Facility name: SOLAR TURBINES INCORPORATED - KEARNY MESA
Facility address: 4200 RUFFIN ROAD
SAN DIEGO, CA 92123
EPA ID: CAT000626549
Mailing address: RUFFIN ROAD
SAN DIEGO, CA 92123
Contact: RUTH G SOKLOW
Contact address: PO BOX 58376
SAN DIEGO, CA 92186
Contact country: US

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Contact telephone: 619-544-5394
Contact email: SOKLOW_RUTH_G@SOLARTURBINES.COM
EPA Region: 09
Land type: Private
Classification: TSDF
Description: Handler is engaged in the treatment, storage or disposal of hazardous waste
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name: CATERPILLAR
Owner/operator address: PACIFIC HIGHWAY
SAN DIEGO, CA 92101
Owner/operator country: US
Owner/operator telephone: 619-544-5394
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 07/31/1981
Owner/Op end date: Not reported

Owner/operator name: CATERPILLAR
Owner/operator address: Not reported
Not reported
Owner/operator country: Not reported
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 07/31/1981
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

. Waste code: 122
. Waste name: Alkaline solution without metals (pH > 12.5)

. Waste code: 131
. Waste name: Aqueous solution (2 < pH < 12.5) containing reactive anions (azide, bromate, chlorate, cyanide, fluoride, hypochlorite, nitrite, perchlorate, and sulfide anions)

. Waste code: 141
. Waste name: Off-specification, aged, or surplus inorganics

. Waste code: 181
. Waste name: Other inorganic solid waste

. Waste code: 212
. Waste name: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)

. Waste code: 331
. Waste name: Off-specification, aged, or surplus organics

. Waste code: 352
. Waste name: Other organic solids

. Waste code: 461
. Waste name: Degreasing sludge

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D002
. Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

. Waste code: D007
. Waste name: CHROMIUM

. Waste code: D008

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

- . Waste name: LEAD
- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Historical Generators:

Date form received by agency: 03/01/2014

Site name: SOLAR TURBINES INC - KEARNY MESA

Classification: Large Quantity Generator

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.
- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.
- . Waste code: D007
- . Waste name: CHROMIUM
- . Waste code: D008
- . Waste name: LEAD
- . Waste code: D009
- . Waste name: MERCURY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE

- . Waste code: F002
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2-TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE LISTED IN F001, F004, OR F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- Date form received by agency: 03/02/2012
- Site name: SOLAR TURBINES INCORPORATED - KEARNY MESA
- Classification: Large Quantity Generator

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 09/09/2010

Site name: SOLAR TURBINES INCORPORATED - KEARNY MESA FACILITY

Classification: Large Quantity Generator

- . Waste code: 212
- . Waste name: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)

- . Waste code: 331
- . Waste name: Off-specification, aged, or surplus organics

- . Waste code: 352
- . Waste name: Other organic solids

- . Waste code: 461
- . Waste name: Degreasing sludge

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

- . Waste code: D005
- . Waste name: BARIUM

- . Waste code: D007
- . Waste name: CHROMIUM

- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency:02/26/2008

Site name: SOLAR TURBINES INCORPORATED - KEARNY MESA FACILITY

Classification: Large Quantity Generator

. Waste code: D001
. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D005
. Waste name: BARIUM

. Waste code: D007
. Waste name: CHROMIUM

. Waste code: F003
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005
. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency:01/23/2006

Site name: SOLAR TURBINES - KEARNY MESA FACILITY

Classification: Large Quantity Generator

. Waste code: D001

. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

. Waste code: D005

. Waste name: BARIUM

. Waste code: D007

. Waste name: CHROMIUM

. Waste code: F003

. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

. Waste code: F005

. Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency:02/18/2004

Site name: SOLAR TURBINES - KEARNY MESA FACILITY

Classification: Large Quantity Generator

. Waste code: D001

. Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

- . Waste code: D005
- . Waste name: BARIUM

- . Waste code: D007
- . Waste name: CHROMIUM

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency: 02/22/2002

Site name: SOLAR TURBINES (KEARNY MESA)

Classification: Large Quantity Generator

- . Waste code: 141
- . Waste name: Off-specification, aged, or surplus inorganics

- . Waste code: 181
- . Waste name: Other inorganic solid waste

- . Waste code: 331
- . Waste name: Off-specification, aged, or surplus organics

- . Waste code: 343
- . Waste name: Unspecified organic liquid mixture

- . Waste code: 352
- . Waste name: Other organic solids

- . Waste code: 541
- . Waste name: Photochemicals / photo processing waste

- . Waste code: D001
- . Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSKEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

- . Waste code: D002
- . Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

- . Waste code: D007
- . Waste name: CHROMIUM

- . Waste code: D011
- . Waste name: SILVER

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Date form received by agency:10/12/2000

Site name: SOLAR TURBINES, INC. - KEARNY MESA

Classification: Large Quantity Generator

Date form received by agency:03/04/1999

Site name: SOLAR TURBINES, INC.

Classification: Large Quantity Generator

Date form received by agency:09/01/1996

Site name: SOLAR TURBINES INC KEARNY MESA FAC

Classification: Large Quantity Generator

Date form received by agency:03/01/1996

Site name: SOLAR TURBINES, INC.

Classification: Large Quantity Generator

Date form received by agency:03/31/1994

Site name: SOLAR TURBINES INC

Classification: Large Quantity Generator

Date form received by agency:02/28/1992

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Site name: SOLAR TURBINES INC
Classification: Large Quantity Generator

Date form received by agency: 05/18/1990

Site name: SOLAR TURBINES INC
Classification: Large Quantity Generator

Date form received by agency: 07/31/1980

Site name: SOLAR TURBINES INC KEARNY MESA FAC
Classification: Large Quantity Generator

Biennial Reports:

Last Biennial Reporting Year: 2017

Annual Waste Handled:

Waste code: D001
Waste name: IGNITABLE HAZARDOUS WASTES ARE THOSE WASTES WHICH HAVE A FLASHPOINT OF LESS THAN 140 DEGREES FAHRENHEIT AS DETERMINED BY A PENSLEY-MARTENS CLOSED CUP FLASH POINT TESTER. ANOTHER METHOD OF DETERMINING THE FLASH POINT OF A WASTE IS TO REVIEW THE MATERIAL SAFETY DATA SHEET, WHICH CAN BE OBTAINED FROM THE MANUFACTURER OR DISTRIBUTOR OF THE MATERIAL. LACQUER THINNER IS AN EXAMPLE OF A COMMONLY USED SOLVENT WHICH WOULD BE CONSIDERED AS IGNITABLE HAZARDOUS WASTE.

Amount (Lbs): 27138

Waste code: D002
Waste name: A WASTE WHICH HAS A PH OF LESS THAN 2 OR GREATER THAN 12.5 IS CONSIDERED TO BE A CORROSIVE HAZARDOUS WASTE. SODIUM HYDROXIDE, A CAUSTIC SOLUTION WITH A HIGH PH, IS OFTEN USED BY INDUSTRIES TO CLEAN OR DEGREASE PARTS. HYDROCHLORIC ACID, A SOLUTION WITH A LOW PH, IS USED BY MANY INDUSTRIES TO CLEAN METAL PARTS PRIOR TO PAINTING. WHEN THESE CAUSTIC OR ACID SOLUTIONS BECOME CONTAMINATED AND MUST BE DISPOSED, THE WASTE WOULD BE A CORROSIVE HAZARDOUS WASTE.

Amount (Lbs): 1174

Waste code: D007
Waste name: CHROMIUM
Amount (Lbs): 1534

Waste code: D008
Waste name: LEAD
Amount (Lbs): 40

Waste code: D035
Waste name: METHYL ETHYL KETONE
Amount (Lbs): 24986

Waste code: F003
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NON-HALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS, AND, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005, AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Amount (Lbs): MIXTURES.
21794

Waste code: F005
Waste name: THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NON-HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Amount (Lbs): 21794

Corrective Action Summary:

Event date: 05/14/1991
Event: LEAD AGENCY DETERMINATION

Event date: 05/14/1991
Event: PA OR CERCLA INSPECTION

Event date: 05/14/1991
Event: NCAPS RANKING/PRIORITY

Event date: 05/14/1991
Event: CA PRIORITIZATION-LOW CA PRIORITY

Event date: 05/10/1999
Event: RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED

Event date: 05/10/1999
Event: HUMAN EXPOSURES CONTROLLED DETERMINATION-MORE INFORMATION NEEDED

Event date: 05/16/2000
Event: RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED

Event date: 05/16/2000
Event: HUMAN EXPOSURES CONTROLLED DETERMINATION-MORE INFORMATION NEEDED

Event date: 05/16/2000
Event: HUMAN EXPOSURES CONTROLLED DETERMINATION-MORE INFORMATION NEEDED

Event date: 05/16/2000
Event: RELEASE TO GW CONTROLLED DETERMINATION-MORE INFORMATION NEEDED

Event date: 01/22/2001
Event: RFA COMPLETED-ASSESSMENT WAS A RFA

Event date: 01/22/2001
Event: CA PRIORITIZATION-LOW CA PRIORITY

Event date: 07/18/2005
Event: HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE

Event date: 07/18/2005
Event: HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

DATE

Event date:	01/24/2007
Event:	INVESTIGATION WORKPLAN APPROVED
Event date:	07/03/2007
Event:	INVESTIGATION REPORT RECEIVED
Event date:	09/14/2007
Event:	RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	09/14/2007
Event:	RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Event date:	01/26/2010
Event:	INVESTIGATION COMPLETE
Event date:	03/04/2010
Event:	REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
Event date:	03/04/2010
Event:	REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
Event date:	09/30/2010
Event:	INVESTIGATION SUPPLEMENTAL INFORMATION RECEIVED
Event date:	02/17/2011
Event:	INVESTIGATION SUPPLEMENTAL INFO DEEMED SATISFACT
Event date:	09/04/2014
Event:	INVESTIGATION IMPLEMENTATION BEGUN
Event date:	10/17/2014
Event:	INVESTIGATION SUPPLEMENTAL INFORMATION RECEIVED
Event date:	01/30/2015
Event:	INVESTIGATION SUPPLEMENTAL INFO DEEMED SATISFACT
Event date:	11/18/2015
Event:	CMS REPORT RECEIVED
Event date:	09/20/2016
Event:	CMS COMPLETE

Facility Has Received Notices of Violations:

Regulation violated:	Not reported
Area of violation:	Generators - General
Date violation determined:	11/13/2003
Date achieved compliance:	12/17/2003
Violation lead agency:	State
Enforcement action:	Not reported
Enforcement action date:	Not reported
Enf. disposition status:	Not reported
Enf. disp. status date:	Not reported
Enforcement lead agency:	Not reported
Proposed penalty amount:	Not reported
Final penalty amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Paid penalty amount: Not reported

Regulation violated: FR - 270
Area of violation: TSD - General
Date violation determined: 01/31/1990
Date achieved compliance: 08/15/1990
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 03/16/1990
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 264.70-77.E
Area of violation: TSD - General
Date violation determined: 01/30/1990
Date achieved compliance: 08/15/1990
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 268 ALL
Area of violation: LDR - General
Date violation determined: 01/30/1990
Date achieved compliance: 08/15/1990
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 268.7
Area of violation: LDR - General
Date violation determined: 01/30/1990
Date achieved compliance: 08/15/1990
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Regulation violated: F - 270
Area of violation: TSD - General
Date violation determined: 01/30/1990
Date achieved compliance: 08/15/1990
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: FR - 270
Area of violation: TSD - General
Date violation determined: 01/13/1988
Date achieved compliance: 05/02/1988
Violation lead agency: State
Enforcement action: WRITTEN INFORMAL
Enforcement action date: 02/16/1988
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: State
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 268 ALL
Area of violation: LDR - General
Date violation determined: 01/13/1988
Date achieved compliance: 05/02/1988
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 268.7
Area of violation: LDR - General
Date violation determined: 01/13/1988
Date achieved compliance: 05/02/1988
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Regulation violated: F - 264.70-77.E

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Area of violation: TSD - General
Date violation determined: 01/13/1988
Date achieved compliance: 05/02/1988
Violation lead agency: State
Enforcement action: Not reported
Enforcement action date: Not reported
Enf. disposition status: Not reported
Enf. disp. status date: Not reported
Enforcement lead agency: Not reported
Proposed penalty amount: Not reported
Final penalty amount: Not reported
Paid penalty amount: Not reported

Evaluation Action Summary:

Evaluation date: 01/20/2015
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 11/13/2003
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Generators - General
Date achieved compliance: 12/17/2003
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 04/28/1994
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 04/08/1993
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 03/08/1993
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

Evaluation date: 02/06/1992
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State Contractor/Grantee

Evaluation date: 01/31/1990
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: TSD - General
Date achieved compliance: 08/15/1990
Evaluation lead agency: State

Evaluation date: 01/30/1990

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 08/15/1990
Evaluation lead agency: State

Evaluation date: 01/30/1990
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: LDR - General
Date achieved compliance: 08/15/1990
Evaluation lead agency: State

Evaluation date: 01/13/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: LDR - General
Date achieved compliance: 05/02/1988
Evaluation lead agency: State

Evaluation date: 01/13/1988
Evaluation: COMPLIANCE EVALUATION INSPECTION ON-SITE
Area of violation: TSD - General
Date achieved compliance: 05/02/1988
Evaluation lead agency: State

Evaluation date: 12/30/1987
Evaluation: FINANCIAL RECORD REVIEW
Area of violation: Not reported
Date achieved compliance: Not reported
Evaluation lead agency: State

US FIN ASSUR:

EPA ID: CAT000626549
County: Not reported
Mechanism type: C
Mechanism Type Description: CORPORATE GUARANTEE
Cost estimate: 99
Face value: 8000000
Effective date: 2009-03-26 00:00:00
Provider: CATERPILLAR INC.
EPA region: 9

EPA ID: CAT000626549
County: Not reported
Mechanism type: C
Mechanism Type Description: CORPORATE GUARANTEE
Cost estimate: 8000000
Face value: 8000000
Effective date: 2009-03-26 00:00:00
Provider: CATERPILLAR INC.
EPA region: 9

2020 COR ACTION:

EPA ID: CAT000626549
Region: 9
Action: Remedy Construction

HAZNET:

Facility Name: SOLAR TURBINES INC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

envid: 1015732938
Year: 2017
GEPAID: CAT000626549
Contact: COLLEEN KLAIBER
Telephone: 6195445126
Mailing Name: Not reported
Mailing Address: PO BOX 85376 MZ T-2
Mailing City,St,Zip: SAN DIEGO, CA 921865376
Gen County: San Diego
TSD EPA ID: ARD981057870
TSD County: 99
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Fuel Blending Prior To Energy Recovery At Another Site
Tons: 1.605
Cat Decode: Not reported
Method Decode: Fuel Blending Prior To Energy Recovery At Another Site
Facility County: San Diego

envid: 1015732938
Year: 2017
GEPAID: CAT000626549
Contact: COLLEEN KLAIBER
Telephone: 6195445126
Mailing Name: Not reported
Mailing Address: PO BOX 85376 MZ T-2
Mailing City,St,Zip: SAN DIEGO, CA 921865376
Gen County: San Diego
TSD EPA ID: ARD981057870
TSD County: 99
Waste Category: Other organic solids
Disposal Method: Fuel Blending Prior To Energy Recovery At Another Site
Tons: 0.2785
Cat Decode: Not reported
Method Decode: Fuel Blending Prior To Energy Recovery At Another Site
Facility County: San Diego

envid: 1015732938
Year: 2017
GEPAID: CAT000626549
Contact: COLLEEN KLAIBER
Telephone: 6195445126
Mailing Name: Not reported
Mailing Address: PO BOX 85376 MZ T-2
Mailing City,St,Zip: SAN DIEGO, CA 921865376
Gen County: San Diego
TSD EPA ID: CAD044429835
TSD County: Los Angeles
Waste Category: Off-specification, aged or surplus organics
Disposal Method: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Tons: 0.694
Cat Decode: Off-specification, aged or surplus organics
Method Decode: Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery (H010-H129) Or (H131-H135)
Facility County: San Diego

envid: 1015732938

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Year: 2017
GEPAID: CAT000626549
Contact: COLLEEN KLAIBER
Telephone: 6195445126
Mailing Name: Not reported
Mailing Address: PO BOX 85376 MZ T-2
Mailing City,St,Zip: SAN DIEGO, CA 921865376
Gen County: San Diego
TSD EPA ID: CAD982444481
TSD County: San Bernardino
Waste Category: Other inorganic solid waste
Disposal Method: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Tons: 0.383
Cat Decode: Other inorganic solid waste
Method Decode: Other Recovery Of Reclamation For Reuse Including Acid Regeneration,
Organics Recovery Ect
Facility County: San Diego

envid: 1015732938
Year: 2017
GEPAID: CAT000626549
Contact: COLLEEN KLAIBER
Telephone: 6195445126
Mailing Name: Not reported
Mailing Address: PO BOX 85376 MZ T-2
Mailing City,St,Zip: SAN DIEGO, CA 921865376
Gen County: San Diego
TSD EPA ID: ARD981057870
TSD County: 99
Waste Category: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)
Disposal Method: Fuel Blending Prior To Energy Recovery At Another Site
Tons: 0.195
Cat Decode: Not reported
Method Decode: Fuel Blending Prior To Energy Recovery At Another Site
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
613 additional CA_HAZNET: record(s) in the EDR Site Report.

NY MANIFEST:

Country: USA
EPA ID: CAT000626549
Facility Status: Not reported
Location Address 1: HAH360087884200 PUFFIN RD
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: SAN DIEGO
Location State: CA
Location Zip: 92123
Location Zip 4: Not reported

NY MANIFEST:

EPAID: CAT000626549
Mailing Name: SOLAR TURBINES
Mailing Contact: RICHARD L BARCH

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOLAR TURBINES INCORPORATED - KEARNY MESA (Continued)

1015732938

Mailing Address 1: 4200 PUFFIN RD
Mailing Address 2: Not reported
Mailing City: SAN DIEGO
Mailing State: CA
Mailing Zip: 92123
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 6196946381

NY MANIFEST:

Document ID: NYB1156815
Manifest Status: K
seq: Not reported
Year: 1993
Trans1 State ID: 409403409
Trans2 State ID: Not reported
Generator Ship Date: 12/15/1993
Trans1 Recv Date: 12/15/1993
Trans2 Recv Date: / /
TSD Site Recv Date: 01/05/1994
Part A Recv Date: / /
Part B Recv Date: 01/18/1994
Generator EPA ID: CAT000626549
Trans1 EPA ID: MOD095038998
Trans2 EPA ID: Not reported
TSDF ID 1: NYD048148175
TSDF ID 2: Not reported
Manifest Tracking Number: Not reported
Import Indicator: Not reported
Export Indicator: Not reported
Discr Quantity Indicator: Not reported
Discr Type Indicator: Not reported
Discr Residue Indicator: Not reported
Discr Partial Reject Indicator: Not reported
Discr Full Reject Indicator: Not reported
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported
Waste Code: D009 - MERCURY 0.2 MG/L TCLP
Waste Code: Not reported
Waste Code: Not reported
Waste Code: Not reported
Waste Code: Not reported
Waste Code: Not reported
Quantity: 00030
Units: P - Pounds
Number of Containers: 002
Container Type: DM - Metal drums, barrels
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 100

[Click this hyperlink](#) while viewing on your computer to access
-1 additional NY MANIFEST: record(s) in the EDR Site Report.

Count: 0 records

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
NO SITES FOUND					

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 12/12/2018	Source: EPA
Date Data Arrived at EDR: 12/28/2018	Telephone: N/A
Date Made Active in Reports: 01/11/2019	Last EDR Contact: 02/15/2019
Number of Days to Update: 14	Next Scheduled EDR Contact: 04/15/2019
	Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 12/12/2018	Source: EPA
Date Data Arrived at EDR: 12/28/2018	Telephone: N/A
Date Made Active in Reports: 01/11/2019	Last EDR Contact: 02/15/2019
Number of Days to Update: 14	Next Scheduled EDR Contact: 04/15/2019
	Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

Date of Government Version: 10/15/1991	Source: EPA
Date Data Arrived at EDR: 02/02/1994	Telephone: 202-564-4267
Date Made Active in Reports: 03/30/1994	Last EDR Contact: 08/15/2011
Number of Days to Update: 56	Next Scheduled EDR Contact: 11/28/2011
	Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 12/12/2018	Source: EPA
Date Data Arrived at EDR: 12/28/2018	Telephone: N/A
Date Made Active in Reports: 01/11/2019	Last EDR Contact: 02/15/2019
Number of Days to Update: 14	Next Scheduled EDR Contact: 04/15/2019
	Data Release Frequency: Quarterly

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 11/07/2016	Source: Environmental Protection Agency
Date Data Arrived at EDR: 01/05/2017	Telephone: 703-603-8704
Date Made Active in Reports: 04/07/2017	Last EDR Contact: 01/04/2019
Number of Days to Update: 92	Next Scheduled EDR Contact: 04/15/2019
	Data Release Frequency: Varies

SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly known as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 12/12/2018	Source: EPA
Date Data Arrived at EDR: 12/28/2018	Telephone: 800-424-9346
Date Made Active in Reports: 01/11/2019	Last EDR Contact: 02/15/2019
Number of Days to Update: 14	Next Scheduled EDR Contact: 04/29/2019
	Data Release Frequency: Quarterly

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 12/13/2018	Source: EPA
Date Data Arrived at EDR: 12/28/2018	Telephone: 800-424-9346
Date Made Active in Reports: 01/11/2019	Last EDR Contact: 02/15/2019
Number of Days to Update: 14	Next Scheduled EDR Contact: 04/29/2019
	Data Release Frequency: Quarterly

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 03/01/2018	Source: EPA
Date Data Arrived at EDR: 03/28/2018	Telephone: 800-424-9346
Date Made Active in Reports: 06/22/2018	Last EDR Contact: 12/03/2018
Number of Days to Update: 86	Next Scheduled EDR Contact: 04/08/2019
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 03/01/2018	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/28/2018	Telephone: (415) 495-8895
Date Made Active in Reports: 06/22/2018	Last EDR Contact: 12/03/2018
Number of Days to Update: 86	Next Scheduled EDR Contact: 04/08/2019
	Data Release Frequency: Quarterly

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 03/01/2018	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/28/2018	Telephone: (415) 495-8895
Date Made Active in Reports: 06/22/2018	Last EDR Contact: 12/03/2018
Number of Days to Update: 86	Next Scheduled EDR Contact: 04/08/2019
	Data Release Frequency: Quarterly

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 03/01/2018	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/28/2018	Telephone: (415) 495-8895
Date Made Active in Reports: 06/22/2018	Last EDR Contact: 12/03/2018
Number of Days to Update: 86	Next Scheduled EDR Contact: 04/08/2019
	Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 03/01/2018	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/28/2018	Telephone: (415) 495-8895
Date Made Active in Reports: 06/22/2018	Last EDR Contact: 12/03/2018
Number of Days to Update: 86	Next Scheduled EDR Contact: 04/08/2019
	Data Release Frequency: Quarterly

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 10/17/2018	Source: Department of the Navy
Date Data Arrived at EDR: 10/25/2018	Telephone: 843-820-7326
Date Made Active in Reports: 12/07/2018	Last EDR Contact: 02/07/2019
Number of Days to Update: 43	Next Scheduled EDR Contact: 05/27/2019
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 07/31/2018	Source: Environmental Protection Agency
Date Data Arrived at EDR: 08/28/2018	Telephone: 703-603-0695
Date Made Active in Reports: 09/14/2018	Last EDR Contact: 02/04/2019
Number of Days to Update: 17	Next Scheduled EDR Contact: 06/10/2019
	Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 07/31/2018	Source: Environmental Protection Agency
Date Data Arrived at EDR: 08/28/2018	Telephone: 703-603-0695
Date Made Active in Reports: 09/14/2018	Last EDR Contact: 02/04/2019
Number of Days to Update: 17	Next Scheduled EDR Contact: 06/10/2019
	Data Release Frequency: Varies

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 09/24/2018	Source: National Response Center, United States Coast Guard
Date Data Arrived at EDR: 09/25/2018	Telephone: 202-267-2180
Date Made Active in Reports: 11/09/2018	Last EDR Contact: 02/08/2019
Number of Days to Update: 45	Next Scheduled EDR Contact: 04/08/2019
	Data Release Frequency: Quarterly

STANDARD ENVIRONMENTAL RECORDS

State- and tribal - equivalent NPL

CA RESPONSE: State Response Sites

Identifies confirmed release sites where DTSC is involved in remediation, either in a lead or oversight capacity. These confirmed release sites are generally high-priority and high potential risk.

Date of Government Version: 01/28/2019	Source: Department of Toxic Substances Control
Date Data Arrived at EDR: 01/29/2019	Telephone: 916-323-3400
Date Made Active in Reports: 03/05/2019	Last EDR Contact: 01/29/2019
Number of Days to Update: 35	Next Scheduled EDR Contact: 05/11/2019
	Data Release Frequency: Quarterly

State- and tribal - equivalent CERCLIS

CA ENVIROSTOR: EnviroStor Database

The Department of Toxic Substances Control's (DTSC's) Site Mitigation and Brownfields Reuse Program's (SMBRP's) EnviroStor database identifies sites that have known contamination or sites for which there may be reasons to investigate further. The database includes the following site types: Federal Superfund sites (National Priorities List (NPL)); State Response, including Military Facilities and State Superfund; Voluntary Cleanup; and School sites. EnviroStor provides similar information to the information that was available in CalSites, and provides additional site information, including, but not limited to, identification of formerly-contaminated properties that have been released for reuse, properties where environmental deed restrictions have been recorded to prevent inappropriate land uses, and risk characterization information that is used to assess potential impacts to public health and the environment at contaminated sites.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 01/28/2019
Date Data Arrived at EDR: 01/29/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 35

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 01/29/2019
Next Scheduled EDR Contact: 05/11/2019
Data Release Frequency: Quarterly

State and tribal landfill and/or solid waste disposal site lists

CA SWF/LF (SWIS): Solid Waste Information System

Active, Closed and Inactive Landfills. SWF/LF records typically contain an inventory of solid waste disposal facilities or landfills. These may be active or inactive facilities or open dumps that failed to meet RCRA Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 02/11/2019
Date Data Arrived at EDR: 02/12/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 21

Source: Department of Resources Recycling and Recovery
Telephone: 916-341-6320
Last EDR Contact: 02/12/2019
Next Scheduled EDR Contact: 05/27/2019
Data Release Frequency: Quarterly

State and tribal leaking storage tank lists

CA LUST REG 3: Leaking Underground Storage Tank Database

Leaking Underground Storage Tank locations. Monterey, San Benito, San Luis Obispo, Santa Barbara, Santa Cruz counties.

Date of Government Version: 05/19/2003
Date Data Arrived at EDR: 05/19/2003
Date Made Active in Reports: 06/02/2003
Number of Days to Update: 14

Source: California Regional Water Quality Control Board Central Coast Region (3)
Telephone: 805-542-4786
Last EDR Contact: 07/18/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: No Update Planned

CA LUST REG 8: Leaking Underground Storage Tanks

California Regional Water Quality Control Board Santa Ana Region (8). For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 02/14/2005
Date Data Arrived at EDR: 02/15/2005
Date Made Active in Reports: 03/28/2005
Number of Days to Update: 41

Source: California Regional Water Quality Control Board Santa Ana Region (8)
Telephone: 909-782-4496
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: Varies

CA LUST REG 7: Leaking Underground Storage Tank Case Listing

Leaking Underground Storage Tank locations. Imperial, Riverside, San Diego, Santa Barbara counties.

Date of Government Version: 02/26/2004
Date Data Arrived at EDR: 02/26/2004
Date Made Active in Reports: 03/24/2004
Number of Days to Update: 27

Source: California Regional Water Quality Control Board Colorado River Basin Region (7)
Telephone: 760-776-8943
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: No Update Planned

CA LUST REG 6V: Leaking Underground Storage Tank Case Listing

Leaking Underground Storage Tank locations. Inyo, Kern, Los Angeles, Mono, San Bernardino counties.

Date of Government Version: 06/07/2005
Date Data Arrived at EDR: 06/07/2005
Date Made Active in Reports: 06/29/2005
Number of Days to Update: 22

Source: California Regional Water Quality Control Board Victorville Branch Office (6)
Telephone: 760-241-7365
Last EDR Contact: 09/12/2011
Next Scheduled EDR Contact: 12/26/2011
Data Release Frequency: No Update Planned

CA LUST REG 6L: Leaking Underground Storage Tank Case Listing

For more current information, please refer to the State Water Resources Control Board's LUST database.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 09/09/2003
Date Data Arrived at EDR: 09/10/2003
Date Made Active in Reports: 10/07/2003
Number of Days to Update: 27

Source: California Regional Water Quality Control Board Lahontan Region (6)
Telephone: 530-542-5572
Last EDR Contact: 09/12/2011
Next Scheduled EDR Contact: 12/26/2011
Data Release Frequency: No Update Planned

CA LUST REG 5: Leaking Underground Storage Tank Database

Leaking Underground Storage Tank locations. Alameda, Alpine, Amador, Butte, Colusa, Contra Costa, Calveras, El Dorado, Fresno, Glenn, Kern, Kings, Lake, Lassen, Madera, Mariposa, Merced, Modoc, Napa, Nevada, Placer, Plumas, Sacramento, San Joaquin, Shasta, Solano, Stanislaus, Sutter, Tehama, Tulare, Tuolumne, Yolo, Yuba counties.

Date of Government Version: 07/01/2008
Date Data Arrived at EDR: 07/22/2008
Date Made Active in Reports: 07/31/2008
Number of Days to Update: 9

Source: California Regional Water Quality Control Board Central Valley Region (5)
Telephone: 916-464-4834
Last EDR Contact: 07/01/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: No Update Planned

CA LUST REG 4: Underground Storage Tank Leak List

Los Angeles, Ventura counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 09/07/2004
Date Data Arrived at EDR: 09/07/2004
Date Made Active in Reports: 10/12/2004
Number of Days to Update: 35

Source: California Regional Water Quality Control Board Los Angeles Region (4)
Telephone: 213-576-6710
Last EDR Contact: 09/06/2011
Next Scheduled EDR Contact: 12/19/2011
Data Release Frequency: No Update Planned

CA LUST REG 9: Leaking Underground Storage Tank Report

Orange, Riverside, San Diego counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 03/01/2001
Date Data Arrived at EDR: 04/23/2001
Date Made Active in Reports: 05/21/2001
Number of Days to Update: 28

Source: California Regional Water Quality Control Board San Diego Region (9)
Telephone: 858-637-5595
Last EDR Contact: 09/26/2011
Next Scheduled EDR Contact: 01/09/2012
Data Release Frequency: No Update Planned

CA LUST REG 2: Fuel Leak List

Leaking Underground Storage Tank locations. Alameda, Contra Costa, Marin, Napa, San Francisco, San Mateo, Santa Clara, Solano, Sonoma counties.

Date of Government Version: 09/30/2004
Date Data Arrived at EDR: 10/20/2004
Date Made Active in Reports: 11/19/2004
Number of Days to Update: 30

Source: California Regional Water Quality Control Board San Francisco Bay Region (2)
Telephone: 510-622-2433
Last EDR Contact: 09/19/2011
Next Scheduled EDR Contact: 01/02/2012
Data Release Frequency: Quarterly

CA LUST REG 1: Active Toxic Site Investigation

Del Norte, Humboldt, Lake, Mendocino, Modoc, Siskiyou, Sonoma, Trinity counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 02/01/2001
Date Data Arrived at EDR: 02/28/2001
Date Made Active in Reports: 03/29/2001
Number of Days to Update: 29

Source: California Regional Water Quality Control Board North Coast (1)
Telephone: 707-570-3769
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: No Update Planned

CA LUST: Leaking Underground Fuel Tank Report (GEOTRACKER)

Leaking Underground Storage Tank (LUST) Sites included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/11/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 35

Source: State Water Resources Control Board
Telephone: see region list
Last EDR Contact: 12/11/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Quarterly

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/13/2018
Date Data Arrived at EDR: 05/18/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 63

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 01/25/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/13/2018
Date Data Arrived at EDR: 05/18/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 63

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 01/25/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/13/2018
Date Data Arrived at EDR: 05/18/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 63

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 01/25/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/13/2018
Date Data Arrived at EDR: 05/18/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 63

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 01/25/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/13/2018
Date Data Arrived at EDR: 05/18/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 63

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 01/25/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/13/2018
Date Data Arrived at EDR: 05/18/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 63

Source: EPA Region 1
Telephone: 617-918-1313
Last EDR Contact: 01/25/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land

A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/13/2018	Source: EPA Region 1
Date Data Arrived at EDR: 05/18/2018	Telephone: 617-918-1313
Date Made Active in Reports: 07/20/2018	Last EDR Contact: 01/25/2019
Number of Days to Update: 63	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land

A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/13/2018	Source: EPA Region 1
Date Data Arrived at EDR: 05/18/2018	Telephone: 617-918-1313
Date Made Active in Reports: 07/20/2018	Last EDR Contact: 01/25/2019
Number of Days to Update: 63	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Varies

CA CPS-SLIC: Statewide SLIC Cases (GEOTRACKER)

Cleanup Program Sites (CPS; also known as Site Cleanups [SC] and formerly known as Spills, Leaks, Investigations, and Cleanups [SLIC] sites) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 12/10/2018	Source: State Water Resources Control Board
Date Data Arrived at EDR: 12/11/2018	Telephone: 866-480-1028
Date Made Active in Reports: 01/15/2019	Last EDR Contact: 12/12/2018
Number of Days to Update: 35	Next Scheduled EDR Contact: 03/25/2019
	Data Release Frequency: Varies

CA SLIC REG 1: Active Toxic Site Investigations

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 04/03/2003	Source: California Regional Water Quality Control Board, North Coast Region (1)
Date Data Arrived at EDR: 04/07/2003	Telephone: 707-576-2220
Date Made Active in Reports: 04/25/2003	Last EDR Contact: 08/01/2011
Number of Days to Update: 18	Next Scheduled EDR Contact: 11/14/2011
	Data Release Frequency: No Update Planned

CA SLIC REG 2: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 09/30/2004	Source: Regional Water Quality Control Board San Francisco Bay Region (2)
Date Data Arrived at EDR: 10/20/2004	Telephone: 510-286-0457
Date Made Active in Reports: 11/19/2004	Last EDR Contact: 09/19/2011
Number of Days to Update: 30	Next Scheduled EDR Contact: 01/02/2012
	Data Release Frequency: Quarterly

CA SLIC REG 3: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 05/18/2006	Source: California Regional Water Quality Control Board Central Coast Region (3)
Date Data Arrived at EDR: 05/18/2006	Telephone: 805-549-3147
Date Made Active in Reports: 06/15/2006	Last EDR Contact: 07/18/2011
Number of Days to Update: 28	Next Scheduled EDR Contact: 10/31/2011
	Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CA SLIC REG 4: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 11/17/2004
Date Data Arrived at EDR: 11/18/2004
Date Made Active in Reports: 01/04/2005
Number of Days to Update: 47

Source: Region Water Quality Control Board Los Angeles Region (4)
Telephone: 213-576-6600
Last EDR Contact: 07/01/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: Varies

CA SLIC REG 5: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 04/01/2005
Date Data Arrived at EDR: 04/05/2005
Date Made Active in Reports: 04/21/2005
Number of Days to Update: 16

Source: Regional Water Quality Control Board Central Valley Region (5)
Telephone: 916-464-3291
Last EDR Contact: 09/12/2011
Next Scheduled EDR Contact: 12/26/2011
Data Release Frequency: Semi-Annually

CA SLIC REG 6V: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 05/24/2005
Date Data Arrived at EDR: 05/25/2005
Date Made Active in Reports: 06/16/2005
Number of Days to Update: 22

Source: Regional Water Quality Control Board, Victorville Branch
Telephone: 619-241-6583
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: Semi-Annually

CA SLIC REG 6L: SLIC Sites

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 09/07/2004
Date Data Arrived at EDR: 09/07/2004
Date Made Active in Reports: 10/12/2004
Number of Days to Update: 35

Source: California Regional Water Quality Control Board, Lahontan Region
Telephone: 530-542-5574
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

CA SLIC REG 7: SLIC List

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 11/24/2004
Date Data Arrived at EDR: 11/29/2004
Date Made Active in Reports: 01/04/2005
Number of Days to Update: 36

Source: California Regional Quality Control Board, Colorado River Basin Region
Telephone: 760-346-7491
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: No Update Planned

CA SLIC REG 8: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 04/03/2008
Date Data Arrived at EDR: 04/03/2008
Date Made Active in Reports: 04/14/2008
Number of Days to Update: 11

Source: California Region Water Quality Control Board Santa Ana Region (8)
Telephone: 951-782-3298
Last EDR Contact: 09/12/2011
Next Scheduled EDR Contact: 12/26/2011
Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CA SLIC REG 9: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 09/10/2007
Date Data Arrived at EDR: 09/11/2007
Date Made Active in Reports: 09/28/2007
Number of Days to Update: 17

Source: California Regional Water Quality Control Board San Diego Region (9)
Telephone: 858-467-2980
Last EDR Contact: 08/08/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: Annually

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 05/15/2017
Date Data Arrived at EDR: 05/30/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 136

Source: FEMA
Telephone: 202-646-5797
Last EDR Contact: 01/08/2019
Next Scheduled EDR Contact: 04/22/2019
Data Release Frequency: Varies

State and tribal registered storage tank lists

CA UST CLOSURE: Proposed Closure of Underground Storage Tank (UST) Cases

UST cases that are being considered for closure by either the State Water Resources Control Board or the Executive Director have been posted for a 60-day public comment period. UST Case Closures being proposed for consideration by the State Water Resources Control Board. These are primarily UST cases that meet closure criteria under the decisional framework in State Water Board Resolution No. 92-49 and other Board orders. UST Case Closures proposed for consideration by the Executive Director pursuant to State Water Board Resolution No. 2012-0061. These are cases that meet the criteria of the Low-Threat UST Case Closure Policy. UST Case Closure Review Denials and Approved Orders.

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/12/2018
Date Made Active in Reports: 01/16/2019
Number of Days to Update: 35

Source: State Water Resources Control Board
Telephone: 916-327-7844
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Varies

CA UST: Active UST Facilities

Active UST facilities gathered from the local regulatory agencies

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/11/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 35

Source: SWRCB
Telephone: 916-341-5851
Last EDR Contact: 12/11/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Semi-Annually

CA MILITARY UST SITES: Military UST Sites (GEOTRACKER)

Military ust sites

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/11/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 35

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Varies

CA AST: Aboveground Petroleum Storage Tank Facilities

A listing of aboveground storage tank petroleum storage tank locations.

Date of Government Version: 07/06/2016
Date Data Arrived at EDR: 07/12/2016
Date Made Active in Reports: 09/19/2016
Number of Days to Update: 69

Source: California Environmental Protection Agency
Telephone: 916-327-5092
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 04/01/2019
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN UST R1: Underground Storage Tanks on Indian Land

Date of Government Version: 04/06/2016	Source: N/A
Date Data Arrived at EDR: 03/02/2017	Telephone: N/A
Date Made Active in Reports: 04/07/2017	Last EDR Contact: 03/05/2019
Number of Days to Update: 36	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

Date of Government Version: 04/06/2016	Source: N/A
Date Data Arrived at EDR: 03/02/2017	Telephone: N/A
Date Made Active in Reports: 04/07/2017	Last EDR Contact: 03/05/2019
Number of Days to Update: 36	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Varies

INDIAN UST R5: Underground Storage Tanks on Indian Land

Date of Government Version: 04/06/2016	Source: N/A
Date Data Arrived at EDR: 03/02/2017	Telephone: N/A
Date Made Active in Reports: 04/07/2017	Last EDR Contact: 03/05/2019
Number of Days to Update: 36	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

Date of Government Version: 04/06/2016	Source: N/A
Date Data Arrived at EDR: 03/02/2017	Telephone: N/A
Date Made Active in Reports: 04/07/2017	Last EDR Contact: 03/05/2019
Number of Days to Update: 36	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

Date of Government Version: 04/06/2016	Source: N/A
Date Data Arrived at EDR: 03/02/2017	Telephone: N/A
Date Made Active in Reports: 04/07/2017	Last EDR Contact: 03/05/2019
Number of Days to Update: 36	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

Date of Government Version: 04/06/2016	Source: N/A
Date Data Arrived at EDR: 03/02/2017	Telephone: N/A
Date Made Active in Reports: 04/07/2017	Last EDR Contact: 03/05/2019
Number of Days to Update: 36	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land

Date of Government Version: 04/06/2016	Source: N/A
Date Data Arrived at EDR: 03/02/2017	Telephone: N/A
Date Made Active in Reports: 04/07/2017	Last EDR Contact: 03/05/2019
Number of Days to Update: 36	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

Date of Government Version: 04/06/2016	Source: N/A
Date Data Arrived at EDR: 03/02/2017	Telephone: N/A
Date Made Active in Reports: 04/07/2017	Last EDR Contact: 03/05/2019
Number of Days to Update: 36	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27

Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 04/20/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

State and tribal voluntary cleanup sites

CA VCP: Voluntary Cleanup Program Properties

Contains low threat level properties with either confirmed or unconfirmed releases and the project proponents have request that DTSC oversee investigation and/or cleanup activities and have agreed to provide coverage for DTSC's costs.

Date of Government Version: 01/28/2019
Date Data Arrived at EDR: 01/29/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 35

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 01/29/2019
Next Scheduled EDR Contact: 05/11/2019
Data Release Frequency: Quarterly

INDIAN VCP R7: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27

Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 04/20/2009
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

State and tribal Brownfields sites

CA BROWNFIELDS: Considered Brownfields Sites Listing

A listing of sites the SWRCB considers to be Brownfields since these are sites have come to them through the MOA Process.

Date of Government Version: 12/20/2018
Date Data Arrived at EDR: 12/21/2018
Date Made Active in Reports: 02/28/2019
Number of Days to Update: 69

Source: State Water Resources Control Board
Telephone: 916-323-7905
Last EDR Contact: 12/21/2018
Next Scheduled EDR Contact: 04/08/2019
Data Release Frequency: Quarterly

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 12/17/2018
Date Data Arrived at EDR: 12/18/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 24

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 12/18/2018
Next Scheduled EDR Contact: 04/01/2019
Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

CA WMUDS/SWAT: Waste Management Unit Database

Waste Management Unit Database System. WMUDS is used by the State Water Resources Control Board staff and the Regional Water Quality Control Boards for program tracking and inventory of waste management units. WMUDS is composed of the following databases: Facility Information, Scheduled Inspections Information, Waste Management Unit Information, SWAT Program Information, SWAT Report Summary Information, SWAT Report Summary Data, Chapter 15 (formerly Subchapter 15) Information, Chapter 15 Monitoring Parameters, TPCA Program Information, RCRA Program Information, Closure Information, and Interested Parties Information.

Date of Government Version: 04/01/2000
Date Data Arrived at EDR: 04/10/2000
Date Made Active in Reports: 05/10/2000
Number of Days to Update: 30

Source: State Water Resources Control Board
Telephone: 916-227-4448
Last EDR Contact: 01/28/2019
Next Scheduled EDR Contact: 05/11/2019
Data Release Frequency: No Update Planned

CA SWRCY: Recycler Database

A listing of recycling facilities in California.

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/12/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 34

Source: Department of Conservation
Telephone: 916-323-3836
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Quarterly

CA HAULERS: Registered Waste Tire Haulers Listing

A listing of registered waste tire haulers.

Date of Government Version: 09/26/2018
Date Data Arrived at EDR: 09/28/2018
Date Made Active in Reports: 11/01/2018
Number of Days to Update: 34

Source: Integrated Waste Management Board
Telephone: 916-341-6422
Last EDR Contact: 02/12/2019
Next Scheduled EDR Contact: 05/27/2019
Data Release Frequency: Varies

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 01/29/2019
Next Scheduled EDR Contact: 05/13/2019
Data Release Frequency: Varies

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137

Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 01/17/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: No Update Planned

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

IHS OPEN DUMPS: Open Dumps on Indian Land

A listing of all open dumps located on Indian Land in the United States.

Date of Government Version: 04/01/2014
Date Data Arrived at EDR: 08/06/2014
Date Made Active in Reports: 01/29/2015
Number of Days to Update: 176

Source: Department of Health & Human Services, Indian Health Service
Telephone: 301-443-1452
Last EDR Contact: 02/01/2019
Next Scheduled EDR Contact: 05/13/2019
Data Release Frequency: Varies

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 09/21/2018
Date Data Arrived at EDR: 09/21/2018
Date Made Active in Reports: 11/09/2018
Number of Days to Update: 49

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 02/21/2019
Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: No Update Planned

Local Lists of Hazardous waste / Contaminated Sites

CA HIST CAL-SITES: Calsites Database

The Calsites database contains potential or confirmed hazardous substance release properties. In 1996, California EPA reevaluated and significantly reduced the number of sites in the Calsites database. No longer updated by the state agency. It has been replaced by ENVIROSTOR.

Date of Government Version: 08/08/2005
Date Data Arrived at EDR: 08/03/2006
Date Made Active in Reports: 08/24/2006
Number of Days to Update: 21

Source: Department of Toxic Substance Control
Telephone: 916-323-3400
Last EDR Contact: 02/23/2009
Next Scheduled EDR Contact: 05/25/2009
Data Release Frequency: No Update Planned

CA SCH: School Property Evaluation Program

This category contains proposed and existing school sites that are being evaluated by DTSC for possible hazardous materials contamination. In some cases, these properties may be listed in the CalSites category depending on the level of threat to public health and safety or the environment they pose.

Date of Government Version: 01/28/2019
Date Data Arrived at EDR: 01/29/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 35

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 01/29/2019
Next Scheduled EDR Contact: 05/11/2019
Data Release Frequency: Quarterly

CA CDL: Clandestine Drug Labs

A listing of drug lab locations. Listing of a location in this database does not indicate that any illegal drug lab materials were or were not present there, and does not constitute a determination that the location either requires or does not require additional cleanup work.

Date of Government Version: 12/31/2017
Date Data Arrived at EDR: 06/12/2018
Date Made Active in Reports: 08/06/2018
Number of Days to Update: 55

Source: Department of Toxic Substances Control
Telephone: 916-255-6504
Last EDR Contact: 01/25/2019
Next Scheduled EDR Contact: 04/22/2019
Data Release Frequency: Varies

CA CERS HAZ WASTE: CERS HAZ WASTE

List of sites in the California Environmental Protection Agency (CalEPA) Regulated Site Portal which fall under the Hazardous Chemical Management, Hazardous Waste Onsite Treatment, Household Hazardous Waste Collection, Hazardous Waste Generator, and RCRA LQ HW Generator programs.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/22/2018
Date Data Arrived at EDR: 10/23/2018
Date Made Active in Reports: 11/30/2018
Number of Days to Update: 38

Source: CalEPA
Telephone: 916-323-2514
Last EDR Contact: 01/24/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Quarterly

CA TOXIC PITS: Toxic Pits Cleanup Act Sites

Toxic PITS Cleanup Act Sites. TOXIC PITS identifies sites suspected of containing hazardous substances where cleanup has not yet been completed.

Date of Government Version: 07/01/1995
Date Data Arrived at EDR: 08/30/1995
Date Made Active in Reports: 09/26/1995
Number of Days to Update: 27

Source: State Water Resources Control Board
Telephone: 916-227-4364
Last EDR Contact: 01/26/2009
Next Scheduled EDR Contact: 04/27/2009
Data Release Frequency: No Update Planned

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 09/21/2018
Date Data Arrived at EDR: 09/21/2018
Date Made Active in Reports: 11/09/2018
Number of Days to Update: 49

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 02/21/2019
Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: Quarterly

Local Lists of Registered Storage Tanks

CA SWEEPS UST: SWEEPS UST Listing

Statewide Environmental Evaluation and Planning System. This underground storage tank listing was updated and maintained by a company contacted by the SWRCB in the early 1990's. The listing is no longer updated or maintained. The local agency is the contact for more information on a site on the SWEEPS list.

Date of Government Version: 06/01/1994
Date Data Arrived at EDR: 07/07/2005
Date Made Active in Reports: 08/11/2005
Number of Days to Update: 35

Source: State Water Resources Control Board
Telephone: N/A
Last EDR Contact: 06/03/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

CA UST MENDOCINO: Mendocino County UST Database

A listing of underground storage tank locations in Mendocino County.

Date of Government Version: 12/04/2018
Date Data Arrived at EDR: 12/06/2018
Date Made Active in Reports: 12/14/2018
Number of Days to Update: 8

Source: Department of Public Health
Telephone: 707-463-4466
Last EDR Contact: 02/21/2019
Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: Annually

CA HIST UST: Hazardous Substance Storage Container Database

The Hazardous Substance Storage Container Database is a historical listing of UST sites. Refer to local/county source for current data.

Date of Government Version: 10/15/1990
Date Data Arrived at EDR: 01/25/1991
Date Made Active in Reports: 02/12/1991
Number of Days to Update: 18

Source: State Water Resources Control Board
Telephone: 916-341-5851
Last EDR Contact: 07/26/2001
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CA SAN FRANCISCO AST: Aboveground Storage Tank Site Listing

Aboveground storage tank sites

Date of Government Version: 09/11/2018
Date Data Arrived at EDR: 09/12/2018
Date Made Active in Reports: 10/11/2018
Number of Days to Update: 29

Source: San Francisco County Department of Public Health
Telephone: 415-252-3896
Last EDR Contact: 01/31/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Varies

CA FID UST: Facility Inventory Database

The Facility Inventory Database (FID) contains a historical listing of active and inactive underground storage tank locations from the State Water Resource Control Board. Refer to local/county source for current data.

Date of Government Version: 10/31/1994
Date Data Arrived at EDR: 09/05/1995
Date Made Active in Reports: 09/29/1995
Number of Days to Update: 24

Source: California Environmental Protection Agency
Telephone: 916-341-5851
Last EDR Contact: 12/28/1998
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

CA CERS TANKS: California Environmental Reporting System (CERS) Tanks

List of sites in the California Environmental Protection Agency (CalEPA) Regulated Site Portal which fall under the Aboveground Petroleum Storage and Underground Storage Tank regulatory programs.

Date of Government Version: 10/22/2018
Date Data Arrived at EDR: 10/23/2018
Date Made Active in Reports: 11/30/2018
Number of Days to Update: 38

Source: California Environmental Protection Agency
Telephone: 916-323-2514
Last EDR Contact: 01/24/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Quarterly

Local Land Records

CA LIENS: Environmental Liens Listing

A listing of property locations with environmental liens for California where DTSC is a lien holder.

Date of Government Version: 11/29/2018
Date Data Arrived at EDR: 12/04/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 38

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Varies

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 12/12/2018
Date Data Arrived at EDR: 12/28/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 14

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 02/15/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Semi-Annually

CA DEED: Deed Restriction Listing

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Site Mitigation and Brownfields Reuse Program Facility Sites with Deed Restrictions & Hazardous Waste Management Program Facility Sites with Deed / Land Use Restriction. The DTSC Site Mitigation and Brownfields Reuse Program (SMBRP) list includes sites cleaned up under the program's oversight and generally does not include current or former hazardous waste facilities that required a hazardous waste facility permit. The list represents deed restrictions that are active. Some sites have multiple deed restrictions. The DTSC Hazardous Waste Management Program (HWMP) has developed a list of current or former hazardous waste facilities that have a recorded land use restriction at the local county recorder's office. The land use restrictions on this list were required by the DTSC HWMP as a result of the presence of hazardous substances that remain on site after the facility (or part of the facility) has been closed or cleaned up. The types of land use restriction include deed notice, deed restriction, or a land use restriction that binds current and future owners.

Date of Government Version: 12/03/2018	Source: DTSC and SWRCB
Date Data Arrived at EDR: 12/05/2018	Telephone: 916-323-3400
Date Made Active in Reports: 01/11/2019	Last EDR Contact: 03/05/2019
Number of Days to Update: 37	Next Scheduled EDR Contact: 06/17/2019
	Data Release Frequency: Semi-Annually

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 03/26/2018	Source: U.S. Department of Transportation
Date Data Arrived at EDR: 03/27/2018	Telephone: 202-366-4555
Date Made Active in Reports: 06/08/2018	Last EDR Contact: 02/08/2019
Number of Days to Update: 73	Next Scheduled EDR Contact: 04/08/2019
	Data Release Frequency: Quarterly

Records of Emergency Release Reports

CA CHMIRS: California Hazardous Material Incident Report System

California Hazardous Material Incident Reporting System. CHMIRS contains information on reported hazardous material incidents (accidental releases or spills).

Date of Government Version: 10/24/2018	Source: Office of Emergency Services
Date Data Arrived at EDR: 01/24/2019	Telephone: 916-845-8400
Date Made Active in Reports: 03/05/2019	Last EDR Contact: 01/24/2019
Number of Days to Update: 40	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Semi-Annually

CA LDS: Land Disposal Sites Listing (GEOTRACKER)

Land Disposal sites (Landfills) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 12/10/2018	Source: State Water Quality Control Board
Date Data Arrived at EDR: 12/11/2018	Telephone: 866-480-1028
Date Made Active in Reports: 01/15/2019	Last EDR Contact: 12/12/2018
Number of Days to Update: 35	Next Scheduled EDR Contact: 03/25/2019
	Data Release Frequency: Quarterly

CA MCS: Military Cleanup Sites Listing (GEOTRACKER)

Military sites (consisting of: Military UST sites; Military Privatized sites; and Military Cleanup sites [formerly known as DoD non UST]) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 12/10/2018	Source: State Water Resources Control Board
Date Data Arrived at EDR: 12/11/2018	Telephone: 866-480-1028
Date Made Active in Reports: 01/15/2019	Last EDR Contact: 12/12/2018
Number of Days to Update: 35	Next Scheduled EDR Contact: 03/25/2019
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CA SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 06/06/2012	Source: FirstSearch
Date Data Arrived at EDR: 01/03/2013	Telephone: N/A
Date Made Active in Reports: 02/22/2013	Last EDR Contact: 01/03/2013
Number of Days to Update: 50	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 03/01/2018	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/28/2018	Telephone: (415) 495-8895
Date Made Active in Reports: 06/22/2018	Last EDR Contact: 12/03/2018
Number of Days to Update: 86	Next Scheduled EDR Contact: 04/08/2019
	Data Release Frequency: Quarterly

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 01/31/2015	Source: U.S. Army Corps of Engineers
Date Data Arrived at EDR: 07/08/2015	Telephone: 202-528-4285
Date Made Active in Reports: 10/13/2015	Last EDR Contact: 02/22/2019
Number of Days to Update: 97	Next Scheduled EDR Contact: 06/03/2019
	Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005	Source: USGS
Date Data Arrived at EDR: 11/10/2006	Telephone: 888-275-8747
Date Made Active in Reports: 01/11/2007	Last EDR Contact: 01/11/2019
Number of Days to Update: 62	Next Scheduled EDR Contact: 04/22/2019
	Data Release Frequency: Semi-Annually

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005	Source: U.S. Geological Survey
Date Data Arrived at EDR: 02/06/2006	Telephone: 888-275-8747
Date Made Active in Reports: 01/11/2007	Last EDR Contact: 01/11/2019
Number of Days to Update: 339	Next Scheduled EDR Contact: 04/22/2019
	Data Release Frequency: N/A

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 01/01/2017
Date Data Arrived at EDR: 02/03/2017
Date Made Active in Reports: 04/07/2017
Number of Days to Update: 63

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 02/15/2019
Next Scheduled EDR Contact: 05/27/2019
Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 08/31/2018
Date Data Arrived at EDR: 09/25/2018
Date Made Active in Reports: 11/09/2018
Number of Days to Update: 45

Source: Environmental Protection Agency
Telephone: 202-566-1917
Last EDR Contact: 02/04/2019
Next Scheduled EDR Contact: 04/08/2019
Data Release Frequency: Quarterly

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 08/30/2013
Date Data Arrived at EDR: 03/21/2014
Date Made Active in Reports: 06/17/2014
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 617-520-3000
Last EDR Contact: 02/08/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 09/30/2017
Date Data Arrived at EDR: 05/08/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 73

Source: Environmental Protection Agency
Telephone: 703-308-4044
Last EDR Contact: 02/08/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Varies

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2016
Date Data Arrived at EDR: 06/21/2017
Date Made Active in Reports: 01/05/2018
Number of Days to Update: 198

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 12/21/2018
Next Scheduled EDR Contact: 04/01/2019
Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 12/31/2016
Date Data Arrived at EDR: 01/10/2018
Date Made Active in Reports: 01/12/2018
Number of Days to Update: 2

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 02/20/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Annually

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 12/10/2010
Date Made Active in Reports: 02/25/2011
Number of Days to Update: 77

Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 01/25/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Annually

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 12/12/2018
Date Data Arrived at EDR: 12/28/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 14

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 02/15/2019
Next Scheduled EDR Contact: 03/18/2019
Data Release Frequency: Annually

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 10/26/2018
Date Data Arrived at EDR: 11/06/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 66

Source: Environmental Protection Agency
Telephone: 202-564-8600
Last EDR Contact: 01/22/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 06/02/2008
Next Scheduled EDR Contact: 09/01/2008
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 08/13/2018	Source: EPA
Date Data Arrived at EDR: 10/04/2018	Telephone: 202-564-6023
Date Made Active in Reports: 11/09/2018	Last EDR Contact: 02/15/2019
Number of Days to Update: 36	Next Scheduled EDR Contact: 05/20/2019
	Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 09/14/2018	Source: EPA
Date Data Arrived at EDR: 10/11/2018	Telephone: 202-566-0500
Date Made Active in Reports: 12/07/2018	Last EDR Contact: 01/11/2019
Number of Days to Update: 57	Next Scheduled EDR Contact: 04/22/2019
	Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 11/18/2016	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/23/2016	Telephone: 202-564-2501
Date Made Active in Reports: 02/10/2017	Last EDR Contact: 01/07/2019
Number of Days to Update: 79	Next Scheduled EDR Contact: 04/22/2019
	Data Release Frequency: Quarterly

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009	Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 08/18/2017
Number of Days to Update: 25	Next Scheduled EDR Contact: 12/04/2017
	Data Release Frequency: Quarterly

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009	Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 08/18/2017
Number of Days to Update: 25	Next Scheduled EDR Contact: 12/04/2017
	Data Release Frequency: Quarterly

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 08/30/2016	Source: Nuclear Regulatory Commission
Date Data Arrived at EDR: 09/08/2016	Telephone: 301-415-7169
Date Made Active in Reports: 10/21/2016	Last EDR Contact: 01/22/2019
Number of Days to Update: 43	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

COAL ASH DOE: Steam-Electric Plant Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005	Source: Department of Energy
Date Data Arrived at EDR: 08/07/2009	Telephone: 202-586-8719
Date Made Active in Reports: 10/22/2009	Last EDR Contact: 12/05/2018
Number of Days to Update: 76	Next Scheduled EDR Contact: 03/18/2019
	Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 07/01/2014	Source: Environmental Protection Agency
Date Data Arrived at EDR: 09/10/2014	Telephone: N/A
Date Made Active in Reports: 10/20/2014	Last EDR Contact: 03/05/2019
Number of Days to Update: 40	Next Scheduled EDR Contact: 06/17/2019
	Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database

The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 05/24/2017	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/30/2017	Telephone: 202-566-0517
Date Made Active in Reports: 12/15/2017	Last EDR Contact: 01/25/2019
Number of Days to Update: 15	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Varies

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 10/02/2018	Source: Environmental Protection Agency
Date Data Arrived at EDR: 10/03/2018	Telephone: 202-343-9775
Date Made Active in Reports: 11/09/2018	Last EDR Contact: 01/03/2019
Number of Days to Update: 37	Next Scheduled EDR Contact: 04/15/2019
	Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/01/2007	Telephone: 202-564-2501
Date Made Active in Reports: 04/10/2007	Last EDR Contact: 12/17/2008
Number of Days to Update: 40	Next Scheduled EDR Contact: 03/17/2008
	Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

DOT OPS: Incident and Accident Data

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 10/01/2018
Date Data Arrived at EDR: 10/30/2018
Date Made Active in Reports: 01/18/2019
Number of Days to Update: 80

Source: Department of Transportation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 01/29/2019
Next Scheduled EDR Contact: 05/11/2019
Data Release Frequency: Quarterly

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 09/30/2018
Date Data Arrived at EDR: 10/12/2018
Date Made Active in Reports: 12/07/2018
Number of Days to Update: 56

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 01/07/2019
Next Scheduled EDR Contact: 04/22/2019
Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2015
Date Data Arrived at EDR: 02/22/2017
Date Made Active in Reports: 09/28/2017
Number of Days to Update: 218

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 02/13/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Biennially

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 07/14/2015
Date Made Active in Reports: 01/10/2017
Number of Days to Update: 546

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 01/07/2019
Next Scheduled EDR Contact: 04/22/2019
Data Release Frequency: Semi-Annually

FUSRAP: Formerly Utilized Sites Remedial Action Program

DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.

Date of Government Version: 08/08/2017
Date Data Arrived at EDR: 09/11/2018
Date Made Active in Reports: 09/14/2018
Number of Days to Update: 3

Source: Department of Energy
Telephone: 202-586-3559
Last EDR Contact: 01/31/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 06/23/2017
Date Data Arrived at EDR: 10/11/2017
Date Made Active in Reports: 11/03/2017
Number of Days to Update: 23

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 02/22/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 12/12/2018
Date Data Arrived at EDR: 12/28/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 14

Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 02/15/2019
Next Scheduled EDR Contact: 04/15/2019
Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 12/12/2018
Date Data Arrived at EDR: 12/28/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 14

Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 02/15/2019
Next Scheduled EDR Contact: 04/15/2019
Data Release Frequency: Varies

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem

Date of Government Version: 10/27/2009
Date Data Arrived at EDR: 11/10/2009
Date Made Active in Reports: 12/08/2009
Number of Days to Update: 28

Source: N/A
Telephone: N/A
Last EDR Contact: 11/12/1996
Next Scheduled EDR Contact: N/A
Data Release Frequency: Annually

US AIRS MINOR: Aerometric Information Retrieval System Facility Subsystem

Date of Government Version: 10/27/2009
Date Data Arrived at EDR: 11/10/2009
Date Made Active in Reports: 12/08/2009
Number of Days to Update: 28

Source: N/A
Telephone: N/A
Last EDR Contact: 11/12/1996
Next Scheduled EDR Contact: N/A
Data Release Frequency: Annually

US MINES: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011
Date Data Arrived at EDR: 06/08/2011
Date Made Active in Reports: 09/13/2011
Number of Days to Update: 97

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 03/01/2019
Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: Varies

US MINES 2: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011
Date Data Arrived at EDR: 06/08/2011
Date Made Active in Reports: 09/13/2011
Number of Days to Update: 97

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 03/01/2019
Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011	Source: USGS
Date Data Arrived at EDR: 06/08/2011	Telephone: 703-648-7709
Date Made Active in Reports: 09/13/2011	Last EDR Contact: 03/01/2019
Number of Days to Update: 97	Next Scheduled EDR Contact: 06/10/2019
	Data Release Frequency: Varies

ABANDONED MINES: Abandoned Mines

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by OSMRE to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

Date of Government Version: 09/10/2018	Source: Department of Interior
Date Data Arrived at EDR: 09/11/2018	Telephone: 202-208-2609
Date Made Active in Reports: 09/14/2018	Last EDR Contact: 12/19/2018
Number of Days to Update: 3	Next Scheduled EDR Contact: 03/25/2019
	Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 11/15/2018	Source: EPA
Date Data Arrived at EDR: 12/05/2018	Telephone: (415) 947-8000
Date Made Active in Reports: 01/11/2019	Last EDR Contact: 03/05/2019
Number of Days to Update: 37	Next Scheduled EDR Contact: 06/17/2019
	Data Release Frequency: Quarterly

UXO: Unexploded Ordnance Sites

A listing of unexploded ordnance site locations

Date of Government Version: 09/30/2017	Source: Department of Defense
Date Data Arrived at EDR: 06/19/2018	Telephone: 703-704-1564
Date Made Active in Reports: 09/14/2018	Last EDR Contact: 01/14/2019
Number of Days to Update: 87	Next Scheduled EDR Contact: 04/29/2019
	Data Release Frequency: Varies

ECHO: Enforcement & Compliance History Information

ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

Date of Government Version: 09/02/2018	Source: Environmental Protection Agency
Date Data Arrived at EDR: 09/05/2018	Telephone: 202-564-2280
Date Made Active in Reports: 09/14/2018	Last EDR Contact: 03/05/2019
Number of Days to Update: 9	Next Scheduled EDR Contact: 06/17/2019
	Data Release Frequency: Quarterly

DOCKET HWC: Hazardous Waste Compliance Docket Listing

A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 05/31/2018
Date Data Arrived at EDR: 07/26/2018
Date Made Active in Reports: 10/05/2018
Number of Days to Update: 71

Source: Environmental Protection Agency
Telephone: 202-564-0527
Last EDR Contact: 03/01/2019
Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: Varies

FUELS PROGRAM: EPA Fuels Program Registered Listing

This listing includes facilities that are registered under the Part 80 (Code of Federal Regulations) EPA Fuels Programs. All companies now are required to submit new and updated registrations.

Date of Government Version: 08/22/2018
Date Data Arrived at EDR: 08/22/2018
Date Made Active in Reports: 10/05/2018
Number of Days to Update: 44

Source: EPA
Telephone: 800-385-6164
Last EDR Contact: 02/21/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Quarterly

Other Ascertainable Records

CA BOND EXP. PLAN: Bond Expenditure Plan

Department of Health Services developed a site-specific expenditure plan as the basis for an appropriation of Hazardous Substance Cleanup Bond Act funds. It is not updated.

Date of Government Version: 01/01/1989
Date Data Arrived at EDR: 07/27/1994
Date Made Active in Reports: 08/02/1994
Number of Days to Update: 6

Source: Department of Health Services
Telephone: 916-255-2118
Last EDR Contact: 05/31/1994
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

CA CORTESE: "Cortese" Hazardous Waste & Substances Sites List

The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste Board (SWF/LS), and the Department of Toxic Substances Control (Cal-Sites).

Date of Government Version: 12/20/2018
Date Data Arrived at EDR: 12/21/2018
Date Made Active in Reports: 02/28/2019
Number of Days to Update: 69

Source: CAL EPA/Office of Emergency Information
Telephone: 916-323-3400
Last EDR Contact: 12/21/2018
Next Scheduled EDR Contact: 04/08/2019
Data Release Frequency: Quarterly

CA CUPA LIVERMORE-PLEASANTON: CUPA Facility Listing

list of facilities associated with the various CUPA programs in Livermore-Pleasanton

Date of Government Version: 08/28/2018
Date Data Arrived at EDR: 08/30/2018
Date Made Active in Reports: 11/01/2018
Number of Days to Update: 63

Source: Livermore-Pleasanton Fire Department
Telephone: 925-454-2361
Last EDR Contact: 02/26/2019
Next Scheduled EDR Contact: 05/27/2019
Data Release Frequency: Varies

CA CUPA SAN FRANCISCO CO: CUPA Facility Listing

Cupa facilities

Date of Government Version: 09/11/2018
Date Data Arrived at EDR: 09/12/2018
Date Made Active in Reports: 09/19/2018
Number of Days to Update: 7

Source: San Francisco County Department of Environmental Health
Telephone: 415-252-3896
Last EDR Contact: 01/31/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Varies

CA DRYCLEAN SOUTH COAST: South Coast Air Quality Management District Drycleaner Listing

A listing of dry cleaners in the South Coast Air Quality Management District

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/04/2018
Date Data Arrived at EDR: 10/05/2018
Date Made Active in Reports: 11/01/2018
Number of Days to Update: 27

Source: South Coast Air Quality Management District
Telephone: 909-396-3211
Last EDR Contact: 02/07/2019
Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: Varies

CA DRYCLEANERS: Cleaner Facilities

A list of drycleaner related facilities that have EPA ID numbers. These are facilities with certain SIC codes: power laundries, family and commercial; garment pressing and cleaner's agents; linen supply; coin-operated laundries and cleaning; drycleaning plants, except rugs; carpet and upholster cleaning; industrial launderers; laundry and garment services.

Date of Government Version: 12/13/2018
Date Data Arrived at EDR: 01/17/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 47

Source: Department of Toxic Substance Control
Telephone: 916-327-4498
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Annually

CA DRYCLEAN AVAQMD: Antelope Valley Air Quality Management District Drycleaner Listing

A listing of dry cleaners in the Antelope Valley Air Quality Management District.

Date of Government Version: 11/13/2018
Date Data Arrived at EDR: 12/04/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 42

Source: Antelope Valley Air Quality Management District
Telephone: 661-723-8070
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Varies

CA EMI: Emissions Inventory Data

Toxics and criteria pollutant emissions data collected by the ARB and local air pollution agencies.

Date of Government Version: 12/31/2017
Date Data Arrived at EDR: 06/20/2018
Date Made Active in Reports: 08/06/2018
Number of Days to Update: 47

Source: California Air Resources Board
Telephone: 916-322-2990
Last EDR Contact: 12/21/2018
Next Scheduled EDR Contact: 04/01/2019
Data Release Frequency: Varies

CA ENF: Enforcement Action Listing

A listing of Water Board Enforcement Actions. Formal is everything except Oral/Verbal Communication, Notice of Violation, Expedited Payment Letter, and Staff Enforcement Letter.

Date of Government Version: 11/01/2018
Date Data Arrived at EDR: 11/02/2018
Date Made Active in Reports: 12/13/2018
Number of Days to Update: 41

Source: State Water Resources Control Board
Telephone: 916-445-9379
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

CA Financial Assurance 1: Financial Assurance Information Listing

Financial Assurance information

Date of Government Version: 01/10/2019
Date Data Arrived at EDR: 01/23/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 41

Source: Department of Toxic Substances Control
Telephone: 916-255-3628
Last EDR Contact: 01/17/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

CA Financial Assurance 2: Financial Assurance Information Listing

A listing of financial assurance information for solid waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 02/15/2019
Date Data Arrived at EDR: 02/19/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 14

Source: California Integrated Waste Management Board
Telephone: 916-341-6066
Last EDR Contact: 02/11/2019
Next Scheduled EDR Contact: 05/27/2019
Data Release Frequency: Varies

CA HAZNET: Facility and Manifest Data

Facility and Manifest Data. The data is extracted from the copies of hazardous waste manifests received each year by the DTSC. The annual volume of manifests is typically 700,000 - 1,000,000 annually, representing approximately 350,000 - 500,000 shipments. Data are from the manifests submitted without correction, and therefore many contain some invalid values for data elements such as generator ID, TSD ID, waste category, and disposal method. This database begins with calendar year 1993.

Date of Government Version: 12/31/2017
Date Data Arrived at EDR: 10/10/2018
Date Made Active in Reports: 11/16/2018
Number of Days to Update: 37

Source: California Environmental Protection Agency
Telephone: 916-255-1136
Last EDR Contact: 01/07/2019
Next Scheduled EDR Contact: 04/22/2019
Data Release Frequency: Annually

CA ICE: ICE

Contains data pertaining to the Permitted Facilities with Inspections / Enforcements sites tracked in Envirostor.

Date of Government Version: 02/19/2019
Date Data Arrived at EDR: 02/20/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 13

Source: Department of Toxic Substances Control
Telephone: 877-786-9427
Last EDR Contact: 02/20/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Quarterly

CA HIST CORTESE: Hazardous Waste & Substance Site List

The sites for the list are designated by the State Water Resource Control Board [LUST], the Integrated Waste Board [SWF/LS], and the Department of Toxic Substances Control [CALSITES]. This listing is no longer updated by the state agency.

Date of Government Version: 04/01/2001
Date Data Arrived at EDR: 01/22/2009
Date Made Active in Reports: 04/08/2009
Number of Days to Update: 76

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 01/22/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

CA HWP: EnviroStor Permitted Facilities Listing

Detailed information on permitted hazardous waste facilities and corrective action ("cleanups") tracked in EnviroStor.

Date of Government Version: 02/19/2019
Date Data Arrived at EDR: 02/20/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 13

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 02/20/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Quarterly

CA HWT: Registered Hazardous Waste Transporter Database

A listing of hazardous waste transporters. In California, unless specifically exempted, it is unlawful for any person to transport hazardous wastes unless the person holds a valid registration issued by DTSC. A hazardous waste transporter registration is valid for one year and is assigned a unique registration number.

Date of Government Version: 01/07/2019
Date Data Arrived at EDR: 01/08/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 56

Source: Department of Toxic Substances Control
Telephone: 916-440-7145
Last EDR Contact: 01/08/2019
Next Scheduled EDR Contact: 04/22/2019
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 01/01/2019
Date Data Arrived at EDR: 01/30/2019
Date Made Active in Reports: 02/14/2019
Number of Days to Update: 15

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 01/30/2019
Next Scheduled EDR Contact: 05/11/2019
Data Release Frequency: Quarterly

CA MINES: Mines Site Location Listing

A listing of mine site locations from the Office of Mine Reclamation.

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/12/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 34

Source: Department of Conservation
Telephone: 916-322-1080
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Quarterly

CA MWMP: Medical Waste Management Program Listing

The Medical Waste Management Program (MWMP) ensures the proper handling and disposal of medical waste by permitting and inspecting medical waste Offsite Treatment Facilities (PDF) and Transfer Stations (PDF) throughout the state. MWMP also oversees all Medical Waste Transporters.

Date of Government Version: 11/09/2018
Date Data Arrived at EDR: 12/05/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 37

Source: Department of Public Health
Telephone: 916-558-1784
Last EDR Contact: 03/05/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Varies

CA NPDES: NPDES Permits Listing

A listing of NPDES permits, including stormwater.

Date of Government Version: 11/12/2018
Date Data Arrived at EDR: 11/14/2018
Date Made Active in Reports: 12/13/2018
Number of Days to Update: 29

Source: State Water Resources Control Board
Telephone: 916-445-9379
Last EDR Contact: 02/12/2019
Next Scheduled EDR Contact: 05/27/2019
Data Release Frequency: Quarterly

CA PEST LIC: Pesticide Regulation Licenses Listing

A listing of licenses and certificates issued by the Department of Pesticide Regulation. The DPR issues licenses and/or certificates to: Persons and businesses that apply or sell pesticides; Pest control dealers and brokers; Persons who advise on agricultural pesticide applications.

Date of Government Version: 12/03/2018
Date Data Arrived at EDR: 12/05/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 37

Source: Department of Pesticide Regulation
Telephone: 916-445-4038
Last EDR Contact: 03/05/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Quarterly

CA PROC: Certified Processors Database

A listing of certified processors.

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/12/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 34

Source: Department of Conservation
Telephone: 916-323-3836
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CA NOTIFY 65: Proposition 65 Records

Listings of all Proposition 65 incidents reported to counties by the State Water Resources Control Board and the Regional Water Quality Control Board. This database is no longer updated by the reporting agency.

Date of Government Version: 09/19/2018	Source: State Water Resources Control Board
Date Data Arrived at EDR: 09/20/2018	Telephone: 916-445-3846
Date Made Active in Reports: 10/19/2018	Last EDR Contact: 12/12/2018
Number of Days to Update: 29	Next Scheduled EDR Contact: 04/01/2019
	Data Release Frequency: No Update Planned

CA UIC: UIC Listing

A listing of wells identified as underground injection wells, in the California Oil and Gas Wells database.

Date of Government Version: 04/27/2018	Source: Department of Conservation
Date Data Arrived at EDR: 06/13/2018	Telephone: 916-445-2408
Date Made Active in Reports: 07/17/2018	Last EDR Contact: 01/25/2019
Number of Days to Update: 34	Next Scheduled EDR Contact: 03/25/2019
	Data Release Frequency: Varies

CA UIC GEO: Underground Injection Control Sites (GEOTRACKER)

Underground control injection sites

Date of Government Version: 12/10/2018	Source: State Water Resource Control Board
Date Data Arrived at EDR: 12/11/2018	Telephone: 866-480-1028
Date Made Active in Reports: 01/15/2019	Last EDR Contact: 12/12/2018
Number of Days to Update: 35	Next Scheduled EDR Contact: 03/25/2019
	Data Release Frequency: Varies

CA WASTEWATER PITS: Oil Wastewater Pits Listing

Water officials discovered that oil producers have been dumping chemical-laden wastewater into hundreds of unlined pits that are operating without proper permits. Inspections completed by the Central Valley Regional Water Quality Control Board revealed the existence of previously unidentified waste sites. The water boards review found that more than one-third of the region's active disposal pits are operating without permission.

Date of Government Version: 05/08/2018	Source: RWQCB, Central Valley Region
Date Data Arrived at EDR: 07/11/2018	Telephone: 559-445-5577
Date Made Active in Reports: 09/13/2018	Last EDR Contact: 01/11/2019
Number of Days to Update: 64	Next Scheduled EDR Contact: 04/22/2019
	Data Release Frequency: Varies

CA WDS: Waste Discharge System

Sites which have been issued waste discharge requirements.

Date of Government Version: 06/19/2007	Source: State Water Resources Control Board
Date Data Arrived at EDR: 06/20/2007	Telephone: 916-341-5227
Date Made Active in Reports: 06/29/2007	Last EDR Contact: 02/13/2019
Number of Days to Update: 9	Next Scheduled EDR Contact: 06/03/2019
	Data Release Frequency: Quarterly

CA MILITARY PRIV SITES: Military Privatized Sites (GEOTRACKER)

Military privatized sites

Date of Government Version: 12/10/2018	Source: State Water Resources Control Board
Date Data Arrived at EDR: 12/11/2018	Telephone: 866-480-1028
Date Made Active in Reports: 01/15/2019	Last EDR Contact: 12/12/2018
Number of Days to Update: 35	Next Scheduled EDR Contact: 03/25/2019
	Data Release Frequency: Varies

CA PROJECT: Project Sites (GEOTRACKER)

Projects sites

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/11/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 35

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Varies

CA WDR: Waste Discharge Requirements Listing

In general, the Waste Discharge Requirements (WDRs) Program (sometimes also referred to as the "Non Chapter 15 (Non 15) Program") regulates point discharges that are exempt pursuant to Subsection 20090 of Title 27 and not subject to the Federal Water Pollution Control Act. Exemptions from Title 27 may be granted for nine categories of discharges (e.g., sewage, wastewater, etc.) that meet, and continue to meet, the preconditions listed for each specific exemption. The scope of the WDRs Program also includes the discharge of wastes classified as inert, pursuant to section 20230 of Title 27.

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/12/2018
Date Made Active in Reports: 01/18/2019
Number of Days to Update: 37

Source: State Water Resources Control Board
Telephone: 916-341-5810
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Quarterly

CA CIWQS: California Integrated Water Quality System

The California Integrated Water Quality System (CIWQS) is a computer system used by the State and Regional Water Quality Control Boards to track information about places of environmental interest, manage permits and other orders, track inspections, and manage violations and enforcement activities.

Date of Government Version: 12/03/2018
Date Data Arrived at EDR: 12/04/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 38

Source: State Water Resources Control Board
Telephone: 866-794-4977
Last EDR Contact: 03/05/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Varies

CA CERS: CalEPA Regulated Site Portal Data

The CalEPA Regulated Site Portal database combines data about environmentally regulated sites and facilities in California into a single database. It combines data from a variety of state and federal databases, and provides an overview of regulated activities across the spectrum of environmental programs for any given location in California. These activities include hazardous materials and waste, state and federal cleanups, impacted ground and surface waters, and toxic materials

Date of Government Version: 10/22/2018
Date Data Arrived at EDR: 10/23/2018
Date Made Active in Reports: 11/30/2018
Number of Days to Update: 38

Source: California Environmental Protection Agency
Telephone: 916-323-2514
Last EDR Contact: 01/24/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

CA WIP: Well Investigation Program Case List

Well Investigation Program case in the San Gabriel and San Fernando Valley area.

Date of Government Version: 07/03/2009
Date Data Arrived at EDR: 07/21/2009
Date Made Active in Reports: 08/03/2009
Number of Days to Update: 13

Source: Los Angeles Water Quality Control Board
Telephone: 213-576-6726
Last EDR Contact: 12/19/2018
Next Scheduled EDR Contact: 04/08/2019
Data Release Frequency: Varies

CA NON-CASE INFO: Non-Case Information Sites (GEOTRACKER)

Non-Case Information sites

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/11/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 35

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CA OTHER OIL GAS: Other Oil & Gas Projects Sites (GEOTRACKER)

Other Oil & Gas Projects sites

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/11/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 35

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Varies

CA PROD WATER PONDS: Produced Water Ponds Sites (GEOTRACKER)

Produced water ponds sites

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/11/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 35

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Varies

CA SAMPLING POINT: Sampling Point ? Public Sites (GEOTRACKER)

Sampling point - public sites

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/11/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 35

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Varies

CA WELL STIM PROJ: Well Stimulation Project (GEOTRACKER)

Includes areas of groundwater monitoring plans, a depiction of the monitoring network, and the facilities, boundaries, and subsurface characteristics of the oilfield and the features (oil and gas wells, produced water ponds, UIC wells, water supply wells, etc?) being monitored

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/11/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 35

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Varies

EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Hist Auto: EDR Exclusive Historical Auto Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR Hist Cleaner: EDR Exclusive Historical Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

CA RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Resources Recycling and Recovery in California.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/13/2014
Number of Days to Update: 196

Source: Department of Resources Recycling and Recovery
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

CA RGA LUST: Recovered Government Archive Leaking Underground Storage Tank

The EDR Recovered Government Archive Leaking Underground Storage Tank database provides a list of LUST incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the State Water Resources Control Board in California.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 12/30/2013
Number of Days to Update: 182

Source: State Water Resources Control Board
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

COUNTY RECORDS

ALAMEDA COUNTY:

Contaminated Sites

A listing of contaminated sites overseen by the Toxic Release Program (oil and groundwater contamination from chemical releases and spills) and the Leaking Underground Storage Tank Program (soil and ground water contamination from leaking petroleum USTs).

Date of Government Version: 01/09/2019
Date Data Arrived at EDR: 01/11/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 53

Source: Alameda County Environmental Health Services
Telephone: 510-567-6700
Last EDR Contact: 01/07/2019
Next Scheduled EDR Contact: 04/22/2019
Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Underground Tanks

Underground storage tank sites located in Alameda county.

Date of Government Version: 10/05/2018
Date Data Arrived at EDR: 10/10/2018
Date Made Active in Reports: 11/02/2018
Number of Days to Update: 23

Source: Alameda County Environmental Health Services
Telephone: 510-567-6700
Last EDR Contact: 01/07/2019
Next Scheduled EDR Contact: 04/24/2047
Data Release Frequency: Semi-Annually

AMADOR COUNTY:

CUPA Facility List Cupa Facility List

Date of Government Version: 07/01/2018
Date Data Arrived at EDR: 07/24/2018
Date Made Active in Reports: 08/20/2018
Number of Days to Update: 27

Source: Amador County Environmental Health
Telephone: 209-223-6439
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Varies

BUTTE COUNTY:

CUPA Facility Listing Cupa facility list.

Date of Government Version: 04/21/2017
Date Data Arrived at EDR: 04/25/2017
Date Made Active in Reports: 08/09/2017
Number of Days to Update: 106

Source: Public Health Department
Telephone: 530-538-7149
Last EDR Contact: 01/07/2019
Next Scheduled EDR Contact: 04/22/2019
Data Release Frequency: No Update Planned

CALVERAS COUNTY:

CUPA Facility Listing Cupa Facility Listing

Date of Government Version: 01/24/2019
Date Data Arrived at EDR: 01/25/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 39

Source: Calveras County Environmental Health
Telephone: 209-754-6399
Last EDR Contact: 12/21/2018
Next Scheduled EDR Contact: 04/08/2019
Data Release Frequency: Quarterly

COLUSA COUNTY:

CUPA Facility List Cupa facility list.

Date of Government Version: 05/23/2018
Date Data Arrived at EDR: 05/24/2018
Date Made Active in Reports: 07/13/2018
Number of Days to Update: 50

Source: Health & Human Services
Telephone: 530-458-0396
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Semi-Annually

CONTRA COSTA COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Site List

List includes sites from the underground tank, hazardous waste generator and business plan/2185 programs.

Date of Government Version: 11/26/2018
Date Data Arrived at EDR: 11/30/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 46

Source: Contra Costa Health Services Department
Telephone: 925-646-2286
Last EDR Contact: 01/28/2019
Next Scheduled EDR Contact: 05/11/2019
Data Release Frequency: Semi-Annually

DEL NORTE COUNTY:

CUPA Facility List

Cupa Facility list

Date of Government Version: 01/16/2019
Date Data Arrived at EDR: 02/05/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 28

Source: Del Norte County Environmental Health Division
Telephone: 707-465-0426
Last EDR Contact: 01/28/2019
Next Scheduled EDR Contact: 05/11/2019
Data Release Frequency: Varies

EL DORADO COUNTY:

CUPA Facility List

CUPA facility list.

Date of Government Version: 12/13/2018
Date Data Arrived at EDR: 12/18/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 28

Source: El Dorado County Environmental Management Department
Telephone: 530-621-6623
Last EDR Contact: 01/28/2019
Next Scheduled EDR Contact: 05/11/2019
Data Release Frequency: Varies

FRESNO COUNTY:

CUPA Resources List

Certified Unified Program Agency. CUPA's are responsible for implementing a unified hazardous materials and hazardous waste management regulatory program. The agency provides oversight of businesses that deal with hazardous materials, operate underground storage tanks or aboveground storage tanks.

Date of Government Version: 10/16/2018
Date Data Arrived at EDR: 10/18/2018
Date Made Active in Reports: 11/14/2018
Number of Days to Update: 27

Source: Dept. of Community Health
Telephone: 559-445-3271
Last EDR Contact: 12/26/2018
Next Scheduled EDR Contact: 04/15/2019
Data Release Frequency: Semi-Annually

GLENN COUNTY:

CUPA Facility List

Cupa facility list

Date of Government Version: 01/22/2018
Date Data Arrived at EDR: 01/24/2018
Date Made Active in Reports: 03/14/2018
Number of Days to Update: 49

Source: Glenn County Air Pollution Control District
Telephone: 830-934-6500
Last EDR Contact: 01/17/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

HUMBOLDT COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA Facility List CUPA facility list.

Date of Government Version: 12/11/2018
Date Data Arrived at EDR: 12/13/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 33

Source: Humboldt County Environmental Health
Telephone: N/A
Last EDR Contact: 11/19/2018
Next Scheduled EDR Contact: 03/04/2019
Data Release Frequency: Semi-Annually

IMPERIAL COUNTY:

CUPA Facility List Cupa facility list.

Date of Government Version: 01/18/2019
Date Data Arrived at EDR: 01/23/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 41

Source: San Diego Border Field Office
Telephone: 760-339-2777
Last EDR Contact: 01/17/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

INYO COUNTY:

CUPA Facility List Cupa facility list.

Date of Government Version: 04/02/2018
Date Data Arrived at EDR: 04/03/2018
Date Made Active in Reports: 06/14/2018
Number of Days to Update: 72

Source: Inyo County Environmental Health Services
Telephone: 760-878-0238
Last EDR Contact: 02/13/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Varies

KERN COUNTY:

Underground Storage Tank Sites & Tank Listing Kern County Sites and Tanks Listing.

Date of Government Version: 11/02/2018
Date Data Arrived at EDR: 11/07/2018
Date Made Active in Reports: 12/14/2018
Number of Days to Update: 37

Source: Kern County Environment Health Services Department
Telephone: 661-862-8700
Last EDR Contact: 01/31/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Quarterly

KINGS COUNTY:

CUPA Facility List

A listing of sites included in the county's Certified Unified Program Agency database. California's Secretary for Environmental Protection established the unified hazardous materials and hazardous waste regulatory program as required by chapter 6.11 of the California Health and Safety Code. The Unified Program consolidates the administration, permits, inspections, and enforcement activities.

Date of Government Version: 02/14/2019
Date Data Arrived at EDR: 02/19/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 14

Source: Kings County Department of Public Health
Telephone: 559-584-1411
Last EDR Contact: 02/13/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Varies

LAKE COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA Facility List Cupa facility list

Date of Government Version: 11/07/2018
Date Data Arrived at EDR: 11/08/2018
Date Made Active in Reports: 11/14/2018
Number of Days to Update: 6

Source: Lake County Environmental Health
Telephone: 707-263-1164
Last EDR Contact: 01/14/2019
Next Scheduled EDR Contact: 04/29/2019
Data Release Frequency: Varies

LASSEN COUNTY:

CUPA Facility List Cupa facility list

Date of Government Version: 01/17/2019
Date Data Arrived at EDR: 01/18/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 46

Source: Lassen County Environmental Health
Telephone: 530-251-8528
Last EDR Contact: 01/17/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

LOS ANGELES COUNTY:

Key Areas of Concerns in Los Angeles County

San Gabriel Valley areas where VOC contamination is at or above the MCL as designated by region 9 EPA office. Date of Government Version: 3/30/2009 Exide Site area is a cleanup plan of lead-impacted soil surrounding the former Exide Facility as designated by the DTSC. Date of Government Version: 7/17/2017

Date of Government Version: 03/30/2009
Date Data Arrived at EDR: 03/31/2009
Date Made Active in Reports: 10/23/2009
Number of Days to Update: 206

Source: N/A
Telephone: N/A
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 04/01/2019
Data Release Frequency: No Update Planned

HMS: Street Number List

Industrial Waste and Underground Storage Tank Sites.

Date of Government Version: 09/20/2018
Date Data Arrived at EDR: 10/12/2018
Date Made Active in Reports: 11/16/2018
Number of Days to Update: 35

Source: Department of Public Works
Telephone: 626-458-3517
Last EDR Contact: 01/07/2019
Next Scheduled EDR Contact: 04/22/2019
Data Release Frequency: Semi-Annually

List of Solid Waste Facilities

Solid Waste Facilities in Los Angeles County.

Date of Government Version: 10/15/2018
Date Data Arrived at EDR: 10/16/2018
Date Made Active in Reports: 11/16/2018
Number of Days to Update: 31

Source: La County Department of Public Works
Telephone: 818-458-5185
Last EDR Contact: 01/15/2019
Next Scheduled EDR Contact: 04/29/2019
Data Release Frequency: Varies

City of Los Angeles Landfills

Landfills owned and maintained by the City of Los Angeles.

Date of Government Version: 01/01/2018
Date Data Arrived at EDR: 05/01/2018
Date Made Active in Reports: 05/14/2018
Number of Days to Update: 13

Source: Engineering & Construction Division
Telephone: 213-473-7869
Last EDR Contact: 01/15/2019
Next Scheduled EDR Contact: 04/29/2019
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Site Mitigation List

Industrial sites that have had some sort of spill or complaint.

Date of Government Version: 07/01/2018	Source: Community Health Services
Date Data Arrived at EDR: 10/16/2018	Telephone: 323-890-7806
Date Made Active in Reports: 11/16/2018	Last EDR Contact: 02/01/2019
Number of Days to Update: 31	Next Scheduled EDR Contact: 04/29/2019
	Data Release Frequency: Annually

City of El Segundo Underground Storage Tank

Underground storage tank sites located in El Segundo city.

Date of Government Version: 01/21/2017	Source: City of El Segundo Fire Department
Date Data Arrived at EDR: 04/19/2017	Telephone: 310-524-2236
Date Made Active in Reports: 05/10/2017	Last EDR Contact: 01/14/2019
Number of Days to Update: 21	Next Scheduled EDR Contact: 04/29/2019
	Data Release Frequency: Semi-Annually

City of Long Beach Underground Storage Tank

Underground storage tank sites located in the city of Long Beach.

Date of Government Version: 03/09/2017	Source: City of Long Beach Fire Department
Date Data Arrived at EDR: 03/10/2017	Telephone: 562-570-2563
Date Made Active in Reports: 05/03/2017	Last EDR Contact: 01/17/2019
Number of Days to Update: 54	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Annually

City of Torrance Underground Storage Tank

Underground storage tank sites located in the city of Torrance.

Date of Government Version: 10/02/2018	Source: City of Torrance Fire Department
Date Data Arrived at EDR: 10/05/2018	Telephone: 310-618-2973
Date Made Active in Reports: 11/02/2018	Last EDR Contact: 01/17/2019
Number of Days to Update: 28	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Semi-Annually

MADERA COUNTY:

CUPA Facility List

A listing of sites included in the county's Certified Unified Program Agency database. California's Secretary for Environmental Protection established the unified hazardous materials and hazardous waste regulatory program as required by chapter 6.11 of the California Health and Safety Code. The Unified Program consolidates the administration, permits, inspections, and enforcement activities.

Date of Government Version: 11/26/2018	Source: Madera County Environmental Health
Date Data Arrived at EDR: 11/27/2018	Telephone: 559-675-7823
Date Made Active in Reports: 12/12/2018	Last EDR Contact: 02/15/2019
Number of Days to Update: 15	Next Scheduled EDR Contact: 06/03/2019
	Data Release Frequency: Varies

MARIN COUNTY:

Underground Storage Tank Sites

Currently permitted USTs in Marin County.

Date of Government Version: 09/26/2018	Source: Public Works Department Waste Management
Date Data Arrived at EDR: 10/04/2018	Telephone: 415-473-6647
Date Made Active in Reports: 11/02/2018	Last EDR Contact: 01/14/2019
Number of Days to Update: 29	Next Scheduled EDR Contact: 04/15/2019
	Data Release Frequency: Semi-Annually

MERCED COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA Facility List

CUPA facility list.

Date of Government Version: 08/29/2018
Date Data Arrived at EDR: 08/31/2018
Date Made Active in Reports: 09/19/2018
Number of Days to Update: 19

Source: Merced County Environmental Health
Telephone: 209-381-1094
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Varies

MONO COUNTY:

CUPA Facility List

CUPA Facility List

Date of Government Version: 12/07/2018
Date Data Arrived at EDR: 12/11/2018
Date Made Active in Reports: 01/24/2019
Number of Days to Update: 44

Source: Mono County Health Department
Telephone: 760-932-5580
Last EDR Contact: 02/21/2019
Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: Varies

MONTEREY COUNTY:

CUPA Facility Listing

CUPA Program listing from the Environmental Health Division.

Date of Government Version: 02/05/2019
Date Data Arrived at EDR: 02/07/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 26

Source: Monterey County Health Department
Telephone: 831-796-1297
Last EDR Contact: 12/27/2018
Next Scheduled EDR Contact: 04/15/2019
Data Release Frequency: Varies

NAPA COUNTY:

Sites With Reported Contamination

A listing of leaking underground storage tank sites located in Napa county.

Date of Government Version: 01/09/2017
Date Data Arrived at EDR: 01/11/2017
Date Made Active in Reports: 03/02/2017
Number of Days to Update: 50

Source: Napa County Department of Environmental Management
Telephone: 707-253-4269
Last EDR Contact: 02/21/2019
Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: No Update Planned

Closed and Operating Underground Storage Tank Sites

Underground storage tank sites located in Napa county.

Date of Government Version: 11/28/2018
Date Data Arrived at EDR: 11/30/2018
Date Made Active in Reports: 12/14/2018
Number of Days to Update: 14

Source: Napa County Department of Environmental Management
Telephone: 707-253-4269
Last EDR Contact: 02/21/2019
Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: No Update Planned

NEVADA COUNTY:

CUPA Facility List

CUPA facility list.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 01/25/2019
Date Data Arrived at EDR: 01/29/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 35

Source: Community Development Agency
Telephone: 530-265-1467
Last EDR Contact: 01/28/2019
Next Scheduled EDR Contact: 05/11/2019
Data Release Frequency: Varies

ORANGE COUNTY:

List of Industrial Site Cleanups

Petroleum and non-petroleum spills.

Date of Government Version: 01/02/2019
Date Data Arrived at EDR: 02/07/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 26

Source: Health Care Agency
Telephone: 714-834-3446
Last EDR Contact: 02/04/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Annually

List of Underground Storage Tank Cleanups

Orange County Underground Storage Tank Cleanups (LUST).

Date of Government Version: 01/02/2019
Date Data Arrived at EDR: 02/08/2019
Date Made Active in Reports: 03/06/2019
Number of Days to Update: 26

Source: Health Care Agency
Telephone: 714-834-3446
Last EDR Contact: 02/04/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Quarterly

List of Underground Storage Tank Facilities

Orange County Underground Storage Tank Facilities (UST).

Date of Government Version: 10/04/2018
Date Data Arrived at EDR: 11/06/2018
Date Made Active in Reports: 12/14/2018
Number of Days to Update: 38

Source: Health Care Agency
Telephone: 714-834-3446
Last EDR Contact: 02/05/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Quarterly

PLACER COUNTY:

Master List of Facilities

List includes aboveground tanks, underground tanks and cleanup sites.

Date of Government Version: 11/29/2018
Date Data Arrived at EDR: 12/04/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 38

Source: Placer County Health and Human Services
Telephone: 530-745-2363
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Semi-Annually

PLUMAS COUNTY:

CUPA Facility List

Plumas County CUPA Program facilities.

Date of Government Version: 01/14/2019
Date Data Arrived at EDR: 01/18/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 46

Source: Plumas County Environmental Health
Telephone: 530-283-6355
Last EDR Contact: 01/17/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

RIVERSIDE COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Listing of Underground Tank Cleanup Sites

Riverside County Underground Storage Tank Cleanup Sites (LUST).

Date of Government Version: 01/29/2019

Date Data Arrived at EDR: 01/31/2019

Date Made Active in Reports: 03/06/2019

Number of Days to Update: 34

Source: Department of Environmental Health

Telephone: 951-358-5055

Last EDR Contact: 12/17/2018

Next Scheduled EDR Contact: 04/01/2019

Data Release Frequency: Quarterly

Underground Storage Tank Tank List

Underground storage tank sites located in Riverside county.

Date of Government Version: 10/10/2018

Date Data Arrived at EDR: 10/12/2018

Date Made Active in Reports: 11/05/2018

Number of Days to Update: 24

Source: Department of Environmental Health

Telephone: 951-358-5055

Last EDR Contact: 12/17/2018

Next Scheduled EDR Contact: 04/01/2019

Data Release Frequency: Quarterly

SACRAMENTO COUNTY:

Toxic Site Clean-Up List

List of sites where unauthorized releases of potentially hazardous materials have occurred.

Date of Government Version: 11/07/2018

Date Data Arrived at EDR: 01/04/2019

Date Made Active in Reports: 03/05/2019

Number of Days to Update: 60

Source: Sacramento County Environmental Management

Telephone: 916-875-8406

Last EDR Contact: 01/04/2019

Next Scheduled EDR Contact: 04/15/2019

Data Release Frequency: Quarterly

Master Hazardous Materials Facility List

Any business that has hazardous materials on site - hazardous material storage sites, underground storage tanks, waste generators.

Date of Government Version: 11/07/2018

Date Data Arrived at EDR: 12/28/2018

Date Made Active in Reports: 03/05/2019

Number of Days to Update: 67

Source: Sacramento County Environmental Management

Telephone: 916-875-8406

Last EDR Contact: 12/28/2018

Next Scheduled EDR Contact: 04/15/2019

Data Release Frequency: Quarterly

SAN BENITO COUNTY:

CUPA Facility List

Cupa facility list

Date of Government Version: 11/15/2018

Date Data Arrived at EDR: 11/16/2018

Date Made Active in Reports: 12/13/2018

Number of Days to Update: 27

Source: San Benito County Environmental Health

Telephone: N/A

Last EDR Contact: 02/27/2019

Next Scheduled EDR Contact: 05/20/2019

Data Release Frequency: Varies

SAN BERNARDINO COUNTY:

Hazardous Material Permits

This listing includes underground storage tanks, medical waste handlers/generators, hazardous materials handlers, hazardous waste generators, and waste oil generators/handlers.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 11/28/2018
Date Data Arrived at EDR: 11/30/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 42

Source: San Bernardino County Fire Department Hazardous Materials Division
Telephone: 909-387-3041
Last EDR Contact: 02/19/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Quarterly

SAN DIEGO COUNTY:

Hazardous Materials Management Division Database

The database includes: HE58 - This report contains the business name, site address, business phone number, establishment 'H' permit number, type of permit, and the business status. HE17 - In addition to providing the same information provided in the HE58 listing, HE17 provides inspection dates, violations received by the establishment, hazardous waste generated, the quantity, method of storage, treatment/disposal of waste and the hauler, and information on underground storage tanks. Unauthorized Release List - Includes a summary of environmental contamination cases in San Diego County (underground tank cases, non-tank cases, groundwater contamination, and soil contamination are included.)

Date of Government Version: 12/03/2018
Date Data Arrived at EDR: 12/05/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 37

Source: Hazardous Materials Management Division
Telephone: 619-338-2268
Last EDR Contact: 03/05/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Quarterly

Solid Waste Facilities

San Diego County Solid Waste Facilities.

Date of Government Version: 04/18/2018
Date Data Arrived at EDR: 04/24/2018
Date Made Active in Reports: 06/19/2018
Number of Days to Update: 56

Source: Department of Health Services
Telephone: 619-338-2209
Last EDR Contact: 01/17/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

Local Oversight Program Listing

A listing of all LOP release sites that are or were under the County of San Diego's jurisdiction. Included are closed or transferred cases, open cases, and cases that did not have a case type indicated. The cases without a case type are mostly complaints; however, some of them could be LOP cases.

Date of Government Version: 10/22/2018
Date Data Arrived at EDR: 10/23/2018
Date Made Active in Reports: 11/30/2018
Number of Days to Update: 38

Source: Department of Environmental Health
Telephone: 858-505-6874
Last EDR Contact: 03/06/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

Environmental Case Listing

The listing contains all underground tank release cases and projects pertaining to properties contaminated with hazardous substances that are actively under review by the Site Assessment and Mitigation Program.

Date of Government Version: 03/23/2010
Date Data Arrived at EDR: 06/15/2010
Date Made Active in Reports: 07/09/2010
Number of Days to Update: 24

Source: San Diego County Department of Environmental Health
Telephone: 619-338-2371
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: No Update Planned

SAN FRANCISCO COUNTY:

Local Oversight Facilities

A listing of leaking underground storage tank sites located in San Francisco county.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 09/19/2008
Date Data Arrived at EDR: 09/19/2008
Date Made Active in Reports: 09/29/2008
Number of Days to Update: 10

Source: Department Of Public Health San Francisco County
Telephone: 415-252-3920
Last EDR Contact: 01/31/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Quarterly

Underground Storage Tank Information

Underground storage tank sites located in San Francisco county.

Date of Government Version: 11/05/2018
Date Data Arrived at EDR: 11/06/2018
Date Made Active in Reports: 12/14/2018
Number of Days to Update: 38

Source: Department of Public Health
Telephone: 415-252-3920
Last EDR Contact: 01/31/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Quarterly

SAN JOAQUIN COUNTY:

San Joaquin Co. UST

A listing of underground storage tank locations in San Joaquin county.

Date of Government Version: 06/22/2018
Date Data Arrived at EDR: 06/26/2018
Date Made Active in Reports: 07/11/2018
Number of Days to Update: 15

Source: Environmental Health Department
Telephone: N/A
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 04/01/2019
Data Release Frequency: Semi-Annually

SAN LUIS OBISPO COUNTY:

CUPA Facility List

Cupa Facility List.

Date of Government Version: 11/14/2018
Date Data Arrived at EDR: 11/15/2018
Date Made Active in Reports: 12/13/2018
Number of Days to Update: 28

Source: San Luis Obispo County Public Health Department
Telephone: 805-781-5596
Last EDR Contact: 02/13/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Varies

SAN MATEO COUNTY:

Business Inventory

List includes Hazardous Materials Business Plan, hazardous waste generators, and underground storage tanks.

Date of Government Version: 12/03/2018
Date Data Arrived at EDR: 12/12/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 34

Source: San Mateo County Environmental Health Services Division
Telephone: 650-363-1921
Last EDR Contact: 12/12/2018
Next Scheduled EDR Contact: 03/25/2019
Data Release Frequency: Annually

Fuel Leak List

A listing of leaking underground storage tank sites located in San Mateo county.

Date of Government Version: 12/13/2018
Date Data Arrived at EDR: 12/18/2018
Date Made Active in Reports: 01/23/2019
Number of Days to Update: 36

Source: San Mateo County Environmental Health Services Division
Telephone: 650-363-1921
Last EDR Contact: 09/10/2018
Next Scheduled EDR Contact: 12/24/2018
Data Release Frequency: Semi-Annually

SANTA BARBARA COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA Facility Listing

CUPA Program Listing from the Environmental Health Services division.

Date of Government Version: 09/08/2011
Date Data Arrived at EDR: 09/09/2011
Date Made Active in Reports: 10/07/2011
Number of Days to Update: 28

Source: Santa Barbara County Public Health Department
Telephone: 805-686-8167
Last EDR Contact: 02/13/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Varies

SANTA CLARA COUNTY:

Cupa Facility List

Cupa facility list

Date of Government Version: 02/13/2019
Date Data Arrived at EDR: 02/19/2019
Date Made Active in Reports: 03/06/2019
Number of Days to Update: 15

Source: Department of Environmental Health
Telephone: 408-918-1973
Last EDR Contact: 02/13/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Varies

HIST LUST - Fuel Leak Site Activity Report

A listing of open and closed leaking underground storage tanks. This listing is no longer updated by the county. Leaking underground storage tanks are now handled by the Department of Environmental Health.

Date of Government Version: 03/29/2005
Date Data Arrived at EDR: 03/30/2005
Date Made Active in Reports: 04/21/2005
Number of Days to Update: 22

Source: Santa Clara Valley Water District
Telephone: 408-265-2600
Last EDR Contact: 03/23/2009
Next Scheduled EDR Contact: 06/22/2009
Data Release Frequency: No Update Planned

LOP Listing

A listing of leaking underground storage tanks located in Santa Clara county.

Date of Government Version: 03/03/2014
Date Data Arrived at EDR: 03/05/2014
Date Made Active in Reports: 03/18/2014
Number of Days to Update: 13

Source: Department of Environmental Health
Telephone: 408-918-3417
Last EDR Contact: 02/21/2019
Next Scheduled EDR Contact: 06/10/2019
Data Release Frequency: Annually

Hazardous Material Facilities

Hazardous material facilities, including underground storage tank sites.

Date of Government Version: 11/01/2018
Date Data Arrived at EDR: 11/06/2018
Date Made Active in Reports: 12/14/2018
Number of Days to Update: 38

Source: City of San Jose Fire Department
Telephone: 408-535-7694
Last EDR Contact: 01/31/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Annually

SANTA CRUZ COUNTY:

CUPA Facility List

CUPA facility listing.

Date of Government Version: 01/21/2017
Date Data Arrived at EDR: 02/22/2017
Date Made Active in Reports: 05/23/2017
Number of Days to Update: 90

Source: Santa Cruz County Environmental Health
Telephone: 831-464-2761
Last EDR Contact: 02/13/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Varies

SHASTA COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA Facility List

Cupa Facility List.

Date of Government Version: 06/15/2017
Date Data Arrived at EDR: 06/19/2017
Date Made Active in Reports: 08/09/2017
Number of Days to Update: 51

Source: Shasta County Department of Resource Management
Telephone: 530-225-5789
Last EDR Contact: 02/13/2019
Next Scheduled EDR Contact: 06/03/2019
Data Release Frequency: Varies

SOLANO COUNTY:

Leaking Underground Storage Tanks

A listing of leaking underground storage tank sites located in Solano county.

Date of Government Version: 11/29/2018
Date Data Arrived at EDR: 12/04/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 38

Source: Solano County Department of Environmental Management
Telephone: 707-784-6770
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Quarterly

Underground Storage Tanks

Underground storage tank sites located in Solano county.

Date of Government Version: 11/29/2018
Date Data Arrived at EDR: 12/04/2018
Date Made Active in Reports: 12/14/2018
Number of Days to Update: 10

Source: Solano County Department of Environmental Management
Telephone: 707-784-6770
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Quarterly

SONOMA COUNTY:

Cupa Facility List

Cupa Facility list

Date of Government Version: 12/21/2018
Date Data Arrived at EDR: 12/27/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 19

Source: County of Sonoma Fire & Emergency Services Department
Telephone: 707-565-1174
Last EDR Contact: 12/19/2018
Next Scheduled EDR Contact: 04/08/2019
Data Release Frequency: Varies

Leaking Underground Storage Tank Sites

A listing of leaking underground storage tank sites located in Sonoma county.

Date of Government Version: 01/08/2019
Date Data Arrived at EDR: 01/10/2019
Date Made Active in Reports: 03/06/2019
Number of Days to Update: 55

Source: Department of Health Services
Telephone: 707-565-6565
Last EDR Contact: 01/07/2019
Next Scheduled EDR Contact: 04/08/2019
Data Release Frequency: Quarterly

STANISLAUS COUNTY:

CUPA Facility List

Cupa facility list

Date of Government Version: 12/11/2018
Date Data Arrived at EDR: 12/13/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 33

Source: Stanislaus County Department of Environmental Protection
Telephone: 209-525-6751
Last EDR Contact: 12/13/2018
Next Scheduled EDR Contact: 04/29/2019
Data Release Frequency: Varies

SUTTER COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Underground Storage Tanks

Underground storage tank sites located in Sutter county.

Date of Government Version: 09/18/2018
Date Data Arrived at EDR: 09/20/2018
Date Made Active in Reports: 10/25/2018
Number of Days to Update: 35

Source: Sutter County Environmental Health Services
Telephone: 530-822-7500
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Semi-Annually

TEHAMA COUNTY:

CUPA Facility List

Cupa facilities

Date of Government Version: 12/13/2018
Date Data Arrived at EDR: 12/18/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 28

Source: Tehama County Department of Environmental Health
Telephone: 530-527-8020
Last EDR Contact: 01/31/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Varies

TRINITY COUNTY:

CUPA Facility List

Cupa facility list

Date of Government Version: 01/18/2019
Date Data Arrived at EDR: 01/23/2019
Date Made Active in Reports: 03/06/2019
Number of Days to Update: 42

Source: Department of Toxic Substances Control
Telephone: 760-352-0381
Last EDR Contact: 01/17/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

TULARE COUNTY:

CUPA Facility List

Cupa program facilities

Date of Government Version: 12/26/2018
Date Data Arrived at EDR: 12/27/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 19

Source: Tulare County Environmental Health Services Division
Telephone: 559-624-7400
Last EDR Contact: 01/31/2019
Next Scheduled EDR Contact: 05/20/2019
Data Release Frequency: Varies

TUOLUMNE COUNTY:

CUPA Facility List

Cupa facility list

Date of Government Version: 04/23/2018
Date Data Arrived at EDR: 04/25/2018
Date Made Active in Reports: 06/25/2018
Number of Days to Update: 61

Source: Division of Environmental Health
Telephone: 209-533-5633
Last EDR Contact: 02/27/2019
Next Scheduled EDR Contact: 05/06/2019
Data Release Frequency: Varies

VENTURA COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Business Plan, Hazardous Waste Producers, and Operating Underground Tanks

The BWT list indicates by site address whether the Environmental Health Division has Business Plan (B), Waste Producer (W), and/or Underground Tank (T) information.

Date of Government Version: 12/26/2018	Source: Ventura County Environmental Health Division
Date Data Arrived at EDR: 01/24/2019	Telephone: 805-654-2813
Date Made Active in Reports: 02/28/2019	Last EDR Contact: 01/22/2019
Number of Days to Update: 35	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Quarterly

Inventory of Illegal Abandoned and Inactive Sites

Ventura County Inventory of Closed, Illegal Abandoned, and Inactive Sites.

Date of Government Version: 12/01/2011	Source: Environmental Health Division
Date Data Arrived at EDR: 12/01/2011	Telephone: 805-654-2813
Date Made Active in Reports: 01/19/2012	Last EDR Contact: 12/26/2018
Number of Days to Update: 49	Next Scheduled EDR Contact: 04/15/2019
	Data Release Frequency: Annually

Listing of Underground Tank Cleanup Sites

Ventura County Underground Storage Tank Cleanup Sites (LUST).

Date of Government Version: 05/29/2008	Source: Environmental Health Division
Date Data Arrived at EDR: 06/24/2008	Telephone: 805-654-2813
Date Made Active in Reports: 07/31/2008	Last EDR Contact: 02/07/2019
Number of Days to Update: 37	Next Scheduled EDR Contact: 05/27/2019
	Data Release Frequency: Quarterly

Medical Waste Program List

To protect public health and safety and the environment from potential exposure to disease causing agents, the Environmental Health Division Medical Waste Program regulates the generation, handling, storage, treatment and disposal of medical waste throughout the County.

Date of Government Version: 09/25/2018	Source: Ventura County Resource Management Agency
Date Data Arrived at EDR: 10/25/2018	Telephone: 805-654-2813
Date Made Active in Reports: 11/30/2018	Last EDR Contact: 01/22/2019
Number of Days to Update: 36	Next Scheduled EDR Contact: 05/06/2019
	Data Release Frequency: Quarterly

Underground Tank Closed Sites List

Ventura County Operating Underground Storage Tank Sites (UST)/Underground Tank Closed Sites List.

Date of Government Version: 11/26/2018	Source: Environmental Health Division
Date Data Arrived at EDR: 12/12/2018	Telephone: 805-654-2813
Date Made Active in Reports: 01/16/2019	Last EDR Contact: 12/12/2018
Number of Days to Update: 35	Next Scheduled EDR Contact: 03/25/2019
	Data Release Frequency: Quarterly

YOLO COUNTY:

Underground Storage Tank Comprehensive Facility Report

Underground storage tank sites located in Yolo county.

Date of Government Version: 12/26/2018	Source: Yolo County Department of Health
Date Data Arrived at EDR: 01/03/2019	Telephone: 530-666-8646
Date Made Active in Reports: 01/16/2019	Last EDR Contact: 12/26/2018
Number of Days to Update: 13	Next Scheduled EDR Contact: 04/15/2019
	Data Release Frequency: Annually

YUBA COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA Facility List

CUPA facility listing for Yuba County.

Date of Government Version: 02/08/2019

Date Data Arrived at EDR: 02/12/2019

Date Made Active in Reports: 03/06/2019

Number of Days to Update: 22

Source: Yuba County Environmental Health Department

Telephone: 530-749-7523

Last EDR Contact: 01/28/2019

Next Scheduled EDR Contact: 05/11/2019

Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

Oil/Gas Pipelines

Source: PennWell Corporation

Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Electric Power Transmission Line Data

Source: PennWell Corporation

This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Daycare Centers: Licensed Facilities
Source: Department of Social Services
Telephone: 916-657-4041

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA
Telephone: 877-336-2627
Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory
Source: Department of Fish & Game
Telephone: 916-445-0411

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

Appendix C
Electuator Records

HAZARDOUS SUBSTANCE STORAGE CONTAINER INFORMATION FOR SAN DIEGO COUNTY

CONTAINER TYPES: 1, 2, 3, 4, 5

(1=FARM MOTOR VEHICLE FUEL TANKS, 2=ALL OTHER PRODUCT TANKS, 3=WASTE TANKS, 4=SUMPS, 5=PITS, PONDS, LAGOONS & OTHERS)

I OWNER

SPIDER'S AIRCRAFT SERVICE INC.
BLD 119 MONTGOMERY FIELD

SAN DIEGO

CA 92123

II FACILITY

SPIDER'S AIRCRAFT SER INC.
BLD 119 MONTGOMERY FIELD
SAN DIEGO CA 92123MAILING ADDRESS
TOWNSHIP/RANGE/SECTIONBLD 119 MONTGOMERY FIELD
SAN DIEGO CA 92123DEALER/FOREMAN/SUPERVISOR
TELEPHONE

FRANK SCHOSSOW

(619) 277-0312

TYPE OF BUSINESS
NO. OF CONTAINERS

AIRCRAFT SERVICE

2

CROSS STREET :
AERO DRIVE

III 24-HR. CONTACT PERSON / TELEPHONE

DAY: SCHOSSOW FRANK

(619) 277-0312

NIGHT:

(619) 276-5320

***** OWNER ASSIGNED CONTAINER NUMBER: 2

***** STATE BOARD ASSIGNED CONTAINER ID NUMBER: 00000037331001 *****

IV DESCRIPTION

A. CONTAINER TYPE : TANK

B. MANUFACTURER/YR OF MFG: /

C. YEAR INSTALLED : UNK

D. CAPACITY (GALLONS) : 250

E. REPAIRS : NONE IF YES WHEN :

F. CURRENTLY USED : YES IF NO, YEAR OF LAST USE:

G. STORES : WASTE

H. MOTOR VEHICLE FUEL/WASTE OIL : YES CONTAINS: WASTE OIL

IS CONTAINER LOCATED ON A FARM : NO

V CONTAINER CONSTRUCTION

A. THICKNESS:

B. VAULTING: NON-VAULTED

C. WALLING: UNKNOWN

D. MATERIAL : UNKNOWN

E. LINING : UNKNOWN

F. WRAPPING : UNKNOWN

VI PIPING

A. ABOVEGROUND PIPING : UNKNOWN

B. UNDERGROUND PIPING :

C. REPAIRS : NONE IF YES, YEAR OF MOST RECENT REPAIR:

VII LEAK DETECTION

NONE

URE TEST COMPOSITION OF SUBSTANCES CURRENTLY STORED IN CONTAINER

12035

WASTE OIL

*** M14 ***

CONTAINER TYPES: 1, 2, 3, 4, 5

(1=FARM MOTOR VEHICLE FUEL TANKS, 2=ALL OTHER PRODUCT TANKS, 3=WASTE TANKS, 4=SUMPS, 5=PITS, PONDS, LAGOONS & OTHERS)

***** OWNER ASSIGNED CONTAINER NUMBER: 1

***** STATE BOARD ASSIGNED CONTAINER ID NUMBER: 00000037331002 *****

IV DESCRIPTION

A. CONTAINER TYPE : TANK

B. MANUFACTURER/YR OF MFG: /

C. YEAR INSTALLED : UNK

D. CAPACITY (GALLONS) : 550

E. REPAIRS : NONE IF YES WHEN :

F. CURRENTLY USED : YES IF NO, YEAR OF LAST USE:

G. STORES : PRODUCT

H. MOTOR VEHICLE FUEL/WASTE OIL : NO CONTAINS:

IS CONTAINER LOCATED ON A FARM : NO

V CONTAINER CONSTRUCTION

A. THICKNESS:

B. VAULTING: NON-VAULTED

C. WALLING: UNKNOWN

D. MATERIAL : UNKNOWN

E. LINING : UNKNOWN

F. WRAPPING : UNKNOWN

VI PIPING

A. ABOVEGROUND PIPING : UNKNOWN

B. UNDERGROUND PIPING :

C. REPAIRS : NONE IF YES, YEAR OF MOST RECENT REPAIR:

VII LEAK DETECTION

NONE

URE TEST

COMPOSITION OF SUBSTANCES CURRENTLY STORED IN CONTAINER
SOLVENTS

PAGE 2189

STATE WATER RESOURCES CONTROL BOARD
HAZARDOUS SUBSTANCE STORAGE CONTAINER INFORMATION FOR SAN DIEGO COUNTY

06/01/89

CONTAINER TYPES: 1, 2, 3, 4, 5
(1=FARM MOTOR VEHICLE FUEL TANKS, 2=ALL OTHER PRODUCT TANKS, 3=WASTE TANKS, 4=SUMPS, 5=PITS, PONDS, LAGOONS & OTHERS)

I OWNER
FEDERAL AVIATION ADMINISTRATIO
8575 GIBBS DRIVE, SUITE 101

SAN DIEGO

CA 92123

II FACILITY

SEAL BEACH VORAC
8575 GIBBS DRIVE, SUITE 101
SAME CA 92123

MAILING ADDRESS
TOWNSHIP/RANGE/SECTION

8575 GIBBS DRIVE, SUITE 101
SAME CA 92123

DEALER/FOREMAN/SUPERVISOR
TELEPHONE

(619) 293-5271

TYPE OF BUSINESS
NO. OF CONTAINERS

STANDBY POWER

1

CROSS STREET :

III 24-HR. CONTACT PERSON / TELEPHONE
DAY: KING, MATTHEW

(619) 293-5271

NIGHT: WATCH SUPERVISOR

(619) 293-5530

***** OWNER ASSIGNED CONTAINER NUMBER: 1

***** STATE BOARD ASSIGNED CONTAINER ID NUMBER: 00000058816001 *****

IV DESCRIPTION

A. CONTAINER TYPE : TANK
B. MANUFACTURER/YR OF MFG :
C. YEAR INSTALLED : UNK
D. CAPACITY (GALLONS) : 515

E. REPAIRS : NONE IF YES WHEN :
F. CURRENTLY USED : YES IF NO, YEAR OF LAST USE:
G. STORES : PRODUCT
H. MOTOR VEHICLE FUEL/WASTE OIL : YES CONTAINS: UNLEADED

IS CONTAINER LOCATED ON A FARM : NO

V CONTAINER CONSTRUCTION

A. THICKNESS:
D. MATERIAL : CARBON STEEL
E. LINING : UNKNOWN
F. WRAPPING : UNKNOWN

B. VAULTING: NON-VAULTED C. WALLING: UNKNOWN

VI PIPING

A. ABOVEGROUND PIPING :
C. REPAIRS : NONE IF YES, YEAR OF MOST RECENT REPAIR:
B. UNDERGROUND PIPING : SUCTON

VII LEAK DETECTION
NONE

12031 COMPOSITION OF SUBSTANCES CURRENTLY STORED IN CONTAINER
UNLEADED MOTOR VEHICLE FUEL



County of San Diego

GARY W. ERBECK
DIRECTOR

DEPARTMENT OF ENVIRONMENTAL HEALTH
P.O. BOX 129281, SAN DIEGO, CA 92112-9281
(619) 338-2222 FAX (619) 338-2088
1-800-253-9933
www.sdcdeh.org

JACK MILLER
ASSISTANT DIRECTOR

December 21, 2006

Mr. Jerry Groomes
City of San Diego Airports Div.
3750 John J. Montgomery Dr.
San Diego, CA 92123

Mr. Craig Fergusson
City of San Diego Environmental Services
9601 Ridgehaven Ct., Ste. 310
San Diego, CA 92123-1636

Mr. William E. Gibbs
Gibbs Flying Service
8906 Aero Drive
San Diego, CA 92123

Dear Responsible Parties:

UNDERGROUND STORAGE TANK (UST) CASE H21291-001
GIBBS FLYING SERVICE, MONTGOMERY FIELD
SAN DIEGO, CA 92123

This letter confirms the completion of a site investigation and corrective action for the underground storage tanks formerly located at the above-described location. Thank you for your cooperation throughout this investigation. Your willingness and promptness in responding to our inquiries concerning the former underground storage tanks is greatly appreciated.

Based on information in the above-referenced file and with the provision that the information provided to this agency was accurate and representative of site conditions, this agency finds that the site investigation and corrective action carried out at your underground storage tank site is in compliance with the requirements of subdivisions (a) and (b) of Section 25296.10 of the Health and Safety Code and with corrective action regulations adopted pursuant to Section 25299.3 of the Health and Safety Code and that no further action related to the petroleum release at the site is required.

This notice is issued pursuant to subdivision (g) of Section 25296.10 of the Health and Safety Code. Please contact David Felix, at (619) 338-2258, if you have questions regarding this matter.

Sincerely,

GARY W. ERBECK, Director
Department of Environmental Health
Site Assessment and Mitigation Program

GWE:DF:kd

Enclosure

cc: John Odermatt, Regional Water Quality Control Board
Ron Duff, SWRCB, UST Cleanup Fund Program

WP/H21291-001-1206CLO

Case Closure Summary

Leaking Underground Fuel Storage Tank Program

I. AGENCY INFORMATION

DATE: December 15, 2006

Agency Name: COUNTY OF SAN DIEGO, ENVIRONMENTAL HEALTH, SAM	Address: P.O. BOX 129261
City/State/Zip: SAN DIEGO, CA 92112-9261	Phone: (619) 338-2222 FAX: (619) 338-2377
Responsible Staff Person: DAVID FELIX	Title: ENVIRONMENTAL HEALTH SPECIALIST III

II. CASE INFORMATION

Site Facility Name: GIBBS FLYING SERVICE-MONTGOMERY FIELD																	
Site Facility Address: 3750 JOHN J MONTGOMERY DR, SAN DIEGO, CA 92123-1733 *																	
RB LUSTIS Case No: 9UT1011	Local Case No: H21291-001	LOP Case No: N/A															
URF Filing Date: 7/12/1988	SWEEPS No: N/A																
<table style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="text-align: left;">Responsible Parties</th> <th style="text-align: left;">Address</th> <th style="text-align: left;">Phone Number</th> </tr> </thead> <tbody> <tr> <td>GIBBS FLYING SERVICE WILLIAM GIBBS</td> <td>8906 AERO DR SAN DIEGO, CA 92123</td> <td>858-277-0310</td> </tr> <tr> <td>CITY OF SAN DIEGO, AIRPORTS DIVISION ATTN: JERRY GROOMES</td> <td>3750 JOHN J. MONTGOMERY DR SAN DIEGO, A 92123</td> <td></td> </tr> <tr> <td>CITY OF SAN DIEGO, ENVIRONMENTAL SERVICES ATTN: CRAIG FERGUSON</td> <td>9601 RIDGEHAVEN COURT SUITE 320 SAN DIEGO, CA 92123-1636</td> <td>858-627-3311</td> </tr> </tbody> </table>			Responsible Parties	Address	Phone Number	GIBBS FLYING SERVICE WILLIAM GIBBS	8906 AERO DR SAN DIEGO, CA 92123	858-277-0310	CITY OF SAN DIEGO, AIRPORTS DIVISION ATTN: JERRY GROOMES	3750 JOHN J. MONTGOMERY DR SAN DIEGO, A 92123		CITY OF SAN DIEGO, ENVIRONMENTAL SERVICES ATTN: CRAIG FERGUSON	9601 RIDGEHAVEN COURT SUITE 320 SAN DIEGO, CA 92123-1636	858-627-3311			
Responsible Parties	Address	Phone Number															
GIBBS FLYING SERVICE WILLIAM GIBBS	8906 AERO DR SAN DIEGO, CA 92123	858-277-0310															
CITY OF SAN DIEGO, AIRPORTS DIVISION ATTN: JERRY GROOMES	3750 JOHN J. MONTGOMERY DR SAN DIEGO, A 92123																
CITY OF SAN DIEGO, ENVIRONMENTAL SERVICES ATTN: CRAIG FERGUSON	9601 RIDGEHAVEN COURT SUITE 320 SAN DIEGO, CA 92123-1636	858-627-3311															
<table style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="text-align: left;">Tank No.</th> <th style="text-align: left;">Size in Gal.</th> <th style="text-align: left;">Contents</th> <th style="text-align: left;">Status</th> <th style="text-align: left;">Date</th> </tr> </thead> <tbody> <tr> <td>T001</td> <td>10000 gallons</td> <td>AVIATION GAS</td> <td>CLOSED BY REMOVAL</td> <td>7/7/88</td> </tr> <tr> <td>T002</td> <td>10000 gallons</td> <td>AVIATION GAS</td> <td>CLOSED BY REMOVAL</td> <td>7/7/88</td> </tr> </tbody> </table>			Tank No.	Size in Gal.	Contents	Status	Date	T001	10000 gallons	AVIATION GAS	CLOSED BY REMOVAL	7/7/88	T002	10000 gallons	AVIATION GAS	CLOSED BY REMOVAL	7/7/88
Tank No.	Size in Gal.	Contents	Status	Date													
T001	10000 gallons	AVIATION GAS	CLOSED BY REMOVAL	7/7/88													
T002	10000 gallons	AVIATION GAS	CLOSED BY REMOVAL	7/7/88													

III. RELEASE AND SITE CHARACTERIZATION INFORMATION

Cause Release: OTHER CAUSE, SUBSTANCE RELEASED FROM PIPING	Substance Released: GASOLINE (AVIATION)																				
Site Characterization complete: YES	Date Approved By Oversight Agency: 10/27/2006																				
Monitoring Wells Installed? NO	Number: 0 Proper Screened Interval? NA																				
Highest GW Depth B.G. Surface: 100 (ESTIMATED)	Lowest Depth: UNKNOWN Flow Direction: UNKNOWN																				
Most Sensitive Current Use: Existing Beneficial Groundwater Use: AGR, IND, PROC and Potential: MUN Existing Beneficial Surface Water Use: AGR, IND, REC1, REC2																					
Are Drinking Water Wells Affected? NO	Aquifer Name: 907.11-Mission San Diego Hydrologic Sub Area																				
Is Surface Water Affected? NO	Nearest SW name: Greater than 0.5 miles																				
Off-Site Beneficial Use Impacts (addresses/locations): NA																					
Report(s) on file? YES	Where is Report(s) Filed? COUNTY OF SAN DIEGO, ENVIRONMENTAL HEALTH																				
TREATMENT AND DISPOSAL OF AFFECTED MATERIAL																					
<table style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="text-align: left;">Material</th> <th style="text-align: left;">Amount (Include Units)</th> <th style="text-align: left;">Action (Treatment or Disposal)</th> <th style="text-align: left;">Date</th> </tr> </thead> <tbody> <tr> <td>WATER</td> <td>800 GALLON</td> <td>TREAT OFF-SITE</td> <td>7/7/1988</td> </tr> <tr> <td>TANK(S)</td> <td>2 NA</td> <td>UNKNOWN</td> <td>7/7/1988</td> </tr> <tr> <td>SOIL</td> <td>200 CUBIC YARD</td> <td>TREAT ON-SITE</td> <td>7/7/1988</td> </tr> <tr> <td>SOIL</td> <td>245 CUBIC YARD</td> <td>TREAT ON-SITE</td> <td>7/9/1990</td> </tr> </tbody> </table>		Material	Amount (Include Units)	Action (Treatment or Disposal)	Date	WATER	800 GALLON	TREAT OFF-SITE	7/7/1988	TANK(S)	2 NA	UNKNOWN	7/7/1988	SOIL	200 CUBIC YARD	TREAT ON-SITE	7/7/1988	SOIL	245 CUBIC YARD	TREAT ON-SITE	7/9/1990
Material	Amount (Include Units)	Action (Treatment or Disposal)	Date																		
WATER	800 GALLON	TREAT OFF-SITE	7/7/1988																		
TANK(S)	2 NA	UNKNOWN	7/7/1988																		
SOIL	200 CUBIC YARD	TREAT ON-SITE	7/7/1988																		
SOIL	245 CUBIC YARD	TREAT ON-SITE	7/9/1990																		

Leaking Underground Fuel Storage Tank Program

III. RELEASE AND SITE CHARACTERIZATION INFORMATION (Continued)

H21291-001

MAXIMUM DOCUMENTED CONTAMINANT CONCENTRATIONS	MAXIMUM	REMAINING
SOIL		
Gasoline	= 8356 mg/kg	= 3226 mg/kg
Benzene	< 1 mg/kg	< 1 mg/kg
Toluene	= 12 mg/kg	= 12 mg/kg
Ethyl benzene	= 11 mg/kg	= 11 mg/kg
Xylene (individual isomers or total)	= 48 mg/kg	= 48 mg/kg
Organic Lead	< .25 mg/kg	<.25 mg/kg

Case opened in July 1988 after two UST's were removed and soil contamination was found under the product piping. Initial sampling in the side walls of the excavation showed high TPH at 17 feet. Assessment was attempted using borings, but the cobbles of the Linda Vista formation could not be penetrated. Trenches were dug in the base of the excavation to a depth of 26 feet and soil samples were obtained. The deepest sample taken from 23 feet showed 3226 mg/kg TPHg; shallower samples had significantly higher TPH, suggesting decreasing trend with depth. In July 1990 the excavation was deepened to 31 feet and enlarged laterally in an attempt to remove soil contamination in excess of 1000 mg/kg which had been established by DEH/SAM and the RWQCB as the cleanup level. Confirmation soil samples were taken, but the samples were not handled properly and were not analyzed.


As estimated 245 yards of stockpiled soil was left on the airport property. In September 1996 this soil was analyzed and found to contain non detectable TPH (<1 mg/kg) and 0.007 mg/kg benzene. Using SW846 statistical analysis, the soil was found to meet the standards of the time for leaving soil on the site (<100 mg/kg). Consultant concluded that because of the decreasing TPH values with depth in the top 26 feet, and observations made during the deeper excavation, the soil cleanup level of 1000 mg/kg was probably attained. Consultant recommended that stockpiled soil be used for fill on the Airport property. Stockpiles remain at the airport as of the date of this summary. Actual location of the tanks is 32 deg 48 min 50.6 sec north, 117 deg 08 min 29.0 sec west.

DEH did not respond to the final consultant's report in November 1996 and the case lay dormant until October 2006. At that time, the case was reviewed, administrative reports and notifications required by changes in the UST laws/ regulations were made, responsible parties were contacted, and the case was closed based on the absence of human or environmental risk.

IV. CLOSURE

Does completed corrective action protect existing beneficial uses per the Regional Board Basin Plan? YES - Assessment and cleanup were done simultaneously. No directive to cleanup ever given by DEH. CAP not required at that time.		
Does completed corrective action protect potential beneficial uses per the Regional Board Basin Plan? YES		
Does corrective action protect public health for current land use? YES		
Case oversight completed based upon the following site use: INDUSTRIAL -- Airplane parking		
Site Management Requirements: ANY CONTAMINATED SOIL EXCAVATED AS PART OF SUBSURFACE CONSTRUCTION WORK MUST BE MANAGED IN ACCORDANCE WITH THE LEGAL REQUIREMENTS AT THAT TIME.		
Should corrective action be reviewed if land use changes? YES		
Monitoring Wells Decommissioned: NA	Number Decommissioned: 0	Number Retained: 0
List Actions Taken: NOTICE OF REIMBURSEMENT / LOCAL		
List Enforcement Actions Rescinded: NONE		

V. LOCAL AGENCY REPRESENTATIVE DATA

Name: TONY SAWYER	Title: HYDROGEOLOGIST
Signature: 	Date: 12-21-06

VI. RWQCB NOTIFICATION

Date Submitted to RB: Soil only - not submitted	RB Response:	
RWQCB Staff Name:	Title:	Date:

VII. ADDITIONAL COMMENTS, DATA, ETC.

* Actual location of tank and dispenser is approximately 100 feet north of the front entrance of the Crownair Terminal building, on the south side of a 50 foot diameter circle of concrete.

This document and the related CASE CLOSURE LETTER, shall be retained by the lead agency as part of the official site file.



County of San Diego

GARY W. ERBECK
DIRECTOR

DEPARTMENT OF ENVIRONMENTAL HEALTH
LAND AND WATER QUALITY DIVISION

P.O. BOX 129261, SAN DIEGO, CA 92112-9261
619-338-2222/FAX 619-338-2315/1-800-253-9933

www.sdcounty.ca.gov/deh/lwq

JACK MILLER
ASSISTANT DIRECTOR

DETERMINATION OF NO FURTHER ACTION AND PROPOSED SITE CLOSURE

November 30, 2006

Mr. Jerry Groomes
City of San Diego Airports Division
3750 John J. Montgomery Drive
San Diego, CA 92123

Dear Mr. Groomes:

INTENT TO MAKE A DETERMINATION THAT NO FURTHER ACTION IS REQUIRED AND ISSUE
A CLOSURE LETTER FOR GIBBS FLYING SERVICE – MONTGOMERY FIELD
3750 JOHN J. MONTGOMERY DRIVE, SAN DIEGO, CA 92123
UNAUTHORIZED RELEASE H21291-001

This letter is to inform you that the County of San Diego, Department of Environmental Health (DEH), Site Assessment and Mitigation Program (SAM), intends to make a determination that no further action is required at the above site and to issue a closure letter. Please notify this agency of any input you may have on these proposed actions within 15 days of the date on this letter.

If you have any questions about these proposed actions, please contact the undersigned at 619/338-2258.

Sincerely,

DAVID FELIX, Project Manager
Site Assessment and Mitigation Program

DF:kd

CERTIFIED/RRR

cc: Jenniffer Jorden, State Water Resources Control Board
RWQCB, Underground Storage Tank Program

WP/H21291-001-1106DNFAJG



County of San Diego

GARY W. ERBECK
DIRECTOR

DEPARTMENT OF ENVIRONMENTAL HEALTH
LAND AND WATER QUALITY DIVISION

P.O. BOX 129261, SAN DIEGO, CA 92112-9261
619-338-2222/FAX 619-338-2315/1-800-253-9933

www.sdcountry.ca.gov/deh/lwq

JACK MILLER
ASSISTANT DIRECTOR

DETERMINATION OF NO FURTHER ACTION AND PROPOSED SITE CLOSURE

November 30, 2006

Mr. Craig Fergusson
City of San Diego Environmental Services
9601 Ridgehaven Court, Suite 320
San Diego, CA 92123-1636

Dear Mr. Fergusson:

INTENT TO MAKE A DETERMINATION THAT NO FURTHER ACTION IS REQUIRED AND ISSUE
A CLOSURE LETTER FOR GIBBS FLYING SERVICE – MONTGOMERY FIELD
3750 JOHN J. MONTGOMERY DRIVE, SAN DIEGO, CA 92123
UNAUTHORIZED RELEASE H21291-001

This letter is to inform you that the County of San Diego, Department of Environmental Health (DEH), Site Assessment and Mitigation Program (SAM), intends to make a determination that no further action is required at the above site and to issue a closure letter. Please notify this agency of any input you may have on these proposed actions within 15 days of the date on this letter.

If you have any questions about these proposed actions, please contact the undersigned at 619/338-2258.

Sincerely,

DAVID FELIX, Project Manager
Site Assessment and Mitigation Program

DF:kd

CERTIFIED/RRR

cc: Jenniffer Jorden, State Water Resources Control Board
RWQCB, Underground Storage Tank Program

WP/H21291-001-1105DNFACF



County of San Diego

GARY W. ERBECK
DIRECTOR

DEPARTMENT OF ENVIRONMENTAL HEALTH
P.O. BOX 129261, SAN DIEGO, CA 92112-9261
(619) 338-2222 FAX (619) 338-2038
1-800-253-9933
www.sdcdeh.org

RICHARD HAAS
ASSISTANT DIRECTOR

April 22, 2004

Mr. Ted Olson
City of San Diego
Environmental Services
9601 Ridgehaven Ct., Ste. 310
San Diego, CA 92123-1636

Dear Mr. Olson:

CLOSURE OF UNDERGROUND STORAGE TANK CASE H21291-002
MONTGOMERY FIELD - GASOLINE TANK NEXT TO GENERATOR SHED
3750 JOHN J. MONTGOMERY DRIVE, SAN DIEGO, CA 92123-1733

This letter confirms the completion of a site investigation and corrective action for the underground storage tank formerly located at the above-described location. Thank you for your cooperation throughout this investigation. Your willingness and promptness in responding to our inquiries concerning the former underground storage tank is greatly appreciated.

Based on information in the above-referenced file and with the provision that the information provided to this agency was accurate and representative of site conditions, this agency finds that the site investigation and corrective action carried out at your underground storage tank site is in compliance with the requirements of subdivisions (a) and (b) of Section 25299.37 of the Health and Safety Code and with corrective action regulations adopted pursuant to Section 25299.77 of the Health and Safety Code and that no further action related to the petroleum release at the site is required.

This notice is issued pursuant to subdivision (h) of Section 25299.37 of the Health and Safety Code. Please contact David Felix at (619) 338-2258 if you have questions regarding this matter.

Sincerely,

GARY W. ERBECK, Director
Department of Environmental Health
Site Assessment and Mitigation Program

GWE:DF:kd

Enclosure

cc: Julie Chan, Regional Water Quality Control Board
Allan Patton, SWRCB, UST Cleanup Fund Program

WP/H21291-002-404CLO

Case Closure Summary **Leaking Underground Fuel Storage Tank Program**

I. AGENCY INFORMATION

DATE: April 14, 2004

Agency Name: COUNTY OF SAN DIEGO, ENVIRONMENTAL HEALTH, SAM	Address: P.O. BOX 129261
City/State/Zip: SAN DIEGO, CA 92112-9261	Phone: (619) 338-2222 FAX: (619) 338-2377
Responsible Staff Person: DAVID FELIX	Title: ENVIRONMENTAL HEALTH SPECIALIST III

II. CASE INFORMATION

Site Facility Name: CITY OF SAN DIEGO-MONTGOMERY FIELD				
Site Facility Address: 3750 JOHN J MONTGOMERY DR, SAN DIEGO, CA 921231733				
RB LUSTIS Case No: 9UT1945		Local Case No: H21291-002		LOP Case No: N/A
URF Filing Date: 3/1/1991		SWEEPS No: N/A		
Responsible Parties		Address		Phone Number
CITY OF SAN DIEGO, ENV. SER. TED OLSON		9601 RIDGEHAVEN CT #310 SAN DIEGO, CA 92123		858-573-1266
Tank No.	Size in Gal.	Contents	Status	Date
T003	50 gallons	REGULAR UNLEADED	CLOSED BY REMOVAL	2/12/91

III. RELEASE AND SITE CHARACTERIZATION INFORMATION

Cause Release: OTHER CAUSE, SUBSTANCE RELEASED FROM UST		Substance Released: GASOLINE (UNLEADED)	
Site Characterization complete: YES		Date Approved By Oversight Agency: 4/13/04*	
Monitoring Wells Installed? NO		Number: 0	Proper Screened Interval? NA
Highest GW Depth B.G. Surface: 130 (ESTIMATED)		Lowest Depth: -	Flow Direction: -
Most Sensitive Current Use: Existing Beneficial Groundwater Use: AGR, IND, PROC and Potential: MUN Existing Beneficial Surface Water Use: AGR, IND, REC1, REC2			
Are Drinking Water Wells Affected? NO		Aquifer Name: 907.11-Mission San Diego Hydrologic Sub Area	
Is Surface Water Affected? NO		Nearest SW name: >1/4 MILE	
Off-Site Beneficial Use Impacts (addresses/locations): NA			
Report(s) on file? YES		Where is Report(s) Filed? COUNTY OF SAN DIEGO, ENVIRONMENTAL HEALTH	
TREATMENT AND DISPOSAL OF AFFECTED MATERIAL			
Material	Amount (Include Units)	Action (Treatment or Disposal)	Date
TANK	1 NA	RECYCLED	2/26/1991
SOIL	20 CUBIC YARD	FILL SOIL	7/18/1991
PRODUCT/WATER	20 GALLON	TREAT OFF-SITE	2/26/1991

Case Closure Summary
Leaking Underground Fuel Storage Tank Program

III. RELEASE AND SITE CHARACTERIZATION INFORMATION (Continued)

H21291-002

MAXIMUM DOCUMENTED CONTAMINANT CONCENTRATIONS	MAXIMUM	REMAINING
SOIL		
Gasoline	= 630 mg/kg	= 91 mg/kg
Benzene	= 0.078 mg/kg	= 0.078 mg/kg
Toluene	= 0.025 mg/kg	= 0.025 mg/kg
Ethyl benzene	= 0.157 mg/kg	= 0.157 mg/kg
Xylene (individual isomers or total)	= 0.156 mg/kg	= 0.156 mg/kg
Organic Lead	< 0.5 mg/kg	< 0.5 mg/kg

Comments: This case is for a 50 gallon Joor tank which was removed in February 1991. The tank had been installed in 1981. Another tank had been in the pit before that. Based on DEH Inspector's observations, the contamination is likely to have originated from the prior tank. Approximately 20 cu yds of visibly contaminated backfill and native soil was removed from the tank pit; excavation extended to 12 feet below grade. Verification soil samples on floor and sidewalls contained less than 91 mg/kg TPH gasoline with trace levels of BTEX as shown in above table.

Excavated soil was sampled in July 1991, four samples were non detect (<10 mg/kg TPH). The soil remains on site.


Additional assessment samples were taken by hand auger in June 1994. These were taken at approximately 6 feet below grade, 8 feet to the east and 8 feet to the west of the tank excavation. Both samples contained less than 10 mg/kg TPH.

Requirements for MTBE analysis were not in effect in 1995 so there are no MTBE values. Groundwater at the nearby General Dynamics property is approximately 130 feet BGS. There are no water supply wells in the area. The possibility of groundwater impact by this release is extremely low.

IV. CLOSURE

Does completed corrective action protect existing beneficial uses per the Regional Board Basin Plan? YES		
Does completed corrective action protect potential beneficial uses per the Regional Board Basin Plan? YES -		
Does corrective action protect public health for current land use? YES		
Case oversight completed based upon the following site use: COMMERCIAL		
Site Management Requirements: ANY CONTAMINATED SOIL EXCAVATED AS PART OF SUBSURFACE CONSTRUCTION WORK MUST BE MANAGED IN ACCORDANCE WITH THE LEGAL REQUIREMENTS AT THAT TIME.		
Should corrective action be reviewed if land use changes? YES		
Monitoring Wells Decommissioned: NA	Number Decommissioned: 0	Number Retained: 0
List Actions Taken: NOTICE OF REIMBURSEMENT / LOCAL		
List Enforcement Actions Rescinded: NONE		

V. LOCAL AGENCY REPRESENTATIVE DATA

Name: TONY SAWYER	Title: HYDROGEOLOGIST
Signature: 	Date: 4-20-04

VI. RWQCB NOTIFICATION

Date Submitted to RB: Soil Only - Not submitted	RB Response:	
RWQCB Staff Name:	Title:	Date:

VII. ADDITIONAL COMMENTS, DATA, ETC.

*Data for closure of this case was submitted to DEH by June 1995 but the case was not closed. Case assigned to David Felix in February 2004 and closed in April 2004.

This document and the related CASE CLOSURE LETTER, shall be retained by the lead agency as part of the official site file.

PAGE 1493

STATE WATER RESOURCES CONTROL BOARD
HAZARDOUS SUBSTANCE STORAGE CONTAINER INFORMATION FOR RIVERSIDE COUNTY

06/01/88

CONTAINER TYPES: 1, 2, 3, 4, 5
(1=FARM MOTOR VEHICLE FUEL TANKS, 2=ALL OTHER PRODUCT TANKS, 3=WASTE TANKS, 4=SUMPS, 5=PITS, PONDS, LAGOONS & OTHERS)

I OWNER
FEDERAL AVIATION ADMINISTRATIO
8665 GIBBS DRIVE-SUITE 100

SAN DIEGO

CA 92123

II FACILITY

TRM RCO
8665 GIBBS DRIVE-SUITE 100
THERMAL CA 92123

MAILING ADDRESS
TOWNSHIP/RANGE/SECTION

8665 GIBBS DRIVE
SAN DIEGO

CA 92123

DEALER/FOREMAN/SUPERVISOR
TELEPHONE

MATT KING

(619) 293-5271

TYPE OF BUSINESS
NO. OF CONTAINERS

STANDBY ENGINE GENER

1

CROSS STREET :

III 24-HR. CONTACT PERSON / TELEPHONE
DAY: MATT KING

(619) 293-5270

NIGHT: JOHN TOMPKINS

(619) 293-5271

***** OWNER ASSIGNED CONTAINER NUMBER: A275

***** STATE BOARD ASSIGNED CONTAINER ID NUMBER: 00000068502001 *****

IV DESCRIPTION

A. CONTAINER TYPE : TANK
B. MANUFACTURER/YR OF MFG:
C. YEAR INSTALLED :
D. CAPACITY (GALLONS) : 80

E. REPAIRS : NONE IF YES WHEN :
F. CURRENTLY USED : NO IF NO, YEAR OF LAST USE: 1983
G. STORES : WASTE
H. MOTOR VEHICLE FUEL/WASTE OIL : NO CONTAINERS:

IS CONTAINER LOCATED ON A FARM : NO

V CONTAINER CONSTRUCTION

A. THICKNESS: X INCHES B. VAULTING: NON-VAULTED C. WALLING: UNKNOWN
D. MATERIAL : CARBON STEEL
E. LINING : UNLINED
F. WRAPPING : UNKNOWN

VI PIPING

A. ABOVEGROUND PIPING : B. UNDERGROUND PIPING : SUCTION
C. REPAIRS : NONE IF YES, YEAR OF MOST RECENT REPAIR:

VII LEAK DETECTION
STOCK INVENTORY

VIII CHEMICAL COMPOSITION OF SUBSTANCES CURRENTLY STORED IN CONTAINER
NONE

Appendix D
Interviews and Background Documents



The Bodhi Group, Inc.
Due Diligence Environmental Questionnaire – **Owner**

Montgomery-Gibbs Executive Airport
3750 John J Montgomery Drive

Please email to bcortright@thebodhigroup.com

Completed by: Wayne Reiter
Company or Organization: City of San Diego
Title: Program Manager
Date: March 13, 2019

1.) Who are the current owners of the Site parcels and when were the parcels purchased?

City of San Diego, 1947

2.) Who are the past owners of the property and years of ownership (if available)?

Bill Gibbs, 1937 - 1947

3.) What was the past use of the subject property?

Airport

4.) Are you aware of any environmental cleanup liens that are filed or recorded against the subject property?

I am not aware

5.) Are you aware of any activity and land use limitations that are in place on the property that have been filed or recorded in a registry?

Not sure, maybe MHPA

6.) Are you aware of any specialized knowledge or experience related to the property or nearby properties that is pertinent to potential adverse environmental conditions?

No, not aware.

7.) Are you aware of commonly known or reasonably obtainable information that would help us to identify conditions indicative of releases or threatened releases of hazardous wastes/materials at the property? Such information includes knowledge of specific chemicals that are present or were once present on the property, spills or other chemicals releases that may have occurred, underground or aboveground storage tanks and environmental cleanups that have been conducted on the property.

Underground fuel storage tanks.



The Bodhi Group, Inc.
Due Diligence Environmental Questionnaire – **Owner**

Montgomery-Gibbs Executive Airport
3750 John J Montgomery Drive

Please email to bcortright@thebodhigroup.com

8.) Based on your knowledge and experience related to the property, are there any obvious indicators that point to the presence or likely presence of contamination at the property?

No.

9.) Based on your knowledge and experience related to the Site, are you aware of any areas where Per- and polyfluoroalkyl substances (PFAS) including Aqueous Film Forming Foam (AFFF) may have historically been or are currently being used. Examples include, landfills, electronics manufacturing, chrome plating, firefighting training, firefighting equipment storage or disposal, and areas of major crashes or accidents where fire suppressants were used? If AFFF was stored or used when (general time periods), and whom was the substance purchased or acquired from?

Possible locations.



The Bodhi Group, Inc.
Due Diligence Environmental Questionnaire – ***Tenant***

Montgomery-Gibbs Executive Airport
3750 John Montgomery Drive

Please email to bcortright@thebodhigroup.com

Completed by: Buzz Gibbs
Company or Organization: Gibbs Flying Service, Inc.
Title: President
Date: March 19, 2019

1.) Are you aware of any environmental cleanup liens that are filed or recorded against the subject property? NO

2.) Are you aware of any specialized knowledge or experience related to the property or nearby properties that is pertinent to potential adverse environmental conditions?

I really do not understand the question about “nearby properties” but the answer is probably yes. There was an unauthorized release in the fuel farm, 8910 Aero Drive, many years ago that after cleanup and reporting, was officially “closed”, meaning no further action is necessary. There have been some minor cleanups of soil from “drips” or “spills” that again were removed and no further action required. Every few years we collect used oil and other hazardous materials that both we, and our tenants, generate, mainly used oil and waste quality control fuel, fluorescent lamps, batteries, paint, etc. These are removed for recycling or proper disposal via hazmat manifests or, like batteries, lamps, delivered to recyclers. Many times these materials are “left” by unknown others at our dumpsters for us to pay to remove. The previous City Fuel Island, nearby property, had those tanks removed and there was contamination that was removed and that site was “closed”.

3.) Are you aware of commonly known or reasonably obtainable information that would help us to identify conditions indicative of releases or threatened releases of hazardous wastes/materials at the property? Such information includes knowledge of specific chemicals that are present or were once present on the property, spills or other chemicals releases that may have occurred, underground or aboveground storage tanks and environmental cleanups that have been conducted on the property.

Our fuel storage facility had the underground tanks replaced in 1986 to meet the then new UST regulations with double walled tanks. There was evidence of unauthorized releases in that tank pit. I believe that documentation is available at County HAZMAT or California Water Resources Board however I have not personally taken the time to verify. I also believe reports were provided to the same regulators for other minor spill cleanups. Annually we report to California HAZMAT about the number of recycled and disposal manifests of hazardous materials. We also have some records of recycled batteries, lamp, etc.

4.) Based on your knowledge and experience related to the property, are there any obvious indicators that point to the presence or likely presence of contamination at the property?

Other than the above, no.



The Bodhi Group, Inc.
Due Diligence Environmental Questionnaire – *Tenant*

Montgomery-Gibbs Executive Airport
3750 John Montgomery Drive

Please email to bcortright@thebodhigroup.com

5.) Based on your knowledge and experience related to the Site, are you aware of any areas where Per- and polyfluoroalkyl substances (PFAS) including Aqueous Film Forming Foam (AFFF) may have historically been or are currently being used. Examples include, landfills, electronics manufacturing, chrome plating, firefighting training, firefighting equipment storage or disposal, and areas of major crashes or accidents where fire suppressants were used? If AFFF was stored or used when (general time periods), and whom was the substance purchased or acquired from?

No



Date of Notice: February 7, 2019

**PUBLIC NOTICE OF PREPARATION OF A
PROGRAM ENVIRONMENTAL IMPACT REPORT
AND SCOPING MEETING
PLANNING DEPARTMENT**

PUBLIC NOTICE: The City of San Diego as the Lead Agency has determined that the project described below will require the preparation of a Program Environmental Impact Report (PEIR) in compliance with the California Environmental Quality Act (CEQA). This Notice of Preparation of a PEIR and Scoping Meeting was publicly noticed and distributed on February 7, 2019. This notice was published in the SAN DIEGO DAILY TRANSCRIPT and placed on the City of San Diego website at:

<http://www.sandiego.gov/city-clerk/officialdocs/notices/index.shtml>, and on

the Planning Department website at:

<https://www.sandiego.gov/planning/programs/ceqa>

SCOPING MEETING: The City of San Diego Planning Department will hold a public scoping on **Thursday February 21st** from 6:00 PM to 7:30 PM at the Metropolitan Operations Complex (MOC II) Auditorium, located at 9192 Topaz Way, San Diego, CA 92123. **Please note that depending on the number of attendees, the meeting could end earlier than 7:30 PM.** Written comments regarding the proposed PEIR's scope and alternatives will be accepted at the meeting.

Written/mail-in comments may also be sent to the following address: **Rebecca Malone, Environmental Planner, City of San Diego Planning Department, 9485 Aero Drive, MS 413, San Diego, CA 92123 or e-mail your comments to PlanningCEQA@sandiego.gov with the Project Name in the subject line** no later than March 9, 2019. Responsible agencies are requested to indicate their statutory responsibilities in connection with this project when responding. A PEIR incorporating public input will then be prepared and distributed for public to review and comment.

PROJECT NAME: Montgomery-Gibbs Executive Airport Master Plan

COMMUNITY PLAN AREA: Kearny Mesa

COUNCIL DISTRICT: Districts 6 and 7

PROJECT DESCRIPTION: The City of San Diego owns and operates the Montgomery-Gibbs Executive Airport (MYF) as a General Aviation (GA) airport located within the Kearny Mesa community north of Aero Drive, east of SR-163, south of Balboa Avenue, and west of Ruffin Road (Attachment 1, *Project Location*). Airport planning occurs at the national, state, regional, and local level; and in 2017, the City began developing an Airport Master Plan (Project) to determine the extent, type, and schedule of development needed. An Airport Master Plan presents the community and airport's vision for a 20-year strategic development plan based on the forecast of activity. It is used as a decision-making tool and is intended to complement other local and regional plans. The Airport Master Plan consists of a report documenting existing conditions of the airport, a forecast of activity, facility requirements (the airport's needs based on the forecast and compliance with Federal Aviation Administration (FAA) Design Standards for airports), development and evaluation of alternatives to meet those needs, and a funding plan for that

development. The Airport Master Plan also includes an Airport Layout Plan (ALP) which graphically depicts all planned development at the airport within the 20-year planning period as determined in the Airport Master Plan. This drawing requires approval by the FAA, which makes the airport eligible to receive federal funding for airport improvements and maintenance under the FAA's Airport Improvement Program.

As shown on Attachment 2, *Proposed Airport Plan*, the Project would involve both landside and airside components. The landside components include a hangar site within the westernmost portion of the airport. The Airport Master Plan identifies up to 92 new hangars, as well as space for 48 new tie-down areas. Some of the smaller hangars would be designed to meet a demand for luxury hangars. Implementation of several of the larger 75,000 square-foot (sf) hangars would require modification of the hotel leasehold. Also, within the westernmost area are the three existing structures which will be evaluated as part of the PEIR for their historic potential. A 6,000 sf expansion to the existing terminal building is proposed (due to a deficit of space), along with other improvements such as a public viewing area (outside the fence line), aircraft wash racks, and a self-service fueling facility (fuel island). As denoted by the green hatch on Attachment 2, there are several areas of the airport that are subject to private leases which are not a part of the Project. In addition, the expansion of the San Diego Fire Department station within airport property is a separate City of San Diego project that is not a part of the Project to be analyzed in the PEIR.

Airside improvements proposed by the Airport Master Plan include removal of pavement at the end of Runway 5 and Taxiway Foxtrot, along with reconfigurations of several other taxiways (refer to Attachment 2). Construction of a new taxiway Delta and new run-up areas is also proposed. The main airside improvement proposed is the removal of the Runway 28R displaced threshold which was put into place by City of San Diego Resolution R-280194 passed in 1992. The resolution was intended to limit the size of aircraft capable of operating at MYF by reducing the amount of runway available when landing to the west. This would result in the threshold being moved 1,200 feet from approximately the location of Taxiway Bravo, eastward to Taxiway Alpha. This component would move safety areas such as the Runway Protection Zone (RPZ) and approach surfaces, as well as require associated improvements such as relocation of glideslope and related equipment. As part of this project, the City will also request from the FAA that an approximately 4-acre area adjacent to Aero Drive and Glenn H Curtis Road be converted to "Non-Aeronautical Land Use"

APPLICANT: City of San Diego, Airports Division

RECOMMENDED FINDING: Pursuant to Section 15060(d) of the CEQA Guidelines, the proposed project may result in significant environmental impacts in the following areas: **Air Quality, Biological Resources, Energy Conservation, Geology and Soils, Greenhouse Gas Emissions, Historical Resources (Built-Environment, Archaeology, and Tribal Cultural Resources), Health and Safety, Hydrology and Water Quality, Land Use, Noise, Paleontological Resources, Public Services and Facilities, Public Utilities, Transportation/Circulation, and Visual Effects and Neighborhood Character.**

AVAILABILITY IN ALTERNATIVE FORMAT: To request this Notice in alternative format, call the Planning Department at (619) 235-5200 OR (800) 735-2929 (TEXT TELEPHONE).

ADDITIONAL INFORMATION: For environmental review information, contact **Rebecca Malone at (619) 446-5371**. For information regarding public meetings/hearings on this project, contact the Airport Program Manager, **Wayne Reiter, at (858) 573-1436**. This Notice was published in the SAN DIEGO DAILY TRANSCRIPT and distributed on February 7, 2019.

Alyssa Muto
Deputy Director
Planning Department

DISTRIBUTION: See Attached


ATTACHMENTS: Project Location (Attachment 1)
Proposed Airport Plan (Attachment 2)




Source: Aerial (Sangis 2017)

Project Location

Figure 1



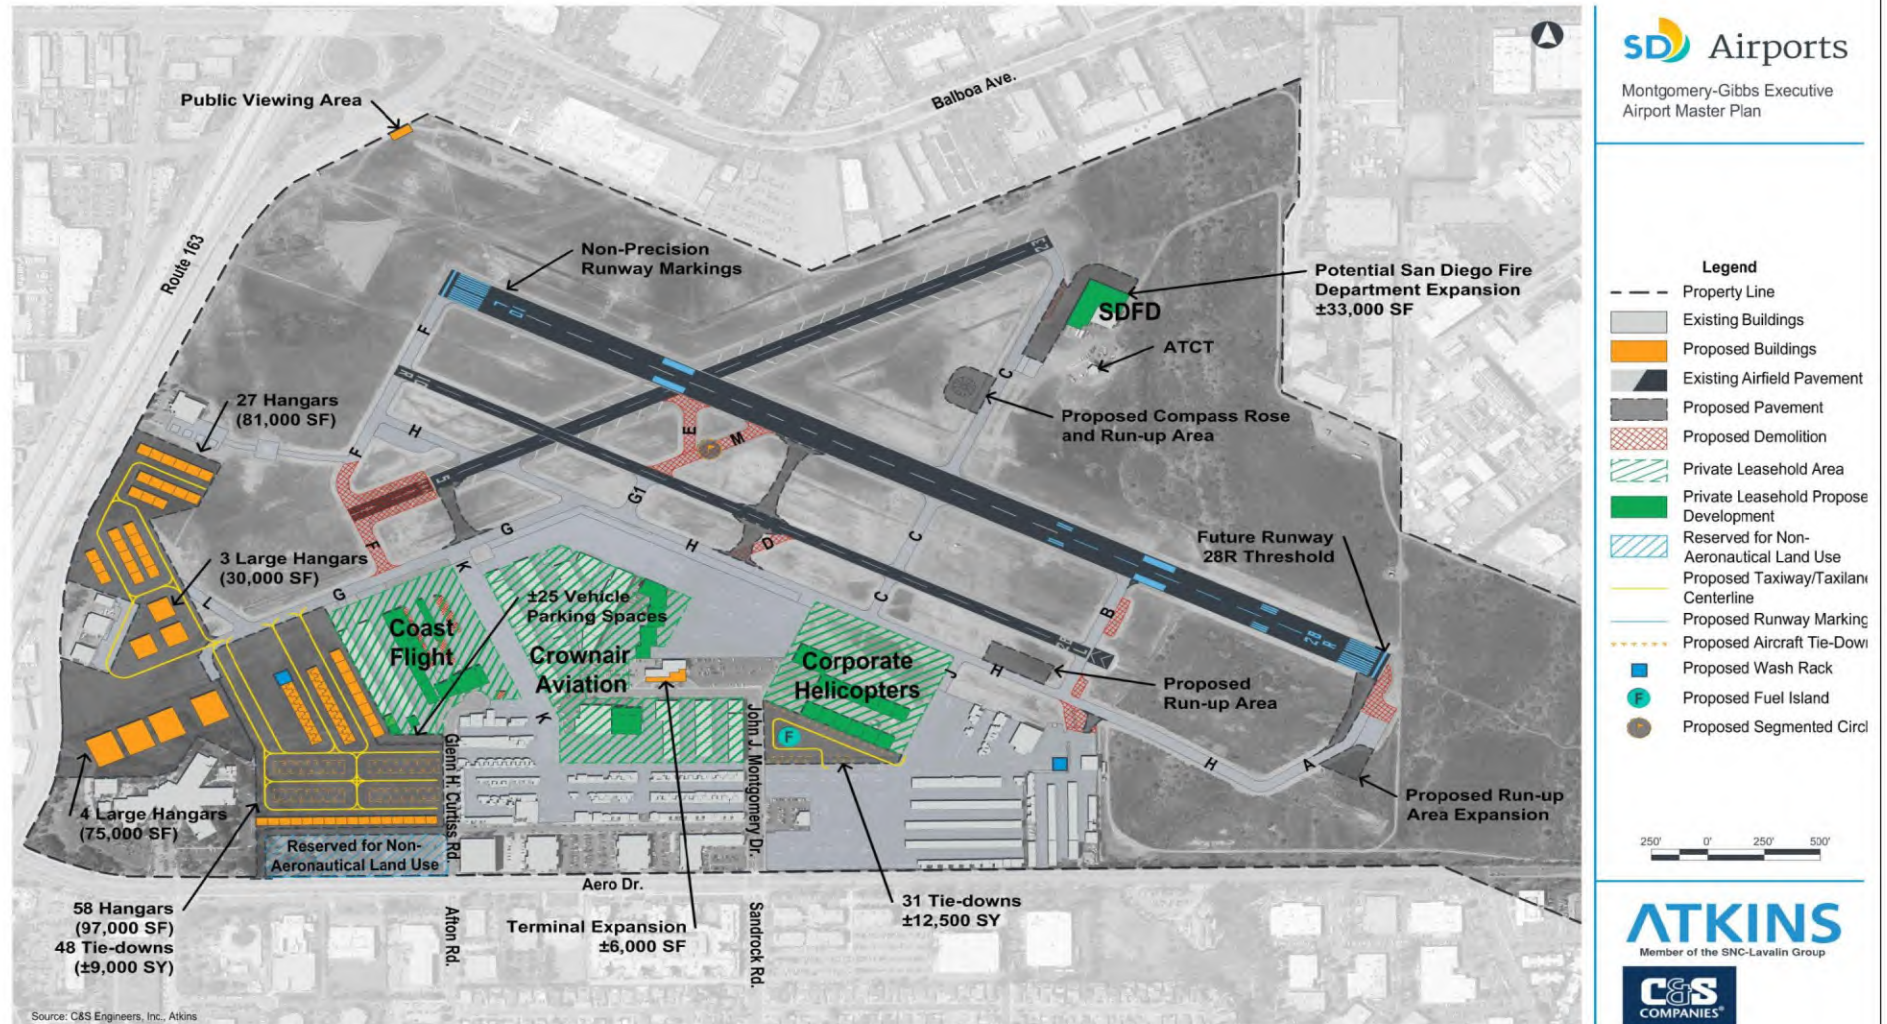

Source: C&S Companies 2018



Airport Master Plan

Montgomery-Gibbs
Executive Airport

Section 1

Inventory, Surveys, &
Data Collection

Prepared by:



This Page Intentionally Left Blank

Table of Contents

1.1	Introduction	1
1.2	Background.....	2
	Airport System Planning Role	2
	Airport History	2
	Airport Setting	5
	Airport Overview.....	7
	Surrounding Airports.....	10
1.3	Population Data	13
	Population Trends.....	13
1.4	Airport Activity and Organizational Structure	14
	Ownership and Operations	14
	Policies and Plans.....	15
	Airport Economic Benefits.....	16
	Existing and Historical Aircraft Operations	17
	Historical and Existing Based Aircraft	18
	Fleet Mix and Critical Aircraft.....	19
1.5	Regional Setting and Land Use	20
	Land Use.....	20
	Zoning.....	22
	Montgomery-Gibbs Executive Airport ALUCP	22
	Community Plans	22
	Climate and Topography	27
	Wind Coverage.....	27
1.6	Airside Facilities	29
	Runways	29
	Displaced Threshold.....	31
	Safety Areas and Object Free Areas.....	32
	Runway Protection Zones	34
	Lighting and Navigational Aids (NAVAIDS)	34
	Instrument Approach Procedures and Electronic Aids to Navigation.....	35
	Additional Equipment	36
	Aircraft Hangars and Parking Areas	37
	Airfield Signage and Markings.....	38
	Airspace and Air Traffic Control	39
	Noise Abatement Procedures.....	41
1.7	Support Facilities	42
	Fixed Base Operators (FBO)	42
	Aircraft Fueling	42
	Aircraft Maintenance	43
	Air Charter Services.....	43
	Flight Instruction and Flying Clubs.....	43
	Emergency Services.....	44
	Additional Facilities.....	44

1.8 Landside Facilities..... 45

Airport Administration Building 45

Hotel 45

Restaurant 46

Access, Circulation and Parking 46

Utilities 46

1.9 Stakeholder Feedback..... 47

1.10 Key Considerations 47

Airside 47

Airspace 47

Landside 47

Environmental..... 47

Other Concerns and Considerations 48

Figures

Figure 1.1 – Airport History
 Figure 1.2 – Airport Local Setting
 Figure 1.3 – Regional Access Routes
 Figure 1.4 – Local Access
 Figure 1.5 – Existing Facilities
 Figure 1.6 – Airspace Environment & Adjacent Airports
 Figure 1.7 – San Diego and Surrounding County Populations
 Figure 1.8 – San Diego County Population Forecast
 Figure 1.9 – Existing Operations Split by Class
 Figure 1.10 – Historical and Existing General Aviation Operations
 Figure 1.11 – Historical and Existing Air Taxi and Military Operations
 Figure 1.12 – Historical Based Aircraft
 Figure 1.13 – Surrounding Land Use
 Figure 1.14 – Surrounding Zoning
 Figure 1.15 – Runway Wind Coverage
 Figure 1.16 – MYF Airfield
 Figure 1.17 – Plan and Profile Views of an Example Displaced Threshold
 Figure 1.18 – Airspace Classification
 Figure 1.19 – Airspace Environment
 Figure 1.20 – Historic Fuel Sales by Type (Gallons)

Tables

Table 1.1 – Surrounding Public-Use and Military Airports
 Table 1.2 – Airport Tenants and Services Provided
 Table 1.3 – Airport Management Documents
 Table 1.4 – Based Aircraft Characteristics
 Table 1.5 – Transient Aircraft Characteristics
 Table 1.6 – Public Facilities within ½ Mile of MYF
 Table 1.7 – Temperature and Precipitation
 Table 1.8 – Runway System Characteristics
 Table 1.9 – Taxiway Width
 Table 1.10 – Runway and Taxiway Safety Area Dimensions (per Standards)
 Table 1.11 – MYF Runway Protection Zones (RPZ) (per Standards)
 Table 1.12 – Runway Lighting
 Table 1.13 – MYF IAPs and Minimums
 Table 1.14 – Aircraft Hangars and Parking Areas
 Table 1.15 – City-Owned Vehicles and Equipment
 Table 1.16 – Public Parking at MYF

Appendices

Appendix A – Lease Parcel Inventory

1.1 Introduction

The City of San Diego owns and operates two General Aviation (GA) airports in San Diego County – the Montgomery-Gibbs Executive Airport and Brown Field Municipal Airport. In 2017, the City began developing an Airport Master Plan for each of the facilities in order to determine the extent, type, and schedule of development needed. The Federal Aviation Administration (FAA) offers a number of objectives as a guide in the preparation of a master plan:

- Understand the issues, opportunities and constraints of the airport
- Consider the impact of recent national and local aviation trends
- Identify the capacity of airport infrastructure
- Determine the need for new improvements
- Estimate costs and identify potential funding sources
- Develop a schedule for implementation of proposed projects
- Comply with federal, state and local regulations

The Airport Master Plan includes a report of existing and future conditions, an Airport Layout Plan (ALP), and a schedule of priorities and funding sources for proposed improvements. This section documents the first step in the Airport Master Plan for Montgomery-Gibbs Executive Airport (hereafter referred to by its FAA identifier “MYF” or “the Airport”), which involves gathering and organizing information on existing conditions of the Airport and the surrounding community. This section provides a summary of existing Airport facilities, air traffic activity, and the surrounding airspace environment. Additionally, general information regarding the Airport’s setting in the community and the larger aviation network is provided. This includes local economic and development characteristics, weather and environmental conditions, and the demographics of the surrounding area. The information obtained in this first step of the master planning process provides a foundation for subsequent analysis.

Unless otherwise indicated, all photographs in this document were taken by C&S Engineers, Inc. 2017.



Airport Entrance Sign

1.2 Background

Airport System Planning Role

Airport planning occurs at the national, state, regional, and local level. The following section identifies the Airport's role based on previous reports, with the goal of the master planning process to guide planning practices at the local level.

The Airport is included in the National Plan of Integrated Airport Systems (NPIAS), which identifies airports that are significant to the national air transportation system and therefore eligible for grant funding under the Federal Aviation Administration's Airport Improvement Program (AIP). The NPIAS 2017–2021 Report, produced by the U.S. Department of Transportation (DOT), documents the projected facility improvements and needs for 3,332 existing and eight proposed airports. It estimates that \$32.5 billion in infrastructure development will be eligible for federal aid over the next five years. In administering funding, the FAA uses the NPIAS, which supports the FAA's strategic goals for safety, system efficiency, and environmental compatibility by identifying the specific airport improvements that will contribute to achievement of those goals.

Due to MYF's proximity to downtown San Diego and the large population served, it is classified by the NPIAS as a regional reliever airport. A reliever airport is one that is in place to accommodate overflow and general aviation traffic that would otherwise cause congestion at a neighboring airport, in this case San Diego International (SAN). Approximately 530, or 16 percent of the airports in the NPIAS, are classified as regional and they account for 12.2 percent of the cost of the AIP. The Airport is one of 151 regional airports classified as a reliever to a primary airport, and one of only six regional relievers to have more than 400-based aircraft¹. The closest regional reliever airport with a comparable number of based aircraft is Whiteman Airport in Los Angeles, California, approximately 125 miles to the northwest. For the first five years of the planning period (through 2021), MYF is projected to remain a regional reliever and require an estimated \$18,288,889² for developments.

At the state level, the California Aviation System Plan 2010 System Needs Assessment identified MYF as the only Metropolitan General Aviation Airport in San Diego County. Enhancements recommended in the plan include a 423-foot runway extension and an increase in weight-bearing capacity.

The San Diego County Regional Airport Authority (SDCRAA) developed the Regional Aviation Strategic Plan (RASP) in 2010 and 2011 to take a comprehensive look at the civilian airports in the San Diego County region. The RASP explored a scenario that proposed to preserve SAN's Airfield capacity for commercial passenger service by making improvements and accommodating GA traffic at Gillespie Field Airport, MYF, and Brown Field Municipal Airport. The improvements at the Airport would include a new Fixed Base Operator (FBO) as well as new corporate aircraft hangars. One issue with this scenario is that the existing runway length at MYF is incapable of handling many high-end corporate GA aircraft³.

Airport History

William "Bill" Gibbs founded Montgomery-Gibbs Executive Airport in 1937 as a single runway, turf airfield. Through the years, it has changed names several times, expanded, and grown into one of the largest GA reliever airports in the U.S. Some of the highlights the Airport's history are presented on

Figure 1.1.

¹ Based aircraft are defined as those stored at an airport and not transient.

² United States of America. U.S. Department of Transportation. Federal Aviation Administration. National Plan of Integrated Airport Systems (NPIAS) Report Airports 2017–2021. N.p., n.d. Web. 14 Mar. 2017.

³ San Diego Regional Airport Authority, (2010) Regional Aviation Strategic Plan



Construction of parallel Runway 10R/28L and the administration building



Renamed "Montgomery-Gibbs Executive Airport to honor Bill Gibbs and demonstrate commitment to providing quality services and facilities

The Airport is leased to the Ryan School of Aeronautics to provide flight training to the Army Air Corps cadets

Purchased by the City of San Diego

Construction of 2 asphalt runways and taxiways

Noise monitoring system installed



Construction of the Air Traffic Control Tower

The Runway 28R instrument landing system is established

Runway 28R is extended to the east to a total of 4,577 feet

Renamed "Montgomery Field" in honor of John J. Montgomery, who is credited with the first controlled flight in a fixed wing aircraft, which took place in the Otay Mesa Area of San Diego.

William "Bill" Gibbs opens "Gibbs Field" as a single turf runway airport



This Page Intentionally Left Blank

Airport Setting

The Airport is located approximately six miles north of downtown San Diego, California, 20 miles south of Escondido, California, 11 miles west of El Cajon, California, and 22 miles north of Tijuana, Mexico. The regional setting and access routes are depicted on **Figure 1.3** on the following page.

The Airport is located in southwest San Diego County, in the Kearny Mesa community planning area. It is the closest GA airport to downtown San Diego. It is easily accessible via Interstates 5 and 15 from the north and south and by Interstate 8 from the east and west. The Airport's local setting is shown on **Figure 1.2**.

Figure 1.2 – Airport Local Setting



The Airport is situated on 549-acres bound by Balboa Avenue to the north, Ruffin Road to the east, Aero Drive to the south, and Kearny Villa Road to the west. It is directly in between State Route 163 on the west and Interstate Route 15 to the east. Local access to the Airport is depicted on **Figure 1.4**. The Airport primarily serves the west central area of San Diego County.

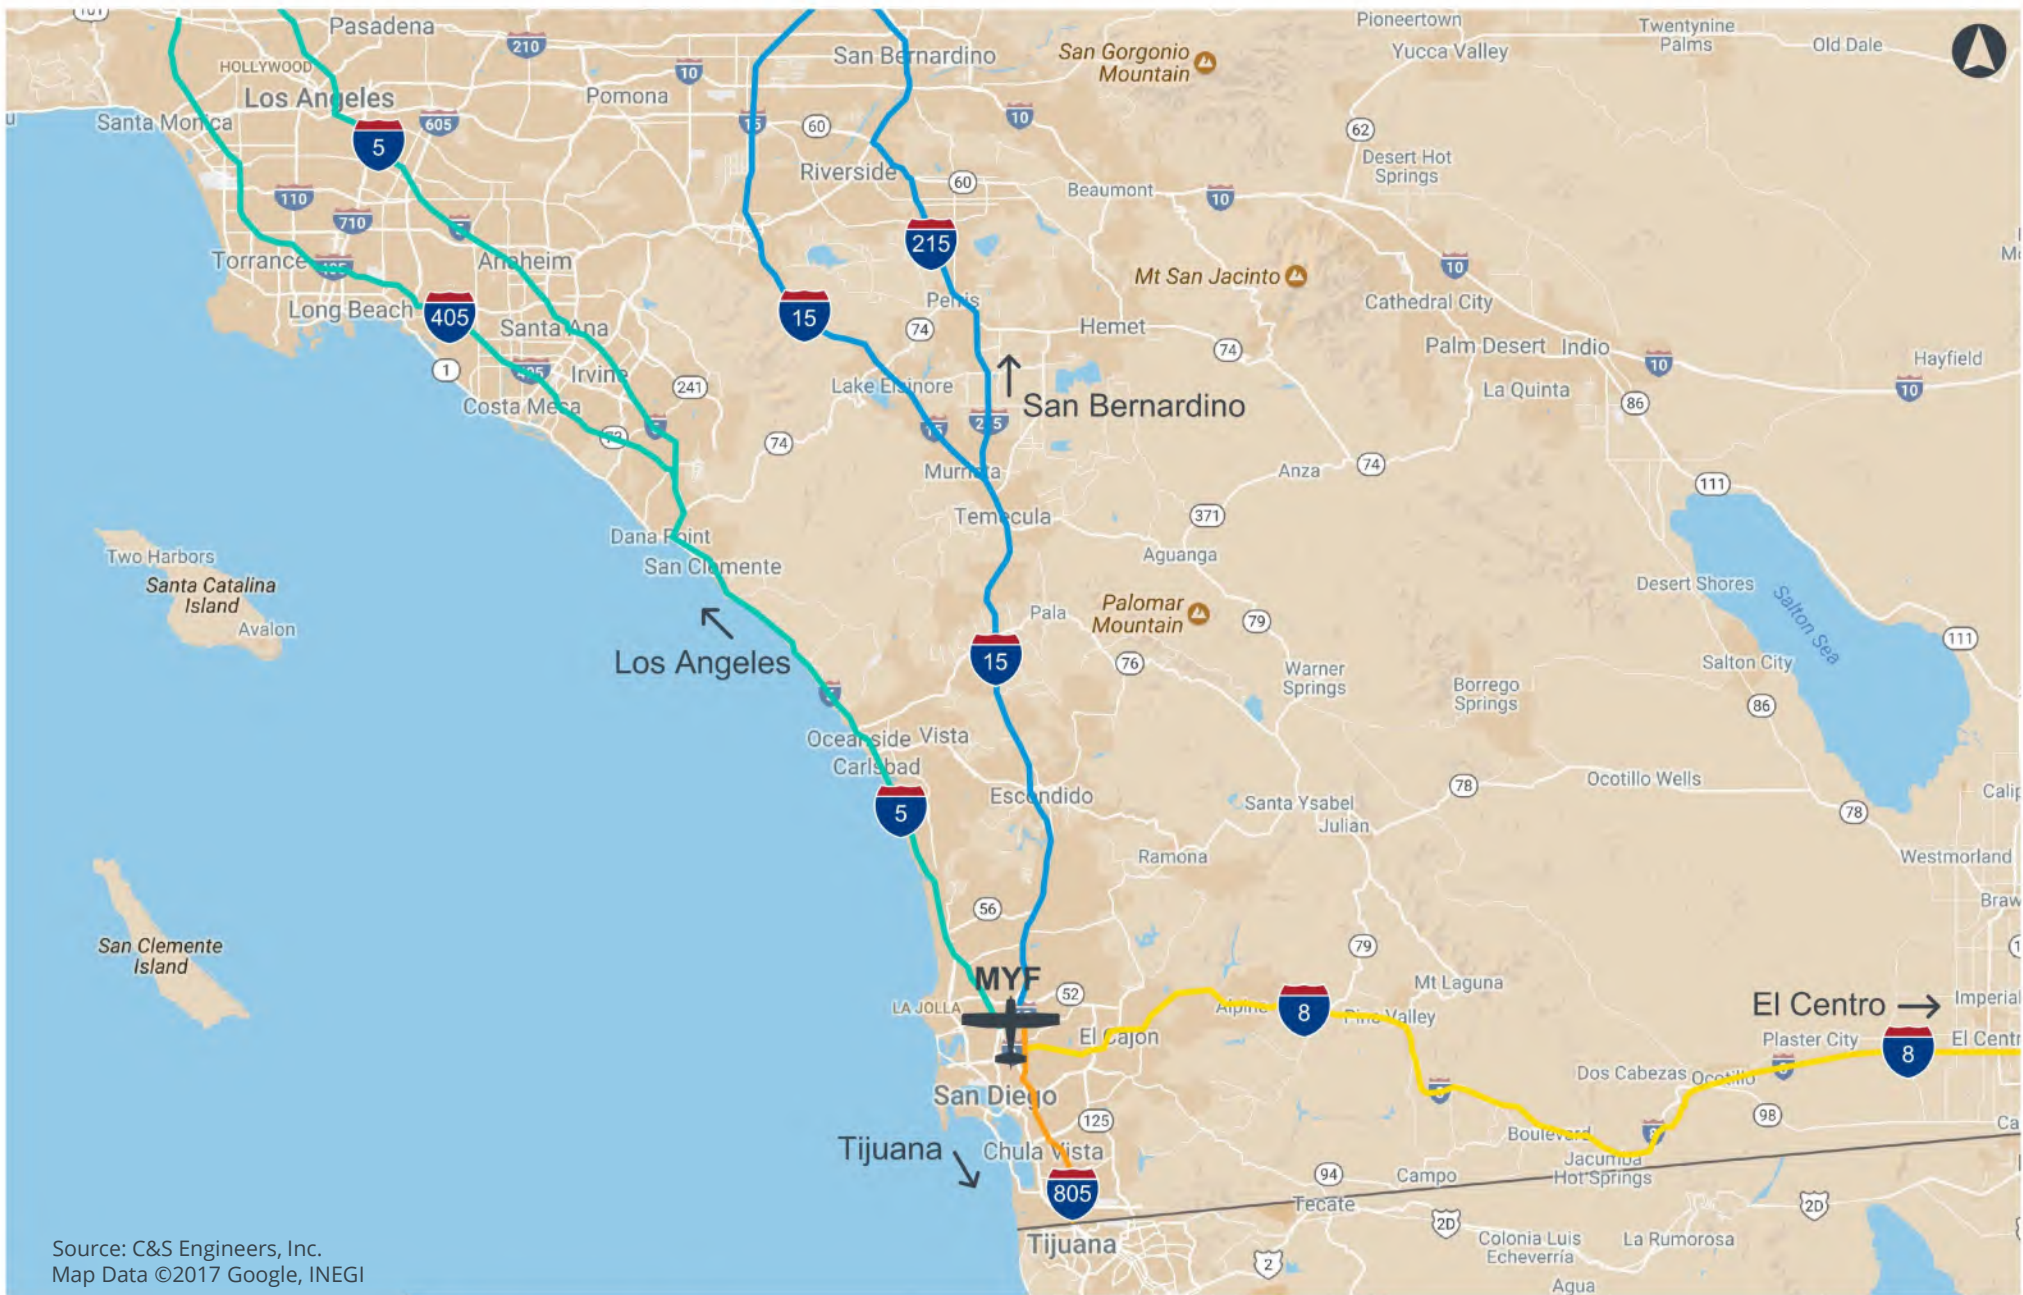
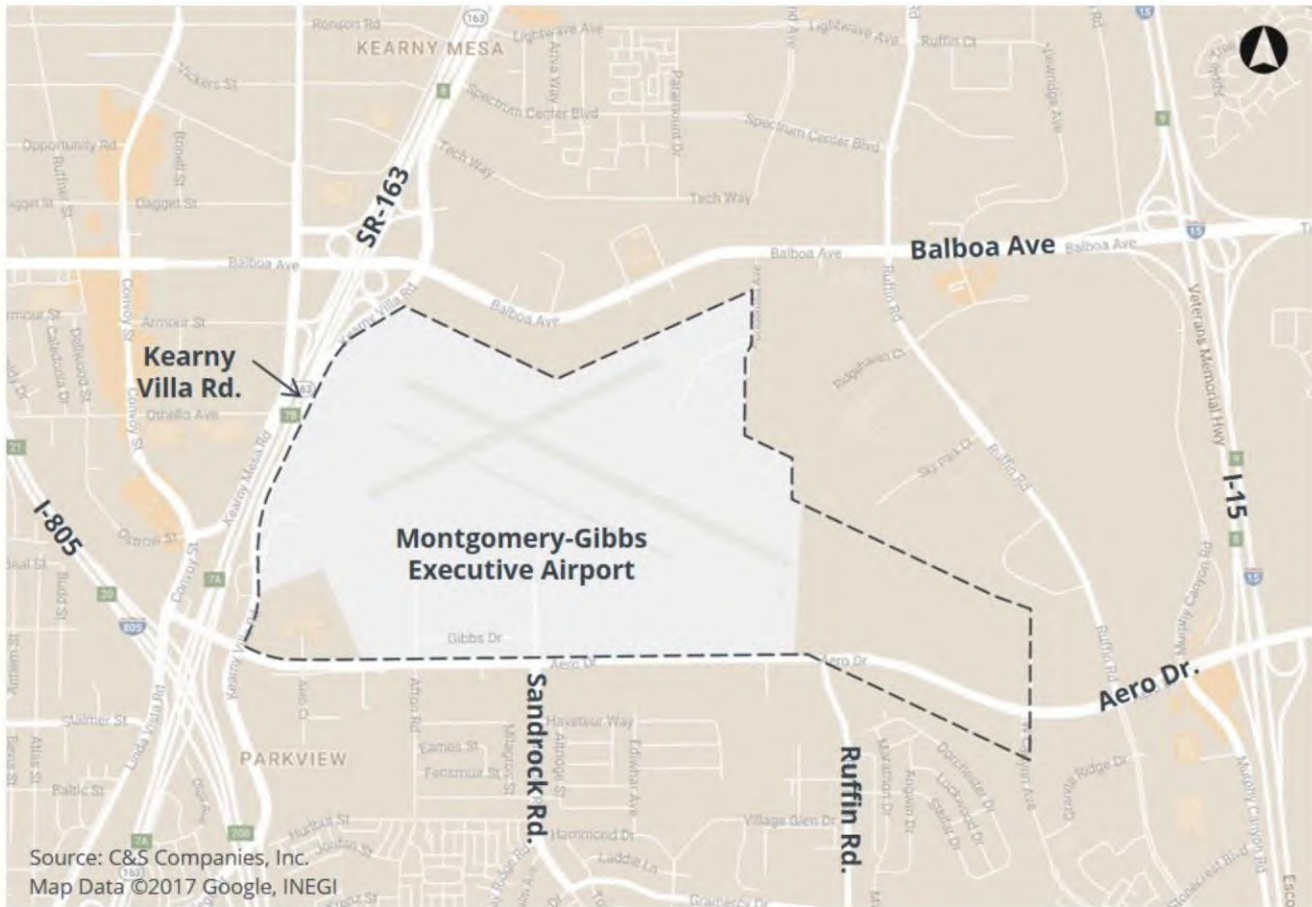


Figure 1.3
Regional Access Routes

Figure 1.4 – Local Access

Airport Overview

The Airport consists of multiple facilities that can be categorized into the following components:

Airside: The airside consists of three runways (Runways 10L/28R, 10R/28L, and 5/23) and 12 taxiways, including a full parallel taxiway serving Runways 10L/28R and 10R/28L. In addition to the runways and taxiways there are several aircraft run-up areas, a helicopter landing area, and various navigational aids (NAVAIDS). The airside also includes aircraft parking aprons, tie-downs, T-hangars, conventional hangars, and the FAA Airport Traffic Control Tower (ATCT).

Landside: Landside facilities at the Airport include the administration building which is made up of offices for both the airport staff and a number of City employees that work for the Airports Division. This building provides the public with a lounge on the first floor and a restaurant located on the second floor.

Support Facilities: Support facilities include those relating to aircraft maintenance, refueling, flight instruction, and aircraft sales. Most of the services are provided by FBOs at the Airport.


Figure 1.5 illustrates the existing facilities at the Airport, which are discussed in subsequent sections of this section.

**MYF ATCT**



Spiders Aircraft

Figure 1.5
Existing Facilities

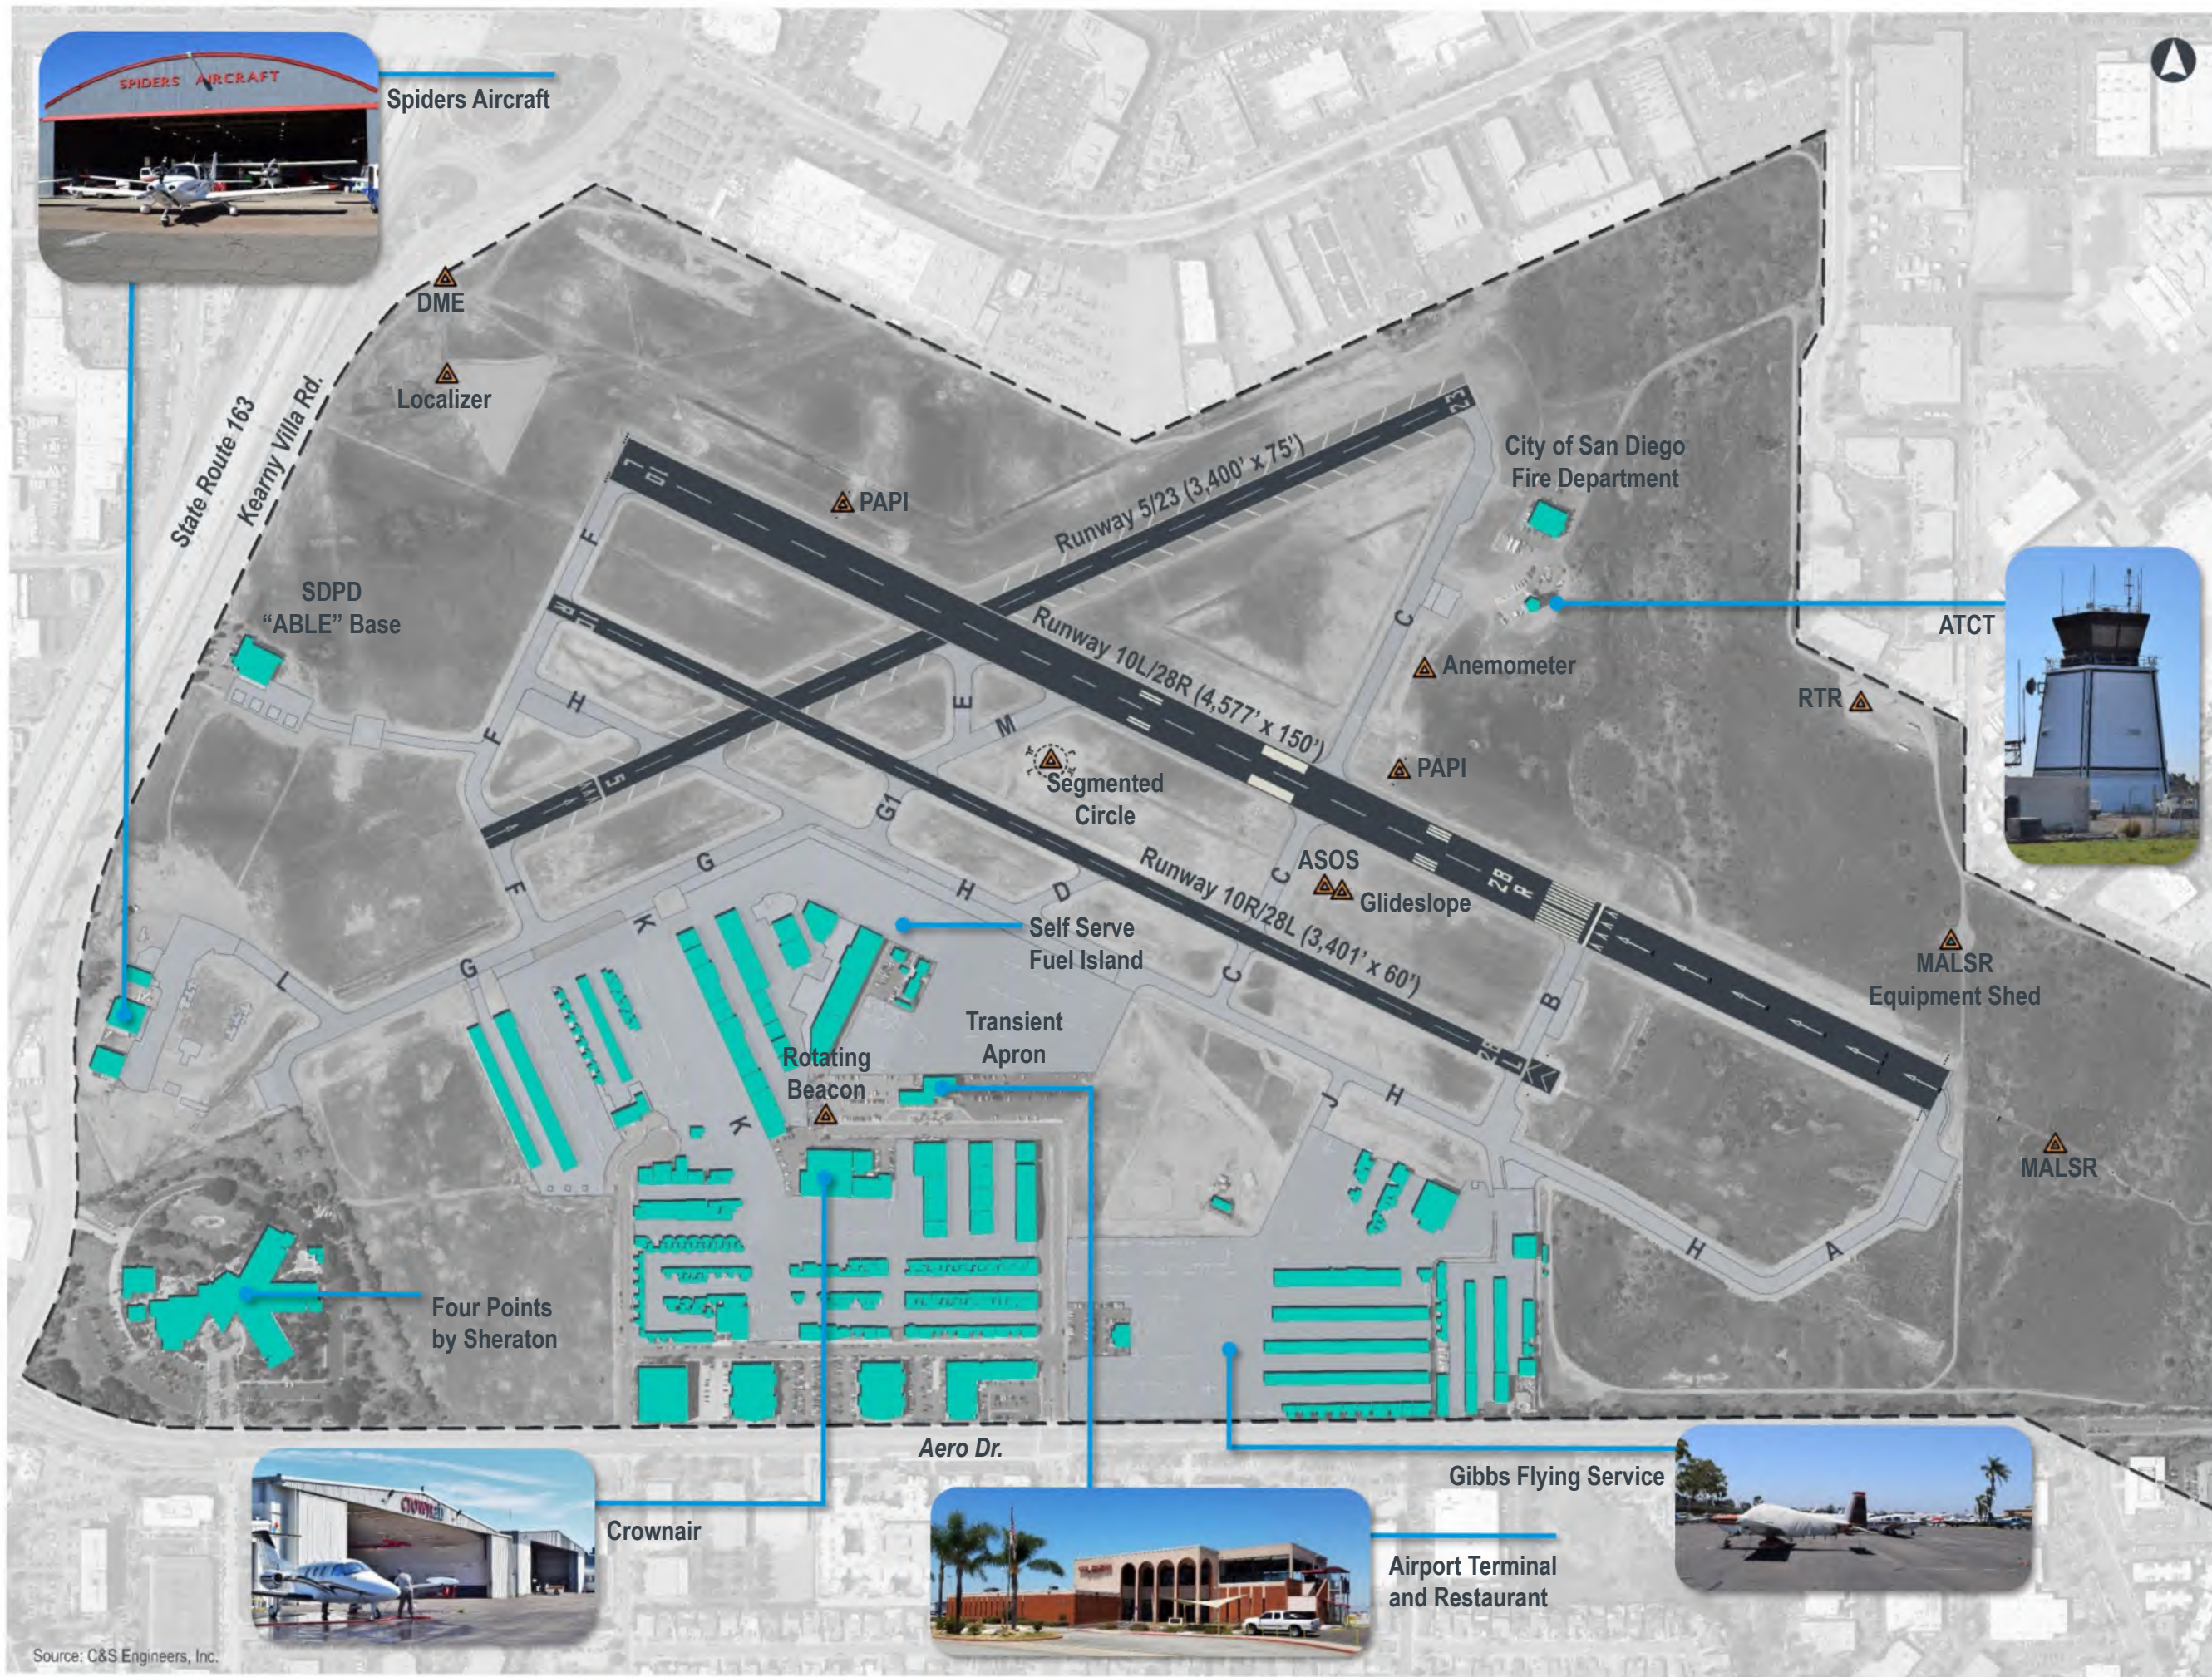

- Legend**
- — Property Line
 - Existing Buildings
 - Existing Airfield Pavement
 - Existing NAVAID



ATCT



Crownair



Airport Terminal and Restaurant



Gibbs Flying Service



This Page Intentionally Left Blank

Surrounding Airports

There are three military, six private, and seven public-use airports that are within a 30-nautical mile (NM) radius of the Airport. The locations of the surrounding airports and associated airspace are depicted on **Figure 1.6**. Descriptions of the surrounding public-use and military airports are included in **Table 1.1**. The nearest medium to large-hub commercial service airports outside of the 30-NM radius are John Wayne Airport, 63 NM to the northwest, and Los Angeles International Airport 93 NM to the northwest.


Table 1.1 – Surrounding Public-Use and Military Airports

Airport Name (Location Identifier) Ownership	Location Distance from MYF	NPIAS Classification	Runway Heading: Runway Dimensions (Surface Type)	Instrument Approaches
Miramar MCAS (NKX)* Marine Corps Air Station	San Diego, CA 3 NM north	N/A (Military)	6L/24R: 12,000' x 200' (Concrete) 6R/24L: 8,001' x 200' (Porous European Mix)	ILS, LOC/DME, RNAV (GPS), TACAN, HI-TACAN
San Diego International (SAN) San Diego County Regional Airport Authority	San Diego, CA 6 NM southwest	Primary Service/Large Hub	9/27: 9,400' x 200' (Asphalt-Concrete)	ILS/LOC, RNAV (GPS)
North Island NAS (NZY)* Naval Air Station	San Diego, CA 8 NM southwest	N/A (Military)	18/36: 8,001' x 200' (Porous European Mix) 11/29: 7,501' x 200' (Porous European Mix)	LOC/DME, RNAV (GPS), VOR, TACAN, HI-TACAN
Gillespie Field (SEE) County of San Diego	El Cajon, CA 8 NM east	National/Reliever	9L/27R: 5,342' x 100' (Asphalt) 17/35: 4,145' x 100' (Asphalt) 9R/27L: 2,738' x 60' (Asphalt)	RNAV (GPS), LOC
Imperial Beach NOLF (NRS)* Naval Outlying Field	Imperial Beach, CA 15 NM south	N/A (Military)	8/26: 2,240' x 151' (Concrete) 9/27: 4,997' x 336' (Porous European Mix)	TACAN
Brown Field Municipal (SDM) City of San Diego	San Diego, CA 17 NM southeast	National/Reliever	8L/26R: 7,972' x 150' (Asphalt-Concrete) 8R/26L: 3,180' x 75' (Asphalt)	RNAV (GPS), VOR-A
Ramona (RNM) County of San Diego	Ramona, CA 18 NM northeast	Regional/Reliever	9/27: 5,001' x 150' (Asphalt)	RNAV (GPS), VOR/DME-A
Tijuana International (TIJ) Mexico	Tijuana, Mexico 19 NM southeast	N/A (Foreign)	9/27: 9,711' x 148' (Asphalt)	ILS, DME, LOC, VOR
McClellan-Palomar (CRQ) County of San Diego	Carlsbad, CA 20 NM northwest	Primary/Nonhub	6/24: 4,897' x 150' (Asphalt)	ILS, LOC, RNAV (GPS), VOR-A
Bob Maxwell Memorial (OKB) City of Oceanside	Oceanside, CA 26 NM northwest	Local/GA	6/24: 2,712' x 75' (Asphalt)	GPS, VOR-A

* Military facility, non-public-use, Source: FAA Chart Supplement

SD Airports

Montgomery-Gibbs Executive Airport

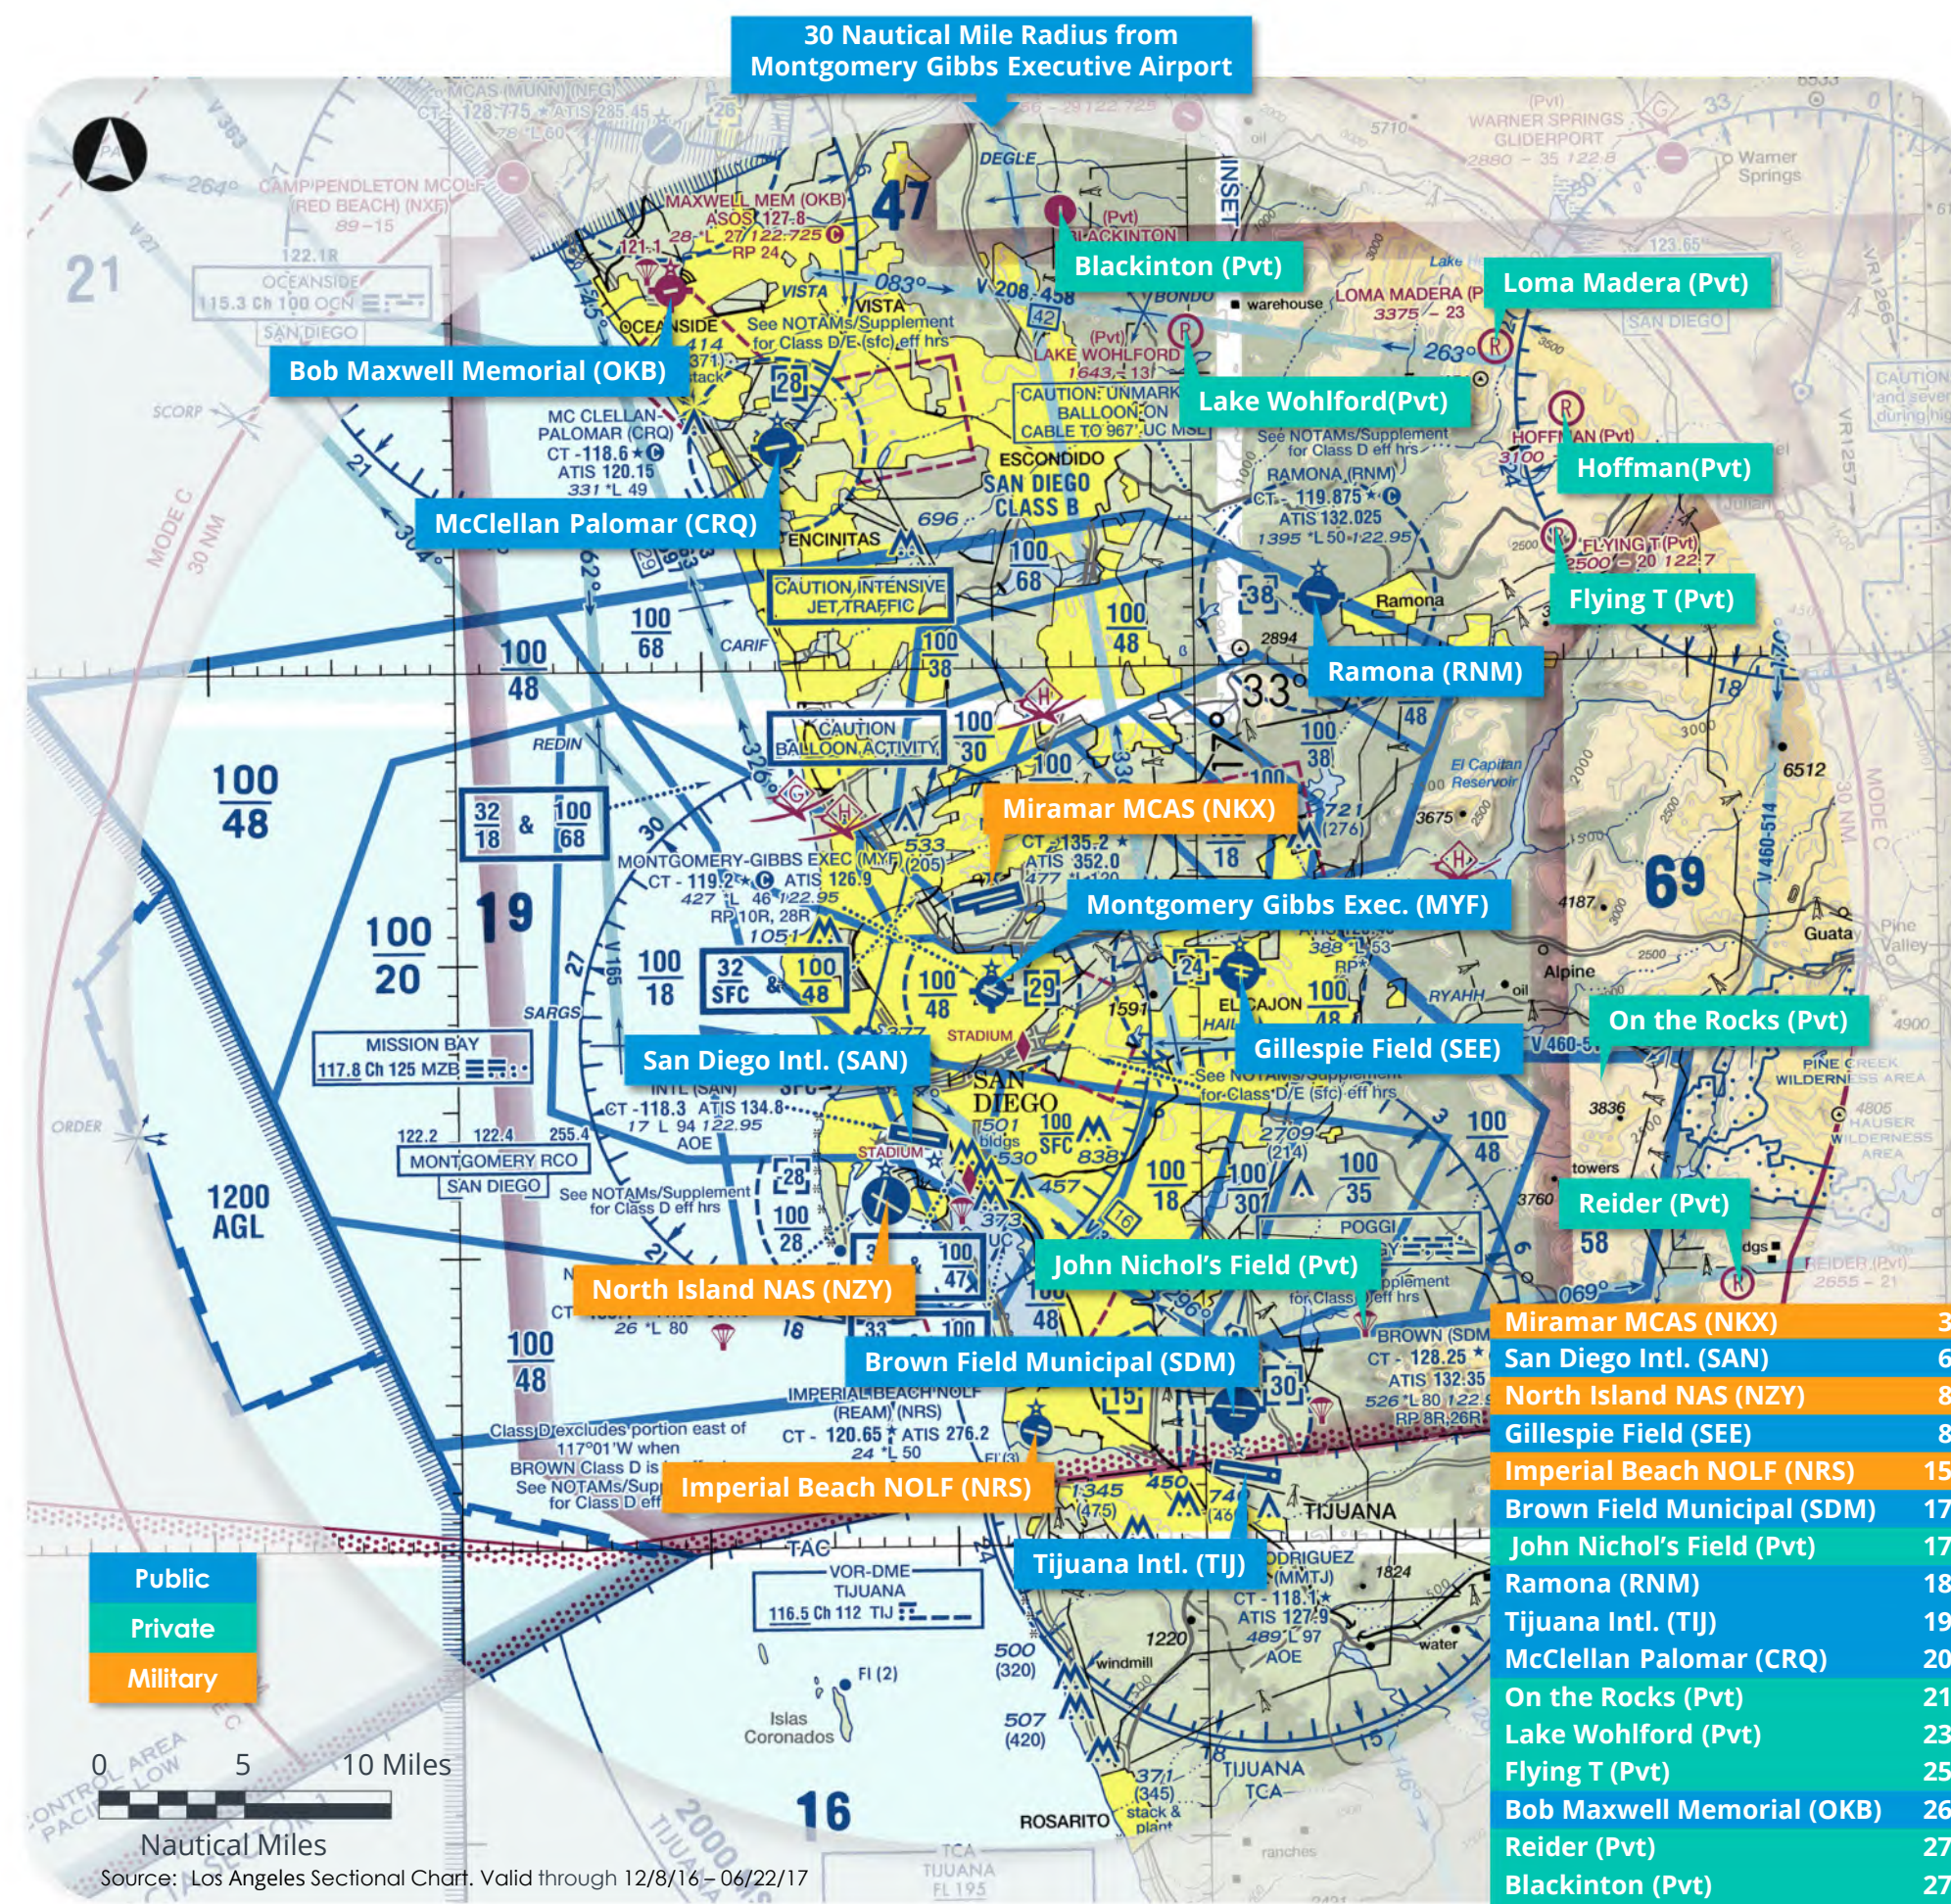

Airports having Control Towers are shown in Blue, all others in Magenta. Consult Chart Supplement for details involving airport lighting, navigation aids, and services. All times are local. For additional symbol information refer to the Chart User's Guide.

AIRPORTS

- Other than hard-surfaced runways
- Hard-surfaced runways 1500 ft. to 8069 ft. in length
- Hard-surfaced runways greater than 8069 ft. or some multiple runways less than 8069 ft.
- Open dot within hard-surfaced runway configuration indicates approximate VOR, VOR-DME, DME or VORTAC location.
- All recognizable hard-surfaced runways, including those closed, are shown for visual identification. Airports may be public or private.

AIRPORT DATA

NAME	(NAM)	(PNAM)	Location Identifier	ICAO	Location Indicator	shown outside contiguous U.S.
CT - 118.3	*	ATIS 123.8				
RP 23, 34						
VFR Advy 125.0						
WX CAM						
AOE						

ADDITIONAL AIRPORT INFORMATION

- Private ("Pvt") - Non-public use having emergency or landmark value
- Military - Other than hard-surfaced; all military airports are identified by abbreviations AFB, NAS, AAF, etc.
- Helipad
- Unverified
- Abandoned - paved having landmark value, 3000 ft. or greater
- Ultralight Flight Park Selected

COMMUNICATION BOXES

122.1R	122.6	123.6
OAKDALE		CHICAGO CHI

RADIO AIDS TO NAVIGATION

- VHF OMNI RANGE (VOR)
- VOR-DME
- DME
- Non-Directional Radio Beacon (NDB)
- NDB - DME

OBSTRUCTIONS

- 1000 ft and higher AGL
- Wind Turbine
- Group Obstruction
- Obstruction with high-intensity lights; may operate part-time

MISCELLANEOUS

- STADIUM
- Intermittent TFR site (within 3 NM, up to & incl 3000' AGL)
- A - Aerobatic Practice Area (See Supplement.)
- G - Glider Operations
- H - Hang Glider Activity
- U - Ultralight Activity
- UA - Unmanned Aircraft Activity
- Parachute Jumping Area (See Supplement.)
- Space Launch Activity Area (See Supplement.)
- VPXYZ
- VFR Waypoints (See chart tabulation for latitude/longitude.)

TOPOGRAPHIC INFORMATION

- Power Transmission Line
- Aerial Cable
- Lookout Tower
- Mountain Pass
- 1823 (Elevation of Pass)
- Pass symbol does not indicate a recommended route or direction of flight and pass elevation does not indicate a recommended clearance altitude. Hazardous flight conditions may exist within and near mountain passes.

Miramar MCAS (NKX)	3 nm
San Diego Intl. (SAN)	6 nm
North Island NAS (NZY)	8 nm
Gillespie Field (SEE)	8 nm
Imperial Beach NOLF (NRS)	15 nm
Brown Field Municipal (SDM)	17 nm
John Nichol's Field (Pvt)	17 nm
Ramona (RNM)	18 nm
Tijuana Intl. (TIJ)	19 nm
McClellan Palomar (CRQ)	20 nm
On the Rocks (Pvt)	21 nm
Lake Wohlford (Pvt)	23 nm
Flying T (Pvt)	25 nm
Bob Maxwell Memorial (OKB)	26 nm
Reider (Pvt)	27 nm
Blackinton (Pvt)	27 nm
Hoffman (Pvt)	28 nm
Loma Madera (Pvt)	28 nm

Figure 1.6
Airspace Environment
& Adjacent Airports

This Page Intentionally Left Blank


1.3 Population Data

This section provides background on the socioeconomic characteristics of the area surrounding the Airport.

Population Trends

San Diego is the second most populous county in California, second only behind Los Angeles County. Population levels in 2016, estimated by the United States Census Bureau for both San Diego County and the surrounding counties, are presented on **Figure 1.7**.


Figure 1.7 – San Diego and Surrounding County Populations

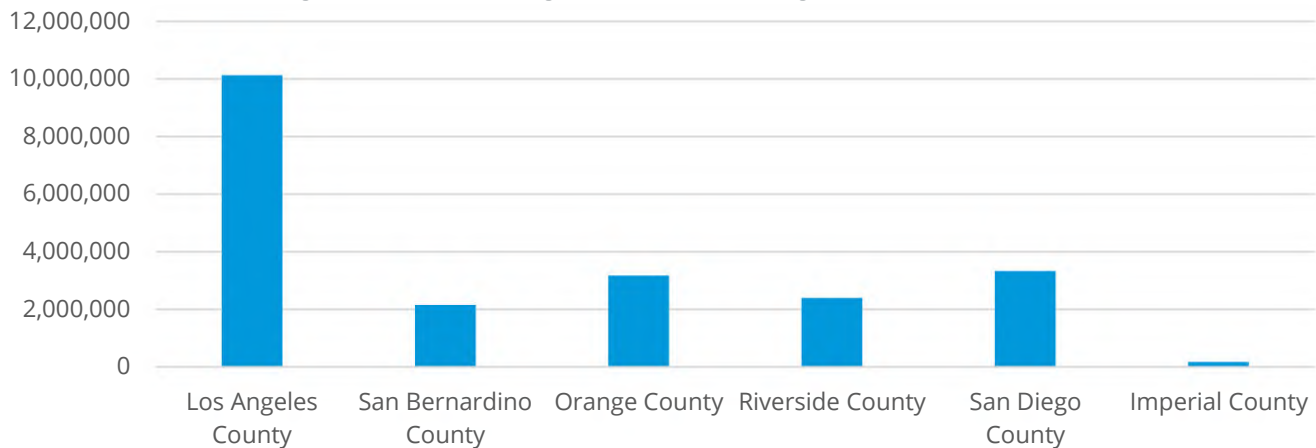

Source: U.S. Census Bureau (2010), C&S Engineers, Inc.

The San Diego County Economic Forecast, produced by the California Department of Transportation, estimates that the population of San Diego County will increase by 597,740 people in the 20-year period from 2017 to 2037. This would bring the total population to 3,936,040. The forecasted increase is presented on **Figure 1.8**.

Figure 1.8 – San Diego County Population Forecast

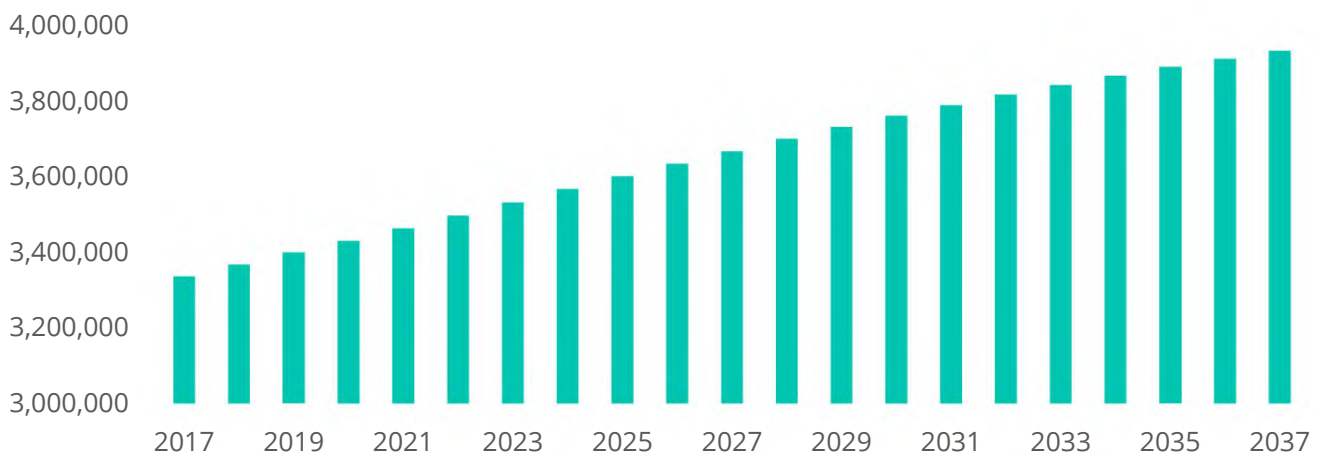

Source: California Department of Transportation, (2016) *San Diego County Economic Forecast*, C&S Engineers, Inc.

1.4 Airport Activity and Organizational Structure

Ownership and Operations

Montgomery–Gibbs Executive Airport is a public-use airport owned and operated by the City of San Diego. The Airports Division is a branch of the City’s Real Estate Assets Department and oversees the operations at City owned airports. The Airport is home to a number of facilities, including two FBO’s, that are owned or leased by tenants. They provide a variety of services such as aircraft maintenance, refueling, flight training, hangar rentals, air charter, and medical transport. **Table 1.2** lists the current tenants at the Airport as well any services they provide.

Table 1.2 – Airport Tenants and Services Provided

Tenant Name	Service Provided
San Diego Police Air Support Unit	Air Support, Surveillance, Aerial Security, Search and Rescue
Advanced Aircraft Services	Aircraft Maintenance
Spiders Aircraft Service	Aircraft Maintenance
Coast Aircraft	Aircraft Maintenance, Hangar Rental, tie-downs
Aviation Unlimited	Aircraft Sales
San Diego Air Tours	Biplane Rides
Crownair Aviation (FBO)	Full Service 100LL/Jet-A, Self Service 100LL, Aircraft Maintenance, tie-downs
Gibbs Flying Service (FBO)	Full Service 100LL/Jet-A, Aircraft Maintenance, tie-downs
National Air College	Flight Training
San Diego Fire-Rescue Air Operations	Fire Fighting, Air Rescue, Patient Transport
ATP Flight School	Flight Training
Learn to Fly San Diego	Flight Training
San Diego Flight Training International	Flight Training
Coast Flight Training and Management	Flight Training, Aircraft Management
Armed Forces Aero Club	Flying Club
Plus One Flyers	Flying Club
Corporate Helicopters of San Diego	Helicopter Tours, Sales, Filming, Construction Projects
Four Points by Sheraton	Hotel
Marv Golden	Pilot Supplies
Casa Machado	Restaurant

Source: City of San Diego

Some of the tenants mentioned above occupy office space in the administration building including:

- San Diego Air Tours
- Casa Machado

Policies and Plans

To enhance operational efficiency, the Airports should develop, maintain, and implement a number of management documents. **Table 1.3** identifies the documents currently in place at the Airport as well as the date they were published.

Table 1.3 – Airport Management Documents

Document	Year
Master Plan Update (Most recent update prior to current version)	2004
Real Estate Assets Department Airports Division: Business Plan (FY 2017) ¹	2015
City of San Diego Airports: Operations, Policies, and Procedures	2015
City of San Diego Airports Division: Minimum Operating Standards (DRAFT)	2017
Hangar Policies	2017

1. Update in progress Source: City records, C&S Engineers, Inc.

The following is a brief description of the purpose and content of the documents listed above.

Master Plan: See introduction at the beginning of this section. The last previously prepared Airport Master Plan for the Airport did not receive City Council approval. However, this effort did result in an FAA approved ALP.

Real Estate Assets Department Airports Division: Business Plan: The plan is intended to ensure that the City’s Airports System is operated safely and efficiently, that it complies with all appropriate regulations, is financially self-sufficient, encourages airport business growth and opportunities, focuses on internal and external customers, maximizes the City’s return on investment for airport property, and is managed by professional airport management staff. This plan is meant to be a “living and working” document that adapts as conditions change. This plan is updated each fiscal year.

City of San Diego Airports: Operations, Policies, and Procedures: This document is intended to guide day-to-day operations of the City of San Diego Airports. It is used by airport management to conduct the daily business of the City of San Diego Airports in an efficient manner, consistent with the policies of the FAA, the state of California, and the City of San Diego.

City of San Diego Airports Division Minimum Operating Standards: The purpose is to provide the threshold entry requirements (qualifications, levels of service, facilities, insurance) for those desiring to provide commercial aeronautical services to the public and to insure that those who have undertaken to provide commodities and services as approved are not exposed to unfair or irresponsible competition. They contain the minimum levels of service, facilities, staffing, insurance, and environmental compliance that must be met by the prospective service provider. The uniform application of these standards relates primarily to the public interest by discouraging substandard entrepreneurs and mandating insurance coverage levels, thereby protecting the Airport, airport patrons, and established aeronautical activities.

Hangar Policy: Published responses to common hangar ownership questions including insurance requirements, waiting list rules, applicable fees, and hangar subleases.

Airport Economic Benefits

In addition to serving as a vital community asset, airports provide an economic benefit to their communities through direct and indirect impacts. Direct impacts include those related to on-airport businesses and government agencies and those attributed to visitor spending and tourism. Indirect impacts mainly include the re-circulation of employees spending their earnings locally and the on-airport businesses purchasing goods and services locally.

As a whole, the air transportation sector in San Diego County was directly responsible for 1,926 jobs⁴ in 2015. This includes a combination of scheduled air transportation, nonscheduled air transportation, and both freight and passenger transport. Countywide, air transportation generates total direct economic activity valued at about \$742.6 million in industry output. In addition, air transportation directly accounts for over \$130.8 million in labor income (both employee compensation and proprietor income). This total does not account for other jobs that are supported and facilitated by air transportation. This would include both suppliers and business-to-business vendors, and industries that rely on air transportation to bring customers and products into the San Diego regional market.


Airport-specific information will be provided under a subsequent section of the Airport Master Plan.

⁴ ADE, Inc.; data from IMPLAN Pro input-output model, May 2017.

Existing and Historical Aircraft Operations


Historical aviation activity at the Airport was gathered using the FAA's Operations Network (OPSNET). The network includes the FAA Terminal Area Forecast (TAF), which provides historical and forecasted aircraft operational data. **Figure 1.9** breaks down aircraft operations from 2016 by user class. Historical activity levels by user class are summarized on **Figure 1.10** and **Figure 1.11**. The operations indicate a slight decrease in total aviation activity from the year 2007. General aviation operations continue, by a large majority, to be the largest user class generating activity. Air taxi and military operations reached a 10-year low point in 2011, but their 2016 levels have seen an increase of 62 percent and 181 percent respectively. Even with this gradual increase, they continue to account for only a small margin (less than three percent) of the total traffic.

Figure 1.9 – Existing Operations Split by Class

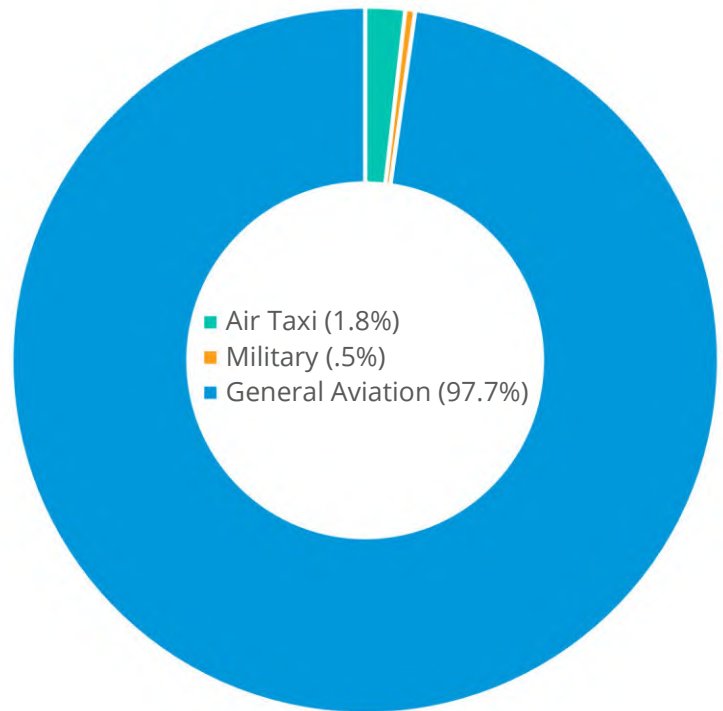


Source: FAA TAF, C&S Engineers, Inc.

Figure 1.10 – Historical and Existing General Aviation Operations

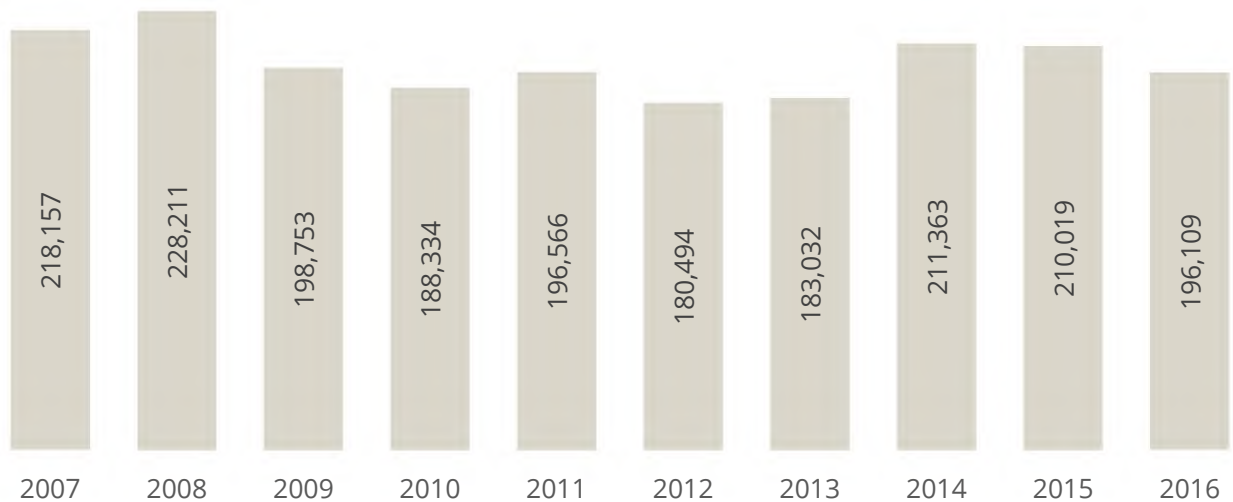


Source: FAA OPSNET data from 01/01/2007 to 12/31/2016. Air carrier operations were negligible (less than 15 per year) and combined with air taxi operations.

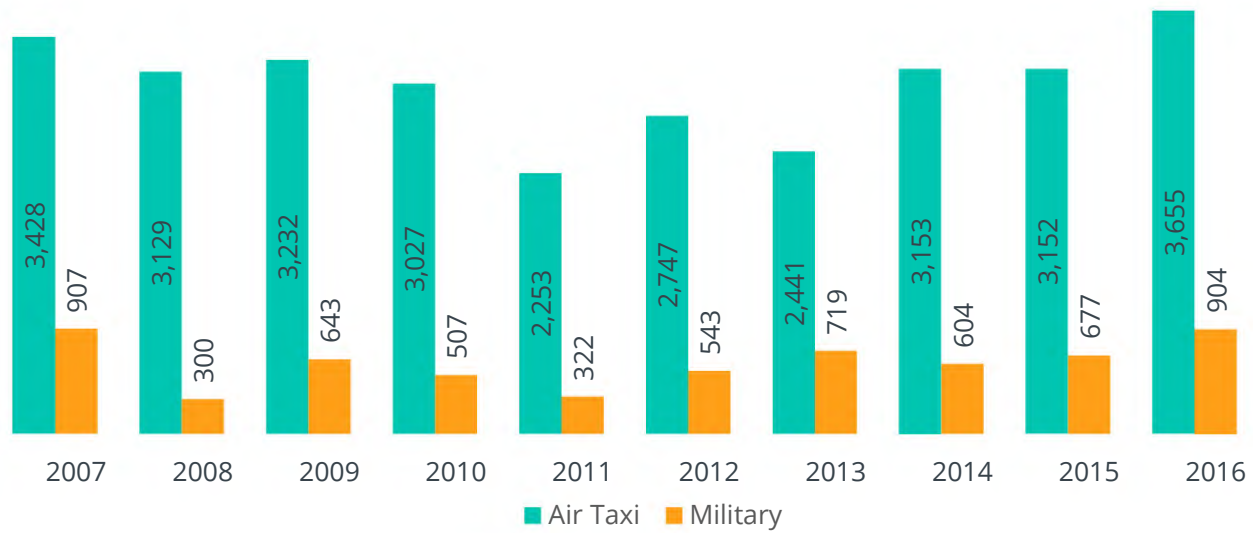Figure 1.11 – Historical and Existing Air Taxi and Military Operations

Source: FAA OPSNET data from 01/01/2007 to 12/31/2016. Air carrier operations were negligible (less than 15 per year) and combined with air taxi operations.

Historical and Existing Based Aircraft

A based aircraft is one that is based at the Airport either permanently or at least for the majority of the year. It is important to evaluate not only the number of aircraft based at the Airport, but the type of aircraft as well. Based aircraft, especially those owned by flight schools and flying clubs, can make up a large number of the aircraft operations. Historical based aircraft information for MYF was retrieved from the FAA TAF while current information was collected from the FAA National Based Aircraft Inventory Program. Historical based aircraft numbers are presented on **Figure 1.12**. As of 05/08/2017, MYF had 604 validated based aircraft. Approximately 83 percent of the based aircraft are single-engine (SE) piston aircraft.

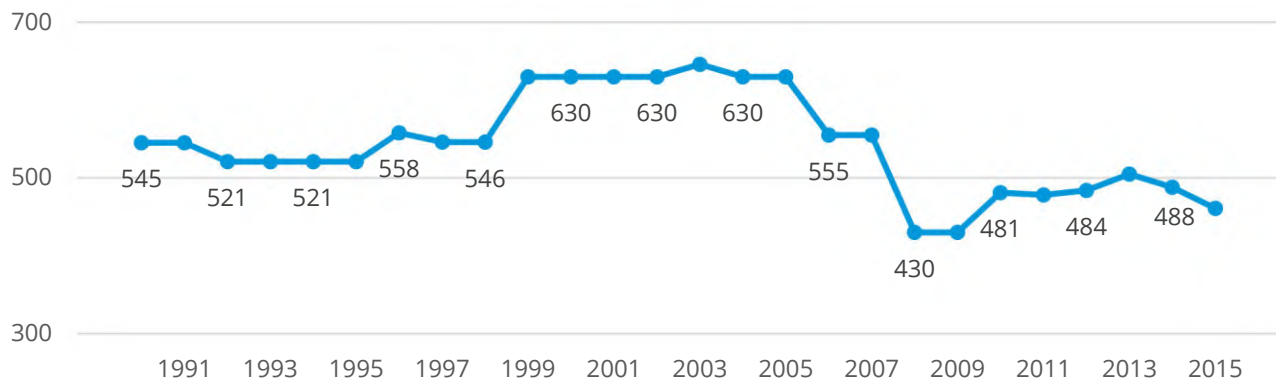Figure 1.12 – Historical Based Aircraft

Source: FAA TAF, C&S Engineers, Inc.

Historical aviation activity is documented in detail in this Master Plan as part of forecast section.

Fleet Mix and Critical Aircraft

The selection of the appropriate FAA airport design standards is based upon the critical aircraft, sometimes referred to as the design aircraft. The FAA has defined the critical aircraft as the most demanding aircraft or aircraft grouping by similar characteristics that performs, or is projected to perform, 500 annual operations at the airport facility. The previous ALP identified the Beechcraft King Air 200 as the critical aircraft for Runway 10L/28R and Runway 5/23. Runway 10R/28L is only 60-feet wide and unsuitable for use by aircraft the size of the King Air 200. It has been assigned a separate critical aircraft, the Cessna 421.

Aircraft Characteristics

The Beechcraft King Air 200 has a wingspan of 54.5 feet, a Maximum Takeoff Weight (MTOW) of 12,500 pounds (lbs.), and an approach speed of 97 knots (kts.). These specifications classify the King Air 200 in Approach Category B (approach speeds 91 knots or more but less than 121 knots) and Airplane Design Group II (aircraft with wingspans up to 49 feet but less than 79 feet and tail heights up to 20 feet but less than 30 feet). A sample of the based and transient aircraft as well as their characteristics is presented in **Table 1.4** and **Table 1.5**. Fleet mix will be covered in further detail under the forecast section of this Master Plan.

Table 1.4 – Based Aircraft Characteristics

Aircraft	Type	MTOW (lbs.)	Approach Speed (kts.)	Wingspan (ft.)	AAC	ADG
Cessna 172	SE	2,450	61	36.1	A	I
Cirrus SR22	SE	3,400	78	38.4	A	I
Beechcraft 200	Turboprop	12,500	98	54.5	B	II
Eclipse 500	Jet	5,950	90	37.25	A	I

Source: FAA Aircraft Characteristics Database, FAA National Based Aircraft Inventory Program, C&S Engineers, Inc.

Table 1.5 – Transient Aircraft Characteristics

Aircraft	Type	MTOW (lbs.)	Approach Speed (kts.)	Wingspan (ft.)	AAC	ADG
Embraer Phenom 100	Jet	10,582	112	40.0	B	I
Cessna XLS+	Jet	20,200	111	56.0	B	II
Beechcraft 350	Turboprop	15,000	107	57.9	B	II
Beechcraft 1900	Turboprop	17,120	113	58	B	II

Source: FAA Aircraft Characteristics Database, FAA Operations Network (OPSNET), C&S Engineers, Inc.

1.5 Regional Setting and Land Use

The following sections provide information regarding land use, zoning, land use compatibility, consistency with other plans, and the Airport's climatological setting.

Land Use

Land uses surrounding the Airport were inventoried to understand existing compatibility. **Figure 1.13** presents the variety of land-uses surrounding the Airport. Land use shape files were retrieved from the San Diego Regional Planning Associations website. Land use immediately to the north of the airport property boundary is mostly industrial with a pocket of residential directly north of the Runway 23 threshold. To the east of the property, there is a mix of industrial, public-use, and open space. On the eastern side of Interstate 15 (I-15), approximately .5 miles from the Airport boundary, land use is mostly residential. The land uses directly south of MYF are industrial and public-use, with a large amount of residential use beginning roughly 500 feet from the property line. To the west of the Airport (west of California State Route 163) are mostly industrial and commercial land uses with some residential land use located between Ruffner Street and Interstate 805 (I-805). West of I-805 is predominately-residential land use.

As indicated by guidance provided in FAA Advisory Circular (AC) 150/5070-6B, *Airport Master Plans*, public facilities within the vicinity of the Airport were identified and are presented in **Table 1.6**.

Table 1.6 – Public Facilities within ½ Mile of MYF

Facility	Direction from Airport
Fire Station	
San Diego Fire-Rescue Department: Station 28	West
Library	
Serra Mesa-Kearny Mesa Branch Library	South
Police Station	
San Diego Police Department: Traffic Division	Southeast
Schools	
Coleman University	North
Brightwood College	North
National University	Southwest
San Diego Community College District North Campus	South
Angier Elementary School	South
Wegeforth Elementary School	South
St. Columbia Catholic School	South
Soille San Diego Hebrew Day School	South
Coleman Tech Charter High School	South
Rock School of Ministry	Southeast
Kavod Elementary School	Southeast
University of Phoenix, San Diego	East
Grace Christian School	East
Places of Worship	
New Life Church	Northwest
Korean Hope Church	Northwest
San Diego Christian Worship	Northeast
Flood Church	East
Saint Columbia Catholic Church	South
San Diego Korean Cathedral	South
Pacific Hope Church	South
Door of Hope Christian Church	South
Gracewave Church	South
Afghan Community Islamic Center	South
Grace Brethren Church-Kearny	Southwest

Source: San Diego Regional Planning Association, C&S Engineers, Inc.

Zoning

The City of San Diego General Plan classifies the Airport as “unzoned” indicating that it falls under a separate set of rules than other land uses. Guidance relating to off-airport land-use compatibility is contained in the Airport Land Use Compatibility Plan (ALUCP). Zoning surrounding the Airport is depicted on **Figure 1.14**.

Montgomery-Gibbs Executive Airport ALUCP

Airport land use compatibility plans are established in order to promote compatibility between airports and the surrounding land uses. In San Diego County, the Board of the SDCRAA is responsible for producing these plans for all public-use and military airports. The purpose of the plan is to provide for the orderly development of the Airport and the surrounding community, as well as to safeguard the general welfare of the inhabitants within the vicinity of the Airport and the public in general⁵. The plan identifies Airport Influence Areas (AIA) and has specific requirements to be followed by local agencies when development is proposed within these areas. The ALUCP is based on the ALP most recently approved by the FAA. Any changes to the ALP occurring as a result of this master planning process will be reviewed by the Airport Land Use Commission (ALUC) to determine potential impacts to the ALUCP.

Community Plans

The City of San Diego is broken up into various communities, each with their own planning group, community plans, and/or regulations. The Airport is referenced and potentially affected by the community plans of three surrounding neighborhoods including Serra Mesa, Kearny Mesa, and Clairemont Mesa.

Kearny Mesa Community Plan

The plan recognizes that while the Airport is technically within the boundaries of the Kearny Mesa planning area, the land use policies are contained in the ALUCP. This plan requires that any proposed development be reviewed for compatibility with both MYF and the Marine Corps Air Station Miramar, per the specifications in the ALUCP. The main concerns of the community include aircraft noise, approach patterns, crash hazards, and future airport expansion.

Serra Mesa Community Plan

While the Airport does not fall within the limits of the Serra Mesa planning area, arriving and departing aircraft pass overhead and thus the Airport is discussed in the plan. The concerns stated in the plan include noise, approach patterns, and crash hazards. The plan recognizes that while aircraft noise levels may not exceed federal and state recognized annoyance level standards it is still an important issue to residents.

Clairemont Mesa Community Plan

The Clairemont Mesa Community Plan is similar to the Serra Mesa plan in that it is affected by the Airport even though MYF is outside of the official planning area. The main concerns of the community regarding the Airport are noise and potential crash hazards. It refers to the MYF ALUCP for development regulations for both airport development and any development in the designated AIAs.


⁵ 2010, *Montgomery Field Airport Land Use Compatibility Plan*

Figure 1.13
Surrounding
Land Use

Legend

- Residential
- Industrial Employment
- Institutional & Public and
Semi-Public Facilities
- Commercial
- Park, Open Space, &
Recreation
- Street & Highway System
- Airport Property Line
- 🔥 Fire Station
- H Hospital
- 📖 Library
- 👮 Police Station
- ✉ Post Office
- 🎓 School
- ⛪ Place of Worship

500' 0' 500' 1000'

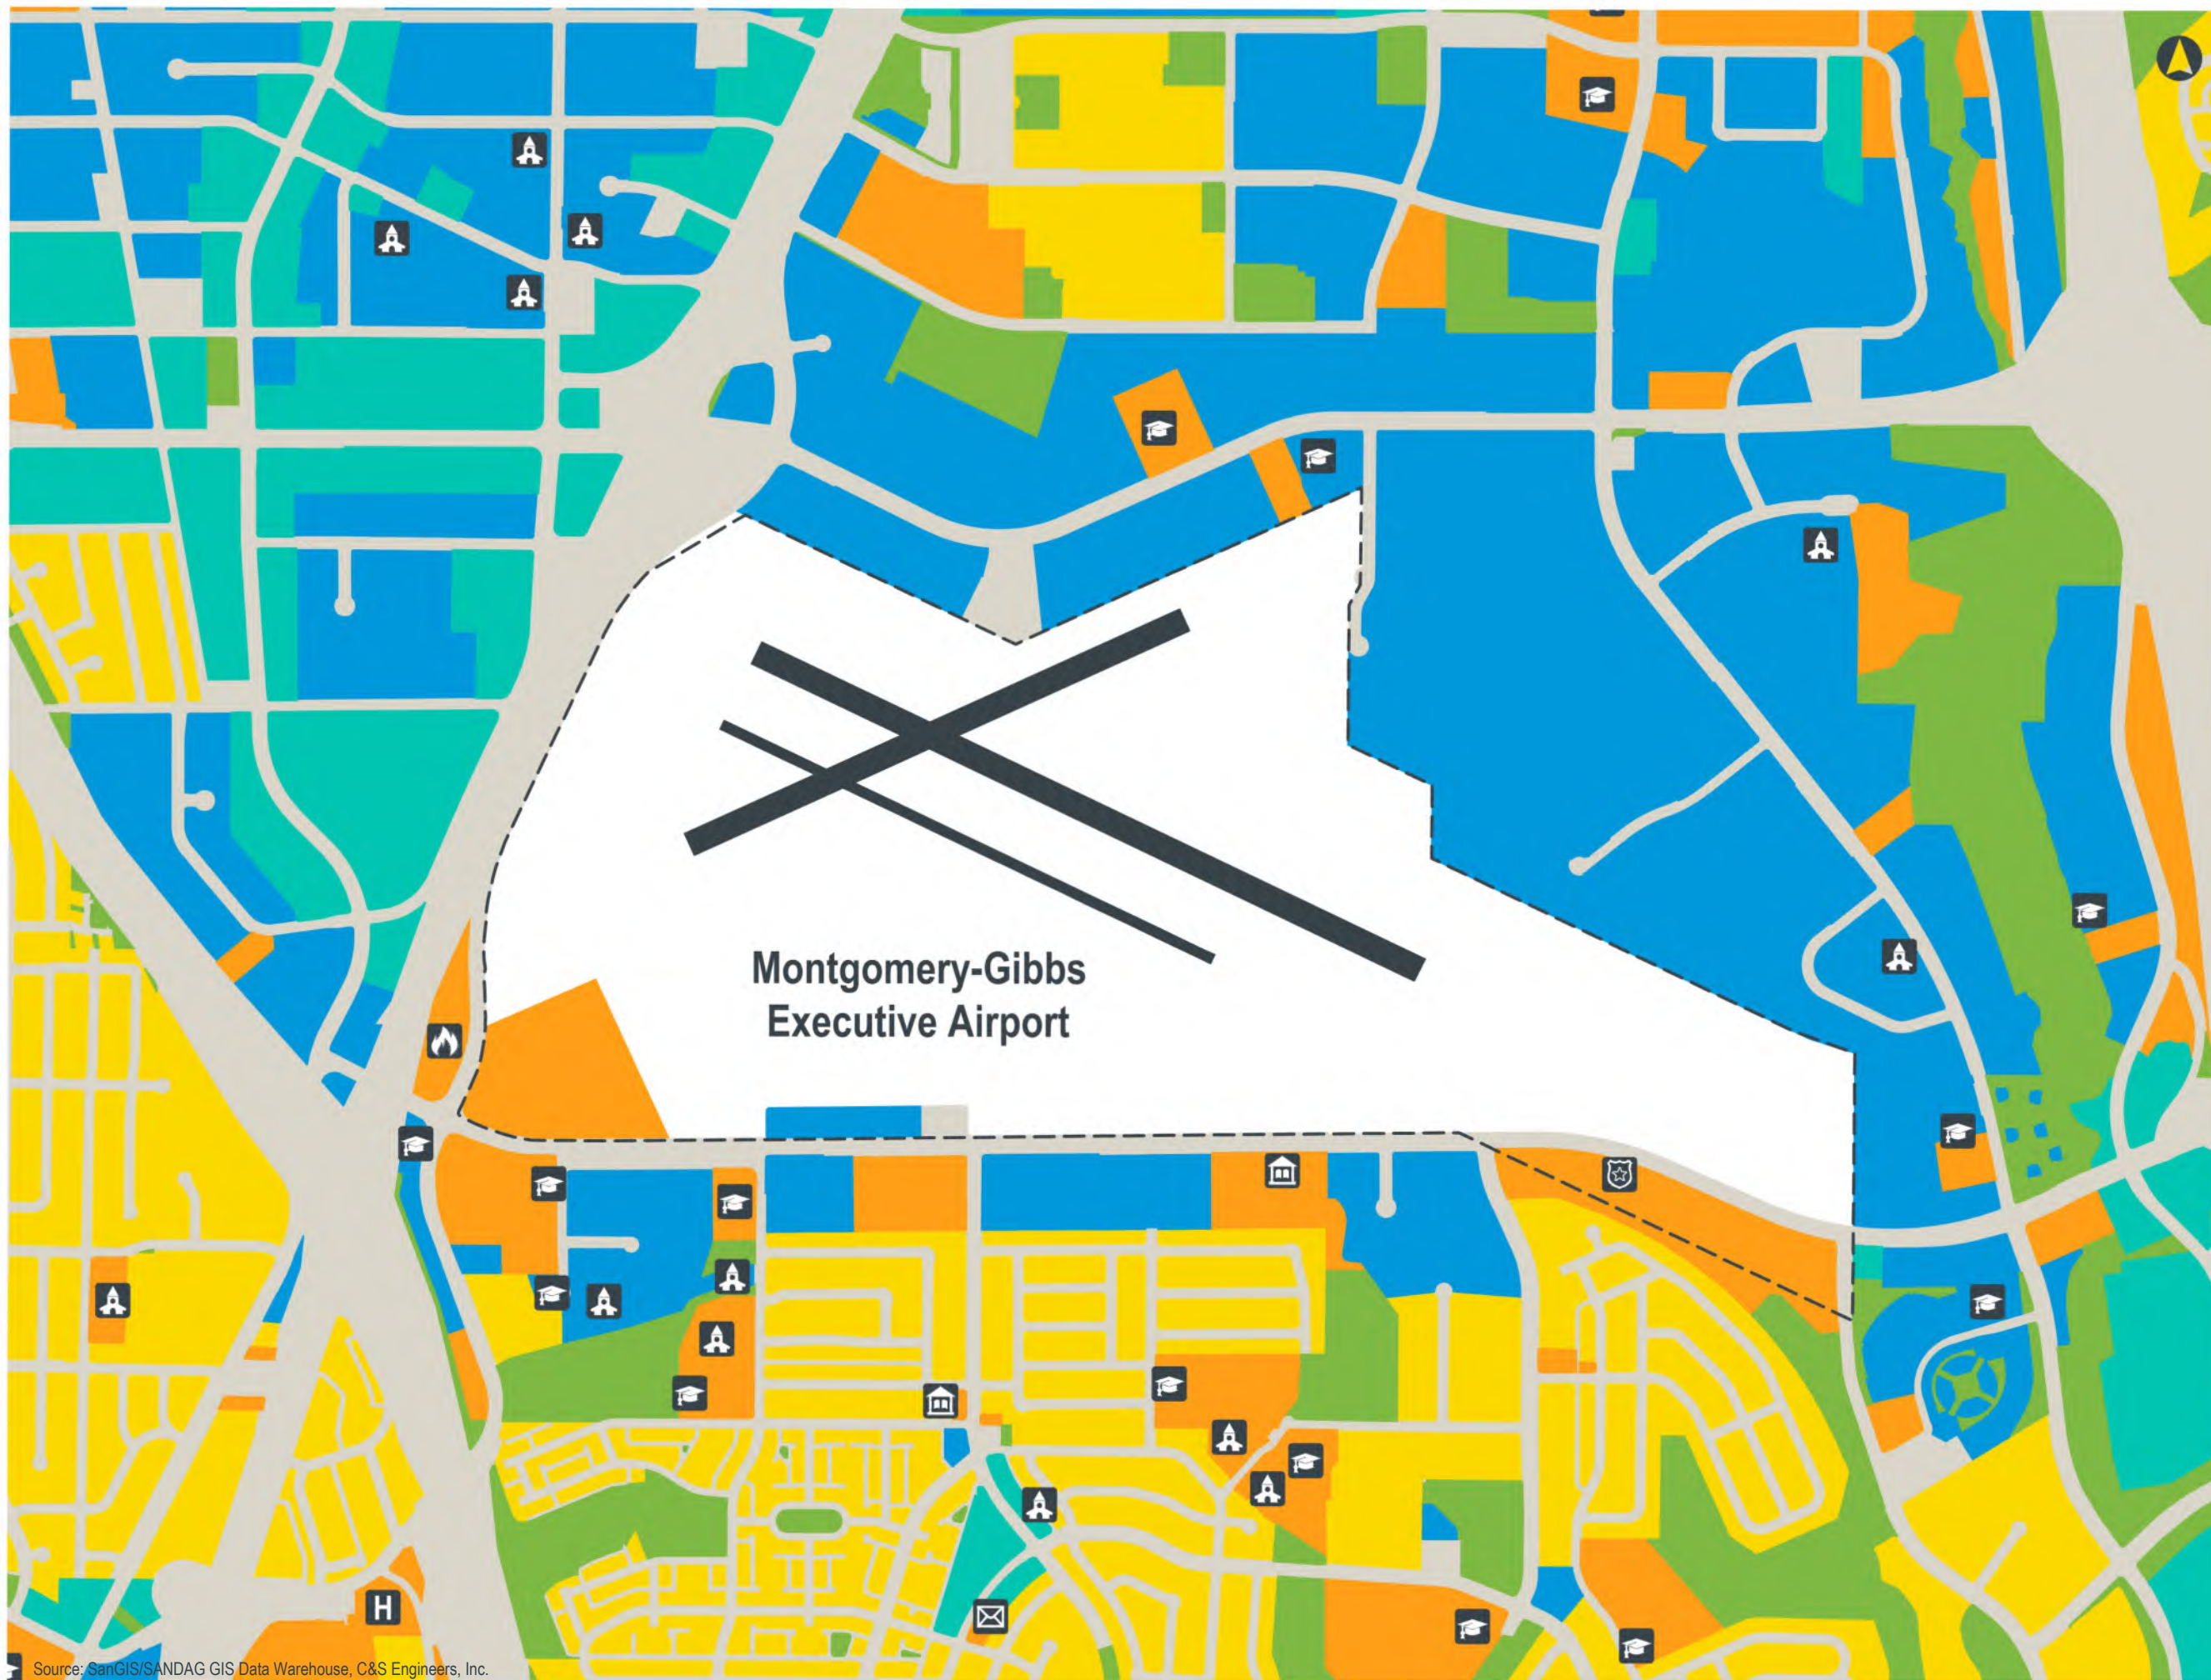


This Page Intentionally Left Blank

Figure 1.14
Surrounding Zoning

Legend¹

	CC-1-1
	CC-1-3
	CC-4-2
	CN-1-2
	CO-1-2
	CP-1-1
	IH-2-1
	IL-2-1
	IL-3-1
	IP-2-1
	OC-1-1
	OP-1-1
	OR-1-1
	RM-1-1
	RM-2-5
	RM-3-7
	RM-3-8
	RM-3-9
	RM-4-10
	RS-1-1
	RS-1-2
	RS-1-3
	RS-1-4
	RS-1-7
	RS-1-8
	Unzoned

1. Refer to the City of San Diego Municipal Code, Chapter 13 for descriptions of each zoning designation.

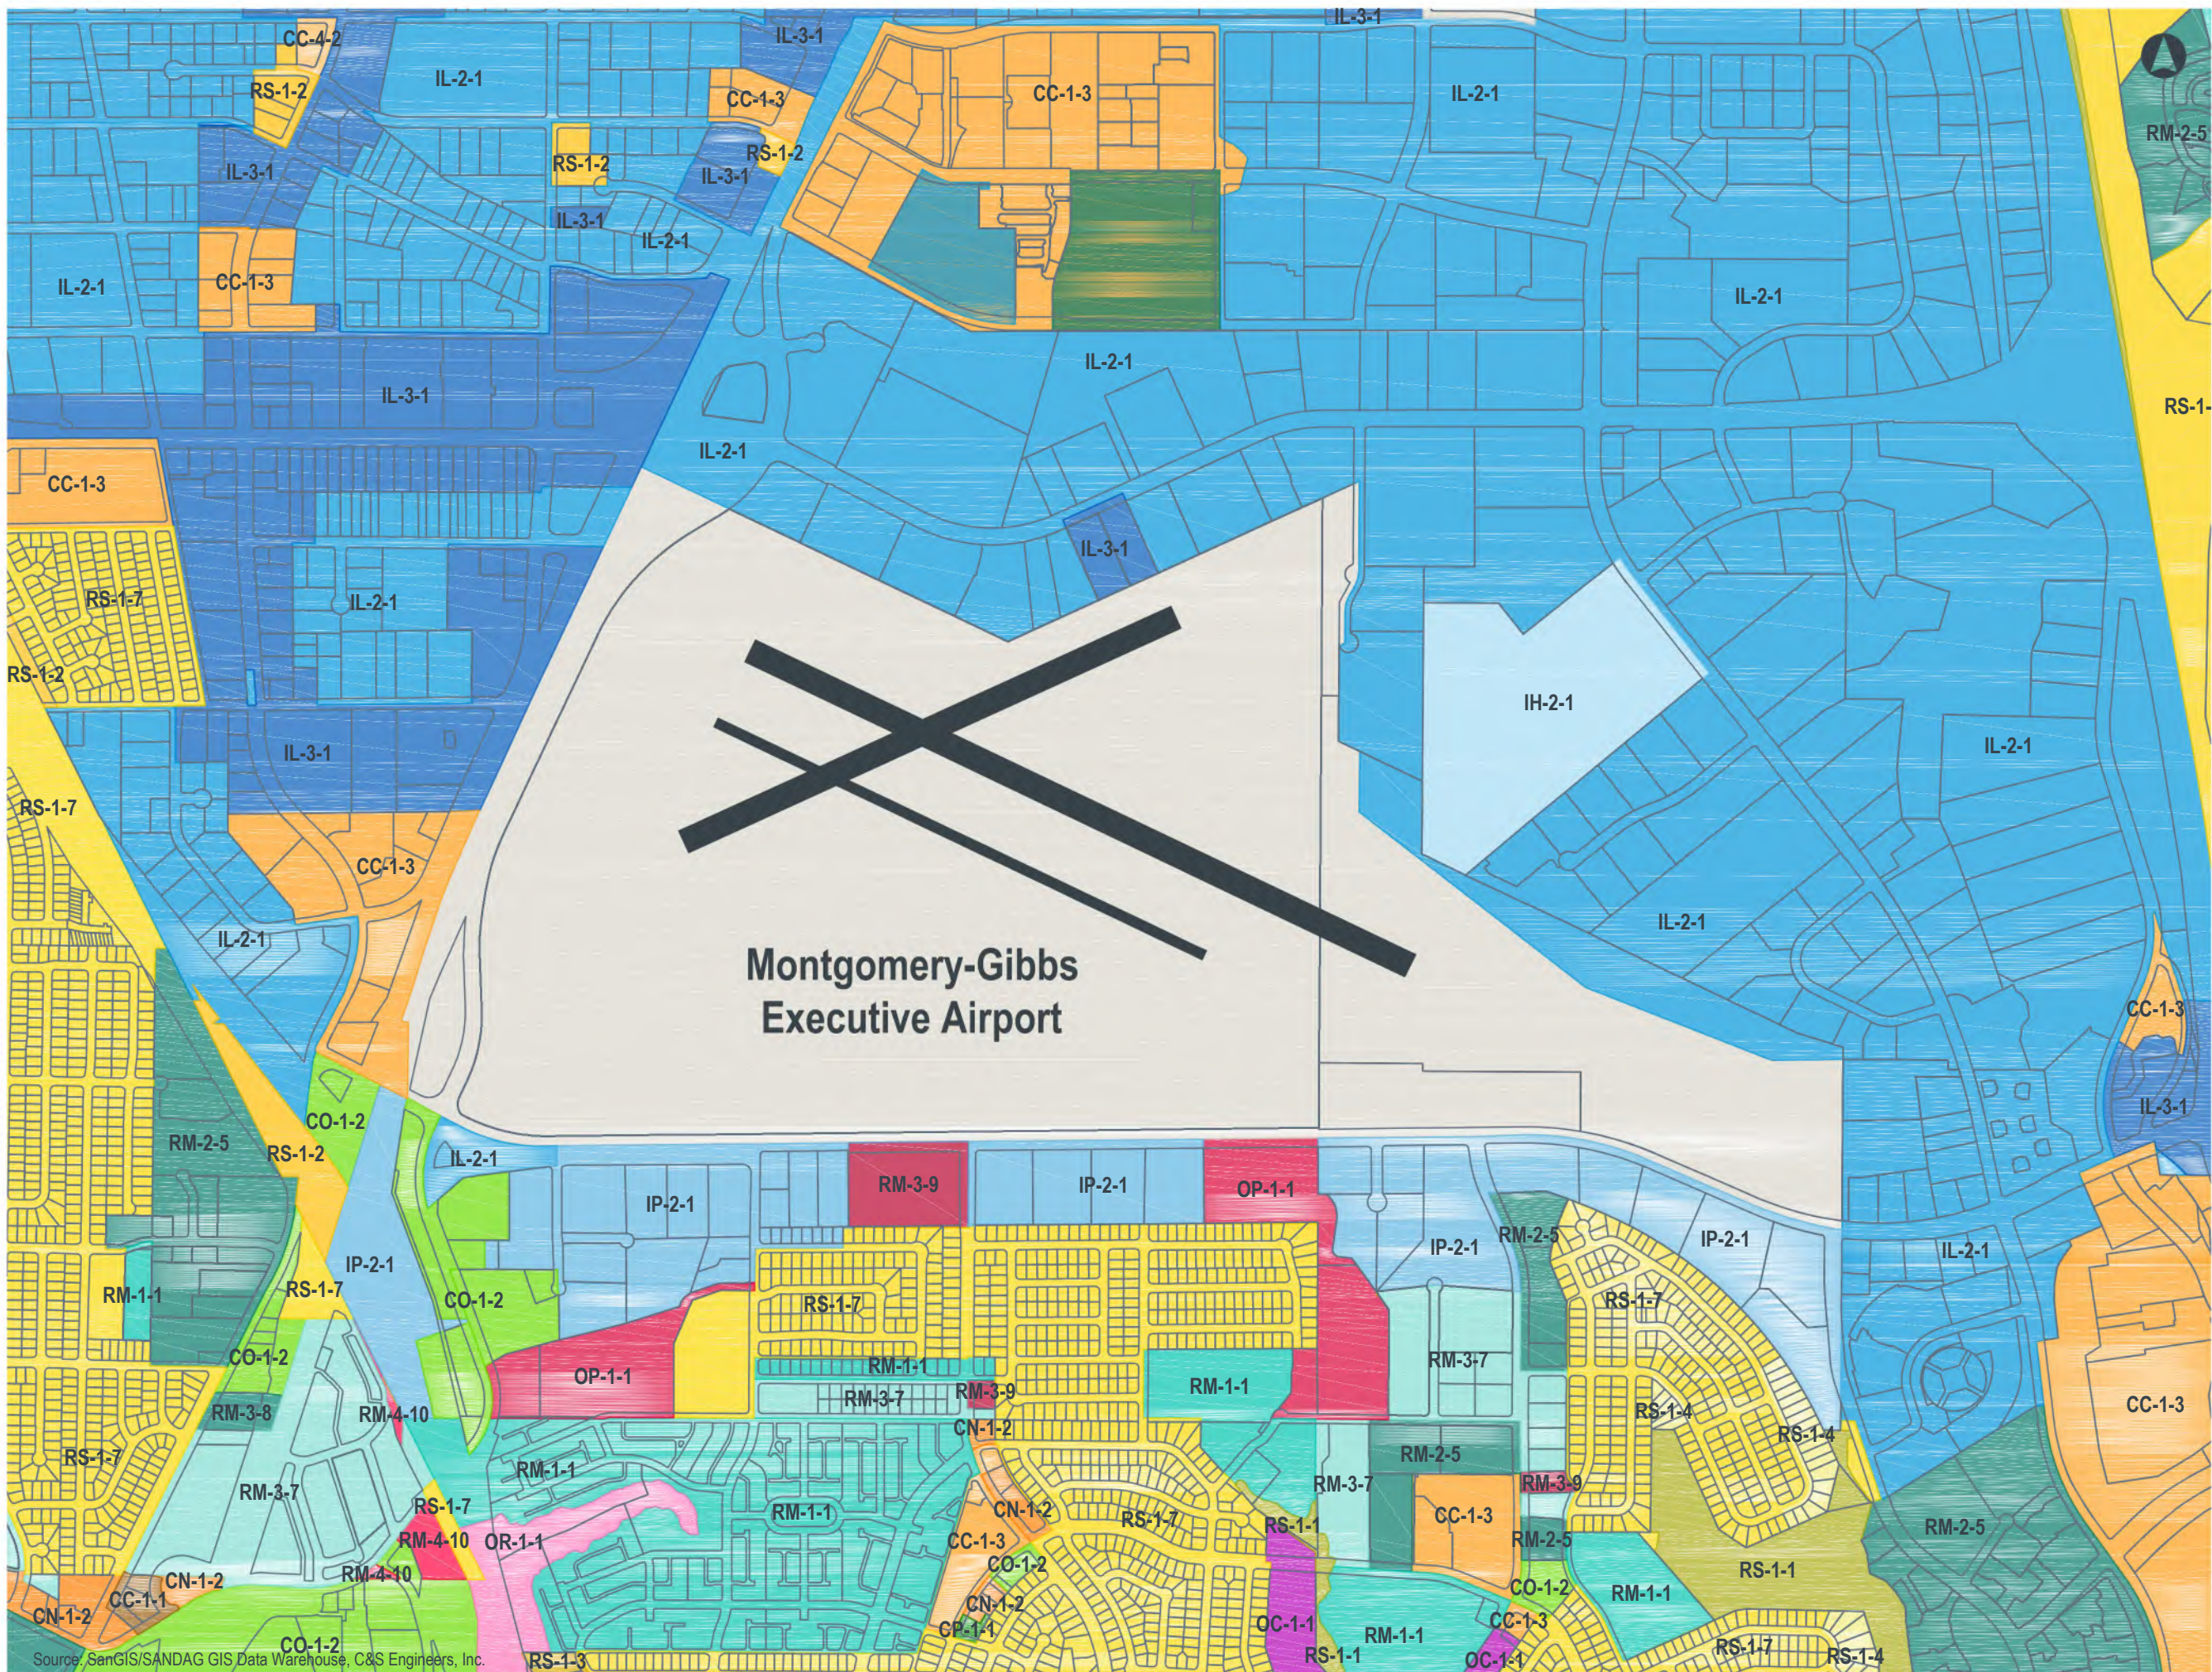

This Page Intentionally Left Blank

Climate and Topography

The Airport is situated in the Kearny Mesa community of San Diego at an elevation of 427.3 feet above mean sea level (MSL). As the name Mesa implies, the area is generally level and is surrounded by steep walled valleys. The climate is classified as semi-arid and often referred to as Mediterranean. Proximity to the Pacific Ocean results in warm summers and mild winters.

There is an Automated Surface Observing System (ASOS) based at the Airport that gathers basic minute-by-minute, 24-hour weather information to be used for weather reporting. According to the Summary of Monthly Normals from 1981-2010, the mean maximum temperature of the hottest month is 80.9°F in the month of August while the mean minimum temperature was 44.3°F in the month of January. January, the wettest month, sees an average of 2.68 inches of precipitation and accounts for 21.4 percent of the average annual precipitation of 12.51 inches. See **Table 1.7** for a summary of the temperature and precipitation averages.

Table 1.7 – Temperature and Precipitation

Hottest Month	August (80.9°F mean maximum temperature)
Coldest Month	January (44.3°F mean minimum temperature)
Mean Annual Temperature	63.0°F
Wettest Month	January (Average 2.68 inches rainfall)
Mean Annual Precipitation	12.51 inches

Source: National Climatic Data Center, 1981-2010 Normals, C&S Engineers, Inc.




Wind Coverage

The FAA provides guidance in FAA AC 150/5300-13A, *Airport Design*, on determining whether the existing runway orientation is sufficient for the fleet mix. The process was followed below.

A wind analysis was conducted using historical wind data obtained from the National Oceanic and Atmospheric Administration (NOAA) National Climatic Data Center (NCDC). Observations for this data were taken at the Airport over the 10-year period from 2006 to 2016. The Airport Reference Code (ARC) dictates maximum crosswind components. The ARC signifies the design standards to which an airport is built. The ARC at the Airport is a B-II, which has a maximum allowable crosswind component of 13 knots. However, numerous planes use the Airport that have a maximum crosswind component greater than 13 knots and so the percent coverage has been shown up to 20 knots. The wind roses for the Airport as well as the percent coverage for each weather condition are presented on **Figure 1.15**. There is a wind rose presented for three weather conditions; All Weather, Instrument Flight Rules⁶ (IFR), and Visual Flight Rules⁷ (VFR). The numbers in each box indicate the number of wind readings that were registered at that speed and direction. If there is a plus sign, it indicates that less than 100 readings have been recorded at that specific speed and direction. A crosswind runway is recommended when an airport’s primary runway orientation provides less than 95 percent wind coverage. Due to the Airport’s existing crosswind runway, the percent wind coverage is sufficient under All Weather, VFR, and IFR conditions.

6 IFR apply when visibility is poor and cloud ceilings are low. The term IFR refers to a set of rules governing the conduct of flight under instrument meteorological conditions (IMC) where pilots rely on instrumentation to navigate.

7 VFR apply when weather is clear (cloud ceiling greater than 3,000 feet above ground level and visibility greater than five statute miles)

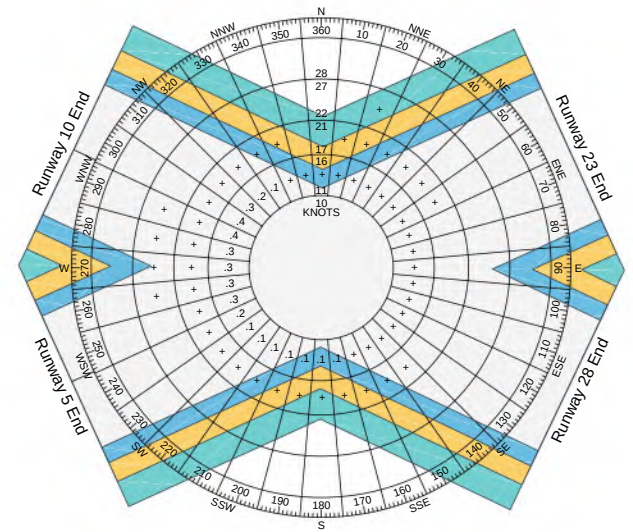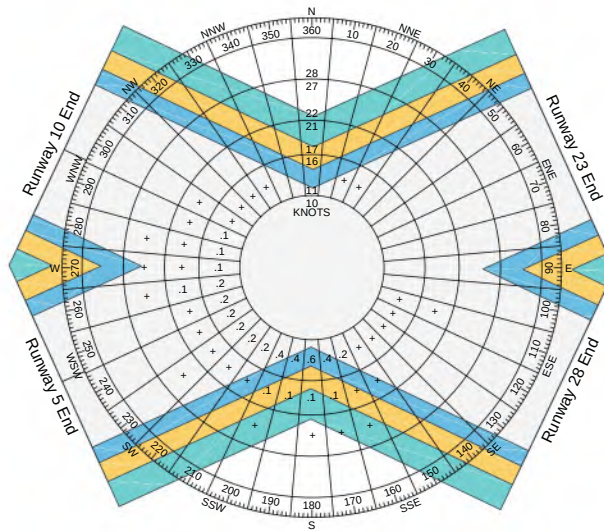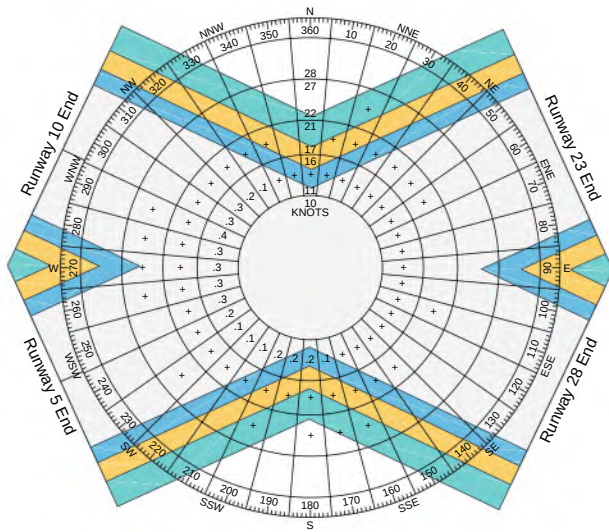

All Weather Wind Coverage			
	Percent Coverage		
Crosswind Component	Runway 10/28	Runway 5/23	Combined
10.5 Knots	98.65%	98.42%	99.49%
13 Knots	99.35%	99.31%	99.82%
16 Knots	99.89%	99.91%	99.96%
20 Knots	99.98%	99.99%	100.00%

IFR Wind Coverage			
	Percent Coverage		
Crosswind Component	Runway 10/28	Runway 5/23	Combined
10.5 Knots	97.11%	97.85%	98.39%
13 Knots	98.43%	98.88%	99.34%
16 Knots	99.57%	99.74%	99.84%
20 Knots	99.92%	99.96%	99.99%

VFR Wind Coverage			
	Percent Coverage		
Crosswind Component	Runway 10/28	Runway 5/23	Combined
10.5 Knots	98.97%	98.58%	99.69%
13 Knots	99.53%	99.41%	99.91%
16 Knots	99.94%	99.93%	99.99%
20 Knots	99.99%	99.99%	100.00%

1.6 Airside Facilities

Airside facilities include those that directly support airport operations including runways, taxiways, NAVAIDS, and apron areas. A diagram of MYF's runways and taxiways is shown on **Figure 1.16**. **Table 1.8** provides a summary of the existing airside facilities that are described in the subsequent text.

Runways

The airfield consists of three paved runways, one 4,598-foot runway with a precision approach, a 3,401-foot parallel runway, and a 3,400-foot crosswind runway. The details and characteristics of each runway are described in **Table 1.8**. A Pavement Maintenance Management Plan (PMMP) was completed for MYF in February 2018 that provided an analysis of the current pavement condition. According to the PMMP report, the overall average pavement condition index (PCI) for the runways at MYF is 85. The PCI is a numerical pavement condition rating that ranges from 0 (failed pavement) to 100 (pavement in perfect condition). Based on Figure 3-4 2017 Pavement Condition Index Map in the PMMP report (see Appendix H), both Runways 10L/28R and 5/23 are in good condition whereas a portion of Runway 10R/28L is in poor condition. Additional information about each of the individual components will be discussed in subsequent sections.

Table 1.8 – Runway System Characteristics

Characteristics	Runway 10L/28R	Runway 10R/28L	Runway 5/23
Use	Primary	Secondary	Crosswind
Length x Width (feet)	4,598 x 150	3,401 x 60	3,400 x 75
Displaced Threshold (feet)	N/A / 1,199	N/A	390 / N/A
Condition	Good ¹	Good ¹	Good ¹
Pavement Condition Index		85 ¹	
Pavement Condition Number	35 ¹	43 ¹	55 ¹
Pavement Strength (pounds)			
Single Wheel			
Dual Wheel	12.0 SWL ¹	12.0 SWL ¹	12.0 SWL ¹
Tandem			
Composition	Asphalt	Asphalt	Asphalt / Treated
Wind Coverage (All Weather)			
13 knots	99.35%	99.35%	99.53%
Markings	Basic / Precision	Basic / Basic	Basic / Basic
Edge Lighting	MIRL	N/A	N/A
Approach Lighting	PAPI / MALSR, PAPI	N/A / REIL	N/A
Instrument Approaches	None / ILS, LOC, GPS	N/A	N/A

Source: FAA Airport Master Record Form 5010 (Chart Supplement EFF 03/02/2017) and C&S Engineers, Inc.


¹Pavement strength and condition were evaluated as a part of a Pavement Maintenance Management Plan (PMMP) which will be included in this report as Appendix A. The PCI is representative of the average pavement condition of all three runways.

As part of City Resolution 280194, an administrative restriction was placed on all runways at MYF limiting the operation of aircraft above 20,000 lbs. maximum gross certified takeoff weight. However, the restriction prescribed no mechanism that could be utilized by the City for its enforcement. The weight restriction will be further evaluated as part of the master planning process.

Taxiways

Runways 10L/28R and 10R/28L share a full-length parallel taxiway while Runway 5/23 is served by a partial length parallel taxiway. The airfield is also developed with a network of connectors and cross-field taxiways equipped with medium intensity taxiway edge lights (MITL). All the taxiways meet the ARC B-II standard separation of 240-feet from runway to taxiway centerline. Both the taxiway and runway locations can be viewed on **Figure 1.16** while **Table 1.9** lists the characteristics of each taxiway. According to the 2018 PMMP report, the average PCI values for the taxiways present at MYF is 71. A PCI rating of 70-100 represents pavement in good condition. Majority of the taxiway pavement found at the Airport is in good condition; however, the PMMP report states that the northern portion of Taxiway Charlie was milled and overlaid with non-standard asphalt surface material making the visual inspection of the pavement insufficient.

Figure 1.16 – MYF Airfield

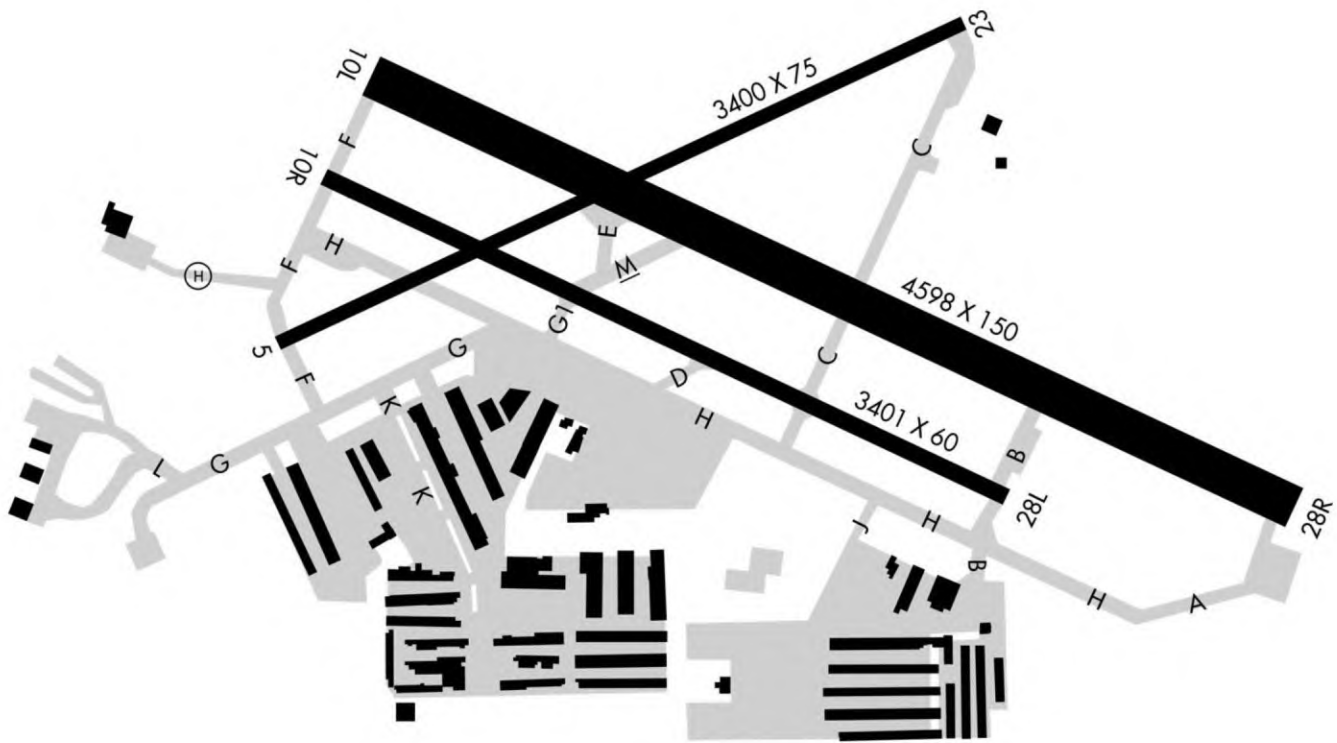

Source: FAA Chart Supplement

Table 1.9 – Taxiway Width

Taxiway Width (feet)	A	B	C	D	E	F	G	G1	H	J	K	L	M
	50	50	50	40	50	50	50	50	40	40	40	40	50

Source: C&S Engineers, Inc., Google Earth 2016

Displaced Threshold

A displaced threshold is placed at the end of a runway with the purpose of changing the point at which an approaching aircraft will touch down on the runway. They are generally put in place in order to move the approach path of an aircraft away from an obstruction, such as a tower or building, that penetrates the FAA defined threshold-siting⁸ surface. The portion of the runway marked as a displaced threshold is permitted to be used during takeoff, but not during landing. See **Figure 1.17** for a graphical depiction of a displaced threshold.


The Runway 28R threshold is displaced 1,176 feet and the Runway 5 threshold is displaced 390 feet. The displaced threshold was placed on the end of Runway 28R in 1995 when the runway was extended. The intent of the displaced threshold was to increase the length of runway available for takeoff, but keep the landing distance the same. According to City Resolution 280194,⁹ keeping the landing threshold at the current location would allow the Airport to continue to accommodate the existing aircraft fleet mix while limiting the use of larger aircraft that may not comply with previously established noise and weight limitations. As noted in the Serra Mesa Community Plan,¹⁰ increasing the available takeoff distance would also allow departing aircraft to achieve a higher altitude prior to passing over residential areas.

A review of historical records found no explanation as to why the Runway 5 landing threshold was displaced. It was likely added to avoid obstructions or provide additional space between the existing hangar development located south of Runway 5 and the landing threshold.

⁸ The dimensions of the threshold-siting surface (TSS) are presented in Table 3-2 of FAA AC 150/5300-13A, *Airport Design*.

⁹ City Resolution 2800914/ R-92-2009, June 22, 1992.

¹⁰ *Serra Mesa Community Plan*, The Serra Mesa Community Planning Group and City of San Diego Planning Department, amended 2011.

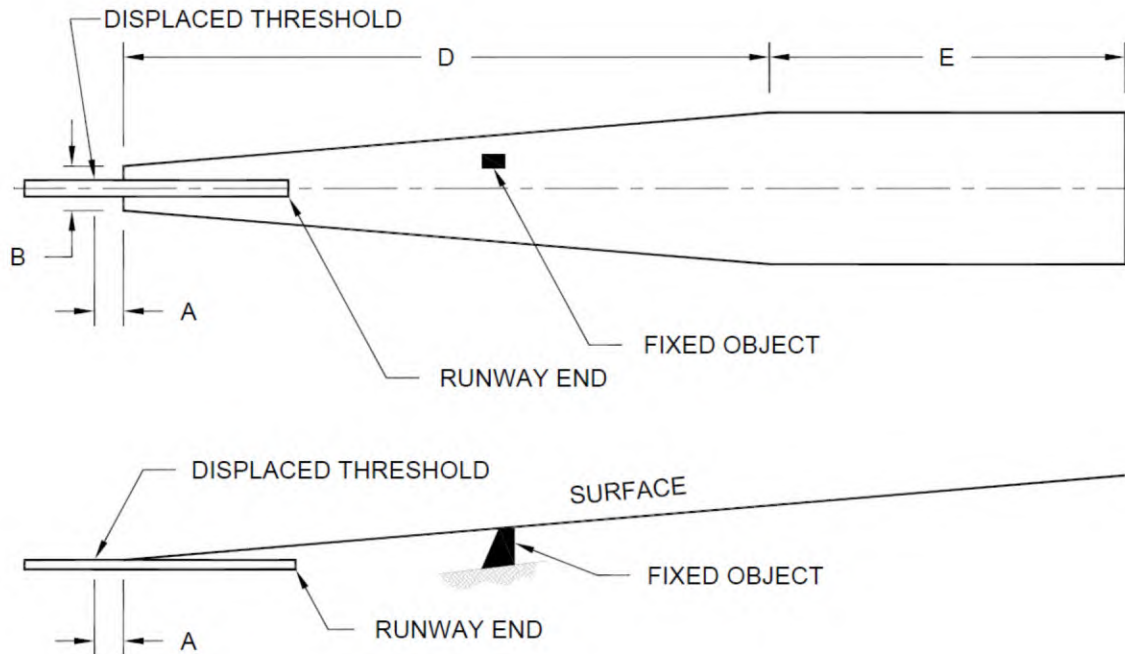Figure 1.17 – Plan and Profile Views of an Example Displaced Threshold

Source: FAA AC 150/5300-13A, *Airport Design*

Safety Areas and Object Free Areas

Runways and taxiways are surrounded by imaginary rectangular areas known as “safety areas” and “object free areas”. The purpose of these areas is to minimize the probability of serious damage to aircraft that accidentally leave designated movement areas as well as to provide greater accessibility for firefighting and rescue equipment during such incidents. These areas require grading between one percent and five percent and must remain free of obstructions to enhance the safety of aircraft that undershoot, overrun, or veer off a runway or taxiway.

The Runway Design Code (RDC) specifies runway design standards applicable to each runway. The RDC consists of three components related to the operational demands of aircraft:

- Aircraft Approach Category (AAC) – approach speed
- Airplane Design Group (ADG) – wingspan and tail height
- Runway Visibility Range (RVR) – visibility minimums

The current ALP, last revised 1/10/2014, was completed prior to the most recent update to FAA AC 150/5300-13A, which established the above definition for RDC. Therefore, the ALP does not identify RDCs for each runway but lists separate ARCs (i.e., the RDC minus the approach visibility minimum). The ARCs for Runway 10L/28R and Runway 5/23 are listed as B-II. The ARC of Runway 10R/28L is identified as B-I. Based on the most current version of FAA AC 150/5300-13A, the ARC combined with the approach visibility minimums, determines the dimensions of the Runway Safety Area (RSA), Runway Object Free Area (ROFA), and Runway Protection Zones (RPZ). The dimensions of the Taxiway Safety Area (TSA) and Taxiway/Taxilane Object Free Areas (TOFA) are determined by the ADG of the critical aircraft, in this case, ADG II.

Table 1.10 lists the standard dimensions of the RSA, ROFA, TSA, and TOFA. Note that although the 2014 ALP listed Runway 10R/28L as an ARC of B-I, the critical aircraft used would qualify as “small” due to its MTOW below 12,500 pounds. The applicable small aircraft standards from FAA AC 150/5300-13A were therefore applied. The facility requirements section will look at each of these areas in greater detail to determine compliance with the most up-to-date FAA standards.

Table 1.10 – Runway and Taxiway Safety Area Dimensions (per Standards)

	Runway 10L/28R	Runway 10R/28L	Runway 5/23
Runway Safety Area			
Length Beyond Runway End	600'	240'	240'
Length Prior to Threshold	600'	240'	240'
Width	300'	120'	120'
Runway Object Free Area			
Length Beyond Runway End	600'	240'	240'
Length Prior to Threshold	600'	240'	240'
Width	800'	250'	250'
Taxiway Safety Area			
Width	79'	79'	79'
Taxiway Object Free Area			
Width	131'	131'	131'
Taxilane Object Free Area			
Width	115'	115'	115'

Source: FAA AC 150/5300-13A, *Airport Design*, C&S Engineers, Inc.

Runway Protection Zones

As defined by FAA AC 150/5300-13A, the function of the Runway Protection Zone is to enhance the protection of people and property on the ground. This is best achieved by airport sponsor acquisition of property located within the RPZ and clearing it of incompatible land uses and obstructions. The RPZ is a trapezoidal shape centered on and extending out from the runway centerline. The type of aircraft that the runway accommodates as well as the approach visibility minimums determines the dimensions of an RPZ. Each runway has a separate approach and departure RPZ whose dimensions are identical unless visibility minimums are lower than one mile (which is the case for Runway 28R). RPZ dimensions for each runway end are outlined in **Table 1.11**.

Recently, hangars located within the Runway 23 departure RPZ were relocated to comply with FAA design standards.

Table 1.11 – MYF Runway Protection Zones (RPZ) (per Standards)

	Runway 10L		Runway 28R		Runway 10R/28L		Runway 5/23	
	Approach	Departure	Approach	Departure	Approach	Departure	Approach	Departure
Length		1,000		2,500		1,000		1,000
Inner Width		500		1,000		250		250
Outer Width		700		1,750		450		450

Source: FAA AC 150/5300-13A, *Airport Design*, C&S Engineers, Inc.

Lighting and Navigational Aids (NAVAIDS)

Visual navigational aids are important for aircraft operating under VFR and IFR. The visual NAVAIDS at the Airport are documented on the following pages.



Wind Cone between Runways 10L/28R and 10R/28L

Wind Cone

A wind cone is a conical textile tube that provides pilots with a visual indication of wind direction and velocity. The Airport has the following wind cones in good condition:

- Between Runways 10L/28R and 10R/28L
- West of Taxiway J

Segmented Circle

A segmented circle is a visual aid designed to provide information about the traffic pattern to aircraft overhead. It is often co-located with a wind cone, as is the case at MYF. It is in good condition

Airport Beacon

A rotating beacon assists pilots in identifying the Airport at night. As a civilian airport, the beacon alternates between white and green flashing lights. The MYF beacon is located in the southwest corner of the administration building parking lot and is in poor condition.

Medium Intensity Approach Lighting System

A Medium Intensity Approach Lighting System with Runway Alignment (MALSR) is installed on the Runway 28R end. This involves a configuration of lights positioned uniformly along the extended runway centerline to provide visual guidance to an aircraft approaching to land on a precision instrument approach procedure. The brightness of the MALSR is controllable by pilots during hours when the ATCT is non-operational. There is a MALSR installed on the Runway 28R end to supplement the ILS approach. The MALSR is in good condition.

Runway End Identifier Lights

Runway End Identifier Lights (REILs) are installed at an airfield to provide rapid and positive identification of the approach end of a particular runway. The system consists of a pair of synchronized flashing lights located laterally on each side of the runway threshold. REILs are installed on the Runway 28L end and are in good condition.



Runway 28R PAPI

Precision Approach Path Indicator

A Precision Approach Path Indicator (PAPI) provides visual approach slope guidance during aircraft landing operations. The PAPI system consists of four light units, located adjacent to the runway and perpendicular to the runway centerline. PAPIs were recently installed on both the Runway 10L and Runway 28R ends. They are both in good condition.

Runway and Taxiway Edge Lighting

All taxiways are equipped with MITL. The Airport has several different runway lighting systems to facilitate operations at night or during periods of low visibility. A summary of runway lighting is presented in **Table 1.12**. Additional information on the condition of airfield lighting will be provided in Section 3 – Facility Requirements.

Table 1.12 – Runway Lighting

	✓ = Available	✗ = Unavailable	
	10L / 28R	10R / 28L	5 / 23
MIRL¹	✓ / ✓	✗ / ✗	✗ / ✗
MALSR	✗ / ✓	✗ / ✗	✗ / ✗
REIL	✗ / ✗	✗ / ✓	✗ / ✗
PAPI	✓ / ✓	✗ / ✗	✗ / ✗

Source: FAA Airport Master Record Form 5010, C&S Engineers, Inc.

Notes: 1. Medium Intensity Runway Lighting (MIRL)

Instrument Approach Procedures and Electronic Aids to Navigation

An instrument approach procedure (IAP) provides an aircraft transition from the en route flight environment to a point from which a safe landing may be accomplished. When cloud ceilings are low and visibility is poor, pilots use IAP's to land. Electronic NAVAIDS are utilized through instrumentation in the aircraft as a part of en route navigation and IAP's. Runway 28R is the only runway that offers an instrument approach and as such is the only runway with dedicated electronic NAVAIDS. **Table 1.13** lists the IAPs available at the Airport and the associated minimums. The electronic NAVAIDS available to pilots operating at the Airport include the following:

Instrument Landing System (ILS) An Instrument Landing System (ILS) is an electronic ground-based system that provides both lateral and vertical guidance to an aircraft approaching and landing on a runway during periods of low ceilings and/or reduced visibility. The Glide Slope (GS), Localizer (LOC), and Distance Measuring Equipment (DME) are all electronic components that make up the ILS. Runway 28R is the only runway equipped with an ILS at the Airport.

Area Navigation (RNAV) / GPS

Area navigation is the precursor to Global Positioning System (GPS) and uses a network of satellites and land stations to create reference points that allow users with the proper receivers to determine their position in the sky. GPS navigation can now provide highly accurate navigational data based on satellites alone. This is hugely beneficial to airports because it allows them to have an IAP without installing expensive ground-based instrumentation. The Airport currently has one published straight-in RNAV (GPS) approach to Runway 28R as well as circling approaches available for the other runways.

Runway 28R Localizer Antenna



Table 1.13 – MYF IAPs and Minimums

Aircraft Approach Category		Altitude (feet MSL)/Visibility		Procedure	
		(statute miles)		Category	
A	B	623-1/2	800-1/2	S-ILS 28R	ILS or LOC RWY 28R
				S-LOC 28R	
				Circling	
				LPV	
A	B	623-1/2	880-1	LNAV/VNAV	RNAV (GPS) RWY 28R
				LNAV	
				Circling	
				880-1	

Source: Approach plates valid 02 MAR 2017 to 30 MAR 2017, C&S Engineers, Inc.

Additional Equipment

The following equipment also serves the Airport:

Automated Surface Observing System: The ASOS is a weather-sensing suite designed to serve aviation and meteorological observing needs for safe and efficient aviation operations, weather forecasting, and climatology. The Airport's ASOS is located in the area between Runway 10L/28R and Runway 10R/28L.

Airfield Electrical Vault: The Airfield Electrical Vault is located on the apron, north of the administration building and directly west of the Aviation Unlimited building. It is in good condition.

ASOS



Aircraft Hangars and Parking Areas

As documented in **Appendix A**, the Airport has several leaseholders that offer both hangars and tie-down storage for based and transient aircraft use. **Table 1.14** lists the different parking areas and the number of spaces available at each.

Table 1.14 – Aircraft Hangars and Parking Areas

Lease Title / Area	Based / Transient	Tie-downs	T-Hangars	Box Hangars	Large Box Hangars (more than 1 aircraft)	Total
Coast Air	Based	4	36	1	1	42
Crownair	Both	N/A	–	16	26	42
Flattop East	Based	1	43	5	–	49
Flattop West	Based	8	21	3	1	33
Gibbs Aviation Services	Both	171	92	7	2	272
Marigold Spots	Based	1	25	1	–	27
National Air College	Based	45	24	20	1	90
Spiders – Sorbi	Both	N/A	–	–	2	2
City Tie-downs	Both	30	–	–	–	30
Total		260	241	53	33	587

Source: C&S Engineers, Inc. Parking positions determined on Google Earth imagery dated 11/08/2016

Information specific to each lease area, including current challenges, can be found in **Appendix A**.



Aircraft Parking Apron in front of the Administration Building

Airfield Signage and Markings

Airfield signage and markings are used for navigational and safety purposes. The following examples are found at the Airport.

Directional Signage

The Airport is equipped with location signs on all taxiways and at all runway ends and runway crossings. All of the signs are lit with the exception of those on Runway 5/23 and Taxiway C, north of Runway 10L/28R.

Informational Signage

Informational signage is in place to notify pilots and other users of important information such as tower or ground control frequencies, procedures, and hazards.

Airfield Markings

Airfield pavement markings provide information that is useful during aircraft takeoff, landing, holding, and taxiing. Examples of airfield markings include runway hold positions, non-movement area boundaries, and taxiway edge markings.



Taxiway Signage


Airspace and Air Traffic Control

The ATCT is located in the northeast corner of the airfield and provides Air Traffic Control (ATC) services to the airport users. It is operational between the hours of 6:00 a.m. and 9:00 p.m. daily.

Aircraft navigate under VFR or IFR. VFR govern procedures when weather is greater than FAA specified minimums. To fly under VFR at MYF the visibility must be greater than three statute miles (SM) and the aircraft must remain 500 feet below, 1,000 feet above, or 2,000 feet horizontally clear of clouds. Flights operated under VFR navigate using a mixture of visual cues and instrumentation. They are not required to contact ATC unless entering controlled airspace. The term IFR refers to the set of rules governing conduct of flight under instrument meteorological conditions (IMC) where pilots rely solely on their instrumentation to navigate and are required to be in contact with ATC.

Whether a pilot flies under VFR or IFR depends on the weather conditions and the class(es) of airspace that will be flown through. The National Airspace System (NAS) is run and maintained by the FAA and categorizes airspace into the following classes (A, B, C, D, E, and G). Each class has specific requirements, restrictions, and dimensions. See **Figure 1.18** for a simplified example of the different types of airspace.



Figure 1.18 – Airspace Classification

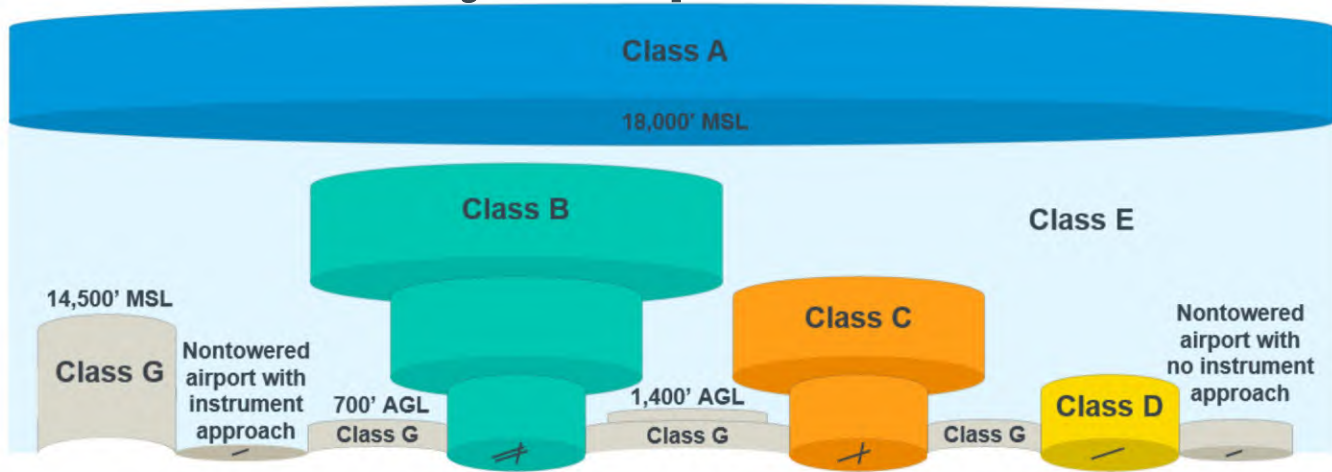

Source: FAAafety.gov, C&S Engineers, Inc.

When the ATCT is in operation, the airspace surrounding MYF is designated as Class D. It begins at the surface, extends to 2,900 feet MSL, and surrounds the Airport with a five SM radius. The MYF Class D airspace is superseded by the Miramar MCAS Class B airspace approximately two miles to the north and the SAN Class B airspace, approximately three miles to the south. Class E airspace exists from 2,901 feet MSL to 4,799 feet MSL. Class B airspace begins at 4,800 feet MSL and continues to 10,000 feet MSL. Class E fills in the space between the end of Class B and the beginning of Class A at 18,000 feet MSL.

Class B airspace surrounds the nation's busiest airports. It begins at the surface and generally extends to 10,000 feet MSL. It consists of different layers of varying size and is often described as resembling an upside down wedding cake. Entrance into Class B airspace requires prior clearance from ATC. The close proximity of two Class B airports, Miramar MCAS and SAN, creates a complex combination of airspace surrounding MYF. **Figure 1.16** depicts the airspace environment surrounding the Airport.

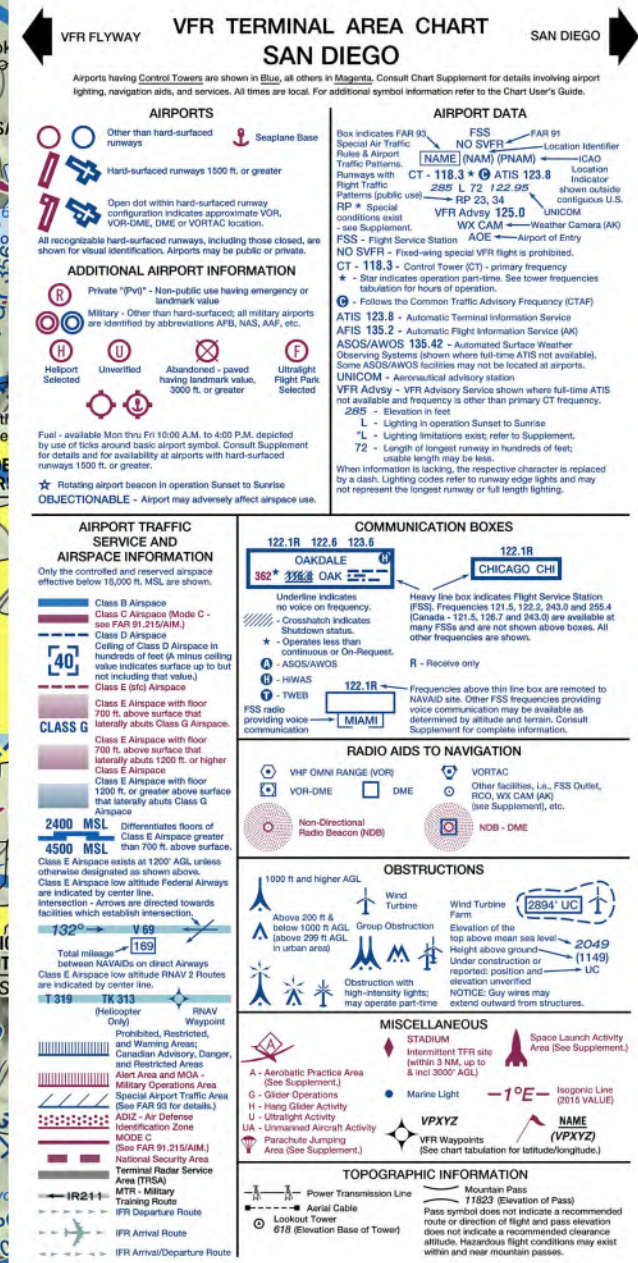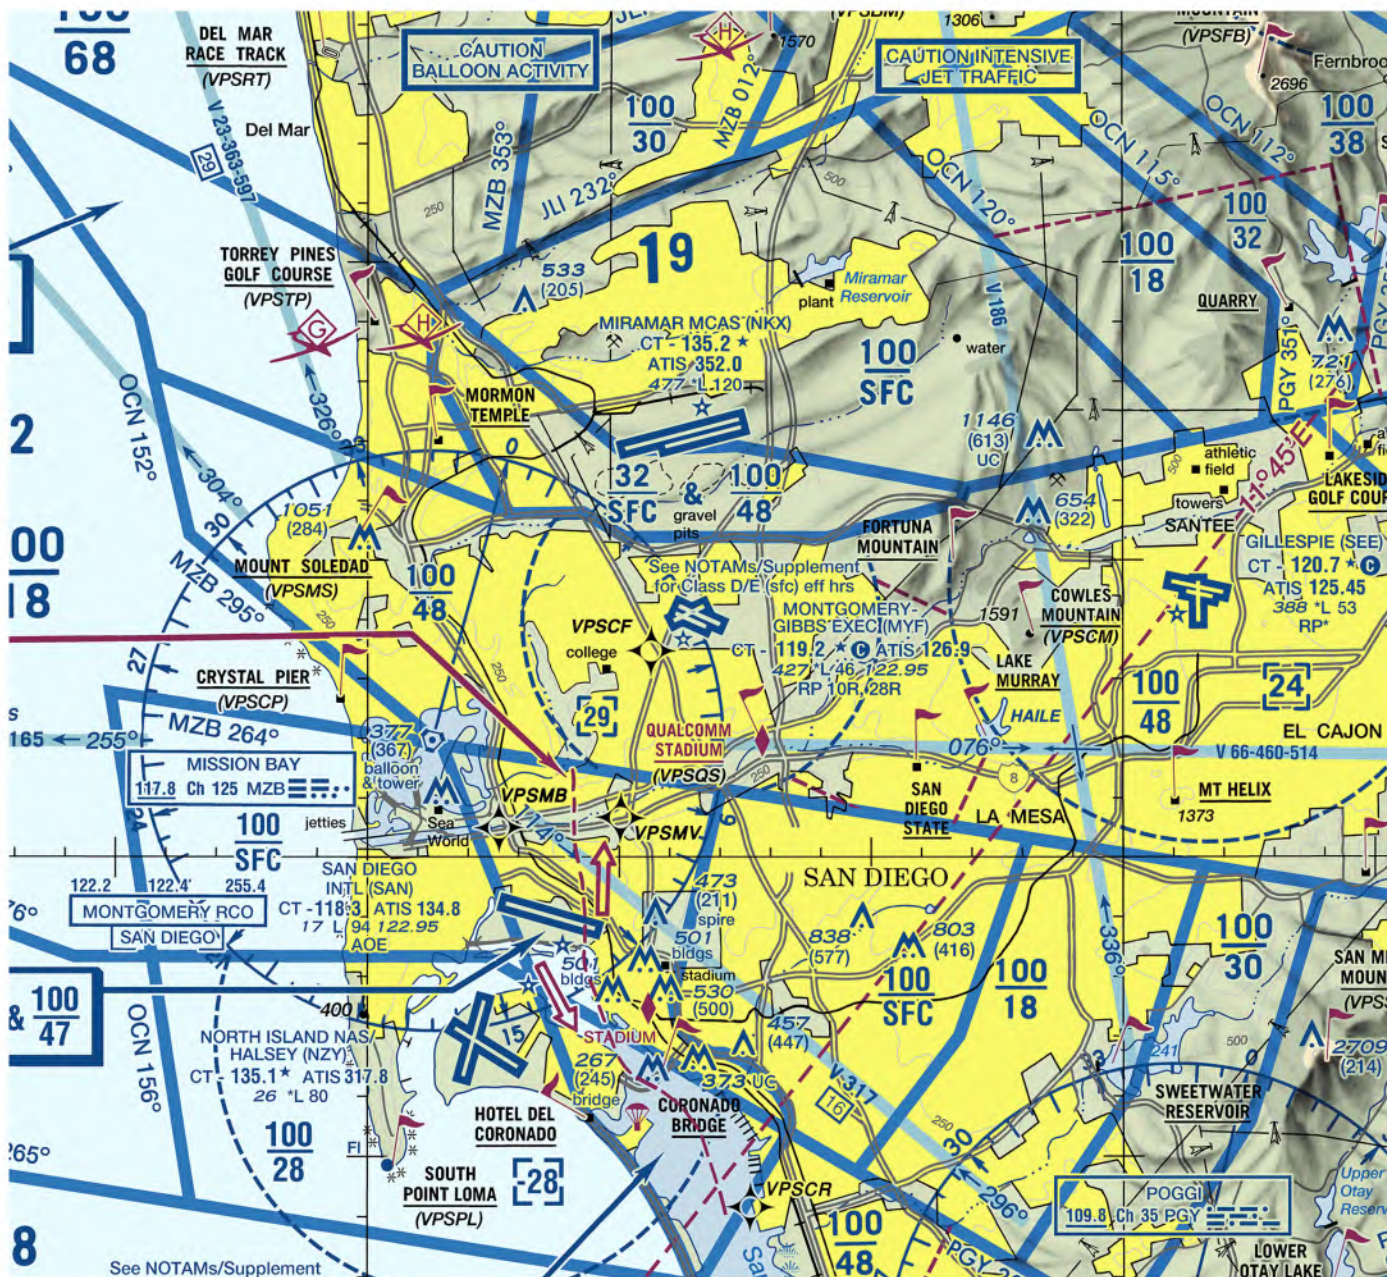

Noise Abatement Procedures

Due to the high volume of residences in both the Clairemont Mesa and Kearny Mesa communities and the larger San Diego area, minimizing the impact of aircraft generated noise is an essential goal of the City. It is impossible to eliminate the effects of noise on the surrounding residential areas, but the City has taken steps to address and mitigate it. In 1985, a noise monitoring system was installed to document the noise produced by aircraft operations at MYF and determine ways of reducing it. MYF has voluntarily enacted noise abatement procedures that are designed to reduce the amount of noise pollution in the surrounding community. These following procedures are recommended:

1. Avoiding departures between the hours of 11:30 p.m. and 6:30 a.m.
2. Higher performance and louder aircraft are requested to use runway 28R/10L.
3. VFR departures are to maintain runway centerline, climb using best rate of climb, reduce power before overflying residential areas, and reach 1,200 feet MSL (2,000 feet for twins) before turning crosswind.
4. IFR departures are to climb to at least 400 feet AGL on runway centerline before turning to their assigned heading and are requested to reduce power before overflying residential areas.
5. VFR arrivals are to maintain pattern the following pattern altitudes until turning base
 - o South of the Airport: 1,427 feet MSL for singles and 2,000 feet MSL for twins
 - o North of the Airport: 1,427 feet MSL for singles and 1,600 feet MSL for twins

In addition to the general requirements listed above, the City has published recommended VFR arrival and departure procedures.



Noise Abatement Procedures Signage

1.7 Support Facilities

Fixed Base Operators (FBO)

The Airport is home to two FBOs. Their location and services offered are summarized below. Additional information is provided in **Appendix A**.

Gibbs Flying Service

The oldest aviation business located at the Airport, Gibbs Flying Service, was started in 1937 when Bill Gibbs relocated his pilot training business to the future site of Montgomery-Gibbs Executive Airport. Located east of John J. Montgomery Drive, it offers aircraft tie-downs, hangars, fueling, and aircraft maintenance services.

Crownair Aviation

Located west of the administration building is one of the largest leaseholds at the Airport, Crownair Aviation. They are a full-service FBO that caters to larger corporate business jets and turboprops as well as to smaller GA customers. Through a partnership with Epic Aviation, they are able to offer aircraft fueling, hangar rental, ground service equipment, aircraft maintenance, and aircraft/avionics sales.



Gibbs Aviation Service Fuel Truck

Aircraft Fueling


There are no City-owned or operated aircraft refueling stations at the Airport. Instead, these services are provided by the FBO's. Both Gibbs Aviation Service and Crownair Aviation offer full-service 100-low-lead (100LL) Aviation Gasoline and Jet-A fuel in underground tanks, as well as mobile fuel by trucks. Gibbs has two 12,000-gallon underground fuel tanks and two 2,000 gallon above ground tanks. The above ground tanks are specifically used for motor fuel gasoline. One of the underground tanks

provides Jet A fuel and the other contains Avgas. All four of these tanks are located on the Gibbs fuel farm. Additionally, Crownair Aviation has a 24/7 self-service 100LL fuel island located south of the intersection of Taxiways Golf and Hotel. National Air College also sells a small amount of 100LL fuel. Gibbs Aviation Services operates a total of six trucks split evenly between Jet A and AvGas fuels. Two 2,200-gallon trucks and one 1,200-gallon truck provide Jet A fuel for the airport. 100LL Avgas is provided by a 750 gallon truck, a 1,000 gallon truck, and a 1,200 gallon truck.

Crownair Aviation sells the largest amount of Jet-A fuel while Gibbs Flying Service sells the most 100LL. There are two 20,000-gallon underground fuel tanks split between Jet A and Avgas 100LL fuel located on the Crownair fuel island. Crownair has one 850-gallon fuel truck for 100LL Avgas and a 2,400- and 3,000-gallon truck for Jet A fuel.

Fuel flowage records were reviewed back to 2011 for each of the providers at the Airport and the total amount of each type of fuel sold each fiscal year (July 1 – June 30) is presented on **Figure 1.20**.

Figure 1.20 – Historic Fuel Sales by Type (Gallons)

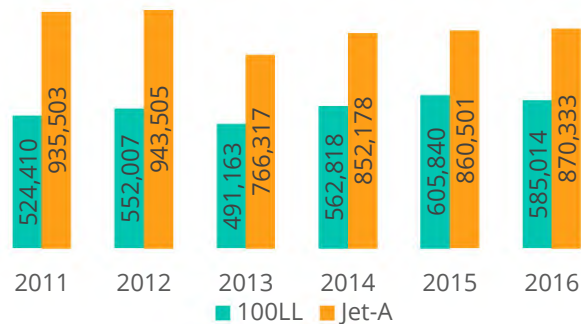

Source: City records, C&S Engineers, Inc.

Aircraft Maintenance

The Airport has several locations that offer aircraft maintenance services including Advanced Aircraft Service, Crownair Aviation, Corporate Helicopters, Gibbs Flying Service, and Spiders Aircraft Service. A more detailed description of the services offered at each location can be found in **Appendix A**.

Air Charter Services

The Airport does not maintain a FAA Part 139 Certification, which would allow for scheduled commercial service flights. However, MYF does handle a notable amount of air charter operations. In the 2016 calendar year, the FAA recorded 3,655 air charter flights. Air charter refers to an aircraft that is rented as whole rather than selling seats individually. The size of aircraft used are typically much smaller than that used by a commercial airline and range anywhere from four to 20+ seats. Crownair Aviation handles most of the air charter flights and Gibbs Flying Service is equipped to handle some of the smaller air charter aircraft.

Flight Instruction and Flying Clubs



A Cessna 172 Touches Down on Runway 28L During a Training Flight

Flight Instruction

Flight instruction accounts for a large portion of the operations at MYF. In 2016, local operations (those remaining in the traffic pattern or within 20 miles of the Airport) accounted for 98,680 out of 200,668 operations, or roughly 49 percent. Flight schools at the Airport include ATP Flight School,

Coast Flight, Corporate Helicopters, Learn to Fly San Diego, National Air College, and San Diego Flight Training International. The majority of the training fleet is made up of single-engine piston aircraft such as the Cessna 172, Piper Archer/Warrior/Arrow. There are also several small multi-engine piston aircraft such as the Piper Seminole/Seneca and Beechcraft Duchess.

Flying Clubs

Flying clubs offer an affordable alternative to aircraft ownership that allows more pilots to stay in the air. They generally charge a monthly membership fee and an hourly rate and give members access to a fleet of aircraft to choose. Flying clubs at the Airport include the Armed Forces Aero Club, Plus One Flyers, Golden Wings, and Consair Flyers Club.

Emergency Services

Police

The San Diego Police Air Support Unit bases several helicopters out of a hangar on the western boundary of the airfield. They are used for search and rescue, aerial security, and air support to patrol operations.

Fire Fighting

The Airport does not have a dedicated Aircraft Rescue and Firefighting (ARFF) station. The closest station to the Airport is Station 28 located at Kearny Villa Road and Aero Drive, directly across the street from the western boundary of the Airport.

The Airport is home to San Diego Fire-Rescue Air Operations that operate off a concrete pad just south of the ATCT. They are planning to expand their facility in the near future. Their helicopters respond to over 400 emergencies each year including firefighting, air-rescue, shoreline rescue, and disaster assessment.



Mercy Air Helicopter

Medical

Mercy Air is a full-service air medical transport system. They have a helicopter based at the Airport that provides air ambulance services to local hospitals.

Additional Facilities

Aircraft Sales and Pilot Supplies

There are several businesses at the Airport to assist pilots in buying new aircraft or outfitting their old aircraft with new electronics and avionics. These include Advanced Aircraft Service, Aviation Unlimited, and Marv Golden.

1.8 Landside Facilities

The landside portion of an airport are those areas that do not play a direct role in the aircraft operations. This includes areas such as the terminal, offices, parking lots, entrance roads, and restaurants.

Airport Administration Building

The Airport Administration Building is a two-story building constructed in 1969. It is located at the end of John J. Montgomery Drive and directly adjacent to the transient aircraft apron. It serves several roles including housing the City of San Diego Airports Division Staff and the MYF operations center, and it is also home to the restaurant Casa Machado and other businesses.



Airport Administration Building

Fleet Vehicles and Equipment

The fleet vehicles owned and operated by the City are listed in **Table 1.15**. These vehicles are stored on the apron directly adjacent to the Airport Administration Building.

Table 1.15 – City-Owned Vehicles and Equipment

Year	Make	Model	Condition
2008	Ford	Taurus	Fair
2009	Ford	F-350	Good
2012	Ford	F-250	Good
2007	Chevrolet	1500	Fair

Source: City records, C&S Engineers, Inc.

Hotel

The Four Points by Sheraton hotel is located on the southwest corner of the airport property, at the intersection of Aero Drive and Kearny Villa Road. It resides on land leased from the City, and the operator recently declared bankruptcy in May of 2015.

Restaurant

The second floor of the administration building is entirely occupied by Casa Machado Restaurant, which serves Mexican food. It offers an opportunity for pilots to dine without leaving the Airport and it allows anyone from the surrounding community to observe the Airport in operation.

Access, Circulation and Parking

Vehicle Access

The Airport is accessed via Interstates 5 and 15 from the north and south and by Interstate 8 from the east and west. The Airport is bound by Balboa Avenue to the north, Ruffin Rd. to the east, Aero Drive to the south, and Kearny Villa Rd. to the west. Entrances to the Airport are located on Aero Drive with the intersections of John J. Montgomery Drive and Glenn H. Curtiss Drive

Multi-modal Access

There are sidewalks along Aero Drive from the intersection with Kearny Villa Road to the west and Interstate 15 to the east. The sidewalk on the Airport side of Aero Drive is incomplete, but one is available on the other side of the street. There is a sidewalk on John J. Montgomery Drive leading to the administration building and an unimproved sidewalk (a graded dirt path) along Glenn H. Curtiss Road leading to the National Air College parking lot. There are crosswalks over Aero Drive at both John J. Montgomery Drive and Glenn H. Curtiss Road.

The Airport is served by Bus Route 25 (Fashion Valley – Kearny Mesa TC) and has stops at the intersection of Aero Drive with both John J. Montgomery Drive and Glenn H. Curtiss Drive. Stops are made approximately every 30 minutes.

Parking

The Airport has several public parking areas available. Parking is free during the day with available overnight parking for a fee. The two main lots are located on both the east and west sides of the Administration Building. Additionally, there is free street parking along Glenn H. Curtiss Road, Gibbs Drive, and John J. Montgomery Drive. The different parking areas and number of spaces available are summarized in **Table 1.16**.

Table 1.16 – Public Parking at MYF

Location	Spaces
Lot East of Administration Building	145
Lot West of Administration Building	73
Street Parking Along Glenn H. Curtiss Road	56
Street Parking Along Gibbs Drive	80
Street Parking Along John J. Montgomery Drive	59
Total Public Parking Spaces Available	413

Source: C&S Engineers, Inc. Parking spaces determined on Google Earth imagery dated 11/08/2016

Utilities

San Diego Gas and Electric provides gas and electric services (SDG&E). The Airport is supplied potable water by the Shepherd Canyon Pipeline.

1.9 Stakeholder Feedback

As part of the airport inventory process, steps were taken in order to solicit feedback from the surrounding airport community, users, and tenants. A public advisory committee (PAC) has been assembled that includes several airport tenants as well as representatives from the surrounding community. The PAC will hold seven meetings at regular intervals throughout the master planning process, the first of which took place on April 18, 2017. The PAC will act as a sounding board in the development of the Airport Master Plan and a conduit for information between various interest groups throughout the community. This interaction between the PAC and City is essential for the review and assessment of project information. The PAC meetings are also open to the public and have a period dedicated to hearing and acknowledging public comments. Separate Public Workshops will also be held throughout the master plan process.

1.10 Key Considerations

This section identifies some of the key considerations that the master planning process will review and attempt to resolve. The items summarized below were identified through an inventory of existing conditions as well as coordination with airport management and the PAC.

Airside

- Limited runway length
- Evaluation of the need for the displaced thresholds
- Inadequate aircraft run-up areas
- FAA designated “hot spots”¹¹
- RSA and RPZ compliance
- Non-standard taxilane safety areas between hangars
- Unknown pavement weight capacity
- Pavement condition
- Lack of runway edge lighting on both visual runways
- Lack of available hangar and tie-down space
- Clay soil that is not ideal for development
- Land and hold short markings on Runway 5/23
- Review and adjustment of aeronautical fees

Airspace

- Aircraft generated noise and overflight impacts to the surrounding community
- Potential changes to IAPs

Landside

- Undevelopable land due to safety areas or environmental constraints
- Market rate evaluation of leases
- Potential impacts of Airport development on the surrounding community

Environmental

- City’s Multi-Habitat Planning Area (MHPA) restrictions on development
- Vernal Pools
- Regulatory agency coordination

¹¹ A “Hot Spot” is a location with a history of potential risk of collisions or runway incursions where heightened attention by pilots and drivers is necessary on an airport movement area.

Other Concerns and Considerations

The first Public Advisory Committee meeting was held on April 18, 2017. Members of the committee identified the following topics.

- Maintaining a balance between the airport user interests and the surrounding communities
- Review of safety procedures
- Continued support of GA facilities and users
- Minimum commercial standards and the cost of operating a business at the Airport
- The potential impact of new aircraft types and drones
- Community consensus on updated noise contours and noise-related impacts