

FINAL DRAFT

Human Health and Public Safety Report

Prepared for

SEAWORLD PARKS
& ENTERTAINMENT



San Diego, California
December 12, 2019

This is a draft and is not intended to be a final representation
of the work done or recommendations made by Brown and Caldwell.
It should not be relied upon; consult the final report.



450 B Street, Suite 1500
San Diego, CA 92101

Table of Contents

List of Figures	iii
List of Tables	iii
List of Abbreviations	iv
1. Introduction and Background	1-1
2. Summary of Previous 2001 EIR Analysis and Findings	2-1
2.1 Hazardous Materials	2-1
2.2 Closed Mission Bay Landfill	2-6
2.3 Mission Bay Sediments	2-9
3. Analysis of the 2020 Master Plan Potential Impacts to Human Health and Public Safety	3-1
3.1 Area 1: SeaWorld Aquatic Theme Park	3-1
3.2 Area 2: Guest Parking	3-2
3.3 Area 3: Administration and Support	3-3
3.4 Area 4: SeaWorld Marina	3-3
3.5 Area 5: Perez Cove Shoreline	3-3
3.6 Significance Thresholds and Impact Assessment	3-4
3.6.1 Health and Safety Issue 1	3-4
3.6.2 Health and Safety Issue 2	3-4
3.6.3 Health and Safety Issue 3	3-5
3.6.4 Health and Safety Issue 4	3-6
3.6.5 Health and Safety Issue 5	3-9
3.6.6 Health and Safety Issue 6	3-10
3.6.7 Health and Safety Issue 7	3-11
4. Significance Conclusions	4-12
4.1 Significance Thresholds	4-12
4.1.1 Significance Threshold 1	4-12
4.1.2 Significance Threshold 2	4-13
4.1.3 Significance Threshold 3	4-13
4.2 Significance Conclusions and Mitigation	4-14
5. Limitations	5-1
6. References	6-1
Appendix A: Hazardous Material Business Plan and Emergency Contingency Plan	A-1
Appendix B: City of San Diego Information Bulletin 116	B-1
Appendix C: Environmental Data Resources Report	C-1

List of Figures

Figure 1-1. SeaWorld Master Plan areas.....	1-2
Figure 2-1. Mission Bay Landfill sampling locations	2-8
Figure 2-2. SeaWorld water and sediment monitoring locations.....	2-11
Figure 3-1. Location of site potential environmental concern within 1 mile of the SeaWorld leasehold.....	3-7

List of Tables

Table 2-1. Hazardous Materials.....	2-2
Table 2-2. Sediment Toxicity in FDZ samples compared to reference locations.....	2-12
Table 3-1. Environmental Records of Concern	3-6
Table 4-1. Health and Safety Significance Conclusions.....	4-14

List of Abbreviations

AIA	airport influence area
ALUC	Airport Land Use Commission
ALUCP	Airport Land Use Compatibility Plans
BMP	best management practice
CalRecycle	California Department of Resources Recycling and Recovery
CCC	California Coastal Commission
CCR	California Code of Regulations
CEQA	California Environmental Quality Act
CHMIRS	California Hazardous Material Incident Report System
City	City of San Diego
CPS-SLIC	Cleanup Program Sites-spills, Leaks, Investigations and Cleanups
DEH	Department of Environmental Health
DTSC	California Department of Toxic Substances Control
EDR	Environmental Data Resources, LLC
EIR	Environmental Impact Report: SeaWorld Master Plan Update
ENVIROSTOR	the Department of Toxic Substances Control's data management system
FAA	Federal Aviation Administration
FDZ	Firework Deposition Zone
General Permit	California Regional Water Quality Control Board, San Diego Region, Order No. R9-2011-0022, General National Pollutant Discharge Elimination System Permit for Residual Firework Pollutant Waste Discharges to Waters of the United States in the San Diego Region from the Public Display of Fireworks
LUST	Leaking Underground Storage Tanks
NPDES	National Pollutant Discharge Elimination System
OA EOP	San Diego County Operational Area Emergency Operations Plan
OES	San Diego County Office of Emergency Services
RWQCB	Regional Water Quality Control Board
SAM	San Diego County Site Assessment and Mitigation
SeaWorld	SeaWorld Parks and Entertainment aquatic amusement park
SEMS-ARCHIVE	Superfund Enterprise Management System Database Archive
SWPPP	Stormwater Pollution Prevention Plan
VAP	Voluntary Assistance Program
VOC	volatile organic compound
Y	Yes

Section 1

Introduction and Background

SeaWorld Parks and Entertainment aquatic amusement park (SeaWorld) is updating its Master Plan to provide a comprehensive update to the 2002 SeaWorld Master Plan, which has largely been implemented. As with the 2002 SeaWorld Master Plan, the 2020 Master Plan sets forth the long-range conceptual development program, development parameters, and project review procedures for the future renovation and development of the entire leasehold area. The 2020 Master Plan would be part of the City of San Diego's (City) Local Coastal Program for Mission Bay Park (SeaWorld San Diego et al. 2019).

The purpose of this document is to provide information regarding the applicable health and safety regulations for, and existing conditions related to, Mission Bay and SeaWorld, and the potential health and safety impacts from implementing SeaWorld's 2020 Master Plan.

The 2020 SeaWorld Master Plan would retain the five designated planning areas—theme park, guest parking, administration and support, SeaWorld Marina, and Perez Cove Shoreline (Figure 1-1); however, the 2020 Master Plan would transition from a “site-specific” development paradigm as outlined in the 2002 Master Plan to an “area-specific” development paradigm that more closely matches SeaWorld's future renovation needs. The 2020 Master Plan would define each planning area with a description of the existing uses, allowed uses, general development criteria, and project-specific development criteria for all future development within the SeaWorld leasehold. The 2020 Master Plan would not result in the expansion of the leasehold.

SeaWorld is located in Mission Bay Park within the City. SeaWorld is approximately 8 miles northwest of the downtown/civic center area. The boundaries of Mission Bay Park are Interstate 5 on the east, the Pacific Ocean on the west, Interstate 8 and the San Diego River Floodway on the south, and Grand Avenue on the north. The SeaWorld leasehold comprises approximately 172 acres of land and 17 acres of water along the south shore of Mission Bay Park, which is owned by the City.



Legend

-  2002 - Master Plan
-  2020 - Master Plan
-  Previously Approved Projects

Brown AND Caldwell

Date: Dec 3, 2019
Project No: 154018
Client: SeaWorld Master Plan
Figure ID: SWMP3191203

Basemap: ESRI, USGS, SeaWorld (2019), Linscott Law & Greenspan Engineers (2000)




Figure 1-1
SeaWorld Master Plan Areas
SeaWorld Master Plan

Section 2

Summary of Previous 2001 EIR Analysis and Findings

This document evaluates the potential for additional human health and public safety impacts resulting from implementation of the 2020 Master Plan beyond what was analyzed in SeaWorld's 2001 *Environmental Impact Report: SeaWorld Master Plan Update* (EIR) prepared for the 2002 Master Plan (baseline).

The 2001 EIR analyzed three potential sources of significant impacts to human health and public safety—hazardous materials, the inactive Mission Bay Landfill, and sediments in Mission Bay. Based on the analysis summarized below, no significant impacts were identified, and no mitigation measures were recommended in the 2001 EIR. The Master Plan areas analyzed in the 2001 EIR are shown on Figure 1-1.

2.1 Hazardous Materials

The 2001 EIR analyzed SeaWorld operations with respect to the use and storage of a variety of chemicals. These materials, their use, and the maximum quantity on site at any single given time, as well as the total yearly amount, were quantified. The analysis took note of the procedures described in the *SeaWorld Hazardous Materials Business Plan and Emergency Contingency Plan* (SeaWorld 2019), which establishes the protocols for safe storage, labeling, access controls, inventory, and emergency procedures in the event of hazardous materials spills, fire or other emergency situation.

In the 2001 EIR, two project areas were identified as having the potential to store and use materials:

1. **The proposed educational facility**, which was to be located near Area 3. Area 3 contains many of the support facilities needed to operate SeaWorld, including cogeneration, water treatment, and storage facilities. Area 3 also includes several existing hazardous chemical storage areas. Due to the proximity of the proposed educational facility to Area 3, the 2001 EIR analyzed the potential impacts of hazardous material storage and use on educational facility users. The conclusion in the EIR was that the storage and use of hazardous materials in Area 3 did not represent a significant impact to future occupants of the educational facility because hazardous materials safe storage and use protocols were observed.
2. **The future hotel site**, where hotel operation was anticipated to involve the use, storage, and disposal of hazardous chemicals. The 2001 EIR concluded that conforming with regulations for these activities would keep any impacts below the level of any significance.

Since the 2001 EIR, SeaWorld has updated the inventory of hazardous materials stored or used on site. Table 2-1 lists these materials, quantifies the maximum quantity on site any single given time as well as the total annual amount, and whether the material is explosive. Additionally, SeaWorld has updated the procedures described in its *Hazardous Materials Business Plan and Emergency Contingency Plan* (included as Appendix A).

Table 2-1. Hazardous Materials

Hazardous Material	Maximum Amount at One Time	Total Annual Amount	Explosive
Waste Absorbent Pad W/Formalin	80 pounds	227 pounds	No
Waste Oily Absorbent	587 pounds	2000 pounds	No
Waste 311 Pharmaceutical Waste	15 gallons	15 gallons	No
Lazquer Thinner and Rags Ethyl Acetate Methyl Ethyl Ketone 5% 2-Butoxy Ethanol 1% Toluene 5% Acetone 5%	15 gallons	15 gallons	No
Waste Motor Oil Various Lubricating Base Oils 85% Additive Package, Including 15% Zinc Alkydithiophosphate 2%	170 gallons	3464 gallons	No
Waste Fuel and Oil Filters	20 pounds	400 pounds	No
WASTE- Excell Plus	15 gallons	400 gallons	No
Culinary Dewars 60% Nitrogen/ 40% CO2 Liquid Nitrogen 60% Carbon Dioxide 40%	4,000 cubic feet	4,000 cubic feet	Yes
Waste- Ethylene Glycol Ethylene glycol 95% Diethylene glycol 4% Dipotassium phosphate 1%	55 gallons	220 gallons	No
Chlorodifluoromethane (R-22)	1,500 cubic feet	1,000 cubic feet	Yes
WASTE- Activated Carbon	350 pounds	2,000 pounds	No
X-Cote 43-0-0 Urea Sulfur Polymer Coating Wax (paraffins- petroleum)	2,000 pounds	Not Reported	No
Nitrogen	3,635 cubic feet	3,635 cubic feet	No
Caustic Soda 25%	275 gallons	275 gallons	No
Neptune's Harvest	45 pounds	Not Reported	No
Silica Sand	50,000 tons	50,000 tons	No
Acetylene, C ₂ H ₂ , 99% Compressed Gas	1,050 gallons	600 gallons	Yes
Propane, Liquified Petroleum Compressed Gas	3,500 gallons	3,500 gallons	Yes
Muriatic/Hydrochloric Acid 31%	1,150 gallons	1,150 gallons	No
Qwik Dress/Tire Detailer	1 gallon	55 gallons	No
Sulfuric Acid 36%	6,400 pounds	1,000 pounds	No

Table 2-1. Hazardous Materials

Hazardous Material	Maximum Amount at One Time	Total Annual Amount	Explosive
Spray Nine, 2-butoxyethanol 3% Ethoxylated C9-C11 Alcohols 3%	55 gallons	Not Reported	No
Sodium Hypochlorite, NAOCL 13%: Liquid Pool Chlorine	12,000 gallons	Not Reported	No
Unleaded Gasoline	11,000 gallons	Not Reported	No
Waste Methanol Water Solution	450 pounds	1,100 pounds	No
Wax Eliminator	55 gallons	Not Reported	No
Calcium Hypochlorite AcuteAB, Calcium Hypochlorite 66%, Calcium Chlorate 2% Calcium Hydroxide 2%, Magnesium 0%	1,000 pounds	Not Reported	No
Acid, Trident 6026	600 gallons	Not Reported	No
Sodium Thiosulfate	2,500 pounds	Not Reported	Yes
Waste-Paint Liquids	280 gallons	1,000 gallons	No
Diesel Fuel	2,000 gallons	Not Reported	No
Ethanol, Foodservice Joy	500 gallons	Not Reported	No
Sterno Canned Cooking Fuel Ethanol 67% t-Butanol 1%	2,000 gallons	Not Reported	No
Kendall Motor Oils Various Weights, Lubricant Base (Petroleum) 70% Additives 30%	350 gallons	Not Reported	No
Waste Sharps	10 pounds	100 pounds	No
Fullsan	220 gallons	Not Reported	No
Assorted Urethanes Acetone 89% 2,4-Pentanedione	170 gallons	Not Reported	No
Red-E-Crete, Portland Cement, Sand Silica Quartz 50% Portland Cement 30% Lime 10% Pulverized Limestone 10%	1,300 pounds	Not Reported	No
Latex Paint Ethylene Glycol 2% Quartz 10% Cristobalite 1% Titanium Dioxide 14% Zinc Oxide 2%	700 gallons	Not Reported	No
Ozzyjuice SW-3 Trunk Degreasing Solin Proprietary microbial organisms	100 gallons	Not Reported	No

Table 2-1. Hazardous Materials

Hazardous Material	Maximum Amount at One Time	Total Annual Amount	Explosive
Mission Oven Cleaner 2-Butoxy Ethanol Sodium Hydroxide	260 gallons	Not Reported	No
Show-N-Go Car Soap	55 gallons	Not Reported	No
Paint-Assorted Enamels and Acrylics, 2-Methoxymethylethoxypropanol 4% Calcium Carbonate 17%	100 gallons	Not Reported	No
Dexron II Automatic Transmission Fluid Petroleum Solvent Refined Light 87% Paraffinic Distillate Petroleum Solvent Refined Heavy 87% Paraffinic Distillate Anti-Oxidant Anti-Wear Dispersant 10% Viscosity Improver 4% Dye 1%	95 gallons	Not Reported	No
Waste, Gas, Diesel, LPG	100 gallons	Not Reported	No
Bubble Master 2000 Premium Fluid Anionic/Non-ionic surfactant blend	400 gallons	Not Reported	No
Clean My Peroxy Alcohol ethoxylate 5% Hydrogen Peroxide 5% Quaternary Amine 5% Fragrance 1%	75 gallons	Not Reported	No
Waste Red Bag	10 pounds	Not Reported	No
Carbon Dioxide, CO2, 99% Compressed Gas	6,250 cubic feet	Not Reported	Yes
Hydraulic oil	3,845 gallons	Not Reported	No
Waste Rags contaminated w/ pounds solvent	450 pounds	Not Reported	No
Ethylene Glycol Ethylene Glycol Methyl Ether	80 gallons	Not Reported	No
Waste Paint Chips & Paint Booth FLTRS (352) (212)	297 pounds	1,720 pounds	No
Argon Gas	1,400 cubic feet	Not Reported	No
Propylene Glycol	100 gallons	Not Reported	No
Sodium Bicarbonate, Soda Ash	4,000 pounds	Not Reported	No
Disinfectant Bleach, Clorox, Generic	560 gallons	Not Reported	No
Lead	1,500 pounds	Not Reported	No
Diesel Fuel	2,000 gallons	Not Reported	No
Activated Carbon 100%	14,000 pounds	Not Reported	No
Underground Tank 100905 T001	10,000 gallons	Not Reported	No
Iron, 95% Galvanized Steel	500 pounds	Not Reported	No

Table 2-1. Hazardous Materials

Hazardous Material	Maximum Amount at One Time	Total Annual Amount	Explosive
Sodium Chloride, NaCl 98% Table Salt	11,000 pounds	Not Reported	No
Waste Aerosols	300 pounds	Not Reported	No
Charcoal	2,500 pounds	Not Reported	No
22-5-6 W/ Ammonium Sulfate Urea Monoammonium Phosphate Potassium Chloride Sulfur Wax	2,000 pounds	Not Reported	No
Nitra King 19-4-4	1,000 pounds	Not Reported	No
Wrought Aluminum Alloy Aluminum 92%	500 pounds	Not Reported	No
Manganese, 13% Stainless Steel	500 pounds	Not Reported	No
Oxygen, 02. 99%, Compressed Gas	6,000 cubic feet	Not Reported	Yes
Nickel, 46% Nickel Steel	500 pounds	Not Reported	No
Freon R-123	2,500 pounds	Not Reported	No
Waste Pathology	40 pounds	600 pounds	No
Aluminum Chlorohydrate	2,000 gallons	Not Reported	No
Sodium Carbonate, 48% Solid Pounds Fusion (solid Detergent)	750 pounds	Not Reported	No
Natural Fine and Coarse Aggregate	5,000 pounds	Not Reported	No
Silicon Dioxide	2,600 pounds	Not Reported	No
Snapshot 2.5 TG Isoxaben 1% Trifluralin 2% Clays, Fuller's earth 79% Silica, crystalline (quartz) 1% Balance 2%	500 pounds	Not Reported	No
Polymaleic Acid	100 gallons	Not Reported	No
Lanthanum Chloride	110 gallons	Not Reported	No
Sodium Sulfite, 25% Solution	5,100 gallons	Not Reported	No
Waste- Decalcifying Solution Water 97% Hydrochloric Acid 3%	5 gallons	15 gallons	No

Table 2-1. Hazardous Materials

Hazardous Material	Maximum Amount at One Time	Total Annual Amount	Explosive
Waste Gram Stain Isopropanol 75% Methanol 2% Ethanol 2% C.I. Basic Violet 3 1% Potassium Iodide 3%	2.5 gallons	15 gallons	No

2.2 Closed Mission Bay Landfill

A portion of the SeaWorld leasehold sits atop the closed Mission Bay Landfill (Figure 2-1). The City owned and operated the landfill from July 1952 to December 1959 for disposal of municipal solid waste. One section of the landfill accepted industrial waste and received waste acids, alkaline solutions, organic solvents, and paint waste. The landfill was the subject of several studies before and after its closure. When the 2001 EIR was prepared, the Mission Bay Landfill was designated as “inactive.” Currently, the landfill is designated as “closed” by the California Department of Resources Recycling and Recovery (CalRecycle). The SeaWorld lease with the City prohibits SeaWorld from disturbing the closed Mission Bay Landfill.

In the 2001 EIR, five project areas were identified as having the potential to be impacted by the closed Mission Bay Landfill:

1. **The proposed site of the Splashdown Ride**, which was in proximity to, although not directly over, the closed landfill. The potential for excavation activities to encounter hazardous materials during construction of this ride was assessed but deemed highly unlikely given the ride was not located directly above the closed landfill.
2. **The site of the educational facility**, which was proposed at a location approximately 2,000 feet from the closed landfill. Potential hazardous materials that might have been encountered during construction excavation were expected to be minimal.
3. **Special Events Center Expansion project site**, with a proposed location near the closed landfill. Although the site is not directly over the closed landfill, it is in proximity, and excavation activities could have encountered hazardous materials.
4. **Project site I-2**, which was proposed at a location adjacent to the approximate boundary for the closed landfill. Due to its proximity to the closed landfill, potential impacts to development could have occurred if hazardous materials were encountered during excavation.
5. **The parking garage site**, which was proposed considerably west of the closed landfill; however, potential impacts to development could have occurred if hazardous materials were encountered during excavation.

The 2001 EIR determined the impacts to these sites from the closed landfill would be insignificant because monitoring during construction would ensure that any hazardous materials/wastes detected in the soils or groundwater would be remediated during site preparation in conformance with local, state, and federal regulations. In addition, the *Postclosure Land Use Plan for Mission Bay South Shores, Phase 3* (City 1995), which covers the part of the landfill that is on the SeaWorld leasehold, recommended:

- prohibiting excavation exceeding 5 feet in depth;

- requiring parking-area trees to be placed in planters set above the surface and treated to prevent root penetration;
- requiring parking lot grading and surfacing to prevent ponding of water; and
- requiring a regularly inspected irrigation system to ensure that the drought-tolerant species are established.

No mitigation measures for the Mission Bay Landfill were included in the 2001 EIR. As required by CalRecycle, the City conducts quarterly inspections of the landfill. When adverse conditions such as ponding or storm drain blockage are observed within the SeaWorld leasehold, SeaWorld is notified and is required to correct the adverse conditions.

In addition to quarterly inspections, annual water quality monitoring and site condition certification reports are completed by the City's Environmental Services Department. The reports for the closed Mission Bay Landfill from 2017 and 2018 indicate groundwater elevations exhibited minor fluctuations, likely due to tidal influences (GeoSyntec Consultants 2018). Landfill sampling locations are shown in Figure 2-1; however, groundwater elevations and direction of flow were generally consistent with previous results. The general chemistry parameters and concentrations of constituents of concern in groundwater and surface water samples are consistent with historical concentrations and/or trends and do not indicate a new or expanding release from the landfill. Concentrations of general chemistry parameters were below their respective prediction limits, with the exception of chloride in groundwater well MBW-3 and pH in surface water samples from SDRSW-9 and MBSW-2 (see Figure 2-1 for sampling locations). During the most recent 2017 and 2018 monitoring period, no volatile organic compounds (VOC) exceeded their water quality objectives, and there were no statistically significant VOC trends observed.

There is no landfill gas collection or monitoring system at the closed Mission Bay Landfill. As SeaWorld's Journey to Atlantis ride is within 1,000 feet of the landfill, SeaWorld voluntarily performs semi-annual monitoring of three landfill gas migration probes and two other areas near the Journey to Atlantis ride for collection of carbon dioxide, oxygen, methane, and hydrogen sulfide. To date, the itemized trace gas concentrations have been below the California Code of Regulations (CCR) Title 27, Article 6, Section 20937, landfill gas monitoring and reporting levels, and the methane gas concentrations are below the CCR Title 27, Article 6, Section 20921 standard. In addition, SeaWorld performs monthly inspections of methane monitors located in the restricted areas of the ride.

There is no evidence of soil or groundwater contamination of the SeaWorld leasehold from the closed Mission Bay Landfill. The changes proposed in the 2020 Master Plan are not affected by the closed landfill and there are no significant impacts to human health or public safety. Monitoring of the landfill, groundwater, and soil gas will continue to be conducted by SeaWorld as a best management practice.



Legend

-  Monitoring Well
-  Surface Water Sample
-  Closed Solid Waste Facility/Landfill
-  SeaWorld Leasehold Boundary

**Brown AND
Caldwell**

Date: Nov 19, 2019
Project No: 154018
Client: SeaWorld Master Plan
Figure ID: LSL191119

Basemap: ESRI, SCS Engineers

0 250 500 1,000
Feet



Figure 2-1
Landfill Sampling Locations
SeaWorld Master Plan

2.3 Mission Bay Sediments

The 2001 EIR used the results of a 1996 study on the chemistry, toxicity, and benthic community conditions in sediments of the San Diego Bay region to assess the impact of SeaWorld operations on the surrounding sediments. Two sampling stations were located in the Southern Pacific Passage, north of the leasehold. The sampling results showed the sediments at these stations were below the threshold effect level and had a nontoxic concentration for *Rhepoxynius* (amphipod). The benthic community at both sites was not considered transitional or degraded, and the sampling stations were not placed on the priority list for future investigation.

Construction of the future marina expansion site was identified in the 2001 EIR as having the potential to disrupt Mission Bay sediments. No significant impacts or mitigation measures were assigned to the potential disruption of sediments because the Regional Water Quality Control Board (RWQCB) and other agencies would regulate and monitor sediment conditions through their permitting processes.

Although no mitigation measures were included in the 2001 EIR, SeaWorld has been performing sediment sampling in Mission Bay since 2001 to monitor the potential impacts of the summer fireworks program under the RWQCB, San Diego Region, Order No. R9-2011-0022, General National Pollutant Discharge Elimination System (NPDES) Permit for Residual Firework Pollutant Waste Discharges to Waters of the United States in the San Diego Region from the Public Display of Fireworks (the General Permit). Initial sediment sampling within the firework fallout area in the back of Mission Bay was conducted during yearly events between 2001 and 2004 (SAIC 2001, 2002, 2003, and 2004) and continued from 2006 through today (Brown and Caldwell 2006, 2007a, 2009, 2010a, 2013a, 2013b, 2014, 2015, 2017, and 2018).

Fireworks events at SeaWorld have historically been performed nightly during the summer months; however, only seven firework events occurred in 2017 and only 12 occurred in 2018. SeaWorld implements best management practices before, during, and after each event, including:

- Several sweeps of the fireworks fallout area where floating debris from spent fireworks is removed from the water using hand-held fishnets.
- Sweeps of the surface of the fireworks barge immediately after the shows to prevent solid waste and debris from being swept into the water by wind where chemicals can be washed from the debris into Mission Bay. Unexploded fireworks, including unexploded components, are collected, handled, and disposed of by the pyrotechnic operator.
- Crews from a SeaWorld subcontractor pick up fireworks debris on the adjacent shoreline every morning and afternoon following each fireworks event.
- Divers search for fireworks-related debris in Mission Bay on an annual basis.

Annual monitoring events and reports characterize metal concentrations in sediment samples and include statistical analyses of the results to evaluate the impacts of the fireworks events on Mission Bay. Mission Bay's sediment composition is sand, silt, and organic material. Due to the variation of material, a number of fate and transport processes for chemicals in sediments are active, including absorption onto organic matter and sediments, diffusion of chemicals through the pore spaces in the sediments, bed consolidation and burial, and biological consumption and degradation. In the fallout area, it is believed the fate of the chemicals is dominated by absorption and eventual burial, along with minor biological consumption and degradation. The collection and analysis of sediment samples to evaluate the effects of the fireworks on beneficial uses of Mission Bay has been performed annually to ensure the quality meets the requirements of the General Permit.

During the initial annual 2001 to 2004 and 2006 to 2010 sampling events, 12 sites were studied—10 locations were within the Firework Deposition Zone (FDZ), and two were reference sites (Sail Bay and Rose Creek) (Figure 2-2). Beginning in 2012, six sites were studied during each of the subsequent sampling events. These annual sampling events consisted of six locations—three within the FDZ, a duplicate, and the two reference sites.

All sample locations in the FDZ were determined using a random sampling scheme within the observed dimensions of the area. The reference areas were located outside the FDZ in different sections of Mission Bay.

The sediment samples were analyzed for chronic toxicity using the amphipod *Eohaustorius estuaries* (*Eohaustorius*), and the polychaete worm *Neanthes arenaceodentata* (*Neanthes*). Statistical analysis was performed to determine if the sampling site was considered toxic compared to a reference sample. Table 2-2 shows that between 2008 and 2018, sediment at the FDZ sampling sites was classified once as moderately toxic and once as low-toxic, with the remaining 114 of the 116 samples as non-toxic when compared to one of the reference locations.

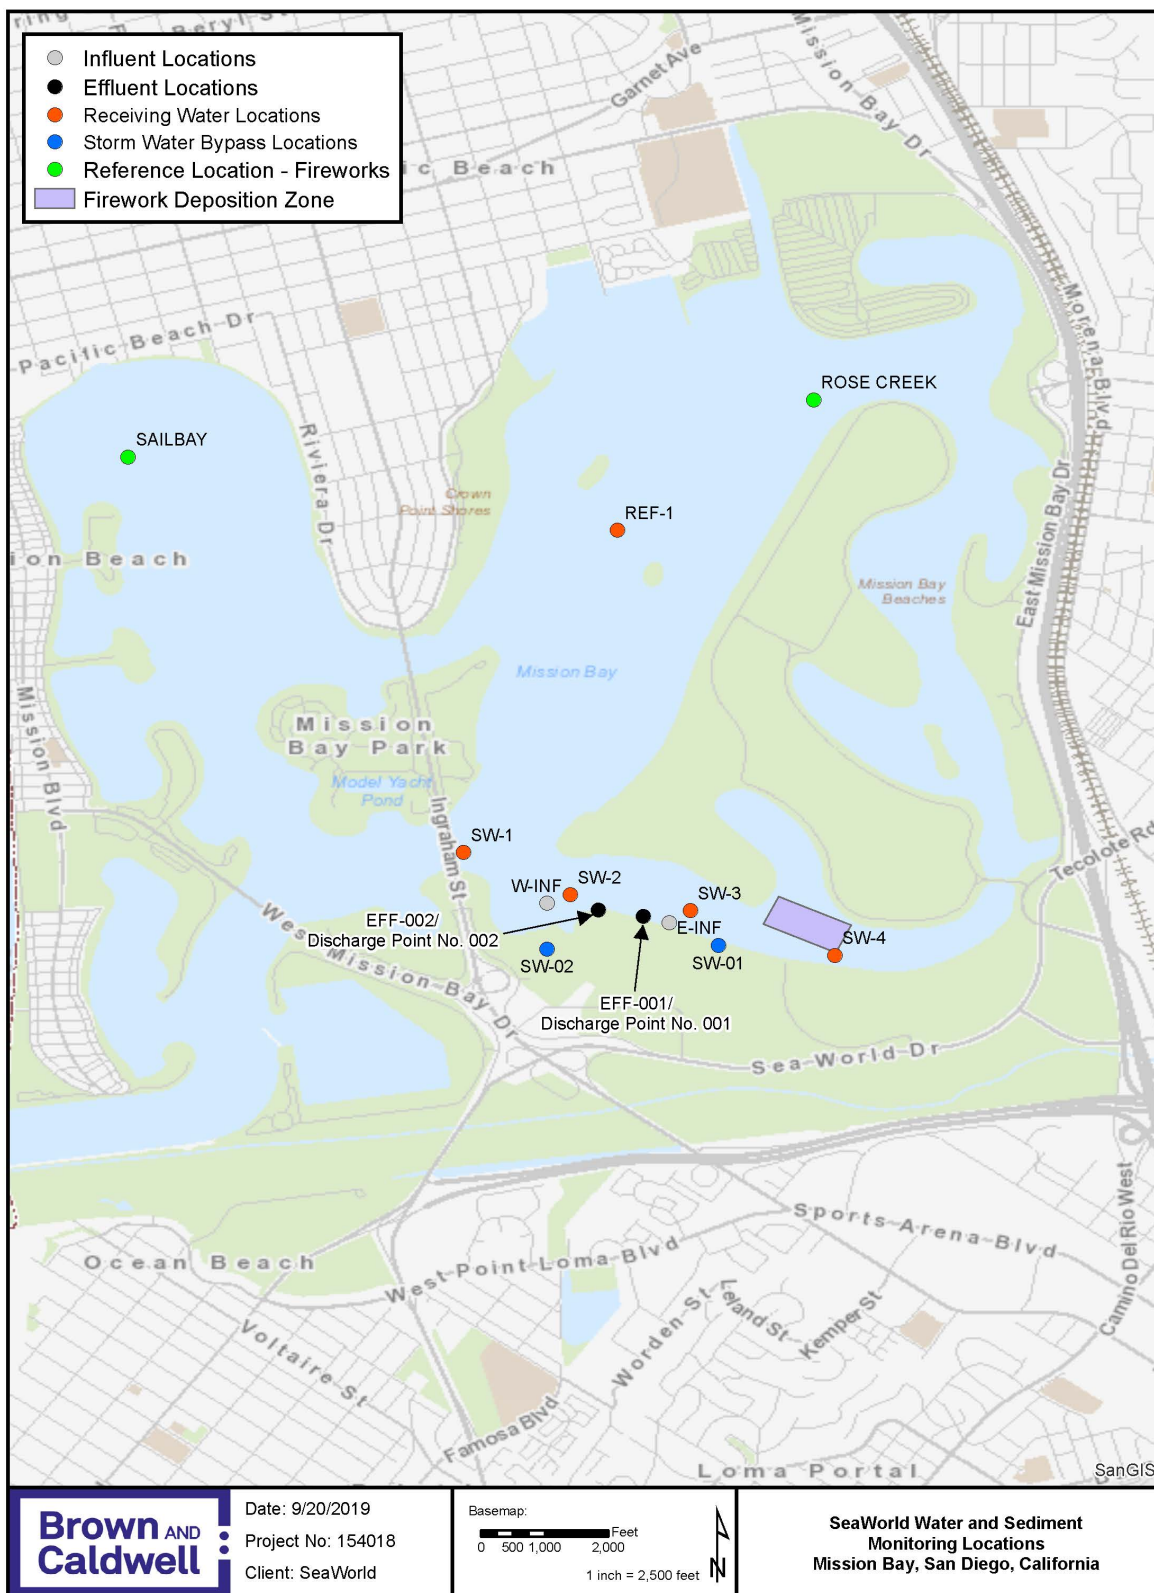


Figure 2-2. SeaWorld water and sediment monitoring locations

Table 2-2. Sediment Toxicity in FDZ samples compared to reference locations

Year	Number of FDZ Sites Classified as Non-Toxic	Number of FDZ Sites Classified as Low-Toxic	Number of FDZ Sites Classified as Moderate-Toxic Sites
2008	19/20	1/20	None
2009	29/30	None	1/30
2010	10/10	None	None
2012	4/4	None	None
2013	4/4	None	None
2014	4/4	None	None
2015	4/4	None	None
2016	4/4	None	None
2017	4/4	None	None
2018	4/4	None	None

Based on the findings from all sampling events, there was relatively little spatial variation, although some temporal variation was observed within the FDZ. It appears accumulation rates of fireworks residues are very small due to the very small mass of fireworks residue that is discharged to Mission Bay during the firework events. The most recent events were generally within historical ranges of previous samples and/or below historical maximum concentrations, with little fluctuation in sediment chemistry.

SeaWorld operations have had an imperceptible effect on the surrounding Mission Bay sediments. Monitoring sediment for impacts from fireworks, as required by the General Permit, will continue.

Section 3

Analysis of the 2020 Master Plan Potential Impacts to Human Health and Public Safety

The City certified the EIR for the SeaWorld Master Plan in 2001 (SCH No. 1984030708). The certified 2001 EIR evaluated development of the entire SeaWorld Master Plan area, or project area, including health and safety impacts. This document tiers from the previously certified 2001 EIR as permitted by Sections 15152 and 15168 of the California Environmental Quality Act (CEQA) Guidelines. Thus, this report only evaluates the potential health and safety impacts from implementation of the 2020 Master Plan beyond what was analyzed in the 2001 EIR.

The following questions are from the City's Initial Study Checklist (*CEQA Significance Determination Thresholds for Health and Safety* [2011]). They are intended to provide guidance on determining the potential significance of health and safety issues by asking if a project would:

1. Expose people or structures to a significant risk of loss, injury, or death related to wildland fires?
2. Result in hazardous emissions or handling hazardous or acutely hazardous materials, substances, or waste within a quarter mile of an existing or proposed school?
3. Impair implementation of, or physically interfere with, an adopted emergency response plan or emergency evacuation plan?
4. Be located on a site that is included on a list of hazardous materials sites compiled pursuant to Government Code Section 65962.5 and, as a result, create a significant hazard to the public or environment?
5. Expose people to toxic substances, such as pesticides and herbicides, some of which have long-lasting ability, that were applied to the soil during previous agricultural uses?
6. Result in a safety hazard for people working in a designated airport influence area?
7. Result in a safety hazard for people residing or working within 2 miles of a private airstrip or a private airport or heliport facility that is not covered by an adopted Airport Land Use Compatibility Plan (ALUCP)?

Furthermore, this analysis is structured in terms of each designated planning area and discusses potential impacts related to future construction activities and long-term operation of SeaWorld. A map of the area is shown in Figure 1-1.

3.1 Area 1: SeaWorld Aquatic Theme Park

Area 1 encompasses the SeaWorld park area of 97.2 acres bounded by the South Pacific Passage channel of Mission Bay to the north, the administration and support area to the west, the South Shores area of Mission Bay Park to the east, and the guest parking area to the south. This area includes 7 acres of open water used for water shows at the Waterfront Stadium.

Future allowed uses in Area 1 may include:

- Marine habitats;
- Special-effects theaters;
- Land-based adventure rides;
- Pelagic fish exhibits (large fish);
- Water-play attractions;
- Themed track or water rides;
- Special-format projection attractions;
- Playgrounds;
- Performance venues;
- Boat rides;
- Historical reenactment presentations;
- Research facilities;
- Animal habitat;
- Rescue conservation/wildlife rehabilitation facilities;
- Special-event centers and facilities;
- Educational facilities;
- Culinary facilities;
- Gift shops;
- Restrooms;
- Support facilities;
- Multi-media facilities;
- Surface parking and access ways; and
- Other uses consistent with the intent and purpose of the 2020 Master Plan as determined by the City and the California Coastal Commission (CCC) during review of any project Coastal Development Permit application.

These projects have not yet gone through an extensive planning and design process. While certain areas of SeaWorld have been identified for future development or redevelopment, the specific nature of the projects has not been defined.

3.2 Area 2: Guest Parking

The guest parking area comprises 56 acres along the south side of the leasehold between SeaWorld and SeaWorld Drive. Future allowed uses in Area 2 may include surface parking, temporary events and associated structures, outdoor educational activities, and operations yards. Reconfiguration and restriping of surface parking will be allowed in response to operational needs. Two previously approved projects are the parking garage and transit station.

A four-level parking garage was approved in the 2002 Master Plan but was not built. The 2020 Master Plan proposes a four-level parking garage within the Area 2 guest parking lot. The parking garage will not be needed until SeaWorld attendance justifies additional parking. Half of the first level will be below grade. The CCC has not reviewed or granted approval of the parking garage and is in no way bound by the development concept contained herein.

A transit station was approved in the 2002 Master Plan but was not built. SeaWorld is committed to working with San Diego Metropolitan Transit System to accommodate the previously approved transit station within Area 2 if and/or when the opportunity arises. The CCC has not reviewed or granted approval of a transit station and is in no way bound by the development concept contained herein.

3.3 Area 3: Administration and Support

The administration and support area consists of 6.8 acres of land located immediately west of SeaWorld (Area 1) between the SeaWorld Marina and the guest parking area. This area contains many of the support facilities needed to operate SeaWorld, including administrative offices, security, water treatment, storage, and other facilities. A reserved parking lot is located in the south portion of the area.

Future allowed uses in Area 3 may include offices, water treatment, storage, maintenance, parking, and similar types of theme park support facilities.

3.4 Area 4: SeaWorld Marina

The SeaWorld Marina contains a 1-acre shoreline land area and a 10-acre open water area. The water area contains the 200-slip marina operated by SeaWorld. Restroom, shower, and lounge facilities are provided for marina guests. On the east side of the marina is the water intake platform, which is one of two intake areas that provide sea water for SeaWorld's marine animals. The filter plant for the intake is located just to the south in Area 3.

Future allowed uses in Area 4 may include marina operations, boat mooring, boat storage, dry storage facilities, boat loading, restrooms, lounge facilities, bayside café, and parking.

As provided in the 2002 Master Plan, the 2020 Master Plan proposes a future expansion of the existing marina by extending the three existing docks and adding a fourth dock to the west. The marina expansion would add 115 water berths for a total of 315 berths. This entitlement has been carried forward in the 2020 Master Plan as a future conceptual development and was only granted by the City. The CCC has not reviewed or granted approval of the marina expansion and is in no way bound by the development concept contained herein.

3.5 Area 5: Perez Cove Shoreline

The Perez Cove Shoreline area consists of 11.4 acres of land between the Perez Cove shoreline on the east and Perez Cove Way on the west. The northern portion of the area contains the Hubbs-SeaWorld Research Institute and parking lot. Additional asphalt parking areas and landscaping cover the remaining area. The parking area serves marina guests and is an auxiliary lot for SeaWorld employees.

Future allowed uses in Area 5 may include parking, a hotel, visitor-serving commercial/recreation uses, research and meeting facilities, and parkland.

As provided in the 2002 Master Plan, the 2020 Master Plan includes a future 300-room hotel. The conceptual proposal includes a ballroom, meeting rooms, surface parking, and a parking structure. A small landing dock for hotel guests will be built in the Perez Cove Shoreline directly behind the hotel. Additional access from the shoreline to the marina docks will be provided on the north side of the site. Prior to project review, SeaWorld will provide an economic feasibility analysis assessing the need for another hotel in Mission Bay Park. The CCC has not reviewed or granted approval of the hotel and is in no way bound by the development concept contained herein.

3.6 Significance Thresholds and Impact Assessment

The following questions are from the City's Initial Study Checklist and are intended to help determine the potential significance of health and safety issues.

3.6.1 Health and Safety Issue 1

Would the project expose people or structures to a significant risk of loss, injury, or death involving wildland fires?

SeaWorld, in its existing configuration and with the changes proposed in the 2020 Master Plan, will not expose people or structures to wildland fires. The San Diego County website "ReadySanDiego" provides a wildland fire hazard map for the county¹. The SeaWorld leasehold is in an area "not designated" with respect to wildland fires, indicating that no wildland fire hazard has been identified in this area by San Diego County.

Area 1: SeaWorld Aquatic Theme Park. San Diego County has identified no wildland fire hazard in this area. The proposed changes in Area 1 do not pose a significant impact related to wildland fires.

Area 2: Guest Parking. San Diego County has identified no wildland fire hazard in this area. The proposed changes in Area 2 do not pose a significant impact related to wildland fires.

Area 3: Administration and Support. San Diego County has identified no wildland fire hazard in this area. The proposed changes in Area 3 do not pose a significant impact related to wildland fires.

Area 4: SeaWorld Marina. San Diego County has identified no wildland fire hazard in this area. The proposed changes in Area 4 do not pose a significant impact related to wildland fires.

Area 5: Perez Cove Shoreline. San Diego County has identified no wildland fire hazard in this area. The proposed changes in Area 5 do not pose a significant impact related to wildland fires.

3.6.2 Health and Safety Issue 2

Would the project result in hazardous emissions or handle hazardous or acutely hazardous materials, substances, or waste within a quarter-mile of an existing or proposed school?

The significance threshold for this issue applies to projects that propose the handling, storage, and treatment of hazardous materials (e.g., a hazardous waste facility) falling under City Municipal Code Sections 141.1001 and 141.1002, which must prepare a risk assessment in conformance with the Tanner Act. The Hazardous Materials Management Division of the Department of Environmental Health (DEH) determines if projects are subject to Tanner Act provisions. SeaWorld hazardous materials operations do not present a significant impact based on the San Diego County established *Guidelines for Determining Significance Hazardous Materials and Existing Contamination* (San Diego County 2007). Guideline 4.1 from these guidelines specifies that businesses that have and follow a hazardous materials business plan do not exceed the significance guidelines. SeaWorld uses the hazardous materials shown in Table 2-1 and manages these materials through, and is in compliance with, its Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A).

The closest schools (Correia Middle School and Urban Corps of San Diego County Charter) are approximately 1 mile from the SeaWorld leasehold boundary.

¹: <https://www.readysandiego.org/wildfire-hazard-map/>

Area 1: SeaWorld Aquatic Theme Park. Hazardous materials are stored and used in this area. The hazardous materials are managed as described in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A). Businesses that have and follow a hazardous materials business plan do not exceed the significance guidelines in the City Development Service's CEQA *Significance Determination Thresholds* (2011) for health and safety.

Area 2: Guest Parking. Hazardous materials are stored and used in this area. The hazardous materials are managed as described in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A). Businesses that have and follow a hazardous materials business plan do not exceed the significance guidelines.

Area 3: Administration and Support. Hazardous materials are stored and used in this area. The hazardous materials are managed as described in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A). Businesses that have and follow a hazardous materials business plan do not exceed the significance guidelines.

Area 4: SeaWorld Marina. Hazardous materials are stored and used in this area. The hazardous materials are managed as described in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A). Businesses that have and follow a hazardous materials business plan do not exceed the significance guidelines.

Area 5: Perez Cove Shoreline. Hazardous materials are stored and used in this area. The hazardous materials are managed as described in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A). Businesses that have and follow a hazardous materials business plan do not exceed the significance guidelines.

3.6.3 Health and Safety Issue 3

Would the project impair implementation of, or physically interfere with, an adopted emergency response plan or emergency evacuation plan?

San Diego County Office of Emergency Services (OES) coordinates the overall county response to disasters. OES is responsible for alerting and notifying appropriate agencies when disaster strikes, coordinating all agencies that respond, ensuring resources are available and mobilized in times of disaster, developing plans and procedures for response to and recovery from disasters, and developing and providing preparedness materials for the public.

The San Diego County Operational Area Emergency Operations Plan (OA EOP) describes a comprehensive emergency management system that provides for a planned response to disaster situations associated with natural disasters, technological incidents, terrorism, and nuclear-related incidents. The proposed changes in the SeaWorld 2020 Master Plan will not impair or interfere with the San Diego County OA EOP.

Area 1: SeaWorld Aquatic Theme Park. SeaWorld is included in and complies with the San Diego County OA EOP in case of emergency. The 2020 Master Plan projects in this area will not pose a significant impact to emergency response.

Area 2: Guest Parking. SeaWorld is included in and complies with the San Diego County OA EOP in case of emergency. The 2020 Master Plan projects in this area will not pose a significant impact to emergency response.

Area 3: Administration and Support. SeaWorld is included in and complies with the San Diego County OA EOP in case of emergency. The 2020 Master Plan projects in this area will not pose a significant impact to emergency response.

Area 4: SeaWorld Marina. SeaWorld is included in and complies with the San Diego County OA EOP in case of emergency. The 2020 Master Plan projects in this area will not pose a significant impact to emergency response.

Area 5: Perez Cove Shoreline. SeaWorld is included in and complies with the San Diego County OA EOP in case of emergency. The 2020 Master Plan projects in this area will not pose a significant impact to emergency response.


3.6.4 Health and Safety Issue 4

Would the project be located on a site that is included on a list of hazardous materials sites compiled pursuant to Government Code Section 65962.5 and, as a result, create a significant hazard to the public or environment?

Hazardous materials sites were identified from an Environmental Data Resources, LLC (EDR) report for the area (provided in Appendix C). The environmental records of concern are listed in Table 3-1, and the locations are shown in Figure 3-1. Based on EDR's findings, GeoTracker and ENVIROSTOR (the California Department of Toxic Substances Control's [DTSC] data management system) databases were consulted to obtain detailed information about the sites of concern. With the exception of the closed Mission Bay Landfill, the 2020 Master Plan areas would not be located on a hazardous materials site.

Table 3-1. Environmental Records of Concern

Environmental Record	Number of sites	Distance from Target Property (miles)	Comments
Solid Waste Facility/Landfill	1	< 1/8	Mission Bay Landfill (closed facility with monitoring)
San Diego County Site Assessment and Mitigation (SAM) Program	14	< 1/2	No open cases
Leaking Underground Storage Tank (LUST)	16	<1/2	No open cases
California Environmental Reporting System (CERS) Hazardous Waste Site	2	1/4	No open cases
Superfund Enterprise Management System Database Archive (SEMS-ARCHIVE)	3	< 1/2	No information
California DTSC Data Management System ENVIROSTOR	14	< 1	No active sites
California Cleanup Program Sites (CPS) and Spills, Leaks, Investigations, and Cleanups (SLIC)	7	<1/2	One open-inactive site
California Hazardous Material Incident Reporting System (CHMIRS)	1	<1/8	Mission Bay Landfill
California Proposition 65	10	<1	Not reported in GeoTracker

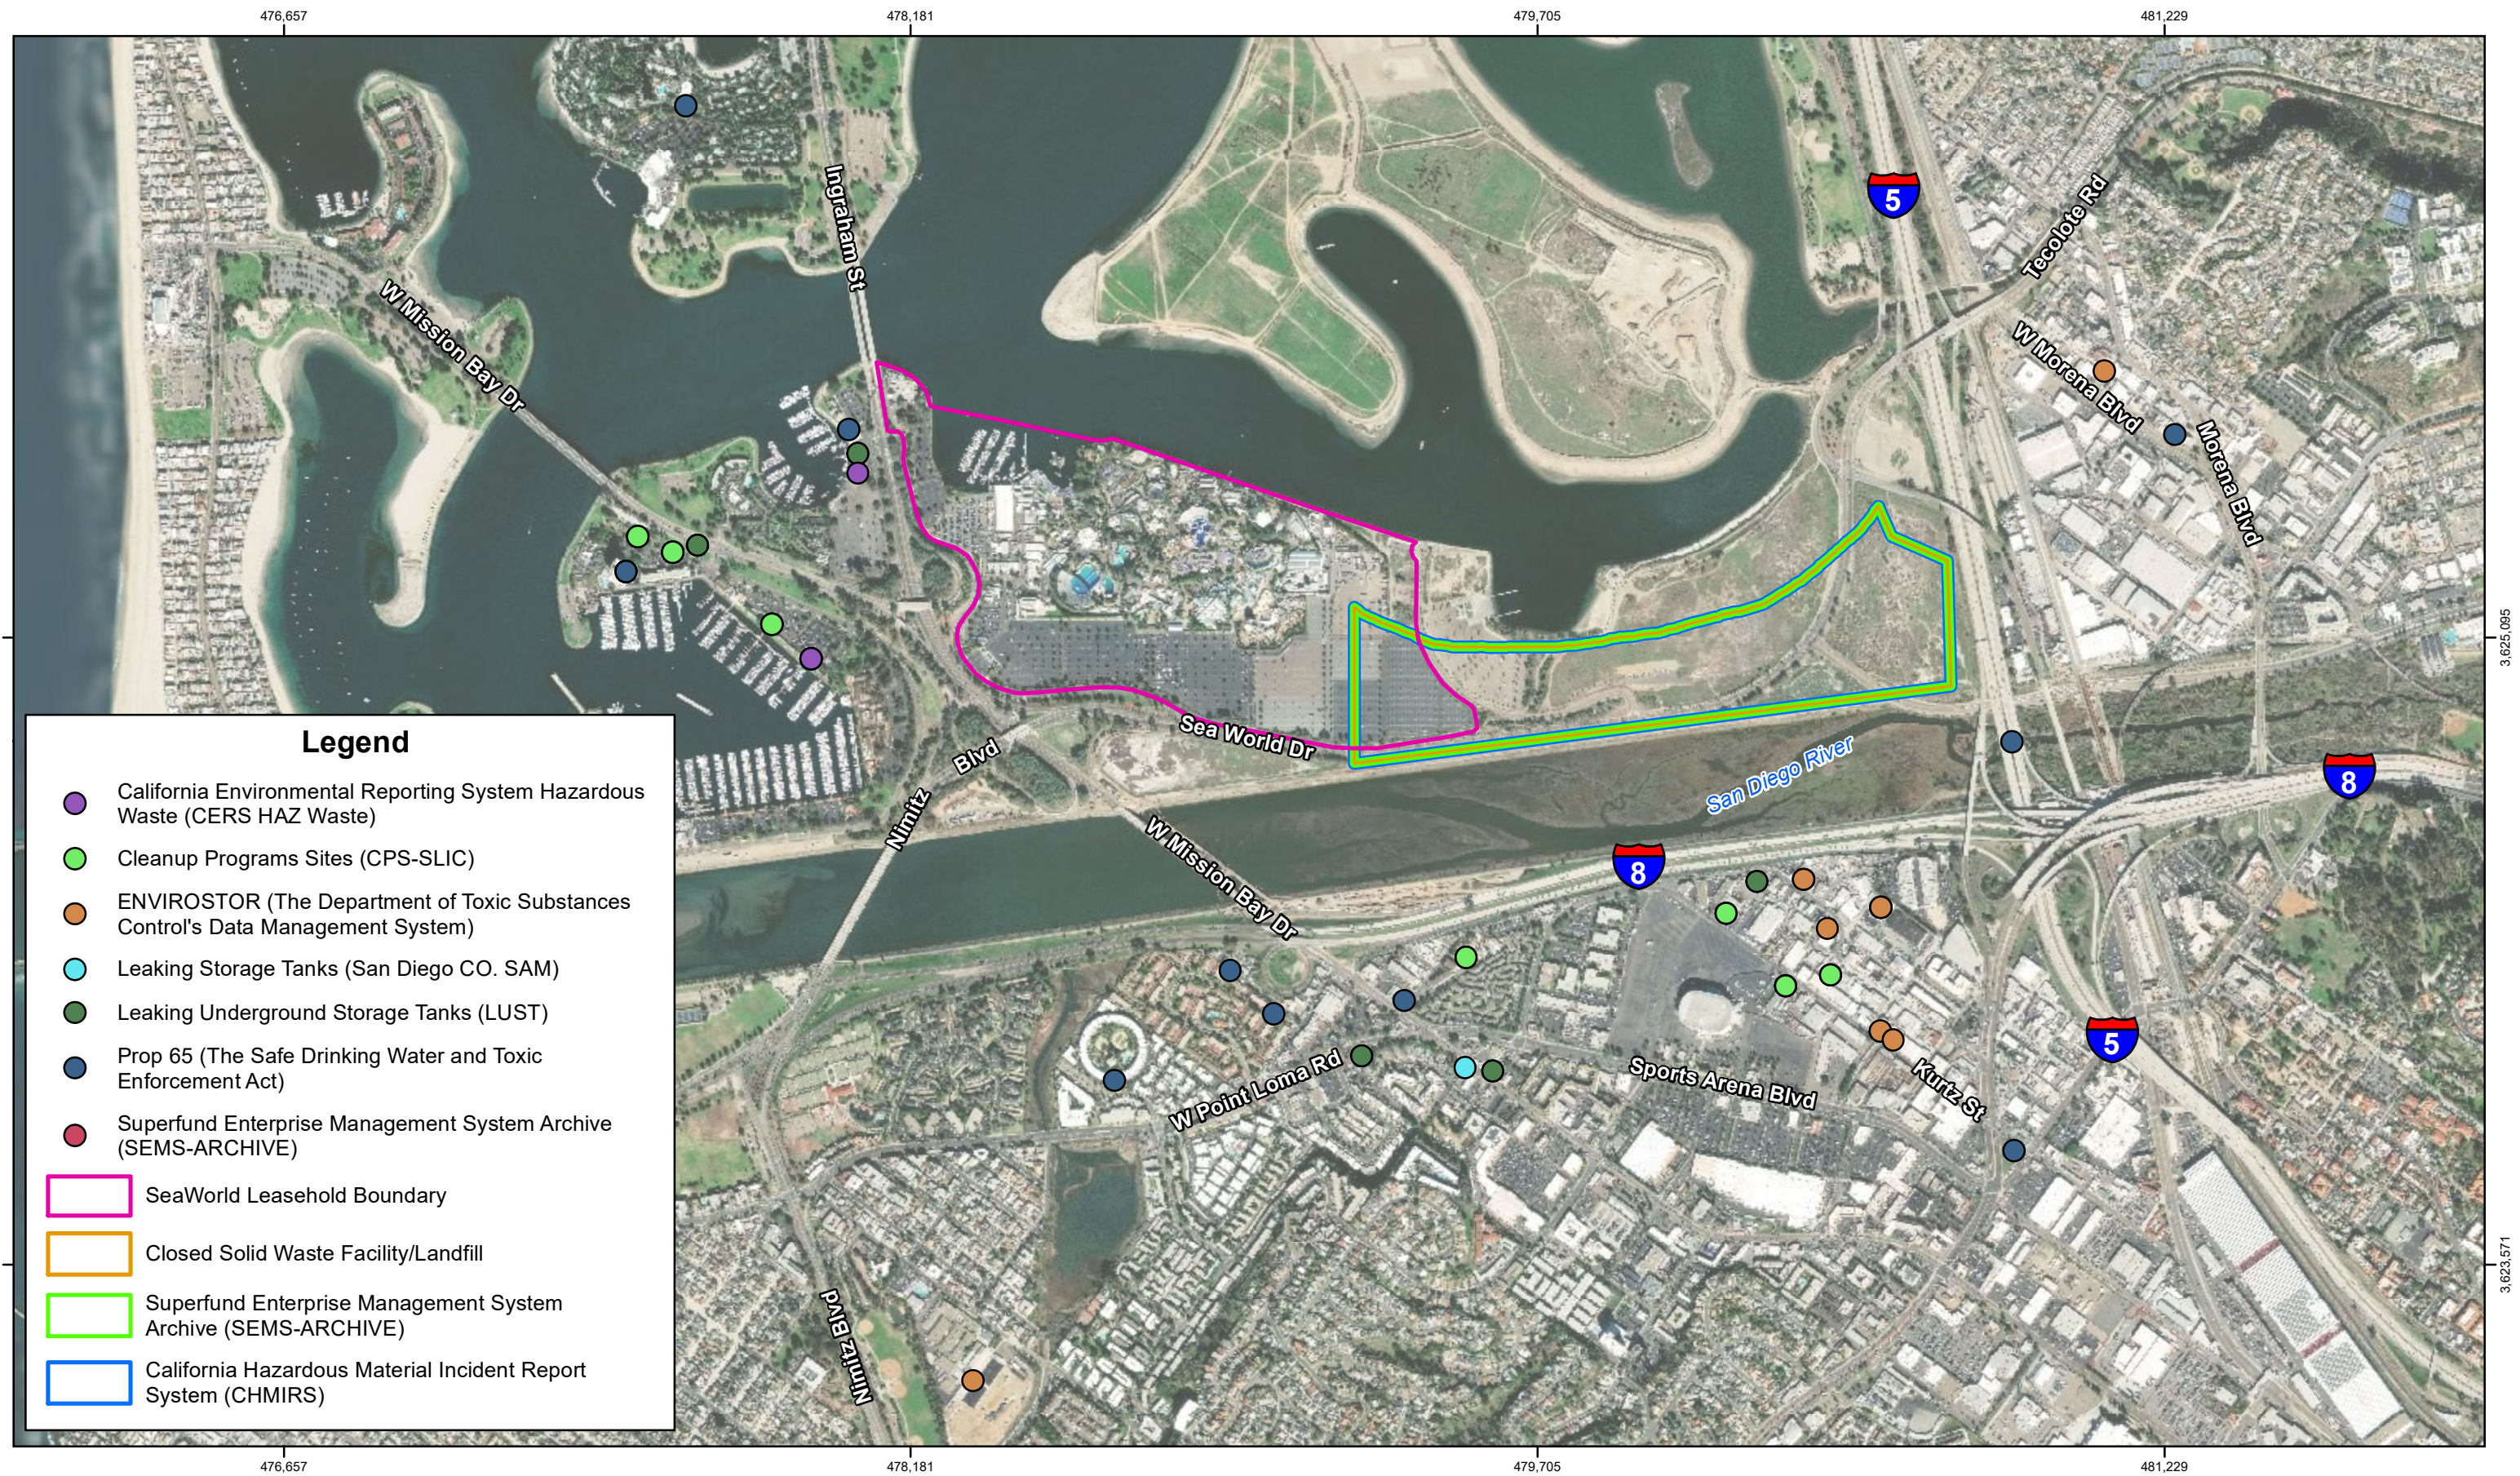

The following is specific information related to the findings in Table 3-1:

- The Mission Bay Landfill is a closed solid waste facility located 0.1 miles southeast of SeaWorld. The landfill operated from 1952 to 1959, and groundwater has been monitored at the site. The site is listed in the Superfund Enterprise Management System Archive (SEMS-ARCHIVE), but it does not qualify for the National Priorities List.
- The Driscoll Mission Bay Boatyard is a boat repair and maintenance facility located a half-mile southwest of SeaWorld. The boatyard is part of the Cleanup Program Site, and historical discharges of copper have resulted in contamination of sediments proximal to the shoreline. No regulatory oversight activities are being conducted.
- No further information for the SEMS-ARCHIVE sites was found on GeoTracker.
- Photic of San Diego is an ENVIROSTOR site located 0.4 miles southeast of SeaWorld. The site has an inactive cleanup status and is listed as having a tiered permit for generating and treating hazardous waste. No additional information was available.
- Sackett & Pendlebury Boat Builders is an ENVIROSTOR site located 0.4 miles southeast of SeaWorld. This is a historical ENVIROSTOR site that included four small warehouses, rented office space, and boat building. The DTSC issued a No Further Action letter in 1994 following review of a report that demonstrated no evidence of any handling of hazardous substances at the site.
- Truck Terminal at Kurtz Street is an ENVIROSTOR site located 0.5 miles southeast of SeaWorld. The site applied to the Voluntary Assistance Program (VAP) in March 2001 due to an apparent gasoline underground storage tank release, and the site was referred to the local agency. The specific local agency was not identified in ENVIROSTOR.
- Don Pollock Excavating, Inc., is an ENVIROSTOR site located 0.6 miles southeast of SeaWorld. This is a historical ENVIROSTOR site with potential contaminated soil. In 1983, several drums were observed with nearby surface staining. Screening was performed in 1987 with no evidence of underground tanks identified at the site. The DTSC issued a No Further Action letter in 1994.
- Boyce Industries is an ENVIROSTOR site located 0.6 miles southeast of SeaWorld. This is a historical ENVIROSTOR site that distributed chemicals and had potential contamination in surface water and soil that included detergent/soap, acid solutions, and polymeric resin waste. The DTSC issued a No Further Action Letter in 1994 after a preliminary assessment identified no evidence of contamination from the operations.

Area 1: SeaWorld Aquatic Theme Park. Portions of this area are located on or near the closed Mission Bay Landfill. Due to its proximity to the inactive landfill, potential impacts to development may occur if hazardous materials are encountered during project excavation; however, monitoring will be conducted prior to and during construction. Any hazardous materials/wastes found in the soils or groundwater would be remediated during site preparation in conformance with local, state, and federal regulations. The 2020 Master Plan projects in this area do not create a significant impact to the public or environment.

Area 2: Guest Parking. Portions of this area are located on or near the closed Mission Bay Landfill. Due to its proximity to the inactive landfill, potential impacts to development may occur if hazardous materials are encountered during project excavation; however, monitoring will be conducted prior to and during construction. Any hazardous materials/wastes found in the soils or groundwater would be remediated during site preparation in conformance with local, state, and federal regulations. The 2020 Master Plan projects in this area do not create a significant impact to the public or environment.

Area 3: Administration and Support. This area is not located on or near the closed Mission Bay Landfill. The 2020 Master Plan projects in this area do not create a significant impact to the public or environment.

Area 4: SeaWorld Marina. This area is not located on or near the closed Mission Bay Landfill. The 2020 Master Plan projects in this area do not create a significant impact to the public or environment.

Area 5: Perez Cove Shoreline. This area is not located on or near the closed Mission Bay Landfill. The 2020 Master Plan projects in this area do not create a significant impact to the public or environment.

3.6.5 Health and Safety Issue 5

Would the project expose people to toxic substances, such as pesticides and herbicides, some of which have long-lasting ability, applied to the soil during previous agricultural uses?

The land beneath the SeaWorld leasehold has not been used for agriculture. Historical United States Geological Survey topographic maps from 1903 show that the SeaWorld area was in the tidal inundation zone until about 1930. From 1930 to 1940, development in other portions of the Mission Bay area effected the tidal zone, and the SeaWorld area was indicated as a marsh. The 1953 topographic map shows the development of the seawalls that define the San Diego River, and the SeaWorld site is indicated as a marsh. SeaWorld is identified as a park on the 1967 topographic map. The sequence of development in the SeaWorld area as tracked in topographic maps is confirmed by historic aerial photographs. The SeaWorld leasehold and surrounding area has not been used for agriculture.

SeaWorld's current operations include the use of pesticides and herbicides for landscaping purposes; however, best management practices (BMPs) are in place to minimize the release of these materials, as described in SeaWorld's Stormwater Pollution Prevention Plan (SWPPP). Details of the type, quantity, and frequency of pesticides and herbicides uses are included in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A),

Area 1: SeaWorld Aquatic Theme Park. This area has not been used for agriculture. SeaWorld's current operations include the use of pesticides and herbicides for landscaping purposes, and these products are included in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A). Businesses that have and follow a hazardous materials business plan do not exceed the significance guidelines.

Area 2: Guest Parking. This area has not been used for agriculture. SeaWorld's current operations include the use of pesticides and herbicides for landscaping purposes, and these products are included in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A). Businesses that have and follow a hazardous materials business plan do not exceed the significance guidelines.

Area 3: Administration and Support. This area has not been used for agriculture. SeaWorld's current operations include the use of pesticides and herbicides for landscaping purposes, and these products are included in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A). Businesses that have and follow a hazardous materials business plan do not exceed the significance guidelines.

Area 4: SeaWorld Marina. This area has not been used for agriculture. SeaWorld's current operations include the use of pesticides and herbicides for landscaping purposes, and these products are included in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A). Businesses that have and follow a hazardous materials business plan do not exceed the significance guidelines.

Area 5: Perez Cove Shoreline. This area has not been used for agriculture. SeaWorld's current operations include the use of pesticides and herbicides for landscaping purposes, and these products are included in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A). Businesses that have and follow a hazardous materials business plan do not exceed the significance guidelines.

3.6.6 Health and Safety Issue 6

Would the project result in a safety hazard for people working in a designated airport influence area (AIA)?

SeaWorld is not within the AIA of any airports in San Diego County. The San Diego County Regional Airport Authority serves as the Airport Land Use Commission (ALUC) for San Diego County. The ALUC adopts ALUCPs for 16 public-use and military airports in San Diego County. ALUCPs provide guidance on appropriate land uses surrounding airports to protect the health and safety of people and property within the vicinity of an airport, as well as the public in general. An ALUCP focuses on a defined area around each airport known as the AIA. Factors including noise, safety, airspace protection and overflight comprise the AIA in accordance with guidance from the California Airport Land Use Planning Handbook published by the California Department of Transportation, Division of Aeronautics. The ALUCP for the San Diego International Airport, the closest airport to SeaWorld, shows that SeaWorld is outside the AIA².

Area 1: SeaWorld Aquatic Theme Park. This area is not within the designated AIA of any airport. The proposed development in Area 1 is not a significant impact with respect to airport safety hazards.

Area 2: Guest Parking. This area is not within the designated AIA of any airport. The proposed development in Area 2 is not a significant impact with respect to airport safety hazards.

Area 3: Administration and Support. This area is not within the designated AIA of any airport. The proposed development in Area 3 is not a significant impact with respect to airport safety hazards.

Area 4: SeaWorld Marina. This area is not within the designated AIA of any airport. The proposed development in Area 4 is not a significant impact with respect to airport safety hazards.

Area 5: Perez Cove Shoreline. This area is not within the designated AIA of any airport. The proposed development in Area 5 is not a significant impact with respect to airport safety hazards.

² (<https://www.san.org/Airport-Projects/Land-Use-Compatibility#118024-overview>)

3.6.7 Health and Safety Issue 7

Would the project result in a safety hazard for people residing or working within two miles of a private airstrip or a private airport or heliport facility that is not covered by an adopted ALUCP?

The San Diego County airport directory³ is a list that contains all public airports, helipads and helidecks, seaplane ports and bases, and private airports and landing strips. None of the listed facilities are within 2 miles of SeaWorld. The SeaWorld 2020 Master Plan proposed changes will not result in a safety hazard for people within 2 miles of a private air facility.

Area 1: SeaWorld Aquatic Theme Park. This area is not within 2 miles of any air transportation facility. The proposed development in Area 1 is not a significant impact with respect to airport safety hazards.

Area 2: Guest Parking. This area is not within 2 miles of any air transportation facility. The proposed development in Area 2 is not a significant impact with respect to airport safety hazards.

Area 3: Administration and Support. This area is not within 2 miles of any air transportation facility. The proposed development in Area 3 is not a significant impact with respect to airport safety hazards.

Area 4: SeaWorld Marina. This area is not within 2 miles of any air transportation facility. The proposed development in Area 4 is not a significant impact with respect to airport safety hazards.

Area 5: Perez Cove Shoreline. This area is not within 2 miles of any air transportation facility. The proposed development in Area 5 is not a significant impact with respect to airport safety hazards.

³ <http://www.tollfreeairline.com/california/sandiego.htm>

Section 4

Significance Conclusions

Significance criteria have been established by the City to determine if proposed projects represent a significant impact(s). Project sites that meet one or more of the significance criteria may result in a significant impact. Significance Determination Thresholds have been established by the City (Development Services Department 2011). The thresholds assist City staff, project proponents, and the public in determining whether, based on substantial evidence, a project may have a significant effect on the environment under CEQA Section 21082.2 and therefore require mitigation. Section F of the Significance Determination Thresholds addresses health and safety.

4.1 Significance Thresholds

The 2020 Master Plan in relation to City significance thresholds are described in the following subsections.

4.1.1 Significance Threshold 1

Significance Threshold 1 applies to projects that propose the handling, storage, and treatment of hazardous materials (e.g., a hazardous waste facility) falling under City Municipal Code Sections 141.1001 and 141.1002 for which a risk assessment must be prepared in conformance with the Tanner Act. The Hazardous Materials Management Division of the DEH determines if projects are subject to Tanner Act provisions. Non-residential projects are instructed to complete Development Services Department form DS-3163, "Hazardous Materials Questionnaire."⁴

SeaWorld does store and use hazardous materials on site (refer to Section 2.1 of this Human Health and Public Safety report). The 2020 Master Plan changes are only expected to increase the amount of hazardous materials used on site by a small fraction of the current usage. The completed Development Services Department form DS-3163, "Hazardous Materials Questionnaire" is provided in Appendix B. The use, storage, and disposal of hazardous materials is conducted as described in SeaWorld's Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A).

SeaWorld hazardous materials operations do not present a significant impact based on San Diego County's *Guidelines for Determining Significance Hazardous Materials and Existing Contamination* (2007). Guideline 4.1 from these guidelines specifies that businesses that have and follow a hazardous materials business plan do not exceed the significance guidelines. SeaWorld has an established Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A) and is in compliance with the significance guidelines. SeaWorld uses the hazardous materials shown in Table 2.1, and the hazardous materials are managed as described in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A).

⁴ Refer to City of San Diego Information Bulletin 116 for more information. www.sandiego.gov/development-services/industry/pdf/infobulletin/ib116.pdf

4.1.2 Significance Threshold 2

Significance Threshold 2 applies to project sites on or near known contamination sources that may result in a significant impact. Known contamination sources were evaluated based on an EDR report; findings are listed in Section 3.1.4 of this Human Health and Public Safety report. With the exception of the closed Mission Bay Landfill, the Master Plan 2020 areas would not be located on or near a hazardous materials site.

4.1.3 Significance Threshold 3

Significance Threshold 3 applies to project sites that meet one or more of the following criteria and may result in a significant impact:

- **Project is located within 1,000 feet of a known contamination site.**

Portions of the 2020 Master Plan are on or adjacent to the closed Mission Bay Landfill. The landfill is capped, and routine monitoring of groundwater has not shown groundwater contamination from the landfill. Compliance with the conditions of required permits would protect workers and the general public from potential risk of exposure. The rules and regulations associated with the permits would also provide measures to reduce the potential risk of unauthorized releases of hazardous wastes/materials to the environment; therefore, the impact of the closed Mission Bay Landfill is not significant for the 2020 Master Plan.

- **Project is located within 2,000 feet of a known border zone property (also known as a Superfund site) or a hazardous waste property subject to corrective action pursuant to the Health and Safety Code.**

SeaWorld is not located within 2,000 feet of a known Superfund site. The closest Superfund site is Marine Corp Base Camp Pendleton located 45 miles northeast of SeaWorld.

- **DEH site file is closed.**

The Truck Terminal is a closed DEH site that is reported on ENVIROSTOR. The site is located 0.5 miles southeast of SeaWorld. The owners applied for VAP participation in March 2001 due to an apparent gasoline underground storage tank release.

- **Project is located in Centre City San Diego, Barrio Logan or other areas known or suspected to contain contamination sites (check with DEH).**

SeaWorld is located 5 miles northwest of Centre City San Diego, and 7 miles northwest of Barrio Logan.

- **Project is located on or near an active or former landfill.**

Portions of the 2020 Master Plan are on or adjacent to the closed Mission Bay Landfill. The landfill is capped, and routine monitoring of groundwater has not shown groundwater contamination from the landfill. Compliance with required permits would protect workers and the general public from potential risk of exposure. The rules and regulations associated with the permits would also provide measures to reduce the potential risk of unauthorized releases of hazardous wastes/materials to the environment; therefore, the impact of the closed Mission Bay Landfill is not significant for the 2020 Master Plan.

- **Properties historically developed with industrial or commercial uses that involved dewatering (the removal of groundwater during excavation), in conjunction with major excavation in an area with high groundwater (such as downtown).**

The original development of SeaWorld required major excavation with high groundwater. The site was developed in 1964, before the NPDES program was introduced. SeaWorld is now part of the NPDES program and follows all discharge regulations.

- **Project is located in a designated AIA and where the Federal Aviation Administration (FAA) has reached a determination of “hazard” through FAA Form 74601, “Notice of Proposed Construction or Alteration,” as required by FAA regulations in the Code of Federal Regulations Title 14 §77.13.**

SeaWorld is not located in a designated AIA. San Diego International Airport, located 2.7 miles southeast of SeaWorld, is the closest airport to the site.

- **Project is located on a site presently or previously used for agricultural purposes.**

SeaWorld is not located on a site that was previously used for agricultural purposes. The area where the site is located was underwater until the 1940s, and not developed until SeaWorld opened in 1964.

SeaWorld’s current operations include the use of pesticides and herbicides for landscaping purposes; however, BMPs are in place to minimize the release of these materials, as described in SeaWorld’s SWPPP. Details of the type, quantity, and frequency of pesticides and herbicides used are included in the Hazardous Materials Business Plan and Emergency Contingency Plan (Appendix A).

4.2 Significance Conclusions and Mitigation

Table 4-1 summarizes the significance conclusions and mitigations for the health and safety issues defined in the City Development Service’s CEQA *Significant Determination Thresholds* (2011). Assuming continued compliance with regulations, permits, and agreements, the 2020 Master Plan does not present significant impacts to human health and safety, and no mitigation measures are recommended.

Table 4-1. Health and Safety Significance Conclusions			
Issue	Significance Conclusion	Mitigation Measures	Significance after Mitigation
1. Expose people or structures to a significant risk of loss, injury, or death involving wildland fire	Not Significant. SeaWorld is not in an area designated as risk of wildland fires by San Diego County	No mitigation measures are recommended because no significant impact is identified	No significant impact
2. Result in hazardous emissions or handle hazardous or acutely hazardous materials, substances, or waste within a quarter-mile of an existing or proposed school?	Not Significant. Hazardous materials are handled as specified in the Hazardous Materials Business Plan and Emergency Contingency Plan and there are no schools within a quarter-mile	No mitigation measures are recommended because no significant impact is identified	No significant impact
3. Impair implementation of, or physically interfere with an adopted emergency response plan or emergency evacuation plan	Not Significant. SeaWorld is included in and complies with the San Diego County OA EOP	No mitigation measures are recommended because no significant impact is identified	No significant impact

Table 4-1. Health and Safety Significance Conclusions

Issue	Significance Conclusion	Mitigation Measures	Significance after Mitigation
4. Be located on a site which is included on a list of hazardous materials sites compiled pursuant to Government Code Section 65962.5 and, as a result, create a significant hazard to the public or environment.	Not Significant. Ongoing required compliance with state and federal regulations, permits, leasehold agreements, and applicable land use plans will protect workers and the general public from potential risk of exposure and releases of hazardous wastes/materials to the environment.	No mitigation measures are recommended because no significant impact is identified	No significant impact
5. Expose people to toxic substances, such as pesticides and herbicides applied to the soil during previous agricultural uses	Not Significant. The area has never been used for agricultural purposes and current landscaping products are used in compliance with the Hazardous Materials Business Plan and Emergency Contingency Plan	No mitigation measures are recommended because no significant impact is identified	No significant impact
6. Result in a safety hazard for people residing or working in a designated AIA	Not Significant. SeaWorld is not within an AIA	No mitigation measures are recommended because no significant impact is identified	No significant impact
7. Result in a safety hazard for people residing or working within 2 miles of a private airstrip or a private airport or heliport facility that is not covered by an adopted ALUCP	Not Significant. SeaWorld is not within 2 miles of a private air transportation facility	No mitigation measures are recommended because no significant impact is identified	No significant impact

Section 5

Limitations

This document was prepared solely for SeaWorld in accordance with professional standards at the time the services were performed and in accordance with the contract between SeaWorld and Brown and Caldwell dated September 10, 2019. This document is governed by the specific scope of work authorized by SeaWorld; it is not intended to be relied upon by any other party except for regulatory authorities contemplated by the scope of work. We have relied on information or instructions provided by SeaWorld and other parties and, unless otherwise expressly indicated, have made no independent investigation as to the validity, completeness, or accuracy of such information.

This document sets forth the results of certain services performed by Brown and Caldwell with respect to the property or facilities described therein (the Property). SeaWorld recognizes and acknowledges that these services were designed and performed within various limitations, including budget and time constraints. These services were not designed or intended to determine the existence and nature of all possible environmental risks (which term shall include the presence or suspected or potential presence of any hazardous waste or hazardous substance, as defined under any applicable law or regulation, or any other actual or potential environmental problems or liabilities) affecting the Property. The nature of environmental risks is such that no amount of additional inspection and testing could determine as a matter of certainty that all environmental risks affecting the Property had been identified. Accordingly, THIS DOCUMENT DOES NOT PURPORT TO DESCRIBE ALL ENVIRONMENTAL RISKS AFFECTING THE PROPERTY, NOR WILL ANY ADDITIONAL TESTING OR INSPECTION RECOMMENDED OR OTHERWISE REFERRED TO IN THIS DOCUMENT NECESSARILY IDENTIFY ALL ENVIRONMENTAL RISKS AFFECTING THE PROPERTY.

Further, Brown and Caldwell makes no warranties, express or implied, with respect to this document, except for those, if any, contained in the agreement pursuant to which the document was prepared. All data, drawings, documents, or information contained this report have been prepared exclusively for the person or entity to whom it was addressed and may not be relied upon by any other person or entity without the prior written consent of Brown and Caldwell unless otherwise provided by the Agreement pursuant to which these services were provided.

Section 6

References

Brown and Caldwell. 2006. Report of Waste Discharge - Aerial Fireworks Show. October.

_____. 2007a. Air Quality Dispersion Modeling Analysis of Chemical Residues from the Fireworks Displays at SeaWorld of San Diego (SeaWorld), California. November.

_____. 2007b. Response to Comments – Application for an Amendment to Order No. R9-2005-0091 (NPDES No. CAD0107336) for Discharges Related to SeaWorld's Fireworks Program. January.

_____. 2009. SeaWorld Aerial Fireworks Displays 2008 Report. March.

_____. 2010a. SeaWorld Aerial Fireworks Displays 2009 Annual Report and 2010 Work Plan. January.

_____. 2010b. SeaWorld Aerial Fireworks displays NPDES Permit Addendum Summary Report. June.

_____. 2010c. Addendum to the *SeaWorld Aerial Fireworks Displays NPDES Permit Summary Report*, Addendum No. 1 to Order No. R9-2005-0091, NPDES No. CA0107336. July.

_____. 2011a. Fireworks Monitoring and Reporting Work Plan. November 30.

_____. 2011b. Sampling and Analysis Plan and Quality Assurance Project Plan. November 30.

_____. 2013a. 2012 Annual Fireworks Monitoring Report. January 2013.

_____. 2013b. 2013 Annual Fireworks Monitoring Report. December 2013.

_____. 2014. 2014 Annual Fireworks Monitoring Report. December 2014.

_____. 2015. 2015 Annual Fireworks Monitoring Report. December 2015.

_____. 2017. 2016 Annual Fireworks Monitoring Report. January 2017.

_____. 2018. 2017 Annual Fireworks Monitoring Report. January 2018.

_____. 2018. 2018 Annual Water Quality Monitoring and Site Condition Certification Report. October 2018.

City Development Services Department 2011. California Environmental Quality Act Significant Determination Thresholds. January 2011.

_____. 1995. *Postclosure Land Use Plan for Mission Bay South Shores Phase 3*, Landfill Facility No. 37-AA-0026. October 1995.

GeoSyntec Consultants 2018. October 2017-September 2018 Annual Monitoring Report Water Quality Monitoring Program, Mission Bay Landfill, San Diego, California. October 2018.

SAIC. 2001. SeaWorld San Diego Fireworks, Baseline Study. San Diego, California. October

_____. 2002. Impacts from SeaWorld San Diego Fireworks Displays to Mission Bay Sediment and Water Quality: Year 1 Monitoring, Final Report, San Diego, California. December.

_____. 2003. Impacts from SeaWorld San Diego Fireworks Displays to Mission Bay Sediment and Water Quality: Year 2 Monitoring, Final Report, San Diego, California. December.

_____. 2004. Impacts from SeaWorld San Diego Fireworks Displays to Mission Bay Sediment and Water Quality: Year 1 Monitoring, Final Report, San Diego, California. December.

SeaWorld 2001. *Environmental Impact Report: SeaWorld Master Plan Update*. May 31, 2001.

_____. 2019. *SeaWorld Hazardous Materials Business Plan and Emergency Contingency Plan*. March 5, 2019.

Appendix A: Hazardous Material Business Plan and Emergency Contingency Plan



SEAWORLD (CERSID: 10383472)**Facility Information** **Submitted Mar 5, 2019**

Submitted on 3/5/2019 8:50:41 AM by *Shari Sehlhorst* of SEAWORLD (SAN DIEGO, CA)

- Business Activities
- Business Owner/Operator Identification
- Locally-Required Documentation
 - *2019 Medical Waste Plan* (Adobe PDF, 211KB)

Hazardous Materials Inventory **Submitted Mar 5, 2019**

Submitted on 3/5/2019 8:50:41 AM by *Shari Sehlhorst* of SEAWORLD (SAN DIEGO, CA)

- Hazardous Material Inventory (87)
- Site Map (Official Use Only)
 - *Annotated Site Map (Official Use Only)* (Adobe PDF, 2484KB)
- Locally-Required Documentation
 - *Prop 65 listing* (Adobe PDF, 542KB)

Site Identification

SEAWORLD

1720 S SHORES RD
SAN DIEGO, CA 92109

County
San Diego

CERS ID
10383472

EPA ID Number
CAD981687221

Submittal Status

Submitted on 3/5/2019 by *Shari Sehlhorst* of SEAWORLD (SAN DIEGO, CA)

Hazardous Materials

Does your facility have on site (for any purpose) at any one time, hazardous materials at or above 55 gallons for liquids, 500 pounds for solids, or 200 cubic feet for compressed gases (include liquids in ASTs and USTs); or is regulated under more restrictive inventory local reporting requirements (shown below if present); or the applicable Federal threshold quantity for an extremely hazardous substance specified in 40 CFR Part 355, Appendix A or B; or handle radiological materials in quantities for which an emergency plan is required pursuant to 10 CFR Parts 30, 40 or 70?

Yes

Underground Storage Tank(s) (UST)

Does your facility own or operate underground storage tanks?

Yes

Hazardous Waste

Is your facility a Hazardous Waste Generator?

Yes

Does your facility treat hazardous waste on-site?

No

Is your facility's treatment subject to financial assurance requirements (for Permit by Rule and Conditional Authorization)?

No

Does your facility consolidate hazardous waste generated at a remote site?

No

Does your facility need to report the closure/removal of a tank that was classified as hazardous waste and cleaned on-site?

No

Does your facility generate in any single calendar month 1,000 kilograms (kg) (2,200 pounds) or more of federal RCRA hazardous waste, or generate in any single calendar month, or accumulate at any time, 1 kg (2.2 pounds) of RCRA acute hazardous waste; or generate or accumulate at any time more than 100 kg (220 pounds) of spill cleanup materials contaminated with RCRA acute hazardous waste.

No

Is your facility a Household Hazardous Waste (HHW) Collection site?

No

Excluded and/or Exempted Materials

Does your facility recycle more than 100 kg/month of excluded or exempted recyclable materials (per HSC 25143.2)?

No

Does your facility own or operate ASTs above these thresholds? Store greater than 1,320 gallons of petroleum products (new or used) in aboveground tanks or containers.

Yes

Does your facility have Regulated Substances stored onsite in quantities greater than the threshold quantities established by the California Accidental Release prevention Program (CalARP)?

No

Additional Information

No additional comments provided.

Facility/Site**SEAWORLD**

1720 S SHORES RD
SAN DIEGO, CA 92109

CERS ID
10383472

Submittal Status

Submitted on 3/5/2019 by *Shari Sehlhorst* of SEAWORLD (SAN DIEGO, CA)

Identification

SEA WORLD LLC

Operator Phone
(619) 222-6363

Business Phone
(619) 222-6363

Business Fax
(619) 226-3996

Beginning Date

Ending Date

Dun & Bradstreet

SIC Code
7996

Primary NAICS
713110

Facility/Site Mailing Address

500 SEA WORLD DR
SAN DIEGO, CA 92109-7994

Primary Emergency Contact

STEVE MELANESE

Title

OPERATIONS - SENIOR LEADER

Business Phone
(619) 226-3841

24-Hour Phone
(858) 243-9020

Pager Number

Owner

SeaWorld LLC
(619) 225-3219
500 Sea World Drive
San Diego, CA 92109

Secondary Emergency Contact

MATT HUDSON

Title

Plant Maintenance Leader

Business Phone
(619) 438-5934

24-Hour Phone
(619) 226-3988

Pager Number

Billing Contact

ATTN: CLAUDIA CASTRO-GUERRERO
6192226363x3667
500 SEA WORLD DR
SAN DIEGO, CA 92109-7994

Environmental Contact

SHARI SEHLHORST

(619) 226-3637

shari.sehlhorst@seaworld.com

500 SEA WORLD DR

SAN DIEGO, CA 92109

Name of Signer

Shari Sehlhorst

Additional Information

Signer Title

Environmental Leader

Document Preparer

Shari Sehlhorst

Locally-collected Fields

Some or all of the following fields may be required by your local regulator(s).

Property Owner

City of San Diego

Phone

Mailing Address

, 00000

Assessor Parcel Number (APN)

435-480-15-00

Number of Employees

Facility ID

37-000-100905

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD		Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	WASTE ABSORBENT PAD W/ FORMALIN	Pounds	80	80	2	227	- Physical Flammable - Health Carcinogenicity - Health Acute Toxicity - Health Skin Corrosion Irritation - Health Respiratory Skin Sensitization - Health Serious Eye Damage Eye Irritation - Health Specific Target Organ Toxicity - Health Germ Cell Mutagenicity - Health Hazard Not Otherwise Classified			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>				
		Solid	Box		Ambient	352				
		<u>Type</u>			<u>Temperature</u>					
		Waste	Days on Site: 365		Ambient					
DOT: 8 - Corrosives (Liquids and Solids)	WASTE HYDROCHLORIC ACID/CORROSIVES	Pounds	26	5		26	- Physical Corrosive To Metal - Health Acute Toxicity - Health Hazard Not Otherwise Classified			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>				
		Liquid	Plastic/Non-metalic Drum		Ambient	791				
		<u>Type</u>			<u>Temperature</u>					
		Waste	Days on Site: 365		Ambient					
	WASTE OILY ABSORBENT	Pounds	587	500	400	2000	- Health Acute Toxicity - Health Skin Corrosion Irritation - Health Serious Eye Damage Eye Irritation - Health Hazard Not Otherwise Classified			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>				
		Solid	Steel Drum		Ambient	352				
		<u>Type</u>			<u>Temperature</u>					
		Waste	Days on Site: 365		Ambient					

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD		Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	WASTE 311 PHARMACEUTICAL WASTE	Gallons	15	30		60	- Physical Hazard			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Not Otherwise Classified			
		<u>Solid</u>	Plastic/Non-metalic Drum		<u>Ambient</u>	311	- Health Hazard			
		<u>Type</u>			<u>Temperature</u>		Not Otherwise Classified			
		<u>Waste</u>	Days on Site: 365		<u>Ambient</u>					
DOT: 4.1 - Flammable Solids	LACQUER THINNER & RAGS	Gallons	15	5	5	15	- Physical	ETHYL ACETATE		141-78-6
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable	METHYL ETHYL KETONE	5 %	78-93-3
Flammable Liquid, Class I-A	NA	<u>Liquid</u>	Steel Drum		<u>Ambient</u>	212	- Health Acute	2-BUTOXY ETHANOL	1 %	111-76-2
		<u>Type</u>			<u>Temperature</u>		Toxicity	TOLUENE	5 %	108-88-3
		<u>Waste</u>	Days on Site: 365		<u>Ambient</u>		- Health Skin	ACETONE	5 %	67-64-1
							Corrosion			
							Irritation			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health Hazard			
							Not Otherwise Classified			
DOT: 3 - Flammable and Combustible Liquids	WASTE MOTOR OIL	Gallons	170	55	55	3464	- Physical	VARIOUS LUBRICATING BASE OILS	85 %	6474X-XX-X
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
		<u>Liquid</u>	Steel Drum		<u>Ambient</u>	221	- Health Acute	ADDITIVE PACKAGE, INCLUDING	15 %	MIXTURE
Combustible Liquid, Class III-B		<u>Type</u>			<u>Temperature</u>		Toxicity	ZINC ALKYL DITHIOPHOSPHATE	2 %	68649-42-3
		<u>Waste</u>	Days on Site: 365		<u>Ambient</u>		- Health Skin			
							Corrosion			
							Irritation			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health Hazard			
							Not Otherwise Classified			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD		Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

CERS ID **10383472**
Facility ID **37-000-100905**
Status **Submitted** on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
DOT: 4.1 - Flammable Solids	WASTE FUEL & OIL FILTERS <u>CAS No</u>	Pounds	20	15	10	400	- Physical			
		<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
		Solid	Steel Drum		Ambient	221	- Health			
		<u>Type</u>			<u>Temperature</u>		Carcinogenicity			
		Waste	Days on Site: 365		Ambient		- Health Acute			
							Toxicity			
							- Health			
							Reproductive			
							Toxicity			
							- Health Skin			
DOT: 3 - Flammable and Combustible Liquids	WASTE - ExCell Plus <u>CAS No</u>	Gallons	15	15	5	400	- Physical	Glyoxal	25 %	107-22-2
		<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
		Liquid	Plastic/Non-metalic Drum		Ambient	331	- Health	Ethanediol	10 %	107-21-1
		<u>Type</u>			<u>Temperature</u>		Carcinogenicity	Ethanol	10 %	64-17-5
		Waste	Days on Site: 365		Ambient		- Health Acute			
							Toxicity			
							- Health Skin			
							Corrosion			
							Irritation			
							- Health			
					Respiratory Skin					
					Sensitization					
					- Health Serious					
					Eye Damage					
					Irritation					
					- Health Germ					
					Cell Mutagenicity					
					- Health Hazard					
					Not Otherwise					
					Classified					

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	Culinary Beer locations	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109	(SWR/PP/Frycones/Calypso/Cafe64)	Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
DOT: 2.1 - Flammable Gases	Culinary Dewars 60% Nitrogen/40% CO2	Cu. Feet	4000	600	4000		- Physical	Liquid Nitrogen	60 %	7727-37-9
Cryogen		<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable	Carbon Dioxide	40 %	124-38-9
		<u>Gas</u>	Cylinder		< Ambient		- Physical Gas			
	<u>CAS No</u>	<u>Type</u>			<u>Temperature</u>		Under Pressure			
		Mixture	Days on Site: 365		Ambient		- Physical			
							Explosive			
							- Physical Hazard			
							Not Otherwise Classified			
							- Health Skin			
							Corrosion			
							Irritation			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health Simple			
							Asphyxiant			
							- Health Hazard			
							Not Otherwise Classified			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	Energy Systems	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	CAS No.
DOT: 3 - Flammable and Combustible Liquids	WASTE - Ethylene Glycol	Gallons	55	55	55	220	- Physical	Ethylene glycol	95 %	107-21-1
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressure</u>		Flammable			
Combustible Liquid, Class II		Liquid	Steel Drum		Ambient	<u>Waste Code</u>	- Health Skin	Diethylene glycol	4 %	111-46-6
		<u>Type</u>			<u>Temperature</u>	343	Corrosion	Dipotassium phosphate	1 %	7758-11-4
		Waste	Days on Site: 365		Ambient		Irritation			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health Hazard			
							Not Otherwise			
							Classified			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org. SEAWORLD		Chemical Location				CERS ID 10383472							
Facility Name SEAWORLD		Energy Systems Cogen Building				Facility ID 37-000-100905							
1720 S SHORES RD, SAN DIEGO 92109						Status Submitted on 3/5/2019 8:50 AM							
						Annual Waste		Hazardous Components					
								(For mixture only)					
DOT Code/Fire Haz. Class		Common Name		Unit	Quantities		Federal Hazard						
					Max. Daily		Largest Cont.	Avg. Daily	Amount	Categories	Component Name	% Wt	EHS CAS No.
DOT: 2.2 - Nonflammable Gases		Chlorodifluoromethane (R-22)		Cu. Feet	1500		250		1000	- Physical Gas			
		<u>CAS No</u>		<u>State</u>		<u>Storage Container</u>		<u>Pressue</u>		<u>Waste Code</u>		Under Pressure	
		75-45-6		Gas		Cylinder		> Ambient		- Physical			
				<u>Type</u>				<u>Temperature</u>		Explosive			
				Pure		Days on Site: 365		Ambient					

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	Explorers Reef LSS Yard	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
DOT: 4.1 - Flammable Solids	WASTE - Activated Carbon	Pounds	350	55	55	2000	- Physical			
Flammable Solid	CAS No 7440-44-0	State Solid	Storage Container Steel Drum		Pressue Ambient	Waste Code 351	Flammable - Physical Hazard Not Otherwise Classified - Health Serious Eye Damage Eye Irritation - Health Hazard Not Otherwise Classified			
		Type Waste	Days on Site: 365		Temperature Ambient					

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	Landscape Nursery Yard	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)			
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS	CAS No.
	X-Cote 43-0-0	Pounds	2000	50	50		- Health Skin	Urea			57-13-6
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Corrosion	Sulfur			7704-34-9
		<u>Solid</u>	<u>Bag</u>		<u>Ambient</u>		Irritation	Polymer Coating			
		<u>Type</u>			<u>Temperature</u>		- Health Serious	Wax (paraffins-petroleum)			64771-72-8
		<u>Mixture</u>			<u>Ambient</u>		Eye Damage Eye Irritation				

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	Lunar Fest. Popcorn Gazebo/Seven Seas French Arctic Area	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
DOT: 2.2 - Nonflammable Gases	Nitrogen	Cu. Feet	3635	3635	3635			- Physical Gas		
Cryogen	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		Under Pressure		
	7727-37-9	Gas	Cylinder		> Ambient			- Physical Hazard		
		<u>Type</u>			<u>Temperature</u>			Not Otherwise Classified		
		Pure	Days on Site: 60		Cryogenic			- Health Skin Corrosion Irritation		
								- Health Simple Asphyxiant		
								- Health Hazard		
								Not Otherwise Classified		

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE MAP NEAR SHAMU STADIUM	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)			
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS	CAS No.
	CAUSTIC SODA 25%	Gallons	275	275	275		- Physical	Sodium Hydroxide	25 %		1310-73-2
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Corrosive To	Water	75 %		7732-18-5
	1310-73-2	Liquid	Aboveground Tank		Ambient		Metal				
		<u>Type</u>			<u>Temperature</u>		- Health Acute				
		Mixture	Days on Site: 365		Ambient		Toxicity				
							- Health Skin				
							Corrosion				
							Irritation				
							- Health				
							Respiratory Skin				
							Sensitization				
							- Health Serious				
							Eye Damage				
							Eye Irritation				

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	See Site Map	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	NEPTUNE'S HARVEST	Pounds	45	45				- Health Acute		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		Toxicity		
		<u>Liquid</u>	Plastic/Non-metalic Drum					- Health		
		<u>Type</u>			<u>Temperature</u>			Respiratory Skin		
		<u>Mixture</u>						Sensitization		

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	SILICA SAND (WATER FILTERS)	Tons	50000	24	50000		- Health			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Carcinogenicity			
	14808-60-7	Solid	Other		Ambient		- Health Acute			
		<u>Type</u>			<u>Temperature</u>		Toxicity			
		Pure	Days on Site: 365		Ambient		- Health			
							Respiratory Skin Sensitization			
							- Health Serious			
							Eye Damage Eye Irritation			
							- Health Specific			
							Target Organ			
							Toxicity			
							- Health Simple			
							Asphyxiant			
							- Health Hazard			
							Not Otherwise Classified			
DOT: 2.1 - Flammable Gases	ACETYLENE, C2H2, 99%,	Cu. Feet	1050	120	600		- Physical			
Unstable (Reactive), Class 2, Flammable Gas	COMPRESSED GAS :	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
	<u>CAS No</u>	Gas	Cylinder		> Ambient		- Physical Gas			
	74-86-2	<u>Type</u>			<u>Temperature</u>		Under Pressure			
		Pure	Days on Site: 365		Ambient		- Physical			
							Explosive			
							- Health Specific			
							Target Organ			
							Toxicity			
							- Health Simple			
							Asphyxiant			
DOT: 2.1 - Flammable Gases	PROPANE, LIQUIFIED PETROLEUM	Gallons	3500	1500	3500		- Physical			
Flammable Gas	COMPRESSED GAS :	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
	<u>CAS No</u>	Liquid	Aboveground Tank		> Ambient		- Physical Gas			
	74-98-6	<u>Type</u>			<u>Temperature</u>		Under Pressure			
		Mixture	Days on Site: 365		Ambient		- Physical			
							Explosive			
							- Health Simple			
							Asphyxiant			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD				Chemical Location	CERS ID	10383472			
Facility Name	SEAWORLD				SEE SITE MAP	Facility ID	37-000-100905			
	1720 S SHORES RD, SAN DIEGO 92109					Status	Submitted on 3/5/2019 8:50 AM			
						Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
DOT Code/Fire Haz. Class	Common Name	Unit	Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
DOT: 2.3 - Toxic Gases	MURIATIC/HYDROCHLORIC ACID	Gallons	1150	550	1150		- Physical Oxidizer			
Corrosive, Water Reactive, Class 2	31%	State	Storage Container		Pressue	Waste Code	- Physical			
	CAS No	Liquid	Aboveground Tank		Ambient		Pyrophoric Gas			
	7647-01-0	Type			Temperature		- Physical			
		Mixture	Days on Site: 365		Ambient		Corrosive To Metal			
							- Health Skin Corrosion			
							Irritation			
							- Health Respiratory Skin Sensitization			
							- Health Serious Eye Damage Eye Irritation			
							- Health Hazard Not Otherwise Classified			
							- Health Acute Toxicity			
	QWIK DRESS / TIRE DETAILER	Gallons	55	55	1		- Health Skin Corrosion			
	CAS No	State	Storage Container		Pressue	Waste Code	Irritation			
	63148-62-9	Liquid	Steel Drum		Ambient		- Health Serious Eye Damage Eye Irritation			
		Type			Temperature		- Health Aspiration Hazard			
		Pure	Days on Site: 365		Ambient					
DOT: 8 - Corrosives (Liquids and Solids)	SULFURIC ACID, 36%, H2SO4	Pounds	6400	1600	1000		- Health Carcinogenicity			
Corrosive, Water Reactive, Class 2, Toxic, Oxidizing, Class 1	CAS No	State	Storage Container		Pressue	Waste Code	- Health Skin Corrosion			
	7664-93-9	Liquid	Aboveground Tank		Ambient		Irritation			
		Type			Temperature		- Health Serious Eye Damage Eye Irritation			
		Pure	Days on Site: 365		Ambient		- Health Hazard Not Otherwise Classified			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org. SEAWORLD	Chemical Location	CERS ID 10383472
Facility Name SEAWORLD	SEE SITE MAP	Facility ID 37-000-100905
1720 S SHORES RD, SAN DIEGO 92109		Status Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	SPRAY NINE	Gallons	55	55	2		- Health Acute	2-butoxyethanol	3 %	111-76-2
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Toxicity	Ethoxylated C9-C11 Alcohols	3 %	68439-46-3
	MIXTURE	Liquid	Plastic/Non-metalic Drum		Ambient		- Health Skin			
		<u>Type</u>			<u>Temperature</u>		Corrosion			
		Mixture	Days on Site: 365		Ambient		Irritation			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health Hazard			
							Not Otherwise			
							Classified			
DOT: 8 - Corrosives (Liquids and Solids)	SODIUM HYPOCHLORITE, NAOCL, 13% : LIQUID POOL CHLORINE	Gallons	12000	2500	8000		- Physical Oxidizer			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	- Physical			
Corrosive, Oxidizing, Class 2	7681-52-9	Liquid	Aboveground Tank		Ambient		Corrosive To			
		<u>Type</u>			<u>Temperature</u>		Metal			
		Pure	Days on Site: 365		Ambient		- Health Acute			
							Toxicity			
							- Health Skin			
							Corrosion			
							Irritation			
							- Health			
							Respiratory Skin			
							Sensitization			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health Hazard			
							Not Otherwise			
							Classified			
DOT: 3 - Flammable and Combustible Liquids	UNLEADED GASOLINE	Gallons	11000	10000	1000		- Physical			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
Flammable Liquid, Class I-B	8006-61-9	Liquid	Belowground Tank		Ambient		- Health			
		<u>Type</u>			<u>Temperature</u>		Carcinogenicity			
		Pure	Days on Site: 365		Ambient		- Health Skin			
							Corrosion			
							Irritation			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health			
							Aspiration Hazard			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	WASTE METHANOL WATER SOLUTION	Pounds	450	450		1100	- Physical			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
		Liquid	Tank Inside Building, Steel Drum		Ambient	343	- Physical Hazard			
		<u>Type</u>			<u>Temperature</u>		Not Otherwise Classified			
		Waste	Days on Site: 365		Ambient		- Health Acute Toxicity			
							- Health Serious Eye Damage Eye Irritation			
							- Health Hazard Not Otherwise Classified			
DOT: 6.1 - Toxic Substances	WAX ELIMINATOR	Gallons	55	1	2		- Physical Hazard			
Toxic, Combustible Liquid, Class III-B	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Not Otherwise Classified			
	111-76-2	Liquid	Plastic Bottle or Jug		Ambient		- Health Acute Toxicity			
		<u>Type</u>			<u>Temperature</u>		- Health Skin Corrosion Irritation			
		Mixture	Days on Site: 365		Ambient		- Health Serious Eye Damage Eye Irritation			
	CALCIUM HYPOCHLORITE ACUTAB	Pounds	1000	50	500		- Physical Oxidizer	Calcium Hypchlorite	66 %	778-54-3
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		Calcium Chlorate	2 %	10137-74-3
	MIXTURE	Solid	Plastic/Non-metalic Drum		Ambient		- Physical	Calcium Carbonate	2 %	471-34-1
		<u>Type</u>			<u>Temperature</u>		Corrosive To Metal	Calcium Hydroxide	2 %	1305-62-0
		Mixture	Days on Site: 365		Ambient		- Health Skin Corrosion Irritation	Magnesium	0 %	7439-95-4
							- Health Respiratory Skin Sensitization			
							- Health Serious Eye Damage Eye Irritation			
DOT: 8 - Corrosives (Liquids and Solids)	ACID, TRIDENT 6026 (WATER TREATMENT)	Gallons	600	200	30		- Physical			
Corrosive	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Corrosive To Metal			
	2809-21-4	Liquid	Aboveground Tank		Ambient		- Health Acute Toxicity			
		<u>Type</u>			<u>Temperature</u>		- Health Skin Corrosion Irritation			
		Pure	Days on Site: 365		Ambient					

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	SODIUM THIOSULFATE	Pounds	2500	50	1500		- Physical			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Explosive			
	10102-17-7	Solid	Bag		Ambient		- Physical			
		<u>Type</u>			<u>Temperature</u>		SelfReactive			
		Pure	Days on Site: 365		Ambient		- Health			
							Respiratory Skin Sensitization			
DOT: 3 - Flammable and Combustible Liquids	WASTE - PAINT LIQUIDS	Gallons	280	55	1	1000	- Physical			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
		Liquid	Steel Drum		Ambient		- Health Acute			
		<u>Type</u>			<u>Temperature</u>	141	Toxicity			
		Waste	Days on Site: 365		Ambient		- Health Skin			
							Corrosion			
							Irritation			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health			
							Aspiration Hazard			
							- Health Hazard			
							Not Otherwise Classified			
DOT: 3 - Flammable and Combustible Liquids	Diesel Fuel	Gallons	2000	2000	1160		- Physical			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
	68476-34-6	Liquid	Aboveground Tank		Ambient		- Health			
Combustible Liquid, Class II		<u>Type</u>			<u>Temperature</u>		Carcinogenicity			
		Pure	Days on Site: 365		Ambient		- Health Acute			
							Toxicity			
							- Health Skin			
							Corrosion			
							Irritation			
							- Health			
							Respiratory Skin Sensitization			
							- Health Specific			
							Target Organ			
							Toxicity			
							- Health			
							Aspiration Hazard			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
DOT: 3 - Flammable and Combustible Liquids	ETHANOL, FOODSERVICE JOY	Gallons	500	1	80		- Physical Flammable - Health Acute Toxicity - Health Serious Eye Damage Eye Irritation - Health Hazard Not Otherwise Classified			
	CAS No 64-17-5	State Liquid Type Pure	Storage Container Plastic Bottle or Jug		Pressue Ambient Temperature Ambient	Waste Code				
Flammable Liquid, Class I-B			Days on Site: 365							
	STERNO CANNED COOKING FUEL	Gallons	2000	1	1000		- Physical Flammable - Health Acute Toxicity - Health Hazard Not Otherwise Classified	Ethanol t-Butanol	67 % 1 %	64-17-5 75-65-0
	CAS No MIXTURE	State Liquid Type Mixture	Storage Container Can		Pressue Ambient Temperature Ambient	Waste Code				
			Days on Site: 365							
	KENDALL MOTOR OILS VARIOUS WEIGHTS	Gallons	350	55	40		- Health Acute Toxicity - Health Skin Corrosion Irritation - Health Serious Eye Damage Eye Irritation - Health Hazard Not Otherwise Classified	Lubricant Base (Petroleum) Additives	70 % 30 %	none given none given
	CAS No	State Liquid Type Mixture	Storage Container Steel Drum		Pressue Ambient Temperature Ambient	Waste Code				
			Days on Site: 365							
DOT: 6.2 - Infectious Substances	WASTE SHARPS	Pounds	10	10		100	- Physical Hazard Not Otherwise Classified - Health Acute Toxicity - Health Hazard Not Otherwise Classified			
	CAS No	State Solid Type Waste	Storage Container Box		Pressue Ambient Temperature Ambient	Waste Code 352				
			Days on Site: 365							
DOT: 3 - Flammable and Combustible Liquids	Fullsan	Gallons	220	55	55		- Health Acute Toxicity - Health Skin Corrosion Irritation - Health Serious Eye Damage Eye Irritation			
	CAS No 9016-45-9	State Liquid Type Mixture	Storage Container Plastic/Non-metalic Drum		Pressue Ambient Temperature Ambient	Waste Code				
Combustible Liquid, Class III-B			Days on Site: 365							

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	ASSORTED URETHANES	Gallons	170	1	85		- Physical	ACETONE	89 %	67-64-1
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable	2,4-PENTANEDIONE		123-54-6
	MIXTURE	Liquid	Can		Ambient		- Physical Hazard			
		<u>Type</u>			<u>Temperature</u>		Not Otherwise Classified			
		Mixture	Days on Site: 365		Ambient		- Health			
							Carcinogenicity			
							- Health Acute			
							Toxicity			
							- Health Skin			
							Corrosion			
							Irritation			
							- Health			
							Respiratory Skin			
							Sensitization			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health Specific			
							Target Organ			
							Toxicity			
							- Health Hazard			
							Not Otherwise Classified			
	RED-E-CRETE, PORTLAND CEMENT	Pounds	1300	50	400		- Health	Sand, Silica, Quartz	50 %	14808-60-7
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Carcinogenicity	Portland Cement	30 %	65997-15-1
	65977-15-1	Solid	Bag		Ambient		- Health Skin	Lime	10 %	01305-62-0
		<u>Type</u>			<u>Temperature</u>		Corrosion	Pulverized Limestone	10 %	01317-65-3
		Mixture	Days on Site: 365		Ambient		Irritation			
							- Health			
							Respiratory Skin			
							Sensitization			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health Specific			
							Target Organ			
							Toxicity			
	LATEX PAINT	Gallons	700	5	700		- Physical Hazard	Ethylene Glycol	2 %	107-21-1
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Not Otherwise Classified	Quartz	10 %	14808-60-7
	MIXTURE	Liquid	Can		Ambient		Classified	Cristobalite	1 %	14464-46-1
		<u>Type</u>			<u>Temperature</u>		- Health	Titanium Dioxide	14 %	13463-67-7
		Mixture	Days on Site: 365		Ambient		Carcinogenicity	Zinc Oxide	2 %	1314-13-2
							- Health Hazard			
							Not Otherwise Classified			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location					CERS ID	10383472		
Facility Name	SEAWORLD	SEE SITE MAP					Facility ID	37-000-100905		
1720 S SHORES RD, SAN DIEGO 92109							Status	Submitted on 3/5/2019 8:50 AM		
DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	OZZYJUICE SW-3 TRUCK DEGREASING SOLIN CAS No NA	Gallons State Liquid Type Pure	100 Storage Container Plastic/Non-metalic Drum Days on Site: 365	50	5 Pressue Ambient Temperature Ambient	Waste Code	- Health Acute Toxicity - Health Skin Corrosion Irritation	Proprietary microbial organisms		none given
	MISSION OVEN CLEANER CAS No MIXTURE	Gallons State Liquid Type Mixture	260 Storage Container Plastic Bottle or Jug Days on Site: 365	5	75 Pressue Ambient Temperature Ambient	Waste Code	- Health Acute Toxicity - Health Skin Corrosion Irritation - Health Serious Eye Damage Eye Irritation - Health Hazard Not Otherwise Classified	2-Butoxy Ethanol Sodium Hydroxide		111-76-2 1310-73-2
	SHOW-N-GO CAR SOAP CAS No	Gallons State Liquid Type Mixture	55 Storage Container Plastic/Non-metalic Drum Days on Site: 365	55	40 Pressue Ambient Temperature Ambient	Waste Code	- Health Skin Corrosion Irritation - Health Hazard Not Otherwise Classified			
	PAINT-ASSORTED ENAMELS AND ACRYLICS CAS No MIXTURE	Gallons State Liquid Type Mixture	100 Storage Container Can Days on Site: 365	5	50 Pressue Ambient Temperature Ambient	Waste Code	- Physical Flammable - Physical Hazard Not Otherwise Classified - Health Acute Toxicity - Health Skin Corrosion Irritation - Health Serious Eye Damage Eye Irritation - Health Hazard Not Otherwise Classified	2-Methoxymethylethoxypropanol Calcium Carbonate	4 % 17 %	34590-94-8 471-34-1
	DEXRON II AUTOMATIC TRANSMISSION FLUID CAS No	Gallons State Liquid Type Mixture	95 Storage Container Steel Drum Days on Site: 365	55	40 Pressue Ambient Temperature Ambient	Waste Code	- Health Skin Corrosion Irritation - Health Serious Eye Damage Eye Irritation	Petroleum, Solvent Refined Light Paraffinic Distillate Petroleum, Solvent Refined Heavy Paraffinic Distillate Anti-Oxidant, Anti-Wear Dispersant Viscosity Improver Dye	87 % 87 % 10 % 4 % 1 %	64741-89-5 64741-88-4 989944-87-4 989930-13-2 989915-93-4

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location					CERS ID	10383472		
Facility Name	SEAWORLD	SEE SITE MAP					Facility ID	37-000-100905		
	1720 S SHORES RD, SAN DIEGO 92109						Status	Submitted on 3/5/2019 8:50 AM		
			Quantities			Annual Waste	Federal Hazard	Hazardous Components (For mixture only)		
DOT Code/Fire Haz. Class	Common Name	Unit	Max. Daily	Largest Cont.	Avg. Daily	Amount	Categories	Component Name	% Wt	EHS CAS No.
DOT: 3 - Flammable and Combustible Liquids	WASTE, GAS, DIESEL, LPG	Gallons	100	55		220	- Physical			
		State	Storage Container		Pressue		Flammable			
	CAS No	Liquid	Steel Drum		Ambient	Waste Code	- Health			
		Type			Temperature	331	Carcinogenicity			
		Waste	Days on Site: 365		Ambient		- Health Acute			
							Toxicity			
							- Health			
							Reproductive			
							Toxicity			
							- Health Skin			
							Corrosion			
							Irritation			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health Germ			
							Cell Mutagenicity			
							- Health Hazard			
							Not Otherwise			
							Classified			
	BUBBLE MASTER 2000 PREMIUM FLUID	Gallons	440	55	440		- Health Skin	Anionic/Non-ionic surfacant blend		none given
		State	Storage Container		Pressue	Waste Code	Corrosion			
	CAS No	Liquid	Plastic/Non-metalic Drum		Ambient		Irritation			
		Type			Temperature		- Health Serious			
	MIXTURE	Mixture	Days on Site: 365		Ambient		Eye Damage Eye			
							Irritation			
							- Health Hazard			
							Not Otherwise			
							Classified			
	CLEAN BY PEROXY	Gallons	75	1	40		- Physical Hazard	Alcohol ethoxylate	5 %	34398-01-1
		State	Storage Container		Pressue	Waste Code	Not Otherwise	Hydrogen Peroxide	5 %	7722-84-1
	CAS No	Liquid	Plastic Bottle or Jug		Ambient		Classified	Quaternary Amine	5 %	68478-94-4
		Type			Temperature		- Health Skin	Fragerance	1 %	proprietary
	MIXTURE	Mixture	Days on Site: 365		Ambient		Corrosion			
							Irritation			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
	WASTE RED BAG	Pounds	10	10		1000	- Health Acute			
		State	Storage Container		Pressue	Waste Code	Toxicity			
	CAS No	Solid	Bag		Ambient		- Health Hazard			
		Type			Temperature		Not Otherwise			
		Waste	Days on Site: 365		Ambient		Classified			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
DOT: 2.2 - Nonflammable Gases	CARBON DIOXIDE, CO2, 99%, COMPRESSED GAS :	Cu. Feet	6250	400	1200			- Physical Gas Under Pressure		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		- Physical Explosive		
	124-38-9	Gas	Cylinder		> Ambient			- Physical Hazard Not Otherwise Classified		
		<u>Type</u>	Days on Site: 365		<u>Temperature</u>			- Health Skin Corrosion Irritation		
	hydraulic oil	Gallons	3845	55	2845			- Health Simple Asphyxiant		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		- Health Skin Corrosion Irritation		
	8002-05-9	Liquid	Steel Drum		Ambient			- Health Respiratory Skin Sensitization		
		<u>Type</u>	Days on Site: 365		<u>Temperature</u>			- Health Serious Eye Damage Eye Irritation		
DOT: 4.1 - Flammable Solids	WASTE RAGS CONTAMINATED W/SOLVENT	Pounds	450	450		1500		- Health Hazard Not Otherwise Classified		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		- Physical Flammable		
		Solid	Steel Drum		Ambient	352		- Health Acute Toxicity		
		<u>Type</u>	Days on Site: 365		<u>Temperature</u>			- Health Skin Corrosion Irritation		
		Waste			Ambient			- Health Serious Eye Damage Eye Irritation		
								- Health Aspiration Hazard		
								- Health Hazard Not Otherwise Classified		

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location					CERS ID	10383472	
Facility Name	SEAWORLD	SEE SITE MAP					Facility ID	37-000-100905	
1720 S SHORES RD, SAN DIEGO 92109							Status	Submitted on 3/5/2019 8:50 AM	
						Annual Waste Amount	Hazardous Components (For mixture only)		
DOT Code/Fire Haz. Class	Common Name	Unit	Max. Daily	Largest Cont.	Avg. Daily	Federal Hazard Categories	Component Name	% Wt	EHS CAS No.
DOT: 3 - Flammable and Combustible Liquids	ETHYLENE GLYCOL	Gallons	80	55	30	- Health Acute Toxicity	ETHYLENE GLYCOL METHYL ETHER		109-86-4
Combustible Liquid, Class II	CAS No 107-21-1	State Liquid	Storage Container Steel Drum		Pressue Ambient	Waste Code	- Health Specific Target Organ Toxicity		
		Type Mixture	Days on Site: 365		Temperature Ambient				
DOT: 4.1 - Flammable Solids	WASTE PAINT CHIPS & PAINT BOOTH FLTRS (352)(212)	Pounds	297	55	2	1720	- Physical Flammable		
	CAS No	State Solid	Storage Container Steel Drum		Pressue Ambient	Waste Code 181	- Health Carcinogenicity		
		Type Waste	Days on Site: 90		Temperature Ambient		- Health Acute Toxicity		
							- Health Skin Corrosion Irritation		
							- Health Hazard Not Otherwise Classified		
DOT: 2.2 - Nonflammable Gases	ARGON GAS	Cu. Feet	1400	300	700		- Physical Gas Under Pressure		
Cryogen	CAS No 7440-37-1	State Gas	Storage Container Cylinder		Pressue > Ambient	Waste Code	- Health Skin Corrosion Irritation		
		Type Pure	Days on Site: 365		Temperature Ambient		- Health Serious Eye Damage Eye Irritation		
							- Health Aspiration Hazard		
							- Health Simple Asphyxiant		
							- Health Hazard Not Otherwise Classified		
DOT: 3 - Flammable and Combustible Liquids	PROPYLENE GLYCOL	Gallons	100	55	55		- Health Acute Toxicity		
Combustible Liquid, Class III-B	CAS No 57-55-6	State Liquid	Storage Container Steel Drum		Pressue Ambient	Waste Code	- Health Skin Corrosion Irritation		
		Type Pure	Days on Site: 365		Temperature Ambient		- Health Serious Eye Damage Eye Irritation		
							- Health Hazard Not Otherwise Classified		

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	SODIUM BICARBONATE, SODA ASH	Pounds	4000	50	2000			- Health Acute Toxicity		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		- Health Serious		
	144-55-8	Solid	Bag		Ambient			Eye Damage Eye Irritation		
		<u>Type</u>	Days on Site: 365		<u>Temperature</u>			- Health Hazard Not Otherwise Classified		
		Pure			Ambient					
DOT: 8 - Corrosives (Liquids and Solids)	DISINFECTANT BLEACH, CLOROX, GENERIC	Gallons	560	1	220			- Physical Oxidizer		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		- Physical Hazard		
Corrosive, Oxidizing, Class 2	7681-52-9	Liquid	Plastic Bottle or Jug		Ambient			Not Otherwise Classified		
		<u>Type</u>	Days on Site: 365		<u>Temperature</u>			- Health Acute Toxicity		
		Pure			Ambient			- Health Skin Corrosion Irritation		
								- Health Serious Eye Damage Eye Irritation		
								- Health Hazard Not Otherwise Classified		
DOT: 9 - Misc. Hazardous Materials	LEAD	Pounds	1500	10	1500			- Physical Combustible Dust		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		- Health		
	7439-92-1	Solid	Other		Ambient			Carcinogenicity		
		<u>Type</u>	Days on Site: 365		<u>Temperature</u>			- Health Acute Toxicity		
		Pure			Ambient			- Health Skin Corrosion Irritation		
								- Health Serious Eye Damage Eye Irritation		
								- Health Hazard Not Otherwise Classified		

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
DOT: 3 - Flammable and Combustible Liquids Flammable Liquid, Class I-B	DIESEL FUEL	Gallons	2000	2000				- Physical		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	- Flammable			
	68476-34-6	Liquid	Belowground Tank		Ambient		- Health			
		<u>Type</u>	Days on Site: 365		<u>Temperature</u>		Carcinogenicity			
		Pure			Ambient		- Health Acute			
							Toxicity			
							- Health Skin			
							Corrosion			
							Irritation			
							- Health			
							Respiratory Skin			
							Sensitization			
							- Health Specific			
							Target Organ			
							Toxicity			
							- Health			
							Aspiration Hazard			
	ACTIVATED CARBON 100%	Pounds	14000	2000	14000			- Physical Hazard		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Not Otherwise			
	7440-44-0	Solid	Aboveground Tank		Ambient		Classified			
		<u>Type</u>	Days on Site: 365		<u>Temperature</u>		- Health Skin			
		Pure			Ambient		Corrosion			
							Irritation			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health Hazard			
							Not Otherwise			
							Classified			
DOT: 3 - Flammable and Combustible Liquids	UNDERGROUND TANK 100905 T001	Gallons	10000	10000	9000			- Physical		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
	684-76-346	Liquid	Belowground Tank		Ambient		- Health			
		<u>Type</u>	Days on Site: 365		<u>Temperature</u>		Carcinogenicity			
		Pure			Ambient		- Health Skin			
							Corrosion			
							Irritation			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health			
							Aspiration Hazard			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
DOT: 9 - Misc. Hazardous Materials	IRON, 95% GALVANIZED STEEL	Pounds	500	50	500			- Physical Hazard		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		Not Otherwise		
	7439-89-6	Solid	Bag		Ambient			Classified		
		<u>Type</u>			<u>Temperature</u>			- Health		
		Pure	Days on Site: 365		Ambient			Carcinogenicity		
								- Health Skin		
								Corrosion		
								Irritation		
								- Health		
								Respiratory Skin		
								Sensitization		
								- Health Serious		
								Eye Damage Eye		
								Irritation		
								- Health Hazard		
								Not Otherwise		
								Classified		
DOT: 2.2 - Nonflammable Gases	SOLID CARBON DIOXIDE (DRY ICE)	Pounds	500	50	300			- Physical Hazard		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		Not Otherwise		
	124-38-9	Solid	Other		Ambient			Classified		
		<u>Type</u>			<u>Temperature</u>			- Health Skin		
		Pure	Days on Site: 365		< Ambient			Corrosion		
								Irritation		
								- Health Serious		
								Eye Damage Eye		
								Irritation		
								- Health Simple		
								Asphyxiant		
DOT: 9 - Misc. Hazardous Materials	SODIUM CHLORIDE, NA CL, 98% : TABLE SALT	Pounds	11000	50	6000			- Health Skin		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		Corrosion		
	7647-14-5	Solid	Bag		Ambient			Irritation		
		<u>Type</u>			<u>Temperature</u>			- Health Serious		
		Pure	Days on Site: 365		Ambient			Eye Damage Eye		
								Irritation		

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
DOT: 2.1 - Flammable Gases	WASTE AEROSOLS	Pounds	300	300		1650	- Physical			
Flammable Liquid, Class I-B	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
		Solid	Steel Drum		Ambient	331	- Physical Gas			
		<u>Type</u>			<u>Temperature</u>		Under Pressure			
		Waste	Days on Site: 365		Ambient		- Physical			
							Explosive			
							- Physical			
							SelfReactive			
							- Physical Hazard			
							Not Otherwise			
							Classified			
							- Health			
							Carcinogenicity			
							- Health Acute			
							Toxicity			
							- Health			
							Respiratory Skin			
							Sensitization			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health Hazard			
							Not Otherwise			
							Classified			
DOT: 4.1 - Flammable Solids	CHARCOAL	Pounds	2500	50	2500		- Physical			
Flammable Solid	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
	16291-96-6	Solid	Bag		Ambient		- Health Hazard			
		<u>Type</u>			<u>Temperature</u>		Not Otherwise			
		Pure	Days on Site: 365		Ambient		Classified			
	22-5-6 W/AMMONIUM SULFATE	Pounds	2000	50	500		- Health Skin	UREA		57-13-6
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Corrosion	MONOAMMONIUM PHOSPHATE		7722-76-1
	7783-20-2	Solid	Bag		Ambient		Irritation	POTASSIUM CHLORIDE		7447-40-7
		<u>Type</u>			<u>Temperature</u>		- Health	SULFUR		7704-34-9
		Mixture	Days on Site: 365		Ambient		Respiratory Skin	WAX		64771-72-8
							Sensitization			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
	NITRA KING 19-4-4	Pounds	1000	50	300		- Health			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Respiratory Skin			
	6484-52-2	Solid	Bag		Ambient		Sensitization			
		<u>Type</u>			<u>Temperature</u>		- Health Serious			
		Pure	Days on Site: 365		Ambient		Eye Damage Eye			
							Irritation			
							- Health Specific			
							Target Organ			
							Toxicity			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location					CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP					Facility ID	37-000-100905
1720 S SHORES RD, SAN DIEGO 92109							Status	Submitted on 3/5/2019 8:50 AM
						Annual Waste Amount	Hazardous Components (For mixture only)	
DOT Code/Fire Haz. Class	Common Name	Unit	Max. Daily	Largest Cont.	Avg. Daily	Federal Hazard Categories	Component Name	% Wt EHS CAS No.
	WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT	Pounds	500	50	250	- Physical		
		State	Storage Container		Pressue	Waste Code	Combustible Dust	
		Solid	Bag, Other		Ambient		- Health	
		Type			Temperature		Carcinogenicity	
		Mixture	Days on Site: 365		Ambient		- Health Skin	
							Corrosion	
							Irritation	
							- Health	
							Respiratory Skin	
							Sensitization	
	MANGANESE, 13% STAINLESS STEEL	Pounds	500	50	500	- Health		
		State	Storage Container		Pressue	Waste Code	Carcinogenicity	
		Solid	Bag		Ambient		- Health	
		Type			Temperature		Respiratory Skin	
		Pure	Days on Site: 365		Ambient		Sensitization	
							- Health Hazard	
							Not Otherwise	
							Classified	
							- Physical	
							Flammable	
DOT: 2.2 - Nonflammable Gases	OXYGEN, 02, 99%, COMPRESSED GAS :	Cu. Feet	6000	240	2875	- Physical		
Cryogen, Oxidizing Gas, Liquefied		State	Storage Container		Pressue	Waste Code	Flammable	
		Gas	Cylinder		> Ambient		- Physical Gas	
		Type			Temperature		Under Pressure	
		Pure	Days on Site: 365		Ambient		- Physical	
							Explosive	
							- Physical Oxidizer	
DOT: 9 - Misc. Hazardous Materials	NICKEL, 46% NICKEL STEEL	Pounds	500	50	500	- Health		
Flammable Solid		State	Storage Container		Pressue	Waste Code	Carcinogenicity	
		Solid	Bag		Ambient		- Health	
		Type			Temperature		Respiratory Skin	
		Pure	Days on Site: 365		Ambient		Sensitization	
							- Health Hazard	
							Not Otherwise	
							Classified	
DOT: 9 - Misc. Hazardous Materials	FREON R-123	Pounds	2500	50	1870	- Health Specific		
		State	Storage Container		Pressue	Waste Code	Target Organ	
		Gas	Other		> Ambient		Toxicity	
		Type			Temperature		- Health	
		Pure	Days on Site: 365		Ambient		Aspiration Hazard	

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	WASTE PATHOLOGY	Pounds	40	40		600	- Physical			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Flammable			
	39515-41-8	Solid	Bag		Ambient		- Health			
		<u>Type</u>			<u>Temperature</u>		Carcinogenicity			
		Waste	Days on Site: 365		Ambient		- Health Acute			
							Toxicity			
							- Health Skin			
							Corrosion			
							Irritation			
							- Health			
							Respiratory Skin			
							Sensitization			
							- Health Serious			
							Eye Damage Eye			
							Irritation			
							- Health Specific			
							Target Organ			
							Toxicity			
							- Health Germ			
							Cell Mutagenicity			
							- Health Hazard			
							Not Otherwise			
							Classified			
DOT: 8 - Corrosives (Liquids and Solids)	Aluminum Chlorohydrate	Gallons	2000	275	1350		- Health Acute			
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	Toxicity			
Corrosive	12042-91-0	Liquid	Plastic/Non-metalic Drum		Ambient		- Health Skin			
		<u>Type</u>			<u>Temperature</u>		Corrosion			
		Mixture	Days on Site: 365		Ambient		Irritation			
							- Health			
							Respiratory Skin			
							Sensitization			
							- Health Serious			
							Eye Damage Eye			
							Irritation			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
Water Reactive, Class 1	SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)	Pounds	750	10	500			- Physical Hazard		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	- Not Otherwise Classified			
	497-19-8	<u>Solid</u>	Box		<u>Ambient</u>		- Health Acute Toxicity			
		<u>Type</u>	Pure	Days on Site: 365	<u>Ambient</u>		- Health Skin Corrosion Irritation			
	NATURAL FINE AND COARSE AGGREGATE	Pounds	5000	100	1400			- Health Carcinogenicity		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>				
	14808-60-7	<u>Solid</u>	Bag		<u>Ambient</u>					
		<u>Type</u>	Pure	Days on Site: 365	<u>Ambient</u>					
	SILICON DIOXIDE (SAND-NURSERY)	Pounds	2600	2600	1000			- Health Carcinogenicity		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>	- Health Acute Toxicity			
	14808-60-7	<u>Solid</u>	Other		<u>Ambient</u>		- Health Specific Target Organ Toxicity			
		<u>Type</u>	Pure	Days on Site: 365	<u>Ambient</u>		- Health Aspiration Hazard			
	SNAPSHOT 2.5 TG	Pounds	500	500				- Health Carcinogenicity	Isoxaben 1 %	82558-50-7
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>			Trifluralin 2 %	1582-09-8
		<u>Solid</u>	Plastic/Non-metalic Drum		<u>Ambient</u>		- Health Acute Toxicity		Clays, Fuller's earth 79 %	8031-18-3
		<u>Type</u>	Mixture		<u>Ambient</u>		- Health Specific Target Organ Toxicity		Silica, crystalline (quartz) 1 %	14808-60-7
Corrosive	POLYMALEIC ACID	Gallons	100	100				- Physical Corrosive To Metal		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>				
	26099-09-2	<u>Liquid</u>	Plastic/Non-metalic Drum		<u>Ambient</u>		- Health Skin Corrosion Irritation			
		<u>Type</u>	Mixture		<u>Ambient</u>		- Health Serious Eye Damage Eye Irritation			

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location					CERS ID	10383472		
Facility Name	SEAWORLD	SEE SITE MAP					Facility ID	37-000-100905		
1720 S SHORES RD, SAN DIEGO 92109							Status	Submitted on 3/5/2019 8:50 AM		
						Annual Waste Amount	Hazardous Components (For mixture only)			
DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Federal Hazard Categories	Component Name	% Wt	EHS	CAS No.
Unstable (Reactive), Class 1	SODA ASH DENSE	Pounds	400	400			- Health Serious			
	CAS No	State	Storage Container		Pressue	Waste Code	Eye Damage			
	497-19-8	Solid	Plastic/Non-metalic Drum				Irritation			
		Type			Temperature					
Pure										
DOT: 9 - Misc. Hazardous Materials	Lanthanum Chloride	Gallons	110	55			- Physical			
	CAS No	State	Storage Container		Pressue	Waste Code	Corrosive To			
	10099-58-8	Solid	Plastic/Non-metalic Drum				Metal			
		Type			Temperature		- Health Acute			
		Pure					Toxicity			
							- Health Skin			
							Corrosion			
							Irritation			
							- Health			
							Respiratory Skin			
							Sensitization			
						- Health Serious				
						Eye Damage				
						Irritation				

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP AND PROP 65 REPORT	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	BELOW STATE DISCLOSURE AMTS	Pounds	0					- Health		
	ARE/MAY BE ON SITE	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		Carcinogenicity		
		<u>Solid</u>	<u>Other</u>		<u>Ambient</u>			- Health Acute		
	<u>CAS No</u>	<u>Type</u>			<u>Temperature</u>			Toxicity		
					<u>Ambient</u>			- Health Specific		
								Target Organ		
								Toxicity		
								- Health Germ		
								Cell Mutagenicity		
								- Health Hazard		
								Not Otherwise		
								Classified		

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location	CERS ID	10383472
Facility Name	SEAWORLD	SEE SITE MAP/PLAN	Facility ID	37-000-100905
	1720 S SHORES RD, SAN DIEGO 92109		Status	Submitted on 3/5/2019 8:50 AM

DOT Code/Fire Haz. Class	Common Name	Unit	Quantities			Annual Waste Amount	Federal Hazard Categories	Hazardous Components (For mixture only)		
			Max. Daily	Largest Cont.	Avg. Daily			Component Name	% Wt	EHS CAS No.
	SODIUM SULFITE, 25% SOLUTION	Gallons	5100	2600	2500			- Health Acute		
	<u>CAS No</u>	<u>State</u>	<u>Storage Container</u>		<u>Pressue</u>	<u>Waste Code</u>		Toxicity		
	7757-83-7	Liquid	Aboveground Tank		Ambient			- Health Skin		
		<u>Type</u>			<u>Temperature</u>			Corrosion		
		Pure	Days on Site: 365		Ambient			Irritation		
								- Health Serious		
								Eye Damage Eye		
								Irritation		

Hazardous Materials And Wastes Inventory Matrix Report

CERS Business/Org.	SEAWORLD	Chemical Location					CERS ID	10383472		
Facility Name	SEAWORLD	Veterinary Lab					Facility ID	37-000-100905		
1720 S SHORES RD, SAN DIEGO 92109							Status	Submitted on 3/5/2019 8:50 AM		
						Annual Waste Amount	Hazardous Components (For mixture only)			
DOT Code/Fire Haz. Class	Common Name	Unit	Max. Daily	Largest Cont.	Avg. Daily		Federal Hazard Categories	Component Name	% Wt	EHS CAS No.
DOT: 6.1 - Toxic Substances	WASTE - Decalcifying Solution	Gallons	5	5	5	15	- Physical Hazard	Water	97 %	7732-18-5
	CAS No	State	Storage Container		Pressue	Waste Code	Not Otherwise Classified	Hydrochloric Acid	3 %	7647-01-0
		Liquid	Plastic Bottle or Jug		Ambient	551	- Health Acute Toxicity			
		Type			Temperature		- Health Germ Cell Mutagenicity			
		Waste	Days on Site: 365		Ambient		- Health Hazard Not Otherwise Classified			
DOT: 3 - Flammable and Combustible Liquids	WASTE _ Gram Stain	Gallons	2.5	2.5	2.5	15	- Physical	isopropanol	75 %	67-63-0
	CAS No	State	Storage Container		Pressue	Waste Code	Flammable			
		Liquid	Plastic Bottle or Jug			791	- Health Acute Toxicity	methanol	2 %	67-56-1
		Type			Temperature		- Health Skin Corrosion	ethanol	2 %	64-17-5
		Waste	Days on Site: 365				- Health Hazard Not Otherwise Classified	C.I. Basic Violet 3	1 %	548-62-9
							Irritation	potassium iodide	3 %	7681-11-0

**2019 HAZARDOUS MATERIALS BUSINESS PLAN
AND
EMERGENCY CONTINGENCY PLAN**

**SEAWORLD SAN DIEGO
500 SEA WORLD DRIVE
SAN DIEGO, CALIFORNIA 92109-7995**

February 28, 2019

Coordinates:

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Business Address: 500 Sea World Dr, San Diego, CA

SITE MAP (Page 1 of 19)

Date: 2/28/2019


Zip Code: 92109

EST#: 100905

FOR OFFICE USE ONLY

Reviewed By: _____

Date: _____

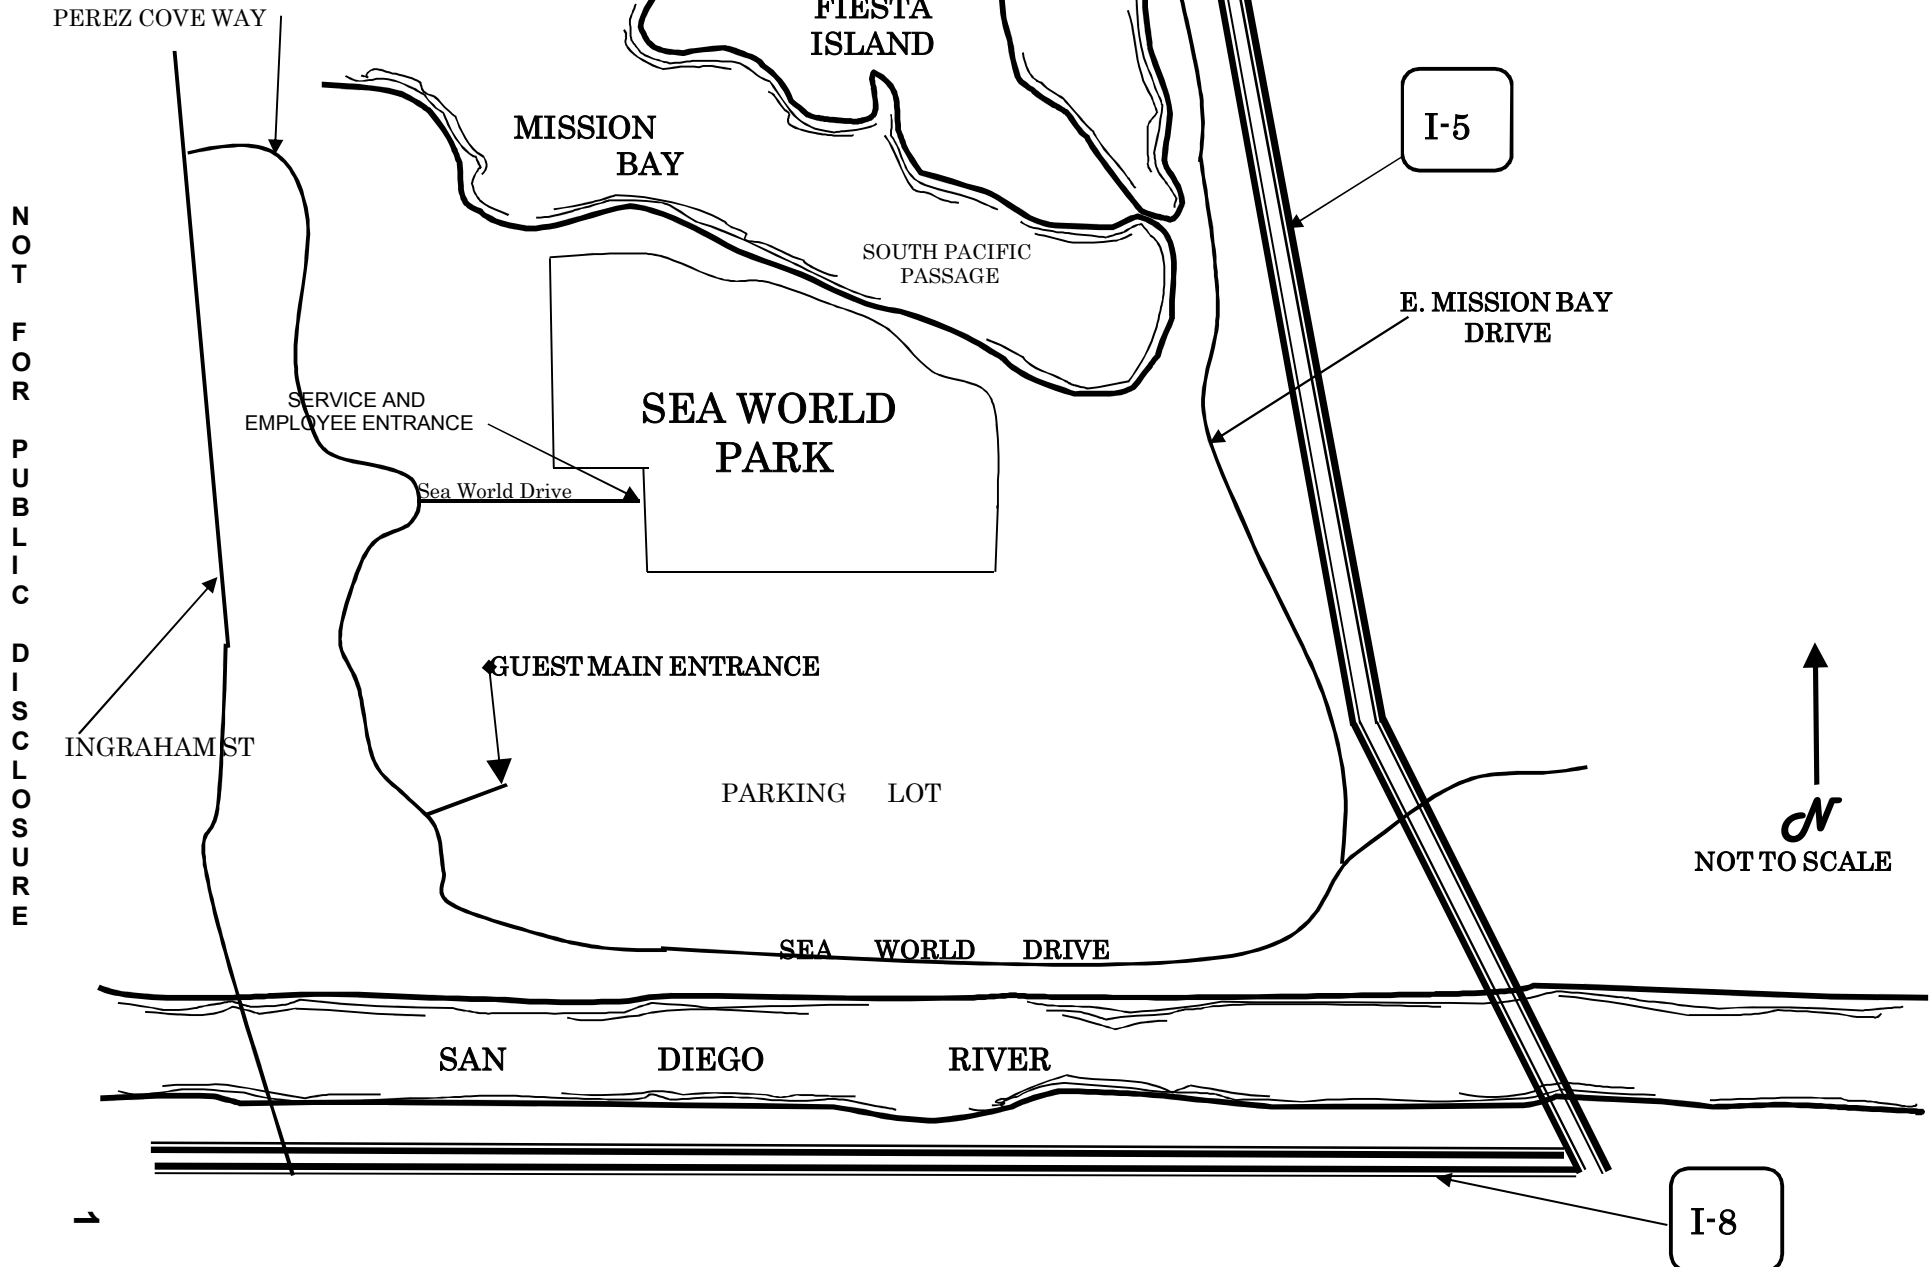

Coordinates:

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Business Address: 500 Sea World Dr, San Diego, CA

SITE MAP (Page 1 of 20)

Date: 2/28/2019


Zip Code: 92109

EST#: 100905

FOR OFFICE USE ONLY

Reviewed By: _____

Date: _____

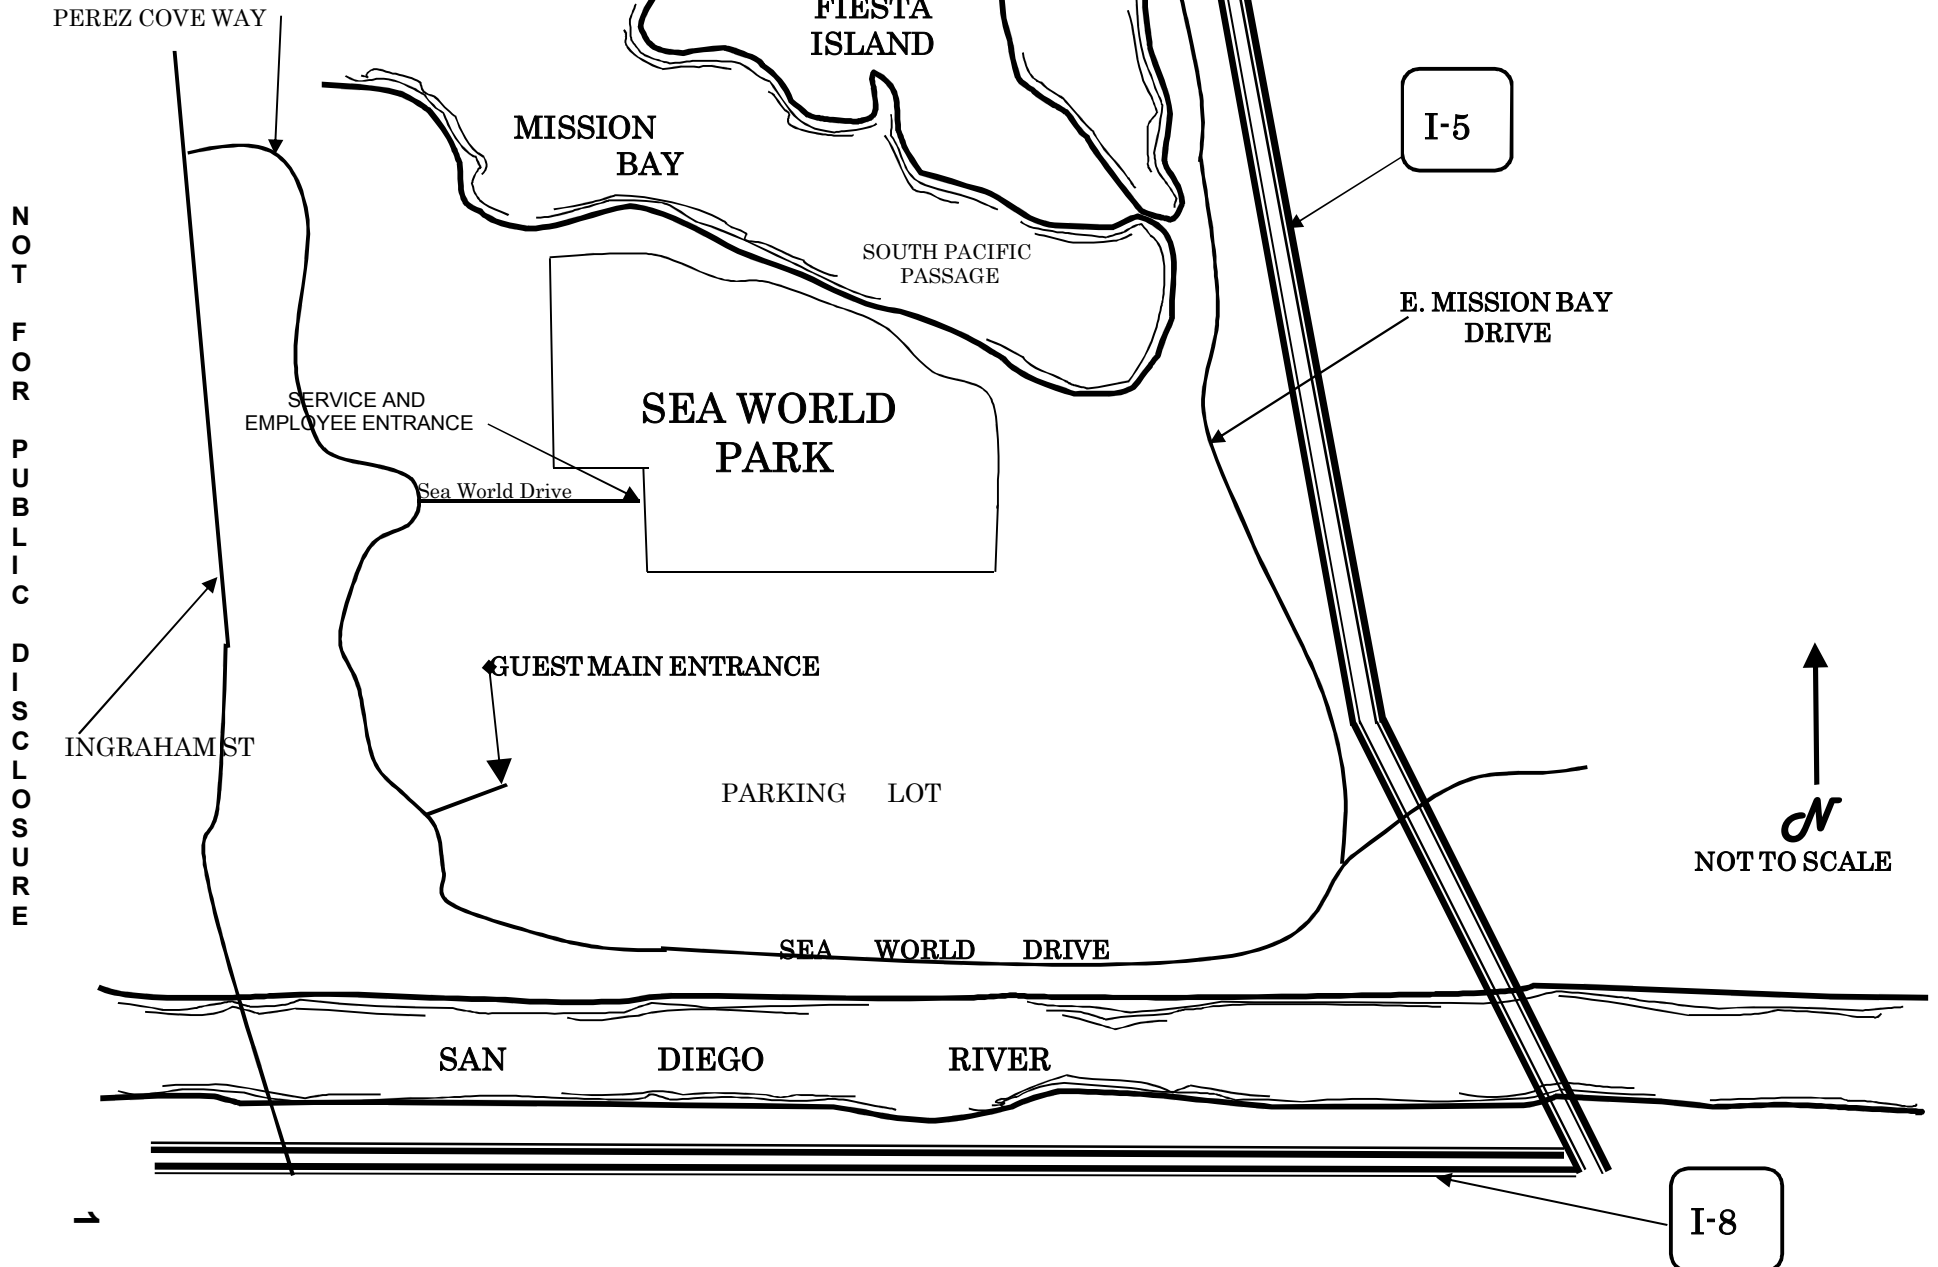

Coordinates:

Thomas Bros. Coordinates: 1268-B3

Business Name: Sea World San Diego

SITE MAP (Page 2 of 20)






Date: 2/28/2019

EST#: 100905

FOR OFFICE USE ONLY

Reviewed By:

Date:

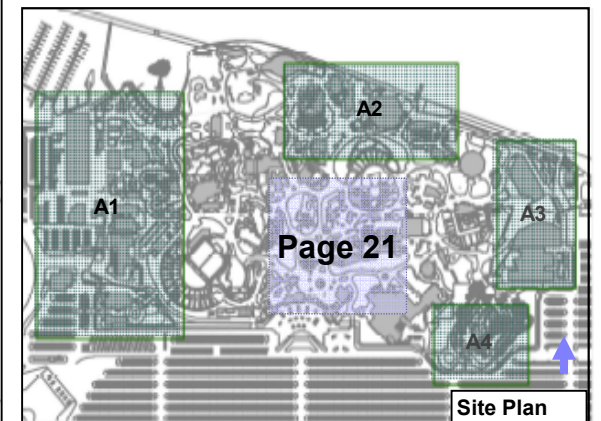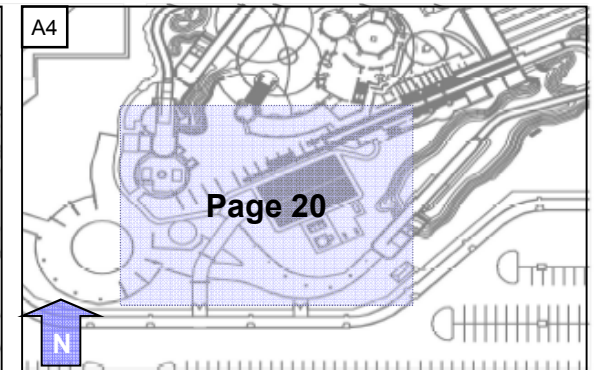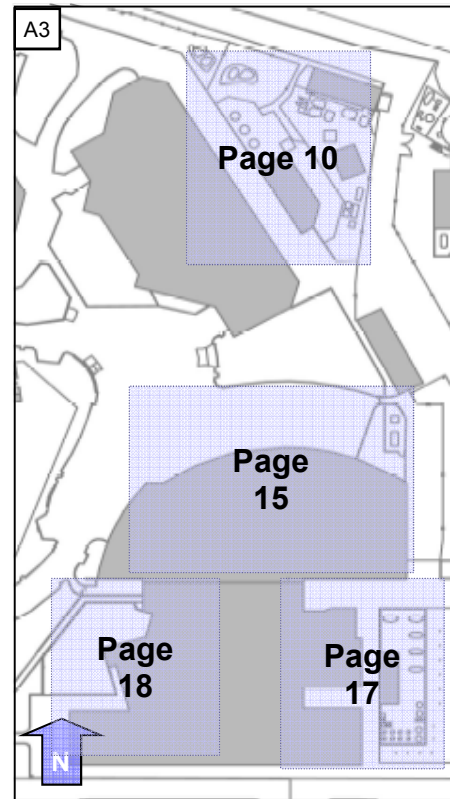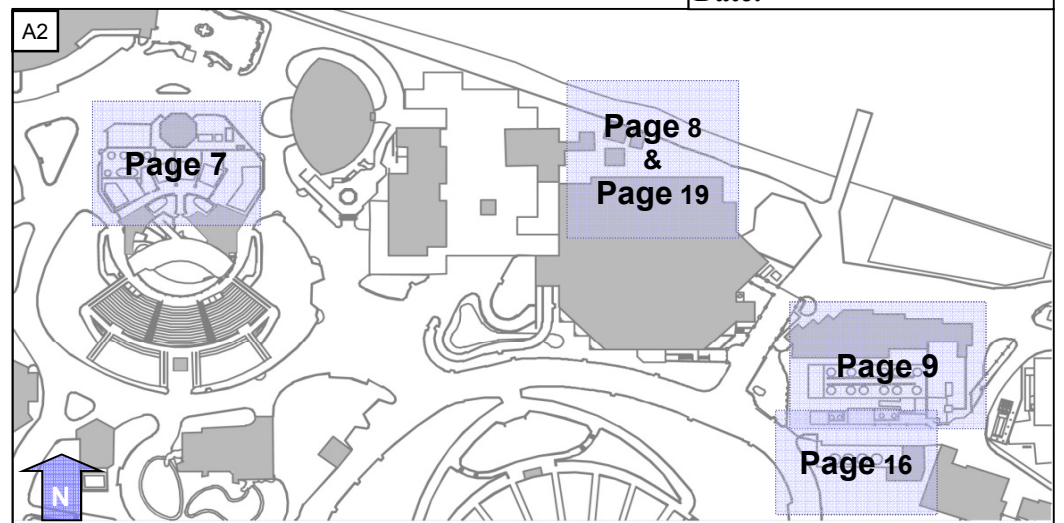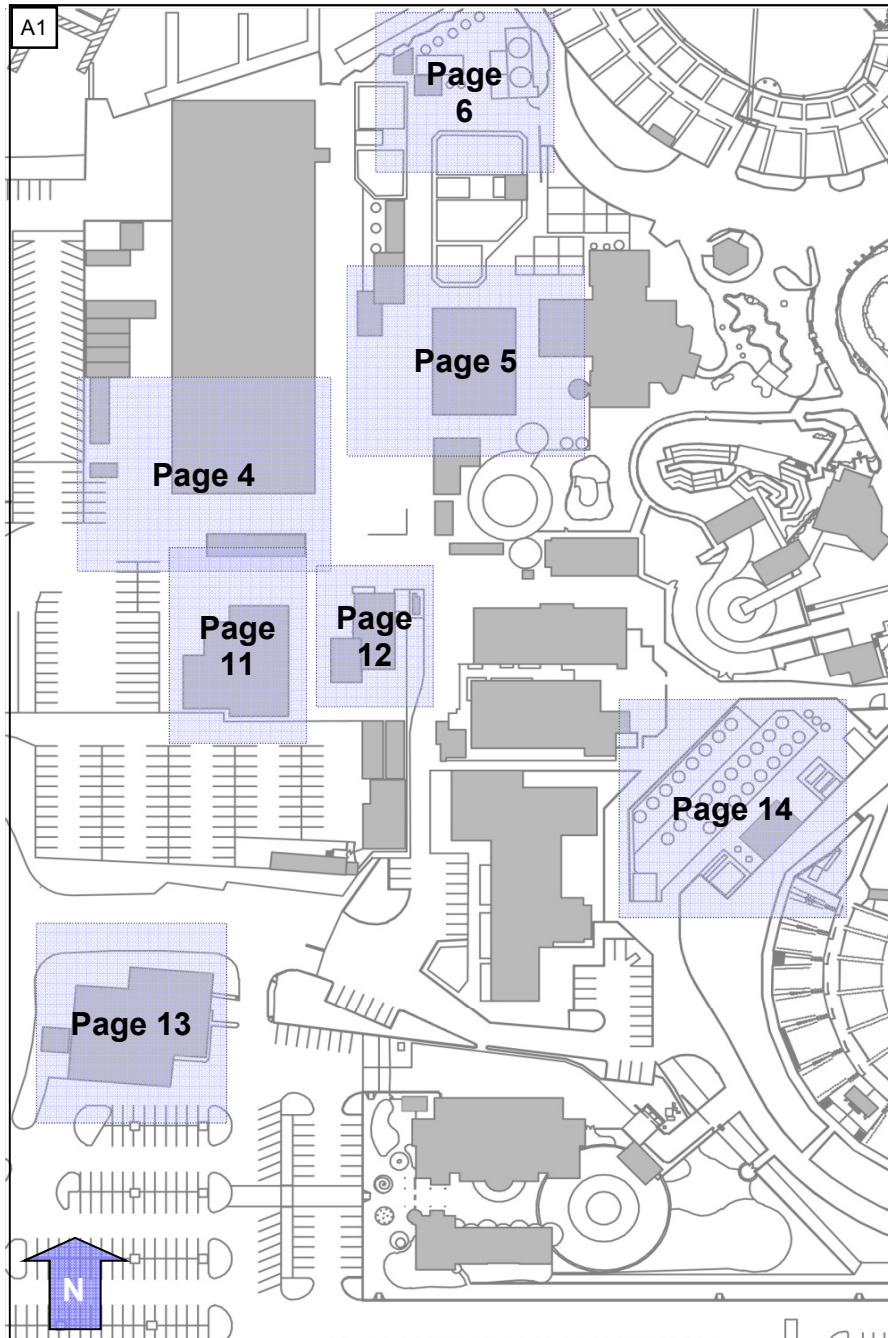

Coordinates:

SITE MAP (Page 3 of 20)

EST#: 100905

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Date: 2/28/2019

Business Address: 500 Sea World Dr, San Diego, CA

Zip Code: 92109

FOR OFFICE USE ONLY

Reviewed By: _____

Date: _____

**N
O
T


F
O
R

P
U
B
L
I
C

D
I
S
C
L
O
S
U
R**



ENTRANCES / EXITS



FENCES



SEWER DRAIN



STORM DRAIN



ELECTRIC MAIN SHUT OFF



WATER MAIN SHUT OFF



GAS MAIN SHUT OFF



FUEL MAIN SHUT OFF



SPILL KIT



EYE WASH



FIRE EXTIGUISHER



FIRE HYDRANT



FIRE SPRINKLER SYSTEM CONNECTION



KNOX BOX



STAIRWELL - RANGE OF FLOORS



ELEVATOR - RANGE OF FLOORS



SAFE REFUGE AREA



BACKUP SAFE REFUGE AREA



HAZARDOUS MATERIALS BUISINESS PLAN



SAFETY DATA SHEET



IMMEDIATE (ACUTE) HEALTH HAZARD (MATERIALS)



IMMEDIATE (ACUTE) HEALTH HAZARD (WASTES)



DELAYED (CHRONIC) HEALTH HAZARD (MATERIALS)



FIRE HAZARD (MATERIALS)



FIRE HAZARD (WASTES)



SUDDEN RELEASE OF PRESSURE (MATERIALS)



SUDDEN RELEASE OF PRESSURE (WASTES)



MEDICAL BIOHAZARDOUS (WASTES)



EXTREMELY HAZARDOUS (MATERIALS)

Coordinates: E-6

SITE MAP (Page 4 of 21)

EST#: 100905

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Business Address: 500 Sea World Dr, San Diego, CA

Date: 2/28/2019


Zip Code: 92109

FOR OFFICE USE ONLY

Reviewed By: _____

Date: _____

NOT FOR PUBLIC DISCLOSURE

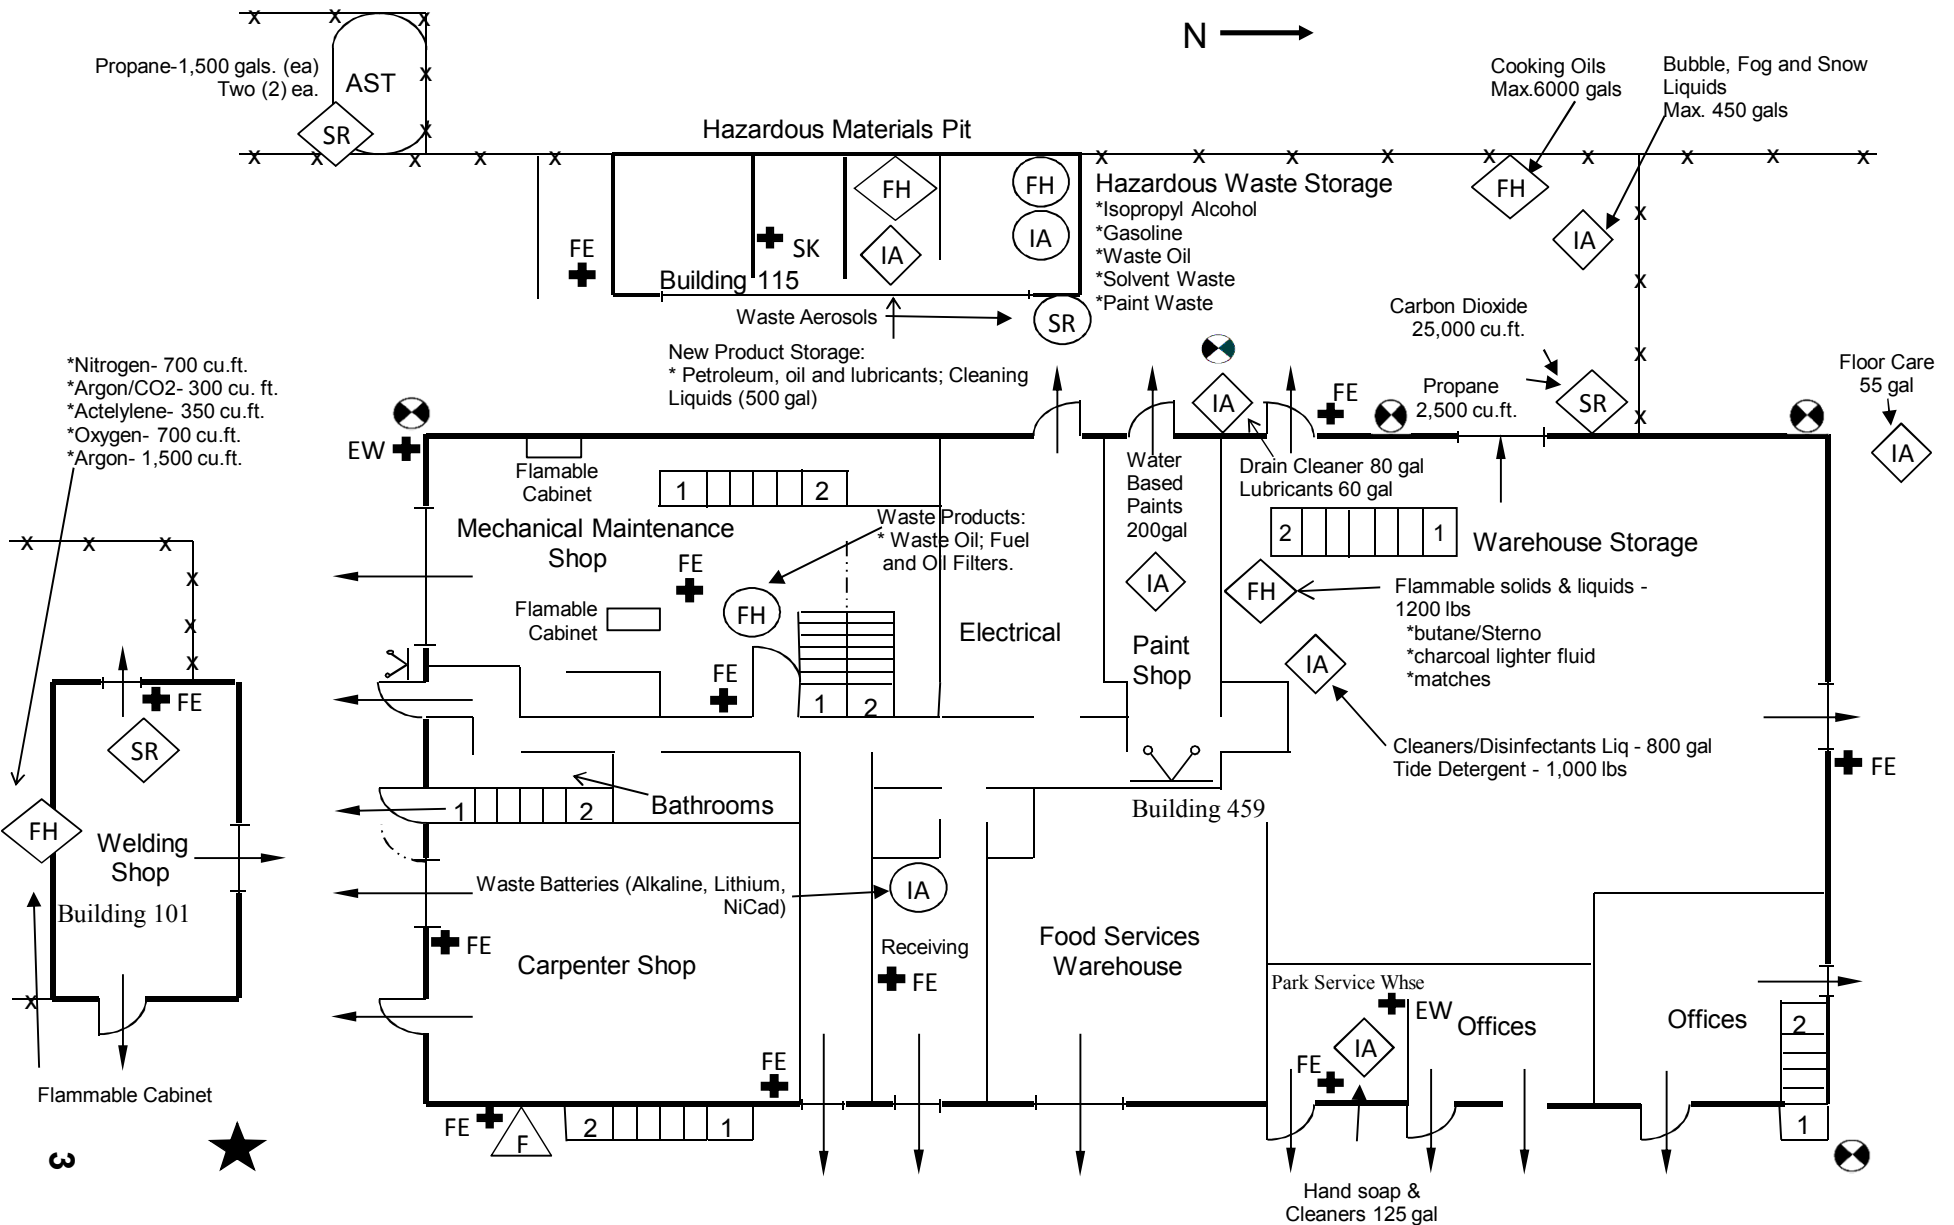

Coordinates: F-7

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Business Address: 500 Sea World Dr, San Diego, CA

SITE MAP (Page 5 of 21)

Date: 2/28/2019


Zip Code: 92109

EST#: 100905

FOR OFFICE USE ONLY

Reviewed By: _____

Date: _____

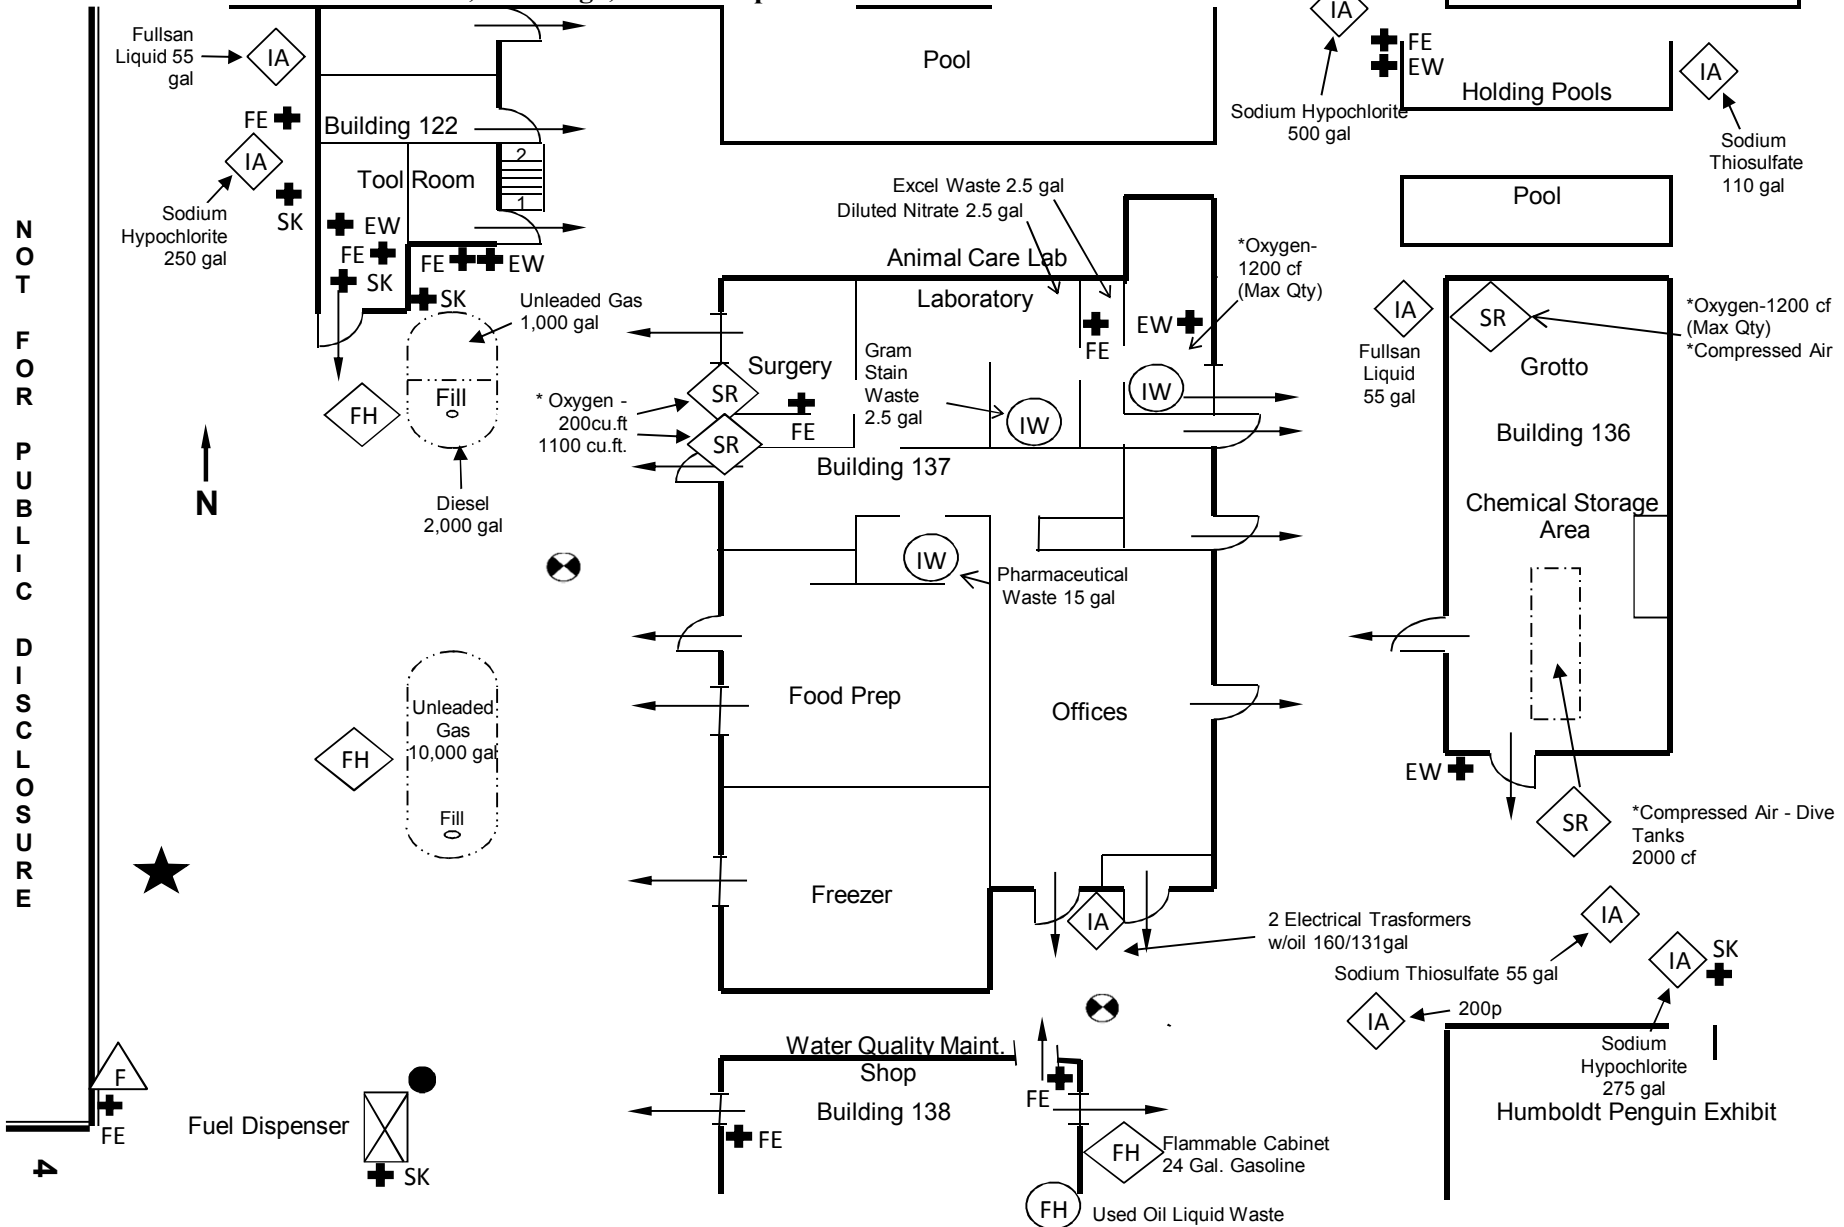

Coordinates: F-8

SITE MAP (Page 6 of 21)

EST#: 100905

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Business Address: 500 Sea World Dr, San Diego, CA

Date: 2/28/2019

Zip Code: 92109


FOR OFFICE USE ONLY


Reviewed By: _____

Date: _____

NOT
FOR
PUBLIC
DISCLOSURE

5

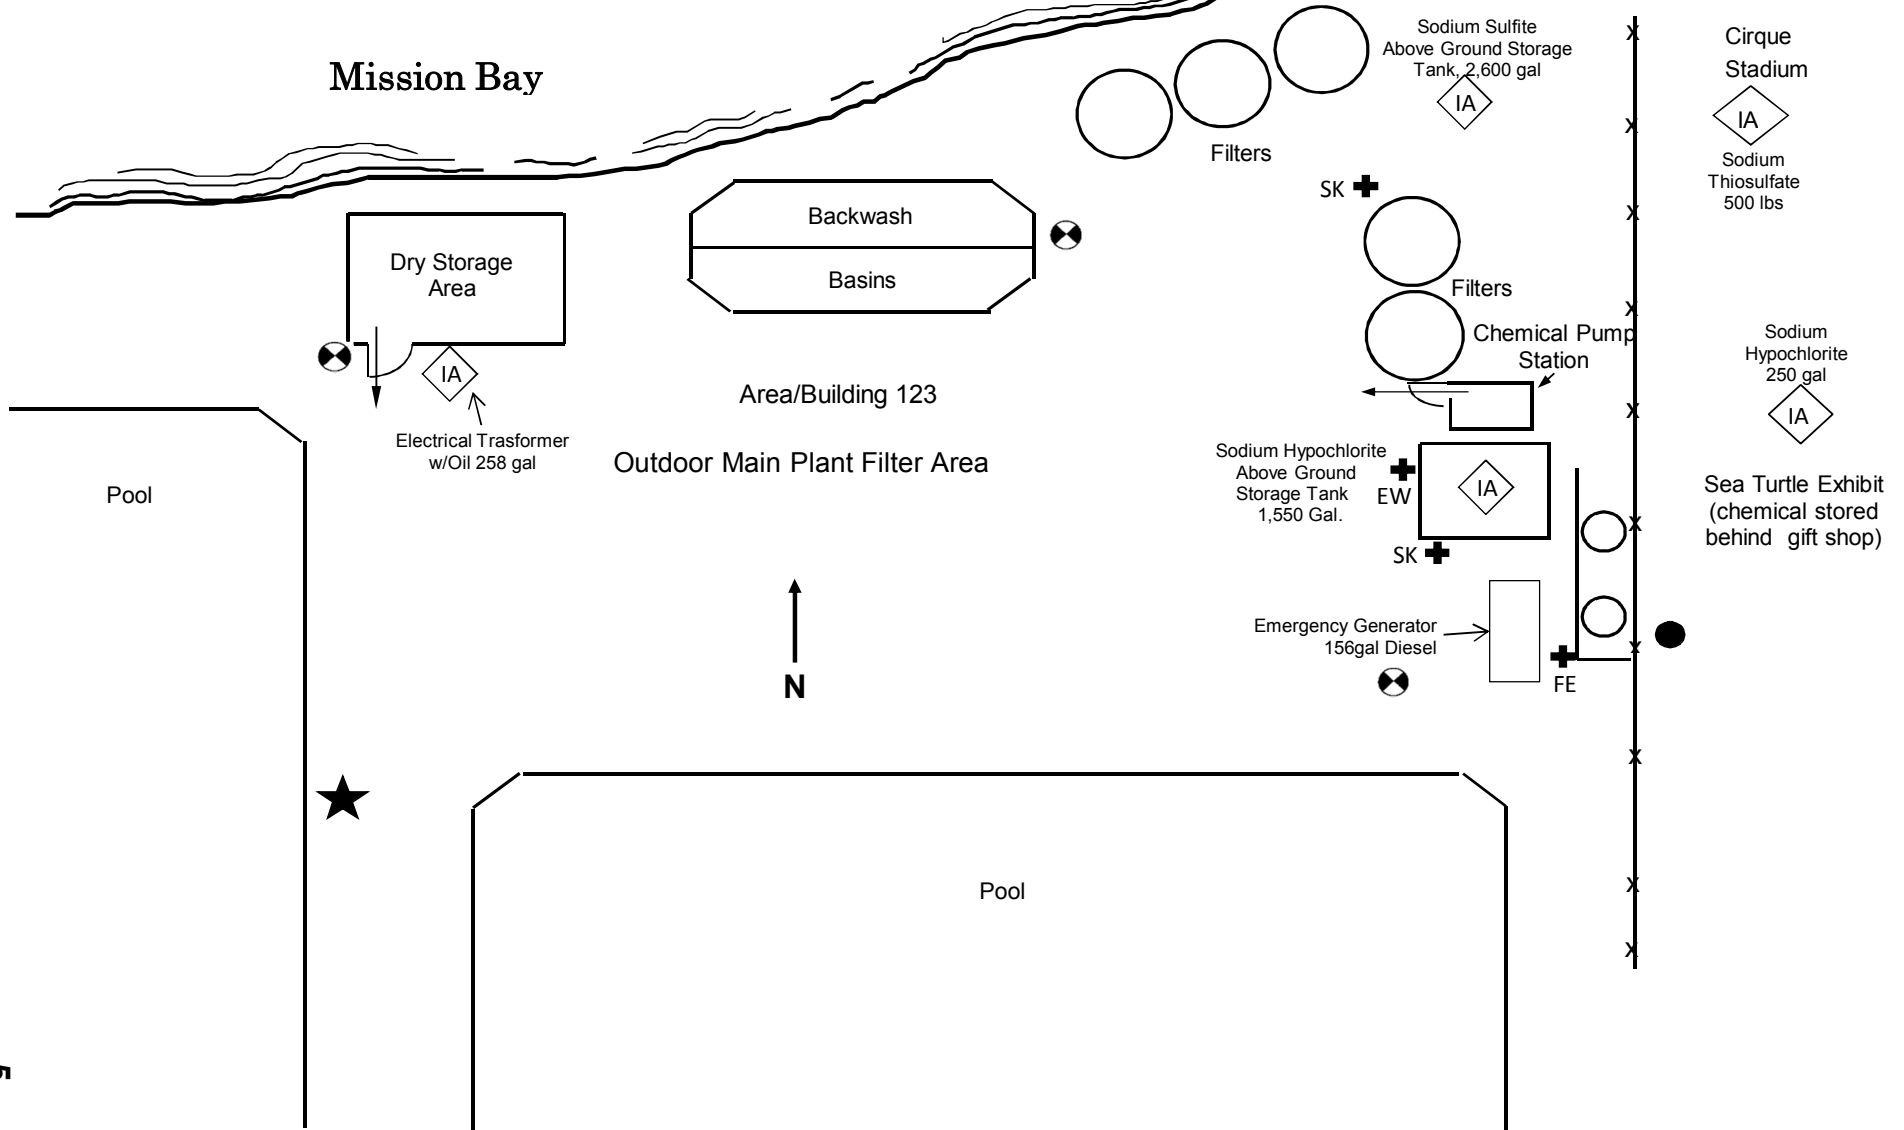

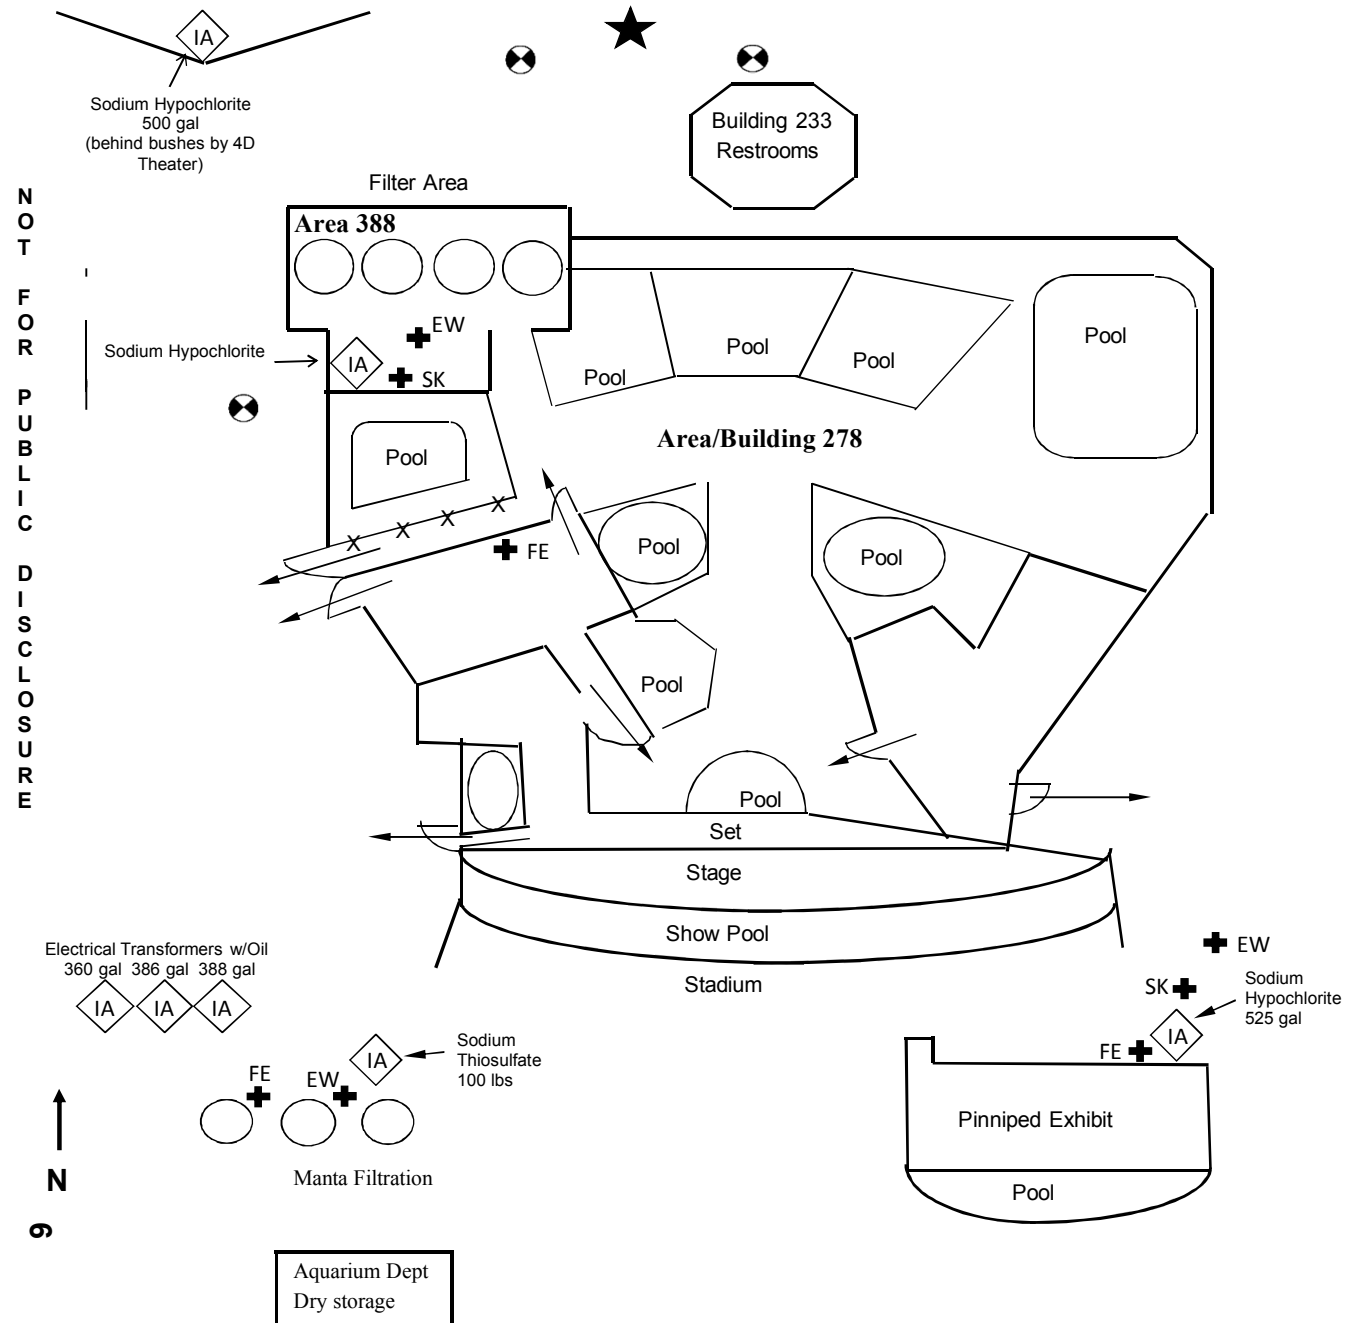

Coordinates: M-8

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Business Address: 500 Sea World Dr, San Diego, CA

SITE MAP (Page 8 of 21)

Date: 2/28/2019

Zip Code: 92109

EST#: 100905


FOR OFFICE USE ONLY

Reviewed By: _____

Date: _____

NOT FOR PUBLIC DISCLOSURE

Mission Bay

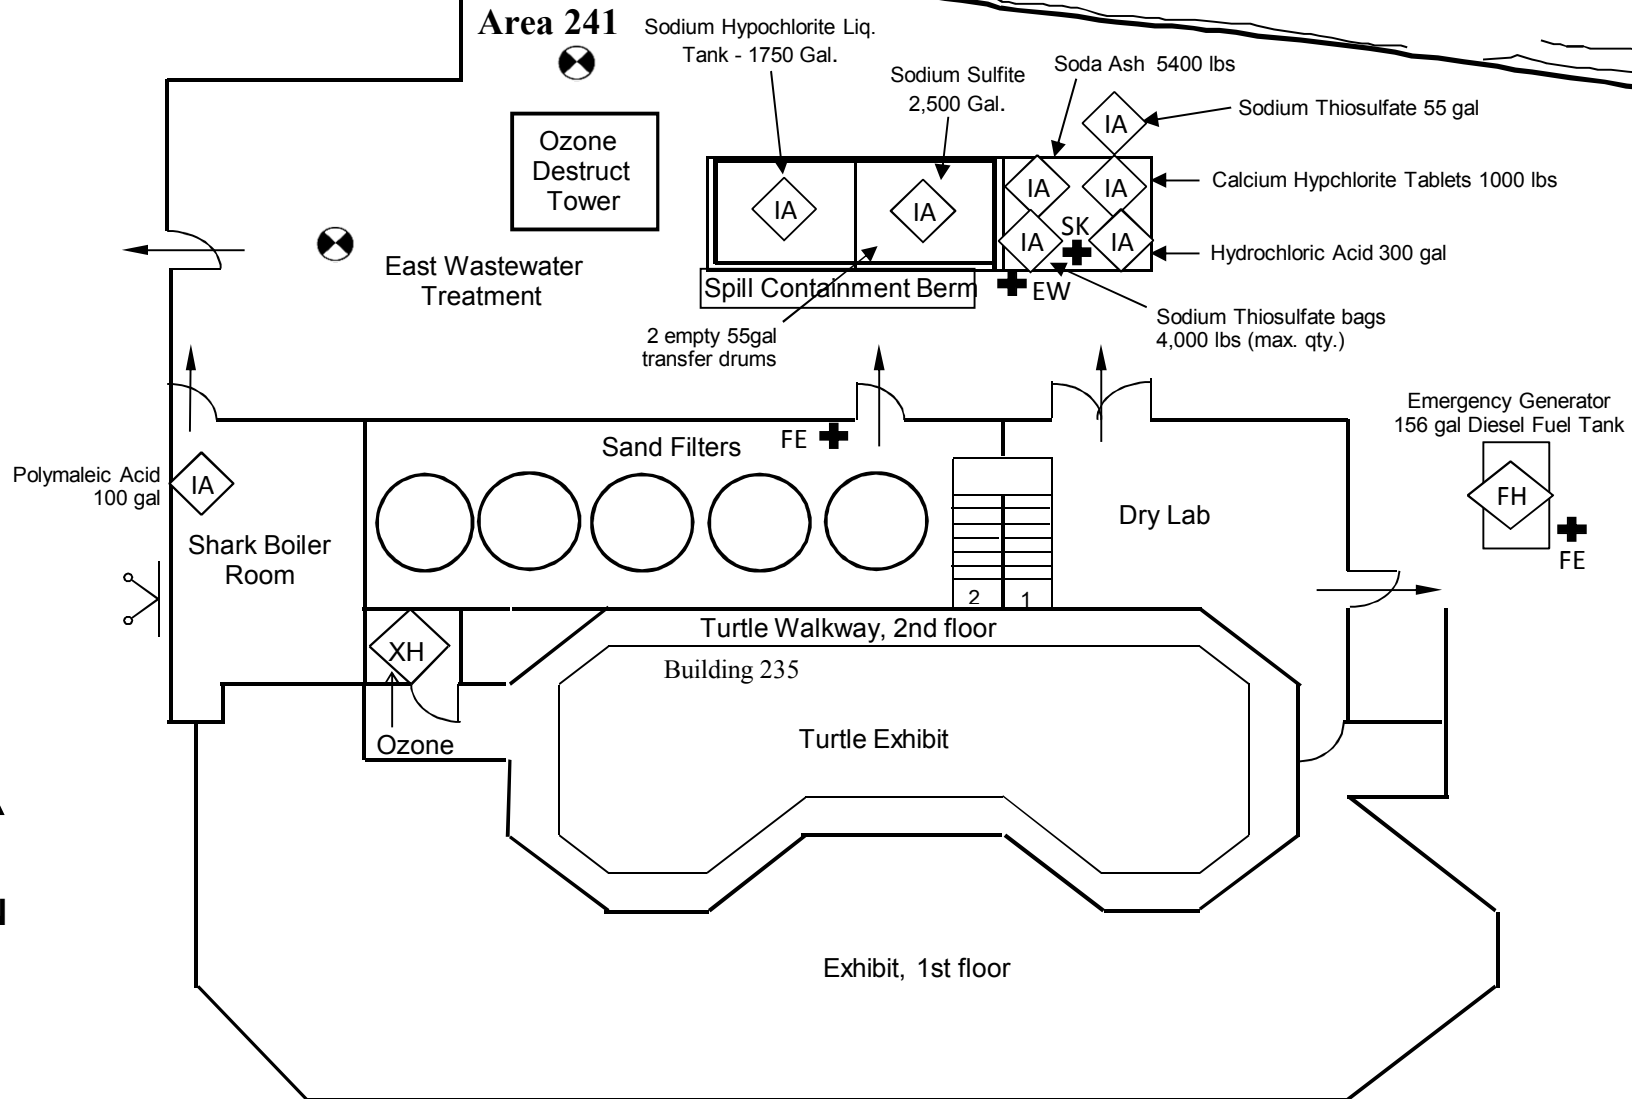

Coordinates: N-7

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Business Address: 500 Sea World Dr, San Diego, CA

SITE MAP (Page 9 of 21)

Date: 2/28/2019

Zip Code: 92109


EST#: 100905

FOR OFFICE USE ONLY

Reviewed By: _____


Date: _____

NOT FOR PUBLIC DISCLOSURE

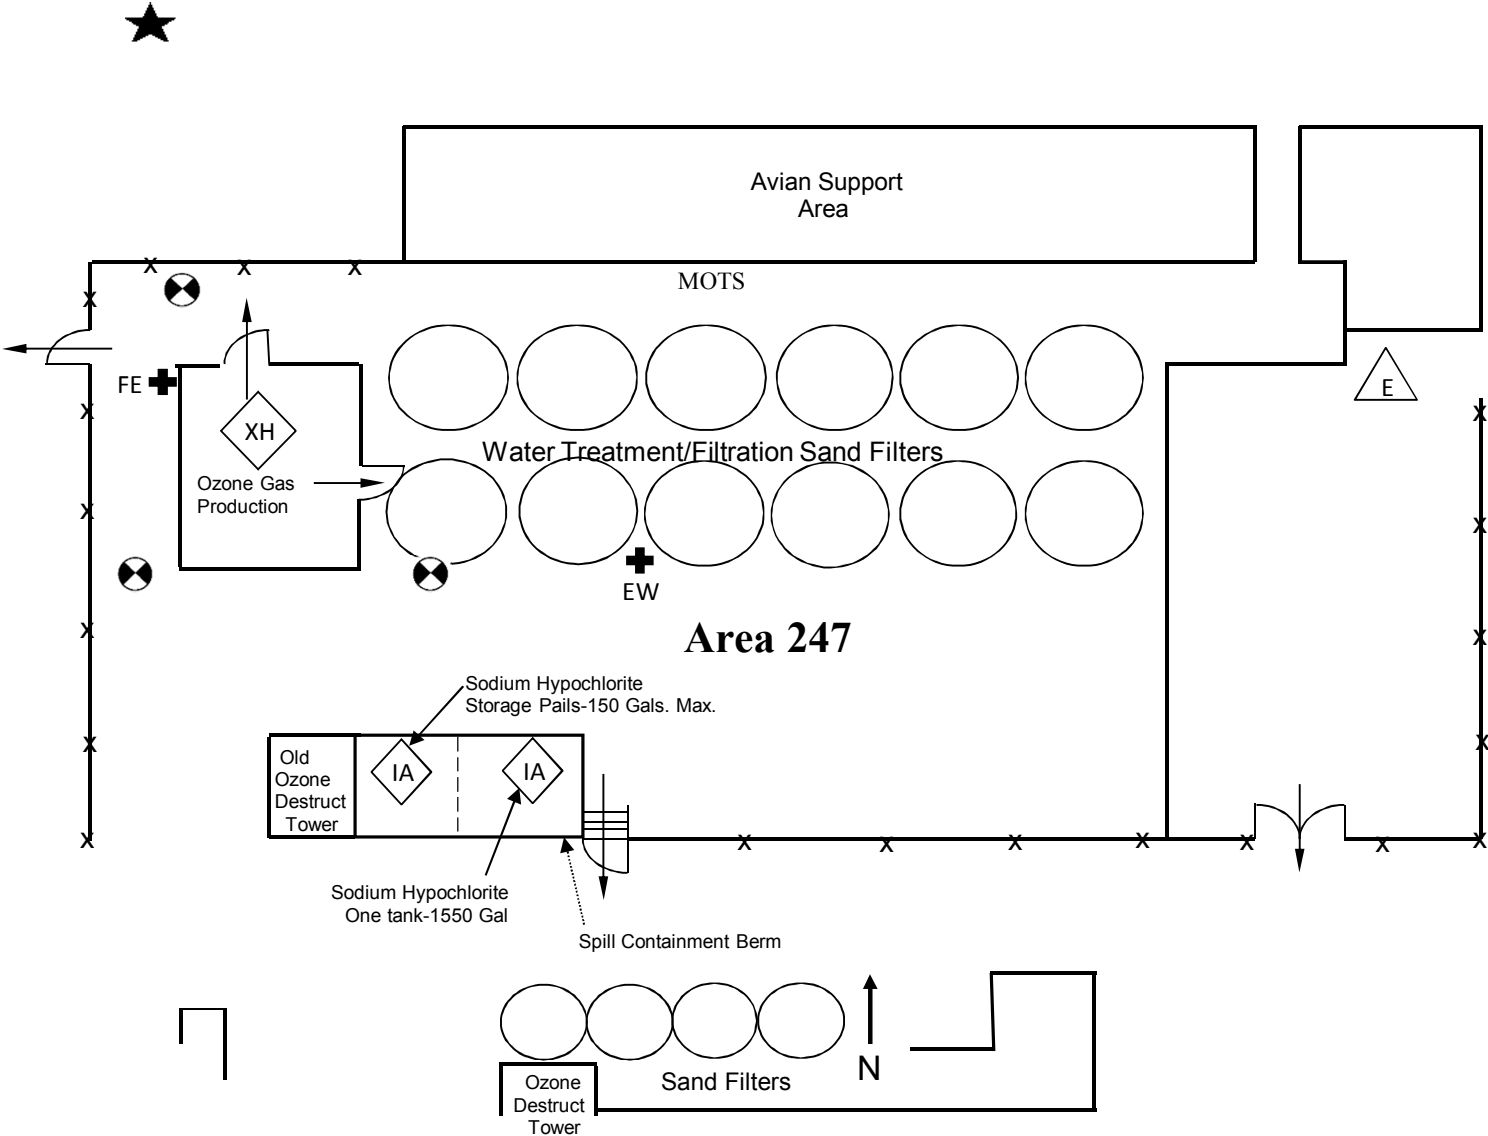

Business Address: 500 Sea World Dr, San Diego, CA

Date:

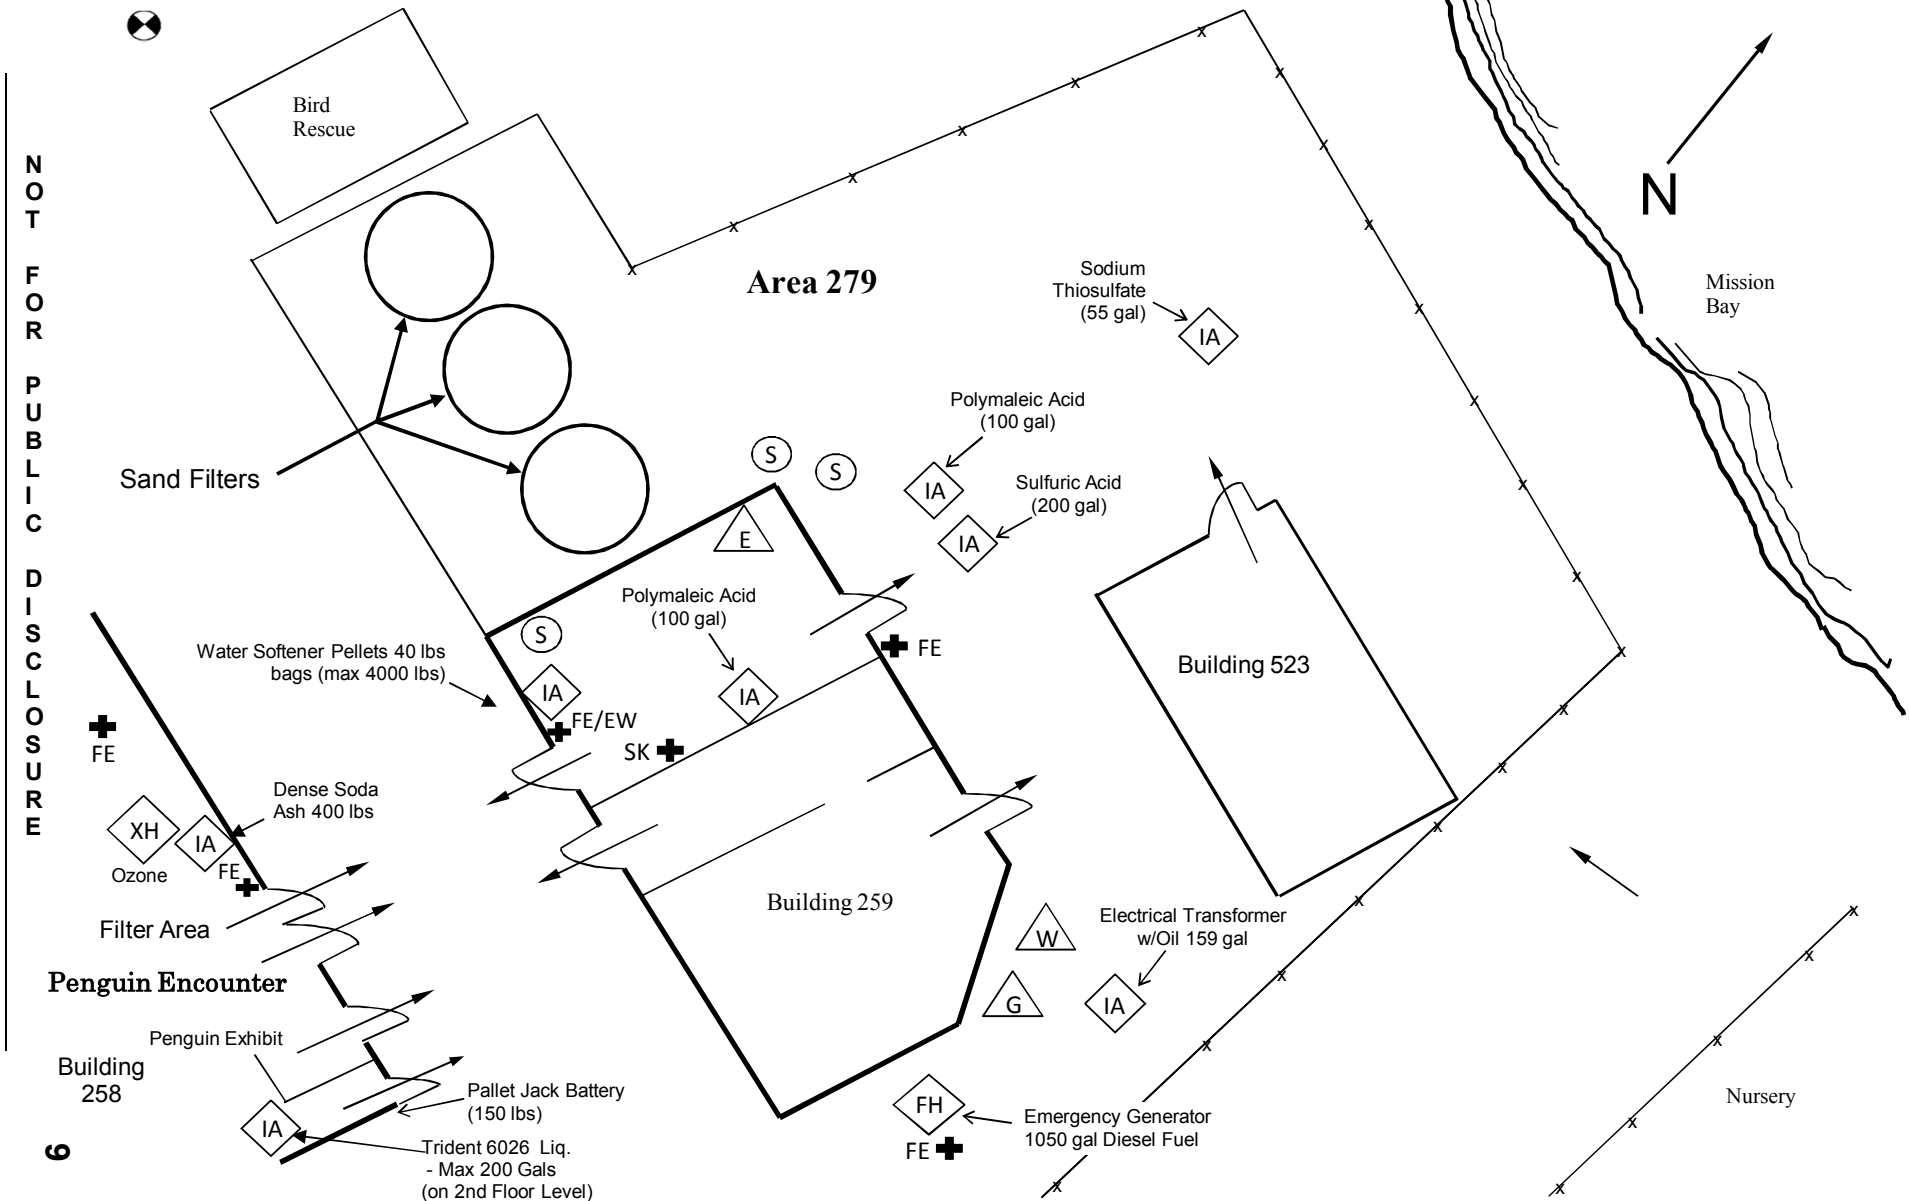

Coordinates: E-5

SITE MAP (Page 11 of 21)

EST#: 100905

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Date: 2/28/2019

Business Address: 500 Sea World Dr, San Diego, CA


Zip Code: 92109

FOR OFFICE USE ONLY

Reviewed By: _____

Date: _____

NOT FOR PUBLIC DISCLOSURE

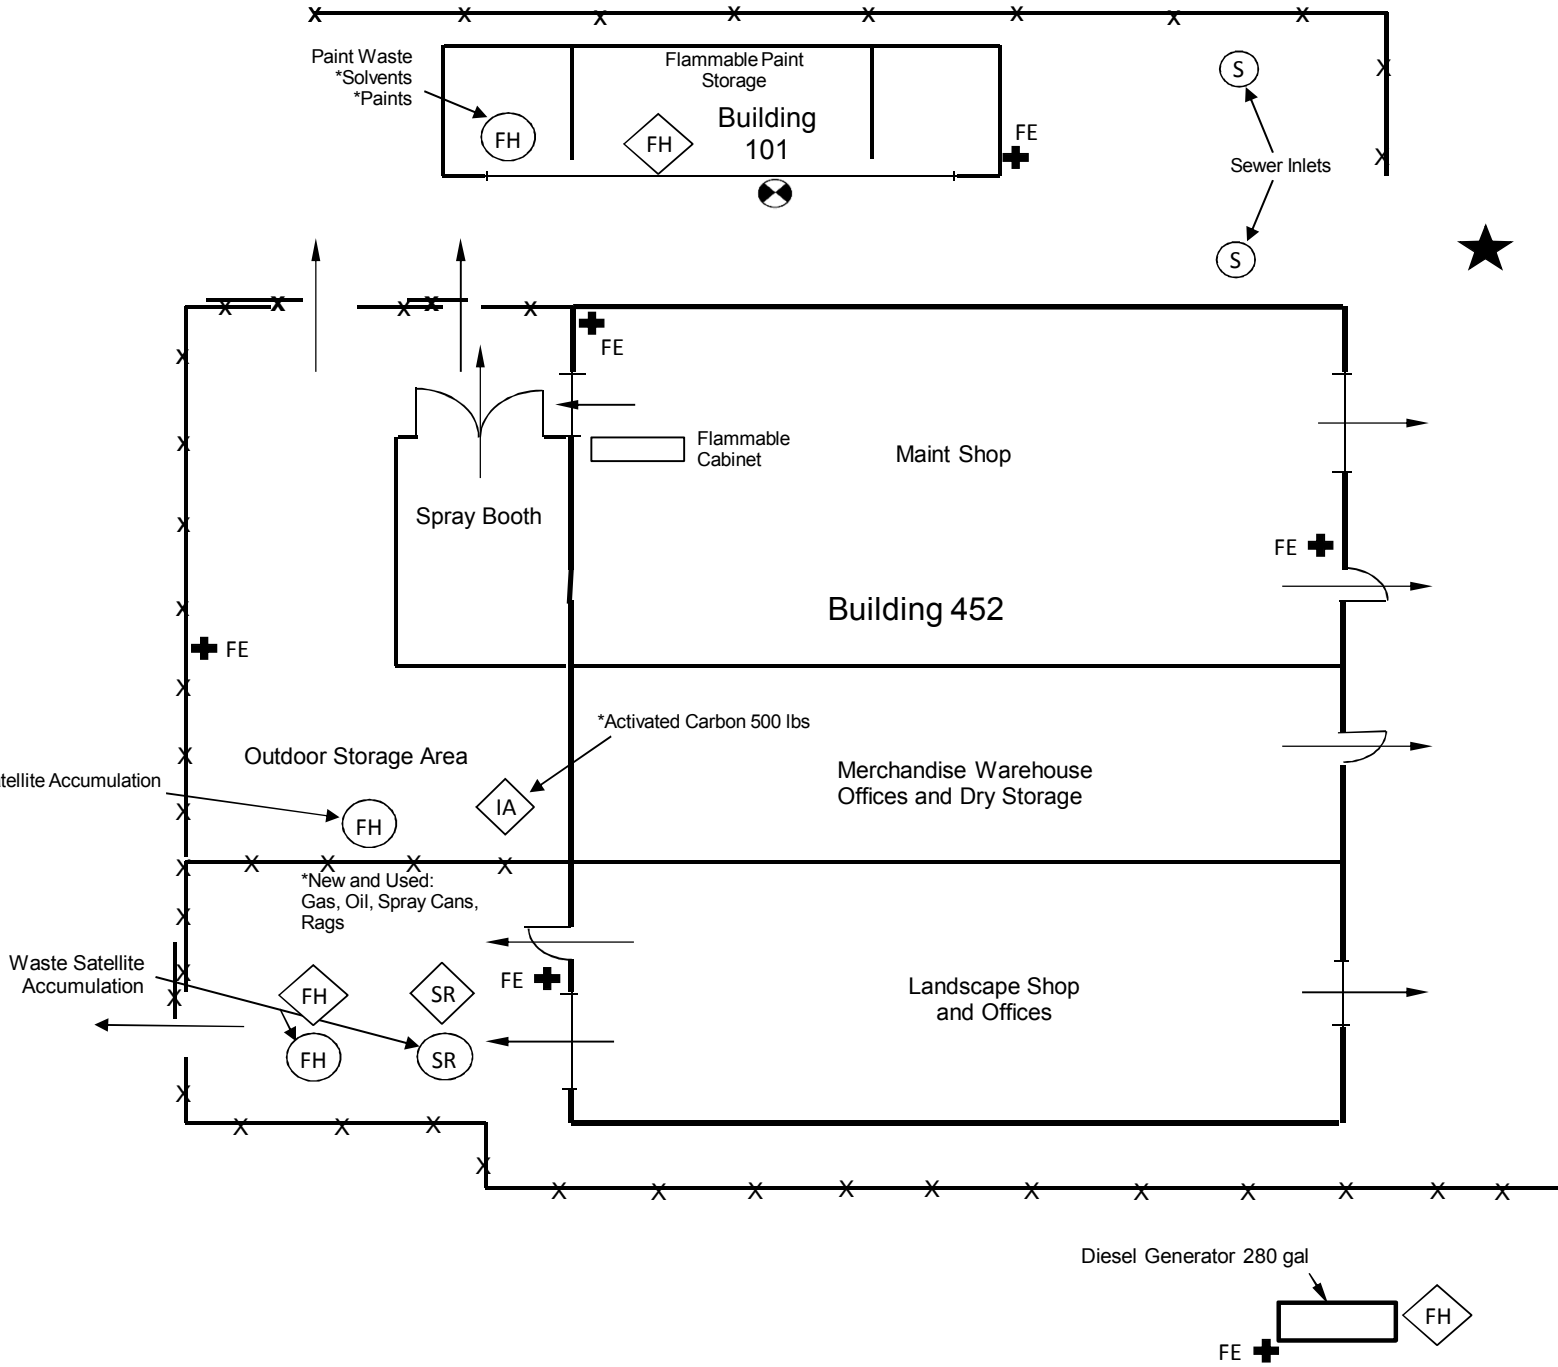

Coordinates: F-5

SITE MAP (Page 12 of 21)

EST#: 100905

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Business Address: 500 Sea World Dr, San Diego, CA

Date: 2/28/2019


Zip Code: 92109

FOR OFFICE USE ONLY

Reviewed By: _____

Date: _____


NOT
FOR
PUBLIC
DISCLOSURE

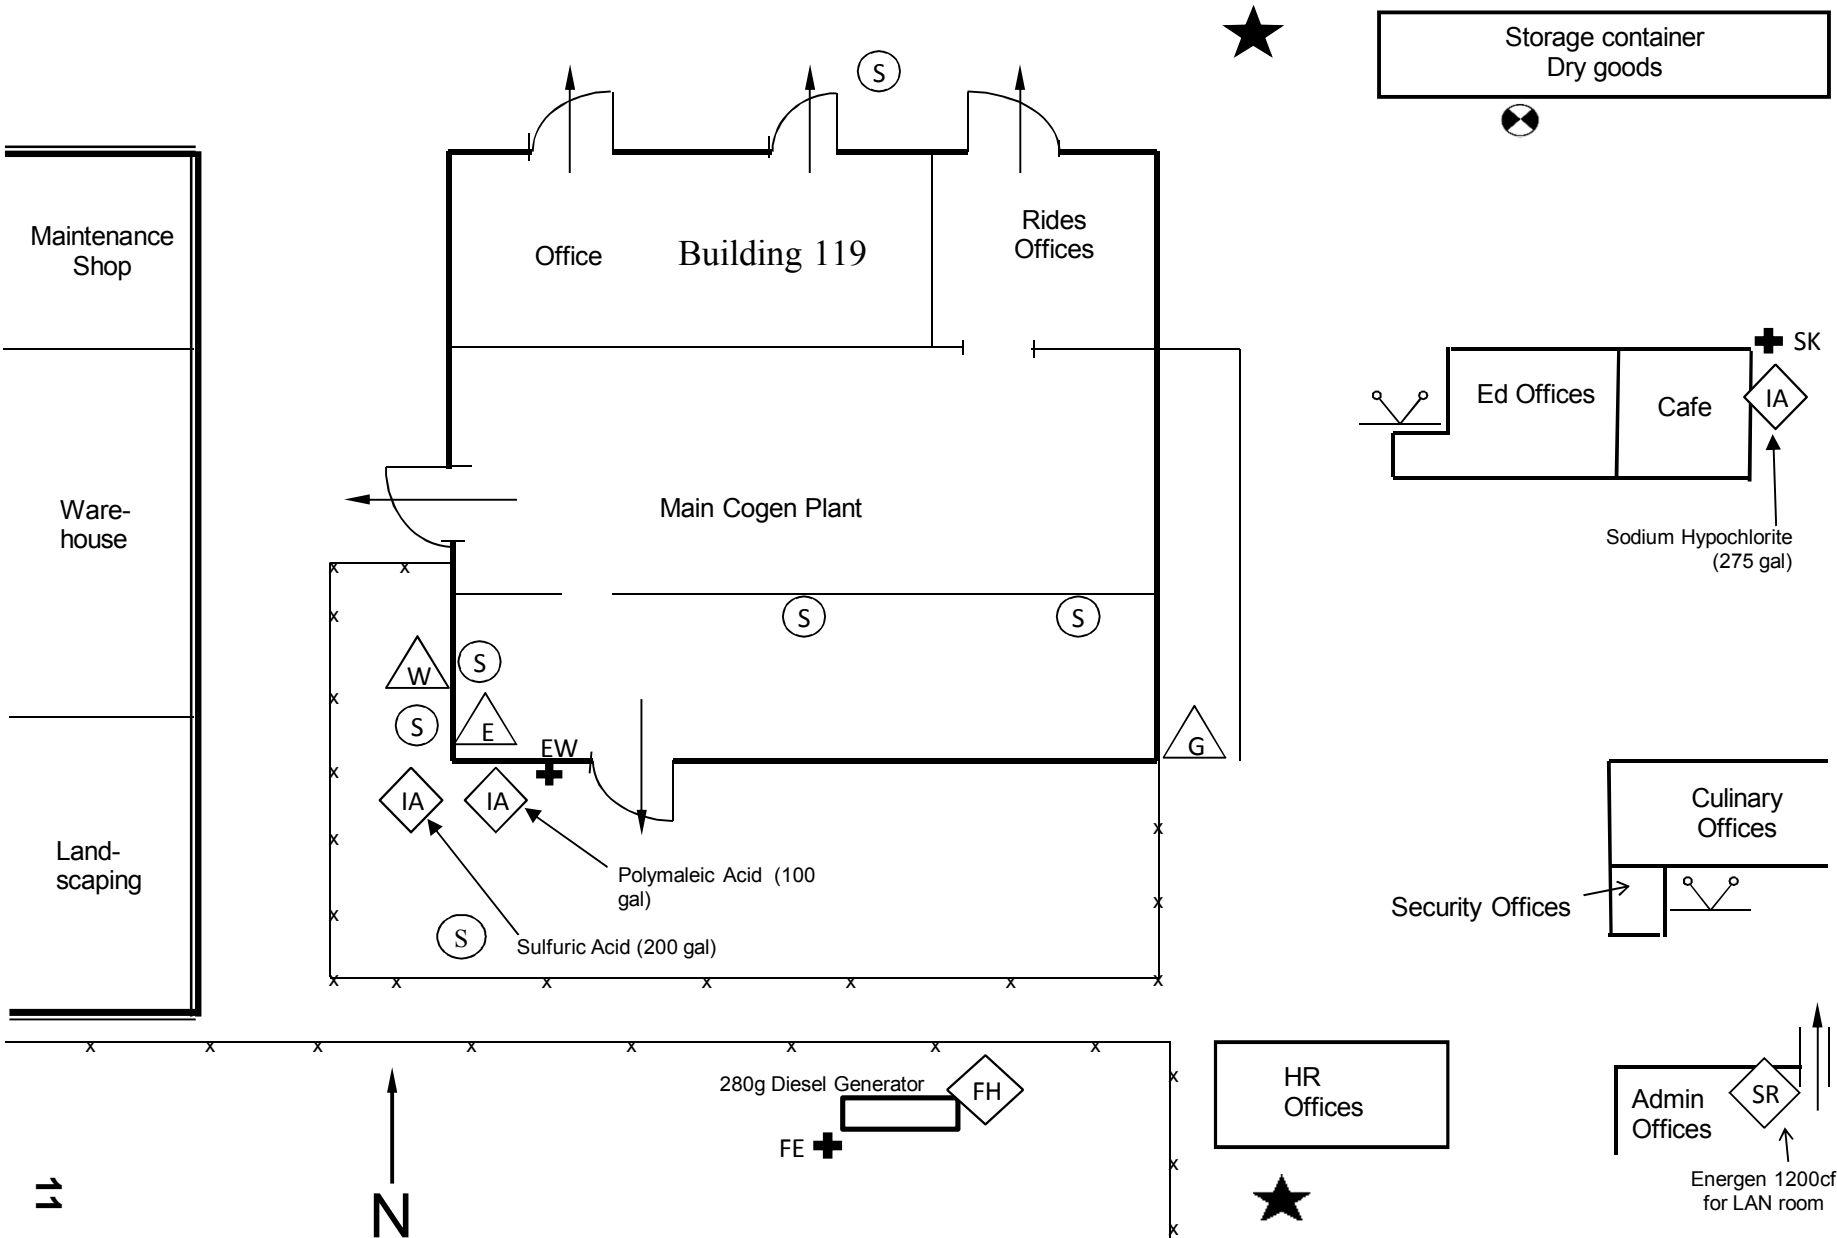


Thomas Bros. Coordinates: 1268-B3
Business Name: SeaWorld San Diego
Business Address: 500 Sea World Dr, S


Date: 2/28/2019
Zip Code: 92109

FOR OFFICE USE ONLY
Reviewed By: _____
Date: _____

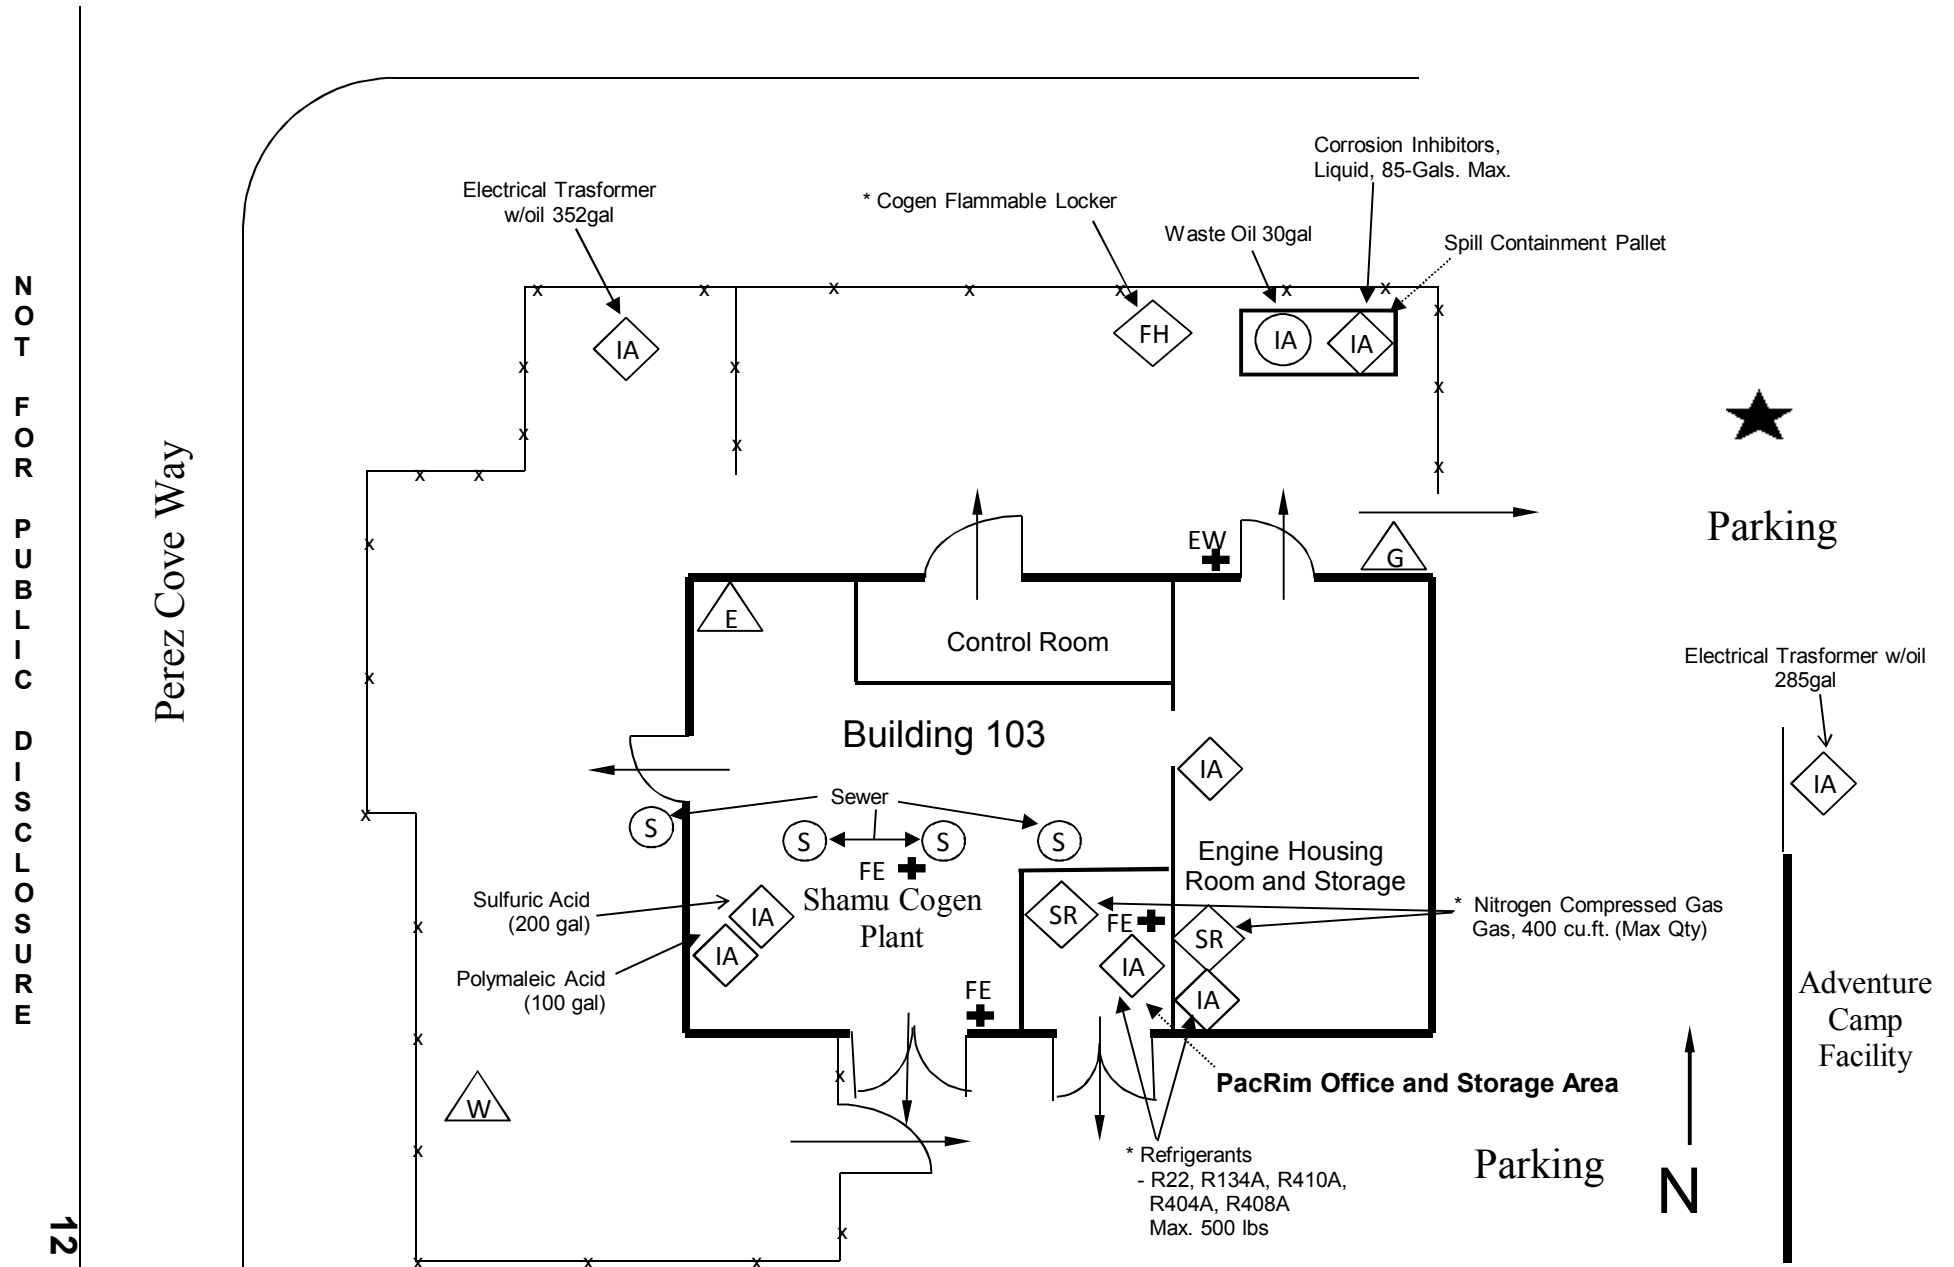

NOT FOR PUBLIC DISCLOSURE

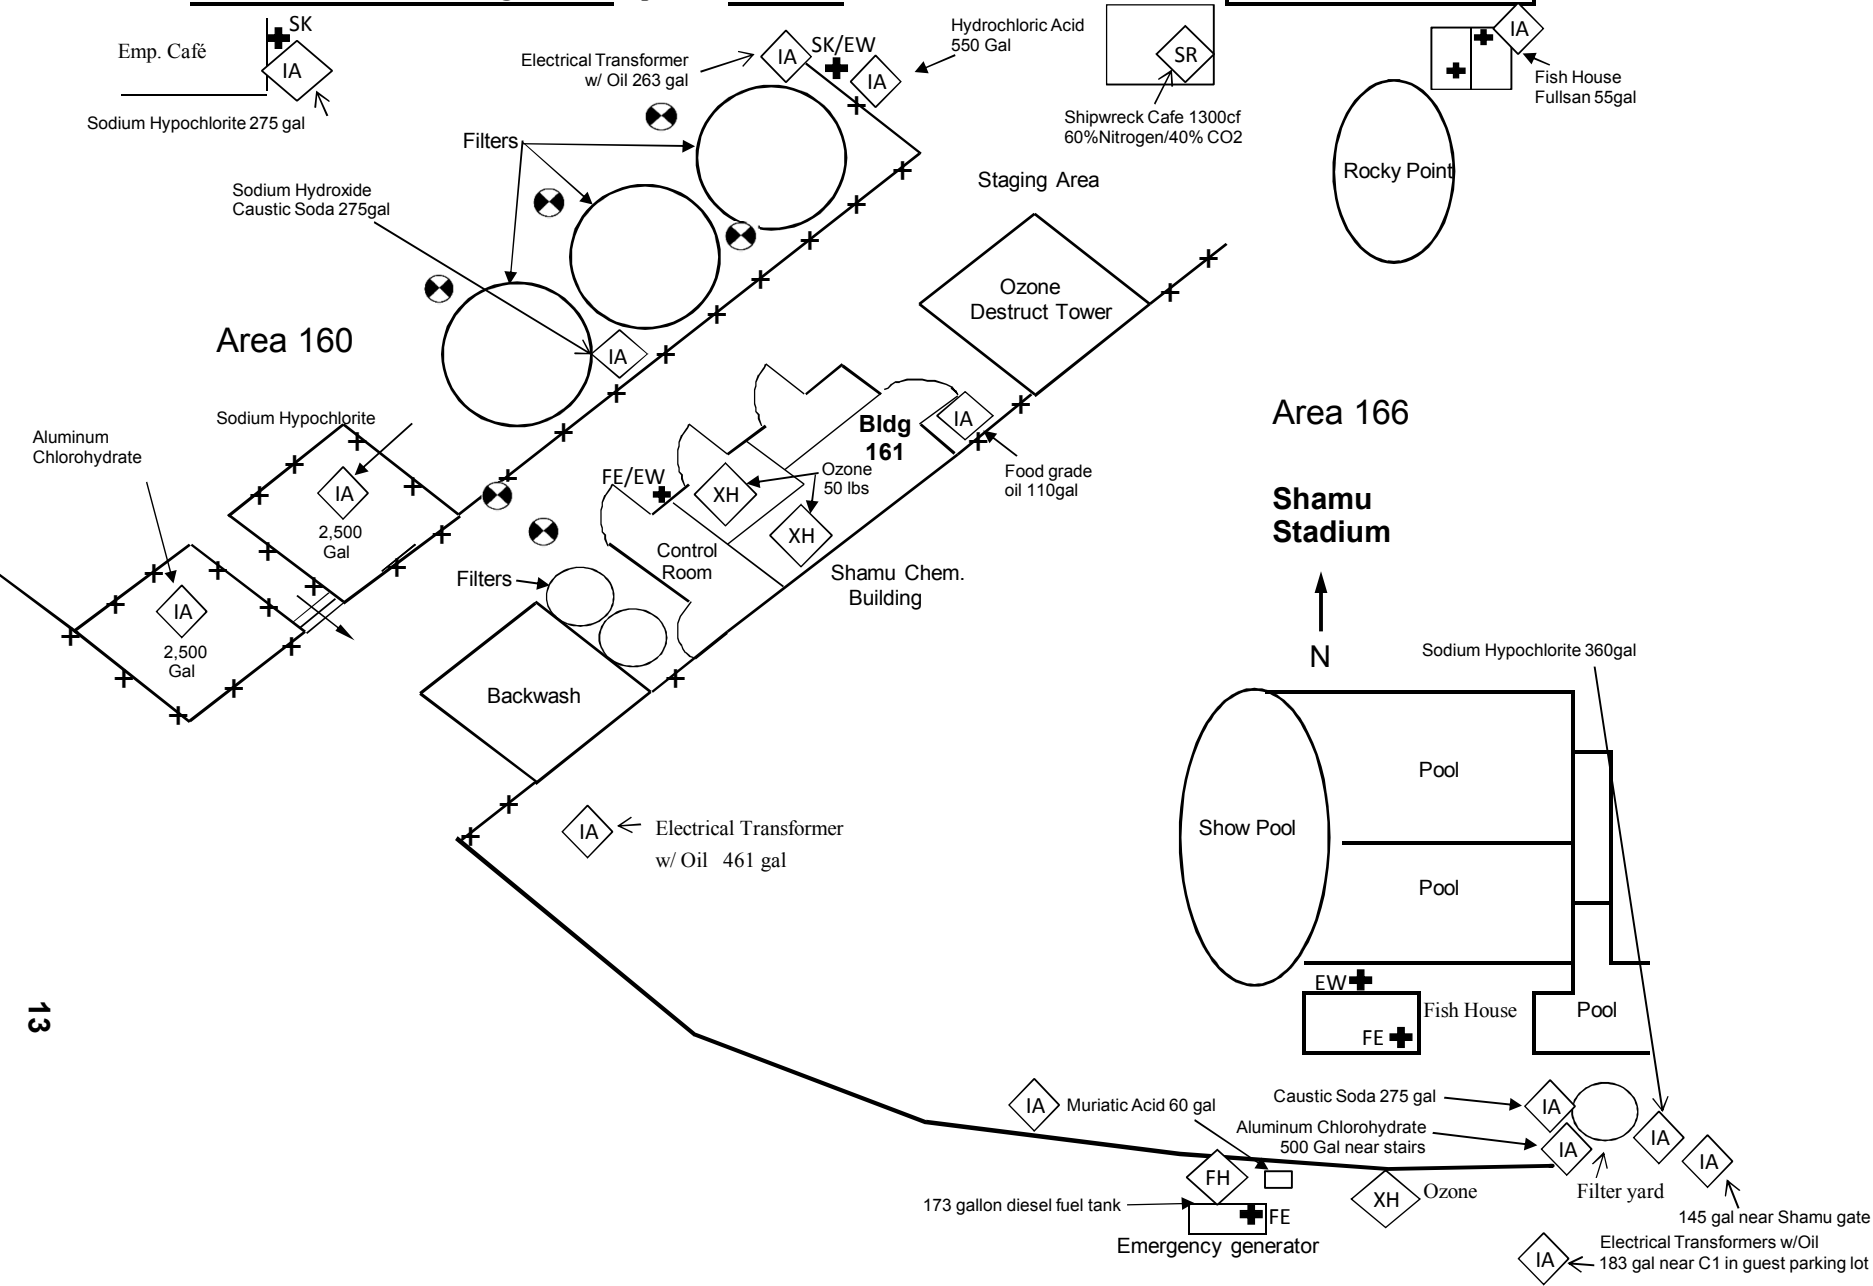

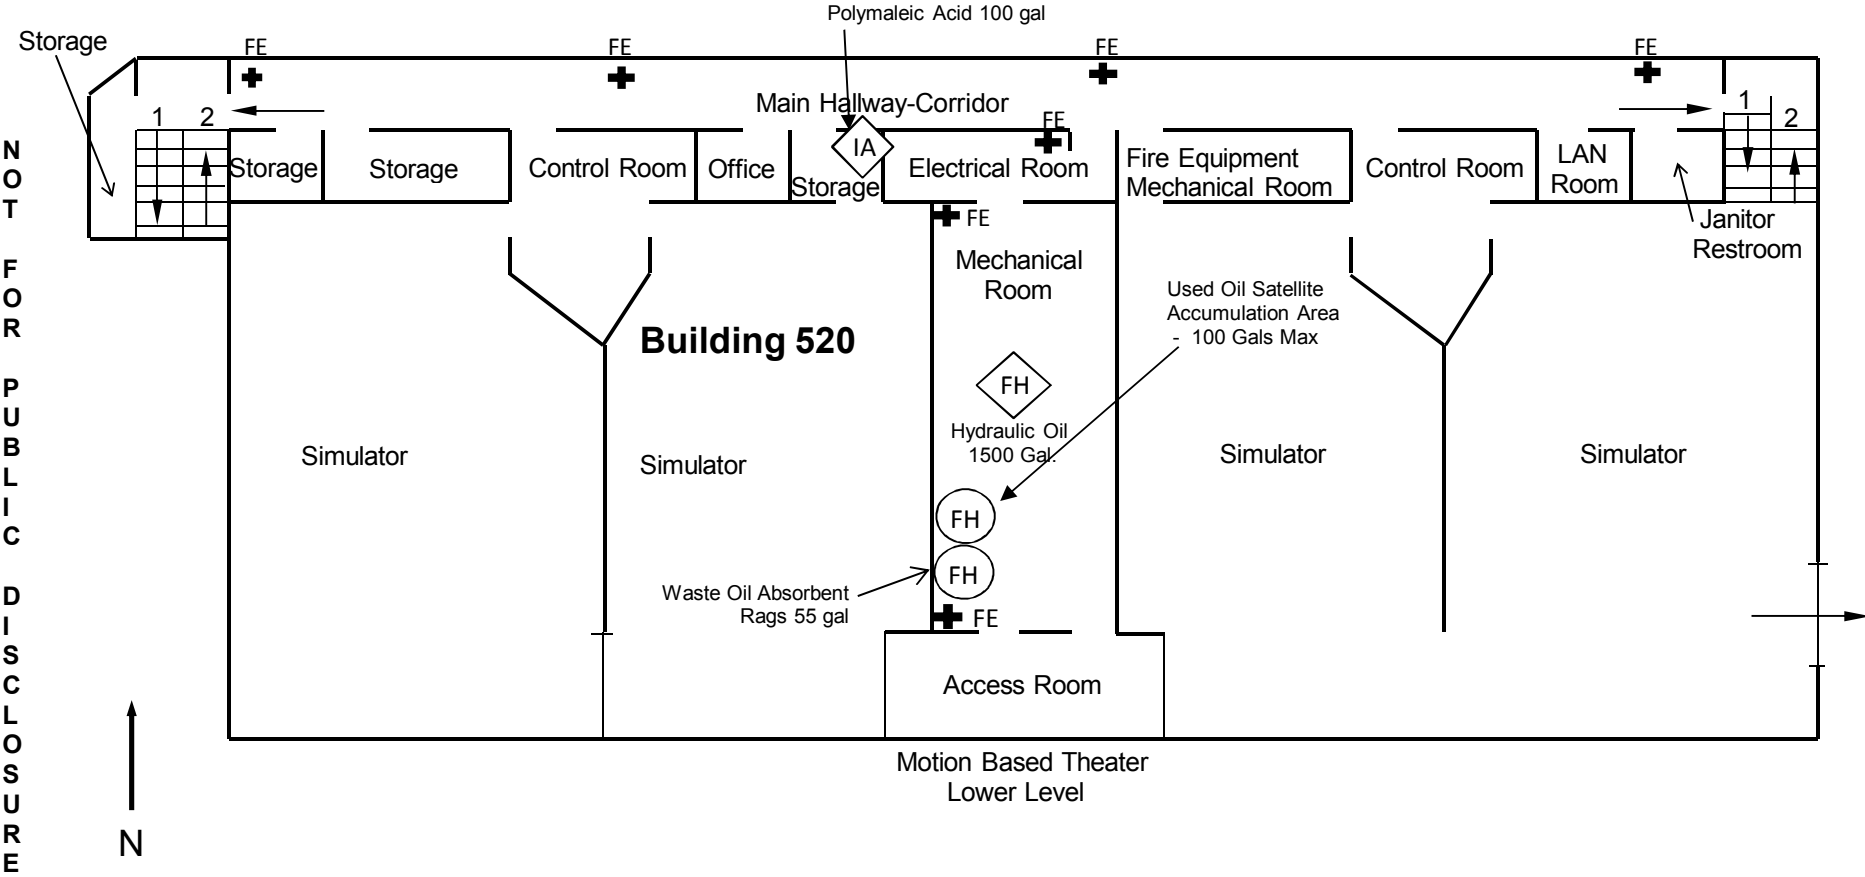

Coordinates: N-7

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Business Address: 500 Sea World Dr, San Diego, CA

SITE MAP (Page 16 of 21)

Date: 2/28/2019

Zip Code: 92109

E'S'#: 100905

FOR OFFICE USE ONLY	
Reviewed By:	
Date:	

500 cf Helium used at Nautilus Ampitheater and Front of Park for Seasonal Summer Digerables

N O T F O R P U B L I C D I S C L O S U R E

[This page intentionally left blank -- Reserved]

Business Address: 500 Sea World Dr, San Diego, CA

SITE MAP (Page 17 of 21)

Date: 2/28/2019


Zip Code: 92109

EST#: 100905

FOR OFFICE USE ONLY

Reviewed By:

Date:

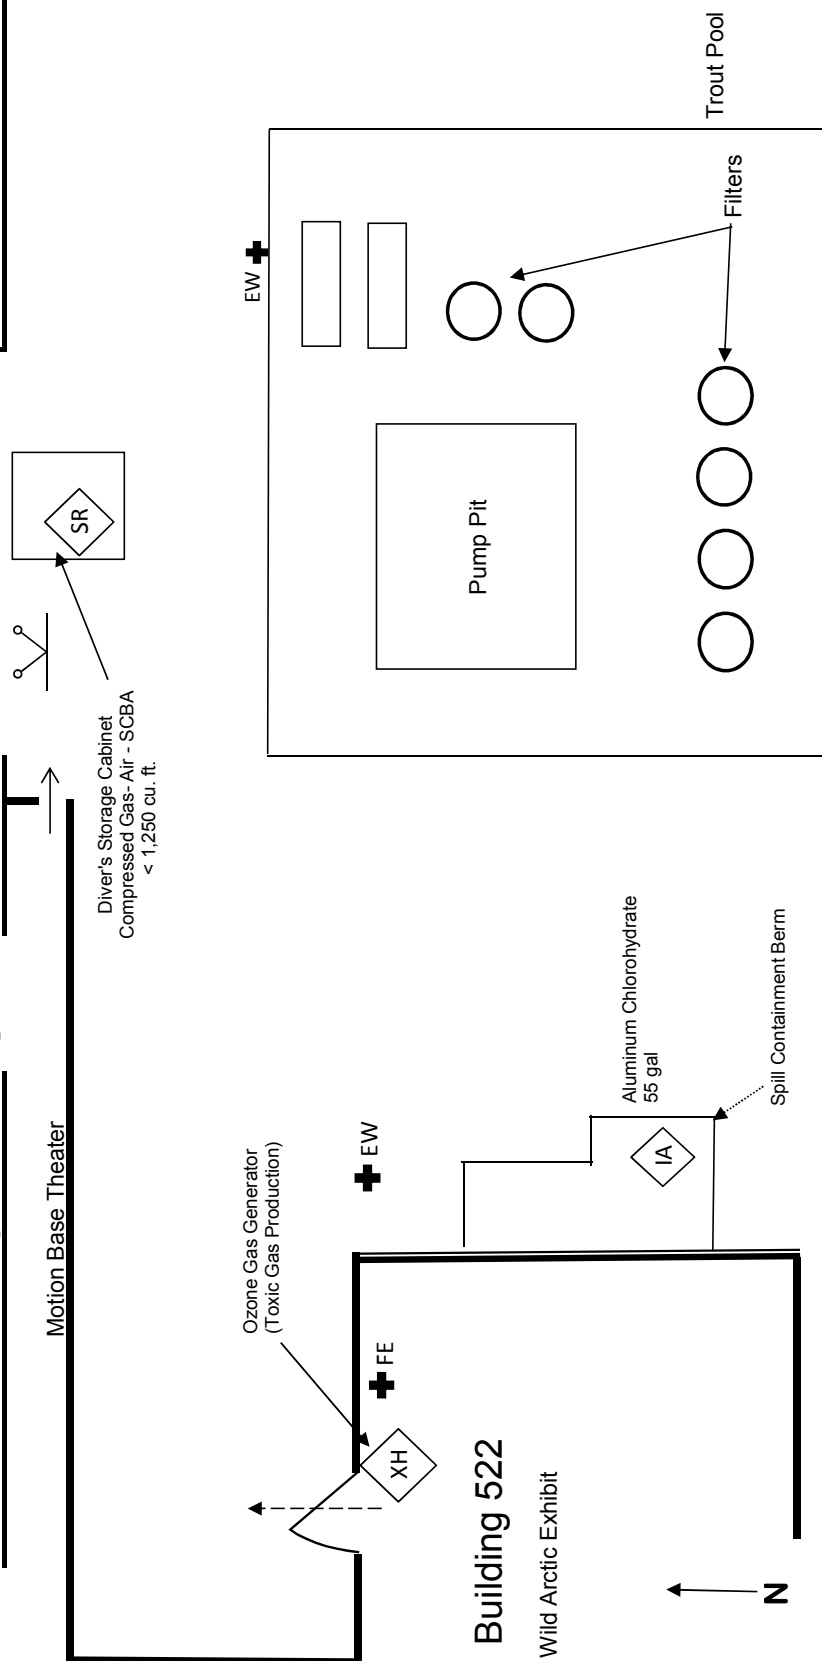

NOT FOR PUBLIC DISCLOSURE

Coordinates: Q-4

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Business Address: 500 Sea World Dr, San Diego, CA

SITE MAP (Page 18 of 21)

Date: 2/28/2019


Zip Code: 92109

EST#: 100905

FOR OFFICE USE ONLY

Reviewed By: _____

Date: _____

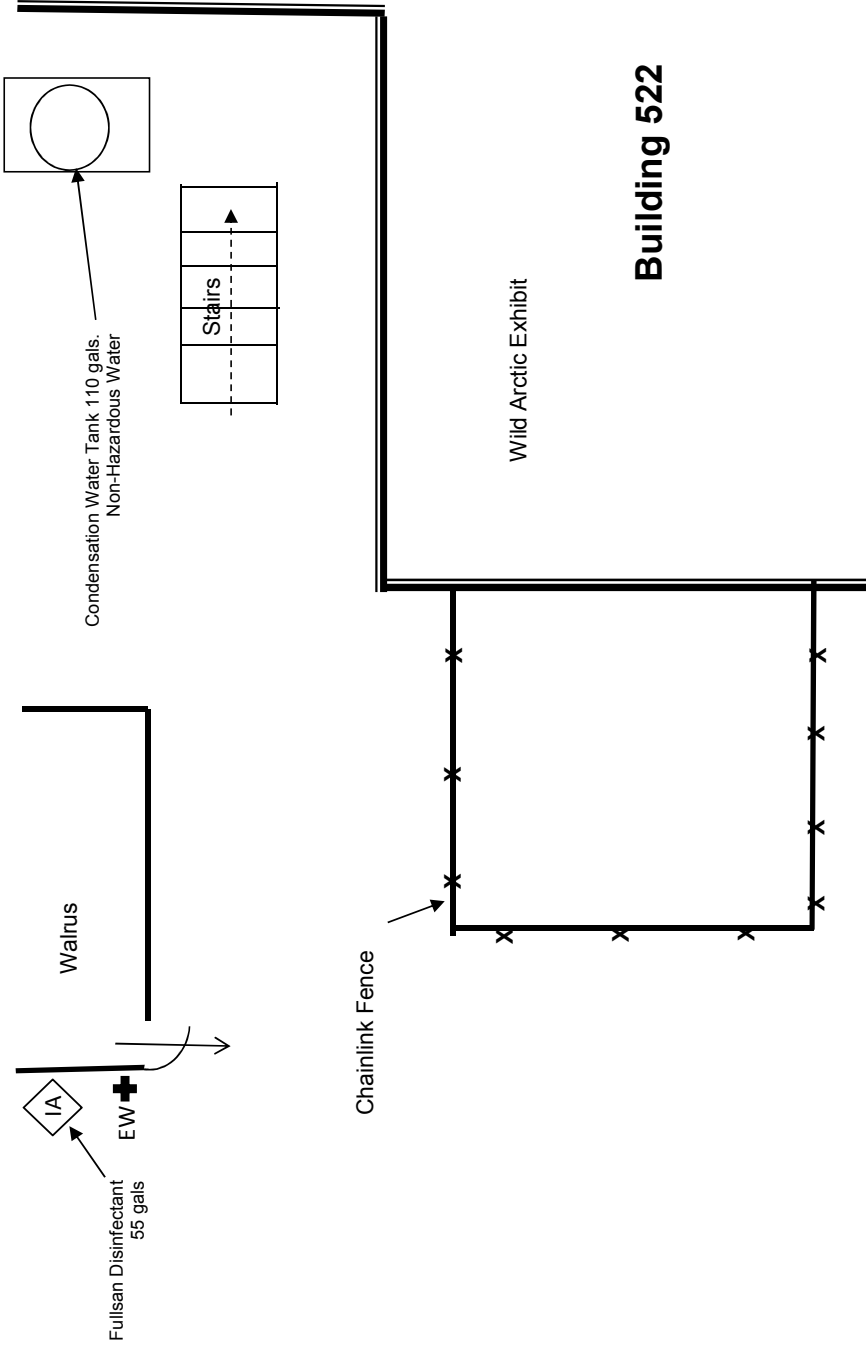

NOT FOR PUBLIC DISCLOSURE

Coordinates: S-6

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Business Address: 500 Sea World Dr, San Diego, CA

SITE MAP (Page 19 of 21)

Date: 2/28/2019


Zip Code: 92109

EST # 100905

FOR OFFICE USE ONLY

Reviewed By: _____

Date: _____

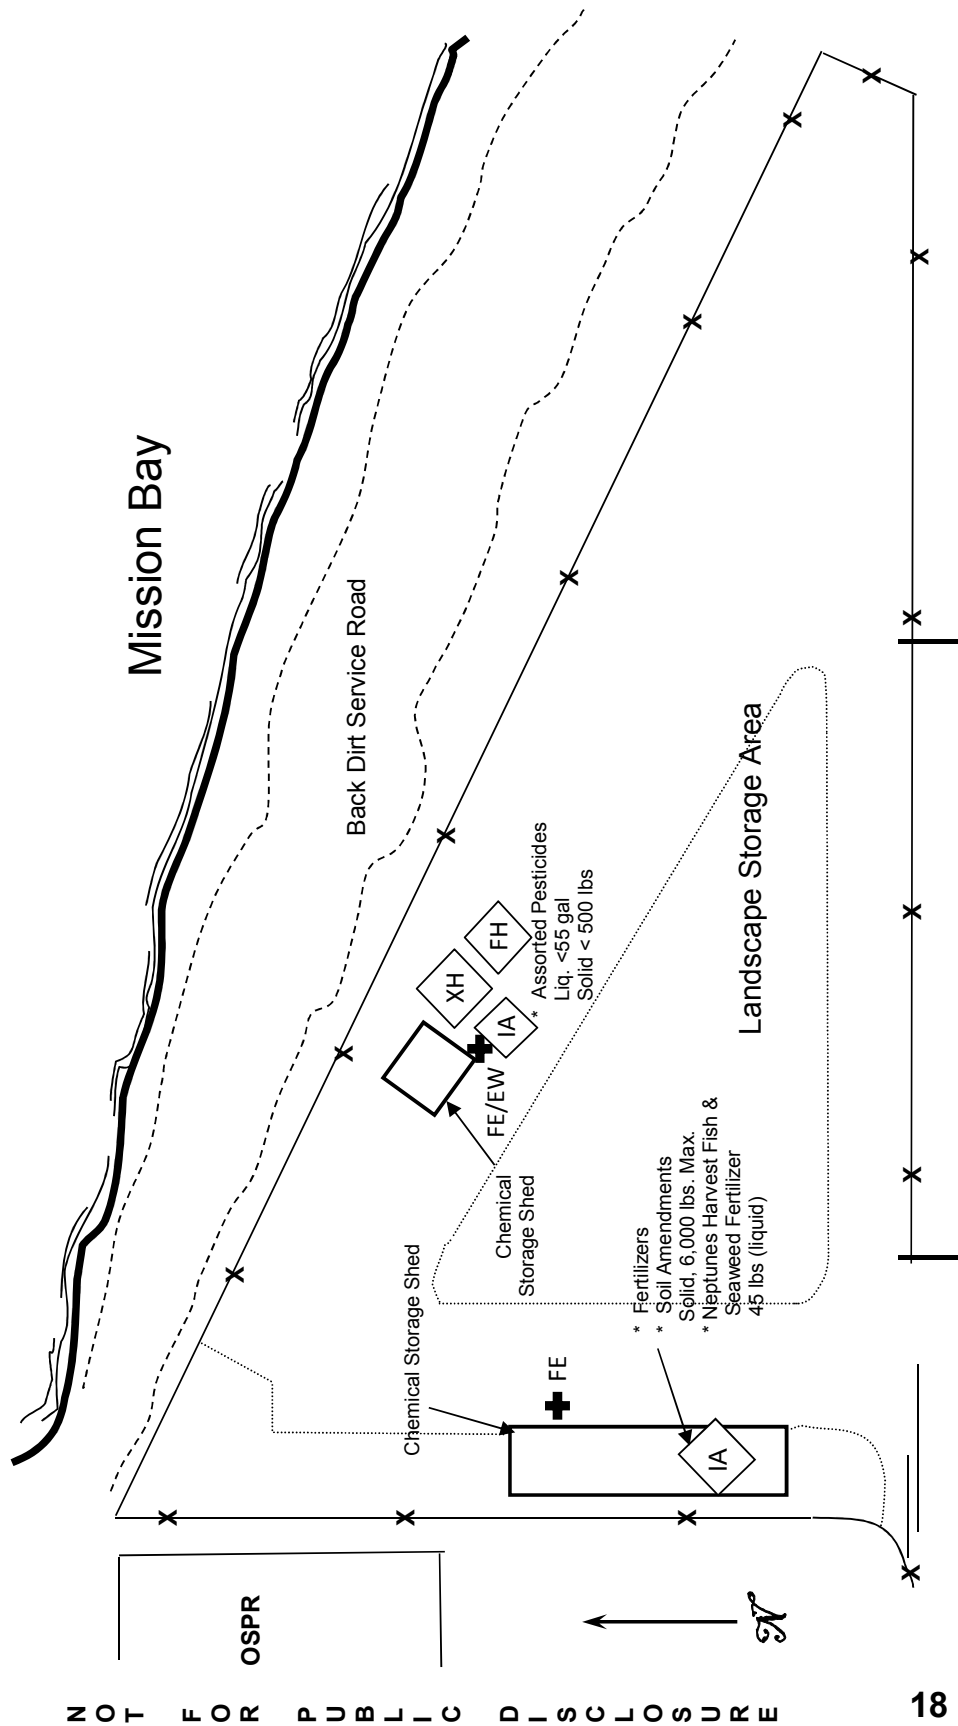

Coordinates: Q-3

Thomas Bros. Coordinates: 1268-B3

Business Name: SeaWorld San Diego

Business Address: 500 Sea World Dr, San Diego, CA

SITE MAP (Page 20 of 21)

Date: 2/28/2019

Zip Code: 92109


EST#100905 H # 100905

FOR OFFICE USE ONLY

Reviewed By:


Date:

NOT FOR PUBLIC DISCLOSURE

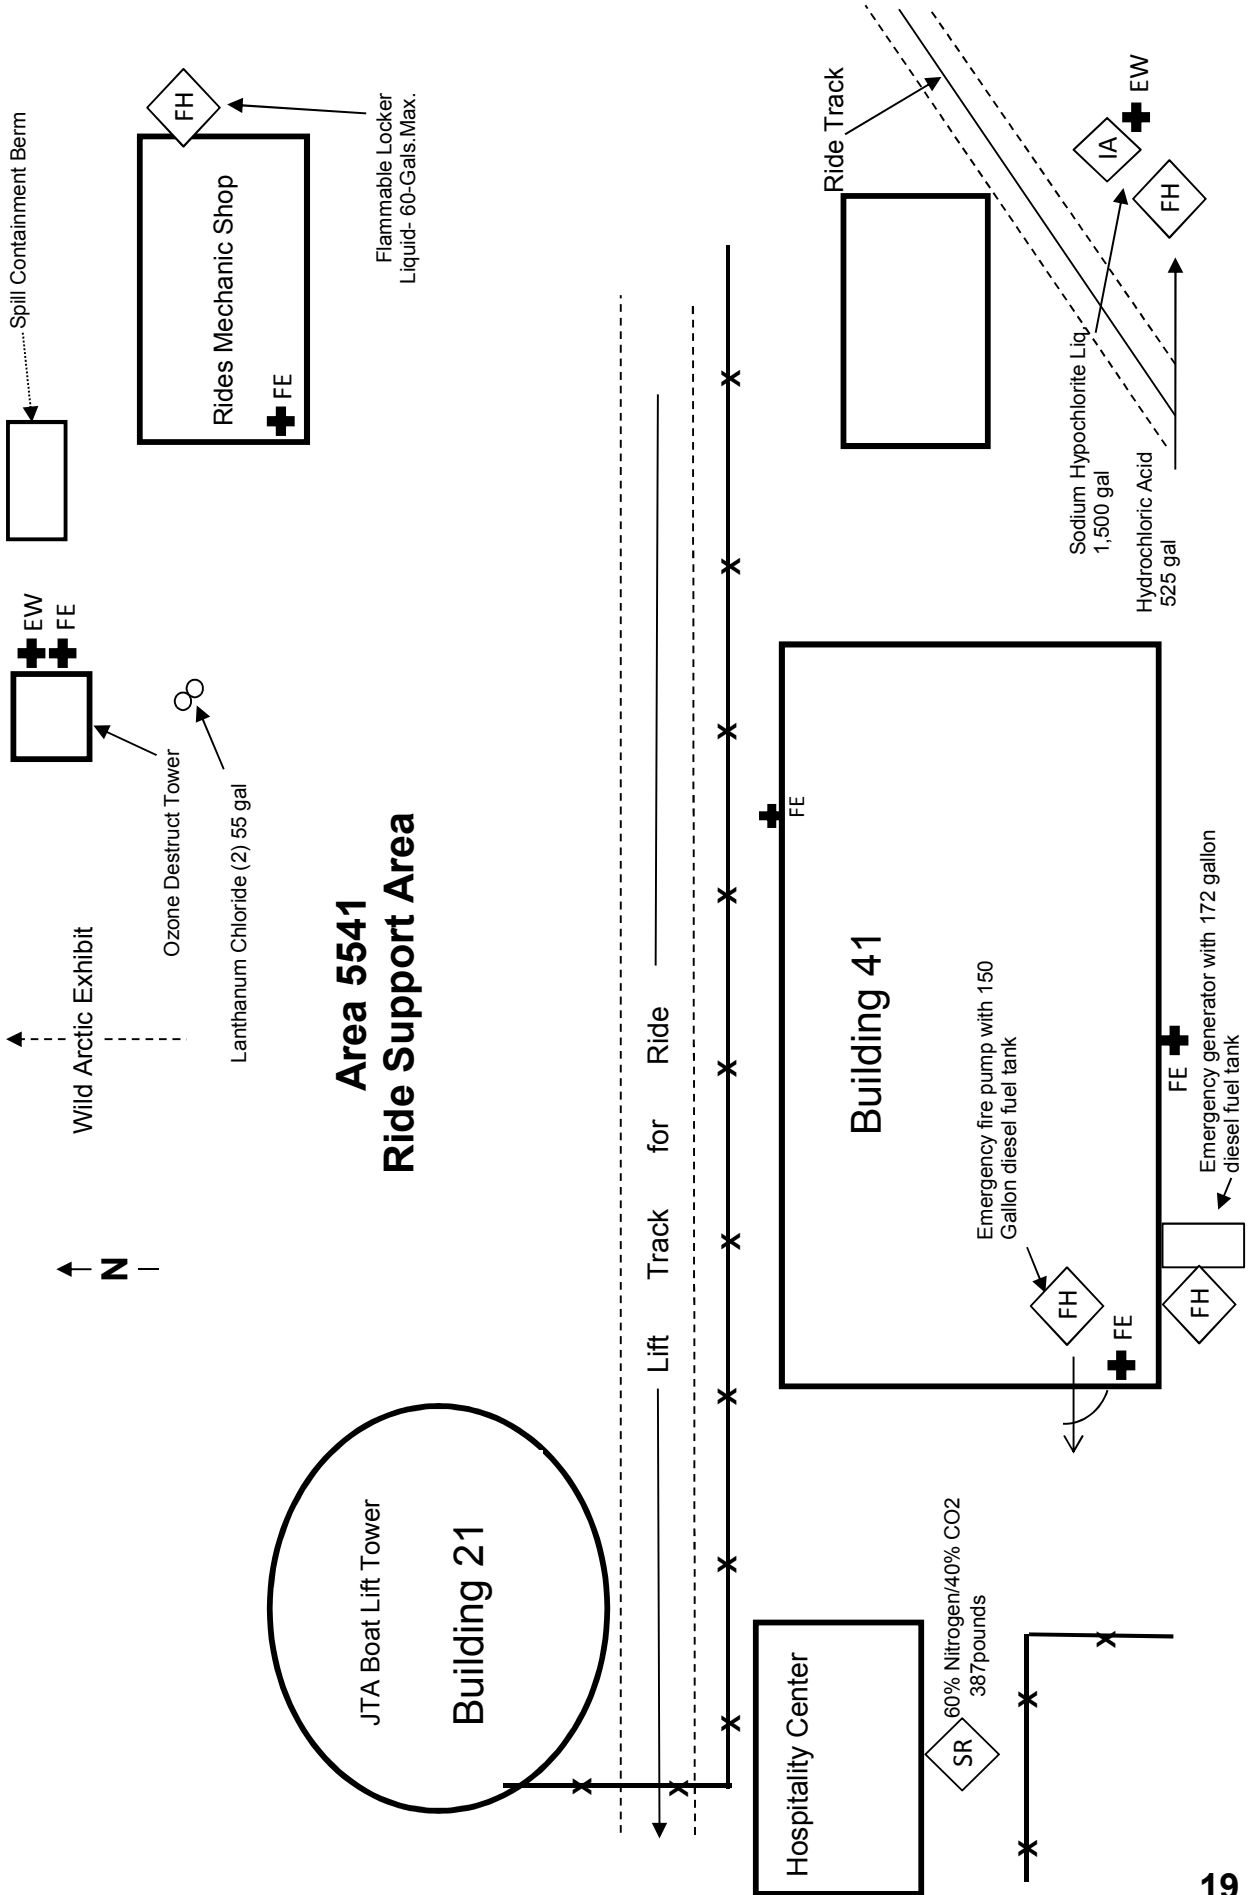

Reviewed By:

Date:



CALIFORNIA ENVIRONMENTAL REPORTING SYSTEM (CERS) CONSOLIDATED EMERGENCY RESPONSE / CONTINGENCY PLAN

Prior to completing this Plan, please refer to the INSTRUCTIONS FOR COMPLETING A CONSOLIDATED CONTINGENCY PLAN

A. FACILITY IDENTIFICATION AND OPERATIONS OVERVIEW

FACILITY ID #	3 7 0 0 0 1 0 0 9 0 5	CERS ID # 10383472	DATE OF PLAN PREPARATION/REVISION (MM/DD/YYYY) 02/28/2019
BUSINESS NAME (Same as Facility Name or DBA - Doing Business As)			
Sea World			
BUSINESS SITE ADDRESS			
500 Sea World Dr.			
BUSINESS SITE CITY		CA	ZIP CODE 92109
San Diego			
TYPE OF BUSINESS (e.g., Painting Contractor)		INCIDENTAL OPERATIONS (e.g., Fleet Maintenance)	
Theme Park			
THIS PLAN COVERS CHEMICAL SPILLS, FIRES, AND EARTHQUAKES INVOLVING (Check all that apply):			
☒ 1. HAZARDOUS MATERIALS; ☒ 2. HAZARDOUS WASTES			

B. INTERNAL RESPONSE

INTERNAL FACILITY EMERGENCY RESPONSE WILL OCCUR BY (Check all that apply):
☒ 1. CALLING PUBLIC EMERGENCY RESPONDERS (e.g., 9-1-1) ☒ 2. CALLING HAZARDOUS WASTE CONTRACTOR ☒ 3. ACTIVATING IN-HOUSE EMERGENCY RESPONSE TEAM

C. EMERGENCY COMMUNICATIONS, PHONE NUMBERS AND NOTIFICATIONS

In the event of an emergency involving hazardous materials and/or hazardous waste, all facilities must IMMEDIATELY:

1. Notify facility personnel and evacuate if necessary in accordance with the Emergency Action Plan (Title 8 California Code of Regulations §3220);
2. Notify local emergency responders by calling 9-1-1;
3. Notify the local Unified Program Agency (UPA) at the phone number below; and
4. Notify the State Warning Center at (800) 852-7550.

Facilities that generate, treat, store or dispose of hazardous waste have additional responsibilities to notify and coordinate with other response agencies. Whenever there is an imminent or actual emergency situation such as an explosion, fire, or release, the Emergency Coordinator must follow the appropriate requirements for the category of facility and type of release involved:

1. Title 22 California Code of Regulations §66265.56. Emergency Procedures for generators of 1,000 kilograms or more of hazardous waste in any calendar month.
2. Title 22 California Code of Regulations §66265.196. Response to Leaks or Spills and Disposition of Leaking or Unfit-for-Use Tank Systems.
3. Title 40 Code of Federal Regulations §302.6. Notification requirements for a release of a hazardous substance equal to or greater than the reportable quantity.
4. Title 22 California Code of Regulations §66262.34(d)(2) and Title 40 Code of Federal Regulations §262.34(d)(5)(ii) for generators of less than 1000 kilograms of hazardous waste in any calendar month.

Following notification and before facility operations are resumed in areas of the facility affected by the incident, the Emergency Coordinator shall notify the local UPA and the local fire department's hazardous materials program, if necessary, that the facility is in compliance with requirements to:

1. Provide for proper storage and disposal of recovered waste, contaminated soil or surface water, or any other material that results from an explosion, fire, or release at the facility; and
2. Ensure that no material that is incompatible with the released material is transferred, stored, or disposed of in areas of the facility affected by the incident until cleanup procedures are completed.

EMERGENCY RESPONSE PHONE NUMBERS:	AMBULANCE, FIRE, POLICE AND CHP 9-1-1 CALIFORNIA STATE WARNING CENTER (CSWC)/CAL OES (800) 852-7550 NATIONAL RESPONSE CENTER (NRC) (800) 424-8802 POISON CONTROL CENTER (800) 222-1222 LOCAL UNIFIED PROGRAM AGENCY (UPA) (858) 505-6880	C1.
	OTHER (Specify): Emergency Response Clean up - Pacific Trans	C2. (619) 441-1818 C3.
NEAREST MEDICAL FACILITY / HOSPITAL NAME:	In house EMT/RNs / UCSD Hillcrest for all others	C4. (858) 657-7000 C5.

AGENCY NOTIFICATION PHONE NUMBERS:	CALIFORNIA DEPT. OF TOXIC SUBSTANCES CONTROL (DTSC) (916) 255-3545 REGIONAL WATER QUALITY CONTROL BOARD (RWQCB) (619) 516-1990	C6.
	U.S. ENVIRONMENTAL PROTECTION AGENCY (US EPA) (800) 300-2193 CALIFORNIA DEPT. OF FISH AND WILDLIFE (CDFW) (916) 358-2900 U.S. COAST GUARD (USCG) (202) 267-2180 CAL OSHA (916) 263-2800 CAL FIRE OFFICE OF THE STATE FIRE MARSHAL (OSFM) (916) 323-7390	
	OTHER (Specify): Local OESSpillResponse-WaterBoard	C7. (858) 822-8344 C8.
	OTHER (Specify): SDGE	C9. (800) 611-7343 C10.

Check the applicable boxes to indicate your facility's procedures for containing spills and preventing and mitigating releases, fires and/or explosions.		D1.
☒	1. MONITOR FOR LEAKS, RUPTURES, PRESSURE BUILD-UP, ETC.;	
☒	2. PROVIDE STRUCTURAL PHYSICAL BARRIERS (e.g., Portable spill containment walls, built-in berms);	
☒	3. PROVIDE ABSORBENT PHYSICAL BARRIERS (e.g., Pads, spill pigs, spill pillows);	
☒	4. COVER OR BLOCK FLOOR AND/OR STORM DRAINS;	
☐	5. LINED TRENCH DRAINS AND/OR SUMPS;	
☒	6. AUTOMATIC FIRE SUPPRESSION SYSTEM;	
☒	7. ELIMINATE SOURCES OF IGNITION FOR FLAMMABLE HAZARDS;	
☒	8. STOP PROCESSES AND/OR OPERATIONS;	
☒	9. AUTOMATIC / ELECTRONIC EQUIPMENT SHUT-OFF SYSTEM;	
☒	10. SHUT OFF WATER, GAS, ELECTRICAL UTILITIES;	
☒	11. CALL 9-1-1 FOR PUBLIC EMERGENCY RESPONDER ASSISTANCE AND/OR MEDICAL AID;	
☒	12. NOTIFY AND EVACUATE PERSONS IN ALL THREATENED AND/OR IMPACTED AREAS;	
☒	13. ACCOUNT FOR EVACUATED PERSONS IMMEDIATELY AFTER EVACUATION;	
☒	14. PROVIDE PROTECTIVE EQUIPMENT FOR ON-SITE EMERGENCY RESPONSE TEAM;	
☒	15. REMOVE CONTAINERS AND/OR ISOLATE AREAS;	
☒	16. HIRE LICENSED HAZARDOUS WASTE CONTRACTOR;	
☒	17. USE ABSORBENT MATERIAL FOR SPILL CONTAINMENT;	
☒	18. VACUUM SUCTION USING APPROPRIATE VACUUM (e.g., Intrinsically safe) FOR SPILL CONTROL AND/OR CLEANUP;	
☒	19. DECONTAMINATE PERSONNEL AND EQUIPMENT WITHIN DESIGNATED AREA AND DISPOSE OF WASTEWATER AS HAZARDOUS WASTE;	
☒	20. PROVIDE SAFE TEMPORARY STORAGE OF HAZARDOUS WASTE GENERATED DURING EMERGENCY ACTIONS;	
☐	21. OTHER (Specify):	D2.

THE FOLLOWING ALARM SIGNAL(S) WILL BE USED TO BEGIN EVACUATION OF THE FACILITY (Check all that apply):	E1.
☐ 1. BELLS;	E2.
☐ 2. HORNS/SIRENS;	
☒ 3. VERBAL (i.e., Shouting);	
☒ 4. OTHER (Specify): Building alarms, bull horns for guest areas	

See Site Map

Note: The Emergency Coordinator must account for all onsite employees and visitors after evacuation.

☐ 1. WRITTEN PROCEDURES DESCRIBING ROUTES, EXITS, AND ASSEMBLY AREAS;

☒ 2. EVACUATION MAP(S) DEPICTING ROUTES, EXITS, AND ASSEMBLY AREAS;

☐ 3. OTHER (Specify):

Note: Evacuation procedures and/or maps should be posted in visible facility locations and must be included in the Contingency Plan.

ADVANCE ARRANGEMENTS FOR LOCAL EMERGENCY SERVICES (Check one of the following):		F1.
☐	1. HAVE BEEN DETERMINED NOT NECESSARY;	
☒	2. THE FOLLOWING ARRANGEMENTS HAVE BEEN MADE (Specify):	F2.
The local EMS/Fire responders are here dozens of times a year with guest transports. They are familiar with our location and staff.		
Note: Advance arrangements with local fire and police departments, hospitals, state and local emergency response teams, and/or emergency services contractors should be made for your facility, if necessary. Large Quantity Generators must describe arrangements in the Contingency Plan.		

G. EMERGENCY EQUIPMENT

Check the applicable boxes to list emergency response equipment available at the facility, identify the location(s) where the equipment is kept, and indicate the equipment's capability, if applicable.

TYPE	EQUIPMENT AVAILABLE G1.	LOCATION G2.	CAPABILITY G3.
EXAMPLE	☒ CHEMICAL PROTECTIVE GLOVES	SPILL RESPONSE KIT	SINGLE USE, OIL RESISTANT ONLY
Safety and First Aid	1. ☐ CHEMICAL PROTECTIVE SUITS, APRONS, AND/OR VESTS		
	2. ☐ CHEMICAL PROTECTIVE GLOVES		
	3. ☐ CHEMICAL PROTECTIVE BOOTS		
	4. ☐ SAFETY GLASSES, GOGGLES, AND FACE SHIELDS		
	5. ☐ HARD HATS		
	6. ☐ AIR-PURIFYING RESPIRATORS		Employee must be properly trained
	7. ☐ SELF-CONTAINED BREATHING APPARATUS (SCBA)		Employee must be properly trained
	8. ☐ FIRST AID KITS	See Site Map	
	9. ☐ PLUMBED EYEWASH FOUNTAIN AND/OR SHOWER	See Site Map	
	10. ☐ PORTABLE EYEWASH KITS AND/OR STATION		
	11. ☐ OTHER		
Fire Fighting	12. ☐ PORTABLE FIRE EXTINGUISHERS	See Site Map	
	13. ☐ FIXED FIRE SUPPRESSION SYSTEMS AND/OR SPRINKLERS	See Site Map (Pages 3, 7, 11)	
	14. ☐ FIRE ALARM BOXES		
	15. ☐ OTHER		
Spill Control and Clean-Up	16. ☐ ALL-IN-ONE SPILL KIT	See Site Map	
	17. ☐ ABSORBENT MATERIAL		
	18. ☐ CONTAINER FOR USED ABSORBENT		
	19. ☐ BERM AND/OR DIKING EQUIPMENT		
	20. ☐ BROOM		
	21. ☐ SHOVEL		
	22. ☐ VACUUM		
	23. ☐ EXHAUST HOOD		
	24. ☐ SUMP AND/OR HOLDING TANK		
	25. ☐ CHEMICAL NEUTRALIZERS		
	26. ☐ GAS CYLINDER LEAK REPAIR KIT		
	27. ☐ SPILL OVERPACK DRUMS		
	28. ☐ OTHER		
Communications and Alarm Systems	29. ☐ TELEPHONES (e.g., Cellular)	Office	
	30. ☐ INTERCOM AND/OR PA SYSTEM		
	31. ☐ PORTABLE RADIOS		
	32. ☐ AUTOMATIC ALARM CHEMICAL MONITORING EQUIPMENT		Only on Ozone for water treatment processes
Other	33. ☐ OTHER		
	34. ☐ OTHER		

H. EARTHQUAKE VULNERABILITY

Identify areas of the facility that are vulnerable to hazardous materials releases due to seismic motion. These areas require immediate isolation and inspection.

VULNERABLE AREAS (Check all that apply): H1. ☐ 1. HAZARDOUS MATERIALS AND/OR WASTE STORAGE AREAS ☐ 2. PROCESS LINES AND PIPING ☐ 3. LABORATORY ☐ 4. WASTE TREATMENT AREA	LOCATIONS (e.g., Shop, outdoor shed, lab): H2. 1. See Site Map 3. See Site Map page 4 4. See Site Map page 7 and 8

Identify mechanical systems vulnerable to releases / spills due to earthquake-related motion. These systems require immediate isolation and inspection.

VULNERABLE SYSTEMS AND/OR EQUIPMENT (Check all that apply): H3. ☐ 1. SHELVES, CABINETS AND/OR RACKS ☐ 2. TANKS AND SHUT-OFF VALVES ☐ 3. PORTABLE GAS CYLINDERS ☐ 4. EMERGENCY SHUT-OFF AND/OR UTILITY VALVES ☐ 5. SPRINKLER SYSTEMS ☐ 6. STATIONARY PRESSURIZED CONTAINERS (e.g., Propane tank)	LOCATIONS: H4. 1. See Site Map 2. UST shut off across from main pump and top of dock at Marina 3. See Site Map 4. Located in HMBP 5. See Site Map 6. Propane tank in fleet parking lot

I. EMPLOYEE TRAINING

Employee training is required for all employees and/or contractors handling hazardous materials and/or hazardous wastes during normal and/or emergency operations. Most facilities will need to submit a separate Training Plan. However, your CUPA may accept this section as the Training Plan for some small facilities. Employee training plans may include the following content:

• Applicable laws and regulations; • Emergency response plans and procedures; • Safety Data Sheets; • Hazard communication related to health and safety; • Methods for safe handling of hazardous substances; • Hazards of materials and processes (e.g., fire, explosion, asphyxiation); • Hazard mitigation, prevention and abatement procedures; • Coordination of emergency response actions; • Notification procedures for local emergency responders, CUPA, Cal OES, and onsite personnel;	• Communication and alarm systems; • Personal protective equipment; • Use and maintenance of emergency response equipment and supplies (e.g. Fire extinguishers, respirators, spill control materials); • Decontamination procedures; • Evacuation procedures and evacuation staging locations; • Identification of facility areas, equipment, and systems vulnerable to earthquakes and other natural disasters. • OTHER (Specify):

Check the applicable boxes below to indicate how the employee training program is administered.

☐ 1. FORMAL CLASSROOM	☐ 2. VIDEOS	☐ 3. SAFETY MEETINGS	☐ 4. STUDY GUIDES / MANUALS	H1.
☐ 5. OTHER (Specify): _____				H2.
☐ 6. NOT APPLICABLE SINCE FACILITY HAS NO EMPLOYEES				
☐ 7. CHECK IF A SEPARATE EMPLOYEE TRAINING PLAN IS USED AND UPLOADED TO CERS AS A PDF DOCUMENT				H3.
☐ 8. CHECK IF EMPLOYEE TRAINING IS COVERED BY THE ABOVE REFERENCED CONTENT AND OTHER DOCUMENTS ONSITE				H4.

EMPLOYEE TRAINING FREQUENCY AND RECORDKEEPING TRAINING MUST BE:

- Provided initially for new employees as soon as possible following the date of hire. New employees should not work in an unsupervised position that involves hazardous materials handling and/or hazardous waste management without proper training;
- Provided within six months from the date of hire for new employees at a large quantity generator;
- Ongoing and provided at least annually;
- Amended prior to a change in process or work assignment;
- Given upon modification to the Emergency Response/Contingency Plan.

Large Quantity Generator Training: Large quantity generators (1,000 kg or more) must retain written plan and documentation of employee training which includes:

- A written description of the type and amount of both initial and ongoing training that will be given to persons filling each job position having responsibility for hazardous waste management and/or emergency response.
- The name, job title and job description for each position at the facility related to hazardous waste management.
- Current employee training records must be retained until closure of the facility and former employee training records must be retained for at least three years after termination of employment.

Small Quantity Generator Training: Small quantity generators (less than 1,000 kg) must include basic hazardous waste management and emergency response procedures but a written employee training plan and training records are not required. In order to show that the facility has met the small quantity generator employee training requirement, an employee training plan and training records may be made available.

Hazardous Materials Business Plan Training: Businesses must provide initial and annual employee training that includes the content referenced above. The training may be based on the job position and training records must be made available for a period of at least three years.

J. LIST OF ATTACHMENTS

Check one of the following: J1.

☐ 1. NO ATTACHMENTS ARE REQUIRED; or	
☐ 2. THE FOLLOWING DOCUMENTS ARE ATTACHED:	J2.

Employee Training plan is an online system

Appendix B: City of San Diego Information Bulletin 116





City of San Diego
Development Services
1222 First Ave., MS-401
San Diego, CA 92101

Hazardous Materials Reporting Form

FORM
DS-165

September 2018

All non-residential projects (except retaining walls, fences and similar projects) must have a completed Hazardous Materials Reporting Form at the time of project submittal. This information is used to determine the occupancy classification of the proposed structure(s) along with the fire and life safety protection systems and procedures required. For information regarding the completion of this form, see Information Bulletin 116.

SECTION I: GENERAL INFORMATION

Project Name: SeaWorld Master Plan Update	Project Number: <i>For City Use Only</i>
Tenant Name: SeaWorld Parks and Entertainment	Permit Number: <i>For City Use Only</i>
Job Address: 500 Sea World Dr. San Diego, CA 92109	Building/Unit/Suite Number:
Project Contact Name: Shari Sehlhorst	Contact Phone Number: 619-226-3637

SECTION II: HAZARDOUS MATERIALS SUMMARY

Will this project include the use, storage, or dispensing of any hazardous materials listed below? ☐ NO or ☒ YES

If the answer above is **YES**, check the box for the applicable hazardous materials classifications below and complete the Chemical Classifications Form and Summary Sheets contained in Section IV below.

☐ Aerosols	☒ Corrosives	☒ Flammable Solids	☐ Pyrophorics
☒ Combustible/Flammable Liquids	☐ Cryogenics (Inert or Oxidizing)	☐ Organic Peroxides	☒ Toxics/Highly Toxics
☐ Combustible Fibers	☒ Fireworks/Explosives	☒ Oxidizers	☒ Unstable Reactives
☐ Compressed Gases	☒ Flammable Gases	☐ Oxidizing Gases	☒ Water Reactives

SECTION III: HAZARDOUS PROCESS SUMMARY

Will this business perform any of the hazardous processes listed below? ☐ NO or ☒ YES

If the answer above is **YES**, check the box of the applicable hazardous materials processes below and complete the Chemical Classification Form and Summary Sheet (as necessary) contained in Section IV below. A Technical Report may be required for complex projects at the direction of the hazardous materials plan reviewer.

☒ Battery Storage	☐ Dry Cleaning	☐ Organic/Powder Coatings	☐ Semiconductor Fabrication
☐ Brewery/Distillery	☐ Dust-Producing Operations	☐ Plant Processing/Extraction	☐ Spray Finishing
☐ Dipping Operations	☐ Metal Plating	☒ Refrigeration Systems	☒ Welding/Cutting

SECTION IV: HAZARDOUS MATERIALS CLASSIFICATION

The classification of all chemicals stored and in use for this project is required in order to determine the requirements in the California Fire Code. Attached is a sample Chemical Classification Form. The hazardous materials submittal must include an inventory of all chemicals along with a summary sheet detailing the total amounts for each hazardous classification. Each building or control area must have a separate summary sheet.

SECTION V: DECLARATION

I declare under penalty of perjury that, to the best of my knowledge, the responses made herein are true and correct.

Name of Owner/Occupant (Authorized Agent) (circle one)

Signature

Date

For City Use Only: Staff Name:

Group H -

Occupancy

Control Area(s):

Printed on recycled paper. Visit our web site at www.sandiego.gov/development-services.
Upon request, this information is available in alternative formats for persons with disabilities.

DS-5165 (09-18)

Clear Form

Project Address/Location: 500 SeaWorld Dr. San Diego, CA 92109
Project Number: (For City use only)

CHEMICAL CLASSIFICATION SUMMARY TABLE

COMMON NAME	CHEMICAL NAME	% CONCENTRATION	CAS #	MATERIAL STATE (LIQUID/SOLID/GAS)	QUANTITY STORED	QUANTITY IN USE (OPEN/CLOSED)	LOCATION (STORAGE & USE)	CFC HAZARDOUS CLASSIFICATIONS
Silica Sand (Water filters)	Silica Sand		14808-60-7	Solid	50,000 tons	50,000 tons	Area 279, Building 235	Carcinogenicity, Acute Toxicity, Respiratory or skin sensitization, Irritant, Asphyxiant
Acetylene	Acetylene, C ₂ H ₂ , 99%, compressed gas	99%	74-86-2	Gas	1,050 cubic feet	600 cubic feet	Building 101	Flammable, Explosive, Toxic, Asphyxiant
Propane	Liquified petroleum compressed gas		74-98-6	Liquid	3,500 gallons	3,500 gallons	Southwest of Mechanical Maintenance Shop	Flammable, Explosive, Asphyxiant
Muriatic Acid	Hydrochloric acid	31%	7647-01-0	Liquid	1,150 gallons	1,150 gallons	Shamu Stadium	Oxidizer, Corrosive, Irritant
Qwik Dress/Tire detailer	Polydimethylsiloxane emulsion		63148-62-9	Liquid	55 gallons	1 gallon	Mechanical Maintenance Shop	Toxic, Irritant, Aspiration Hazard
Sulfuric Acid	Sulfuric Acid, H ₂ SO ₄	36%	7664-93-9	Liquid	6,400 lbs	1,000 lbs	Area 279	Carcinogenicity, Irritant
Spray Nine	2-butoxyethanol Ethoxylated C9-C11 Alcohols	3% 3%	111-76-2 68439-46-3	Liquid	55 gallons	2 gallons	Mechanical Maintenance Shop	Toxic, Irritant
Liquid Pool Chlorine	Sodium Hypochlorite, NaOCl	13%	7681-52-9	Liquid	12,000 gallons	8,000 gallons	Treatment Plants, Mammal habitats, Storm Drain Conveyance Systems	Oxidizer, Corrosive, Toxic, Irritant
Waste Absorbent Pad with Formalin	Waste 352 Organic Solids (Other)			Solid	80 lbs	2 lbs	Building 137, Veterinary Lab	Flammable, Carcinogenicity, Toxic, Irritant
Unleaded Gasoline	Gasoline		8006-61-9	Liquid	11,000 gallons	1,000 gallons	West of building 137	Flammable, Carcinogenicity, Irritant

Clear Page 2

Project Address/Location: 500 SeaWorld Dr. San Diego, CA 92109

Project Number: (For City use only)

CHEMICAL CLASSIFICATION SUMMARY TABLE

COMMON NAME	CHEMICAL NAME	% CONCENTRATION	CAS #	MATERIAL STATE (LIQUID/SOLID/GAS)	QUANTITY STORED	QUANTITY IN USE (OPEN/CLOSED)	LOCATION (STORAGE & USE)	CFC HAZARDOUS CLASSIFICATIONS
Waste Methanol Water Solution	Waste 343			Liquid	450 lbs		Pearl Factory Gift Shop	Flammable, Toxic, Irritant
Wax Eliminator	Ethylene Glycol N-Butyl Ether		111-76-2	Liquid	55 gallons	2 gallons	Mechanical Maintenance Shop, PQ Warehouse	Toxic, Irritant
Calcium Hypochlorite Acutab	Calcium Hypochlorite Calcium Chlorate Calcium Carbonate Calcium Hydroxide Magnesium	88% 1.9% 1.9% 1.9% 0.18%	778-34-3 10137-74-3 471-34-1 1305-62-0 7439-95-4	Solid	1,000 lbs	500 lbs	East Wastewater Treatment	Oxidizer, Corrosive, Irritant
Acid, Trident 6026 (Water Treatment)	Hydroxethylidene Diphosphonic		2809-21-4	Liquid	600 gallons	30 gallons	Penguin Encounter	Corrosive, Toxic, Irritant
Sodium Thiosulfate	Sodium Thiosulfate		10102-17-7	Solid	2,500 lbs	1,500 lbs	North/South of building 136 East Wastewater Treatment	Explosive, Self-reactive
Waste - Paint Liquids	Waste 461 Paint			Liquid	280 gallons	1 gallon	Building 101, 115	Flammable, Toxic, Irritant,
Diesel Fuel	Diesel Fuel		68476-34-6	Liquid	2,000 gallons	1,160 gallons	Building 259, Sea Turtle Exhibit	Flammable, Toxic, Carcinogenic, Irritant,
Sodium Sulfite	Sodium Sulfite, 25% solution	25%	7757-83-7	Liquid	5,100 gallons	2,500 gallons	East Wastewater Treatment	Toxic, Irritant
Ethanol, Foodservice Joy	Ethanol		64-17-5	Liquid	500 gallons	80 gallons	Culinary Warehouse	Flammable, Toxic, Irritant
Sterno Canned Cooking Fuel	Ethanol t-Butanol	67% 0.90%	64-17-5 75-65-0	Liquid	2,000 gallons	1,000 gallons	West of Warehouse Storage	Flammable, Toxic

Clear Page 2

Project Address/Location: 500 SeaWorld Dr. San Diego, CA 92109
Project Number: (For City use only)

CHEMICAL CLASSIFICATION SUMMARY TABLE

COMMON NAME	CHEMICAL NAME	% CONCENTRATION	CAS #	MATERIAL STATE (LIQUID/SOLID/GAS)	QUANTITY STORED	QUANTITY IN USE (OPEN/CLOSED)	LOCATION (STORAGE & USE)	CFC HAZARDOUS CLASSIFICATIONS
Kendall Motor Oils Various Weights	Lubricant Base (Petroleum) Additives	70% 30%		Liquid	350 gallons	40 gallons	Building 115	Toxic, Irritant
Waste Sharps	Waste 902 Infectious Waste			Solid	10 lbs		Veterinary Lab, Medical Services, Park Restrooms	Toxic
Fullsan	Nonyl Phenol Polyethylene Glycol Ether Fulliquid Quarterns		9016-45-9	Liquid	220 gallons	55 gallons	Building 122, 136, 522	
Assorted Urethanes	Acetone 2,4-Pentanedione	89%	67-64-1 123-54-6	Liquid	170 gallons	85 gallons	Paint Shop in building 459	Flammable, Carcinogenic, Toxic, Irritant
Red-e-crete, Portland Cement	Sand, Silica, Quartz Portland Cement Lime Pulverized Limestone	50% 30% 10% 10%	14808-60-7 65997-15-1 01305-62-0 01317-65-3	Solid	1,300 lbs	400 lbs	Paint Shop exterior shed	Carcinogenic, Irritant, Toxic
Latex Paint	Ethylene Glycol Quartz Cristobalite Titanium Dioxide Zinc Oxide	2% 10% 1% 14% 2%	107-21-1 14808-60-7 14484-46-1 13463-67-7 1314-13-2	Liquid	700 gallons	700 gallons	Paint Shop in building 459	Carcinogenic
Ozzyjuice SW-3 Truck Degreasing Solin	Proprietary microbial organisms			Liquid	100 gallons	5 gallons	Mechanical Maintenance Shop, Ride Shops, Water Quality Shops	Toxic, Irritant
Mission Oven Cleaner	2-Butoxy Ethanol Sodium Hydroxide		111-76-2 1310-73-2	Liquid	260 gallons	75 gallons	Culinary Restaurants, Locals	Toxic, Irritant
Lanthanum Chloride			10099-58-8	Solid	110 gallons		Journey to Atlantis Ride	Toxic, Corrosive, Irritant
Show-n-go car soap	Surfactant			Liquid	55 gallons	40 gallons	Building 115	Irritant

Clear Page 2

Project Address/Location: 500 SeaWorld Dr. San Diego, CA 92109

Project Number: (For City use only)

CHEMICAL CLASSIFICATION SUMMARY TABLE

COMMON NAME	CHEMICAL NAME	% CONCENTRATION	CAS #	MATERIAL STATE (LIQUID/SOLID/GAS)	QUANTITY STORED	QUANTITY IN USE (OPEN/CLOSED)	LOCATION (STORAGE & USE)	CFC HAZARDOUS CLASSIFICATIONS
Paint-Assorted Enamels and Acrylics	2-Methoxymethylethoxypropanol Calcium Carbonate	4% 17%	34590-94-8 471-34-1	Liquid	100 gallons	50 gallons	Paint Shop building 459	Flammable, Toxic, Irritant
Dexron II Automatic Transmission Fluid	Petroleum, Solvent Refined Light Paraffinic Distillate Petroleum, Solvent Refined Heavy Paraffinic Distillate Anti-Oxidant, Anti-Wear Dispersant Viscosity Improver Dye	87% 87% 10% 4% 1%	64741-89-5 64741-88-4 989944-87-4 989930-13-2 989915-93-4	Liquid	95 gallons	40 gallons	Mechanical Maintenance Shop	Irritant
Waste, Gas, Diesel, LPG	Waste 331, Off-spec, Aged, Surplus Organics			Liquid	100 gallons		Building 115	Flammable, Carcinogenic, Toxic, Irritant
Bubble Master 2000 Premium Fluid	Surfactant Bubble Master			Liquid	440 gallons	440 gallons	West of Warehouse Storage	Irritant
Clean by Peroxy	Alcohol ethoxylate Hydrogen Peroxide Quaternary Amine Fragrance	5% 5% 5% 0.9%	34398-01-1 7722-84-1 68478-94-4 proprietary	Liquid	75 gallons	40 gallons	West of Warehouse Storage	Irritant
Waste Red Bag	Waste 901 Infectious Waste			Solid	10 lbs		Medical Services, Veterinary Lab	Toxic
Carbon Dioxide, Compressed Gas	CO2	99%	124-38-9	Gas	6,250 cubic feet	1,200 cubic feet	Warehouse Storage	Explosive, Irritant, Asphyxiant
Hydraulic Oil	Motor Oil, Hydraulic Oil		8002-05-9	Liquid	3,845 gallons	2,845 gallons	Building 520	Irritant
Polymaleic Acid	(Z)-2-Butenedioic Acid Homopolymer		26099-09-2	Liquid	Liquid		Building 259 Area 279 Building 520	Corrosive, Irritant
Waste Rags Contaminated with Solvent	Waste 352 Organic Solids (Other)			Solid	450 lbs		Building 101 - West End	Flammable, Toxic, Irritant

Clear Page 2

Project Address/Location: 500 SeaWorld Dr. San Diego, CA 92109

Project Number: (For City use only)

CHEMICAL CLASSIFICATION SUMMARY TABLE

COMMON NAME	CHEMICAL NAME	% CONCENTRATION	CAS #	MATERIAL STATE (LIQUID/SOLID/GAS)	QUANTITY STORED	QUANTITY IN USE (OPEN/CLOSED)	LOCATION (STORAGE & USE)	CFC HAZARDOUS CLASSIFICATIONS
Ethylene Glycol	ETHYLENE GLYCOL		107-21-1	Liquid	80 gallons	30 gallons	Mechanical Maintenance Shop	Toxic
Waste Paint Chips and Paint booth Filters	Waste 181 Inorganic Solid Waste			Solid	297 gallons	2 gallons	Building 115, 101	Flammable, Carcinogenic, Toxic, Irritant
Waste Oily Absorbent	Waste 352 Organic Solids			Solid	587 lbs	400 lbs	Building 520	Toxic, Irritant
Argon Gas	Argon Gas		7440-37-1	Gas	1,400 cubic feet	700 cubic feet	Building 101	Gas under pressure, Irritant, Asphyxiant
Propylene Glycol	Propylene Glycol		57-55-6	Liquid	100 gallons	55 gallons	Mechanical Maintenance Shop	Toxic, Irritant
Soda Ash	Sodium Bicarbonate		144-55-8	Solid	4,000 lbs	2,000 lbs	East Otter, Penguin Encounter	Toxic, Irritant
Disinfectant Bleach, Clorox	Sodium Hypochlorite, NaOCl	5%	7681-52-9	Liquid	560 gallons	220 gallons	Warehouse Storage	Oxidizer, Toxic, Irritant
Lead	Lead		7439-92-1	Solid	1,500 lbs	1,500 lbs	Building 101	Carcinogenic, Toxic, Combustible Dust, Irritant
Diesel Fuel	Diesel		68476-34-6	Liquid	2,000 gallons		Explorer's Reef LSS Yard Shamu Stadium	Flammable, Carcinogenic, Toxic, Irritant
Activated Carbon	Activated Carbon	100%	7440-44-0	Solid	14,000 lbs	14,000 lbs	Building 452-Outdoor Storage area Explorer's Reef LSS Yard Ocean Explorer	Irritant

Clear Page 2

Project Address/Location: 500 SeaWorld Dr. San Diego, CA 92109
Project Number: (For City use only)

CHEMICAL CLASSIFICATION SUMMARY TABLE

COMMON NAME	CHEMICAL NAME	% CONCENTRATION	CAS #	MATERIAL STATE (LIQUID/SOLID/GAS)	QUANTITY STORED	QUANTITY IN USE (OPEN/CLOSED)	LOCATION (STORAGE & USE)	CFC HAZARDOUS CLASSIFICATIONS
Underground Tank 100905 T001	Regular Unleaded		684-76-346	Liquid	10,000 gallons	9,000 gallons	West of building 137	Flammable, Carcinogenic, Irritant
Waste 311 Pharmaceutical Waste	Waste 311 Pharmaceutical Waste			Solid	15 lbs		Building 137	HNOC
Iron	95% Galvanized Steel	95%	7439-89-6	Solid	500 lbs	500 lbs	Building 101	Carcinogenic, Irritant
Snapshot 2.5 TG Herbicide	Isoxaben Trifluralin Clays, Fuller's earth Silica, crystalline (quartz) Balance	0.5% 2% 78.5% 0.9% 2.4%	82558-50-7 1582-09-8 8031-18-3 14808-60-7	Solid	500 lbs		Landscape Storage area	Carcinogenic, Toxic
Table Salt	Sodium Chloride, NaCl	98%	7647-14-5	Solid	11,000 lbs	6,000 lbs	Ocean Explorer	Irritant
Waste Aerosols	Waste 331			Solid	300 lbs		Building 115	Flammable, Gas under pressure, explosive, self-reactive, carcinogenic, Toxic, Irritant
Charcoal	Charcoal		16291-96-6	Solid	2,500 lbs	2,500 lbs	Culinary Warehouse	Flammable
Fertilizer, Turf Gold	UREA MONOAMMONIUM PHOSPHATE POTASSIUM CHLORIDE SULFUR WAX		57-13-6 7722-78-1 7447-40-7 7704-34-9 64771-72-8	Solid	2,000 lbs	500 lbs	Landscape Storage area	Irritant
Nitra King 19-4-4	Ammonia Nitrate Fertilizer		6484-52-2	Solid	1,000 lbs	300 lbs	Landscape Storage area	Irritant, Toxic
Wrought Aluminum Alloy	Aluminum 92%	92%	7429-90-5	Solid	500 lbs	250 lbs	Building 101	Combustible Dust, Carcinogenic, Irritant

Clear Page 2

Project Address/Location: 500 SeaWorld Dr. San Diego, CA 92109
Project Number: (For City use only)

CHEMICAL CLASSIFICATION SUMMARY TABLE

COMMON NAME	CHEMICAL NAME	% CONCENTRATION	CAS #	MATERIAL STATE (LIQUID/SOLID/GAS)	QUANTITY STORED	QUANTITY IN USE (OPEN/CLOSED)	LOCATION (STORAGE & USE)	CFC HAZARDOUS CLASSIFICATIONS
Manganese	13% Stainless Steel	13%	7439-96-5	Solid	500 lbs	500 lbs	Building 101	Carcinogenic
Oxygen, Compressed gas	O2	99%	7782-44-7	Gas	6,000 cubic feet	2,875 cubic feet	Building 137, 136	Flammable, Gas under pressure, Explosive, Oxidizer
Nickel	46% Nickel Steel	46%	7440-02-0	Solid	500 lbs	500 lbs	Building 101	Carcinogenic
Freon R-123	Freon R-123		306-83-2	Gas	2,500 lbs	1,870 lbs	Building 103	Toxic
Lacquer Thinner and Rags	Waste 212 Oxygenated Solvents and Solids			Liquid	15 gallons	5 gallons	Southwest Corner of building 101	Flammable, Toxic, Irritant
Waste Pathology	Waste 903		39515-41-8	Solid	40 lbs		Veterinary Lab, Building 137	Flammable, Carcinogenic, Toxic, Irritant
Waste Motor Oil	VARIOUS LUBRICATING BASE OILS ADDITIVE PACKAGE, INCLUDING ZINC ALKYL DITHIOPHOSPHATE	85% 15% 2%	6474X-XX-X Mixture 68649-42-3	Liquid	170 gallons	55 gallons	Building 520	Flammable, Toxic, Irritant
Waste Fuel and Oil Filters				Solids	20 lbs	10 lbs	Mechanical Maintenance Shop	Flammable, Carcinogenic, Toxic, Irritant
Aluminum Chlorohydrate	Aluminum Sulfate		12042-91-0	Liquid	2,000 gallons	1,350 gallons	Building 522, south of Fish House Shamu Stadium	Toxic, Irritant
Solid Detergent	Sodium Carbonate, 48% Solid Fusion	48%	497-19-8	Solid	750 lbs	500 lbs	Warehouse Storage	Toxic, Irritant

Clear Page 2

Project Address/Location: 500 SeaWorld Dr. San Diego, CA 92109
Project Number: (For City use only)

CHEMICAL CLASSIFICATION SUMMARY TABLE

COMMON NAME	CHEMICAL NAME	% CONCENTRATION	CAS #	MATERIAL STATE (LIQUID/SOLID/GAS)	QUANTITY STORED	QUANTITY IN USE (OPEN/CLOSED)	LOCATION (STORAGE & USE)	CFC HAZARDOUS CLASSIFICATIONS
Natural Fine and Coarse Aggregate	Silicon Sand (Aquarium)		14808-60-7	Solid	5,000 lbs	1,400 lbs	Ocean Explorers	Carcinogenic
Silicon Dioxide			14808-60-7	Solid	2,600 lbs	1,000 lbs	South of Landscape Storage	Carcinogenic, Toxic
Nitrogen - Food Grade for Popcorn	Nitrogen		7727-37-9	Gas	3,635 cubic feet	3,635 cubic feet	Seven seas French Arctic Area	Gas under pressure, Irritant, Asphyxiant
Culinary Dewars	Liquid Nitrogen Carbon Dioxide	60% 40%	7727-37-9 124-38-9	Gas	4,000 cubic feet	4,000 cubic feet	Culinary Beer Locations	Flammable, Gas under pressure, Explosive, Irritant, Asphyxiant
Waste - Decalcifying Solution	Water Hydrochloric Acid	97% 3%	7732-18-5 7647-01-0	Liquid	5 gallons	5 gallons	Veterinary Lab	Toxic
Waste - Gram Stain	isopropanol methanol ethanol C.I. Basic Violet 3 potassium iodide	75% 2% 2% 0.5% 3%	67-63-0 67-56-1 64-17-5 548-62-9 7681-11-0	Liquid	2.5 gallons	2.5 gallons	Veterinary Lab	Flammable, Toxic, Irritant
Waste - Ethylene Glycol	Ethylene glycol Diethylene glycol Dipotassium phosphate	95% 4% 1%	107-21-1 111-46-6 7758-11-4	Liquid	55 gallons	55 gallons	Energy Systems	Flammable, Irritant
Waste - Activated Carbon			7440-44-0	Solid	350 lbs	55 lbs	Explorers Reef LSS Yard	Flammable, Irritant
Waste - ExCell Plus	Glyoxal Ethenediol Ethanol	25% 10% 10%	107-22-2 107-21-1 64-17-5	Liquid	15 gallons	5 gallons	Laboratory	Flammable, Carcinogenic, Toxic, Irritant
Caustic Soda	Sodium Hydroxide Water	25% 75%	1310-73-2 7732-18-5	Liquid	275 gallons	275 gallons	Shamu Stadium	Corrosive, Toxic, Irritant

Clear Page 2

Project Address/Location:

500 SeaWorld Dr. San Diego, CA 92109

Project Number: (For City use only)

CHEMICAL CLASSIFICATION SUMMARY TABLE								
COMMON NAME	CHEMICAL NAME	% CONCENTRA- TION	CAS #	MATERIAL STATE (LIQUID/SOLID/ GAS)	QUANTITY STORED	QUANTITY IN USE (OPEN/CLOSED)	LOCATION (STORAGE & USE)	CFC HAZARDOUS CLASSIFICATIONS
X-Cote 43-0-0	Urea Sulfur Polymer Coating Wax (paraffins-petroleum)		67-13-6 7704-34-9 84771-72-8	Solid	2,000 lbs	50 lbs	Landscape Nursery Yard	Irritant
Chlorodifluoromethane	Chlorodifluoro methane (R-22)		75-45-6	Gas	1,500 cubic feet	1,000 cubic feet	Energy Systems Cogen Building	Gas under pressure, Explosive
Neptune's Harvest	Neptune's Harvest Hydrolyzed Fish 2-4-1			Liquid	45 lbs		Landscape Storage area	Toxic

Appendix C: Environmental Data Resources Report

SeaWorld

500 SeaWorld Dr
San Diego, CA 92109

Inquiry Number: 5775389.2s
September 03, 2019

The EDR Radius Map™ Report with GeoCheck®



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	8
Orphan Summary	852
Government Records Searched/Data Currency Tracking	GR-1
 <u>GEOCHECK ADDENDUM</u>	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-5
Physical Setting Source Map	A-7
Physical Setting Source Map Findings	A-9
Physical Setting Source Records Searched	PSGR-1

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2019 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E 1527-13), the ASTM Standard Practice for Environmental Site Assessments for Forestland or Rural Property (E 2247-16), the ASTM Standard Practice for Limited Environmental Due Diligence: Transaction Screen Process (E 1528-14) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

500 SEAWORLD DR
SAN DIEGO, CA 92109

COORDINATES

Latitude (North): 32.7648410 - 32° 45' 53.42"
Longitude (West): 117.2256960 - 117° 13' 32.50"
Universal Transverse Mercator: Zone 11
UTM X (Meters): 478860.2
UTM Y (Meters): 3625050.0
Elevation: 19 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map: 5622824 LA JOLLA, CA
Version Date: 2012

South Map: 5622832 POINT LOMA, CA
Version Date: 2012

Southwest Map: 5622850 POINT LOMA OE W, CA
Version Date: 2012

Northwest Map: 5622840 LA JOLLA OE W, CA
Version Date: 2012

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from: 20140603
Source: USDA

MAPPED SITES SUMMARY

Target Property Address:
500 SEAWORLD DR
SAN DIEGO, CA 92109

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
A1	SEA WORLD PKING LOT	500 SEA WORLD DR	CIWQS		TP
A2	SEAWORLDNA SAN DIEGO	500 SEAWORLD	FINDS		TP
A3	SEA WORLD INC	500 SEA WORLD DR	EMI, CERS		TP
A4	SEAWORLD, SAN DIEGO	500 SEAWORLD DRIVE	ENF, WDS, CIWQS		TP
A5	SEA WORLD	500 SEA WORLD DR	RGA LUST		TP
A6	SEA WORLD SAN DIEGO	500 SEA WORLD DRIVE	NPDES, CIWQS		TP
A7	SEA WORLD	500 SEA WORLD DR	SAN DIEGO CO. SAM, CPS-SLIC, UST, San Diego Co....		TP
A8	SEAWORLD SAN DIEGO E	500 SEA WORLD DR	CIWQS		TP
A9	12 KVA CIRCUIT EXTEN	500 SEA WORLD DR	CIWQS		TP
A10	SEAWORLD - FIREWORKS	500 SEAWORLD	CERS		TP
A11		500 SEAWORLD DR., SL	CHMIRS		TP
A12		500 SEAWORLD DR	ERNS		TP
A13		500 SEA WORLD DR.	CHMIRS		TP
A14	ANTONIO E AUSTIN	500 SEAWORLD DR	PEST LIC		TP
A15		500 SEAWORLD DR	ERNS		TP
A16	SEAWORLD SAN DIEGO	500 SEA WORLD DRIVE	RCRA-LQG, FINDS		TP
A17		500 SEA WORLD DR	ERNS		TP
A18	SEA WORLD SAN DIEGO	500 SEA WORLD	CERS		TP
A19	SEAWORLD - FIREWORKS	500 SEAWORLD	FINDS		TP
A20	SEA WORLD SAN DIEGO	500 SEA WORLD	FINDS		TP
A21	SEA WORLD SAN DIEGO	500 SEA WORLD DRIVE	NPDES, CIWQS		TP
A22	AFISHN SEA CF# 11167	500 SEA WORLD DR SLI	HAZNET		TP
A23	LEON RAYMOND HUBBARD	500 SEA WORLD DRIVE	ECHO		TP
A24	SEAWORLD, SAN DIEGO	500 SEAWORLD DRIVE	CHMIRS, NPDES, CIWQS		TP
A25	SEAWORLD, SAN DIEGO	500 SEAWORLD	CERS		TP
A26		500 SEA WORLD DRIVE	CHMIRS		TP
A27	AT&T MOBILITY - TIN	500 SEA WORLD DR	FINDS		TP
A28	SEAWORLD SAN DIEGO 2	500 SEA WORLD DRIVE	CERS		TP
A29	INGRID GAASBEEK	500 SEA WORLD DR	PEST LIC		TP
A30	PCL CONSTRUCTION SER	500 SEA WORLD DR	HAZNET		TP
A31	SEA WORLD, SAN DIEGO	500 SEAWORLD DRIVE	ICIS, FINDS, ECHO		TP
A32		500 SEAWORLD DR	ERNS		TP
A33		500 SEA WORLD DR.	ERNS		TP
A34	2004 EXPANSION	500 SEA WORLD DR	CIWQS		TP
A35	BIKE & PEDESTRIAN PA	500 SEA WORLD DR	CIWQS		TP
36		SEA WORLD OFF RAMP	CHMIRS	Lower	1 ft.
B37	HUBBS-SEA WORLD INST	2595 INGRAHAM STREET	San Diego Co. HMMD, CERS HAZ WASTE, ENF, CERS	Lower	1 ft.
B38	HUBBS-SEA WORLDNA MI	2595 INGRAHAM	FINDS	Lower	1 ft.
B39	HUBBS-SEA WORLD INST	2595 INGRAHAM	CERS	Lower	1 ft.

MAPPED SITES SUMMARY

Target Property Address:
500 SEAWORLD DR
SAN DIEGO, CA 92109

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.)
B40	HUBBS-SEA WORLD RESE	2595 INGRAHAM STREET	FINDS, ECHO	Lower	1 ft.
B41	HUBBS-SEA WORLD MISS	2595 INGRAHAM STREET	WDS	Lower	1 ft.
B42	HUBBS-SEA WORLD RESE	2595 INGRAHAM ST	FINDS	Lower	1 ft.
B43	HUBBS-SEA WORLD RESE	2595 INGRAHAM STREET	HAZNET	Lower	1 ft.
B44	HUBBS-SEA WORLD RESE	2595 INGRAHAM STREET	RCRA NonGen / NLR	Lower	1 ft.
C45		1660 S. SHORES ROAD	CHMIRS	Lower	1 ft.
C46		1660 SOUTH SHORES RD	ERNS	Lower	1 ft.
C47		1660 S. SHORES ROAD	ERNS	Lower	1 ft.
C48	SEA WORLD MARINA	1660 S SHORES RD	RGA LUST	Lower	1 ft.
C49		1660 S. SHORES ROAD	ERNS	Lower	1 ft.
C50		1660 S. SHORES ROAD	ERNS	Lower	1 ft.
C51		1660 S. SHORES ROAD	ERNS	Lower	1 ft.
C52	SEAWORLD	1720 S SHORES RD	UST	Lower	1 ft.
C53		1660 SOUTH SHORES RO	CHMIRS	Lower	1 ft.
C54		1660 SOUTH SHORES RO	CHMIRS	Lower	1 ft.
C55		1660 S. SHORES ROAD	ERNS	Lower	1 ft.
C56		1720 SOUTH SHORES RO	CHMIRS	Lower	1 ft.
C57	SEA WORLD MARINA	1660 SHORES RD	San Diego Co. HMMD	Lower	1 ft.
C58		1660 S. SHORES RD.	CHMIRS	Lower	1 ft.
C59	SEAWORLD	1700 S SHORES RD	San Diego Co. HMMD	Lower	1 ft.
C60		1660 S. SHORES ROAD	ERNS	Lower	1 ft.
C61		1660 S. SHORES ROAD	CHMIRS	Lower	1 ft.
C62		1660 S. SHORES ROAD	ERNS	Lower	1 ft.
C63	SEA WORLD, PEREZ COV	1660 SHORES	HIST CORTESE	Lower	1 ft.
C64		1660 S. SHORES ROAD	ERNS	Lower	1 ft.
C65	SEA WORLD HYDRO DOCK	1720 SOUTH SHORES RD	RGA LUST	Lower	1 ft.
C66	SEA WORLD	1720 SHORES	HIST CORTESE	Lower	1 ft.
C67	SEA WORLD MARINA	1660 S SHORES RD	FINDS	Lower	1 ft.
C68	SEA WORLD	1720 S SHORES RD	SWEEPS UST, HIST UST, CERS	Lower	1 ft.
C69		1660 S. SHORES ROAD	CHMIRS	Lower	1 ft.
C70		1660 S. SHORES ROAD	CHMIRS	Lower	1 ft.
C71		1660 S. SHORES ROAD,	CHMIRS	Lower	1 ft.
C72	SEA WORLD MARINA	1660 S SHORES RD	SAN DIEGO CO. SAM, LUST, CPS-SLIC, SWEEPS UST,...	Lower	1 ft.
C73	SEA WORLD, PEREZ COV	1660 SOUTH SHORES RD	RGA LUST	Lower	1 ft.
C74		1660 S. SHORES ROAD,	CHMIRS	Lower	1 ft.
C75		1660 S. SHORES ROAD	ERNS	Lower	1 ft.
C76	SAMURAYA VESSEL# 943	1660 S SHORES RD	HAZNET	Lower	1 ft.
C77	SEA WORLD HYDRO DOCK	1660 S SHORES RD	RGA LUST	Lower	1 ft.
C78		1660 S. SHORES ROAD	ERNS	Lower	1 ft.

MAPPED SITES SUMMARY

Target Property Address:
500 SEAWORLD DR
SAN DIEGO, CA 92109

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.)
C79	SEA WORLD, PEREZ COV	1660 SOUTH SHORES DR	RGALUST	Lower	1 ft.
C80	SEA WORLD SAN DIEGO	1720 S SHORES RD	HAZNET	Lower	1 ft.
C81		1660 S. SHORES ROAD	ERNS	Lower	1 ft.
82	MISSION BAY LANDFILL	MISSION BAY - SEA WO	CHMIRS, ENF, WDS, CIWQS	Lower	1 ft.
C83	SEA WORLD INC	1720 SOUTH SHORES RO	LUST, FINDS, ECHO	Lower	1 ft.
C84	SEA WORLD, PEREZ COV	1660 SOUTH SHORES RD	LUST	Lower	1 ft.
C85	SEA WORLD MARINA	1660 SOUTH SHORES RO	HIST UST	Lower	1 ft.
C86	SEA WORLD, PEREZ COV	1660 SOUTH SHORES RO	RGALUST	Lower	1 ft.
C87		1660 S. SHORES ROAD,	CHMIRS	Lower	1 ft.
C88	SEA WORLD HYDRO DOCK	1720 SOUTH SHORES DR	RGALUST	Lower	1 ft.
C89		1660 S. SHORES ROAD	ERNS	Lower	1 ft.
C90	1720 S SHORES RD	1720 S SHORES RD	CIWQS	Lower	1 ft.
C91		1720 SOUTH SHORES RD	ERNS	Lower	1 ft.
C92		1660 S. SHORES ROAD	CHMIRS	Lower	1 ft.
C93		1660 S. SHORES ROAD,	CHMIRS	Lower	1 ft.
C94	1720 S SHORE RD	1720 S SHORES RD	NPDES, CIWQS	Lower	1 ft.
C95	SEAWORLD	1720 S SHORES RD	AST	Lower	1 ft.
C96	SEAWORLD	1720 S SHORES RD	San Diego Co. HMMD, CERS HAZ WASTE, CERS TANKS,...	Lower	1 ft.
C97	SEA WORLD HYDRO DOCK	1720 SHORES	HIST CORTESE	Lower	1 ft.
B98	GOLDEN STATE BOATS I	2630 INGRAHAM ST	RCRA NonGen / NLR	Lower	100, 0.019, WNW
B99	DANA LANDING FUEL DO	2590 INGRAHAM ST	SAN DIEGO CO. SAM, UST, HIST UST, SAN DIEGO CO LOP	Lower	102, 0.019, WNW
B100	DANA MARINA BAIT & T	2590 INGRAHAM ST	HIST UST	Lower	102, 0.019, WNW
B101	MARSHALL SHIELDS	2590 INGRAHAM ST	HIST UST, HAZNET	Lower	102, 0.019, WNW
B102	DANA LANDING FUEL DO	2590 INGRAHAM ST	LUST, HIST CORTESE, CERS	Lower	102, 0.019, WNW
B103	DANA LANDING FUEL DO	2590 INGRAHAM ST	LUST, San Diego Co. HMMD, SWEEPS UST, CHMIRS, EMI,...	Lower	102, 0.019, WNW
D104	RAD STATION L-6 MIS		ENVIROSTOR	Lower	248, 0.047, ESE
D105	RADAR STATION L-6 MI		FUDS	Lower	252, 0.048, ESE
E106	DANA LANDING FUEL DO	2580 INGRAHAM ST	San Diego Co. HMMD, CERS HAZ WASTE, CERS TANKS,...	Lower	414, 0.078, WNW
E107	DANA LANDING FUEL DO	2580 INGRAHAM ST	UST	Lower	414, 0.078, WNW
108	2500 BLK OF INGRAHAM	DANA LANDING BOAT RA	Notify 65	Lower	455, 0.086, West
109	MISSION BAY LDFL	BET SN DIEGO RIV & M	SEMS-ARCHIVE	Lower	515, 0.098, ESE
110	MISSION BAY LANDFILL	SEA WORLD DRIVE	SWF/LF, CERS	Lower	549, 0.104, ESE
F111	SEAFORTH SPORTFISHIN	1717 QUIVIRA CT	LUST, CERS HAZ WASTE, SWEEPS UST, CERS TANKS, SAN	Lower	842, 0.159, West
F112	SEAFORTH SPORTFISHIN	1717 QUIVIRA RD	SAN DIEGO CO. SAM, UST, San Diego Co. HMMD, SWEEPS...	Lower	842, 0.159, West
F113	SEAFORTH SPORTFISHIN	1717 QUIVIRA RD	LUST	Lower	842, 0.159, West
F114	SEAFORTH MARINA	1677 QUIVIRA RD	SAN DIEGO CO. SAM, LUST, CPS-SLIC, San Diego Co....	Lower	949, 0.180, West
G115	SEAFORTH SPORTFISHIN	1717 QUIVIRA	HIST CORTESE	Lower	1369, 0.259, West
G116	SEAFORTH MARINA	1677 QUIVIRA	HIST CORTESE	Lower	1598, 0.303, West
117	ACTIVCARE AT POINT L	3423 CHANNEL WY	SAN DIEGO CO. SAM, CPS-SLIC, San Diego Co. HMMD,...	Lower	1646, 0.312, SE

MAPPED SITES SUMMARY

Target Property Address:
500 SEAWORLD DR
SAN DIEGO, CA 92109

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
118	ISLANDIA SPORTSFISHI	1551 MISSION BAY	LUST, HIST CORTESE	Lower	1650, 0.312, West
119	BENTON ROOFING	3691 HANCOCK ST	LUST, SAN DIEGO CO. SAM, San Diego Co. HMMD, CERS...	Lower	1672, 0.317, ESE
120	BUTLER, LYLE	3612 KURTZ ST	SAN DIEGO CO. SAM, LUST, CPS-SLIC, San Diego Co....	Lower	1783, 0.338, ESE
H121	WRIGHT SURF REPAIR	3630 HANCOCK ST	ENVIROSTOR, San Diego Co. HMMD, CERS HAZ WASTE,...	Lower	1891, 0.358, ESE
H122	SACKETT & PENDLEBURY	3630 HANCOCK ST	SEMS-ARCHIVE	Lower	1891, 0.358, ESE
I123		4236 VENUS ST.	Notify 65	Lower	1896, 0.359, South
I124		VENUS ST & CAMULOS S	Notify 65	Lower	1904, 0.361, South
J125	ISLANDIA SPORTFISHIN	1551 W MISSION BAY D	LUST, SAN DIEGO CO. SAM, UST, SWEEPS UST, SAN...	Lower	1930, 0.366, West
126		3936 JUPITER ST.	Notify 65	Lower	1970, 0.373, SSE
K127	L.A. DISTRICT ENG OF		FUDS	Lower	2086, 0.395, South
K128	LA DE OFFICE & YD S		ENVIROSTOR	Lower	2087, 0.395, South
L129	SAN DIEGO GUN TOWER		FUDS	Lower	2205, 0.418, ESE
J130	HYATT ISLANDIA HOTEL	1441 QUIVIRA CT	LUST, SWEEPS UST, CHMIRS, HAZNET, CERS	Lower	2210, 0.419, West
J131	HYATT ISLANDIA	1441 QUIVIRA RD	RCRA-SQG, LUST, CHMIRS, FINDS, ECHO, HIST CORTESE	Lower	2210, 0.419, West
J132	HYATT REGENCY MISSIO	1441 QUIVIRA RD	SAN DIEGO CO. SAM, San Diego Co. HMMD, CERS HAZ...	Lower	2210, 0.419, West
L133	SAN DIEGO GUN TOWER		ENVIROSTOR	Lower	2214, 0.419, ESE
134	PHOTIC OF SAN DIEGO	3515 HANCOCK ST	ENVIROSTOR, San Diego Co. HMMD	Lower	2335, 0.442, ESE
135	BURKE CO THE 08	3870 HOUSTON ST	SEMS-ARCHIVE, RCRA-SQG, ENVIROSTOR, FINDS, ECHO,...	Lower	2459, 0.466, ESE
136	STONEWOOD GARDENS AP	3835 MIDWAY DR	SAN DIEGO CO. SAM	Lower	2461, 0.466, SSE
M137	MISSION BAY MARINA	1548 QUIVIRA	SAN DIEGO CO. SAM, San Diego Co. HMMD, HIST...	Lower	2496, 0.473, WSW
M138	MISSION BAY MARINA	1548 QUIVIRA WAY	LUST, CPS-SLIC, SWEEPS UST, CERS	Lower	2496, 0.473, WSW
139	GENIE CAR WASH	3949 POINT LOMA BLVD	LUST, SAN DIEGO CO. SAM, San Diego Co. HMMD, CERS...	Lower	2499, 0.473, SSE
N140	GOLDEN CHARIOT TRUCK	3495 KURTZ ST	LUST, CPS-SLIC, San Diego Co. HMMD, HIST UST, SAN...	Lower	2577, 0.488, SE
N141	GOLDEN CHARIOT TRUCK	3495 KURTZ ST	SAN DIEGO CO. SAM, San Diego Co. HMMD, SWEEPS UST,...	Lower	2577, 0.488, SE
N142	TRUCK TERMINAL	3495 KURTS STREET	ENVIROSTOR	Lower	2590, 0.491, SE
143	JENSEN MEAT COMPANY	3477 HANCOCK ST	SAN DIEGO CO. SAM, LUST, CPS-SLIC, San Diego Co....	Lower	2602, 0.493, ESE
M144	1500 QUIVIRA WAY	1500 QUIVIRA WAY	LUST, CPS-SLIC, CERS HAZ WASTE, CHMIRS, ENF,...	Lower	2607, 0.494, WSW
145	U HAUL INTERNATIONAL	3820 MIDWAY DR	LUST, SAN DIEGO CO. SAM, San Diego Co. HMMD,...	Lower	2621, 0.496, SSE
146	S. D. PRINCESS RESOR	1404 VACATION VILLAG	Notify 65	Lower	2755, 0.522, NW
O147	DYKE-SAN DIEGO HARBO		FUDS	Lower	2823, 0.535, SSW
O148	DYKE - SAN DIEGO HBR		ENVIROSTOR	Lower	2828, 0.536, SSW
149	RELIEF VALVE CLAPPER	I-5 AND S.D. RIVER C	Notify 65	Lower	2857, 0.541, East
150	SAN DIEGO RIVER/MISS		FUDS	Higher	2990, 0.566, NNE
151	3050 RUE DE ORLEANS	PACIFIC ISLAND APTS.	Notify 65	Lower	3113, 0.590, South
152	SOUTHERN CALIFORNIA	5000 PACIFIC COAST H	HWP, CERS	Higher	3147, 0.596, East
P153	DON POLLOCK EXCAVATI	3366 KURTZ STREET	ENVIROSTOR	Lower	3211, 0.608, ESE
P154	BOYCE INDUSTRIES	3344 KURTZ ST	ENVIROSTOR, San Diego Co. HMMD, HIST CORTESE, CERS	Lower	3309, 0.627, ESE
155	HOWARD TAYLOR DODGE	3740 ROSECRANS	CPS-SLIC, HIST CORTESE, Notify 65	Lower	4584, 0.868, SE
Q156	MIDWAY DRIVE (A.K.A.		FUDS	Lower	4669, 0.884, SE

MAPPED SITES SUMMARY

Target Property Address:
 500 SEAWORLD DR
 SAN DIEGO, CA 92109

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
Q157	MIDWAY DRIVE (A.K.A.		ENVIROSTOR	Lower	4673, 0.885, SE
158	MISSION CHEMICAL CO.	4990 NAPLES	ENVIROSTOR, LUST, HAZNET, HIST CORTESE, NPDES, SAN	Higher	4680, 0.886, ENE
159	CORREIA JUNIOR HIGH	4302 VALETA	ENVIROSTOR, LUST, SAN DIEGO CO. SAM, SCH, DEED,...	Higher	4737, 0.897, SSW
160		1079 WEST MORENA BLV	Notify 65	Higher	4806, 0.910, East
R161	SAN DIEGO MANUFACTUR		FUDS	Lower	5176, 0.980, ESE
R162	SAN DIEGO MFG PLT		ENVIROSTOR	Lower	5178, 0.981, ESE

EXECUTIVE SUMMARY

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following records. For more information on this property see page 8 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
SEA WORLD PKING LOT 500 SEA WORLD DR SAN DIEGO, CA 92109	CIWQS	N/A
SEAWORLDNA SAN DIEGO 500 SEAWORLD SAN DIEGO, CA 92109	FINDS Registry ID:: 110066043098	N/A
SEA WORLD INC 500 SEA WORLD DR SAN DIEGO, CA 92109	EMI Facility Id: 937 CERS	N/A
SEAWORLD, SAN DIEGO 500 SEAWORLD DRIVE SAN DIEGO, CA 92109	ENF Status: Historical Status: Superceded Status: Historical Facility Id: 256121 WDS Facility Status: A Facility Id: 9 000000083 CIWQS	N/A
SEA WORLD 500 SEA WORLD DR SAN DIEGO, CA	RGA LUST	N/A
SEA WORLD SAN DIEGO 500 SEA WORLD DRIVE SAN DIEGO, CA 92109	NPDES Facility Status: Terminated CIWQS	N/A
SEA WORLD 500 SEA WORLD DR SAN DIEGO, CA 92109	SAN DIEGO CO. SAM Case Number: H00905-001 Facility Status: Closed Case CPS-SLIC Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Global Id: T0608142413 UST Database: UST, Date of Government Version: 06/10/2019 Facility Id: H00905 San Diego Co. HMMD	N/A

EXECUTIVE SUMMARY

Record ID: DEH2015-HUPFP-002022

CHMIRS

OES Incident Number: 5-6490

OES Incident Number: 17-1436

EMI

Facility Id: 937

HAZNET

GEPAID: CAC002897790

SAN DIEGO CO LOP

CIWQS

CERS

SEAWORLD SAN DIEGO E
500 SEA WORLD DR
SAN DIEGO, CA 92109

CIWQS

N/A

12 KVA CIRCUIT EXTEN
500 SEA WORLD DR
SAN DIEGO, CA 92109

CIWQS

N/A

SEAWORLD - FIREWORKS
500 SEAWORLD
SAN DIEGO, CA 92109

CERS

N/A

500 SEAWORLD DR., SL
500 SEAWORLD DR., SL
SAN DIEGO, CA

CHMIRS

OES Incident Number: 13-4861

N/A

500 SEAWORLD DR
500 SEAWORLD DR
SAN DIEGO, CA 92109

ERNS

NRC Report #: 810012

N/A

500 SEA WORLD DR.
500 SEA WORLD DR.
SAN DIEGO, CA

CHMIRS

OES Incident Number: 4-2083

N/A

ANTONIO E AUSTIN
500 SEAWORLD DR
SAN DIEGO, CA 92109

PEST LIC

N/A

500 SEAWORLD DR
500 SEAWORLD DR
SAN DIEGO, CA 92109

ERNS

NRC Report #: 1056320

N/A

SEAWORLD SAN DIEGO
500 SEA WORLD DRIVE
SAN DIEGO, CA 92109

RCRA-LQG

CAD981687221

EXECUTIVE SUMMARY

	EPA ID:: CAD981687221 FINDS Registry ID:: 110017860894 Registry ID:: 110064253953	
500 SEA WORLD DR 500 SEA WORLD DR SAN DIEGO, CA 92109	ERNS NRC Report #: 719301	N/A
SEA WORLD SAN DIEGO 500 SEA WORLD SAN DIEGO, CA 92109	CERS	N/A
SEAWORLD - FIREWORKS 500 SEAWORLD SAN DIEGO, CA 92109	FINDS Registry ID:: 110066758869	N/A
SEA WORLD SAN DIEGO 500 SEA WORLD SAN DIEGO, CA 92109	FINDS Registry ID:: 110065742021	N/A
SEA WORLD SAN DIEGO 500 SEA WORLD DRIVE SAN DIEGO, CA 92109	NPDES Facility Status: Historical CIWQS	N/A
AFISHN SEA CF# 11167 500 SEA WORLD DR SLI SAN DIEGO, CA 92109	HAZNET GEPAID: CAC002618895	N/A
LEON RAYMOND HUBBARD 500 SEA WORLD DRIVE SAN DIEGO, CA 92109	ECHO Registry ID: 110017860894	N/A
SEAWORLD, SAN DIEGO 500 SEAWORLD DRIVE SAN DIEGO, CA 92109	CHMIRS OES Incident Number: 12-3637 OES Incident Number: 6-5238 NPDES Facility Status: Historical Facility Status: Active CIWQS	N/A
SEAWORLD, SAN DIEGO 500 SEAWORLD SAN DIEGO, CA 92109	CERS	N/A

EXECUTIVE SUMMARY

500 SEA WORLD DRIVE 500 SEA WORLD DRIVE SAN DIEGO, CA 92109	CHMIRS OES Incident Number: 2-4158	N/A
AT&T MOBILITY - TIN 500 SEA WORLD DR SAN DIEGO, CA 92109	FINDS Registry ID:: 110066267961	N/A
SEAWORLD SAN DIEGO 2 500 SEA WORLD DRIVE SAN DIEGO, CA 92019	CERS	N/A
INGRID GAASBEEK 500 SEA WORLD DR SAN DIEGO, CA 92109	PEST LIC	N/A
PCL CONSTRUCTION SER 500 SEA WORLD DR SAN DIEGO, CA 92109	HAZNET GEPAID: CAC002779680	N/A
SEA WORLD, SAN DIEGO 500 SEAWORLD DRIVE SAN DIEGO, CA 92109	ICIS FRS ID:: 110064253962 FINDS Registry ID:: 110064253962 ECHO Registry ID: 110064253962	N/A
500 SEAWORLD DR 500 SEAWORLD DR SAN DIEGO, CA 92109	ERNS NRC Report #: 1015331	N/A
500 SEA WORLD DR. 500 SEA WORLD DR. SAN DIEGO, CA 92109	ERNS NRC Report #: 778995	N/A
2004 EXPANSION 500 SEA WORLD DR SAN DIEGO, CA 92109	CIWQS	N/A
BIKE & PEDESTRIAN PA 500 SEA WORLD DR SAN DIEGO, CA 92109	CIWQS	N/A

EXECUTIVE SUMMARY

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL..... National Priority List
Proposed NPL..... Proposed National Priority List Sites
NPL LIENS..... Federal Superfund Liens

Federal Delisted NPL site list

Delisted NPL..... National Priority List Deletions

Federal CERCLIS list

FEDERAL FACILITY..... Federal Facility Site Information listing
SEMS..... Superfund Enterprise Management System

Federal RCRA CORRACTS facilities list

CORRACTS..... Corrective Action Report

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF..... RCRA - Treatment, Storage and Disposal

Federal RCRA generators list

RCRA-SQG..... RCRA - Small Quantity Generators
RCRA-CESQG..... RCRA - Conditionally Exempt Small Quantity Generator

Federal institutional controls / engineering controls registries

LUCIS..... Land Use Control Information System
US ENG CONTROLS..... Engineering Controls Sites List
US INST CONTROL..... Sites with Institutional Controls

State- and tribal - equivalent NPL

RESPONSE..... State Response Sites

State and tribal leaking storage tank lists

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

State and tribal registered storage tank lists

FEMA UST..... Underground Storage Tank Listing

EXECUTIVE SUMMARY

INDIAN UST..... Underground Storage Tanks on Indian Land

State and tribal voluntary cleanup sites

VCP..... Voluntary Cleanup Program Properties
INDIAN VCP..... Voluntary Cleanup Priority Listing

State and tribal Brownfields sites

BROWNFIELDS..... Considered Brownfields Sites Listing

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS..... A Listing of Brownfields Sites

Local Lists of Landfill / Solid Waste Disposal Sites

WMUDS/SWAT..... Waste Management Unit Database
SWRCY..... Recycler Database
HAULERS..... Registered Waste Tire Haulers Listing
INDIAN ODI..... Report on the Status of Open Dumps on Indian Lands
ODI..... Open Dump Inventory
DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations
IHS OPEN DUMPS..... Open Dumps on Indian Land

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL..... Delisted National Clandestine Laboratory Register
HIST Cal-Sites..... Historical Calsites Database
SCH..... School Property Evaluation Program
CDL..... Clandestine Drug Labs
Toxic Pits..... Toxic Pits Cleanup Act Sites
US CDL..... National Clandestine Laboratory Register
PFAS..... PFAS Contamination Site Location Listing

Local Lists of Registered Storage Tanks

CA FID UST..... Facility Inventory Database

Local Land Records

LIENS..... Environmental Liens Listing
LIENS 2..... CERCLA Lien Information
DEED..... Deed Restriction Listing

Records of Emergency Release Reports

HMIRS..... Hazardous Materials Information Reporting System
LDS..... Land Disposal Sites Listing
MCS..... Military Cleanup Sites Listing
SPILLS 90..... SPILLS 90 data from FirstSearch

Other Ascertainable Records

DOD..... Department of Defense Sites

EXECUTIVE SUMMARY

SCRD DRYCLEANERS.....	State Coalition for Remediation of Drycleaners Listing
US FIN ASSUR.....	Financial Assurance Information
EPA WATCH LIST.....	EPA WATCH LIST
2020 COR ACTION.....	2020 Corrective Action Program List
TSCA.....	Toxic Substances Control Act
TRIS.....	Toxic Chemical Release Inventory System
SSTS.....	Section 7 Tracking Systems
ROD.....	Records Of Decision
RMP.....	Risk Management Plans
RAATS.....	RCRA Administrative Action Tracking System
PRP.....	Potentially Responsible Parties
PADS.....	PCB Activity Database System
FTTS.....	FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
MLTS.....	Material Licensing Tracking System
COAL ASH DOE.....	Steam-Electric Plant Operation Data
COAL ASH EPA.....	Coal Combustion Residues Surface Impoundments List
PCB TRANSFORMER.....	PCB Transformer Registration Database
RADINFO.....	Radiation Information Database
HIST FTTS.....	FIFRA/TSCA Tracking System Administrative Case Listing
DOT OPS.....	Incident and Accident Data
CONSENT.....	Superfund (CERCLA) Consent Decrees
INDIAN RESERV.....	Indian Reservations
FUSRAP.....	Formerly Utilized Sites Remedial Action Program
UMTRA.....	Uranium Mill Tailings Sites
LEAD SMELTERS.....	Lead Smelter Sites
US AIRS.....	Aerometric Information Retrieval System Facility Subsystem
US MINES.....	Mines Master Index File
ABANDONED MINES.....	Abandoned Mines
DOCKET HWC.....	Hazardous Waste Compliance Docket Listing
UXO.....	Unexploded Ordnance Sites
FUELS PROGRAM.....	EPA Fuels Program Registered Listing
CA BOND EXP. PLAN.....	Bond Expenditure Plan
Cortese.....	"Cortese" Hazardous Waste & Substances Sites List
CUPA Listings.....	CUPA Resources List
DRYCLEANERS.....	Cleaner Facilities
Financial Assurance.....	Financial Assurance Information Listing
ICE.....	ICE
HWT.....	Registered Hazardous Waste Transporter Database
MINES.....	Mines Site Location Listing
MWMP.....	Medical Waste Management Program Listing
PROC.....	Certified Processors Database
UIC.....	UIC Listing
UIC GEO.....	UIC GEO (GEOTRACKER)
WASTEWATER PITS.....	Oil Wastewater Pits Listing
WIP.....	Well Investigation Program Case List
MILITARY PRIV SITES.....	MILITARY PRIV SITES (GEOTRACKER)
PROJECT.....	PROJECT (GEOTRACKER)
WDR.....	Waste Discharge Requirements Listing
NON-CASE INFO.....	NON-CASE INFO (GEOTRACKER)
OTHER OIL GAS.....	OTHER OIL & GAS (GEOTRACKER)
PROD WATER PONDS.....	PROD WATER PONDS (GEOTRACKER)
SAMPLING POINT.....	SAMPLING POINT (GEOTRACKER)
WELL STIM PROJ.....	Well Stimulation Project (GEOTRACKER)

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP..... EDR Proprietary Manufactured Gas Plants

EXECUTIVE SUMMARY

EDR Hist Auto..... EDR Exclusive Historical Auto Stations
EDR Hist Cleaner..... EDR Exclusive Historical Cleaners

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA LF..... Recovered Government Archive Solid Waste Facilities List

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Federal CERCLIS NFRAP site list

SEMS-ARCHIVE: SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be potential NPL site.

A review of the SEMS-ARCHIVE list, as provided by EDR, and dated 04/11/2019 has revealed that there are 3 SEMS-ARCHIVE sites within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MISSION BAY LDFL Site ID: 0902103 EPA Id: CAD980881353	BET SN DIEGO RIV & M	ESE 0 - 1/8 (0.098 mi.)	109	537
SACKETT & PENDLEBURY Site ID: 0903101 EPA Id: CAD982360190	3630 HANCOCK ST	ESE 1/4 - 1/2 (0.358 mi.)	H122	636
BURKE CO THE 08 Site ID: 0903106	3870 HOUSTON ST	ESE 1/4 - 1/2 (0.466 mi.)	135	688

EXECUTIVE SUMMARY

EPA Id: CAD084240761

Federal ERNS list

ERNS: The Emergency Response Notification System records and stores information on reported releases of oil and hazardous substances. The source of this database is the U.S. EPA.

A review of the ERNS list, as provided by EDR, and dated 03/25/2019 has revealed that there are 14 ERNS sites within approximately 0.001 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
Not reported NRC Report #: 1141695	1660 SOUTH SHORES RD	0 - 1/8 (0.000 mi.)	C46	193
Not reported NRC Report #: 1120359	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C47	197
Not reported NRC Report #: 1233299	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C49	203
Not reported NRC Report #: 1013442	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C50	207
Not reported NRC Report #: 1158560	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C51	211
Not reported NRC Report #: 1057258	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C55	219
Not reported NRC Report #: 1020535	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C60	291
Not reported NRC Report #: 1054517	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C62	297
Not reported NRC Report #: 1146674	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C64	302
Not reported NRC Report #: 1122161	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C75	335
Not reported NRC Report #: 851942	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C78	340
Not reported NRC Report #: 1174663	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C81	346
Not reported NRC Report #: 1072184	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C89	368
Not reported NRC Report #: 398202	1720 SOUTH SHORES RD	0 - 1/8 (0.000 mi.)	C91	373

State- and tribal - equivalent CERCLIS

ENVIROSTOR: The Department of Toxic Substances Control's (DTSC's) Site Mitigation and Brownfields Reuse Program's (SMBRP's) EnviroStor database identifies sites that have known contamination or sites for which

EXECUTIVE SUMMARY

there may be reasons to investigate further. The database includes the following site types: Federal Superfund sites (National Priorities List (NPL)); State Response, including Military Facilities and State Superfund; Voluntary Cleanup; and School sites. EnviroStor provides similar information to the information that was available in CalSites, and provides additional site information, including, but not limited to, identification of formerly-contaminated properties that have been released for reuse, properties where environmental deed restrictions have been recorded to prevent inappropriate land uses, and risk characterization information that is used to assess potential impacts to public health and the environment at contaminated sites.

A review of the ENVIROSTOR list, as provided by EDR, and dated 04/29/2019 has revealed that there are 14 ENVIROSTOR sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MISSION CHEMICAL CO. Facility Id: 37510124 Status: Refer: Other Agency	4990 NAPLES	ENE 1/2 - 1 (0.886 mi.)	158	815
CORREIA JUNIOR HIGH Facility Id: 60000103 Status: Active	4302 VALETA	SSW 1/2 - 1 (0.897 mi.)	159	827
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
RAD STATION L-6 MIS Facility Id: 80000424 Status: Inactive - Needs Evaluation		ESE 0 - 1/8 (0.047 mi.)	D104	495
WRIGHT SURF REPAIR Facility Id: 37370122 Status: Refer: Other Agency	3630 HANCOCK ST	ESE 1/4 - 1/2 (0.358 mi.)	H121	624
LA DE OFFICE & YD S Facility Id: 80000297 Status: Inactive - Needs Evaluation		S 1/4 - 1/2 (0.395 mi.)	K128	641
SAN DIEGO GUN TOWER Facility Id: 80000454 Status: Inactive - Needs Evaluation		ESE 1/4 - 1/2 (0.419 mi.)	L133	685
PHOTIC OF SAN DIEGO Facility Id: 71002960 Status: Inactive - Needs Evaluation	3515 HANCOCK ST	ESE 1/4 - 1/2 (0.442 mi.)	134	686
BURKE CO THE 08 Facility Id: 37290006 Status: No Further Action	3870 HOUSTON ST	ESE 1/4 - 1/2 (0.466 mi.)	135	688
TRUCK TERMINAL Facility Id: 37420016 Status: Refer: 1248 Local Agency	3495 KURTS STREET	SE 1/4 - 1/2 (0.491 mi.)	N142	740
DYKE - SAN DIEGO HBR Facility Id: 80000451 Status: Inactive - Needs Evaluation		SSW 1/2 - 1 (0.536 mi.)	O148	791
DON POLLOCK EXCAVATI Facility Id: 37170001 Status: Refer: Other Agency	3366 KURTZ STREET	ESE 1/2 - 1 (0.608 mi.)	P153	805
BOYCE INDUSTRIES Facility Id: 37510093	3344 KURTZ ST	ESE 1/2 - 1 (0.627 mi.)	P154	807

EXECUTIVE SUMMARY

Status: No Further Action			
MIDWAY DRIVE (A.K.A. Facility Id: 80001106 Status: Inactive - Needs Evaluation	SE 1/2 - 1 (0.885 mi.)	Q157	814
SAN DIEGO MFG PLT Facility Id: 80000456 Status: Inactive - Needs Evaluation	ESE 1/2 - 1 (0.981 mi.)	R162	850

State and tribal landfill and/or solid waste disposal site lists

SWF/LF: The Solid Waste Facilities/Landfill Sites records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. The data come from the Integrated Waste Management Board's Solid Waste Information System (SWIS) database.

A review of the SWF/LF list, as provided by EDR, has revealed that there is 1 SWF/LF site within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
MISSION BAY LANDFILL Database: SWF/LF (SWIS), Date of Government Version: 05/13/2019 Facility ID: 37-AA-0026 Operational Status: Closed Regulation Status: Unpermitted	SEA WORLD DRIVE	ESE 0 - 1/8 (0.104 mi.)	110	539

State and tribal leaking storage tank lists

SAN DIEGO CO. SAM: The listing contains all underground tank release cases and projects pertaining to properties contaminated with hazardous substances that are actively under review by the Site Assessment and Mitigation Program.

A review of the SAN DIEGO CO. SAM list, as provided by EDR, and dated 03/23/2010 has revealed that there are 15 SAN DIEGO CO. SAM sites within approximately 0.5 miles of the target property.

Lower Elevation	Address	Direction / Distance	Map ID	Page
SEA WORLD MARINA Case Number: H21142-004 Case Number: H21142-002 Case Number: H21142-003 Case Number: H21142-001 Facility Status: Closed Case	1660 S SHORES RD	0 - 1/8 (0.000 mi.)	C72	317
DANA LANDING FUEL DO Case Number: H03337-001 Facility Status: Closed Case	2590 INGRAHAM ST	WNW 0 - 1/8 (0.019 mi.)	B99	481
SEAFORTH SPORTFISHIN Case Number: H21141-001 Facility Status: Closed Case	1717 QUIVIRA RD	W 1/8 - 1/4 (0.159 mi.)	F112	558
SEAFORTH MARINA	1677 QUIVIRA RD	W 1/8 - 1/4 (0.180 mi.)	F114	587

EXECUTIVE SUMMARY

Case Number: H10554-001 Facility Status: Closed Case				
ACTIVCARE AT POINT L	3423 CHANNEL WY	SE 1/4 - 1/2 (0.312 mi.)	117	592
Case Number: H15864-001 Facility Status: Closed Case				
BENTON ROOFING	3691 HANCOCK ST	ESE 1/4 - 1/2 (0.317 mi.)	119	594
Case Number: H04267-001 Facility Status: Closed Case				
BUTLER, LYLE	3612 KURTZ ST	ESE 1/4 - 1/2 (0.338 mi.)	120	619
Case Number: H21154-001 Case Number: H21154-002 Facility Status: Closed Case				
ISLANDIA SPORTFISHIN	1551 W MISSION BAY D	W 1/4 - 1/2 (0.366 mi.)	J125	637
Case Number: H21138-001 Facility Status: Closed Case				
HYATT REGENCY MISSIO	1441 QUIVIRA RD	W 1/4 - 1/2 (0.419 mi.)	J132	655
Case Number: H12330-001 Facility Status: Closed Case				
STONEWOOD GARDENS AP	3835 MIDWAY DR	SSE 1/4 - 1/2 (0.466 mi.)	136	700
Case Number: 2007-324-001 Facility Status: Closed Case				
MISSION BAY MARINA	1548 QUIVIRA	WSW 1/4 - 1/2 (0.473 mi.)	M137	700
Case Number: H10545-001 Facility Status: Closed Case				
GENIE CAR WASH	3949 POINT LOMA BLVD	SSE 1/4 - 1/2 (0.473 mi.)	139	705
Case Number: H00703-001 Facility Status: Remedial Investigation				
GOLDEN CHARIOT TRUCK	3495 KURTZ ST	SE 1/4 - 1/2 (0.488 mi.)	N141	737
Case Number: H19221-001 Case Number: H21153-001 Facility Status: Closed Case				
JENSEN MEAT COMPANY	3477 HANCOCK ST	ESE 1/4 - 1/2 (0.493 mi.)	143	741
Case Number: H04589-001 Facility Status: Closed Case				
U HAUL INTERNATIONAL	3820 MIDWAY DR	SSE 1/4 - 1/2 (0.496 mi.)	145	779
Case Number: H12159-001 Facility Status: Closed Case				

LUST: Leaking Underground Storage Tank (LUST) Sites included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

A review of the LUST list, as provided by EDR, has revealed that there are 20 LUST sites within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEA WORLD MARINA	1660 S SHORES RD	0 - 1/8 (0.000 mi.)	C72	317
Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed				

EXECUTIVE SUMMARY

Global Id: T0607302766
Global Id: T0607300861

SEA WORLD INC	1720 SOUTH SHORES RO	0 - 1/8 (0.000 mi.)	C83	363
Database: LUST REG 9, Date of Government Version: 03/01/2001				
Status: Remedial action (cleanup) Underway				
Case Number: 9UT2091				
SEA WORLD, PEREZ COV	1660 SOUTH SHORES RD	0 - 1/8 (0.000 mi.)	C84	364
Database: LUST REG 9, Date of Government Version: 03/01/2001				
Closed Date: 12/20/91				
Status: Case Closed				
Case Number: 9UT464				
DANA LANDING FUEL DO	2590 INGRAHAM ST	WNW 0 - 1/8 (0.019 mi.)	B102	485
Database: LUST, Date of Government Version: 12/10/2018				
Status: Completed - Case Closed				
Global Id: T0607302265				
DANA LANDING FUEL DO	2590 INGRAHAM ST	WNW 0 - 1/8 (0.019 mi.)	B103	487
Database: LUST REG 9, Date of Government Version: 03/01/2001				
Status: Preliminary site assessment workplan submitted				
Case Number: 9UT3499				
SEAFORTH SPORTFISHIN	1717 QUIVIRA CT	W 1/8 - 1/4 (0.159 mi.)	F111	541
Database: LUST, Date of Government Version: 12/10/2018				
Status: Completed - Case Closed				
Global Id: T0607302777				
SEAFORTH SPORTFISHIN	1717 QUIVIRA RD	W 1/8 - 1/4 (0.159 mi.)	F113	586
Database: LUST REG 9, Date of Government Version: 03/01/2001				
Closed Date: 10/16/92				
Status: Case Closed				
Case Number: 9UT476				
SEAFORTH MARINA	1677 QUIVIRA RD	W 1/8 - 1/4 (0.180 mi.)	F114	587
Database: LUST REG 9, Date of Government Version: 03/01/2001				
Closed Date: 7/24/86				
Status: Case Closed				
Case Number: 9UT57				
ISLANDIA SPORTSFISHI	1551 MISSION BAY	W 1/4 - 1/2 (0.312 mi.)	118	593
Database: LUST REG 9, Date of Government Version: 03/01/2001				
Status: Preliminary site assessment underway				
Case Number: 9UT3915				
BENTON ROOFING	3691 HANCOCK ST	ESE 1/4 - 1/2 (0.317 mi.)	119	594
Database: LUST REG 9, Date of Government Version: 03/01/2001				
Database: LUST, Date of Government Version: 12/10/2018				
Status: Completed - Case Closed				
Closed Date: 2/18/00				
Status: Case Closed				
Global Id: T0607301928				
Case Number: 9UT3161				
BUTLER, LYLE	3612 KURTZ ST	ESE 1/4 - 1/2 (0.338 mi.)	120	619
Database: LUST REG 9, Date of Government Version: 03/01/2001				
Database: LUST, Date of Government Version: 12/10/2018				
Status: Completed - Case Closed				
Closed Date: 2/12/98				
Status: Case Closed				

EXECUTIVE SUMMARY

Global Id: T0607300339
Case Number: 9UT1519

ISLANDIA SPORTFISHIN	1551 W MISSION BAY D	W 1/4 - 1/2 (0.366 mi.)	J125	637
Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed Global Id: T0607302675				
HYATT ISLANDIA HOTEL	1441 QUIVIRA CT	W 1/4 - 1/2 (0.419 mi.)	J130	643
Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed Global Id: T0607303027				
HYATT ISLANDIA	1441 QUIVIRA RD	W 1/4 - 1/2 (0.419 mi.)	J131	647
Database: LUST REG 9, Date of Government Version: 03/01/2001 Closed Date: 11/17/94 Status: Case Closed Case Number: 9UT775				
MISSION BAY MARINA	1548 QUIVIRA WAY	WSW 1/4 - 1/2 (0.473 mi.)	M138	702
Database: LUST REG 9, Date of Government Version: 03/01/2001 Closed Date: 6/15/87 Status: Case Closed Case Number: 9UT261				
GENIE CAR WASH	3949 POINT LOMA BLVD	SSE 1/4 - 1/2 (0.473 mi.)	139	705
Database: LUST REG 9, Date of Government Version: 03/01/2001 Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed Status: Preliminary site assessment workplan submitted Global Id: T0607302125 Case Number: 9UT3363				
GOLDEN CHARIOT TRUCK	3495 KURTZ ST	SE 1/4 - 1/2 (0.488 mi.)	N140	730
Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed Global Id: T0608122119				
JENSEN MEAT COMPANY	3477 HANCOCK ST	ESE 1/4 - 1/2 (0.493 mi.)	143	741
Database: LUST REG 9, Date of Government Version: 03/01/2001 Closed Date: 10/22/86 Status: Case Closed Case Number: 9UT229				
1500 QUIVIRA WAY	1500 QUIVIRA WAY	WSW 1/4 - 1/2 (0.494 mi.)	M144	745
Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed Global Id: T10000005269				
U HAUL INTERNATIONAL	3820 MIDWAY DR	SSE 1/4 - 1/2 (0.496 mi.)	145	779
Database: LUST REG 9, Date of Government Version: 03/01/2001 Database: LUST, Date of Government Version: 12/10/2018 Status: Completed - Case Closed Status: Preliminary site assessment underway Global Id: T0607300360 Case Number: 9UT1541				

EXECUTIVE SUMMARY

CPS-SLIC: Cleanup Program Sites (CPS; also known as Site Cleanups [SC] and formerly known as Spills, Leaks, Investigations, and Cleanups [SLIC] sites) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

A review of the CPS-SLIC list, as provided by EDR, has revealed that there are 8 CPS-SLIC sites within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEA WORLD MARINA Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Global Id: T0608107147 Global Id: T0608117690	1660 S SHORES RD	0 - 1/8 (0.000 mi.)	C72	317
SEAFORTH MARINA Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Global Id: T0607302858	1677 QUIVIRA RD	W 1/8 - 1/4 (0.180 mi.)	F114	587
ACTIVCARE AT POINT L Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Global Id: T0608166682	3423 CHANNEL WY	SE 1/4 - 1/2 (0.312 mi.)	117	592
BUTLER, LYLE Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Global Id: T0608198857	3612 KURTZ ST	ESE 1/4 - 1/2 (0.338 mi.)	120	619
MISSION BAY MARINA Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Global Id: T0607301361	1548 QUIVIRA WAY	WSW 1/4 - 1/2 (0.473 mi.)	M138	702
GOLDEN CHARIOT TRUCK Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Global Id: T0608180738	3495 KURTZ ST	SE 1/4 - 1/2 (0.488 mi.)	N140	730
JENSEN MEAT COMPANY Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Completed - Case Closed Global Id: T0607301056	3477 HANCOCK ST	ESE 1/4 - 1/2 (0.493 mi.)	143	741
1500 QUIVIRA WAY Database: CPS-SLIC, Date of Government Version: 12/10/2018 Facility Status: Open - Inactive Global Id: T10000006510	1500 QUIVIRA WAY	WSW 1/4 - 1/2 (0.494 mi.)	M144	745

State and tribal registered storage tank lists

UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the State Water Resources Control Board's Hazardous Substance Storage Container Database.

A review of the UST list, as provided by EDR, has revealed that there are 4 UST sites within

EXECUTIVE SUMMARY

approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEAWORLD Database: UST, Date of Government Version: 06/10/2019 Facility Id: 37-000-100905	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C52	216
DANA LANDING FUEL DO Database: UST, Date of Government Version: 06/10/2019 Facility Id: H03337	2590 INGRAHAM ST	WNW 0 - 1/8 (0.019 mi.)	B99	481
DANA LANDING FUEL DO Database: UST, Date of Government Version: 06/10/2019 Facility Id: 37-000-103337	2580 INGRAHAM ST	WNW 0 - 1/8 (0.078 mi.)	E107	536
SEAFORTH SPORTFISHIN Database: UST, Date of Government Version: 06/10/2019 Facility Id: 37-000-121141	1717 QUIVIRA RD	W 1/8 - 1/4 (0.159 mi.)	F112	558

AST: A listing of aboveground storage tank petroleum storage tank locations.

A review of the AST list, as provided by EDR, has revealed that there is 1 AST site within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEAWORLD Database: AST, Date of Government Version: 07/06/2016	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C95	384

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Hazardous waste / Contaminated Sites

San Diego Co. HMMD: The Hazardous Materials Management Division Database comes from the Hazardous Materials Management Division.

A review of the San Diego Co. HMMD list, as provided by EDR, and dated 03/04/2019 has revealed that there are 4 San Diego Co. HMMD sites within approximately 0.001 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUBBS-SEA WORLD INST Record ID: DEH2002-HUPFP-134291	2595 INGRAHAM STREET	0 - 1/8 (0.000 mi.)	B37	165
SEA WORLD MARINA	1660 SHORES RD	0 - 1/8 (0.000 mi.)	C57	225
SEAWORLD	1700 S SHORES RD	0 - 1/8 (0.000 mi.)	C59	228
SEAWORLD Record ID: DEH2002-HUPFP-100905	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C96	385

EXECUTIVE SUMMARY

CERS HAZ WASTE: List of sites in the California Environmental Protection Agency (CalEPA) Regulated Site Portal which fall under the Hazardous Chemical Management, Hazardous Waste Onsite Treatment, Household Hazardous Waste Collection, Hazardous Waste Generator, and RCRA LQ HW Generator programs.

A review of the CERS HAZ WASTE list, as provided by EDR, and dated 04/09/2019 has revealed that there are 4 CERS HAZ WASTE sites within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUBBS-SEA WORLD INST	2595 INGRAHAM STREET	0 - 1/8 (0.000 mi.)	B37	165
SEAWORLD	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C96	385
DANA LANDING FUEL DO	2580 INGRAHAM ST	WNW 0 - 1/8 (0.078 mi.)	E106	496
SEAFORTH SPORTFISHIN	1717 QUIVIRA CT	W 1/8 - 1/4 (0.159 mi.)	F111	541

Local Lists of Registered Storage Tanks

SWEEPS UST: Statewide Environmental Evaluation and Planning System. This underground storage tank listing was updated and maintained by a company contacted by the SWRCB in the early 1990's. The listing is no longer updated or maintained. The local agency is the contact for more information on a site on the SWEEPS list.

A review of the SWEEPS UST list, as provided by EDR, and dated 06/01/1994 has revealed that there are 6 SWEEPS UST sites within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEA WORLD Status: A Tank Status: A Comp Number: 905	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C68	308
SEA WORLD MARINA Status: A Comp Number: 21142	1660 S SHORES RD	0 - 1/8 (0.000 mi.)	C72	317
DANA LANDING FUEL DO Status: A Tank Status: A Comp Number: 3337	2590 INGRAHAM ST	WNW 0 - 1/8 (0.019 mi.)	B103	487
SEAFORTH SPORTFISHIN Status: A Tank Status: A Comp Number: 21141	1717 QUIVIRA CT	W 1/8 - 1/4 (0.159 mi.)	F111	541
SEAFORTH SPORTFISHIN Comp Number: 21141	1717 QUIVIRA RD	W 1/8 - 1/4 (0.159 mi.)	F112	558
SEAFORTH MARINA Comp Number: 10554	1677 QUIVIRA RD	W 1/8 - 1/4 (0.180 mi.)	F114	587

EXECUTIVE SUMMARY

HIST UST: Historical UST Registered Database.

A review of the HIST UST list, as provided by EDR, and dated 10/15/1990 has revealed that there are 5 HIST UST sites within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEA WORLD Facility Id: 00000011930	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C68	308
SEA WORLD MARINA Facility Id: 00000011929	1660 SOUTH SHORES RO	0 - 1/8 (0.000 mi.)	C85	365
DANA LANDING FUEL DO Facility Id: 00000067207	2590 INGRAHAM ST	WNW 0 - 1/8 (0.019 mi.)	B99	481
DANA MARINA BAIT & T Facility Id: 00000018546	2590 INGRAHAM ST	WNW 0 - 1/8 (0.019 mi.)	B100	483
MARSHALL SHIELDS	2590 INGRAHAM ST	WNW 0 - 1/8 (0.019 mi.)	B101	484

CERS TANKS: List of sites in the California Environmental Protection Agency (CalEPA) Regulated Site Portal which fall under the Aboveground Petroleum Storage and Underground Storage Tank regulatory programs.

A review of the CERS TANKS list, as provided by EDR, and dated 04/09/2019 has revealed that there are 3 CERS TANKS sites within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEAWORLD	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C96	385
DANA LANDING FUEL DO	2580 INGRAHAM ST	WNW 0 - 1/8 (0.078 mi.)	E106	496
SEAFORTH SPORTFISHIN	1717 QUIVIRA CT	W 1/8 - 1/4 (0.159 mi.)	F111	541

Records of Emergency Release Reports

CHMIRS: The California Hazardous Material Incident Report System contains information on reported hazardous material incidents, i.e., accidental releases or spills. The source is the California Office of Emergency Services.

A review of the CHMIRS list, as provided by EDR, and dated 10/24/2018 has revealed that there are 16 CHMIRS sites within approximately 0.001 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
Not reported OES Incident Number: 803649 Date Completed: 02-NOV-88	SEA WORLD OFF RAMP	0 - 1/8 (0.000 mi.)	36	164
Not reported OES Incident Number: 7-6359 OES Incident Number: 12-3251	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C45	190
Not reported OES Incident Number: 16-1273	1660 SOUTH SHORES RO	0 - 1/8 (0.000 mi.)	C53	216
Not reported OES Incident Number: 18-2341	1660 SOUTH SHORES RO	0 - 1/8 (0.000 mi.)	C54	218
Not reported	1720 SOUTH SHORES RO	0 - 1/8 (0.000 mi.)	C56	224

EXECUTIVE SUMMARY

OES Incident Number: 6-2320				
Not reported	1660 S. SHORES RD.	0 - 1/8 (0.000 mi.)	C58	227
OES Incident Number: 18-2290				
Not reported	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C61	296
OES Incident Number: 18-8566				
Not reported	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C69	313
OES Incident Number: 18-5624				
Not reported	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C70	314
OES Incident Number: 15-3891				
Not reported	1660 S. SHORES ROAD,	0 - 1/8 (0.000 mi.)	C71	316
OES Incident Number: 13-5057				
SEA WORLD MARINA	1660 S SHORES RD	0 - 1/8 (0.000 mi.)	C72	317
OES Incident Number: 18-2098				
OES Incident Number: 18-1904				
OES Incident Number: 18-1900				
OES Incident Number: 18-1415				
OES Incident Number: 4-0493				
Not reported	1660 S. SHORES ROAD,	0 - 1/8 (0.000 mi.)	C74	333
OES Incident Number: 16-5498				
MISSION BAY LANDFILL	MISSION BAY - SEA WO	0 - 1/8 (0.000 mi.)	82	351
OES Incident Number: 3-4193				
OES Incident Number: 7-1545				
OES Incident Number: 7-4062				
OES Incident Number: 6-5693				
OES Incident Number: 3-4217				
<i>*Additional key fields are available in the Map Findings section</i>				
Not reported	1660 S. SHORES ROAD,	0 - 1/8 (0.000 mi.)	C87	366
OES Incident Number: 17-2525				
Not reported	1660 S. SHORES ROAD	0 - 1/8 (0.000 mi.)	C92	377
OES Incident Number: 16-2577				
OES Incident Number: 19-2943				
Not reported	1660 S. SHORES ROAD,	0 - 1/8 (0.000 mi.)	C93	380
OES Incident Number: 15-3482				

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 03/25/2019 has revealed that there are 2 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUBBS-SEA WORLD RESE EPA ID:: CAL930283590	2595 INGRAHAM STREET	0 - 1/8 (0.000 mi.)	B44	189
GOLDEN STATE BOATS I	2630 INGRAHAM ST	WNW 0 - 1/8 (0.019 mi.)	B98	480

EXECUTIVE SUMMARY

EPA ID:: CAL000420263

FUDS: The Listing includes locations of Formerly Used Defense Sites Properties where the US Army Corps Of Engineers is actively working or will take necessary cleanup actions.

A review of the FUDS list, as provided by EDR, and dated 03/07/2019 has revealed that there are 7 FUDS sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SAN DIEGO RIVER/MISS		NNE 1/2 - 1 (0.566 mi.)	150	792
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
RADAR STATION L-6 MI		ESE 0 - 1/8 (0.048 mi.)	D105	496
L.A. DISTRICT ENG OF		S 1/4 - 1/2 (0.395 mi.)	K127	641
SAN DIEGO GUN TOWER		ESE 1/4 - 1/2 (0.418 mi.)	L129	642
DYKE-SAN DIEGO HARBO		SSW 1/2 - 1 (0.535 mi.)	O147	790
MIDWAY DRIVE (A.K.A.		SE 1/2 - 1 (0.884 mi.)	Q156	813
SAN DIEGO MANUFACTUR		ESE 1/2 - 1 (0.980 mi.)	R161	850

FINDS: The Facility Index System contains both facility information and "pointers" to other sources of information that contain more detail. These include: RCRIS; Permit Compliance System (PCS); Aerometric Information Retrieval System (AIRS); FATES (FIFRA [Federal Insecticide Fungicide Rodenticide Act] and TSCA Enforcement System, FTTS [FIFRA/TSCA Tracking System]; CERCLIS; DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes); Federal Underground Injection Control (FURS); Federal Reporting Data System (FRDS); Surface Impoundments (SIA); TSCA Chemicals in Commerce Information System (CICS); PADS; RCRA-J (medical waste transporters/disposers); TRIS; and TSCA. The source of this database is the U.S. EPA/NTIS.

A review of the FINDS list, as provided by EDR, and dated 02/15/2019 has revealed that there are 5 FINDS sites within approximately 0.001 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUBBS-SEA WORLDNA MI Registry ID:: 110065550264	2595 INGRAHAM	0 - 1/8 (0.000 mi.)	B38	184
HUBBS-SEA WORLD RESE Registry ID:: 110070490084	2595 INGRAHAM STREET	0 - 1/8 (0.000 mi.)	B40	186
HUBBS-SEA WORLD RESE Registry ID:: 110066625227	2595 INGRAHAM ST	0 - 1/8 (0.000 mi.)	B42	187
SEA WORLD MARINA Registry ID:: 110066250791	1660 S SHORES RD	0 - 1/8 (0.000 mi.)	C67	307
SEA WORLD INC Registry ID:: 110002144019	1720 SOUTH SHORES RO	0 - 1/8 (0.000 mi.)	C83	363

EXECUTIVE SUMMARY

ECHO: ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

A review of the ECHO list, as provided by EDR, and dated 04/07/2019 has revealed that there are 2 ECHO sites within approximately 0.001 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUBBS-SEA WORLD RESE Registry ID: 110070490084	2595 INGRAHAM STREET	0 - 1/8 (0.000 mi.)	B40	186
SEA WORLD INC Registry ID: 110002144019	1720 SOUTH SHORES RO	0 - 1/8 (0.000 mi.)	C83	363

ENF: A listing of Water Board Enforcement Actions. Formal is everything except Oral/Verbal Communication, Notice of Violation, Expedited Payment Letter, and Staff Enforcement Letter.

A review of the ENF list, as provided by EDR, and dated 11/01/2018 has revealed that there are 2 ENF sites within approximately 0.001 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUBBS-SEA WORLD INST Status: Historical Facility Id: 230781	2595 INGRAHAM STREET	0 - 1/8 (0.000 mi.)	B37	165
MISSION BAY LANDFILL Status: Historical Status: Active Facility Id: 240934	MISSION BAY - SEA WO	0 - 1/8 (0.000 mi.)	82	351

HAZNET: The data is extracted from the copies of hazardous waste manifests received each year by the DTSC. The annual volume of manifests is typically 700,000-1,000,000 annually, representing approximately 350,000-500,000 shipments. Data from non-California manifests & continuation sheets are not included at the present time. Data are from the manifests submitted without correction, and therefore many contain some invalid values for data elements such as generator ID, TSD ID, waste category, & disposal method. The source is the Department of Toxic Substance Control is the agency. This database begins with calendar year 1993.

A review of the HAZNET list, as provided by EDR, and dated 12/31/2017 has revealed that there are 3 HAZNET sites within approximately 0.001 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUBBS-SEA WORLD RESE GEPAID: CAL930283590	2595 INGRAHAM STREET	0 - 1/8 (0.000 mi.)	B43	187
SAMURAYA VESSEL# 943 GEPAID: CAC002595304	1660 S SHORES RD	0 - 1/8 (0.000 mi.)	C76	339
SEA WORLD SAN DIEGO GEPAID: CAD981687221	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C80	345

EXECUTIVE SUMMARY

HIST CORTESE: The sites for the list are designated by the State Water Resource Control Board [LUST], the Integrated Waste Board [SWF/LS], and the Department of Toxic Substances Control [CALSITES]. This listing is no longer updated by the state agency.

A review of the HIST CORTESE list, as provided by EDR, and dated 04/01/2001 has revealed that there are 14 HIST CORTESE sites within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEA WORLD, PEREZ COV Reg Id: 9UT464	1660 SHORES	0 - 1/8 (0.000 mi.)	C63	302
SEA WORLD Reg Id: 9 000000083	1720 SHORES	0 - 1/8 (0.000 mi.)	C66	307
SEA WORLD HYDRO DOCK Reg Id: 9UT2091	1720 SHORES	0 - 1/8 (0.000 mi.)	C97	480
DANA LANDING FUEL DO Reg Id: 9UT3499	2590 INGRAHAM ST	WNW 0 - 1/8 (0.019 mi.)	B102	485
SEAFORTH SPORTFISHIN Reg Id: 9UT476	1717 QUIVIRA	W 1/4 - 1/2 (0.259 mi.)	G115	591
SEAFORTH MARINA Reg Id: 9UT57	1677 QUIVIRA	W 1/4 - 1/2 (0.303 mi.)	G116	591
ISLANDIA SPORTSFISHI Reg Id: 9UT3915	1551 MISSION BAY	W 1/4 - 1/2 (0.312 mi.)	118	593
BENTON ROOFING Reg Id: 9UT3161	3691 HANCOCK ST	ESE 1/4 - 1/2 (0.317 mi.)	119	594
BUTLER, LYLE Reg Id: 9UT1519	3612 KURTZ ST	ESE 1/4 - 1/2 (0.338 mi.)	120	619
HYATT ISLANDIA Reg Id: 9UT775	1441 QUIVIRA RD	W 1/4 - 1/2 (0.419 mi.)	J131	647
MISSION BAY MARINA Reg Id: 9UT261	1548 QUIVIRA	WSW 1/4 - 1/2 (0.473 mi.)	M137	700
GENIE CAR WASH Reg Id: 9UT3363	3949 POINT LOMA BLVD	SSE 1/4 - 1/2 (0.473 mi.)	139	705
JENSEN MEAT COMPANY Reg Id: 9UT2298	3477 HANCOCK ST	ESE 1/4 - 1/2 (0.493 mi.)	143	741
U HAUL INTERNATIONAL Reg Id: 9UT1541	3820 MIDWAY DR	SSE 1/4 - 1/2 (0.496 mi.)	145	779

HWP: Detailed information on permitted hazardous waste facilities and corrective action ("cleanups") tracked in EnviroStor.

A review of the HWP list, as provided by EDR, and dated 05/20/2019 has revealed that there is 1 HWP site within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SOUTHERN CALIFORNIA EPA Id: CAD000630921 Cleanup Status: OPERATING PERMIT	5000 PACIFIC COAST H	E 1/2 - 1 (0.596 mi.)	152	793

EXECUTIVE SUMMARY

NPDES: A listing of NPDES permits, including stormwater.

A review of the NPDES list, as provided by EDR, and dated 05/13/2019 has revealed that there is 1 NPDES site within approximately 0.001 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
1720 S SHORE RD	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C94	382

Notify 65: Listings of all Proposition 65 incidents reported to counties by the State Water Resources Control Board and the Regional Water Quality Control Board. This database is no longer updated by the reporting agency.

A review of the Notify 65 list, as provided by EDR, and dated 03/18/2019 has revealed that there are 10 Notify 65 sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
Not reported	1079 WEST MORENA BLV	E 1/2 - 1 (0.910 mi.)	160	849
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
2500 BLK OF INGRAHAM	DANA LANDING BOAT RA	W 0 - 1/8 (0.086 mi.)	108	537
Not reported	4236 VENUS ST.	S 1/4 - 1/2 (0.359 mi.)	I123	637
Not reported	VENUS ST & CAMULOS S	S 1/4 - 1/2 (0.361 mi.)	I124	637
Not reported	3936 JUPITER ST.	SSE 1/4 - 1/2 (0.373 mi.)	126	640
HYATT REGENCY MISSIO	1441 QUIVIRA RD	W 1/4 - 1/2 (0.419 mi.)	J132	655
S. D. PRINCESS RESOR	1404 VACATION VILLAG	NW 1/2 - 1 (0.522 mi.)	146	790
RELIEF VALVE CLAPPER	I-5 AND S.D. RIVER C	E 1/2 - 1 (0.541 mi.)	149	792
3050 RUE DE ORLEANS	PACIFIC ISLAND APTS.	S 1/2 - 1 (0.590 mi.)	151	793
HOWARD TAYLOR DODGE	3740 ROSECRANS	SE 1/2 - 1 (0.868 mi.)	155	813

WDS: California Water Resources Control Board - Waste Discharge System.

A review of the WDS list, as provided by EDR, and dated 06/19/2007 has revealed that there are 2 WDS sites within approximately 0.001 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUBBS-SEA WORLD MISS Facility Status: A Facility Id: 9 000000578	2595 INGRAHAM STREET	0 - 1/8 (0.000 mi.)	B41	186
MISSION BAY LANDFILL Facility Status: A Facility Id: 9 000000378	MISSION BAY - SEA WO	0 - 1/8 (0.000 mi.)	82	351

SAN DIEGO CO LOP: A listing of all LOP release sites that are or were under the County of San Diego's jurisdiction. Included are closed or transferred cases, open cases, and cases that did not have a case type indicated. The cases without a case type are mostly complaints; however, some of them could be LOP cases.

A review of the SAN DIEGO CO LOP list, as provided by EDR, and dated 04/24/2019 has revealed that there is 1 SAN DIEGO CO LOP site within approximately 0.001 miles of the target property.

EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEA WORLD MARINA	1660 S SHORES RD	0 - 1/8 (0.000 mi.)	C72	317

CIWQS: The California Integrated Water Quality System (CIWQS) is a computer system used by the State and Regional Water Quality Control Boards to track information about places of environmental interest, manage permits and other orders, track inspections, and manage violations and enforcement activities.

A review of the CIWQS list, as provided by EDR, and dated 03/05/2019 has revealed that there are 3 CIWQS sites within approximately 0.001 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MISSION BAY LANDFILL	MISSION BAY - SEA WO	0 - 1/8 (0.000 mi.)	82	351
1720 S SHORES RD	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C90	373
1720 S SHORE RD	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C94	382

CERS: The CalEPA Regulated Site Portal database combines data about environmentally regulated sites and facilities in California into a single database. It combines data from a variety of state and federal databases, and provides an overview of regulated activities across the spectrum of environmental programs for any given location in California. These activities include hazardous materials and waste, state and federal cleanups, impacted ground and surface waters, and toxic materials

A review of the CERS list, as provided by EDR, and dated 04/09/2019 has revealed that there are 5 CERS sites within approximately 0.001 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HUBBS-SEA WORLD INST	2595 INGRAHAM STREET	0 - 1/8 (0.000 mi.)	B37	165
HUBBS-SEA WORLD INST	2595 INGRAHAM	0 - 1/8 (0.000 mi.)	B39	184
SEA WORLD	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C68	308
SEA WORLD MARINA	1660 S SHORES RD	0 - 1/8 (0.000 mi.)	C72	317
SEAWORLD	1720 S SHORES RD	0 - 1/8 (0.000 mi.)	C96	385

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA LUST: The EDR Recovered Government Archive Leaking Underground Storage Tank database provides a list of LUST incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the State Water Resources Control Board in California.

A review of the RGA LUST list, as provided by EDR, has revealed that there are 7 RGA LUST sites within approximately 0.001 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEA WORLD MARINA	1660 S SHORES RD	0 - 1/8 (0.000 mi.)	C48	202
SEA WORLD HYDRO DOCK	1720 SOUTH SHORES RD	0 - 1/8 (0.000 mi.)	C65	306
SEA WORLD, PEREZ COV	1660 SOUTH SHORES RD	0 - 1/8 (0.000 mi.)	C73	333
SEA WORLD HYDRO DOCK	1660 S SHORES RD	0 - 1/8 (0.000 mi.)	C77	340
SEA WORLD, PEREZ COV	1660 SOUTH SHORES DR	0 - 1/8 (0.000 mi.)	C79	344

EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SEA WORLD, PEREZ COV	1660 SOUTH SHORES RO	0 - 1/8 (0.000 mi.)	C86	366
SEA WORLD HYDRO DOCK	1720 SOUTH SHORES DR	0 - 1/8 (0.000 mi.)	C88	368

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 3 records.


Site Name

MISSION BAY (MZB VOR)
MISSION BAY LANDFILL
PUBLIC AUTO SERVICE

Database(s)

San Diego Co. HMMD, SWEEPS UST
ENVIROSTOR
SAN DIEGO CO. SAM

OVERVIEW MAP - 5775389.2S

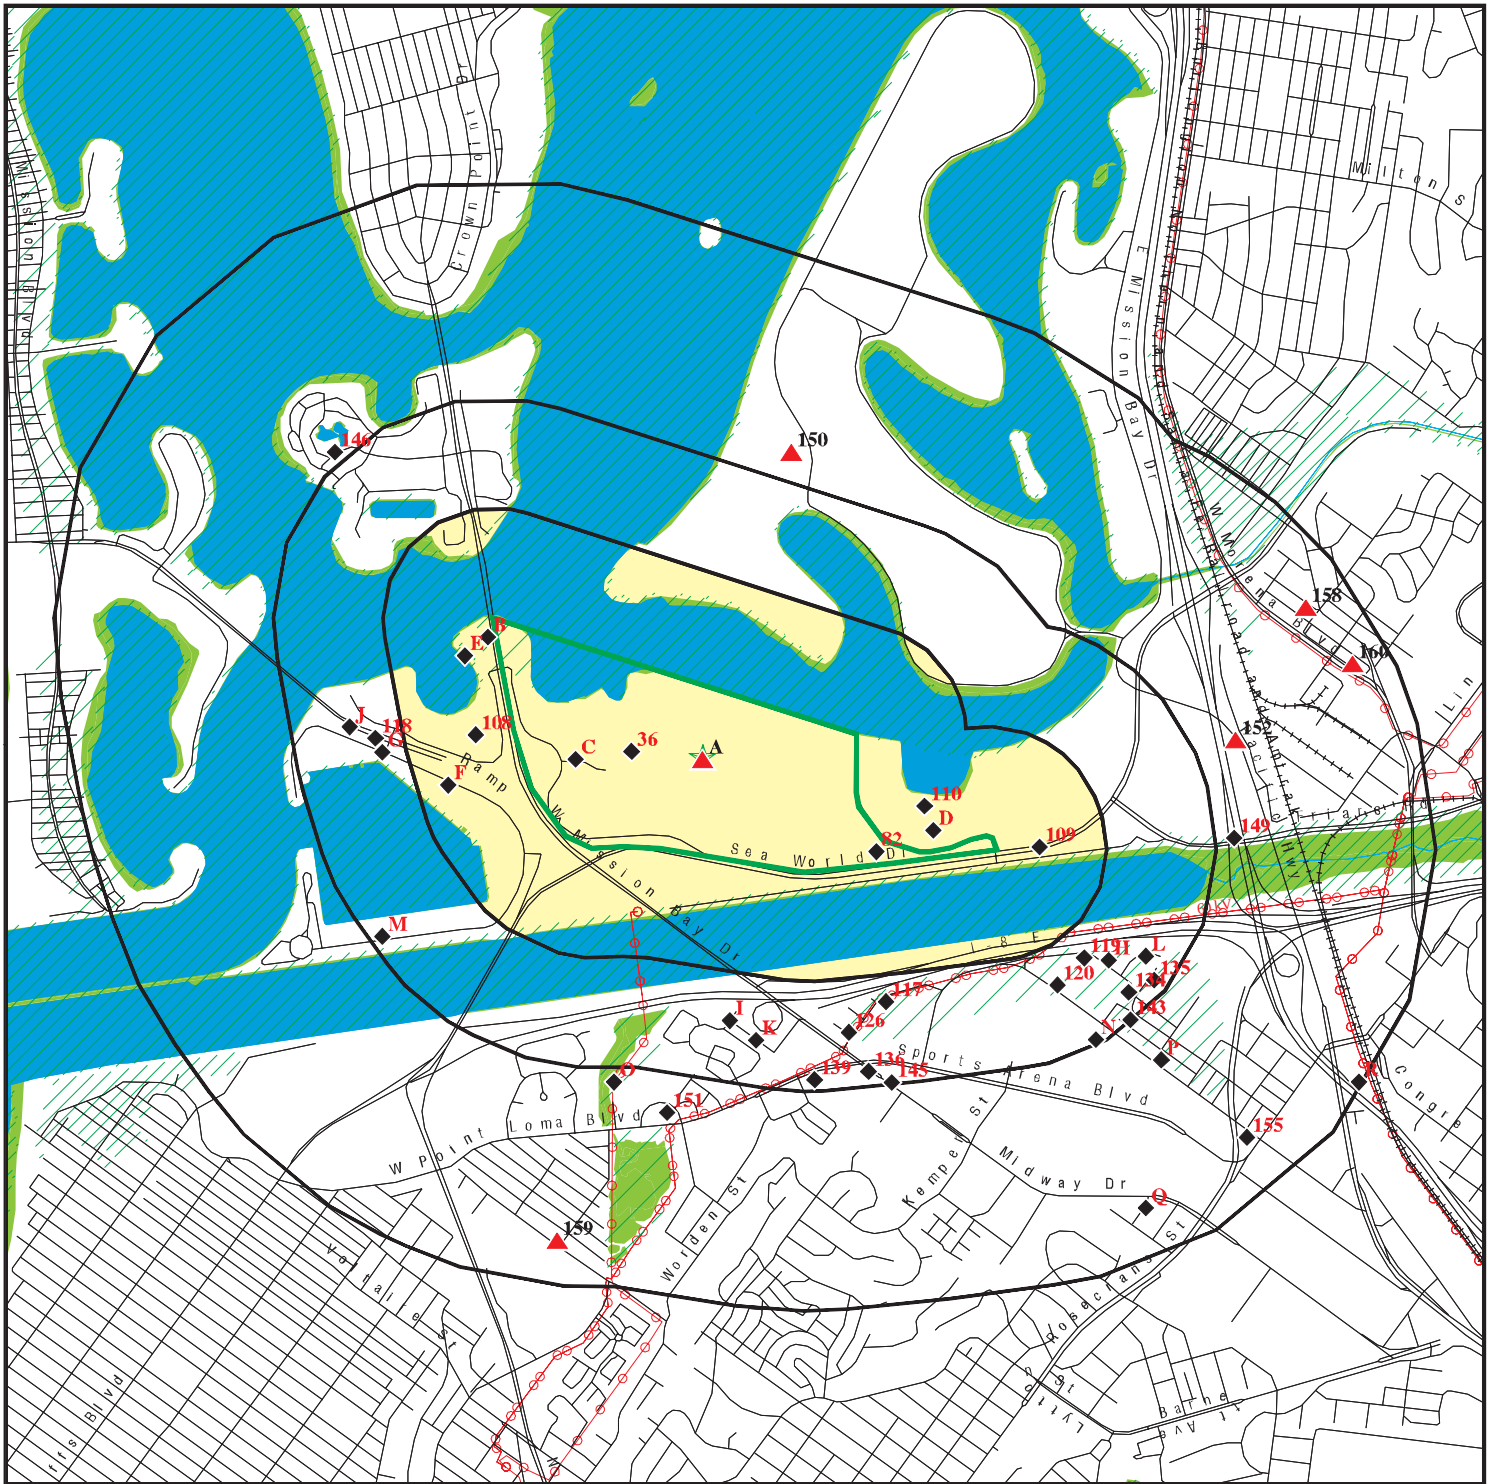

Target Property

Sites at elevations higher than or equal to the target property

Sites at elevations lower than the target property

Manufactured Gas Plants

National Priority List Sites

Dept. Defense Sites

Indian Reservations BIA

Power transmission lines

100-year flood zone

500-year flood zone

National Wetland Inventory

State Wetlands


Areas of Concern

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: SeaWorld
ADDRESS: 500 SeaWorld Dr
San Diego CA 92109
LAT/LONG: 32.764841 / 117.225696

CLIENT: Brown & Caldwell Consultants
CONTACT: Laura Carpenter
INQUIRY #: 5775389.2s
DATE: September 03, 2019 5:29 pm

DETAIL MAP - 5775389.2S

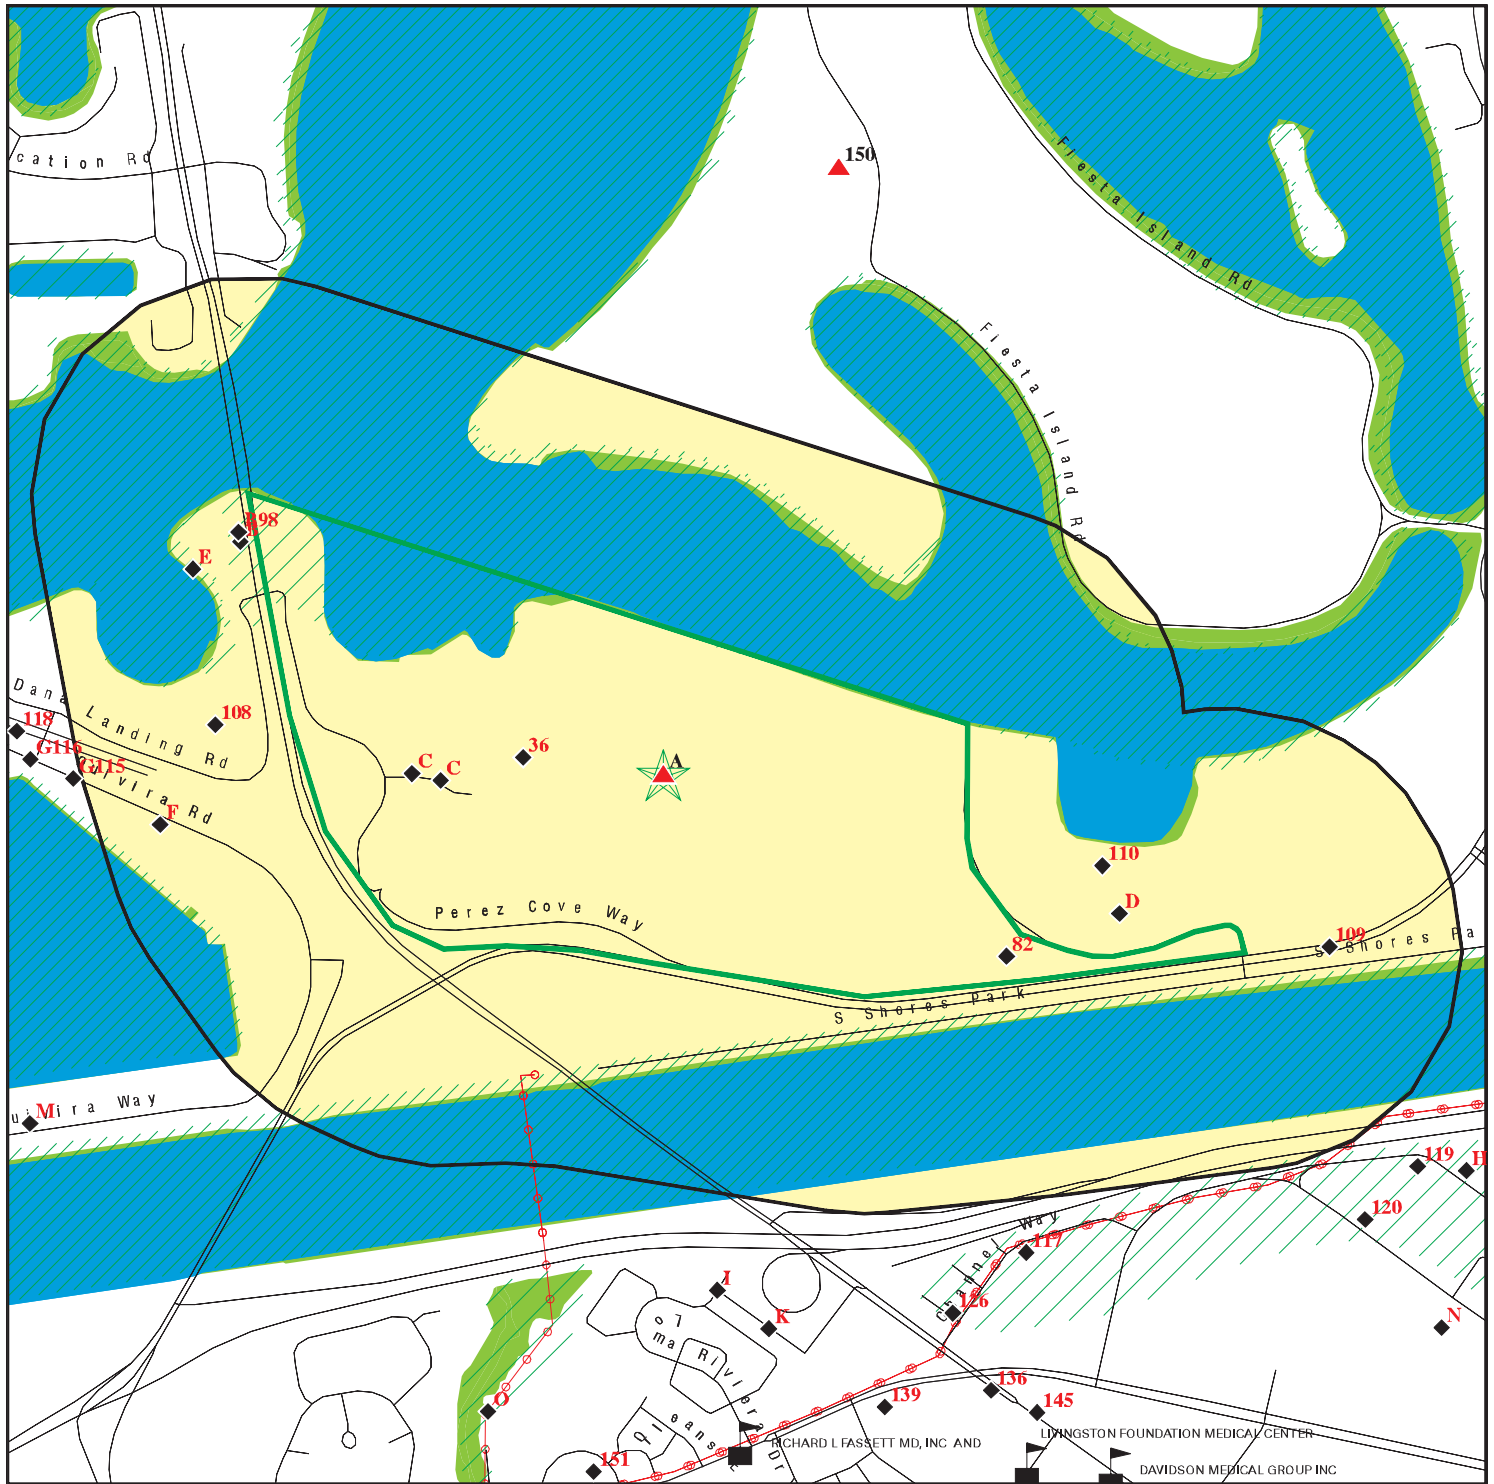

Target Property

Sites at elevations higher than or equal to the target property

Sites at elevations lower than the target property

Manufactured Gas Plants

Sensitive Receptors

National Priority List Sites

Dept. Defense Sites

Indian Reservations BIA

Power transmission lines

100-year flood zone

500-year flood zone

National Wetland Inventory

State Wetlands

Areas of Concern

0 1/8 1/4 1/2 Miles

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: SeaWorld
ADDRESS: 500 SeaWorld Dr
San Diego CA 92109
LAT/LONG: 32.764841 / 117.225696

CLIENT: Brown & Caldwell Consultants
CONTACT: Laura Carpenter
INQUIRY #: 5775389.2s
DATE: September 03, 2019 5:37 pm

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
<i>Federal NPL site list</i>								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	1.000		0	0	0	0	NR	0
<i>Federal Delisted NPL site list</i>								
Delisted NPL	1.000		0	0	0	0	NR	0
<i>Federal CERCLIS list</i>								
FEDERAL FACILITY	0.500		0	0	0	NR	NR	0
SEMS	0.500		0	0	0	NR	NR	0
<i>Federal CERCLIS NFRAP site list</i>								
SEMS-ARCHIVE	0.500		1	0	2	NR	NR	3
<i>Federal RCRA CORRACTS facilities list</i>								
CORRACTS	1.000		0	0	0	0	NR	0
<i>Federal RCRA non-CORRACTS TSD facilities list</i>								
RCRA-TSDF	0.500		0	0	0	NR	NR	0
<i>Federal RCRA generators list</i>								
RCRA-LQG	0.250	1	0	0	NR	NR	NR	1
RCRA-SQG	0.250		0	0	NR	NR	NR	0
RCRA-CESQG	0.250		0	0	NR	NR	NR	0
<i>Federal institutional controls / engineering controls registries</i>								
LUCIS	0.500		0	0	0	NR	NR	0
US ENG CONTROLS	0.500		0	0	0	NR	NR	0
US INST CONTROL	0.500		0	0	0	NR	NR	0
<i>Federal ERNS list</i>								
ERNS	0.001	5	14	NR	NR	NR	NR	19
<i>State- and tribal - equivalent NPL</i>								
RESPONSE	1.000		0	0	0	0	NR	0
<i>State- and tribal - equivalent CERCLIS</i>								
ENVIROSTOR	1.000		1	0	6	7	NR	14
<i>State and tribal landfill and/or solid waste disposal site lists</i>								
SWF/LF	0.500		1	0	0	NR	NR	1
<i>State and tribal leaking storage tank lists</i>								
SAN DIEGO CO. SAM	0.500	1	2	2	11	NR	NR	16

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
LUST	0.500		5	3	12	NR	NR	20
INDIAN LUST	0.500		0	0	0	NR	NR	0
CPS-SLIC	0.500	1	1	1	6	NR	NR	9
State and tribal registered storage tank lists								
FEMA UST	0.250		0	0	NR	NR	NR	0
UST	0.250	1	3	1	NR	NR	NR	5
AST	0.250		1	0	NR	NR	NR	1
INDIAN UST	0.250		0	0	NR	NR	NR	0
State and tribal voluntary cleanup sites								
VCP	0.500		0	0	0	NR	NR	0
INDIAN VCP	0.500		0	0	0	NR	NR	0
State and tribal Brownfields sites								
BROWNFIELDS	0.500		0	0	0	NR	NR	0
ADDITIONAL ENVIRONMENTAL RECORDS								
Local Brownfield lists								
US BROWNFIELDS	0.500		0	0	0	NR	NR	0
Local Lists of Landfill / Solid Waste Disposal Sites								
WMUDS/SWAT	0.500		0	0	0	NR	NR	0
SWRCY	0.500		0	0	0	NR	NR	0
HAULERS	0.001		0	NR	NR	NR	NR	0
INDIAN ODI	0.500		0	0	0	NR	NR	0
ODI	0.500		0	0	0	NR	NR	0
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
IHS OPEN DUMPS	0.500		0	0	0	NR	NR	0
Local Lists of Hazardous waste / Contaminated Sites								
US HIST CDL	0.001		0	NR	NR	NR	NR	0
HIST Cal-Sites	1.000		0	0	0	0	NR	0
SCH	0.250		0	0	NR	NR	NR	0
CDL	0.001		0	NR	NR	NR	NR	0
San Diego Co. HMMD	0.001	1	4	NR	NR	NR	NR	5
CERS HAZ WASTE	0.250		3	1	NR	NR	NR	4
Toxic Pits	1.000		0	0	0	0	NR	0
US CDL	0.001		0	NR	NR	NR	NR	0
PFAS	0.500		0	0	0	NR	NR	0
Local Lists of Registered Storage Tanks								
SWEEPS UST	0.250		3	3	NR	NR	NR	6
HIST UST	0.250		5	0	NR	NR	NR	5
CA FID UST	0.250		0	0	NR	NR	NR	0
CERS TANKS	0.250		2	1	NR	NR	NR	3
Local Land Records								
LIENS	0.001		0	NR	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
LIENS 2	0.001		0	NR	NR	NR	NR	0
DEED	0.500		0	0	0	NR	NR	0
Records of Emergency Release Reports								
HMIRS	0.001		0	NR	NR	NR	NR	0
CHMIRS	0.001	5	16	NR	NR	NR	NR	21
LDS	0.001		0	NR	NR	NR	NR	0
MCS	0.001		0	NR	NR	NR	NR	0
SPILLS 90	0.001		0	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA NonGen / NLR	0.250		2	0	NR	NR	NR	2
FUDS	1.000		1	0	2	4	NR	7
DOD	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0
US FIN ASSUR	0.001		0	NR	NR	NR	NR	0
EPA WATCH LIST	0.001		0	NR	NR	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
TSCA	0.001		0	NR	NR	NR	NR	0
TRIS	0.001		0	NR	NR	NR	NR	0
SSTS	0.001		0	NR	NR	NR	NR	0
ROD	1.000		0	0	0	0	NR	0
RMP	0.001		0	NR	NR	NR	NR	0
RAATS	0.001		0	NR	NR	NR	NR	0
PRP	0.001		0	NR	NR	NR	NR	0
PADS	0.001		0	NR	NR	NR	NR	0
ICIS	0.001	1	0	NR	NR	NR	NR	1
FTTS	0.001		0	NR	NR	NR	NR	0
MLTS	0.001		0	NR	NR	NR	NR	0
COAL ASH DOE	0.001		0	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0
PCB TRANSFORMER	0.001		0	NR	NR	NR	NR	0
RADINFO	0.001		0	NR	NR	NR	NR	0
HIST FTTS	0.001		0	NR	NR	NR	NR	0
DOT OPS	0.001		0	NR	NR	NR	NR	0
CONSENT	1.000		0	0	0	0	NR	0
INDIAN RESERV	1.000		0	0	0	0	NR	0
FUSRAP	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
LEAD SMELTERS	0.001		0	NR	NR	NR	NR	0
US AIRS	0.001		0	NR	NR	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
ABANDONED MINES	0.250		0	0	NR	NR	NR	0
FINDS	0.001	6	5	NR	NR	NR	NR	11
DOCKET HWC	0.001		0	NR	NR	NR	NR	0
UXO	1.000		0	0	0	0	NR	0
ECHO	0.001	2	2	NR	NR	NR	NR	4
FUELS PROGRAM	0.250		0	0	NR	NR	NR	0
CA BOND EXP. PLAN	1.000		0	0	0	0	NR	0
Cortese	0.500		0	0	0	NR	NR	0
CUPA Listings	0.250		0	0	NR	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
DRYCLEANERS	0.250		0	0	NR	NR	NR	0
EMI	0.001	2	0	NR	NR	NR	NR	2
ENF	0.001	1	2	NR	NR	NR	NR	3
Financial Assurance	0.001		0	NR	NR	NR	NR	0
HAZNET	0.001	3	3	NR	NR	NR	NR	6
ICE	0.001		0	NR	NR	NR	NR	0
HIST CORTESE	0.500		4	0	10	NR	NR	14
HWP	1.000		0	0	0	1	NR	1
HWT	0.250		0	0	NR	NR	NR	0
MINES	0.250		0	0	NR	NR	NR	0
MWMP	0.250		0	0	NR	NR	NR	0
NPDES	0.001	3	1	NR	NR	NR	NR	4
PEST LIC	0.001	2	0	NR	NR	NR	NR	2
PROC	0.500		0	0	0	NR	NR	0
Notify 65	1.000		1	0	4	5	NR	10
UIC	0.001		0	NR	NR	NR	NR	0
UIC GEO	0.001		0	NR	NR	NR	NR	0
WASTEWATER PITS	0.500		0	0	0	NR	NR	0
WDS	0.001	1	2	NR	NR	NR	NR	3
WIP	0.250		0	0	NR	NR	NR	0
MILITARY PRIV SITES	0.001		0	NR	NR	NR	NR	0
PROJECT	0.001		0	NR	NR	NR	NR	0
WDR	0.001		0	NR	NR	NR	NR	0
SAN DIEGO CO LOP	0.001	1	1	NR	NR	NR	NR	2
CIWQS	0.001	10	3	NR	NR	NR	NR	13
CERS	0.001	6	5	NR	NR	NR	NR	11
NON-CASE INFO	0.001		0	NR	NR	NR	NR	0
OTHER OIL GAS	0.001		0	NR	NR	NR	NR	0
PROD WATER PONDS	0.001		0	NR	NR	NR	NR	0
SAMPLING POINT	0.001		0	NR	NR	NR	NR	0
WELL STIM PROJ	0.001		0	NR	NR	NR	NR	0

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP	1.000		0	0	0	0	NR	0
EDR Hist Auto	0.125		0	NR	NR	NR	NR	0
EDR Hist Cleaner	0.125		0	NR	NR	NR	NR	0

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA LF	0.001		0	NR	NR	NR	NR	0
RGA LUST	0.001	1	7	NR	NR	NR	NR	8

- Totals --		54	101	12	53	17	0	237

NOTES:

TP = Target Property

NR = Not Requested at this Search Distance

Sites may be listed in more than one database

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A1
Target
Property

SEA WORLD PKING LOT EXPANSION
500 SEA WORLD DR
SAN DIEGO, CA 92109

CIWQS **S121672467**
N/A

Site 1 of 35 in cluster A

Actual:
19 ft.

CIWQS:
Name: SEA WORLD PKING LOT EXPANSION
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Agency: Sea World
Agency Address: 500 Sea World Dr, San Diego, CA 92109
Place/Project Type: Construction
SIC/NAICS: Not reported
Region: 9
Program: CONSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water construction
Order Number: 2009-0009-DWQ
WDID: 9 37C319720
NPDES Number: CAS000002
Adoption Date: Not reported
Effective Date: 01/02/2003
Termination Date: 10/21/2011
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.762897
Longitude: -117.231191

A2
Target
Property

SEAWORLDNA SAN DIEGO
500 SEAWORLD
SAN DIEGO, CA 92109

FINDS **1023311461**
N/A

Site 2 of 35 in cluster A

Actual:
19 ft.

FINDS:
Registry ID: 110066043098
Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A3
Target
Property
SEA WORLD INC
500 SEA WORLD DR
SAN DIEGO, CA 92109

EMI
CERS
S106839065
N/A

Site 3 of 35 in cluster A

Actual:
19 ft.

EMI:

Name: SEA WORLD INC
Address: 1720 SOUTH SHORES RD
City,State,Zip: CA 92109
Year: 1987
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7999
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 6
Reactive Organic Gases Tons/Yr: 3
Carbon Monoxide Emissions Tons/Yr: 5
NOX - Oxides of Nitrogen Tons/Yr: 33
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Name: SEA WORLD INC
Address: 1720 SOUTH SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Year: 1990
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7999
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 57
Reactive Organic Gases Tons/Yr: 8
Carbon Monoxide Emissions Tons/Yr: 27
NOX - Oxides of Nitrogen Tons/Yr: 19
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smllr Tons/Yr:1

Name: SEA WORLD INC
Address: 1720 SOUTH SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Year: 1995
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD INC (Continued)

S106839065

Total Organic Hydrocarbon Gases Tons/Yr: 64
Reactive Organic Gases Tons/Yr: 6
Carbon Monoxide Emissions Tons/Yr: 33
NOX - Oxides of Nitrogen Tons/Yr: 30
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smlr Tons/Yr:1

Name: SEA WORLD INC
Address: 1720 SOUTH SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Year: 1996
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 64
Reactive Organic Gases Tons/Yr: 6
Carbon Monoxide Emissions Tons/Yr: 33
NOX - Oxides of Nitrogen Tons/Yr: 30
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smlr Tons/Yr:1

Name: SEA WORLD INC
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA
Year: 2005
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 1.27297
Reactive Organic Gases Tons/Yr: 1.173502
Carbon Monoxide Emissions Tons/Yr: 1.40906
NOX - Oxides of Nitrogen Tons/Yr: 1.79
SOX - Oxides of Sulphur Tons/Yr: .011684
Particulate Matter Tons/Yr: .1312310914668337896
Part. Matter 10 Micrometers and Smlr Tons/Yr:130966

Name: SEA WORLD INC
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA
Year: 2006
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD INC (Continued)

S106839065

Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.493317201
Reactive Organic Gases Tons/Yr: 3.401222958
Carbon Monoxide Emissions Tons/Yr: .675561927
NOX - Oxides of Nitrogen Tons/Yr: 1.597379828
SOX - Oxides of Sulphur Tons/Yr: .010692952
Particulate Matter Tons/Yr: .121708765
Part. Matter 10 Micrometers and Smlr Tons/Yr: .121708765

Name: SEA WORLD INC
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 93722
Year: 2007
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.503316
Reactive Organic Gases Tons/Yr: 3.41122
Carbon Monoxide Emissions Tons/Yr: .675561
NOX - Oxides of Nitrogen Tons/Yr: 1.59737
SOX - Oxides of Sulphur Tons/Yr: .010693502
Particulate Matter Tons/Yr: .1217097
Part. Matter 10 Micrometers and Smlr Tons/Yr: .1217097

Name: SEA WORLD INC
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Year: 2008
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.503316
Reactive Organic Gases Tons/Yr: 3.41122
Carbon Monoxide Emissions Tons/Yr: .675561
NOX - Oxides of Nitrogen Tons/Yr: 1.59737
SOX - Oxides of Sulphur Tons/Yr: .010693502
Particulate Matter Tons/Yr: .1217097
Part. Matter 10 Micrometers and Smlr Tons/Yr: .1217097

Name: SEA WORLD INC
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Year: 2009
County Code: 37
Air Basin: SD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD INC (Continued)

S106839065

Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 3.52
Reactive Organic Gases Tons/Yr: 3.4300000000000002
Carbon Monoxide Emissions Tons/Yr: 0.6700000000000004
NOX - Oxides of Nitrogen Tons/Yr: 1.6100000000000001
SOX - Oxides of Sulphur Tons/Yr: 0.01
Particulate Matter Tons/Yr: 0.13
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.13

Name: SEA WORLD INC
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Year: 2010
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.36075180000000001
Reactive Organic Gases Tons/Yr: 0.2204004
Carbon Monoxide Emissions Tons/Yr: 2.1466820000000002
NOX - Oxides of Nitrogen Tons/Yr: 2.58067
SOX - Oxides of Sulphur Tons/Yr: 0.01040025
Particulate Matter Tons/Yr: 0.19212589999999999
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.19212589999999999

Name: SEA WORLD INC
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Year: 2013
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.36
Reactive Organic Gases Tons/Yr: 0.22
Carbon Monoxide Emissions Tons/Yr: 2.14
NOX - Oxides of Nitrogen Tons/Yr: 2.58
SOX - Oxides of Sulphur Tons/Yr: 0.02
Particulate Matter Tons/Yr: 0.19
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.19

Name: SEA WORLD INC
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD INC (Continued)

S106839065

Year: 2014
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.2533022
Reactive Organic Gases Tons/Yr: 0.1480679
Carbon Monoxide Emissions Tons/Yr: 1.5114288
NOX - Oxides of Nitrogen Tons/Yr: 1.840648
SOX - Oxides of Sulphur Tons/Yr: 0.010019471
Particulate Matter Tons/Yr: 0.1334076
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.1334076

Name: SEA WORLD INC
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Year: 2015
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.2533022
Reactive Organic Gases Tons/Yr: 0.1480679
Carbon Monoxide Emissions Tons/Yr: 1.5114288
NOX - Oxides of Nitrogen Tons/Yr: 1.840648
SOX - Oxides of Sulphur Tons/Yr: 0.010019471
Particulate Matter Tons/Yr: 0.1334076
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.1334076

Name: SEA WORLD INC
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Year: 2016
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.2533022
Reactive Organic Gases Tons/Yr: 0.1480679
Carbon Monoxide Emissions Tons/Yr: 1.5114288
NOX - Oxides of Nitrogen Tons/Yr: 1.840648
SOX - Oxides of Sulphur Tons/Yr: 0.010019471
Particulate Matter Tons/Yr: 0.1334076
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.1334076

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD INC (Continued)

S106839065

Name: SEA WORLD INC
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Year: 2017
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.2533022
Reactive Organic Gases Tons/Yr: 0.1480679
Carbon Monoxide Emissions Tons/Yr: 1.5114288
NOX - Oxides of Nitrogen Tons/Yr: 1.840648
SOX - Oxides of Sulphur Tons/Yr: 0.010019471
Particulate Matter Tons/Yr: 0.1334076
Part. Matter 10 Micrometers and Smlr Tons/Yr: 0.1334076

CERS:

Name: SEA WORLD INC
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 493173
CERS ID: 110064253953
CERS Description: US EPA Air Emission Inventory System (EIS)

**A4
Target
Property**

**SEAWORLD, SAN DIEGO
500 SEAWORLD DRIVE
SAN DIEGO, CA 92109**

**ENF
WDS
CIWQS**

**S106905429
N/A**

Site 4 of 35 in cluster A

**Actual:
19 ft.**

ENF:

Name: SEAWORLD, SAN DIEGO
Address: 500 SEAWORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 256121
Agency Name: Not reported
Place Type: Service/Commercial
Place Subtype: Service/Commercial Site, NEC
Facility Type: Industrial
Agency Type: Not reported
Of Agencies: Not reported
Place Latitude: 32.762897
Place Longitude: -117.231191
SIC Code 1: 7996
SIC Desc 1: Amusement Parks
SIC Code 2: Not reported
SIC Desc 2: Not reported
SIC Code 3: Not reported
SIC Desc 3: Not reported
NAICS Code 1: Not reported
NAICS Desc 1: Not reported
NAICS Code 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Enf Action
Design Flow:	Not reported
Threat To Water Quality:	Not reported
Complexity:	Not reported
Pretreatment:	Not reported
Facility Waste Type:	Not reported
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	Not reported
Program Category1:	Not reported
Program Category2:	NPDESWW
# Of Programs:	Not reported
WDID:	Not reported
Reg Measure Id:	Not reported
Reg Measure Type:	Not reported
Region:	Not reported
Order #:	Not reported
Npdes# CA#:	Not reported
Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	Not reported
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Not reported
Status Date:	Not reported
Effective Date:	Not reported
Expiration/Review Date:	Not reported
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Not reported
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Not reported
Enforcement Id(EID):	248288
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	10/04/2002
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	10/04/2002
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	Total and fecal coliform exceeded '10%' limit (see

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

violations for detailed information).

Program: NPDESWW
Latest Milestone Completion Date: Not reported
Of Programs1: 1
Total Assessment Amount: 0
Initial Assessed Amount: 0
Liability \$ Amount: 0
Project \$ Amount: 0
Liability \$ Paid: 0
Project \$ Completed: 0
Total \$ Paid/Completed Amount: 0

Name: SEAWORLD, SAN DIEGO
Address: 500 SEAWORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 256121
Agency Name: Not reported
Place Type: Service/Commercial
Place Subtype: Service/Commercial Site, NEC
Facility Type: Industrial
Agency Type: Not reported
Of Agencies: Not reported
Place Latitude: 32.762897
Place Longitude: -117.231191
SIC Code 1: 7996
SIC Desc 1: Amusement Parks
SIC Code 2: Not reported
SIC Desc 2: Not reported
SIC Code 3: Not reported
SIC Desc 3: Not reported
NAICS Code 1: Not reported
NAICS Desc 1: Not reported
NAICS Code 2: Not reported
NAICS Desc 2: Not reported
NAICS Code 3: Not reported
NAICS Desc 3: Not reported
Of Places: 1
Source Of Facility: Enf Action
Design Flow: Not reported
Threat To Water Quality: Not reported
Complexity: Not reported
Pretreatment: Not reported
Facility Waste Type: Not reported
Facility Waste Type 2: Not reported
Facility Waste Type 3: Not reported
Facility Waste Type 4: Not reported
Program: Not reported
Program Category1: Not reported
Program Category2: NPDESWW
Of Programs: Not reported
WDID: Not reported
Reg Measure Id: Not reported
Reg Measure Type: Not reported
Region: Not reported
Order #: Not reported
Npdes# CA#: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	Not reported
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Not reported
Status Date:	Not reported
Effective Date:	Not reported
Expiration/Review Date:	Not reported
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Not reported
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Not reported
Enforcement Id(EID):	390104
Region:	9
Order / Resolution Number:	R9-2011-0032
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	05/02/2013
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	05/02/2013
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	SEL re R9-2011-0032 for SeaWorld, San Diego (2011 SW Rpt, Feb 2012 and Sep-Oct 2012 e-SMR's)
Description:	Missed sampling of storm water bypass at east treatment plant and multiple total coliform violations
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	Not reported
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

# Of Agencies:	Not reported
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Enf Action
Design Flow:	Not reported
Threat To Water Quality:	Not reported
Complexity:	Not reported
Pretreatment:	Not reported
Facility Waste Type:	Not reported
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	Not reported
Program Category1:	Not reported
Program Category2:	NPDESWW
# Of Programs:	Not reported
WDID:	Not reported
Reg Measure Id:	Not reported
Reg Measure Type:	Not reported
Region:	Not reported
Order #:	Not reported
Npdes# CA#:	Not reported
Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	Not reported
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Not reported
Status Date:	Not reported
Effective Date:	Not reported
Expiration/Review Date:	Not reported
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Not reported
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Not reported
Enforcement Id(EID):	245712

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Region: 9
Order / Resolution Number: UNKNOWN
Enforcement Action Type: Staff Enforcement Letter
Effective Date: 12/05/2002
Adoption/Issuance Date: Not reported
Achieve Date: Not reported
Termination Date: 12/05/2002
ACL Issuance Date: Not reported
EPL Issuance Date: Not reported
Status: Historical
Title: Enforcement - 9 000000083
Description: Enterococcus exceedance at east treatment facility on October 2, 2002.

Program: NPDESWW
Latest Milestone Completion Date: Not reported
Of Programs1: 1
Total Assessment Amount: 0
Initial Assessed Amount: 0
Liability \$ Amount: 0
Project \$ Amount: 0
Liability \$ Paid: 0
Project \$ Completed: 0
Total \$ Paid/Completed Amount: 0

Name: SEAWORLD, SAN DIEGO
Address: 500 SEAWORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 256121
Agency Name: Not reported
Place Type: Service/Commercial
Place Subtype: Service/Commercial Site, NEC
Facility Type: Industrial
Agency Type: Not reported
Of Agencies: Not reported
Place Latitude: 32.762897
Place Longitude: -117.231191
SIC Code 1: 7996
SIC Desc 1: Amusement Parks
SIC Code 2: Not reported
SIC Desc 2: Not reported
SIC Code 3: Not reported
SIC Desc 3: Not reported
NAICS Code 1: Not reported
NAICS Desc 1: Not reported
NAICS Code 2: Not reported
NAICS Desc 2: Not reported
NAICS Code 3: Not reported
NAICS Desc 3: Not reported
Of Places: 1
Source Of Facility: Enf Action
Design Flow: Not reported
Threat To Water Quality: Not reported
Complexity: Not reported
Pretreatment: Not reported
Facility Waste Type: Not reported
Facility Waste Type 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	Not reported
Program Category1:	Not reported
Program Category2:	NPDESWW
# Of Programs:	Not reported
WDID:	Not reported
Reg Measure Id:	Not reported
Reg Measure Type:	Not reported
Region:	Not reported
Order #:	Not reported
Npdes# CA#:	Not reported
Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	Not reported
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Not reported
Status Date:	Not reported
Effective Date:	Not reported
Expiration/Review Date:	Not reported
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Not reported
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Not reported
Enforcement Id(EID):	256207
Region:	9
Order / Resolution Number:	R9-2005-0129
Enforcement Action Type:	Admin Civil Liability
Effective Date:	05/16/2005
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Superceded
Title:	Enforcement - 9 000000083
Description:	Violation #199264, Daily maximum and monthly average effluent limitation violations.
Program:	NPDESWW
Latest Milestone Completion Date:	2005-06-09
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Name: SEAWORLD, SAN DIEGO
Address: 500 SEAWORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 256121
Agency Name: Not reported
Place Type: Service/Commercial
Place Subtype: Service/Commercial Site, NEC
Facility Type: Industrial
Agency Type: Not reported
Of Agencies: Not reported
Place Latitude: 32.762897
Place Longitude: -117.231191
SIC Code 1: 7996
SIC Desc 1: Amusement Parks
SIC Code 2: Not reported
SIC Desc 2: Not reported
SIC Code 3: Not reported
SIC Desc 3: Not reported
NAICS Code 1: Not reported
NAICS Desc 1: Not reported
NAICS Code 2: Not reported
NAICS Desc 2: Not reported
NAICS Code 3: Not reported
NAICS Desc 3: Not reported
Of Places: 1
Source Of Facility: Enf Action
Design Flow: Not reported
Threat To Water Quality: Not reported
Complexity: Not reported
Pretreatment: Not reported
Facility Waste Type: Not reported
Facility Waste Type 2: Not reported
Facility Waste Type 3: Not reported
Facility Waste Type 4: Not reported
Program: Not reported
Program Category1: Not reported
Program Category2: NPDESWW
Of Programs: Not reported
WDID: Not reported
Reg Measure Id: Not reported
Reg Measure Type: Not reported
Region: Not reported
Order #: Not reported
Npdes# CA#: Not reported
Major-Minor: Not reported
Npdes Type: Not reported
Reclamation: Not reported
Dredge Fill Fee: Not reported
301H: Not reported
Application Fee Amt Received: Not reported
Status: Not reported
Status Date: Not reported
Effective Date: Not reported
Expiration/Review Date: Not reported
Termination Date: Not reported
WDR Review - Amend: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Not reported
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Not reported
Enforcement Id(EID):	255858
Region:	9
Order / Resolution Number:	R9-2005-0223
Enforcement Action Type:	Admin Civil Liability
Effective Date:	08/10/2005
Adoption/Issuance Date:	08/10/2005
Achieve Date:	Not reported
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	Violation #246680, 265704 Daily maximum and monthly average effluent limitation violations.
Program:	NPDESWW
Latest Milestone Completion Date:	2005-06-08
# Of Programs1:	1
Total Assessment Amount:	6000
Initial Assessed Amount:	0
Liability \$ Amount:	6000
Project \$ Amount:	0
Liability \$ Paid:	6000
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	6000
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	Not reported
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Not reported
# Of Agencies:	Not reported
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Enf Action
Design Flow:	Not reported
Threat To Water Quality:	Not reported
Complexity:	Not reported
Pretreatment:	Not reported
Facility Waste Type:	Not reported
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	Not reported
Program Category1:	Not reported
Program Category2:	NPDESWW
# Of Programs:	Not reported
WDID:	Not reported
Reg Measure Id:	Not reported
Reg Measure Type:	Not reported
Region:	Not reported
Order #:	Not reported
Npdes# CA#:	Not reported
Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	Not reported
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Not reported
Status Date:	Not reported
Effective Date:	Not reported
Expiration/Review Date:	Not reported
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Not reported
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Not reported
Enforcement Id(EID):	253224
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Notice of Violation
Effective Date:	09/07/2004
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	09/07/2004
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	Ammonia violation for west outfall effluent. Sample taken on 6/23/04 exceeded the maximum limitation of 0.55 mg/L

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

(0.66 mg/l).
Program: NPDESWW
Latest Milestone Completion Date: Not reported
Of Programs1: 1
Total Assessment Amount: 0
Initial Assessed Amount: 0
Liability \$ Amount: 0
Project \$ Amount: 0
Liability \$ Paid: 0
Project \$ Completed: 0
Total \$ Paid/Completed Amount: 0

Name: SEAWORLD, SAN DIEGO
Address: 500 SEAWORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 256121
Agency Name: Not reported
Place Type: Service/Commercial
Place Subtype: Service/Commercial Site, NEC
Facility Type: Industrial
Agency Type: Not reported
Of Agencies: Not reported
Place Latitude: 32.762897
Place Longitude: -117.231191
SIC Code 1: 7996
SIC Desc 1: Amusement Parks
SIC Code 2: Not reported
SIC Desc 2: Not reported
SIC Code 3: Not reported
SIC Desc 3: Not reported
NAICS Code 1: Not reported
NAICS Desc 1: Not reported
NAICS Code 2: Not reported
NAICS Desc 2: Not reported
NAICS Code 3: Not reported
NAICS Desc 3: Not reported
Of Places: 1
Source Of Facility: Enf Action
Design Flow: Not reported
Threat To Water Quality: Not reported
Complexity: Not reported
Pretreatment: Not reported
Facility Waste Type: Not reported
Facility Waste Type 2: Not reported
Facility Waste Type 3: Not reported
Facility Waste Type 4: Not reported
Program: Not reported
Program Category1: Not reported
Program Category2: NPDESWW
Of Programs: Not reported
WDID: Not reported
Reg Measure Id: Not reported
Reg Measure Type: Not reported
Region: Not reported
Order #: Not reported
Npdes# CA#: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	Not reported
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Not reported
Status Date:	Not reported
Effective Date:	Not reported
Expiration/Review Date:	Not reported
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Not reported
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Not reported
Enforcement Id(EID):	252223
Region:	9
Order / Resolution Number:	R9-2004-0194
Enforcement Action Type:	Admin Civil Liability
Effective Date:	06/10/2004
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	06/10/2004
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	ACL/MMP Order R9-2004-0194 against Sea World for \$6,000
Description:	ACL Order containing Mandatory Minimum Penalties against Sea World San Diego in the amount of \$6,000. Resolves Complaint R9-2004-0085
Program:	NPDESWW
Latest Milestone Completion Date:	2004-05-17
# Of Programs1:	1
Total Assessment Amount:	6000
Initial Assessed Amount:	0
Liability \$ Amount:	6000
Project \$ Amount:	0
Liability \$ Paid:	6000
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	6000
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	Not reported
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

# Of Agencies:	Not reported
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Enf Action
Design Flow:	Not reported
Threat To Water Quality:	Not reported
Complexity:	Not reported
Pretreatment:	Not reported
Facility Waste Type:	Not reported
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	Not reported
Program Category1:	Not reported
Program Category2:	NPDESWW
# Of Programs:	Not reported
WDID:	Not reported
Reg Measure Id:	Not reported
Reg Measure Type:	Not reported
Region:	Not reported
Order #:	Not reported
Npdes# CA#:	Not reported
Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	Not reported
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Not reported
Status Date:	Not reported
Effective Date:	Not reported
Expiration/Review Date:	Not reported
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Not reported
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Not reported
Enforcement Id(EID):	252221

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Region:	9
Order / Resolution Number:	R9-2004-0085
Enforcement Action Type:	Admin Civil Liability
Effective Date:	03/22/2004
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Superceded
Title:	Enforcement - 9 000000083
Description:	ACL Complaint containing mandatory minimum penalties for \$12,000. Discharger submitted information justifying modification of Complaint to \$6,000. Dropped 2 Total Suspended Solids violations on September 7, 2000.
Program:	NPDESWW
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	373525
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2011-0032
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	08/07/2018
Effective Date:	07/28/2011
Expiration/Review Date:	07/27/2016
Termination Date:	08/01/2018
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	419435
Region:	9
Order / Resolution Number:	Not reported
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	Not reported
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	04/27/2018
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	SEL for SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Description:	Not reported
Program:	NPDNONMUNIPRCS
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Status Date: 12/20/2011
Effective Date: 04/23/2005
Expiration/Review Date: 04/13/2010
Termination Date: 07/28/2011
WDR Review - Amend: Not reported
WDR Review - Revise/Renew: Not reported
WDR Review - Rescind: Not reported
WDR Review - No Action Required: Not reported
WDR Review - Pending: Not reported
WDR Review - Planned: Not reported
Status Enrollee: N
Individual/General: I
Fee Code: 66 - NPDES Based on Flow
Direction/Voice: Passive
Enforcement Id(EID): 383678
Region: 9
Order / Resolution Number: R9-2012-0008
Enforcement Action Type: Admin Civil Liability
Effective Date: 02/07/2012
Adoption/Issuance Date: 02/07/2012
Achieve Date: Not reported
Termination Date: 04/25/2012
ACL Issuance Date: Not reported
EPL Issuance Date: 01/26/2012
Status: Historical
Title: ACL R9-2012-0008 for SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Description: EPL for 2 violations of total ammonia effluent limitations subject to MMP.
Program: NPDINDLRG
Latest Milestone Completion Date: Not reported
Of Programs1: 1
Total Assessment Amount: 6000
Initial Assessed Amount: 6000
Liability \$ Amount: 6000
Project \$ Amount: 0
Liability \$ Paid: 6000
Project \$ Completed: 0
Total \$ Paid/Completed Amount: 6000
Name: SEAWORLD, SAN DIEGO
Address: 500 SEAWORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 256121
Agency Name: SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type: Service/Commercial
Place Subtype: Service/Commercial Site, NEC
Facility Type: Industrial
Agency Type: Privately-Owned Business
Of Agencies: 1
Place Latitude: 32.762897
Place Longitude: -117.231191
SIC Code 1: 7996
SIC Desc 1: Amusement Parks
SIC Code 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	380789
Region:	9
Order / Resolution Number:	Not reported
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	Not reported
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	May-Jun 2011 8/11/11 SEL for Sea World, Inc. - SeaWorld San Diego
Description:	May-Jun 2011 8/11/11 SEL for SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC 2 violations: The effluent exceeded the instantaneous maximum limitation for ammonia of 0.55 mg/l at Outfall No. 001 with a value of 7.2 mg/l. The effluent exceeded the instantaneous maximum (mass-based) limitation for ammonia of 15 lbs/day at Outfall No. 001 with a value of 76.02 lbs/day.
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	378251
Region:	9
Order / Resolution Number:	Not reported
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	03/24/2011
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	07/24/2011 SEL for 2010 Sea World Inc. R9-2005-0091
Description:	Violations of Order No. R9-2005-0091, NPDES Permit No. CA0107336, Review of 2007 Self-Monitoring Reports for Sea World, San Diego
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	378246
Region:	9
Order / Resolution Number:	Not reported
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	03/24/2011
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	7/24/2011 SEL for 2006 Sea World Inc. R9-2005-0091
Description:	For the year of 2006, Sea World turned in incomplete weekly monitoring reports for the months of November and December.
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	376242
Region:	9
Order / Resolution Number:	Not reported
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	03/24/2011
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	Not reported
ACL Issuance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

EPL Issuance Date:	Not reported
Status:	Historical
Title:	7/24/2011 SEL for 2007 Sea World Inc. R9-2005-0091
Description:	Violations of Order No. R9-2005-0091, NPDES Permit No. CA0107336, Review of 2007 Self-Monitoring Reports for Sea World, San Diego
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Active
Enforcement Id(EID):	376133
Region:	9
Order / Resolution Number:	R9-2011-0011
Enforcement Action Type:	Admin Civil Liability
Effective Date:	01/12/2011
Adoption/Issuance Date:	01/12/2011
Achieve Date:	Not reported
Termination Date:	01/12/2011
ACL Issuance Date:	10/07/2010
EPL Issuance Date:	Not reported
Status:	Historical
Title:	ACL Order R9-2011-0011 (formerly Complaint R9-2010-0138) to Sea World, San Diego
Description:	ACL Complaint for \$6,000 in MMP.
Program:	NPDESWW
Latest Milestone Completion Date:	2010-11-03
# Of Programs1:	1
Total Assessment Amount:	6000
Initial Assessed Amount:	0
Liability \$ Amount:	6000
Project \$ Amount:	0
Liability \$ Paid:	6000
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	6000
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	374476
Region:	9
Order / Resolution Number:	Not reported
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	03/24/2011
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	7/26/11 SEL for 2008 Sea World Inc. R9-2005-0091
Description:	Violations of Order No. R9-2005-0091, NPDES Permit No. CA0107336, Review of 2008 Self-Monitoring Reports for Sea World, San Diego
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	242828
Region:	9
Order / Resolution Number:	R9-2000-221
Enforcement Action Type:	Notice of Violation
Effective Date:	09/06/2000
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	09/06/2000
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	cited for 3 coliform violations. Subject to 1 MMP of \$3,000
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	235169
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	11/14/2000
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	11/14/2000
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	SEL for Entero and TC violations. Migden penalties are triggered.
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	234969
Region:	9
Order / Resolution Number:	R9-2000-0239
Enforcement Action Type:	Admin Civil Liability

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Effective Date:	11/16/2000
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	ACL Order No. R9-2000-0239 to Anheuser Busch, Enforcement - 900000083
Description:	MMP for TC and Entero violations 4287, 4286, 4288, 4432, 4433, 4901, 4902) issued. This item was contested at the 2/21/01 Board meeting. Resolution 2001-22 accepted payment.
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	12000
Initial Assessed Amount:	0
Liability \$ Amount:	12000
Project \$ Amount:	0
Liability \$ Paid:	12000
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	12000
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	234934
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	12/28/2000
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	12/28/2000
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	daily maximum exceedence
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDES DLRG
Program Category1:	NPDES WW
Program Category2:	NPDES WW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

WDR Review - Amend: Not reported
WDR Review - Revise/Renew: Not reported
WDR Review - Rescind: Not reported
WDR Review - No Action Required: Not reported
WDR Review - Pending: Not reported
WDR Review - Planned: Not reported
Status Enrollee: N
Individual/General: I
Fee Code: 66 - NPDES Based on Flow
Direction/Voice: Passive
Enforcement Id(EID): 234932
Region: 9
Order / Resolution Number: UNKNOWN
Enforcement Action Type: Staff Enforcement Letter
Effective Date: 12/28/2000
Adoption/Issuance Date: Not reported
Achieve Date: Not reported
Termination Date: 12/28/2000
ACL Issuance Date: Not reported
EPL Issuance Date: Not reported
Status: Historical
Title: Enforcement - 9 000000083
Description: 1.4 times for monthly average.
Program: NPDINDLRG
Latest Milestone Completion Date: Not reported
Of Programs1: 1
Total Assessment Amount: 0
Initial Assessed Amount: 0
Liability \$ Amount: 0
Project \$ Amount: 0
Liability \$ Paid: 0
Project \$ Completed: 0
Total \$ Paid/Completed Amount: 0

Name: SEAWORLD, SAN DIEGO
Address: 500 SEAWORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 256121
Agency Name: SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type: Service/Commercial
Place Subtype: Service/Commercial Site, NEC
Facility Type: Industrial
Agency Type: Privately-Owned Business
Of Agencies: 1
Place Latitude: 32.762897
Place Longitude: -117.231191
SIC Code 1: 7996
SIC Desc 1: Amusement Parks
SIC Code 2: Not reported
SIC Desc 2: Not reported
SIC Code 3: Not reported
SIC Desc 3: Not reported
NAICS Code 1: Not reported
NAICS Desc 1: Not reported
NAICS Code 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	234640
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	05/11/2000
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	05/11/2000
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	MMR received one day late.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	234491
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Notice of Violation
Effective Date:	08/07/2000
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	08/07/2000
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	No more than 10% of samples in a 30-day period shall exceed 230 MPN/100 mL for TC. This was exceeded with one value (17%) of 230 MPN on 6-13-2000.
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Enforcement Id(EID):	234344
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	05/11/2000
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	05/11/2000
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	March MMR received one day late and incorrect signatory requirements.
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	234157
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	10/21/1999
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	10/21/1999
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	SEL dated 10-21-99 from CMC
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	233337
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Notice of Violation
Effective Date:	12/20/1999
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	12/20/1999
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	NOV for failure to submit Report of Waste Discharge (Due September 10, 1999) for permit reissuance.
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	233336
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	11/23/1999
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	11/23/1999
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Status:	Historical
Title:	Enforcement - 9 000000083
Description:	Discharger failed to submit RoWD for permit reissuance. Due Sept. 10, 1999. SEL Sent 11/23/99
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	233211
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	11/22/1999
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	11/22/1999
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	SEL for monnhtly coliform mean exceedance. May be a chronic. Must check.
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	222780
Region:	9
Order / Resolution Number:	88-095
Enforcement Action Type:	Cease and Desist Order
Effective Date:	10/03/1988
Adoption/Issuance Date:	Not reported
Achieve Date:	1995-03-09
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	IF THE SOURCE CONTROL PROGRAM DOES NOT ACHIEVE COMPLIANCE BY 11-14-88 ADDL FACILITIES MUST BE BUILT.
Program:	NPDINDLRG
Latest Milestone Completion Date:	1995-03-09
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	222779
Region:	9
Order / Resolution Number:	88-095A1
Enforcement Action Type:	Cease and Desist Order
Effective Date:	10/23/1989
Adoption/Issuance Date:	Not reported
Achieve Date:	1995-03-09
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	AMENDED COMPLIANCE SCHEDULE DATES CONTAINED IN CEASE AND DESIST ORDER NO. 88-095.
Program:	NPDINDLRG
Latest Milestone Completion Date:	1995-03-09
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	9.35999999
Threat To Water Quality:	2
Complexity:	A
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDLRG
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000083
Reg Measure Id:	133368
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2005-0091
Npdes# CA#:	CA0107336
Major-Minor:	Major
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	12/20/2011
Effective Date:	04/23/2005
Expiration/Review Date:	04/13/2010
Termination Date:	07/28/2011
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	222778
Region:	9
Order / Resolution Number:	88-095A2
Enforcement Action Type:	Cease and Desist Order
Effective Date:	12/17/1990
Adoption/Issuance Date:	Not reported
Achieve Date:	1995-03-09
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000083
Description:	REVISED TIME SCHEDULE FOR COMPLIANCE WITH ORDER 86-12.
Program:	NPDIINDLRG
Latest Milestone Completion Date:	1995-03-09
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	Not reported
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Not reported
# Of Agencies:	Not reported
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Enf Action
Design Flow:	Not reported
Threat To Water Quality:	Not reported
Complexity:	Not reported
Pretreatment:	Not reported
Facility Waste Type:	Not reported
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	Not reported
Program Category1:	Not reported
Program Category2:	NPDESWW
# Of Programs:	Not reported
WDID:	Not reported
Reg Measure Id:	Not reported
Reg Measure Type:	Not reported
Region:	Not reported
Order #:	Not reported
Npdes# CA#:	Not reported
Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	Not reported
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Not reported
Status Date:	Not reported
Effective Date:	Not reported
Expiration/Review Date:	Not reported
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Not reported
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Not reported
Enforcement Id(EID):	396781
Region:	9
Order / Resolution Number:	R9-2011-0016
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	06/12/2014
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	06/13/2014

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	SEL re R9-2011-0032 for SeaWorld, San Diego (Mar 2014)
Description:	The effluent exceeded the 30-day limitation for total coliform of no more than 10 percent of the samples collected during any calendar month should exceed 230/100 mL for a five-tube test at the east treatment facility. Approximately 29% of the samples exceeded 230 during the month of March.
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	256121
Agency Name:	Not reported
Place Type:	Service/Commercial
Place Subtype:	Service/Commercial Site, NEC
Facility Type:	Industrial
Agency Type:	Not reported
# Of Agencies:	Not reported
Place Latitude:	32.762897
Place Longitude:	-117.231191
SIC Code 1:	7996
SIC Desc 1:	Amusement Parks
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Enf Action
Design Flow:	Not reported
Threat To Water Quality:	Not reported
Complexity:	Not reported
Pretreatment:	Not reported
Facility Waste Type:	Not reported
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Program Category1:	Not reported
Program Category2:	NPDESWW
# Of Programs:	Not reported
WDID:	Not reported
Reg Measure Id:	Not reported
Reg Measure Type:	Not reported
Region:	Not reported
Order #:	Not reported
Npdes# CA#:	Not reported
Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	Not reported
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Not reported
Status Date:	Not reported
Effective Date:	Not reported
Expiration/Review Date:	Not reported
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Not reported
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Not reported
Enforcement Id(EID):	408183
Region:	9
Order / Resolution Number:	R9-2011-0032
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	08/11/2016
Adoption/Issuance Date:	08/11/2016
Achieve Date:	Not reported
Termination Date:	08/11/2016
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	SEL re R9-2011-0032 for SeaWorld San Diego (Aug 2015)
Description:	2 Chronic Toxicity Violations (Aug 2015)
Program:	NPDINDLRG
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0

WDS:

Name: SEA WORLD SAN DIEGO
Address: 500 SeaWorld Drive

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

City: SAN DIEGO
Facility ID: San Diego 000000083
Facility Type: Industrial - Facility that treats and/or disposes of liquid or semisolid wastes from any servicing, producing, manufacturing or processing operation of whatever nature, including mining, gravel washing, geothermal operations, air conditioning, ship building and repairing, oil production, storage and disposal operations, water pumping.
Facility Status: Active - Any facility with a continuous or seasonal discharge that is under Waste Discharge Requirements.
NPDES Number: CA0107336 The 1st 2 characters designate the state. The remaining 7 are assigned by the Regional Board
Subregion: 9
Facility Telephone: Not reported
Facility Contact: KEVIN J. CARR
Agency Name: SEA WORLD INC
Agency Address: 500 SeaWorld Drive
Agency City,St,Zip: SAN DIEGO 921097995
Agency Contact: KEVIN J CARR
Agency Telephone: Not reported
Agency Type: Private
SIC Code: 999
SIC Code 2: Not reported
Primary Waste Type: Designated/Influent or Solid Wastes that pose a significant threat to water quality because of their high concentrations (E.G., BOD, Hardness, TRF, Chloride). 'Manageable' hazardous wastes (E.G., inorganic salts and heavy metals) are included in this category.
Primary Waste: PROCES
Waste Type2: Not reported
Waste2: Process Waste (Waste produced as part of the industrial/manufacturing process)
Primary Waste Type: Designated/Influent or Solid Wastes that pose a significant threat to water quality because of their high concentrations (E.G., BOD, Hardness, TRF, Chloride). 'Manageable' hazardous wastes (E.G., inorganic salts and heavy metals) are included in this category.
Secondary Waste: Not reported
Secondary Waste Type: Not reported
Design Flow: 9
Baseline Flow: 5
Reclamation: No reclamation requirements associated with this facility.
POTW: The facility is not a POTW.
Treat To Water: Moderate Threat to Water Quality. A violation could have a major adverse impact on receiving biota, can cause aesthetic impairment to a significant human population, or render unusable a potential domestic or municipal water supply. Aesthetic impairment would include nuisance from a waste treatment facility.
Complexity: Category A - Any major NPDES facility, any non-NPDES facility (particularly those with toxic wastes) that would be a major if discharge was made to surface or ground waters, or any Class I disposal site. Includes any small-volume complex facility (particularly those with toxicwastes) with numerous discharge points, leak detection systems or ground water monitoring wells.

CIWQS:

Name: SEAWORLD, SAN DIEGO
Address: 500 SEAWORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S106905429

Agency:	Anheuser Busch Inc
Agency Address:	500 Sea World Drive, San Diego, CA 92109-7995
Place/Project Type:	Service/Commercial Site, NEC
SIC/NAICS:	7996
Region:	9
Program:	NPDINDLRG
Regulatory Measure Status:	Historical
Regulatory Measure Type:	NPDES Permit
Order Number:	00-025
WDID:	9 000000083
NPDES Number:	CA0107336
Adoption Date:	04/12/2000
Effective Date:	04/12/2000
Termination Date:	Not reported
Expiration/Review Date:	04/12/2005
Design Flow:	9.36
Major/Minor:	Major
Complexity:	A
TTWQ:	2
Enforcement Actions within 5 years:	2
Violations within 5 years:	11
Latitude:	32.762897
Longitude:	-117.231191
Name:	SEAWORLD, SAN DIEGO
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Agency:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Agency Address:	500 Sea World Drive, San Diego, CA 92109
Place/Project Type:	Service/Commercial Site, NEC
SIC/NAICS:	7996
Region:	9
Program:	NPDINDLRG
Regulatory Measure Status:	Active
Regulatory Measure Type:	NPDES Permit
Order Number:	R9-2018-0004
WDID:	9 000000083
NPDES Number:	CA0107336
Adoption Date:	06/20/2018
Effective Date:	08/01/2018
Termination Date:	Not reported
Expiration/Review Date:	06/30/2023
Design Flow:	9.36
Major/Minor:	Major
Complexity:	A
TTWQ:	2
Enforcement Actions within 5 years:	2
Violations within 5 years:	11
Latitude:	32.762897
Longitude:	-117.231191

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A5
Target
Property

SEA WORLD
500 SEA WORLD DR
SAN DIEGO, CA

RGA LUST

S114684312
N/A

Site 5 of 35 in cluster A

Actual:
19 ft.

RGA LUST:

Name: SEA WORLD
Address: 500 SEA WORLD DR
City: SAN DIEGO
State: SAN DIEGO
2007 SEA WORLD 500 SEA WORLD DR
Name: SEA WORLD
Address: 500 SEA WORLD DR
City: SAN DIEGO
State: SAN DIEGO
2006 SEA WORLD 500 SEA WORLD DR
Name: SEA WORLD
Address: 500 SEA WORLD DR
City: SAN DIEGO
State: SAN DIEGO
2005 SEA WORLD 500 SEA WORLD DR
Name: SEA WORLD
Address: 500 SEA WORLD DR
City: SAN DIEGO
State: SAN DIEGO
2004 SEA WORLD 500 SEA WORLD DR
Name: SEA WORLD
Address: 500 SEA WORLD DR
City: SAN DIEGO
State: SAN DIEGO
2003 SEA WORLD 500 SEA WORLD DR

A6
Target
Property

SEA WORLD SAN DIEGO 2017 ATTRACTION
500 SEA WORLD DRIVE
SAN DIEGO, CA 92109

NPDES
CIWQS

S119087276
N/A

Site 6 of 35 in cluster A

Actual:
19 ft.

NPDES:

Name: SEA WORLD SAN DIEGO 2017 ATTRACTION
Address: 500 SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported
Order Number: Not reported
WDID: 9 37C377359
Regulatory Measure Type: Construction
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD SAN DIEGO 2017 ATTRACTION (Continued)

S119087276

Discharge State: Not reported
Discharge Zip: Not reported
Status: Terminated
Status Date: 06/01/2018
Operator Name: SeaWorld Parks and Entertainment
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

NPDES as of 03/2018:

NPDES Number: CAS000002
Status: Active
Agency Number: 0
Region: 9
Regulatory Measure ID: 476058
Order Number: 2009-0009-DWQ
Regulatory Measure Type: Enrollee
Place ID: Not reported
WDID: 9 37C377359
Program Type: Construction
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 08/29/2016
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: SeaWorld Parks and Entertainment
Discharge Address: 500 Sea World Drive
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92109
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported
Contact: Not reported
Contact Title: Not reported
Contact Phone: Not reported
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Contact: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported
Operator Contact Phone Ext: Not reported
Operator Contact Email: Not reported
Operator Type: Not reported
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: Not reported
Developer Zip: Not reported
Developer Contact: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD SAN DIEGO 2017 ATTRACTION (Continued)

S119087276

Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	Not reported
Status:	Not reported
Agency Number:	Not reported
Region:	9
Regulatory Measure ID:	476058
Order Number:	Not reported
Regulatory Measure Type:	Construction
Place ID:	Not reported
WDID:	9 37C377359
Program Type:	Not reported
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Not reported
Discharge Address:	Not reported
Discharge City:	Not reported
Discharge State:	Not reported
Discharge Zip:	Not reported
Received Date:	08/19/2016
Processed Date:	08/29/2016
Status:	Active
Status Date:	08/29/2016
Place Size:	2.3
Place Size Unit:	Acres
Contact:	Darlene Walter
Contact Title:	Vice President Engineering
Contact Phone:	619-226-3626

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD SAN DIEGO 2017 ATTRACTION (Continued)

S119087276

Contact Phone Ext:	Not reported
Contact Email:	darlene.walter@seaworld.com
Operator Name:	SeaWorld Parks and Entertainment
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Private Individual
Developer:	SeaWorld Parks and Entertainment
Developer Address:	500 Sea World Drive
Developer City:	San Diego
Developer State:	California
Developer Zip:	92109
Developer Contact:	Darlene Walter
Developer Contact Title:	Vice President Engineering
Constype Linear Utility Ind:	N
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	N
Constype Below Ground Ind:	N
Constype Cable Line Ind:	N
Constype Comm Line Ind:	N
Constype Commercial Ind:	Y
Constype Electrical Line Ind:	N
Constype Gas Line Ind:	N
Constype Industrial Ind:	N
Constype Other Description:	Not reported
Constype Other Ind:	N
Constype Recons Ind:	N
Constype Residential Ind:	N
Constype Transport Ind:	N
Constype Utility Description:	Not reported
Constype Utility Ind:	N
Constype Water Sewer Ind:	N
Dir Discharge Uswater Ind:	N
Receiving Water Name:	Mission Bay
Certifier:	Darlene Walter
Certifier Title:	Vice President Engineering
Certification Date:	19-AUG-16
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

Name:	SEA WORLD SAN DIEGO 2017 ATTRACTION
Address:	500 SEA WORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Facility Status:	Terminated
NPDES Number:	CAS000002
Region:	9
Agency Number:	0
Regulatory Measure ID:	476058

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD SAN DIEGO 2017 ATTRACTION (Continued)

S119087276

Place ID: Not reported
Order Number: 2009-0009-DWQ
WDID: 9 37C377359
Regulatory Measure Type: Enrollee
Program Type: Construction
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 08/29/2016
Termination Date Of Regulatory Measure: 06/01/2018
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: 500 Sea World Drive
Discharge Name: SeaWorld Parks and Entertainment
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92109
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

NPDES as of 03/2018:

NPDES Number: CAS000002
Status: Active
Agency Number: 0
Region: 9
Regulatory Measure ID: 476058
Order Number: 2009-0009-DWQ
Regulatory Measure Type: Enrollee
Place ID: Not reported
WDID: 9 37C377359
Program Type: Construction
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 08/29/2016
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: SeaWorld Parks and Entertainment
Discharge Address: 500 Sea World Drive
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92109
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported
Contact: Not reported
Contact Title: Not reported
Contact Phone: Not reported
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD SAN DIEGO 2017 ATTRACTION (Continued)

S119087276

Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	Not reported
Status:	Not reported
Agency Number:	Not reported
Region:	9
Regulatory Measure ID:	476058
Order Number:	Not reported
Regulatory Measure Type:	Construction
Place ID:	Not reported
WDID:	9 37C377359
Program Type:	Not reported
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Not reported
Discharge Address:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD SAN DIEGO 2017 ATTRACTION (Continued)

S119087276

Discharge City:	Not reported
Discharge State:	Not reported
Discharge Zip:	Not reported
Received Date:	08/19/2016
Processed Date:	08/29/2016
Status:	Active
Status Date:	08/29/2016
Place Size:	2.3
Place Size Unit:	Acres
Contact:	Darlene Walter
Contact Title:	Vice President Engineering
Contact Phone:	619-226-3626
Contact Phone Ext:	Not reported
Contact Email:	darlene.walter@seaworld.com
Operator Name:	SeaWorld Parks and Entertainment
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Private Individual
Developer:	SeaWorld Parks and Entertainment
Developer Address:	500 Sea World Drive
Developer City:	San Diego
Developer State:	California
Developer Zip:	92109
Developer Contact:	Darlene Walter
Developer Contact Title:	Vice President Engineering
Constype Linear Utility Ind:	N
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	N
Constype Below Ground Ind:	N
Constype Cable Line Ind:	N
Constype Comm Line Ind:	N
Constype Commercial Ind:	Y
Constype Electrical Line Ind:	N
Constype Gas Line Ind:	N
Constype Industrial Ind:	N
Constype Other Description:	Not reported
Constype Other Ind:	N
Constype Recons Ind:	N
Constype Residential Ind:	N
Constype Transport Ind:	N
Constype Utility Description:	Not reported
Constype Utility Ind:	N
Constype Water Sewer Ind:	N
Dir Discharge Uswater Ind:	N
Receiving Water Name:	Mission Bay
Certifier:	Darlene Walter
Certifier Title:	Vice President Engineering
Certification Date:	19-AUG-16
Primary Sic:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD SAN DIEGO 2017 ATTRACTION (Continued)

S119087276

Secondary Sic: Not reported
Tertiary Sic: Not reported

CIWQS:

Name: SEA WORLD SAN DIEGO 2017 ATTRACTION
Address: 500 SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Agency: SeaWorld Parks and Entertainment
Agency Address: 500 Sea World Drive, San Diego, CA 92109
Place/Project Type: Construction - Commercial
SIC/NAICS: Not reported
Region: 9
Program: CONSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water construction
Order Number: 2009-0009-DWQ
WDID: 9 37C377359
NPDES Number: CAS000002
Adoption Date: Not reported
Effective Date: 08/29/2016
Termination Date: 06/01/2018
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.764634
Longitude: -117.224971

**A7
Target
Property**

**SEA WORLD
500 SEA WORLD DR
SAN DIEGO, CA 92109**

Site 7 of 35 in cluster A

**Actual:
19 ft.**

**SAN DIEGO CO. SAM U003789059
CPS-SLIC N/A
UST
San Diego Co. HMMDC
CHMIRS
EMI
HAZNET
SAN DIEGO CO LOP
CIWQS
CERS**

SAN DIEGO CO. SAM:

Name: SEA WORLD
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 921097995
Case Number: H00905-001
Agency: DEH Site Assessment & Mitigation
Funding: Non Billable
Facility Type: Failed Integrity Test
Facility Status: Closed Case
Date: 12/1/1987
Date Began: 9/23/1986

CPS-SLIC:

Name: SEA WORLD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

U003789059

Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 921097995
Region: STATE
Facility Status: Completed - Case Closed
Status Date: 12/01/1987
Global Id: T0608142413
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H00905-001
Latitude: 32.7657311
Longitude: -117.2260311
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

UST:

Name: SEA WORLD
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Facility ID: H00905
Permitting Agency: SAN DIEGO COUNTY
Latitude: 32.7651695
Longitude: -117.2253685

HMMD SAN DIEGO:

Name: AT&T MOBILITY - TIN SHED @ SEA WORLD (USID112696)
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109-7904
Permit Number: Not reported
Business Type: Not reported
EPA Id Number: Not reported
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: (619) 607-2131
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 06/13/2018
Facility Owner: Not reported
Facility Mailing Address: 5001 Executive Pkwy, RM 4W200I, San Ramon, CA 94583
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: N
Treat Haz Waste: N
Generate Medical Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

U003789059

Waste and Materials:

Record ID:	DEH2015-HUPFP-002022
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0111445
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2016-08-26T01:48:35.000
Chemical Name:	Lead-Acid Batteries
Common Name:	Lead-Acid Batteries
Case Number:	Not reported

CHMIRS:

Name:	Not reported
Address:	500 SEA WORLD DR
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	5-6490
OES notification:	11/09/2005
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Not reported
Waterway:	Mission Bay
Spill Site:	Not reported
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Date/Time:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

U003789059

Year:	2005
Agency:	NRC
Incident Date:	11/9/200512:00:00 AM
Admin Agency:	San Diego County Health Services Dept.
Amount:	Not reported
Contained:	Yes
Site Type:	Ship/Harbor/Port
E Date:	Not reported
Substance:	Hydraulic Oil
Gallons:	0.000000
Unknown:	0
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	Per NRC Fax The caller stated that a dock box was leaking fuel into the water. Remedial Actions Contained and cleaned up.
Name:	Not reported
Address:	500 SEA WORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
OES Incident Number:	17-1436
OES notification:	02/16/2017
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

U003789059

CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	No
Waterway:	Not reported
Spill Site:	Merchant/Business
Cleanup By:	Contractor
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Gal(s)
Other:	Not reported
Date/Time:	1057
Year:	2017
Agency:	Environmental Management
Incident Date:	02/16/2017
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Yes
Site Type:	Not reported
E Date:	Not reported
Substance:	Hydraulic Oil
Quantity Released:	30-40
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	Per teh caller a hydraulic oil filter fell off a truck causing the spill in a parking lot.

EMI:

Name:	SEA WORLD INC.
Address:	500 SEA WORLD DR
City,State,Zip:	SAN DIEGO, CA
Year:	1997
County Code:	37
Air Basin:	SD
Facility ID:	937
Air District Name:	SD
SIC Code:	7996

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

U003789059

Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 41
Reactive Organic Gases Tons/Yr: 10
Carbon Monoxide Emissions Tons/Yr: 12
NOX - Oxides of Nitrogen Tons/Yr: 10
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 2
Part. Matter 10 Micrometers and Smlr Tons/Yr:2

Name: SEA WORLD INC.
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA
Year: 1998
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 41
Reactive Organic Gases Tons/Yr: 10
Carbon Monoxide Emissions Tons/Yr: 12
NOX - Oxides of Nitrogen Tons/Yr: 10
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 2
Part. Matter 10 Micrometers and Smlr Tons/Yr:2

Name: SEA WORLD INC.
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA
Year: 1999
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 81
Reactive Organic Gases Tons/Yr: 19
Carbon Monoxide Emissions Tons/Yr: 21
NOX - Oxides of Nitrogen Tons/Yr: 17
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 3
Part. Matter 10 Micrometers and Smlr Tons/Yr:3

Name: SEA WORLD INC.
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA
Year: 2000
County Code: 37
Air Basin: SD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

U003789059

Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 81
Reactive Organic Gases Tons/Yr: 19
Carbon Monoxide Emissions Tons/Yr: 21
NOX - Oxides of Nitrogen Tons/Yr: 17
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 3
Part. Matter 10 Micrometers and Smlr Tons/Yr:3

Name: SEA WORLD INC.
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA
Year: 2001
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Y
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 74
Reactive Organic Gases Tons/Yr: 6
Carbon Monoxide Emissions Tons/Yr: 19
NOX - Oxides of Nitrogen Tons/Yr: 15
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smlr Tons/Yr:1

Name: SEA WORLD INC.
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA
Year: 2002
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Y
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 71
Reactive Organic Gases Tons/Yr: 6
Carbon Monoxide Emissions Tons/Yr: 17
NOX - Oxides of Nitrogen Tons/Yr: 12
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smlr Tons/Yr:1

Name: SEA WORLD INC.
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

U003789059

Year: 2003
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 71
Reactive Organic Gases Tons/Yr: 6
Carbon Monoxide Emissions Tons/Yr: 17
NOX - Oxides of Nitrogen Tons/Yr: 12
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 1
Part. Matter 10 Micrometers and Smlr Tons/Yr:1

Name: SEA WORLD INC.
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA
Year: 2004
County Code: 37
Air Basin: SD
Facility ID: 937
Air District Name: SD
SIC Code: 7996
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Y
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 70.70338961
Reactive Organic Gases Tons/Yr: 5.878064585
Carbon Monoxide Emissions Tons/Yr: 17.04125201
NOX - Oxides of Nitrogen Tons/Yr: 12.20003375
SOX - Oxides of Sulphur Tons/Yr: 0.038391325
Particulate Matter Tons/Yr: 0.60752297
Part. Matter 10 Micrometers and Smlr Tons/Yr:0.60752297

HAZNET:

Name: UNITED RENTALS, INC.
Address: 500 SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92040
Year: 2017
GEPAID: CAC002897790
Contact: GRANT ZOLDOWSKI
Telephone: 3032864394
Mailing Name: Not reported
Mailing Address: 791 E. 64TH ST.
Mailing City,St,Zip: DENVER, CO 80229
Gen County: San Diego
TSD EPA ID: CAD028409019
TSD County: Los Angeles
Tons: 0.1
CA Waste Code: 352-Other organic solids
Method: H141-Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

U003789059

Name: UNITED RENTALS, INC.
Address: 500 SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92040
Year: 2017
GEPAID: CAC002897790
Contact: GRANT ZOLDOWSKI
Telephone: 3032864394
Mailing Name: Not reported
Mailing Address: 791 E. 64TH ST.
Mailing City,St,Zip: DENVER, CO 80229
Gen County: San Diego
TSD EPA ID: CAD028409019
TSD County: Los Angeles
Tons: 0.3336
CA Waste Code: 133-Aqueous solution with total organic residues 10 percent or more
Method: H135-Discharge To Sewer/Potw Or Npdes(With Prior Storage--With Or Without Treatment)
Facility County: San Diego

SAN DIEGO CO LOP:

Name: SEA WORLD
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109-7995
Record ID: DEH1986-LSAM-H00905-001
Record Status: Completed
Opened Date: 09/23/1986
Parcel Number: 435-480-15-00
Case Type: FIT - Failed Integrity Test
Historical Name: SEA WORLD
SWRCB Global ID: T0608142413
Funding: N - Non-Billable
Lead Agency: DEH/SAM
Lead Agency Date: 09/23/1986
Census Tract: 76.00
Community: Not reported
Jurisdiction: Not reported
Watershed Basin Number: 906.70
Water Purveyor: Not reported
Fire Agency: Not reported
Latitude: Not reported
Longitude: Not reported
X MapCoord: Not reported
Y MapCoord: Not reported

CIWQS:

Name: SEA WORLD SAN DIEGO 2012 EXPANSION
Address: 500 SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Agency: SeaWorld Parks and Entertainment
Agency Address: 500 Sea World Drive, San Diego, CA 92109
Place/Project Type: Construction - Commercial, Other: New Ride
SIC/NAICS: Not reported
Region: 9
Program: CONSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water construction

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

U003789059

Order Number: 2009-0009-DWQ
WDID: 9 37C360626
NPDES Number: CAS000002
Adoption Date: Not reported
Effective Date: 03/21/2011
Termination Date: 01/10/2013
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.76709
Longitude: -117.2277

Name: SWSD ATTRACTION 2014
Address: 500 SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Agency: SeaWorld Parks and Entertainment
Agency Address: 500 Sea World Drive, San Diego, CA 92109
Place/Project Type: Construction - Commercial
SIC/NAICS: Not reported
Region: 9
Program: CONSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water construction
Order Number: 2009-0009-DWQ
WDID: 9 37C365551
NPDES Number: CAS000002
Adoption Date: Not reported
Effective Date: 01/30/2013
Termination Date: 04/29/2014
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.76453
Longitude: -117.22664

CERS:

Name: SEA WORLD
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 921097995
Site ID: 209952
CERS ID: T0608142413
CERS Description: Cleanup Program Site

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A8
Target
Property

SEAWORLD SAN DIEGO ED CTR
500 SEA WORLD DR
SAN DIEGO, CA 92109

CIWQS **S121672563**
N/A

Site 8 of 35 in cluster A

Actual:
19 ft.

CIWQS:
Name: SEAWORLD SAN DIEGO ED CTR
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Agency: Sea World San Diego
Agency Address: 500 Sea World Dr, San Diego, CA 92109
Place/Project Type: Construction - Commercial
SIC/NAICS: Not reported
Region: 9
Program: CONSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water construction
Order Number: 99-08DW
WDID: 9 37C320140
NPDES Number: CAS000002
Adoption Date: Not reported
Effective Date: 02/14/2003
Termination Date: 01/27/2005
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.762897
Longitude: -117.231191

A9
Target
Property

12 KVA CIRCUIT EXTENSION JTA
500 SEA WORLD DR
SAN DIEGO, CA 92109

CIWQS **S121613065**
N/A

Site 9 of 35 in cluster A

Actual:
19 ft.

CIWQS:
Name: 12 KVA CIRCUIT EXTENSION JTA
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Agency: Sea World San Diego
Agency Address: 500 Sea World Dr, San Diego, CA 92109
Place/Project Type: Construction - Commercial, Utility
SIC/NAICS: Not reported
Region: 9
Program: CONSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water construction
Order Number: 99-08DW
WDID: 9 37C320406
NPDES Number: CAS000002
Adoption Date: Not reported
Effective Date: 03/07/2003
Termination Date: 04/11/2005
Expiration/Review Date: Not reported
Design Flow: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

12 KVA CIRCUIT EXTENSION JTA (Continued)

S121613065

Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.762897
Longitude: -117.231191

A10
Target **SEAWORLD - FIREWORKS EVENT LOCATIONS**
Property **500 SEAWORLD**
SAN DIEGO, CA 92109

CERS **S123511768**
N/A

Site 10 of 35 in cluster A

Actual:
19 ft.

CERS:
Name: SEAWORLD - FIREWORKS EVENT LOCATIONS
Address: 500 SEAWORLD
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 353095
CERS ID: 767591
CERS Description: NPDES Wastewater and Stormwater

Evaluation:
Eval General Type: Compliance Evaluation Inspection
Eval Date: 06-16-2014
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDNONMUNI
Eval Source: CIWQS

Eval General Type: Complaint Inspection
Eval Date: 07-13-2011
Violations Found: No
Eval Type: Complaint Inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDNONMUNI
Eval Source: CIWQS

A11
Target **500 SEAWORLD DR., SLIP 220**
Property **SAN DIEGO, CA**

CHMIRS **S114001070**
N/A

Site 11 of 35 in cluster A

Actual:
19 ft.

CHMIRS:
Name: Not reported
Address: 500 SEAWORLD DR., SLIP 220
City,State,Zip: SAN DIEGO, CA
OES Incident Number: 13-4861
OES notification: 08/06/2013
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S114001070

Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Waterways
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Cup(s)
Other:	Not reported
Date/Time:	1825
Year:	2013
Agency:	NRC
Incident Date:	8/6/2013
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Yes
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Diesel
Quantity Released:	1
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S114001070

Injuries: Not reported
Fataals: Not reported
Comments: Not reported
Description: Per NRC report: "The caller is reporting a discharge of diesel fuel into Mission Bay. The caller stated that while fueling a vessel at the marina, the tank burped and the material spilled from the vent. Sheen Information: Silvery, broken sheen 50 yards by 2 feet. Vessel Information: 25' pleasure craft. Remedial Actions: Booms applied, clean ups underway."

A12
Target
Property

500 SEAWORLD DR
SAN DIEGO, CA 92109

ERNS 2006810012
N/A

Site 12 of 35 in cluster A

Actual:
19 ft.

Incident Commons:
NRC Report #: 810012
Description of Incident: CALLER STATED THAT THERE WAS A SHEEN SPOTTED IN THE MARINA WATERS. THERE WAS A CLEANUP CREW OUT IN THE MARINA THAT WORKED FOR SEA WORLD AND THEY ASKED THE INDIVIDUAL IF IT WAS HIS BOAT. THEN THE BOAT SPED AWAY.
Type of Incident: VESSEL
Incident Cause: UNKNOWN
Incident Date Time: 2006-09-01 13:30:00
Incident DTG: OCCURRED
Incident Location: SLIP 139
Loaction Address: 500 SEAWORLD DR
Location Street 1: Not reported
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: Not reported
Incidents:
NRC Report #: 810012
Aircraft Type: Not reported
Aircraft Model: Not reported
Aircraft ID: Not reported
Aircraft Fuel Capacity: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2006810012

Aircraft Fuel Capacity Units:	Not reported
Aircraft Fuel on Board:	Not reported
Aircraft Fuel on Board Units:	Not reported
Aircraft Spot Number:	Not reported
Aircraft Hanger:	Not reported
Aircraft Runway Number:	Not reported
Road Mile Marker:	Not reported
Building ID:	Not reported
Type of Fixed Object:	Not reported
Power Generating Facility:	U
Generating Capacity:	Not reported
Type of Fuel:	Not reported
NPDES:	Not reported
NPDES Compliance:	U
Pipeline Type:	Not reported
DOT Regulated:	U
Pipeline Above Ground:	ABOVE
Exposed Underwater:	N
Pipeline Covered:	U
Railroad Hotline:	Not reported
Grade Crossing:	N
Location Subdivision:	Not reported
Railroad Milepost:	Not reported
Type Vehicle Involved:	Not reported
Crossing Device Type:	Not reported
Device Operational:	Y
DOT Crossing Number:	Not reported
Brake Failure:	N
Description of Tank:	Not reported
Tank Above Ground:	ABOVE
Transportable Container:	U
Tank Regulated:	U
Tank Regulated By:	Not reported
Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSF Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	Not reported
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	N
Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U
Airbag Deployed:	Not reported
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2006810012

Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported
Unknown Testing:	Not reported
Passenger Handling:	Not reported
Passenger Route:	XXX
Passenger Delay:	XXX

Incident Details:

NRC Report #:	810012
Fire Involved:	N
Fire Extinguished:	U
Any Evacuations:	N
Number Evacuated:	Not reported
Who Evacuated:	Not reported
Radius of Evacuation:	Not reported
Any Injuries:	N
Number Injured:	Not reported
Number Hospitalized:	Not reported
Any Fatalities:	N
Number Fatalities:	Not reported
Any Damages:	N
Damage Amount:	Not reported
Air Corridor Closed:	N
Air Corridor Desc:	Not reported
Air Closure Time:	Not reported
Waterway Closed:	N
Waterway Desc:	Not reported
Waterway Closure Time:	Not reported
Road Closed:	N
Road Desc:	Not reported
Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported
Media Interest:	NONE
Medium Desc:	WATER
Additional Medium Info:	MISSION BAY
Body of Water:	MISSION BAY
Tributary of:	PACIFIC OCEAN
Release Secured:	U

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2006810012

Estimated Duration of Release: Not reported
Release rate: Not reported
Desc Remedial Action: BOOMS APPLIED , ABSORBANTS USED
State Agency on Scene: NONE
State Agency Report Number: NO REPORT #
Other Agency Notified: Not reported
Weather Conditions: PARTLY CLOUDY
Air Temperature: 78
Wind Speed: 10
Wind Direction: E
Water Supply Contaminated: U
Sheen Size: Not reported
Sheen Color: RAINBOW
Direction of Sheen Travel: Not reported
Sheen Odor Description: Not reported
Wave Condition: Not reported
Current Speed: Not reported
Current Direction: Not reported
Water Temperature: Not reported
Track Close Dir: Not reported
Empl Fatality: Not reported
Pass Fatality: Not reported
Community Impact: N
Wind Speed Unit: MPH
Employee Injuries: Not reported
Passenger Injuries: Not reported
Occupant Fatality: Not reported
Current Speed Unit: Not reported
Road Closure Units: Not reported
Track CLOsure Units: Not reported
Sheen Size Units: Not reported
Additional Info: THE COMPANY THAT WAS DOING THE CLEANING WAS ALPHA ONE DIVING SERVICE.
THEY CAN BE REACHED AT 858-502-1300.

State Agency Notified: NONE
Federal Agency Notified: NONE
nearest River Mile Marker: Not reported
Sheen Size Length: 40
Sheen Size Length Units: FEET
Sheen Size Width: 100
Sheen Size Width Units: FEET
Offshore: N
Duration Unit: Not reported
Release Rate Unit: Not reported
Release Rate Rate: Not reported
Passengers Transferred: NO

Calls:

NRC Report #: 810012
Site ID: 2006810012
Date Time Received: 2006-09-01 17:23:41
Date Time Complete: 2006-09-01 17:30:58
Call Type: INC
Responsible Company: Not reported
Responsible Org Type: UNKNOWN
Responsible City: Not reported
Responsible State: XX
Responsible Zip: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2006810012

On Behalf: Not reported
Source: TELEPHONE

Vessels Detail:

Site ID: 2006810012
Vessel Name: UNKNOWN
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: Not reported
Hull Construction: Not reported
Fuel Capacity: Not reported
Fuel on Board: Not reported
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: N
Flag: UNKNOWN
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 810012
Chris Code: OUN
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: UNKNOWN OIL
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

A13
Target
Property

500 SEA WORLD DR.
SAN DIEGO, CA

CHMIRS S107450316
N/A

Site 13 of 35 in cluster A

Actual:
19 ft.

CHMIRS:

Name: Not reported
Address: 500 SEA WORLD DR.
City,State,Zip: SAN DIEGO, CA
OES Incident Number: 4-2083
OES notification: 04/19/2004
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S107450316

Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Not reported
Waterway:	Mission Bay
Spill Site:	Not reported
Cleanup By:	Contractor
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Date/Time:	Not reported
Year:	2004
Agency:	Sea World San Diego
Incident Date:	4/18/200412:00:00 AM
Admin Agency:	San Diego County Health Services Dept.
Amount:	Not reported
Contained:	Yes
Site Type:	Merchant/Business
E Date:	Not reported
Substance:	Unleaded gasoline
Gallons:	1/2
Unknown:	0
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	This release is from the bilge water of a tenants boat.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A14
Target
Property
ANTONIO E AUSTIN
500 SEAWORLD DR
SAN DIEGO, CA 92109

PEST LIC **S117636822**
N/A

Site 14 of 35 in cluster A

Actual:
19 ft.

PEST LIC:
Name: FRED G HART
Address: 500 SEAWORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Facility Type: QAC
Categories: B
License No: 92914
Issued or Renewed Date: 03/11/2019
Expiration Date: 12/31/2020

Name: ANTONIO E AUSTIN
Address: 500 SEAWORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Facility Type: QAC
Categories: B
License No: 133667
Issued or Renewed Date: 01/01/2019
Expiration Date: 12/31/2020

A15
Target
Property
500 SEAWORLD DR
SAN DIEGO, CA 92109

ERNS **2013056320**
N/A

Site 15 of 35 in cluster A

Actual:
19 ft.

Incident Commons:
NRC Report #: 1056320
Description of Incident: THE CALLER IS REPORTING A DISCHARGE OF DIESEL FUEL INTO MISSION BAY. THE CALLER STATED THAT WHILE FUELING A VESSEL AT THE MARINA, THE TANK BURPED AND THE MATERIAL SPILLED FROM THE VENT.

Type of Incident: VESSEL
Incident Cause: OPERATOR ERROR
Incident Date Time: 2013-08-06 18:25:00
Incident DTG: OCCURRED
Incident Location: Not reported
Location Address: 500 SEAWORLD DR
Location Street 1: SLIP 220
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013056320

Location Township: Not reported
Location range: Not reported
Potential Range: N

Incidents:

NRC Report #: 1056320
Aircraft Type: Not reported
Aircraft Model: Not reported
Aircraft ID: Not reported
Aircraft Fuel Capacity: Not reported
Aircraft Fuel Capacity Units: Not reported
Aircraft Fuel on Board: Not reported
Aircraft Fuel on Board Units: Not reported
Aircraft Spot Number: Not reported
Aircraft Hanger: Not reported
Aircraft Runway Number: Not reported
Road Mile Marker: Not reported
Building ID: Not reported
Type of Fixed Object: Not reported
Power Generating Facility: U
Generating Capacity: Not reported
Type of Fuel: Not reported
NPDES: Not reported
NPDES Compliance: U
Pipeline Type: Not reported
DOT Regulated: U
Pipeline Above Ground: ABOVE
Exposed Underwater: N
Pipeline Covered: U
Railroad Hotline: Not reported
Grade Crossing: U
Location Subdivision: Not reported
Railroad Milepost: Not reported
Type Vehicle Involved: Not reported
Crossing Device Type: Not reported
Device Operational: U
DOT Crossing Number: Not reported
Brake Failure: U
Description of Tank: Not reported
Tank Above Ground: ABOVE
Transportable Container: U
Tank Regulated: U
Tank Regulated By: Not reported
Tank ID: Not reported
Capacity of Tank: Not reported
Capacity of Tank Units: Not reported
Actual Amount: Not reported
Actual Amount Units: Not reported
Platform Rig Name: Not reported
Platform Letter: Not reported
Location Area ID: Not reported
Location Block ID: Not reported
OCSG Number: Not reported
OCSF Number: Not reported
State Lease Number: Not reported
Pier Dock Number: Not reported
Berth Slip Number: 220
Continuous Release Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013056320

Initial Continuous Release No: Not reported
Continuous Release Permit: Not reported
Allision: N
Type of Structure: Not reported
Structure Name: Not reported
Structure Operational: U
Airbag Deployed: U
Date Tiem Normal Service: Not reported
Service Disruption Time: Not reported
Service Disruption Units: Not reported
Transit Bus Flag: Not reported
CR Begin Date: Not reported
CR End Date: Not reported
CR Change Date: Not reported
FBI Contact: Not reported
FBI Contact Date Time: Not reported
Sub Part C Testing Req: XXX
Conductor Testing: Not reported
Engineer Testing: Not reported
Trainman Testing: Not reported
Yard Foreman Testing: Not reported
RCL Operator Testing: Not reported
Brakeman Testing: Not reported
Train Dispatcher Testing: Not reported
Signalman Testing: Not reported
Other Employee Testing: Not reported
Unknown Testing: Not reported
Passenger Handling: Not reported
Passenger Route: XXX
Passenger Delay: XXX

Incident Details:

NRC Report #: 1056320
Fire Involved: N
Fire Extinguished: U
Any Evacuations: N
Number Evacuated: Not reported
Who Evacuated: Not reported
Radius of Evacuation: Not reported
Any Injuries: N
Number Injured: Not reported
Number Hospitalized: Not reported
Any Fatalities: N
Number Fatalities: Not reported
Any Damages: N
Damage Amount: Not reported
Air Corridor Closed: N
Air Corridor Desc: Not reported
Air Closure Time: Not reported
Waterway Closed: N
Waterway Desc: Not reported
Waterway Closure Time: Not reported
Road Closed: N
Road Desc: Not reported
Road Closure Time: Not reported
Closure Direction: Not reported
Major Artery: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013056320

Track Closed: N
Track Desc: Not reported
Track Closure Time: Not reported
Media Interest: UNKNOWN
Medium Desc: WATER
Additional Medium Info: MISSION BAY
Body of Water: MISSION BAY
Tributary of: PACIFIC OCEAN
Release Secured: Y
Estimated Duration of Release: Not reported
Release rate: Not reported
Desc Remedial Action: BOOMS APPLIED, ABSORBENTS APPLIED, CLEAN UPS UNDERWAY.
State Agency on Scene: Not reported
State Agency Report Number: Not reported
Other Agency Notified: Not reported
Weather Conditions: CLEAR
Air Temperature: 70
Wind Speed: Not reported
Wind Direction: Not reported
Water Supply Contaminated: U
Sheen Size: Not reported
Sheen Color: SILVERY
Direction of Sheen Travel: Not reported
Sheen Odor Description: ****BROKEN SHEEN***
Wave Condition: Not reported
Current Speed: Not reported
Current Direction: Not reported
Water Temperature: Not reported
Track Close Dir: Not reported
Empl Fatality: Not reported
Pass Fatality: Not reported
Community Impact: Not reported
Wind Speed Unit: Not reported
Employee Injuries: Not reported
Passenger Injuries: Not reported
Occupant Fatality: Not reported
Current Speed Unit: Not reported
Road Closure Units: Not reported
Track Closure Units: Not reported
Sheen Size Units: Not reported
Additional Info: Not reported
State Agency Notified: Not reported
Federal Agency Notified: USCG
nearest River Mile Marker: Not reported
Sheen Size Length: 50
Sheen Size Length Units: YARDS
Sheen Size Width: 2
Sheen Size Width Units: FEET
Offshore: N
Duration Unit: Not reported
Release Rate Unit: Not reported
Release Rate Rate: Not reported
Passengers Transferred: NO

Calls:

NRC Report #: 1056320
Site ID: 20131056320

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013056320

Date Time Received: 2013-08-06 21:53:18
Date Time Complete: 2013-08-06 22:02:13
Call Type: INC
Responsible Company: Not reported
Responsible Org Type: PRIVATE CITIZEN
Responsible City: BALLEY CENTER
Responsible State: CA
Responsible Zip: 09082
On Behalf: Not reported
Source: TELEPHONE

Vessels Detail:

Site ID: 20131056320
Vessel Name: HARBOR MIST
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: 25
Hull Construction: Not reported
Fuel Capacity: Not reported
Fuel on Board: Not reported
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: N
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 1056320
Chris Code: ODS
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 1
Unit of Measure: CUP(S)
Name of Material: OIL: DIESEL
If Reached Water: YES
Amount in Water: 1
Unit of Measure Reach Water: CUP(S)

A16
Target
Property

SEAWORLD SAN DIEGO
500 SEA WORLD DRIVE
SAN DIEGO, CA 92109

RCRA-LQG
FINDS

1007199601
CAD981687221

Site 16 of 35 in cluster A

Actual:
19 ft.

RCRA-LQG:
Date form received by agency: 03/01/2014
Facility name: SEAWORLD SAN DIEGO
Facility address: 500 SEA WORLD DR
SAN DIEGO, CA 92109
EPA ID: CAD981687221
Mailing address: S SHORES RD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD SAN DIEGO (Continued)

1007199601

Contact: S SHORES RD
SAN DIEGO, CA 92109
Contact address: JULIE C BYFORD
SEA WORLD DR
SAN DIEGO, CA 92109
Contact country: Not reported
Contact telephone: 619-225-3247
Contact email: JULIE.BYFORD@SEAWORLD.COM
EPA Region: 09
Classification: Large Quantity Generator
Description: Handler: generates 1,000 kg or more of hazardous waste during any calendar month; or generates more than 1 kg of acutely hazardous waste during any calendar month; or generates more than 100 kg of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month; or generates 1 kg or less of acutely hazardous waste during any calendar month, and accumulates more than 1 kg of acutely hazardous waste at any time; or generates 100 kg or less of any residue or contaminated soil, waste or other debris resulting from the cleanup of a spill, into or on any land or water, of acutely hazardous waste during any calendar month, and accumulates more than 100 kg of that material at any time

Owner/Operator Summary:

Owner/operator name: SEAWORLD PARKS & ENTERTAINMENT
Owner/operator address: SOUTHPARK CENTER LOOP
ORLANDO, FL 32819
Owner/operator country: Not reported
Owner/operator telephone: 407-226-5000
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: 12/01/2009
Owner/Op end date: Not reported

Owner/operator name: SEAWORLD, INC
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Municipal
Owner/Operator Type: Owner
Owner/Op start date: 12/01/1989
Owner/Op end date: Not reported

Owner/operator name: SEAWORLD LLC DBA SEAWORLD SAN DIEGO
Owner/operator address: Not reported
Not reported
Owner/operator country: Not reported
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD SAN DIEGO (Continued)

1007199601

Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 01/01/1964
Owner/Op end date: Not reported

Owner/operator name: SEAWORLD SAN DIEGO
Owner/operator address: Not reported
Not reported
Owner/operator country: US
Owner/operator telephone: Not reported
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: 12/01/1989
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 02/24/2010
Site name: SEA WORLD- SAN DIEGO
Classification: Large Quantity Generator

Date form received by agency: 02/27/2008
Site name: SEA WORLD- SAN DIEGO
Classification: Not a generator, verified

Date form received by agency: 02/25/2006
Site name: SEA WORLD SAN DIEGO
Classification: Large Quantity Generator

Date form received by agency: 04/01/2004
Site name: SEAWORLD SAN DIEGO
Classification: Large Quantity Generator

Date form received by agency: 04/03/2003
Site name: SEA WORLD OF CALIFORNIA
Classification: Small Quantity Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD SAN DIEGO (Continued)

1007199601

Date form received by agency: 10/12/2000
Site name: SEAWORLD SAN DIEGO
Classification: Large Quantity Generator

Date form received by agency: 03/04/1999
Site name: SEA WORLD OF CALIFORNIA
Classification: Large Quantity Generator

Date form received by agency: 09/01/1996
Site name: SEA WORLD INC
Classification: Large Quantity Generator

Date form received by agency: 03/19/1996
Site name: SEA WORLD OF CALIFORNIA
Classification: Large Quantity Generator

Date form received by agency: 03/28/1994
Site name: SEA WORLD OF CALIFORNIA
Classification: Large Quantity Generator

Date form received by agency: 03/27/1992
Site name: SEA WORLD OF CALIFORNIA
Classification: Large Quantity Generator

Date form received by agency: 10/27/1986
Site name: SEA WORLD INC
Classification: Small Quantity Generator

Hazardous Waste Summary:

- . Waste code: 122
- . Waste name: Alkaline solution without metals (pH > 12.5)

- . Waste code: 131
- . Waste name: Aqueous solution (2 < pH < 12.5) containing reactive anions (azide, bromate, chlorate, cyanide, fluoride, hypochlorite, nitrite, perchlorate, and sulfide anions)

- . Waste code: 141
- . Waste name: Off-specification, aged, or surplus inorganics

- . Waste code: 212
- . Waste name: Oxygenated solvents (acetone, butanol, ethyl acetate, etc.)

- . Waste code: 213
- . Waste name: Hydrocarbon solvents (benzene, hexane, Stoddard, etc.)

- . Waste code: 331
- . Waste name: Off-specification, aged, or surplus organics

- . Waste code: 352
- . Waste name: Other organic solids

- . Waste code: 513
- . Waste name: Empty containers less than 30 gallons

- . Waste code: 541

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD SAN DIEGO (Continued)

1007199601

- . Waste name: Photochemicals / photo processing waste
- . Waste code: 551
- . Waste name: Laboratory waste chemicals
- . Waste code: 731
- . Waste name: Liquids with polychlorinated biphenyls > 50 mg/l
- . Waste code: 741
- . Waste name: Liquids with halogenated organic compounds > 1000 mg/l
- . Waste code: D001
- . Waste name: IGNITABLE WASTE
- . Waste code: D002
- . Waste name: CORROSIVE WASTE
- . Waste code: D003
- . Waste name: REACTIVE WASTE
- . Waste code: D006
- . Waste name: CADMIUM
- . Waste code: D007
- . Waste name: CHROMIUM
- . Waste code: D008
- . Waste name: LEAD
- . Waste code: D009
- . Waste name: MERCURY
- . Waste code: D010
- . Waste name: SELENIUM
- . Waste code: D011
- . Waste name: SILVER
- . Waste code: D018
- . Waste name: BENZENE
- . Waste code: D035
- . Waste name: METHYL ETHYL KETONE
- . Waste code: D040
- . Waste name: TRICHLORETHYLENE
- . Waste code: F002
- . Waste name: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD SAN DIEGO (Continued)

1007199601

- . Waste code: F003
- . Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: F005
- . Waste name: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

- . Waste code: P036
- . Waste name: ARSONOUS DICHLORIDE, PHENYL- (OR) DICHLOROPHENYLARSINE

- . Waste code: U044
- . Waste name: CHLOROFORM (OR) METHANE, TRICHLORO-

- . Waste code: U080
- . Waste name: METHANE, DICHLORO- (OR) METHYLENE CHLORIDE

- . Waste code: U122
- . Waste name: FORMALDEHYDE

- . Waste code: U154
- . Waste name: METHANOL (I) (OR) METHYL ALCOHOL (I)

- . Waste code: U160
- . Waste name: 2-BUTANONE, PEROXIDE (R,T) (OR) METHYL ETHYL KETONE PEROXIDE (R,T)

Violation Status: No violations found

FINDS:

Registry ID: 110017860894

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD SAN DIEGO (Continued)

1007199601

limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

HAZARDOUS WASTE BIENNIAL REPORTER

Registry ID: 110064253953

Environmental Interest/Information System
HAZARDOUS AIR POLLUTANT MAJOR

STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

**A17
Target
Property**

**500 SEA WORLD DR
SAN DIEGO, CA 92109**

**ERNS 2004719301
N/A**

Site 17 of 35 in cluster A

**Actual:
19 ft.**

Incident Commons:
NRC Report #: 719301
Description of Incident: CALLER IS REPORTING THAT 0.5 GALLONS OF UNLEADED GASOLINE WAS PUMPED OVERBOARD FROM A TENANT'S RECREATIONAL VESSEL WHEN IT'S BILGE PUMPED TURNED ON.
Type of Incident: VESSEL
Incident Cause: UNKNOWN
Incident Date Time: 2004-04-18 15:30:00
Incident DTG: DISCOVERED
Incident Location: SEA WORLD MARINA - SLIP 405
Loaction Address: 500 SEA WORLD DR
Location Street 1: Not reported
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: Not reported
Incidents:
NRC Report #: 719301

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2004719301

Aircraft Type:	Not reported
Aircraft Model:	Not reported
Aircraft ID:	Not reported
Aircraft Fuel Capacity:	Not reported
Aircraft Fuel Capacity Units:	Not reported
Aircraft Fuel on Board:	Not reported
Aircraft Fuel on Board Units:	Not reported
Aircraft Spot Number:	Not reported
Aircraft Hanger:	Not reported
Aircraft Runway Number:	Not reported
Road Mile Marker:	Not reported
Building ID:	Not reported
Type of Fixed Object:	Not reported
Power Generating Facility:	U
Generating Capacity:	Not reported
Type of Fuel:	Not reported
NPDES:	Not reported
NPDES Compliance:	U
Pipeline Type:	Not reported
DOT Regulated:	U
Pipeline Above Ground:	ABOVE
Exposed Underwater:	N
Pipeline Covered:	U
Railroad Hotline:	Not reported
Grade Crossing:	N
Location Subdivision:	Not reported
Railroad Milepost:	Not reported
Type Vehicle Involved:	Not reported
Crossing Device Type:	Not reported
Device Operational:	Y
DOT Crossing Number:	Not reported
Brake Failure:	N
Description of Tank:	Not reported
Tank Above Ground:	ABOVE
Transportable Container:	U
Tank Regulated:	U
Tank Regulated By:	Not reported
Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSP Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	Not reported
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	N
Type of Structure:	Not reported
Structure Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2004719301

Structure Operational:	U
Airbag Deployed:	Not reported
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported
Unknown Testing:	Not reported
Passenger Handling:	Not reported
Passenger Route:	XXX
Passenger Delay:	XXX

Incident Details:

NRC Report #:	719301
Fire Involved:	N
Fire Extinguished:	U
Any Evacuations:	N
Number Evacuated:	Not reported
Who Evacuated:	Not reported
Radius of Evacuation:	Not reported
Any Injuries:	N
Number Injured:	Not reported
Number Hospitalized:	Not reported
Any Fatalities:	N
Number Fatalities:	Not reported
Any Damages:	N
Damage Amount:	Not reported
Air Corridor Closed:	N
Air Corridor Desc:	Not reported
Air Closure Time:	Not reported
Waterway Closed:	N
Waterway Desc:	Not reported
Waterway Closure Time:	Not reported
Road Closed:	N
Road Desc:	Not reported
Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported
Media Interest:	NONE
Medium Desc:	WATER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2004719301

Additional Medium Info: MISSION BAY
Body of Water: MISSION BAY
Tributary of: Not reported
Release Secured: U
Estimated Duration of Release: Not reported
Release rate: Not reported
Desc Remedial Action: VESSEL WAS BOOMED, MATERIAL CONTAINED. CONTRACTOR (NRC) ON SCENE
PERFORMING CLEANUP, FIRE DEPT RESPONDED

State Agency on Scene: FIRE DEPT
State Agency Report Number: OES# 04-2083
Other Agency Notified: Not reported
Weather Conditions: SUNNY
Air Temperature: Not reported
Wind Speed: Not reported
Wind Direction: Not reported
Water Supply Contaminated: N
Sheen Size: Not reported
Sheen Color: RAINBOW
Direction of Sheen Travel: Not reported
Sheen Odor Description: Not reported
Wave Condition: Not reported
Current Speed: Not reported
Current Direction: Not reported
Water Temperature: Not reported
Track Close Dir: Not reported
Empl Fatality: Not reported
Pass Fatality: Not reported
Community Impact: N
Wind Speed Unit: Not reported
Employee Injuries: Not reported
Passenger Injuries: Not reported
Occupant Fatality: Not reported
Current Speed Unit: Not reported
Road Closure Units: Not reported
Track Closure Units: Not reported
Sheen Size Units: Not reported
Additional Info: THE LOCAL FIRE DEPT WAS NOTIFIED BECAUSE OF A STRONG SMELL OF GASOLINE
WITHIN VESSEL. FIRE DEPT FOAMED THE COMPARTMENT, THEREBY ACTIVATING
IT'S BILGE PUMP AND PUMPING SOME OF THE FOAM OVERBOARD. BOOM WAS
ALREADY IN PLACE AND THE MATERIAL WAS CONTAINED. CALLER WILL NOTIFY:
EPAIX, SAN DIEGO REGIONAL WATER QUALITY CONTROL.

State Agency Notified: CA OES, COUNTY DEPT ENV. HEALTH
Federal Agency Notified: Not reported
nearest River Mile Marker: Not reported
Sheen Size Length: Not reported
Sheen Size Length Units: Not reported
Sheen Size Width: Not reported
Sheen Size Width Units: Not reported
Offshore: N
Duration Unit: Not reported
Release Rate Unit: Not reported
Release Rate Rate: Not reported
Passengers Transferred: UNK

Calls:
NRC Report #: 719301
Site ID: 2004719301

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2004719301

Date Time Received: 2004-04-19 18:34:22
Date Time Complete: 2004-04-19 18:45:42
Call Type: INC
Responsible Company: Not reported
Responsible Org Type: UNKNOWN
Responsible City: Not reported
Responsible State: XX
Responsible Zip: Not reported
On Behalf: Y
Source: TELEPHONE

Vessels Detail:

Site ID: 2004719301
Vessel Name: UNKNOWN
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: Not reported
Hull Construction: Not reported
Fuel Capacity: Not reported
Fuel on Board: Not reported
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: N
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 719301
Chris Code: GAS
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0.5
Unit of Measure: GALLON(S)
Name of Material: GASOLINE: AUTOMOTIVE (UNLEADED)
If Reached Water: YES
Amount in Water: 0.5
Unit of Measure Reach Water: GALLON(S)

A18
Target
Property

SEA WORLD SAN DIEGO MANTA ATTRACTION 2012 CONSTRUC
500 SEA WORLD
SAN DIEGO, CA 92109

CERS **S123511766**
N/A

Site 18 of 35 in cluster A

Actual:
19 ft.

CERS:
Name: SEA WORLD SAN DIEGO MANTA ATTRACTION 2012 CONSTRUCTION DEWATERING PROJECT
Address: 500 SEA WORLD
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 353089
CERS ID: 768284

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD SAN DIEGO MANTA ATTRACTION 2012 CONSTRUCTION DEWAT (Continued)

S123511766

CERS Description:

NPDES Wastewater and Stormwater

A19
Target
Property

SEAWORLD - FIREWORKS EVENT LOCATIONS
500 SEAWORLD
SAN DIEGO, CA 92109

FINDS **1023377634**
N/A

Site 19 of 35 in cluster A

Actual:
19 ft.

FINDS:

Registry ID: 110066758869

Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

A20
Target
Property

SEA WORLD SAN DIEGO MANTA ATTRACTION 2012 CONSTRUC
500 SEA WORLD
SAN DIEGO, CA 92109

FINDS **1023283404**
N/A

Site 20 of 35 in cluster A

Actual:
19 ft.

FINDS:

Registry ID: 110065742021

Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

A21
Target
Property

SEA WORLD SAN DIEGO MANTA ATTRACTION 2012 CONSTRUC
500 SEA WORLD DRIVE
SAN DIEGO, CA 92109

NPDES **S121672468**
CIWQS **N/A**

Site 21 of 35 in cluster A

Actual:
19 ft.

NPDES:

Name: SEA WORLD SAN DIEGO MANTA ATTRACTION 2012 CONSTRUCTION DEWATERING PR
Address: 500 SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Facility Status: Historical
NPDES Number: CAG919002
Region: 9
Agency Number: 523232
Regulatory Measure ID: 380178
Place ID: 768284
Order Number: Not reported
WDID: 9 000002305
Regulatory Measure Type: Enrollee - NPDES

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD SAN DIEGO MANTA ATTRACTION 2012 CONSTRUCTION DEWAT (Continued)

S121672468

Program Type: NPDNONMUNIPRCS
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 07/18/2011
Termination Date Of Regulatory Measure: 06/24/2016
Expiration Date Of Regulatory Measure: 09/30/2020
Discharge Address: 500 Sea World Drive
Discharge Name: SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Discharge City: San Diego
Discharge State: CA
Discharge Zip: 92109
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

CIWQS:

Name: SEA WORLD SAN DIEGO MANTA ATTRACTION 2012 CONSTRUCTION DEWATERING PR
Address: 500 SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Agency: SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Agency Address: 500 Sea World Drive, San Diego, CA 92109
Place/Project Type: Development Site, NEC
SIC/NAICS: Not reported
Region: 9
Program: NPDNONMUNIPRCS
Regulatory Measure Status: Historical
Regulatory Measure Type: Enrollee - NPDES
Order Number: R9-2008-0002
WDID: 9 000002305
NPDES Number: CAG919002
Adoption Date: Not reported
Effective Date: 07/18/2011
Termination Date: 06/24/2016
Expiration/Review Date: 09/30/2020
Design Flow: Not reported
Major/Minor: Minor
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.76395
Longitude: -117.22675

A22 **AFISHN SEA CF# 1116782**
Target **500 SEA WORLD DR SLIP 333**
Property **SAN DIEGO, CA 92109**

HAZNET **S112962851**
N/A

Site 22 of 35 in cluster A

Actual: **HAZNET:**
19 ft. Name: AFISHN SEA CF# 1116782
Address: 500 SEA WORLD DR SLIP 333
City,State,Zip: SAN DIEGO, CA 921097904

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AFISHN SEA CF# 1116782 (Continued)

S112962851

Year: 2007
GEPAID: CAC002618895
Contact: VICTOR SALEM
Telephone: 6194018833
Mailing Name: Not reported
Mailing Address: 5135 RUSSEL SQUARE
Mailing City,St,Zip: LA MESA, CA 91941
Gen County: San Diego
TSD EPA ID: CAD409028019
TSD County: Not reported
Tons: 0.51
CA Waste Code: 343-Unspecified organic liquid mixture
Method: H135-Discharge To Sewer/Potw Or Npdes(With Prior Storage--With Or Without Treatment)
Facility County: San Diego

A23
Target
Property

LEON RAYMOND HUBBARD, JR
500 SEA WORLD DRIVE
SAN DIEGO, CA 92109

ECHO **1013954988**
N/A

Site 23 of 35 in cluster A

Actual:
19 ft.

ECHO:
Envid: 1013954988
Registry ID: 110017860894
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110017860894>

A24
Target
Property

SEAWORLD, SAN DIEGO
500 SEAWORLD DRIVE
SAN DIEGO, CA 92109

CHMIRS **S109039613**
NPDES **N/A**
CIWQS

Site 24 of 35 in cluster A

Actual:
19 ft.

CHMIRS:
Name: Not reported
Address: 500 SEAWORLD DR
City,State,Zip: SAN DIEGO, CA
OES Incident Number: 12-3637
OES notification: 06/22/2012
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S109039613

Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Misson Bay
Spill Site:	Waterways
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Sheen
Other:	Not reported
Date/Time:	2330
Year:	2012
Agency:	NRC
Incident Date:	6/21/2012
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown
Site Type:	Misson Bay
E Date:	Not reported
Substance:	Sheen
Quantity Released:	50 feet diameter
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	Per. NRC report: Caller reported an unknown sheen and smell of fuel from an unknown source at the marina.
Name:	Not reported
Address:	500 SEAWORLD DR.
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	6-5238
OES notification:	09/01/2006
OES Date:	Not reported
OES Time:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S109039613

Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Not reported
Waterway:	Mission Bay
Spill Site:	Not reported
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Date/Time:	Not reported
Year:	2006
Agency:	NRC
Incident Date:	9/1/2006 12:00:00 AM
Admin Agency:	San Diego County Health Services Dept.
Amount:	Not reported
Contained:	Unknown
Site Type:	Waterways
E Date:	Not reported
Substance:	Unknown Oil
Gallons:	0.000000
Unknown:	0
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S109039613

Evacs: Not reported
Injuries: Not reported
Fatals: Not reported
Comments: Not reported
Description: Caller stated that there was a sheen spotted in the marina waters. There was a cleanup crew out in the marina that worked for Seaworld and they asked the individual if it was his boat. Then the boat sped away.

NPDES:

Name: SEAWORLD, SAN DIEGO
Address: 500 SEAWORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Facility Status: Historical
NPDES Number: CA0107336
Region: 9
Agency Number: 523232
Regulatory Measure ID: 373525
Place ID: 256121
Order Number: R9-2011-0032
WDID: 9 000000083
Regulatory Measure Type: NPDES Permits
Program Type: NPDINDLRG
Adoption Date Of Regulatory Measure: 06/08/2011
Effective Date Of Regulatory Measure: 07/28/2011
Termination Date Of Regulatory Measure: 08/01/2018
Expiration Date Of Regulatory Measure: 07/27/2016
Discharge Address: 500 Sea World Drive
Discharge Name: SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Discharge City: San Diego
Discharge State: CA
Discharge Zip: 92109
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

NPDES as of 03/2018:

NPDES Number: CA0107336
Status: Active
Agency Number: 523232
Region: 9
Regulatory Measure ID: 373525
Order Number: R9-2011-0032
Regulatory Measure Type: NPDES Permits
Place ID: 256121
WDID: 9 000000083
Program Type: NPDINDLRG
Adoption Date Of Regulatory Measure: 06/08/2011
Effective Date Of Regulatory Measure: 07/28/2011
Expiration Date Of Regulatory Measure: 07/27/2016
Termination Date Of Regulatory Measure: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S109039613

Discharge Name:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Discharge Address:	500 Sea World Drive
Discharge City:	San Diego
Discharge State:	CA
Discharge Zip:	92109
Received Date:	Not reported
Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S109039613

Certifier Title: Not reported
Certification Date: Not reported
Primary Sic: Not reported
Secondary Sic: Not reported
Tertiary Sic: Not reported

Name: SEAWORLD - FIREWORKS EVENT LOCATIONS
Address: 500 SEAWORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109-7904
Facility Status: Active
NPDES Number: CAG999002
Region: 9
Agency Number: 523232
Regulatory Measure ID: 379747
Place ID: 767591
Order Number: R9-2011-0022
WDID: 9 000002300
Regulatory Measure Type: Enrollee
Program Type: NPDNONMUNIPRCS
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 06/01/2011
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: 05/31/2016
Discharge Address: 500 Sea World Drive
Discharge Name: SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Discharge City: San Diego
Discharge State: CA
Discharge Zip: 92109
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

NPDES as of 03/2018:

NPDES Number: CAG999002
Status: Active
Agency Number: 523232
Region: 9
Regulatory Measure ID: 379747
Order Number: R9-2011-0022
Regulatory Measure Type: Enrollee
Place ID: 767591
WDID: 9 000002300
Program Type: NPDNONMUNIPRCS
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 06/01/2011
Expiration Date Of Regulatory Measure: 05/31/2016
Termination Date Of Regulatory Measure: Not reported
Discharge Name: SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Discharge Address: 500 Sea World Drive
Discharge City: San Diego
Discharge State: CA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S109039613

Discharge Zip:	92109
Received Date:	Not reported
Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S109039613

Name: SEAWORLD, SAN DIEGO
Address: 500 SEAWORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
Facility Status: Active
NPDES Number: CA0107336
Region: 9
Agency Number: 523232
Regulatory Measure ID: 420773
Place ID: 256121
Order Number: R9-2018-0004
WDID: 9 000000083
Regulatory Measure Type: NPDES Permits
Program Type: NPDINDLRG
Adoption Date Of Regulatory Measure: 06/20/2018
Effective Date Of Regulatory Measure: 08/01/2018
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: 06/30/2023
Discharge Address: 500 Sea World Drive
Discharge Name: SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Discharge City: San Diego
Discharge State: CA
Discharge Zip: 92109
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
NPDES as of 03/2018:
NPDES Number: CA0107336
Status: Active
Agency Number: 523232
Region: 9
Regulatory Measure ID: 373525
Order Number: R9-2011-0032
Regulatory Measure Type: NPDES Permits
Place ID: 256121
WDID: 9 000000083
Program Type: NPDINDLRG
Adoption Date Of Regulatory Measure: 06/08/2011
Effective Date Of Regulatory Measure: 07/28/2011
Expiration Date Of Regulatory Measure: 07/27/2016
Termination Date Of Regulatory Measure: Not reported
Discharge Name: SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Discharge Address: 500 Sea World Drive
Discharge City: San Diego
Discharge State: CA
Discharge Zip: 92109
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S109039613

Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

CIWQS:

Name:	SEAWORLD - FIREWORKS EVENT LOCATIONS
Address:	500 SEAWORLD DRIVE
City,State,Zip:	SAN DIEGO, CA 92109
Agency:	SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S109039613

Agency Address: 500 Sea World Drive, San Diego, CA 92109
Place/Project Type: Outdoor Event Venue
SIC/NAICS: 7999
Region: 9
Program: NPDNONMUNIPRCS
Regulatory Measure Status: Active
Regulatory Measure Type: Enrollee
Order Number: R9-2011-0022
WDID: 9 000002300
NPDES Number: CAG999002
Adoption Date: Not reported
Effective Date: 06/01/2011
Termination Date: Not reported
Expiration/Review Date: 05/31/2016
Design Flow: Not reported
Major/Minor: Minor
Complexity: C
TTWQ: 3
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.76395
Longitude: -117.22675

A25
Target
Property

SEAWORLD, SAN DIEGO
500 SEAWORLD
SAN DIEGO, CA 92109

CERS S123502160
N/A

Site 25 of 35 in cluster A

Actual:
19 ft.

CERS:
Name: SEAWORLD, SAN DIEGO
Address: 500 SEAWORLD
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 152315
CERS ID: 256121
CERS Description: NPDES Wastewater and Stormwater

Violations:
Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 03-24-2011
Citation: California Water Code
Violation Description: Not reported
Violation Notes: Total Coliform 30-Day Average limit is 10 % and reported value was 29 %.
Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 09-06-2000
Citation: California Water Code
Violation Description: Not reported
Violation Notes: west treatment plant TC on 7/19 was 500 MPN. Since no more than 10% of the samples in a 30-day period shall exceed 230 MPN/100 mL, this is a residual violation resulting from 7/19. MMP #3.
Violation Division: Water Boards

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	10-04-2002
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	Fecal coliform reading taken on 8/20/2002 caused the number of samples taken during any 30-day period to exceed the limit of 400 MPN/100 ml on more than 10% of the samples.
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	10-21-1999
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	Discharger did not report influent suspended solids (required quarterly) in their semi-annual report.
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	03-15-2011
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	In the month of November 2006 weekly monitoring for pH, total coliform, fecal coliform, enterococcus and residual chlorine, was not conducted at outfalls No.1 and No. 2, in accordance with Sections III.A.1 and IV.A.1 of the Monitoring & Reporting Program
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	10-21-1999
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	TC collected 8-31-1999 from east drainage exceeded daily max. of 2000 MPN (5000 MPN).
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	10-21-1999
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	TC from East Drainage exceeded monthly mean of 1000 MPN (1294 MPN)
Violation Division:	Water Boards

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	03-15-2011
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	In the month of December 2008 weekly monitoring for pH, Total Coliform, Fecal Coliform, Enterococcus, and Residual Chlorine, was not conducted at outfalls No.1 and No. 2, in accordance with Sections III.A.1 and IV.A.1 of the Monitoring & Reporting Program
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	09-26-2008
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	The effluent exceeded the monthly average limitation for Enterococcus of 35 MPN/100 ml at Outfall No. 1 with a value of 201.5 MPN/100 ml on September 26
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	11-28-2007
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	The effluent exceeded the monthly average limitation for Enterococcus of 35 MPN/100 ml at Outfall No. 1 with a value of 103.3 MPN/100 ml on November 28
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	12-05-2002
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	Effluent samples from the east outfall resulted in 280 CFU/100 ml of enterococcus. The limit 'maximum at any time' is 104 CFU/100 ml.
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	06-20-2007
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	The effluent exceeded the monthly average limitation for Enterococcus

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

of 35 MPN/100 ml at Outfall No. 1 with a value of 47.6 MPN/100 ml on June 20

Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 09-26-2008
Citation: California Water Code
Violation Description: Not reported
Violation Notes: The effluent exceeded the instantaneous maximum limitation of Enterococcus of 104 MPN/100 ml at Outfall No. 1 with a value of 800 MPN/100 ml on September 26.

Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 05-30-1992
Citation: California Water Code
Violation Description: Not reported
Violation Notes: IN APRIL 92: TSS AT THE EAST DISCHARGE EXCEEDED LIMITS.

Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 03-15-2011
Citation: California Water Code
Violation Description: Not reported
Violation Notes: In the month of January 2008 weekly monitoring for Enterococcus was not conducted at outfalls No.1 and No. 2, in accordance with Sections III.A.1 and IV.A.1 of the Monitoring & Reporting Program.

Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 10-21-1999
Citation: California Water Code
Violation Description: Not reported
Violation Notes: Monthly TC mean at west drainage exceeded 1000 MPN (4003 MPN).

Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 08-07-2000
Citation: California Water Code
Violation Description: Not reported
Violation Notes: No more than 10% of samples in a 30-day period shall exceed 230 MPN/100 mL for TC. This was exceeded with one value (17%) of 230 MPN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

on 6-13-2000. Later deemed non-MMP eligible.

Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 10-04-2002
Citation: California Water Code
Violation Description: Not reported
Violation Notes: Total coliform readings taken on 8/19/02 caused the number of samples taken during any 30-day period to exceed the limit of 230 MPN/100 ml on more than 10% of the samples.

Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 03-15-2011
Citation: California Water Code
Violation Description: Not reported
Violation Notes: In the month of February weekly monitoring for pH, total coliform, fecal coliform, enterococcus and residual chlorine, was not conducted at outfalls No.1 and No. 2, in accordance with Sections III.A.1 and IV.A.1 of the Monitoring & Reporting Program

Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 09-07-2004
Citation: California Water Code
Violation Description: Not reported
Violation Notes: Sample from the west outfall exceeded ammonia maximum at any time effluent limitation of 0.55 mg/l (tested 0.66 mg/l). First Chronic violation for ammonia in 6-month period.

Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 11-14-2000
Citation: California Water Code
Violation Description: Not reported
Violation Notes: west treatment plant TC on 7/19 was 500 MPN. Since no more than 10% of the samples in a 30-day period shall exceed 230 MPN/100 mL, this is a residual violation resulting from 7/19. MMP #6.

Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 10-21-1999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	TC sample collected 7/15/99 from E. drainage exceeded daily max. of 2000 MPN (>16,000 MPN)
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	06-20-2007
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	The effluent exceeded the instantaneous maximum limitation for Enterococcus of 104 MPN/ 100 ml at Outfall No. 1 with a value of 230 MPN/100 ml on June 20
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	03-15-2011
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	In the month of December 2006 weekly monitoring for pH, total coliform, fecal coliform, enterococcus and residual chlorine, was not conducted at outfalls No.1 and No. 2, in accordance with Sections III.A.1 and IV.A.1 of the Monitoring & Reporting Program
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	10-04-2002
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	Total coliform reading taken on 8/20/2002 caused the number of samples taken during any 30-day period to exceed the limit of 230 MPN/100 ml on more than 10% of the samples.
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	11-22-1999
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	Monthly median total coliform from East treatment facilities exceeded 70 MPN median limit
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Site Name:	SeaWorld, San Diego
Violation Date:	09-06-2000
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	east treatment plant TC resulted in a value of 500 MPN/100 mL. No more than 10% of the samples in a 30-day period shall exceed 230 MPN/100 mL using a five-tube decimal dilution. MMP eligible penalty #2
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	03-15-2011
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	In the month of February 2008 weekly monitoring for Enterococcus was not conducted at outfalls No.1 and No. 2, in accordance with Sections III.A.1 and IV.A.1 of the Monitoring & Reporting Program.
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	04-21-2005
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	On Dec 15, 2004 the suspended solids concentration exceeded limitation for average monthly of 11.1 mg/L. The monthly average limitation is intake concentration plus 10 mg/L. Reported 1.1 mg/L for intake concentration. Exceeded intake by 360%.
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	03-15-2011
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	In the month of May 2007 weekly monitoring for Enterococcus was not conducted at outfalls No.1 and No. 2, in accordance with Sections III.A.1 and IV.A.1 of the Monitoring & Reporting Program.
Violation Division:	Water Boards
Violation Program:	NPDINDLRG
Violation Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Violation Date:	11-14-2000
Citation:	California Water Code
Violation Description:	Not reported
Violation Notes:	One enterococcus sample from East resulted in 220 CFU> 104. Migden eligible #7.
Violation Division:	Water Boards
Violation Program:	NPDINDLRG

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 05-11-2000
Citation: California Water Code
Violation Description: Not reported
Violation Notes: Report received one day late.
Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 11-14-2000
Citation: California Water Code
Violation Description: Not reported
Violation Notes: west treatment plant TC on 7/19 was 500 MPN. Since no more than 10% of the samples in a 30-day period shall exceed 230 MPN/100 mL, this is a residual violation resulting from 7/19. MMP #5.
Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 11-18-2008
Citation: California Water Code
Violation Description: Not reported
Violation Notes: The effluent exceeded the instantaneous maximum limitation for ammonia of 0.55 mg/l at outfall No. 2 with a value of 1.7 mg/l on November 18.
Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 08-01-2011
Citation: California Water Code
Violation Description: Not reported
Violation Notes: Ammonia, Total (as N) Instantaneous Maximum limit is 15 lb/day and reported value was 76.02 lb/day.
Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 11-14-2000
Citation: California Water Code
Violation Description: Not reported
Violation Notes: west treatment plant TC on 7/19 was 500 MPN. Since no more than 10% of the samples in a 30-day period shall exceed 230 MPN/100 mL, this is a residual violation resulting from 7/19. MMP #4.
Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 10-21-1999
Citation: California Water Code
Violation Description: Not reported
Violation Notes: TC collected 6/30/1999 exceeded daily max. of 2000 MPN (2400 MPN).
Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 09-10-1999
Citation: California Water Code
Violation Description: Not reported
Violation Notes: Discharger has not submitted a Report of Waste Discharge to re-issue permit.
Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 05-11-2000
Citation: California Water Code
Violation Description: Not reported
Violation Notes: MMR received one day late.
Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 11-28-2007
Citation: California Water Code
Violation Description: Not reported
Violation Notes: The effluent exceeded the instantaneous maximum limitation for Enterococcus of 104 MPN/100 ml at Outfall No. 1 with a value of 500 MPN/100 ml on November 28.
Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 04-21-2005
Citation: California Water Code
Violation Description: Not reported
Violation Notes: On Dec 15, 2004 the suspended solids concentration exceeded limitation for daily maximum limitation of 16.1 mg/L, i.e. intake concentration plus 15 mg/L. Reported intake concentration was 1.1 mg/L. Exceeds limitations for group one pollutant by 248%.
Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Site Name: SeaWorld, San Diego
Violation Date: 09-06-2000
Citation: California Water Code
Violation Description: Not reported
Violation Notes: One enterococcus sample collected from the East treatment facility
oresulted in a value of 130 MPN/100 mL; which exceeds the permitted
limit of 104 MPN/100 mL (at any time). MMP eligible penalty #1

Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Violation Date: 10-04-2002
Citation: California Water Code
Violation Description: Not reported
Violation Notes: Fecal coliform readings taken on 8/20/02 caused the number of samples
taken during any 30-day period to exceed the limit of 400 MPN/100 ml
on more than 10% of the samples.

Violation Division: Water Boards
Violation Program: NPDINDLRG
Violation Source: CIWQS

Evaluation:

Eval General Type: Compliance Evaluation Inspection
Eval Date: 02-11-2004
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 02-17-2005
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 02-20-1992
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Initial Site Inspection
Eval Date: 02-20-1994
Violations Found: No
Eval Type: Prerequisite inspection
Eval Notes: Not reported
Eval Division: Water Boards

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Eval Program:	NPDINDLRG
Eval Source:	CIWQS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	03-03-2007
Violations Found:	No
Eval Type:	RWQCB Type B compliance inspection
Eval Notes:	Not reported
Eval Division:	Water Boards
Eval Program:	NPDINDLRG
Eval Source:	CIWQS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	03-11-2015
Violations Found:	No
Eval Type:	RWQCB Type B compliance inspection
Eval Notes:	Not reported
Eval Division:	Water Boards
Eval Program:	NPDINDLRG
Eval Source:	CIWQS
Eval General Type:	Compliance Sampling Inspection
Eval Date:	03-27-1998
Violations Found:	No
Eval Type:	RWQCB Type A compliance inspection
Eval Notes:	Not reported
Eval Division:	Water Boards
Eval Program:	NPDINDLRG
Eval Source:	CIWQS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-05-2006
Violations Found:	No
Eval Type:	RWQCB Type B compliance inspection
Eval Notes:	Not reported
Eval Division:	Water Boards
Eval Program:	NPDINDLRG
Eval Source:	CIWQS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-08-2010
Violations Found:	No
Eval Type:	RWQCB Type B compliance inspection
Eval Notes:	Not reported
Eval Division:	Water Boards
Eval Program:	NPDINDLRG
Eval Source:	CIWQS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-15-2009
Violations Found:	No
Eval Type:	RWQCB Type B compliance inspection
Eval Notes:	Not reported
Eval Division:	Water Boards
Eval Program:	NPDINDLRG
Eval Source:	CIWQS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-19-2011
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 05-12-2017
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Compliance Sampling Inspection
Eval Date: 06-06-2000
Violations Found: No
Eval Type: RWQCB Type A compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 06-19-1992
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-03-2001
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-30-2001
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-24-2013
Violations Found: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-27-1995
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 10-25-1996
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 12-05-2000
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 12-20-2017
Violations Found: No
Eval Type: RWQCB Type B compliance inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: NPDINDLRG
Eval Source: CIWQS

Enforcement Action:
Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 01-12-2011
Enf Action Type: Administrative Enforcement with Penalty
Enf Action Description: Administrative Enforcement with Civil Liability (Penalty)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Site ID: 152315

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 02-07-2012
Enf Action Type: Administrative Enforcement with Penalty
Enf Action Description: Administrative Enforcement with Civil Liability (Penalty)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 03-22-2004
Enf Action Type: Administrative Enforcement with Penalty
Enf Action Description: Administrative Enforcement with Civil Liability (Penalty)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 03-24-2011
Enf Action Type: Staff Enforcement Letter (Informal)
Enf Action Description: Staff Enforcement Letter (Informal)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 05-02-2013
Enf Action Type: Staff Enforcement Letter (Informal)
Enf Action Description: Staff Enforcement Letter (Informal)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 05-11-2000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Enf Action Type:	Staff Enforcement Letter (Informal)
Enf Action Description:	Staff Enforcement Letter (Informal)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD
Site City:	SAN DIEGO
Site Zip:	92109
Enf Action Date:	05-16-2005
Enf Action Type:	Administrative Enforcement with Penalty
Enf Action Description:	Administrative Enforcement with Civil Liability (Penalty)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD
Site City:	SAN DIEGO
Site Zip:	92109
Enf Action Date:	06-10-2004
Enf Action Type:	Administrative Enforcement with Penalty
Enf Action Description:	Administrative Enforcement with Civil Liability (Penalty)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD
Site City:	SAN DIEGO
Site Zip:	92109
Enf Action Date:	06-12-2014
Enf Action Type:	Staff Enforcement Letter (Informal)
Enf Action Description:	Staff Enforcement Letter (Informal)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD
Site City:	SAN DIEGO
Site Zip:	92109
Enf Action Date:	08-07-2000
Enf Action Type:	Notice of Violation (Water)
Enf Action Description:	Notice of Violation Letter (Informal)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD
Site City:	SAN DIEGO
Site Zip:	92109
Enf Action Date:	08-07-2019
Enf Action Type:	Staff Enforcement Letter (Informal)
Enf Action Description:	Staff Enforcement Letter (Informal)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD
Site City:	SAN DIEGO
Site Zip:	92109
Enf Action Date:	08-10-2005
Enf Action Type:	Administrative Enforcement with Penalty
Enf Action Description:	Administrative Enforcement with Civil Liability (Penalty)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD
Site City:	SAN DIEGO
Site Zip:	92109
Enf Action Date:	08-11-2016
Enf Action Type:	Staff Enforcement Letter (Informal)
Enf Action Description:	Staff Enforcement Letter (Informal)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD
Site City:	SAN DIEGO
Site Zip:	92109
Enf Action Date:	09-06-2000
Enf Action Type:	Notice of Violation (Water)
Enf Action Description:	Notice of Violation Letter (Informal)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 09-07-2004
Enf Action Type: Notice of Violation (Water)
Enf Action Description: Notice of Violation Letter (Informal)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 10-03-1988
Enf Action Type: Cease and Desist Order
Enf Action Description: Cease and Desist Order
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 10-04-2002
Enf Action Type: Staff Enforcement Letter (Informal)
Enf Action Description: Staff Enforcement Letter (Informal)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 10-21-1999
Enf Action Type: Staff Enforcement Letter (Informal)
Enf Action Description: Staff Enforcement Letter (Informal)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 10-23-1989
Enf Action Type: Cease and Desist Order
Enf Action Description: Cease and Desist Order

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD
Site City:	SAN DIEGO
Site Zip:	92109
Enf Action Date:	11-14-2000
Enf Action Type:	Staff Enforcement Letter (Informal)
Enf Action Description:	Staff Enforcement Letter (Informal)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD
Site City:	SAN DIEGO
Site Zip:	92109
Enf Action Date:	11-16-2000
Enf Action Type:	Administrative Enforcement with Penalty
Enf Action Description:	Administrative Enforcement with Civil Liability (Penalty)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD
Site City:	SAN DIEGO
Site Zip:	92109
Enf Action Date:	11-22-1999
Enf Action Type:	Staff Enforcement Letter (Informal)
Enf Action Description:	Staff Enforcement Letter (Informal)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS
Site ID:	152315
Site Name:	SeaWorld, San Diego
Site Address:	500 SEAWORLD
Site City:	SAN DIEGO
Site Zip:	92109
Enf Action Date:	11-23-1999
Enf Action Type:	Staff Enforcement Letter (Informal)
Enf Action Description:	Staff Enforcement Letter (Informal)
Enf Action Notes:	Not reported
Enf Action Division:	Water Boards
Enf Action Program:	NPDINDLRG
Enf Action Source:	CIWQS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 12-05-2002
Enf Action Type: Staff Enforcement Letter (Informal)
Enf Action Description: Staff Enforcement Letter (Informal)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 12-17-1990
Enf Action Type: Cease and Desist Order
Enf Action Description: Cease and Desist Order
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 12-20-1999
Enf Action Type: Notice of Violation (Water)
Enf Action Description: Notice of Violation Letter (Informal)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Site ID: 152315
Site Name: SeaWorld, San Diego
Site Address: 500 SEAWORLD
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 12-28-2000
Enf Action Type: Staff Enforcement Letter (Informal)
Enf Action Description: Staff Enforcement Letter (Informal)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: NPDINDLRG
Enf Action Source: CIWQS

Affiliation:
Affiliation Type Desc: Owner and Operator
Entity Name: SeaWorld Parks & Entertainment, Inc. a Delaware Corporation, SeaWorld LLC
Entity Title: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD, SAN DIEGO (Continued)

S123502160

Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

A26
Target
Property

500 SEA WORLD DRIVE
SAN DIEGO, CA 92109

CHMIRS **S105885552**
N/A

Site 26 of 35 in cluster A

Actual:
19 ft.

CHMIRS:
Name: Not reported
Address: 500 SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92109
OES Incident Number: 2-4158
OES notification: 07/31/2002
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: Mission Bay
Spill Site: Not reported
Cleanup By: Reporting Party
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Date/Time: Not reported
Year: 2002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S105885552

Agency: Sea World
Incident Date: 7/31/2002 12:00:00 AM
Admin Agency: San Diego County Health Services Dept.
Amount: Not reported
Contained: Yes
Site Type: Merchant/Business
E Date: Not reported
Substance: Boat Transmission Fluid
Gallons: 0.000000
Ounces: 0.5
Unknown: 0
Substance #2: Not reported
Substance #3: Not reported
Evacuations: 0
Number of Injuries: 0
Number of Fatalities: 0
#1 Pipeline: Not reported
#2 Pipeline: Not reported
#3 Pipeline: Not reported
#1 Vessel >= 300 Tons: Not reported
#2 Vessel >= 300 Tons: Not reported
#3 Vessel >= 300 Tons: Not reported
Evacs: Not reported
Injuries: Not reported
Fataals: Not reported
Comments: Not reported
Description: Substance was released due to transmission work done earlier, When boat was placed in water substance was released from a transmission line. Substance was boomed and absorbents were in-placed. Substance has been cleaned up.

A27 AT&T MOBILITY - TIN SHED @ SEA WORLD (USID112696)
Target 500 SEA WORLD DR
Property SAN DIEGO, CA 92109

FINDS 1023332074
N/A

Site 27 of 35 in cluster A

Actual:
19 ft.

FINDS:

Registry ID: 110066267961

Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A28
Target
Property **SEAWORLD SAN DIEGO 2020 ATTRACTION**
500 SEA WORLD DRIVE
SAN DIEGO, CA 92019

CERS **S124441517**
N/A

Site 28 of 35 in cluster A

Actual:
19 ft.

CERS:
Name: SEAWORLD SAN DIEGO 2020 ATTRACTION
Address: 500 SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92019
Site ID: 549345
CERS ID: 872862
CERS Description: Construction Storm Water

Affiliation:
Affiliation Type Desc: Owner/Operator
Entity Name: SeaWorld Parks and Entertainment
Entity Title: Operator
Affiliation Address: 500 Sea World Drive
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92109
Affiliation Phone: Not reported

A29
Target
Property **INGRID GAASBEEK**
500 SEA WORLD DR
SAN DIEGO, CA 92109

PEST LIC **S117648485**
N/A

Site 29 of 35 in cluster A

Actual:
19 ft.

PEST LIC:
Name: INGRID GAASBEEK
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Facility Type: QAC
Categories: B
License No: 85710
Issued or Renewed Date: 01/01/2019
Expiration Date: 12/31/2020

A30
Target
Property **PCL CONSTRUCTION SERVICES, INC.**
500 SEA WORLD DR
SAN DIEGO, CA 92109

HAZNET **S118217335**
N/A

Site 30 of 35 in cluster A

Actual:
19 ft.

HAZNET:
Name: PCL CONSTRUCTION SERVICES, INC.
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 921097904
Year: 2014
GEPAID: CAC002779680
Contact: ALBERT VALENZUELA
Telephone: 8586573400
Mailing Name: Not reported
Mailing Address: 4690 EXECUTIVE DR STE 100
Mailing City,St,Zip: SAN DIEGO, CA 921213073

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PCL CONSTRUCTION SERVICES, INC. (Continued)

S118217335

Gen County: San Diego
TSD EPA ID: CAD982444481
TSD County: San Bernardino
Tons: 0.0578
CA Waste Code: 343-Unspecified organic liquid mixture
Method: H141-Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

Name: PCL CONSTRUCTION SERVICES, INC.
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 921097904
Year: 2014
GEPAID: CAC002779680
Contact: ALBERT VALENZUELA
Telephone: 8586573400
Mailing Name: Not reported
Mailing Address: 4690 EXECUTIVE DR STE 100
Mailing City,St,Zip: SAN DIEGO, CA 921213073
Gen County: San Diego
TSD EPA ID: CAD982444481
TSD County: San Bernardino
Tons: 0.03336
CA Waste Code: 291-Latex waste
Method: H141-Storage, Bulking, And/Or Transfer Off Site--No Treatment/Reovery
(H010-H129) Or (H131-H135)
Facility County: San Diego

A31 **SEA WORLD, SAN DIEGO**
Target **500 SEAWORLD DRIVE**
Property **SAN DIEGO, CA 92109**

ICIS **1013788405**
FINDS **N/A**
ECHO

Site 31 of 35 in cluster A

Actual:
19 ft.

ICIS:
Enforcement Action ID: CA-N00004244
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Cwa Penalty Ao
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: State CWA Penalty AO
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCWAAPO
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003853
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Viol. Notice To Regultd Entity

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD, SAN DIEGO (Continued)

1013788405

Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: Notice of Violation
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003852
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Cwa Penalty Ao
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: State CWA Penalty AO
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCWAAPO
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003851
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Cwa Penalty Ao
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: State CWA Penalty AO
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCWAAPO
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD, SAN DIEGO (Continued)

1013788405

Enforcement Action ID: CA-N00003195
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Viol. Notice To Regultd Entity
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: Notice of Violation
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003194
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Viol. Notice To Regultd Entity
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: Notice of Violation
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003193
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Viol. Notice To Regultd Entity
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: Notice of Violation
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD, SAN DIEGO (Continued)

1013788405

Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003192
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Administrative Order
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: State CWA Non Penalty AO
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCWAAO
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003191
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Administrative Order
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: State CWA Non Penalty AO
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCWAAO
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003190
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Administrative Order
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: State CWA Non Penalty AO
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCWAAO
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD, SAN DIEGO (Continued)

1013788405

Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003189
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Letter Of Violation/Warning Letter
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: Letter of Violation/ Warning Letter
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LOVWL
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003188
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Letter Of Violation/Warning Letter
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: Letter of Violation/ Warning Letter
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LOVWL
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003187
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Letter Of Violation/Warning Letter
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: Letter of Violation/ Warning Letter
Facility County: SAN DIEGO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD, SAN DIEGO (Continued)

1013788405

Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LOVWL
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003186
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Letter Of Violation/Warning Letter

Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: Letter of Violation/ Warning Letter
Facility County: SAN DIEGO

Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LOVWL
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003185
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Letter Of Violation/Warning Letter

Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: Letter of Violation/ Warning Letter
Facility County: SAN DIEGO

Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LOVWL
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00003184
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Letter Of Violation/Warning

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD, SAN DIEGO (Continued)

1013788405

Letter
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: Letter of Violation/ Warning Letter
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LOVWL
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00002542
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Cwa Penalty Ao
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: State CWA Penalty AO
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCWAAPO
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-N00002534
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Cwa Penalty Ao
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: State CWA Penalty AO
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCWAAPO
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD, SAN DIEGO (Continued)

1013788405

Enforcement Action ID: CA-N00000715
FRS ID: 110064253962
Action Name: SEA WORLD, SAN DIEGO (Permit CA0107336) Penalty Ao Issued By State
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: State CWA Penalty AO
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCWAAPO
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-2012-1019
FRS ID: 110064253962
Action Name: SeaWorld, San Diego - EPL
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: State CWA Penalty AO
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCWAAPO
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-2011-1001
FRS ID: 110064253962
Action Name: Sea World, San Diego - ACL
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980
Enforcement Action Type: State CWA Penalty AO
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCWAAPO
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD, SAN DIEGO (Continued)

1013788405

Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-200103562
FRS ID: 110064253962
Action Name: SeaWorld, San Diego - SEL
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: Letter to Regulated Entity
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LRE
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-200089463
FRS ID: 110064253962
Action Name: SeaWorld, San Diego - SEL
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: Letter to Regulated Entity
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LRE
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-200053362
FRS ID: 110064253962
Action Name: SeaWorld, San Diego - SEL
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: Letter to Regulated Entity
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LRE
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD, SAN DIEGO (Continued)

1013788405

Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-200053361
FRS ID: 110064253962
Action Name: SeaWorld, San Diego - SEL
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: Letter to Regulated Entity
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LRE
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-200053359
FRS ID: 110064253962
Action Name: SeaWorld, San Diego - SEL
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: Letter to Regulated Entity
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LRE
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-200053358
FRS ID: 110064253962
Action Name: SeaWorld, San Diego - SEL
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: Letter to Regulated Entity
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LRE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD, SAN DIEGO (Continued)

1013788405

Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

Enforcement Action ID: CA-200040732
FRS ID: 110064253962
Action Name: SeaWorld, San Diego - SEL
Facility Name: SEA WORLD, SAN DIEGO
Facility Address: 500 SEAWORLD DRIVE
SAN DIEGO, CA 921099980

Enforcement Action Type: Letter to Regulated Entity
Facility County: SAN DIEGO
Program System Acronym: NPDES
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: LRE
Facility SIC Code: 7996
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 32.762972
Longitude in Decimal Degrees: -117.231333
Permit Type Desc: NPDES Individual Permit
Program System Acronym: CA0107336
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

FINDS:

Registry ID: 110064253962

Environmental Interest/Information System

US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1013788405
Registry ID: 110064253962
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110064253962>

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A32
Target
Property

500 SEAWORLD DR
SAN DIEGO, CA 92109

ERNS 2012015331
N/A

Site 32 of 35 in cluster A

Actual:
19 ft.

Incident Commons:

NRC Report #: 1015331
Description of Incident: CALLER REPORTED AN UNKNOWN SHEEN FROM AN UNKNOWN SOURCE AT THE MARINA.
Type of Incident: UNKNOWN SHEEN
Incident Cause: UNKNOWN
Incident Date Time: 2012-06-21 23:30:00
Incident DTG: OCCURRED
Incident Location: UNKNOWN SHEEN INCIDENT
Loaction Address: 500 SEAWORLD DR
Location Street 1: Not reported
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N

Incidents:

NRC Report #: 1015331
Aircraft Type: Not reported
Aircraft Model: Not reported
Aircraft ID: Not reported
Aircraft Fuel Capacity: Not reported
Aircraft Fuel Capacity Units: Not reported
Aircraft Fuel on Board: Not reported
Aircraft Fuel on Board Units: Not reported
Aircraft Spot Number: Not reported
Aircraft Hanger: Not reported
Aircraft Runway Number: Not reported
Road Mile Marker: Not reported
Building ID: Not reported
Type of Fixed Object: Not reported
Power Generating Facility: U
Generating Capacity: Not reported
Type of Fuel: Not reported
NPDES: Not reported
NPDES Compliance: U
Pipeline Type: Not reported
DOT Regulated: U
Pipeline Above Ground: ABOVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2012015331

Exposed Underwater:	N
Pipeline Covered:	U
Railroad Hotline:	Not reported
Grade Crossing:	U
Location Subdivision:	Not reported
Railroad Milepost:	Not reported
Type Vehicle Involved:	Not reported
Crossing Device Type:	Not reported
Device Operational:	U
DOT Crossing Number:	Not reported
Brake Failure:	U
Description of Tank:	Not reported
Tank Above Ground:	ABOVE
Transportable Container:	U
Tank Regulated:	U
Tank Regulated By:	Not reported
Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSF Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	Not reported
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	U
Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U
Airbag Deployed:	U
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2012015331

Unknown Testing: Not reported
Passenger Handling: Not reported
Passenger Route: XXX
Passenger Delay: XXX

Incident Details:

NRC Report #: 1015331
Fire Involved: N
Fire Extinguished: U
Any Evacuations: N
Number Evacuated: Not reported
Who Evacuated: Not reported
Radius of Evacuation: Not reported
Any Injuries: N
Number Injured: Not reported
Number Hospitalized: Not reported
Any Fatalities: N
Number Fatalities: Not reported
Any Damages: N
Damage Amount: Not reported
Air Corridor Closed: N
Air Corridor Desc: Not reported
Air Closure Time: Not reported
Waterway Closed: N
Waterway Desc: Not reported
Waterway Closure Time: Not reported
Road Closed: N
Road Desc: Not reported
Road Closure Time: Not reported
Closure Direction: Not reported
Major Artery: N
Track Closed: N
Track Desc: Not reported
Track Closure Time: Not reported
Media Interest: NONE
Medium Desc: WATER
Additional Medium Info: MISSION BAY
Body of Water: MISSION BAY
Tributary of: Not reported
Release Secured: U
Estimated Duration of Release: Not reported
Release rate: Not reported
Desc Remedial Action: Not reported
State Agency on Scene: Not reported
State Agency Report Number: Not reported
Other Agency Notified: Not reported
Weather Conditions: OVERCAST
Air Temperature: Not reported
Wind Speed: Not reported
Wind Direction: Not reported
Water Supply Contaminated: U
Sheen Size: Not reported
Sheen Color: Not reported
Direction of Sheen Travel: Not reported
Sheen Odor Description: Not reported
Wave Condition: Not reported
Current Speed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2012015331

Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	Not reported
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported
Passenger Injuries:	Not reported
Occupant Fatality:	Not reported
Current Speed Unit:	Not reported
Road Closure Units:	Not reported
Track CLosure Units:	Not reported
Sheen Size Units:	Not reported
Additional Info:	Not reported
State Agency Notified:	Not reported
Federal Agency Notified:	Not reported
nearest River Mile Marker:	Not reported
Sheen Size Length:	Not reported
Sheen Size Length Units:	Not reported
Sheen Size Width:	Not reported
Sheen Size Width Units:	Not reported
Offshore:	N
Duration Unit:	Not reported
Release Rate Unit:	Not reported
Release Rate Rate:	Not reported
Passengers Transferred:	NO

Calls:

NRC Report #:	1015331
Site ID:	20121015331
Date Time Received:	2012-06-22 03:23:30
Date Time Complete:	2012-06-22 03:29:19
Call Type:	INC
Responsible Company:	Not reported
Responsible Org Type:	UNKNOWN
Responsible City:	Not reported
Responsible State:	XX
Responsible Zip:	Not reported
On Behalf:	Not reported
Source:	TELEPHONE

Material Involved:

NRC Report #:	1015331
Chris Code:	OUN
Case Number:	000000-00-0
UN Number:	Not reported
Amount of Material:	0
Unit of Measure:	UNKNOWN AMOUNT
Name of Material:	UNKNOWN OIL
If Reached Water:	YES
Amount in Water:	0
Unit of Measure Reach Water:	UNKNOWN AMOUNT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A33
Target
Property

500 SEA WORLD DR.
SAN DIEGO, CA 92109

ERNS 2005778995
N/A

Site 33 of 35 in cluster A

Actual:
19 ft.

Incident Commons:

NRC Report #: 778995
Description of Incident: THE CALLER STATED THAT A DOCK BOX WAS LEAKING FUEL INTO THE WATER.
Type of Incident: FIXED
Incident Cause: EQUIPMENT FAILURE
Incident Date Time: 2005-11-09 09:30:00
Incident DTG: OCCURRED
Incident Location: Not reported
Loaction Address: 500 SEA WORLD DR.
Location Street 1: Not reported
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: Not reported

Incidents:

NRC Report #: 778995
Aircraft Type: Not reported
Aircraft Model: Not reported
Aircraft ID: Not reported
Aircraft Fuel Capacity: Not reported
Aircraft Fuel Capacity Units: Not reported
Aircraft Fuel on Board: Not reported
Aircraft Fuel on Board Units: Not reported
Aircraft Spot Number: Not reported
Aircraft Hanger: Not reported
Aircraft Runway Number: Not reported
Road Mile Marker: Not reported
Building ID: Not reported
Type of Fixed Object: OTHER
Power Generating Facility: N
Generating Capacity: Not reported
Type of Fuel: Not reported
NPDES: Not reported
NPDES Compliance: U
Pipeline Type: Not reported
DOT Regulated: U
Pipeline Above Ground: ABOVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2005778995

Exposed Underwater:	N
Pipeline Covered:	U
Railroad Hotline:	Not reported
Grade Crossing:	N
Location Subdivision:	Not reported
Railroad Milepost:	Not reported
Type Vehicle Involved:	Not reported
Crossing Device Type:	Not reported
Device Operational:	Y
DOT Crossing Number:	Not reported
Brake Failure:	N
Description of Tank:	Not reported
Tank Above Ground:	ABOVE
Transportable Container:	U
Tank Regulated:	U
Tank Regulated By:	Not reported
Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSF Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	Not reported
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	N
Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U
Airbag Deployed:	Not reported
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2005778995

Unknown Testing: Not reported
Passenger Handling: Not reported
Passenger Route: XXX
Passenger Delay: XXX

Incident Details:

NRC Report #: 778995
Fire Involved: N
Fire Extinguished: U
Any Evacuations: N
Number Evacuated: Not reported
Who Evacuated: Not reported
Radius of Evacuation: Not reported
Any Injuries: N
Number Injured: Not reported
Number Hospitalized: Not reported
Any Fatalities: N
Number Fatalities: Not reported
Any Damages: N
Damage Amount: Not reported
Air Corridor Closed: N
Air Corridor Desc: Not reported
Air Closure Time: Not reported
Waterway Closed: N
Waterway Desc: Not reported
Waterway Closure Time: Not reported
Road Closed: N
Road Desc: Not reported
Road Closure Time: Not reported
Closure Direction: Not reported
Major Artery: N
Track Closed: N
Track Desc: Not reported
Track Closure Time: Not reported
Media Interest: NONE
Medium Desc: WATER
Additional Medium Info: MISSION BAY
Body of Water: MISSION BAY
Tributary of: Not reported
Release Secured: Y
Estimated Duration of Release: Not reported
Release rate: Not reported
Desc Remedial Action: CONTAINED AND CLEANED UP
State Agency on Scene: Not reported
State Agency Report Number: Not reported
Other Agency Notified: Not reported
Weather Conditions: OVERCAST
Air Temperature: 68
Wind Speed: Not reported
Wind Direction: Not reported
Water Supply Contaminated: N
Sheen Size: Not reported
Sheen Color: UNKNOWN
Direction of Sheen Travel: Not reported
Sheen Odor Description: Not reported
Wave Condition: Not reported
Current Speed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2005778995

Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	N
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported
Passenger Injuries:	Not reported
Occupant Fatality:	Not reported
Current Speed Unit:	Not reported
Road Closure Units:	Not reported
Track CLosure Units:	Not reported
Sheen Size Units:	Not reported
Additional Info:	THE CALLER WILL NOTIFY: QUALITY CONTROL BOARD
State Agency Notified:	Not reported
Federal Agency Notified:	Not reported
nearest River Mile Marker:	Not reported
Sheen Size Length:	Not reported
Sheen Size Length Units:	Not reported
Sheen Size Width:	Not reported
Sheen Size Width Units:	Not reported
Offshore:	N
Duration Unit:	Not reported
Release Rate Unit:	Not reported
Release Rate Rate:	Not reported
Passengers Transferred:	UNK

Calls:

NRC Report #:	778995
Site ID:	2005778995
Date Time Received:	2005-11-09 13:08:40
Date Time Complete:	2005-11-09 13:12:17
Call Type:	INC
Responsible Company:	Not reported
Responsible Org Type:	UNKNOWN
Responsible City:	Not reported
Responsible State:	XX
Responsible Zip:	Not reported
On Behalf:	N
Source:	TELEPHONE

Material Involved:

NRC Report #:	778995
Chris Code:	OHY
Case Number:	000000-00-0
UN Number:	Not reported
Amount of Material:	250
Unit of Measure:	LITER(S)
Name of Material:	HYDRAULIC OIL
If Reached Water:	YES
Amount in Water:	250
Unit of Measure Reach Water:	LITER(S)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A34
Target
Property

2004 EXPANSION
500 SEA WORLD DR
SAN DIEGO, CA 92109

CIWQS **S121614269**
N/A

Site 34 of 35 in cluster A

Actual:
19 ft.

CIWQS:
Name: 2004 EXPANSION
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Agency: Sea World San Diego
Agency Address: 500 Sea World Dr, San Diego, CA 92109
Place/Project Type: Construction - Commercial
SIC/NAICS: Not reported
Region: 9
Program: CONSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water construction
Order Number: 99-08DW
WDID: 9 37C319580
NPDES Number: CAS000002
Adoption Date: Not reported
Effective Date: 12/06/2002
Termination Date: 12/01/2005
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.762897
Longitude: -117.231191

A35
Target
Property

BIKE & PEDESTRIAN PATH
500 SEA WORLD DR
SAN DIEGO, CA 92109

CIWQS **S121623625**
N/A

Site 35 of 35 in cluster A

Actual:
19 ft.

CIWQS:
Name: BIKE & PEDESTRIAN PATH
Address: 500 SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Agency: SeaWorld San Diego
Agency Address: 500 Sea World Dr, San Diego, CA 92109
Place/Project Type: Construction
SIC/NAICS: Not reported
Region: 9
Program: CONSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water construction
Order Number: 99-08DW
WDID: 9 37C345326
NPDES Number: CAS000002
Adoption Date: Not reported
Effective Date: 01/18/2007
Termination Date: 06/30/2010
Expiration/Review Date: Not reported
Design Flow: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BIKE & PEDESTRIAN PATH (Continued)

S121623625

Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: Not reported
Longitude: Not reported

36

CHMIRS S100279085
N/A

< 1/8
1 ft.

**SEA WORLD OFF RAMP
SAN DIEGO, CA**

Relative:
Lower
Actual:
17 ft.

CHMIRS:

Name: Not reported
Address: SEA WORLD OFF RAMP
City,State,Zip: SAN DIEGO, CA
OES Incident Number: 803649
OES notification: Not reported
OES Date: Not reported
OES Time: Not reported
Date Completed: 02-NOV-88
Property Use: 962
Agency Id Number: 37717
Agency Incident Number: 88-529
Time Notified: 830
Time Completed: 930
Surrounding Area: 500
Estimated Temperature: 75
Property Management: C
More Than Two Substances Involved?: N
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: MIKE VERNON
Report Date: 02-NOV-88
Facility Telephone: 619 236-2222
Waterway Involved: Not reported
Waterway: Not reported
Spill Site: Not reported
Cleanup By: Not reported
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Date/Time: Not reported
Year: 88-92
Agency: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S100279085

Incident Date: 02-NOV-88
Admin Agency: Not reported
Amount: Not reported
Contained: Not reported
Site Type: Not reported
E Date: Not reported
Substance: Not reported
Unknown: Not reported
Substance #2: Not reported
Substance #3: Not reported
Evacuations: Not reported
Number of Injuries: Not reported
Number of Fatalities: Not reported
#1 Pipeline: Not reported
#2 Pipeline: Not reported
#3 Pipeline: Not reported
#1 Vessel >= 300 Tons: Not reported
#2 Vessel >= 300 Tons: Not reported
#3 Vessel >= 300 Tons: Not reported
Evacs: Not reported
Injuries: Not reported
Fatafs: Not reported
Comments: N
Description: Not reported

B37 **HUBBS-SEA WORLD INSTITUTE, MISSION BAY**
2595 INGRAHAM STREET
< 1/8 **SAN DIEGO, CA 92109**
1 ft.

San Diego Co. HMMD
CERS HAZ WASTE
ENF
CERS

S104754332
N/A

Site 1 of 14 in cluster B

Relative:
Lower
Actual:
9 ft.

HMMD SAN DIEGO:
Name: HUBBS-SEA WORLD RESEARCH INST, INC
Address: 2595 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 134291
Business Type: 6HK67
EPA Id Number: CAL930283590
APN: 760-029-07-00
Last HMMD Inspection: 07/10/2012
Facility Telephone: 619-226-3870
Permit Status: OPEN
Permit Expiration: 12/31/2012
Date Last Updated: 11/02/2012
Facility Owner: HUBBS-SEA WORLD RESEARCH INST
Facility Mailing Address: 2595 INGRAHAM ST
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109-
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Y
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Permit Number: 134291
Update Date: 11/02/2012
Case Number: 124-38-9
Name: CARBON DIOXIDE GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported
Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Material Waste: Not reported
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN LIQUID
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CRYOGENIC

Permit Number: 134291
Update Date: 11/02/2012
Case Number: 7681-52-9
Name: SODIUM HYPOCHLORITE 12.5%
Other Information: LIQUID CHLORINE BLEACH
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: NITRATE REAGENT WASTE W/ CU
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: AIR COMPRESSOR OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 551 LABORATORY WASTE CHEMICALS
Other Information: LAB PACK
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 905 INFECTIOUS WASTE, LAB
Other Information: RED BAGS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 134291
Update Date: 11/02/2012
Inspection Date: 09/16/2003
Violation Code: 6HV0402
Violation: TRAINING PROGRAM NOT ADEQUATE
Violation Citation: Personnel training is not adequate to ensure compliance with hazardous waste regulations. CCR 66265.16(a)&(b)
Activity: ACTIVE

Permit Number: 134291
Update Date: 11/02/2012
Inspection Date: 10/01/2010
Violation Code: 6HV0221
Violation: DID NOT COMPLY W/SATELLITE REGS.
Violation Citation: Failed to comply with satellite regulations. 66262.34(e)
Activity: ACTIVE

Permit Number: 134291
Update Date: 11/02/2012
Inspection Date: 10/01/2010
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Activity: address, and phone number. 68.1205
ACTIVE

Name: HUBBS-SEA WORLD RESEARCH INST, INC
Address: 2595 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 134291
Business Type: 6HK67
EPA Id Number: CAL930283590
APN: 760-029-07-00
Last HMMD Inspection: 07/10/2012
Facility Telephone: 619-226-3870
Permit Status: OPEN
Permit Expiration: 12/31/2012
Date Last Updated: 11/02/2012
Facility Owner: HUBBS-SEA WORLD RESEARCH INST
Facility Mailing Address: 2595 INGRAHAM ST
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109-
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 134291
Update Date: 11/02/2012
Case Number: 124-38-9
Name: CARBON DIOXIDE GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported
Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Material Waste: Not reported
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 134291

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Update Date:	11/02/2012
Case Number:	7782-44-7
Name:	OXYGEN LIQUID
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	CRYOGENIC
Permit Number:	134291
Update Date:	11/02/2012
Case Number:	7681-52-9
Name:	SODIUM HYPOCHLORITE 12.5%
Other Information:	LIQUID CHLORINE BLEACH
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	ACUTE
Permit Number:	134291
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information:	NITRATE REAGENT WASTE W/ CU
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	134291
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	AIR COMPRESSOR OIL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	134291
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 551 LABORATORY WASTE CHEMICALS
Other Information:	LAB PACK
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	134291
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information:	Not reported
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	134291
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 905 INFECTIOUS WASTE, LAB

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Other Information: RED BAGS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 134291
Update Date: 11/02/2012
Inspection Date: 09/16/2003
Violation Code: 6HV0402
Violation: TRAINING PROGRAM NOT ADEQUATE
Violation Citation: Personnel training is not adequate to ensure compliance with hazardous waste regulations. CCR 66265.16(a)&(b)
Activity: ACTIVE

Permit Number: 134291
Update Date: 11/02/2012
Inspection Date: 10/01/2010
Violation Code: 6HV0221
Violation: DID NOT COMPLY W/SATELLITE REGS.
Violation Citation: Failed to comply with satellite regulations. 66262.34(e)
Activity: ACTIVE

Permit Number: 134291
Update Date: 11/02/2012
Inspection Date: 10/01/2010
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name, address, and phone number. 68.1205
Activity: ACTIVE

Name: HUBBS-SEA WORLD RESEARCH INST, INC
Address: 2595 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL930283590
APN: Not reported
Last HMMI Inspection: Not reported
Facility Telephone: 619-226-3870
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 04/04/2018
Facility Owner: Not reported
Facility Mailing Address: 2595 INGRAHAM ST, SAN DIEGO, CA 92109
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Waste and Materials:

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0143289
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-04-04T00:35:43.000
Chemical Name: Parasite - S
Common Name: Parasite - S
Case Number: Not reported

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0116787
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-12-07T02:34:01.000
Chemical Name: SODIUM HYPOCHLORITE 12.5%
Common Name: LIQUID CHLORINE BLEACH
Case Number: 7681-52-9

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0116788
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-12-07T02:34:01.000
Chemical Name: CARBON DIOXIDE GAS
Common Name: CARBON DIOXIDE GAS
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0116789
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-12-07T02:34:01.000
Chemical Name: OXYGEN LIQUID
Common Name: OXYGEN LIQUID
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0098104
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-12-07T02:34:01.000
Chemical Name: Lab Pack
Common Name: Waste Chemicals Lab Pack
Case Number: Not reported

Record ID: DEH2002-HUPFP-134291

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0098105
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-12-07T02:34:01.000
Chemical Name:	Cadmium Bromide and Silver Chloride
Common Name:	Waste liquids with metals
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-134291
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0098106
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-12-07T02:34:01.000
Chemical Name:	Ammonium Salicylate/Cyanurate and Bromocresol Green and Methyl Red
Common Name:	Waste Liquid without metals
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-134291
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0098107
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-12-07T02:34:01.000
Chemical Name:	WASTE 902 INFECTIOUS WASTE, SHARPS
Common Name:	Sharps
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-134291
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0143286
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-04-04T00:35:43.000
Chemical Name:	SODIUM HYPOCHLORITE 12.5%
Common Name:	LIQUID CHLORINE BLEACH 0.016%
Case Number:	7681-52-9
Record ID:	DEH2002-HUPFP-134291
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0143287
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-04-04T00:35:43.000
Chemical Name:	OXYGEN LIQUID
Common Name:	OXYGEN LIQUID
Case Number:	7782-44-7
Record ID:	DEH2002-HUPFP-134291
Permit Status:	Permit Renewed
Active Permit:	Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Child Record Id: DEH2017-HCHEM-0143288
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-04-04T00:35:43.000
Chemical Name: Thiosulfuric acid (H₂S₂O₃), sodium salt (1:2)
Common Name: Sodium Thiosulfate 0.13%
Case Number: 7772-98-7

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0122011
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-04T00:35:43.000
Chemical Name: Lab Pack
Common Name: Waste Chemicals Lab Pack
Case Number: Not reported

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0122012
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-04T00:35:43.000
Chemical Name: Cadmium Bromide and Silver Chloride
Common Name: Waste liquids with metals
Case Number: Not reported

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0122013
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-04T00:35:43.000
Chemical Name: Ammonium Salicylate/Cyanurate and Bromocresol Green and Methyl Red
Common Name: Waste Liquid without metals
Case Number: Not reported

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0122014
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-04T00:35:43.000
Chemical Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Common Name: Sharps
Case Number: Not reported

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0197169
Trade Secret: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Hazardous Material Type:	Mixture
Last Updated:	2018-12-06T02:31:52.000
Chemical Name:	SODIUM HYPOCHLORITE 12.5%
Common Name:	LIQUID CHLORINE BLEACH 0.016%
Case Number:	7681-52-9
Record ID:	DEH2002-HUPFP-134291
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0197170
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-12-06T02:31:52.000
Chemical Name:	OXYGEN LIQUID
Common Name:	OXYGEN LIQUID
Case Number:	7782-44-7
Record ID:	DEH2002-HUPFP-134291
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0197171
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-12-06T02:31:52.000
Chemical Name:	Thiosulfuric acid (H ₂ S ₂ O ₃), sodium salt (1:2)
Common Name:	Sodium Thiosulfate 0.13%
Case Number:	7772-98-7
Record ID:	DEH2002-HUPFP-134291
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0197172
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-12-06T02:31:52.000
Chemical Name:	Parasite - S
Common Name:	Parasite - S
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-134291
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0169844
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-12-06T02:31:52.000
Chemical Name:	Lab Pack
Common Name:	Waste Chemicals Lab Pack
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-134291
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0169845
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-12-06T02:31:52.000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Chemical Name: Cadmium Bromide and Silver Chloride
Common Name: Waste liquids with metals
Case Number: Not reported

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169846
Trade Secret: N
Hazardous Material Type: Not reported

Last Updated: 2018-12-06T02:31:52.000
Chemical Name: Ammonium Salicylate/Cyanurate and Bromocresol Green and Methyl Red
Common Name: Waste Liquid without metals
Case Number: Not reported

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169847
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-12-06T02:31:52.000
Chemical Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Common Name: Sharps
Case Number: Not reported

Record ID: DEH2002-HUPFP-134291
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169848
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-12-06T02:31:52.000
Chemical Name: UN 3291 Regulated Medical Waste
Common Name: Red Bag Waste
Case Number: Not reported

Name: HUBBS-SEA WORLD RESEARCH INST, INC
Address: 2595 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 134291
Business Type: 6HK67
EPA Id Number: CAL930283590
APN: 760-029-07-00
Last HMMD Inspection: 07/10/2012
Facility Telephone: 619-226-3870
Permit Status: OPEN
Permit Expiration: 12/31/2012
Date Last Updated: 11/02/2012
Facility Owner: HUBBS-SEA WORLD RESEARCH INST
Facility Mailing Address: 2595 INGRAHAM ST
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109-
UST Owner: Not reported
Handle Regulated Hazmat: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Y
Generate Medical Waste: Y

Inventory Active Permits (not SQG Medical):

Permit Number: 134291
Update Date: 11/02/2012
Case Number: 124-38-9
Name: CARBON DIOXIDE GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported
Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Material Waste: Not reported
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN LIQUID
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CRYOGENIC

Permit Number: 134291
Update Date: 11/02/2012
Case Number: 7681-52-9
Name: SODIUM HYPOCHLORITE 12.5%
Other Information: LIQUID CHLORINE BLEACH
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: NITRATE REAGENT WASTE W/ CU
Material Waste: Waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: AIR COMPRESSOR OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 551 LABORATORY WASTE CHEMICALS
Other Information: LAB PACK
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 134291
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 905 INFECTIOUS WASTE, LAB
Other Information: RED BAGS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 134291
Update Date: 11/02/2012
Inspection Date: 09/16/2003
Violation Code: 6HV0402
Violation: TRAINING PROGRAM NOT ADEQUATE
Violation Citation: Personnel training is not adequate to ensure compliance with hazardous waste regulations. CCR 66265.16(a)&(b)
Activity: ACTIVE

Permit Number: 134291
Update Date: 11/02/2012
Inspection Date: 10/01/2010
Violation Code: 6HV0221
Violation: DID NOT COMPLY W/SATELLITE REGS.
Violation Citation: Failed to comply with satellite regulations. 66262.34(e)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Permit Number: 134291
Update Date: 11/02/2012
Inspection Date: 10/01/2010
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name,
address, and phone number. 68.1205
Activity: ACTIVE

CERS HAZ WASTE:

Name: HUBBS-SEA WORLD RESEARCH INST, INC
Address: 2595 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 123432
CERS ID: 10383370
CERS Description: Hazardous Waste Generator

ENF:

Name: HUBBS-SEA WORLD INSTITUTE, MISSION BAY
Address: 2595 INGRAHAM STREET
City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 230781
Agency Name: Not reported
Place Type: Growing
Place Subtype: Aquaculture/Hatchery
Facility Type: All other facilities
Agency Type: Not reported
Of Agencies: Not reported
Place Latitude: 32.767744
Place Longitude: -117.23354
SIC Code 1: Not reported
SIC Desc 1: Not reported
SIC Code 2: Not reported
SIC Desc 2: Not reported
SIC Code 3: Not reported
SIC Desc 3: Not reported
NAICS Code 1: Not reported
NAICS Desc 1: Not reported
NAICS Code 2: Not reported
NAICS Desc 2: Not reported
NAICS Code 3: Not reported
NAICS Desc 3: Not reported
Of Places: 1
Source Of Facility: Enf Action
Design Flow: Not reported
Threat To Water Quality: Not reported
Complexity: Not reported
Pretreatment: Not reported
Facility Waste Type: Not reported
Facility Waste Type 2: Not reported
Facility Waste Type 3: Not reported
Facility Waste Type 4: Not reported
Program: Not reported
Program Category1: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Program Category2:	ANIMALWASTE
# Of Programs:	Not reported
WDID:	Not reported
Reg Measure Id:	Not reported
Reg Measure Type:	Not reported
Region:	Not reported
Order #:	Not reported
Npdes# CA#:	Not reported
Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	Not reported
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Not reported
Status Date:	Not reported
Effective Date:	Not reported
Expiration/Review Date:	Not reported
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Not reported
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Not reported
Enforcement Id(EID):	234876
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	13267 Letter
Effective Date:	10/19/2000
Adoption/Issuance Date:	Not reported
Achieve Date:	2000-11-21
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000578
Description:	Aquaria questionnaire, 13267 letter.<CR>Evaluation for NPDES permit applicability.
Program:	ANIWSTOTH
Latest Milestone Completion Date:	2000-11-21
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	HUBBS-SEA WORLD INSTITUTE, MISSION BAY
Address:	2595 INGRAHAM STREET
City,State,Zip:	SAN DIEGO, CA 92109

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Region:	9
Facility Id:	230781
Agency Name:	Not reported
Place Type:	Growing
Place Subtype:	Aquaculture/Hatchery
Facility Type:	All other facilities
Agency Type:	Not reported
# Of Agencies:	Not reported
Place Latitude:	32.767744
Place Longitude:	-117.23354
SIC Code 1:	Not reported
SIC Desc 1:	Not reported
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Enf Action
Design Flow:	Not reported
Threat To Water Quality:	Not reported
Complexity:	Not reported
Pretreatment:	Not reported
Facility Waste Type:	Not reported
Facility Waste Type 2:	Not reported
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	Not reported
Program Category1:	Not reported
Program Category2:	ANIMALWASTE
# Of Programs:	Not reported
WDID:	Not reported
Reg Measure Id:	Not reported
Reg Measure Type:	Not reported
Region:	Not reported
Order #:	Not reported
Npdes# CA#:	Not reported
Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	Not reported
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Not reported
Status Date:	Not reported
Effective Date:	Not reported
Expiration/Review Date:	Not reported
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Not reported
Individual/General:	Not reported
Fee Code:	Not reported
Direction/Voice:	Not reported
Enforcement Id(EID):	249396
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	07/18/2002
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	07/18/2002
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000578
Description:	Asked in ackn, letter for April 02 and May 02 monthly reports that Hubbs submit the late Jan-Dec 01 annual report upon receipt of the letter.
Program:	ANIWSTOTH
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0

CERS:

Name:	HUBBS-SEA WORLD RESEARCH INST, INC
Address:	2595 INGRAHAM ST
City,State,Zip:	SAN DIEGO, CA 92109
Site ID:	123432
CERS ID:	10383370
CERS Description:	Chemical Storage Facilities

Evaluation:

Eval General Type:	Compliance Evaluation Inspection
Eval Date:	07-17-2018
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Denslow Vikki Inspection ID:5864769
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS

Eval General Type:	Compliance Evaluation Inspection
Eval Date:	07-17-2018
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Denslow Vikki Inspection ID:5864769
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-11-2015
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Preece Sharon Inspection ID:4146746
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-11-2015
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Preece Sharon Inspection ID:4146746
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Coordinates:
Site ID: 123432
Facility Name: HUBBS-SEA WORLD RESEARCH INST, INC
Env Int Type Code: HWG
Program ID: 10383370
Coord Name: Not reported
Ref Point Type Desc: Center of a facility or station.
Latitude: 32.767660
Longitude: -117.233490

Affiliation:
Affiliation Type Desc: Onsite Treatment Unit Owner Operator
Entity Name: Matt Anderson
Entity Title: Facilities and Safety Manager
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Operator
Entity Name: HUBBS-SEA WORLD RESEARCH INST
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 226-3870

Affiliation Type Desc: CUPA District
Entity Name: San Diego County Env Health
Entity Title: Not reported
Affiliation Address: PO Box 129261
Affiliation City: San Diego

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92112-9261
Affiliation Phone: (858) 505-6880

Affiliation Type Desc: Identification Signer
Entity Name: Chris Walters
Entity Title: FACILITIES AND SAFETY MANAGER
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Environmental Contact
Entity Name: Chris Walters
Entity Title: Not reported
Affiliation Address: 2595 INGRAHAM ST
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92109
Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 2595 INGRAHAM ST
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92109
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner
Entity Name: HUBBS-SEA WORLD RESEARCH INSTITUTE
Entity Title: Not reported
Affiliation Address: 2595 INGRAHAM ST
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92109
Affiliation Phone: (619) 226-3870

Affiliation Type Desc: Parent Corporation
Entity Name: HUBBS-SEA WORLD RESEARCH INST, INC
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Property Owner
Entity Name: Sea World

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S104754332

Entity Title: Not reported
Affiliation Address: 500 Sea World Drive
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92109
Affiliation Phone: (619) 226-3800

B38 **HUBBS-SEA WORLDNA MISSION BAY**
2595 INGRAHAM
< 1/8 **SAN DIEGO, CA 92109**
1 ft.
Site 2 of 14 in cluster B

FINDS **1023265499**
N/A

Relative:
Lower

FINDS:

Actual:
9 ft.

Registry ID: 110065550264
Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access
additional FINDS: detail in the EDR Site Report.

B39 **HUBBS-SEA WORLD INSTITUTE, MISSION BAY**
2595 INGRAHAM
< 1/8 **SAN DIEGO, CA 92109**
1 ft.
Site 3 of 14 in cluster B

CERS **S123514168**
N/A

Relative:
Lower

CERS:

Actual:
9 ft.

Name: HUBBS-SEA WORLD INSTITUTE, MISSION BAY
Address: 2595 INGRAHAM
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 37225
CERS ID: 230781
CERS Description: Animal Wastewater Discharge

Violations:

Site ID: 37225
Site Name: Hubbs-Sea World Institute, Mission Bay
Violation Date: 05-15-2002
Citation: California Water Code
Violation Description: Not reported
Violation Notes: January - December 2001 monitoring report not received.
Violation Division: Water Boards
Violation Program: ANIWSTOTH
Violation Source: CIWQS

Evaluation:

Eval General Type: Compliance Sampling Inspection
Eval Date: 07-07-2000
Violations Found: No
Eval Type: RWQCB Type A compliance inspection

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD INSTITUTE, MISSION BAY (Continued)

S123514168

Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: ANIWSTOTH
Eval Source: CIWQS

Eval General Type: Initial Site Inspection
Eval Date: 11-12-2009
Violations Found: No
Eval Type: Prerequisite inspection
Eval Notes: Not reported
Eval Division: Water Boards
Eval Program: ANIWSTOTH
Eval Source: CIWQS

Enforcement Action:

Site ID: 37225
Site Name: Hubbs-Sea World Institute, Mission Bay
Site Address: 2595 INGRAHAM
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 07-18-2002
Enf Action Type: Staff Enforcement Letter (Informal)
Enf Action Description: Staff Enforcement Letter (Informal)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: ANIWSTOTH
Enf Action Source: CIWQS

Site ID: 37225
Site Name: Hubbs-Sea World Institute, Mission Bay
Site Address: 2595 INGRAHAM
Site City: SAN DIEGO
Site Zip: 92109
Enf Action Date: 10-19-2000
Enf Action Type: Enforcement Letter (Formal)
Enf Action Description: Enforcement Letter Citing Violations and with Required Actions (Formal)
Enf Action Notes: Not reported
Enf Action Division: Water Boards
Enf Action Program: ANIWSTOTH
Enf Action Source: CIWQS

Affiliation:

Affiliation Type Desc: Regulating
Entity Name: San Diego Regional Water Quality Control Board
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

B40 **HUBBS-SEA WORLD RESEARCH INST.**
2595 INGRAHAM STREET
< 1/8 **SAN DIEGO, CA 92109**
1 ft.

FINDS **1024701690**
ECHO **N/A**

Site 4 of 14 in cluster B

Relative:
Lower

FINDS:

Actual:
9 ft.

Registry ID: 110070490084

Environmental Interest/Information System

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1024701690
Registry ID: 110070490084
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110070490084>

B41 **HUBBS-SEA WORLD MISSION BAY**
2595 INGRAHAM STREET
< 1/8 **SAN DIEGO, CA 92109**
1 ft.

WDS **S105558030**
N/A

Site 5 of 14 in cluster B

Relative:
Lower

WDS:

Actual:
9 ft.

Name: HUBBS-SEA WORLD MISSION BAY
Address: 2595 INGRAHAM STREET
City: SAN DIEGO
Facility ID: San Diego 000000578
Facility Type: Not reported
Facility Status: Active - Any facility with a continuous or seasonal discharge that is under Waste Discharge Requirements.
NPDES Number: Not reported
Subregion: 9
Facility Telephone: Not reported
Facility Contact: Not reported
Agency Name: HUBBS-SEA WORLD MISSION BAY
Agency Address: 2595 Ingraham Street
Agency City,St,Zip: San Diego 92109
Agency Contact: Donald B. Kent
Agency Telephone: Not reported
Agency Type: Private
SIC Code: 0
SIC Code 2: Not reported
Primary Waste Type: Not reported
Primary Waste: Not reported
Waste Type2: Not reported
Waste2: Not reported
Primary Waste Type: Not reported
Secondary Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD MISSION BAY (Continued)

S105558030

Secondary Waste Type: Not reported
Design Flow: 0
Baseline Flow: 0
Reclamation: Not reported
POTW: Not reported
Treat To Water: Minor Threat to Water Quality. A violation of a regional board order should cause a relatively minor impairment of beneficial uses compared to a major or minor threat. Not: All nurds without a TTWQ will be considered a minor threat to water quality unless coded at a higher Level. A Zero (0) may be used to code those NURDS that are found to represent no threat to water quality.

Complexity: Category B - Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or III disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities.

B42 **HUBBS-SEA WORLD RESEARCH INSTNA INC**
2595 INGRAHAM ST
SAN DIEGO, CA 92109

FINDS **1023365035**
N/A

< 1/8
1 ft.

Site 6 of 14 in cluster B

Relative:
Lower

FINDS:

Actual:
9 ft.

Registry ID: 110066625227

Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

B43 **HUBBS-SEA WORLD RESEARCH INST.**
2595 INGRAHAM STREET
SAN DIEGO, CA 92109

HAZNET **S113169055**
N/A

< 1/8
1 ft.

Site 7 of 14 in cluster B

Relative:
Lower

HAZNET:

Actual:
9 ft.

Name: HUBBS-SEA WORLD RESEARCH INST.
Address: 2595 INGRAHAM STREET
City,State,Zip: SAN DIEGO, CA 921090000
Year: 2017
GEPAID: CAL930283590
Contact: CHRIS WALTERS
Telephone: 6192263870
Mailing Name: Not reported
Mailing Address: 2595 INGRAHAM ST
Mailing City,St,Zip: SAN DIEGO, CA 921097902
Gen County: San Diego
TSD EPA ID: ARD981057870
TSD County: 99
Tons: 0.0465
CA Waste Code: 331-Off-specification, aged or surplus organics

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD RESEARCH INST. (Continued)

S113169055

Method: H061-Fuel Blending Prior To Energy Recovery At Another Site
Facility County: San Diego

Name: HUBBS-SEA WORLD RESEARCH INST.
Address: 2595 INGRAHAM STREET
City,State,Zip: SAN DIEGO, CA 921090000
Year: 2017
GEPAID: CAL930283590
Contact: CHRIS WALTERS
Telephone: 6192263870
Mailing Name: Not reported
Mailing Address: 2595 INGRAHAM ST
Mailing City,St,Zip: SAN DIEGO, CA 921097902
Gen County: San Diego
TSD EPA ID: ARD981057870
TSD County: 99
Tons: 0.0225
CA Waste Code: 352-Other organic solids
Method: H061-Fuel Blending Prior To Energy Recovery At Another Site
Facility County: San Diego

Name: HUBBS-SEA WORLD RESEARCH INST.
Address: 2595 INGRAHAM STREET
City,State,Zip: SAN DIEGO, CA 921090000
Year: 2017
GEPAID: CAL930283590
Contact: CHRIS WALTERS
Telephone: 6192263870
Mailing Name: Not reported
Mailing Address: 2595 INGRAHAM ST
Mailing City,St,Zip: SAN DIEGO, CA 921097902
Gen County: San Diego
TSD EPA ID: NVT330010000
TSD County: 99
Tons: 0.01668
CA Waste Code: 132-Aqueous solution with metals (< restricted levels and (Alkaline solution (pH >= 12.5) with metals))
Method: H132-Landfill Or Surface Impoundment That Will Be Closed As Landfill(
To Include On-Site Treatment And/Or Stabilization)
Facility County: San Diego

Name: HUBBS-SEA WORLD RESEARCH INST.
Address: 2595 INGRAHAM STREET
City,State,Zip: SAN DIEGO, CA 921090000
Year: 2017
GEPAID: CAL930283590
Contact: CHRIS WALTERS
Telephone: 6192263870
Mailing Name: Not reported
Mailing Address: 2595 INGRAHAM ST
Mailing City,St,Zip: SAN DIEGO, CA 921097902
Gen County: San Diego
TSD EPA ID: INR000127621
TSD County: 99
Tons: 0.0374
CA Waste Code: 343-Unspecified organic liquid mixture
Method: H061-Fuel Blending Prior To Energy Recovery At Another Site
Facility County: San Diego

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD RESEARCH INST. (Continued)

S113169055

Name: HUBBS-SEA WORLD RESEARCH INST.
Address: 2595 INGRAHAM STREET
City,State,Zip: SAN DIEGO, CA 921090000
Year: 2017
GEPAID: CAL930283590
Contact: CHRIS WALTERS
Telephone: 6192263870
Mailing Name: Not reported
Mailing Address: 2595 INGRAHAM ST
Mailing City,St,Zip: SAN DIEGO, CA 921097902
Gen County: San Diego
TSD EPA ID: INR000127621
TSD County: 99
Tons: 0.04587
CA Waste Code: 223-Unspecified oil-containing waste
Method: H061-Fuel Blending Prior To Energy Recovery At Another Site
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
36 additional CA_HAZNET: record(s) in the EDR Site Report.

B44

HUBBS-SEA WORLD RESEARCH INST.

RCRA NonGen / NLR

1024876177

2595 INGRAHAM STREET

CAL930283590

< 1/8

SAN DIEGO, CA 92109

1 ft.

Site 8 of 14 in cluster B

**Relative:
Lower**

RCRA NonGen / NLR:

**Actual:
9 ft.**

Date form received by agency: 01/28/1993
Facility name: HUBBS-SEA WORLD RESEARCH INST.
Facility address: 2595 INGRAHAM STREET
SAN DIEGO, CA 92109-0000
EPA ID: CAL930283590
Mailing address: 2595 INGRAHAM ST
SAN DIEGO, CA 92109-7902
Contact: CHRIS WALTERS
Contact address: 2595 INGRAHAM ST
SAN DIEGO, CA 92109
Contact country: Not reported
Contact telephone: 619-226-3870
Contact email: CWALTERS@HSWRI.ORG
EPA Region: 09
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:

Owner/operator name: CHRIS WALTERS
Owner/operator address: 2595 INGRAHAM ST
SAN DIEGO, CA 92109
Owner/operator country: Not reported
Owner/operator telephone: 619-226-3870
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Other
Owner/Operator Type: Operator
Owner/Op start date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HUBBS-SEA WORLD RESEARCH INST. (Continued)

1024876177

Owner/Op end date: Not reported

Owner/operator name: HUBBS-SEA WORLD RESEARCH INST
Owner/operator address: 2595 INGRAHAM ST
SAN DIEGO, CA 92109

Owner/operator country: Not reported
Owner/operator telephone: 619-226-3870
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Other
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: Yes
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

C45

**< 1/8
1 ft.**

**1660 S. SHORES ROAD
SAN DIEGO, CA 92110**

Site 1 of 52 in cluster C

**CHMIRS S109036610
N/A**

**Relative:
Lower**

**Actual:
15 ft.**

CHMIRS:
Name: Not reported
Address: 1660 S. SHORES ROAD
City, State, Zip: SAN DIEGO, CA 92110
OES Incident Number: 7-6359
OES notification: 10/18/2007
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S109036610

Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Not reported
Waterway: Mission Bay/Pacific Ocean
Spill Site: Not reported
Cleanup By: Unknown
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Date/Time: Not reported
Year: 2007
Agency: NRC
Incident Date: 10/18/2007 12:00:00 AM
Admin Agency: San Diego County Health Services Dept.
Amount: Not reported
Contained: Unknown
Site Type: Ship/Harbor/Port
E Date: Not reported
Substance: gasoline-automotive
Gallons: UNK
Unknown: 0
Substance #2: Not reported
Substance #3: Not reported
Evacuations: 0
Number of Injuries: 0
Number of Fatalities: 0
#1 Pipeline: Not reported
#2 Pipeline: Not reported
#3 Pipeline: Not reported
#1 Vessel >= 300 Tons: Not reported
#2 Vessel >= 300 Tons: Not reported
#3 Vessel >= 300 Tons: Not reported
Evacs: Not reported
Injuries: Not reported
FataIs: Not reported
Comments: Not reported
Description: per NRC fax: "Caller reported that a pleasure craft sank at the slip due to unknown causes."
Remedial Actions: Pads were placed on the water, owner is calling Seatow to remove the vessel from the water.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S109036610

Name:	Not reported
Address:	1660 S. SHORES ROAD
City,State,Zip:	SAN DIEGO, CA 92109
OES Incident Number:	12-3251
OES notification:	06/03/2012
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Ship/Harbor/Port
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	N/A
Other:	Not reported
Date/Time:	730
Year:	2012
Agency:	NRC
Incident Date:	6/3/2012
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	No
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Hydraulic Oil
Quantity Released:	4
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S109036610

Number of Fatalities: Not reported
#1 Pipeline: Not reported
#2 Pipeline: Not reported
#3 Pipeline: Not reported
#1 Vessel >= 300 Tons: Not reported
#2 Vessel >= 300 Tons: Not reported
#3 Vessel >= 300 Tons: Not reported
Evacs: Not reported
Injuries: Not reported
Fataals: Not reported
Comments: Not reported
Description: Quoting the NRC report: "CALLER IS REPORTING A DISCHARGE OF HYDRAULIC FLUID FROM THE OUT-DRIVE ON THE VESSEL DUE TO AN UNKNOWN CAUSE AT THIS TIME." "CALLER STATES BOOMS & ABSORBENTS WERE APPLIED AND THE MATERIAL WAS CONTAINED." Vessel Name: "Irish Jig." Vessel Type: Pleasure craft.

C46

ERNS 2016141695
N/A

< 1/8
1 ft.

1660 SOUTH SHORES RD
SAN DIEGO, CA

Site 2 of 52 in cluster C

Relative:
Lower

Actual:
15 ft.

Incident Commons:
NRC Report #: 1141695
Description of Incident: CALLER REPORTED A RELEASE OF DIESEL FROM A RESIDENTS VESSEL.
Type of Incident: VESSEL
Incident Cause: UNKNOWN
Incident Date Time: 2016-02-29 19:00:00
Incident DTG: OCCURRED
Incident Location: Not reported
Loaction Address: 1660 SOUTH SHORES RD
Location Street 1: Not reported
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: Not reported
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N

Incidents:
NRC Report #: 1141695
Aircraft Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2016141695

Aircraft Model:	Not reported
Aircraft ID:	Not reported
Aircraft Fuel Capacity:	Not reported
Aircraft Fuel Capacity Units:	Not reported
Aircraft Fuel on Board:	Not reported
Aircraft Fuel on Board Units:	Not reported
Aircraft Spot Number:	Not reported
Aircraft Hanger:	Not reported
Aircraft Runway Number:	Not reported
Road Mile Marker:	Not reported
Building ID:	Not reported
Type of Fixed Object:	Not reported
Power Generating Facility:	U
Generating Capacity:	Not reported
Type of Fuel:	Not reported
NPDES:	Not reported
NPDES Compliance:	U
Pipeline Type:	Not reported
DOT Regulated:	U
Pipeline Above Ground:	ABOVE
Exposed Underwater:	N
Pipeline Covered:	U
Railroad Hotline:	Not reported
Grade Crossing:	U
Location Subdivision:	Not reported
Railroad Milepost:	Not reported
Type Vehicle Involved:	Not reported
Crossing Device Type:	Not reported
Device Operational:	U
DOT Crossing Number:	Not reported
Brake Failure:	U
Description of Tank:	Not reported
Tank Above Ground:	ABOVE
Transportable Container:	U
Tank Regulated:	U
Tank Regulated By:	Not reported
Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSF Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	Not reported
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	U
Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2016141695

Airbag Deployed: U
Date Tiem Normal Service: Not reported
Service Disruption Time: Not reported
Service Disruption Units: Not reported
Transit Bus Flag: Not reported
CR Begin Date: Not reported
CR End Date: Not reported
CR Change Date: Not reported
FBI Contact: Not reported
FBI Contact Date Time: Not reported
Sub Part C Testing Req: XXX
Conductor Testing: Not reported
Engineer Testing: Not reported
Trainman Testing: Not reported
Yard Foreman Testing: Not reported
RCL Operator Testing: Not reported
Brakeman Testing: Not reported
Train Dispatcher Testing: Not reported
Signalman Testing: Not reported
Other Employee Testing: Not reported
Unknown Testing: Not reported
Passenger Handling: Not reported
Passenger Route: XXX
Passenger Delay: XXX

Incident Details:

NRC Report #: 1141695
Fire Involved: N
Fire Extinguished: U
Any Evacuations: N
Number Evacuated: Not reported
Who Evacuated: Not reported
Radius of Evacuation: Not reported
Any Injuries: N
Number Injured: Not reported
Number Hospitalized: Not reported
Any Fatalities: N
Number Fatalities: Not reported
Any Damages: N
Damage Amount: Not reported
Air Corridor Closed: N
Air Corridor Desc: Not reported
Air Closure Time: Not reported
Waterway Closed: N
Waterway Desc: Not reported
Waterway Closure Time: Not reported
Road Closed: N
Road Desc: Not reported
Road Closure Time: Not reported
Closure Direction: Not reported
Major Artery: N
Track Closed: N
Track Desc: Not reported
Track Closure Time: Not reported
Media Interest: UNKNOWN
Medium Desc: WATER
Additional Medium Info: MISSION BAY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2016141695

Body of Water:	MISSION BAY
Tributary of:	Not reported
Release Secured:	U
Estimated Duration of Release:	Not reported
Release rate:	Not reported
Desc Remedial Action:	ABSORBENTS APPLIED, CLEAN UP UNDERWAY
State Agency on Scene:	Not reported
State Agency Report Number:	Not reported
Other Agency Notified:	Not reported
Weather Conditions:	PARTLY CLOUDY
Air Temperature:	Not reported
Wind Speed:	Not reported
Wind Direction:	Not reported
Water Supply Contaminated:	U
Sheen Size:	Not reported
Sheen Color:	RAINBOW
Direction of Sheen Travel:	Not reported
Sheen Odor Description:	Not reported
Wave Condition:	Not reported
Current Speed:	Not reported
Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	Not reported
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported
Passenger Injuries:	Not reported
Occupant Fatality:	Not reported
Current Speed Unit:	Not reported
Road Closure Units:	Not reported
Track Closure Units:	Not reported
Sheen Size Units:	Not reported
Additional Info:	Not reported
State Agency Notified:	Not reported
Federal Agency Notified:	Not reported
nearest River Mile Marker:	Not reported
Sheen Size Length:	200
Sheen Size Length Units:	FEET
Sheen Size Width:	200
Sheen Size Width Units:	FEET
Offshore:	N
Duration Unit:	Not reported
Release Rate Unit:	Not reported
Release Rate Rate:	Not reported
Passengers Transferred:	NO

Calls:

NRC Report #:	1141695
Site ID:	20161141695
Date Time Received:	2016-02-29 22:08:42
Date Time Complete:	2016-02-29 22:13:58
Call Type:	INC
Responsible Company:	Not reported
Responsible Org Type:	UNKNOWN
Responsible City:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

20161141695

Responsible State: XX
Responsible Zip: Not reported
On Behalf: Not reported
Source: TELEPHONE

Vessels Detail:

Site ID: 20161141695
Vessel Name: UNKNOWN
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: Not reported
Hull Construction: Not reported
Fuel Capacity: Not reported
Fuel on Board: Not reported
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: N
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 1141695
Chris Code: OOD
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: OIL, FUEL: NO. 1-D
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

C47

< 1/8
1 ft.

1660 S. SHORES ROAD
SAN DIEGO, CA 92109

Site 3 of 52 in cluster C

Relative:
Lower

Actual:
15 ft.

Incident Commons:

NRC Report #: 1120359
Description of Incident: WHAT APPEARS TO BE OIL WAS OBSERVED IN A SLIP AT THE SEAWORLD MARINA, DUE TO UNKNOWN CAUSES. SUSPECTED SOURCE IS A 25' VESSEL ONSCENE.
Type of Incident: VESSEL
Incident Cause: UNKNOWN
Incident Date Time: 2015-06-19 20:35:00
Incident DTG: DISCOVERED
Incident Location: SLIP 213, SEAWORLD MARINA
Location Address: 1660 S. SHORES ROAD
Location Street 1: Not reported
Location Street 2: Not reported
Location Nearest City: SAN DIEGO

ERNS 2015120359
N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2015120359

Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N

Incidents:

NRC Report #: 1120359
Aircraft Type: Not reported
Aircraft Model: Not reported
Aircraft ID: Not reported
Aircraft Fuel Capacity: Not reported
Aircraft Fuel Capacity Units: Not reported
Aircraft Fuel on Board: Not reported
Aircraft Fuel on Board Units: Not reported
Aircraft Spot Number: Not reported
Aircraft Hanger: Not reported
Aircraft Runway Number: Not reported
Road Mile Marker: Not reported
Building ID: Not reported
Type of Fixed Object: Not reported
Power Generating Facility: U
Generating Capacity: Not reported
Type of Fuel: Not reported
NPDES: Not reported
NPDES Compliance: U
Pipeline Type: Not reported
DOT Regulated: U
Pipeline Above Ground: ABOVE
Exposed Underwater: N
Pipeline Covered: U
Railroad Hotline: Not reported
Grade Crossing: U
Location Subdivision: Not reported
Railroad Milepost: Not reported
Type Vehicle Involved: Not reported
Crossing Device Type: Not reported
Device Operational: U
DOT Crossing Number: Not reported
Brake Failure: U
Description of Tank: Not reported
Tank Above Ground: ABOVE
Transportable Container: U
Tank Regulated: U
Tank Regulated By: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2015120359

Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSF Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	213
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	U
Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U
Airbag Deployed:	U
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported
Unknown Testing:	Not reported
Passenger Handling:	Not reported
Passenger Route:	XXX
Passenger Delay:	XXX

Incident Details:

NRC Report #:	1120359
Fire Involved:	N
Fire Extinguished:	U
Any Evacuations:	N
Number Evacuated:	Not reported
Who Evacuated:	Not reported
Radius of Evacuation:	Not reported
Any Injuries:	N
Number Injured:	Not reported
Number Hospitalized:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2015120359

Any Fatalities:	N
Number Fatalities:	Not reported
Any Damages:	N
Damage Amount:	Not reported
Air Corridor Closed:	N
Air Corridor Desc:	Not reported
Air Closure Time:	Not reported
Waterway Closed:	N
Waterway Desc:	Not reported
Waterway Closure Time:	Not reported
Road Closed:	N
Road Desc:	Not reported
Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported
Media Interest:	UNKNOWN
Medium Desc:	WATER
Additional Medium Info:	/ SEAWORLD MARINA
Body of Water:	SEAWORLD MARINA
Tributary of:	Not reported
Release Secured:	U
Estimated Duration of Release:	Not reported
Release rate:	Not reported
Desc Remedial Action:	BOOM DEPLOYED.
State Agency on Scene:	Not reported
State Agency Report Number:	Not reported
Other Agency Notified:	Not reported
Weather Conditions:	CLEAR
Air Temperature:	Not reported
Wind Speed:	Not reported
Wind Direction:	Not reported
Water Supply Contaminated:	U
Sheen Size:	Not reported
Sheen Color:	RAINBOW
Direction of Sheen Travel:	Not reported
Sheen Odor Description:	Not reported
Wave Condition:	Not reported
Current Speed:	Not reported
Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	Not reported
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported
Passenger Injuries:	Not reported
Occupant Fatality:	Not reported
Current Speed Unit:	Not reported
Road Closure Units:	Not reported
Track CLOSure Units:	Not reported
Sheen Size Units:	Not reported
Additional Info:	Not reported
State Agency Notified:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2015120359

Federal Agency Notified: USCG
nearest River Mile Marker: Not reported
Sheen Size Length: 40
Sheen Size Length Units: FEET
Sheen Size Width: Not reported
Sheen Size Width Units: Not reported
Offshore: N
Duration Unit: Not reported
Release Rate Unit: Not reported
Release Rate Rate: Not reported
Passengers Transferred: NO

Calls:

NRC Report #: 1120359
Site ID: 20151120359
Date Time Received: 2015-06-19 23:49:17
Date Time Complete: 2015-06-19 23:59:26
Call Type: INC
Responsible Company: Not reported
Responsible Org Type: PRIVATE CITIZEN
Responsible City: Not reported
Responsible State: XX
Responsible Zip: Not reported
On Behalf: Not reported
Source: TELEPHONE

Vessels Detail:

Site ID: 20151120359
Vessel Name: HULL # SKP02744J586
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: Not reported
Hull Construction: Not reported
Fuel Capacity: Not reported
Fuel on Board: Not reported
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: N
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 1120359
Chris Code: OUN
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: UNKNOWN OIL
If Reached Water: YES
Amount in Water: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2015120359

Unit of Measure Reach Water: UNKNOWN AMOUNT

C48

SEA WORLD MARINA
1660 S SHORES RD
SAN DIEGO, CA

RGA LUST

S114684308
N/A

< 1/8
1 ft.

Site 4 of 52 in cluster C

Relative:
Lower

RGA LUST:

Actual:
15 ft.

Name:	SEA WORLD MARINA	
Address:	1660 S SHORES RD	
City:	SAN DIEGO	
State:	SAN DIEGO	
	2012 SEA WORLD MARINA	1660 S SHORES RD
Name:	SEA WORLD MARINA	
Address:	1660 S SHORES RD	
City:	SAN DIEGO	
State:	SAN DIEGO	
	2011 SEA WORLD MARINA	1660 S SHORES RD
Name:	SEA WORLD MARINA	
Address:	1660 S SHORES RD	
City:	SAN DIEGO	
State:	SAN DIEGO	
	2010 SEA WORLD MARINA	1660 S SHORES RD
Name:	SEA WORLD MARINA	
Address:	1660 S SHORES RD	
City:	SAN DIEGO	
State:	SAN DIEGO	
	2009 SEA WORLD MARINA	1660 S SHORES RD
Name:	SEA WORLD MARINA	
Address:	1660 S SHORES RD	
City:	SAN DIEGO	
State:	SAN DIEGO	
	2008 SEA WORLD MARINA	1660 S SHORES RD
Name:	SEA WORLD MARINA	
Address:	1660 S SHORES RD	
City:	SAN DIEGO	
State:	SAN DIEGO	
	2007 SEA WORLD MARINA	1660 S SHORES RD
Name:	SEA WORLD MARINA	
Address:	1660 S SHORES RD	
City:	SAN DIEGO	
State:	SAN DIEGO	
	2007 SEA WORLD MARINA	1660 S SHORES RD
Name:	SEA WORLD MARINA	
Address:	1660 S SHORES RD	
City:	SAN DIEGO	
State:	SAN DIEGO	
	2007 SEA WORLD MARINA	1660 S SHORES RD
Name:	SEA WORLD MARINA	
Address:	1660 S SHORES RD	
City:	SAN DIEGO	
State:	SAN DIEGO	
	2007 SEA WORLD MARINA	1660 S SHORES RD
Name:	SEA WORLD MARINA	
Address:	1660 S SHORES RD	
City:	SAN DIEGO	

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S114684308

State: SAN DIEGO
2006 SEA WORLD MARINA 1660 S SHORES RD
Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City: SAN DIEGO
State: SAN DIEGO
2005 SEA WORLD MARINA 1660 S SHORES RD
Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City: SAN DIEGO
State: SAN DIEGO
2004 SEA WORLD MARINA 1660 S SHORES RD
Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City: SAN DIEGO
State: SAN DIEGO
2003 SEA WORLD MARINA 1660 S SHORES RD

C49

1660 S. SHORES ROAD
SAN DIEGO, CA 92109

ERNS 2018233299
N/A

< 1/8
1 ft.

Site 5 of 52 in cluster C

Relative:
Lower
Actual:
15 ft.

Incident Commons:
NRC Report #: 1233299
Description of Incident: CALLER IS REPORTING THE DISCOVERY OF AN UNKNOWN SHEEN IN THE WATER AT THE INCIDENT LOCATION ON MISSION BAY.
Type of Incident: UNKNOWN SHEEN
Incident Cause: UNKNOWN
Incident Date Time: 2018-12-17 15:05:00
Incident DTG: DISCOVERED
Incident Location: UNKNOWN SHEEN INCIDENT//NEAR THE FLAG POLE
Location Address: 1660 S. SHORES ROAD
Location Street 1: MISSION BAY
Location Street 2: SLIP 400
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N
Incidents:
NRC Report #: 1233299

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2018233299

Aircraft Type:	Not reported
Aircraft Model:	Not reported
Aircraft ID:	Not reported
Aircraft Fuel Capacity:	Not reported
Aircraft Fuel Capacity Units:	Not reported
Aircraft Fuel on Board:	Not reported
Aircraft Fuel on Board Units:	Not reported
Aircraft Spot Number:	Not reported
Aircraft Hanger:	Not reported
Aircraft Runway Number:	Not reported
Road Mile Marker:	Not reported
Building ID:	Not reported
Type of Fixed Object:	Not reported
Power Generating Facility:	U
Generating Capacity:	Not reported
Type of Fuel:	Not reported
NPDES:	Not reported
NPDES Compliance:	U
Pipeline Type:	Not reported
DOT Regulated:	U
Pipeline Above Ground:	ABOVE
Exposed Underwater:	N
Pipeline Covered:	U
Railroad Hotline:	Not reported
Grade Crossing:	U
Location Subdivision:	Not reported
Railroad Milepost:	Not reported
Type Vehicle Involved:	Not reported
Crossing Device Type:	Not reported
Device Operational:	U
DOT Crossing Number:	Not reported
Brake Failure:	U
Description of Tank:	Not reported
Tank Above Ground:	ABOVE
Transportable Container:	U
Tank Regulated:	U
Tank Regulated By:	Not reported
Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSP Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	400
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	U
Type of Structure:	Not reported
Structure Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2018233299

Structure Operational:	U
Airbag Deployed:	U
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported
Unknown Testing:	Not reported
Passenger Handling:	Not reported
Passenger Route:	XXX
Passenger Delay:	XXX

Incident Details:

NRC Report #:	1233299
Fire Involved:	N
Fire Extinguished:	U
Any Evacuations:	N
Number Evacuated:	Not reported
Who Evacuated:	Not reported
Radius of Evacuation:	Not reported
Any Injuries:	N
Number Injured:	Not reported
Number Hospitalized:	Not reported
Any Fatalities:	N
Number Fatalities:	Not reported
Any Damages:	N
Damage Amount:	Not reported
Air Corridor Closed:	N
Air Corridor Desc:	Not reported
Air Closure Time:	Not reported
Waterway Closed:	N
Waterway Desc:	Not reported
Waterway Closure Time:	Not reported
Road Closed:	N
Road Desc:	Not reported
Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported
Media Interest:	UNKNOWN
Medium Desc:	WATER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2018233299

Additional Medium Info:	MISSION BAY
Body of Water:	MISSION BAY
Tributary of:	Not reported
Release Secured:	U
Estimated Duration of Release:	Not reported
Release rate:	Not reported
Desc Remedial Action:	Not reported
State Agency on Scene:	Not reported
State Agency Report Number:	Not reported
Other Agency Notified:	Not reported
Weather Conditions:	Not reported
Air Temperature:	Not reported
Wind Speed:	Not reported
Wind Direction:	Not reported
Water Supply Contaminated:	U
Sheen Size:	Not reported
Sheen Color:	RAINBOW
Direction of Sheen Travel:	Not reported
Sheen Odor Description:	Not reported
Wave Condition:	Not reported
Current Speed:	Not reported
Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	Not reported
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported
Passenger Injuries:	Not reported
Occupant Fatality:	Not reported
Current Speed Unit:	Not reported
Road Closure Units:	Not reported
Track CLosure Units:	Not reported
Sheen Size Units:	Not reported
Additional Info:	Not reported
State Agency Notified:	Not reported
Federal Agency Notified:	USCG SECTOR SAN DIEGO
nearest River Mile Marker:	Not reported
Sheen Size Length:	Not reported
Sheen Size Length Units:	Not reported
Sheen Size Width:	Not reported
Sheen Size Width Units:	Not reported
Offshore:	N
Duration Unit:	Not reported
Release Rate Unit:	Not reported
Release Rate Rate:	Not reported
Passengers Transferred:	NO

Calls:

NRC Report #:	1233299
Site ID:	20181233299
Date Time Received:	2018-12-17 18:16:15
Date Time Complete:	2018-12-17 18:20:00
Call Type:	INC
Responsible Company:	Not reported
Responsible Org Type:	UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2018233299

Responsible City: Not reported
Responsible State: XX
Responsible Zip: Not reported
On Behalf: Not reported
Source: TELEPHONE

Material Involved:
NRC Report #: 1233299
Chris Code: OUN
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: UNKNOWN OIL
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

C50

< 1/8
1 ft.

1660 S. SHORES ROAD
SAN DIEGO, CA 92109

Site 6 of 52 in cluster C

ERNS 2012013442
N/A

Relative:
Lower

Actual:
15 ft.

Incident Commons:
NRC Report #: 1013442
Description of Incident: CALLER IS REPORTING A DISCHARGE OF HYDRAULIC FLUID FROM THE OUT-DRIVE ON THE VESSEL DUE TO AN UNKNOWN CAUSE AT THIS TIME.
Type of Incident: VESSEL
Incident Cause: UNKNOWN
Incident Date Time: 2012-06-03 07:30:00
Incident DTG: DISCOVERED
Incident Location: SLIP 210
Loaction Address: 1660 S. SHORES ROAD
Location Street 1: Not reported
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2012013442

Incidents:

NRC Report #:	1013442
Aircraft Type:	Not reported
Aircraft Model:	Not reported
Aircraft ID:	Not reported
Aircraft Fuel Capacity:	Not reported
Aircraft Fuel Capacity Units:	Not reported
Aircraft Fuel on Board:	Not reported
Aircraft Fuel on Board Units:	Not reported
Aircraft Spot Number:	Not reported
Aircraft Hanger:	Not reported
Aircraft Runway Number:	Not reported
Road Mile Marker:	Not reported
Building ID:	Not reported
Type of Fixed Object:	Not reported
Power Generating Facility:	U
Generating Capacity:	Not reported
Type of Fuel:	Not reported
NPDES:	Not reported
NPDES Compliance:	U
Pipeline Type:	Not reported
DOT Regulated:	U
Pipeline Above Ground:	ABOVE
Exposed Underwater:	N
Pipeline Covered:	U
Railroad Hotline:	Not reported
Grade Crossing:	U
Location Subdivision:	Not reported
Railroad Milepost:	Not reported
Type Vehicle Involved:	Not reported
Crossing Device Type:	Not reported
Device Operational:	U
DOT Crossing Number:	Not reported
Brake Failure:	U
Description of Tank:	Not reported
Tank Above Ground:	ABOVE
Transportable Container:	U
Tank Regulated:	U
Tank Regulated By:	Not reported
Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSF Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	210
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2012013442

Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U
Airbag Deployed:	U
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported
Unknown Testing:	Not reported
Passenger Handling:	Not reported
Passenger Route:	XXX
Passenger Delay:	XXX

Incident Details:

NRC Report #:	1013442
Fire Involved:	N
Fire Extinguished:	U
Any Evacuations:	N
Number Evacuated:	Not reported
Who Evacuated:	Not reported
Radius of Evacuation:	Not reported
Any Injuries:	N
Number Injured:	Not reported
Number Hospitalized:	Not reported
Any Fatalities:	N
Number Fatalities:	Not reported
Any Damages:	N
Damage Amount:	Not reported
Air Corridor Closed:	N
Air Corridor Desc:	Not reported
Air Closure Time:	Not reported
Waterway Closed:	N
Waterway Desc:	Not reported
Waterway Closure Time:	Not reported
Road Closed:	N
Road Desc:	Not reported
Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2012013442

Media Interest: NONE
Medium Desc: WATER
Additional Medium Info: MISSION BAY
Body of Water: MISSION BAY
Tributary of: Not reported
Release Secured: N
Estimated Duration of Release: Not reported
Release rate: Not reported
Desc Remedial Action: CALLER STATES BOOMS & ABSORBENTS WERE APPLIED AND THE MATERIAL WAS CONTAINED.
State Agency on Scene: Not reported
State Agency Report Number: NO REPORT #
Other Agency Notified: Not reported
Weather Conditions: CLEAR
Air Temperature: 69
Wind Speed: Not reported
Wind Direction: Not reported
Water Supply Contaminated: U
Sheen Size: Not reported
Sheen Color: RAINBOW
Direction of Sheen Travel: Not reported
Sheen Odor Description: Not reported
Wave Condition: Not reported
Current Speed: Not reported
Current Direction: Not reported
Water Temperature: Not reported
Track Close Dir: Not reported
Empl Fatality: Not reported
Pass Fatality: Not reported
Community Impact: Not reported
Wind Speed Unit: Not reported
Employee Injuries: Not reported
Passenger Injuries: Not reported
Occupant Fatality: Not reported
Current Speed Unit: Not reported
Road Closure Units: Not reported
Track CLosure Units: Not reported
Sheen Size Units: Not reported
Additional Info: CALLER STATES THE SHEEN SIZE COVERS THE WHOLE BASIN.
State Agency Notified: NONE
Federal Agency Notified: USCG
nearest River Mile Marker: Not reported
Sheen Size Length: Not reported
Sheen Size Length Units: Not reported
Sheen Size Width: Not reported
Sheen Size Width Units: Not reported
Offshore: N
Duration Unit: Not reported
Release Rate Unit: Not reported
Release Rate Rate: Not reported
Passengers Transferred: NO

Calls:

NRC Report #: 1013442
Site ID: 20121013442
Date Time Received: 2012-06-03 13:05:40
Date Time Complete: 2012-06-03 13:10:44

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2012013442

Call Type: INC
Responsible Company: Not reported
Responsible Org Type: PRIVATE CITIZEN
Responsible City: ESCONDIDO
Responsible State: CA
Responsible Zip: 92029
On Behalf: Not reported
Source: TELEPHONE

Vessels Detail:

Site ID: 2012013442
Vessel Name: IRISH JIG
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: Not reported
Hull Construction: Not reported
Fuel Capacity: 0
Fuel on Board: 0
Cargo Capacity: 0
Cargo on Board: 0
Is Vessel Aground: N
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: UNKNOWN AMOUNT
Fuel on Board Units: UNKNOWN AMOUNT
Cargo Capacity Units: UNKNOWN AMOUNT
Cargo on Board Units: UNKNOWN AMOUNT

Material Involved:

NRC Report #: 1013442
Chris Code: OHY
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 4
Unit of Measure: TEASPOON(S)
Name of Material: HYDRAULIC OIL
If Reached Water: YES
Amount in Water: 4
Unit of Measure Reach Water: TEASPOON(S)

C51

< 1/8
1 ft.

1660 S. SHORES ROAD
SAN DIEGO, CA 92109

Site 7 of 52 in cluster C

Relative:
Lower
Actual:
15 ft.

Incident Commons:
NRC Report #: 1158560
Description of Incident: CALLER IS REPORTING A RELEASE OF MOTOR OIL FROM A VESSEL FOR UNKNOWN REASONS INTO MISSION BAY.
Type of Incident: VESSEL
Incident Cause: UNKNOWN
Incident Date Time: 2016-09-09 06:50:00
Incident DTG: DISCOVERED
Incident Location: Not reported

ERNS 2016158560
N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2016158560

Location Address: 1660 S. SHORES ROAD
Location Street 1: SLIP 406
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N

Incidents:

NRC Report #: 1158560
Aircraft Type: Not reported
Aircraft Model: Not reported
Aircraft ID: Not reported
Aircraft Fuel Capacity: Not reported
Aircraft Fuel Capacity Units: Not reported
Aircraft Fuel on Board: Not reported
Aircraft Fuel on Board Units: Not reported
Aircraft Spot Number: Not reported
Aircraft Hanger: Not reported
Aircraft Runway Number: Not reported
Road Mile Marker: Not reported
Building ID: Not reported
Type of Fixed Object: Not reported
Power Generating Facility: U
Generating Capacity: Not reported
Type of Fuel: Not reported
NPDES: Not reported
NPDES Compliance: U
Pipeline Type: Not reported
DOT Regulated: U
Pipeline Above Ground: ABOVE
Exposed Underwater: N
Pipeline Covered: U
Railroad Hotline: Not reported
Grade Crossing: U
Location Subdivision: Not reported
Railroad Milepost: Not reported
Type Vehicle Involved: Not reported
Crossing Device Type: Not reported
Device Operational: U
DOT Crossing Number: Not reported
Brake Failure: U
Description of Tank: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2016158560

Tank Above Ground:	ABOVE
Transportable Container:	U
Tank Regulated:	U
Tank Regulated By:	Not reported
Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSF Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	406
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	U
Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U
Airbag Deployed:	U
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported
Unknown Testing:	Not reported
Passenger Handling:	Not reported
Passenger Route:	XXX
Passenger Delay:	XXX

Incident Details:

NRC Report #:	1158560
Fire Involved:	N
Fire Extinguished:	U
Any Evacuations:	N
Number Evacuated:	Not reported
Who Evacuated:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2016158560

Radius of Evacuation:	Not reported
Any Injuries:	N
Number Injured:	Not reported
Number Hospitalized:	Not reported
Any Fatalities:	N
Number Fatalities:	Not reported
Any Damages:	N
Damage Amount:	Not reported
Air Corridor Closed:	N
Air Corridor Desc:	Not reported
Air Closure Time:	Not reported
Waterway Closed:	N
Waterway Desc:	Not reported
Waterway Closure Time:	Not reported
Road Closed:	N
Road Desc:	Not reported
Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported
Media Interest:	NONE
Medium Desc:	WATER
Additional Medium Info:	MISSION BAY
Body of Water:	MISSION BAY
Tributary of:	SAN DIEGO BAY
Release Secured:	U
Estimated Duration of Release:	Not reported
Release rate:	Not reported
Desc Remedial Action:	NOTIFICATIONS. SORBENT BOOM AND PADS APPLIED.
State Agency on Scene:	Not reported
State Agency Report Number:	Not reported
Other Agency Notified:	Not reported
Weather Conditions:	SUNNY
Air Temperature:	67
Wind Speed:	Not reported
Wind Direction:	Not reported
Water Supply Contaminated:	U
Sheen Size:	Not reported
Sheen Color:	RAINBOW
Direction of Sheen Travel:	Not reported
Sheen Odor Description:	OIL
Wave Condition:	0 CALM
Current Speed:	Not reported
Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	Not reported
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported
Passenger Injuries:	Not reported
Occupant Fatality:	Not reported
Current Speed Unit:	Not reported
Road Closure Units:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2016158560

Track CLosure Units: Not reported
Sheen Size Units: Not reported
Additional Info: Not reported
State Agency Notified: Not reported
Federal Agency Notified: USCG
nearest River Mile Marker: Not reported
Sheen Size Length: 300
Sheen Size Length Units: YARDS
Sheen Size Width: 20
Sheen Size Width Units: FEET
Offshore: N
Duration Unit: Not reported
Release Rate Unit: Not reported
Release Rate Rate: Not reported
Passengers Transferred: NO

Calls:

NRC Report #: 1158560
Site ID: 20161158560
Date Time Received: 2016-09-09 10:28:20
Date Time Complete: 2016-09-09 10:39:08
Call Type: INC
Responsible Company: Not reported
Responsible Org Type: PRIVATE CITIZEN
Responsible City: SAN DIEGO
Responsible State: CA
Responsible Zip: Not reported
On Behalf: Not reported
Source: TELEPHONE

Vessels Detail:

Site ID: 20161158560
Vessel Name: FINOLOGOYIV
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: 33
Hull Construction: FIBERGLASS HULL
Fuel Capacity: Not reported
Fuel on Board: 0
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: N
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: UNKNOWN AMOUNT
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 1158560
Chris Code: OMT
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2016158560

Unit of Measure: UNKNOWN AMOUNT
Name of Material: OIL, MISC: MOTOR
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

C52 SEAWORLD
1720 S SHORES RD
< 1/8 SAN DIEGO, CA 92109
1 ft.

UST U004261878
N/A

Site 8 of 52 in cluster C

Relative: UST:
Lower Name: SEAWORLD
Actual: Address: 1720 S SHORES RD
15 ft. City,State,Zip: SAN DIEGO, CA 92109
Facility ID: 37-000-100905
Permitting Agency: San Diego County Department of Environmental Health
Latitude: 32.76482
Longitude: -117.23067

C53 1660 SOUTH SHORES ROAD
< 1/8 SAN DIEGO, CA
1 ft.

CHMIRS S118737787
N/A

Site 9 of 52 in cluster C

Relative: CHMIRS:
Lower Name: Not reported
Actual: Address: 1660 SOUTH SHORES ROAD
15 ft. City,State,Zip: SAN DIEGO, CA
OES Incident Number: 16-1273
OES notification: 02/29/2016
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S118737787

CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Waterways
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	N/A
Other:	Not reported
Date/Time:	1900
Year:	2016
Agency:	NRC
Incident Date:	02/29/2016
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Yes
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Oil, Fuel, 1-D
Quantity Released:	Unknown
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	Per NRC #1141695,"Caller reported a release of diesel from a residents vessel." SHEEN COLOR: Rainbow SHEEN LENGTH: 200' SHEEN WIDTH: 200' BODY OF WATER: Mission Bay REMEDIAL ACTION: Absorbents applied. Cleanup underway.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C54

< 1/8
1 ft.

1660 SOUTH SHORES ROAD
SAN DIEGO, CA

Site 10 of 52 in cluster C

CHMIRS

S123295632
N/A

Relative:
Lower

Actual:
15 ft.

CHMIRS:

Name:	Not reported
Address:	1660 SOUTH SHORES ROAD
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	18-2341
OES notification:	04/10/2018
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Waterways
Cleanup By:	Marina Personnel
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Sheen
Other:	Not reported
Date/Time:	1200
Year:	2018
Agency:	NRC
Incident Date:	04/08/2018
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Yes
Site Type:	Mission Bay

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S123295632

E Date:	Not reported
Substance:	Hydraulic Oil
Quantity Released:	2X2
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	Yes
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	Per NRC Report: "CALLER STATED THERE WAS A SPILL OF HYDRAULIC OIL FROM A VESSEL DUE TO A BAD/FAULTY SEAL ON THE VESSEL." Remedial Actions: "CALLER STATED THE MARINA PERSONNEL BOOMED OFF THE VESSEL AND PLACED ABSORBANT PADS ON THE SPILL FOR CLEAN UP." Per Reporting Party: 21ft boat, hydraulic fluid dripping from outboard motor, sheen size 2x2 ft.

C55

< 1/8
1 ft.

1660 S. SHORES ROAD
SAN DIEGO, CA 92109

Site 11 of 52 in cluster C

ERNS 2013057258
N/A

Relative:
Lower

Actual:
15 ft.

Incident Commons:	
NRC Report #:	1057258
Description of Incident:	CALLER IS REPORTING A RELEASE OF OIL FROM A BOAT AT THE MARINA, THE CAUSE IS UNKNOWN.
Type of Incident:	VESSEL
Incident Cause:	UNKNOWN
Incident Date Time:	2013-08-15 20:00:00
Incident DTG:	OCCURRED
Incident Location:	Not reported
Location Address:	1660 S. SHORES ROAD
Location Street 1:	Not reported
Location Street 2:	Not reported
Location Nearest City:	SAN DIEGO
Location State:	CA
Location County:	SAN DIEGO
Location Zip:	92109
Distance From City:	Not reported
Distance Units:	Not reported
Direction From City:	Not reported
Lat Deg:	Not reported
Lat Min:	Not reported
Lat Sec:	Not reported
Lat Quad:	Not reported
Long Deg:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013057258

Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N

Incidents:

NRC Report #: 1057258
Aircraft Type: Not reported
Aircraft Model: Not reported
Aircraft ID: Not reported
Aircraft Fuel Capacity: Not reported
Aircraft Fuel Capacity Units: Not reported
Aircraft Fuel on Board: Not reported
Aircraft Fuel on Board Units: Not reported
Aircraft Spot Number: Not reported
Aircraft Hanger: Not reported
Aircraft Runway Number: Not reported
Road Mile Marker: Not reported
Building ID: Not reported
Type of Fixed Object: Not reported
Power Generating Facility: U
Generating Capacity: Not reported
Type of Fuel: Not reported
NPDES: Not reported
NPDES Compliance: U
Pipeline Type: Not reported
DOT Regulated: U
Pipeline Above Ground: ABOVE
Exposed Underwater: N
Pipeline Covered: U
Railroad Hotline: Not reported
Grade Crossing: U
Location Subdivision: Not reported
Railroad Milepost: Not reported
Type Vehicle Involved: Not reported
Crossing Device Type: Not reported
Device Operational: U
DOT Crossing Number: Not reported
Brake Failure: U
Description of Tank: Not reported
Tank Above Ground: ABOVE
Transportable Container: U
Tank Regulated: U
Tank Regulated By: Not reported
Tank ID: Not reported
Capacity of Tank: Not reported
Capacity of Tank Units: Not reported
Actual Amount: Not reported
Actual Amount Units: Not reported
Platform Rig Name: Not reported
Platform Letter: Not reported
Location Area ID: Not reported
Location Block ID: Not reported
OCSG Number: Not reported
OCSP Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013057258

State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	142
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	N
Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U
Airbag Deployed:	U
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported
Unknown Testing:	Not reported
Passenger Handling:	Not reported
Passenger Route:	XXX
Passenger Delay:	XXX

Incident Details:

NRC Report #:	1057258
Fire Involved:	N
Fire Extinguished:	U
Any Evacuations:	N
Number Evacuated:	Not reported
Who Evacuated:	Not reported
Radius of Evacuation:	Not reported
Any Injuries:	N
Number Injured:	Not reported
Number Hospitalized:	Not reported
Any Fatalities:	N
Number Fatalities:	Not reported
Any Damages:	N
Damage Amount:	Not reported
Air Corridor Closed:	N
Air Corridor Desc:	Not reported
Air Closure Time:	Not reported
Waterway Closed:	N
Waterway Desc:	Not reported
Waterway Closure Time:	Not reported
Road Closed:	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013057258

Road Desc:	Not reported
Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported
Media Interest:	UNKNOWN
Medium Desc:	WATER
Additional Medium Info:	MISSION BAY
Body of Water:	MISSION BAY
Tributary of:	PACIFIC OCEAN
Release Secured:	Y
Estimated Duration of Release:	Not reported
Release rate:	Not reported
Desc Remedial Action:	BOOMS APPLIED
State Agency on Scene:	Not reported
State Agency Report Number:	Not reported
Other Agency Notified:	Not reported
Weather Conditions:	OVERCAST
Air Temperature:	72
Wind Speed:	Not reported
Wind Direction:	Not reported
Water Supply Contaminated:	U
Sheen Size:	Not reported
Sheen Color:	Not reported
Direction of Sheen Travel:	Not reported
Sheen Odor Description:	MOTOR OIL
Wave Condition:	Not reported
Current Speed:	Not reported
Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	Not reported
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported
Passenger Injuries:	Not reported
Occupant Fatality:	Not reported
Current Speed Unit:	Not reported
Road Closure Units:	Not reported
Track CLOSure Units:	Not reported
Sheen Size Units:	Not reported
Additional Info:	Not reported
State Agency Notified:	Not reported
Federal Agency Notified:	USCG
nearest River Mile Marker:	Not reported
Sheen Size Length:	3
Sheen Size Length Units:	FEET
Sheen Size Width:	Not reported
Sheen Size Width Units:	Not reported
Offshore:	N
Duration Unit:	Not reported
Release Rate Unit:	Not reported
Release Rate Rate:	Not reported
Passengers Transferred:	NO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013057258

Calls:

NRC Report #: 1057258
Site ID: 20131057258
Date Time Received: 2013-08-15 19:55:11
Date Time Complete: 2013-08-15 20:00:52
Call Type: INC
Responsible Company: Not reported
Responsible Org Type: UNKNOWN
Responsible City: Not reported
Responsible State: XX
Responsible Zip: Not reported
On Behalf: Not reported
Source: TELEPHONE

Vessels Detail:

Site ID: 20131057258
Vessel Name: N/A
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: 28
Hull Construction: FIBERGLASS HULL
Fuel Capacity: Not reported
Fuel on Board: Not reported
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: N
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 1057258
Chris Code: OMT
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: OIL, MISC: MOTOR
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C56

< 1/8
1 ft.

1720 SOUTH SHORES ROAD
SAN DIEGO, CA

CHMIRS

S109036684
N/A

Site 12 of 52 in cluster C

Relative:
Lower

Actual:
15 ft.

CHMIRS:

Name:	Not reported
Address:	1720 SOUTH SHORES ROAD
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	6-2320
OES notification:	04/17/2006
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Not reported
Waterway:	Mission Bay
Spill Site:	Not reported
Cleanup By:	Reporting Party
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Date/Time:	Not reported
Year:	2006
Agency:	Sea World Marina
Incident Date:	4/17/2006 12:00:00 AM
Admin Agency:	San Diego County Health Services Dept.
Amount:	Not reported
Contained:	Yes
Site Type:	Ship/Harbor/Port
E Date:	Not reported
Substance:	hydraulic fluid
Gallons:	0.000000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S109036684

Unknown: 0
Substance #2: Not reported
Substance #3: Not reported
Evacuations: 0
Number of Injuries: 0
Number of Fatalities: 0
#1 Pipeline: Not reported
#2 Pipeline: Not reported
#3 Pipeline: Not reported
#1 Vessel >= 300 Tons: Not reported
#2 Vessel >= 300 Tons: Not reported
#3 Vessel >= 300 Tons: Not reported
Evacs: Not reported
Injuries: Not reported
Fatals: Not reported
Comments: Not reported
Description: Released during maintenance on a vessel.

C57 SEA WORLD MARINA
1660 SHORES RD
< 1/8 SAN DIEGO, CA 92109
1 ft.

San Diego Co. HMMD S106061822
N/A

Site 13 of 52 in cluster C

Relative:
Lower
Actual:
15 ft.

HMMD SAN DIEGO:
Name: SEA WORLD MARINA
Address: 1660 SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 121142
Business Type: Not reported
EPA Id Number: Not reported
APN: 435-480-15-00
Last HMMD Inspection: 05/14/1990
Facility Telephone: 619-222-6363
Permit Status: INAC
Permit Expiration: Not reported
Date Last Updated: 11/02/2012
Facility Owner: SEA WORLD INC
Facility Mailing Address: 1660 S SHORES RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109-7903
UST Owner: SEA WORLD INC
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported
UST:
UST Name: UNDERGROUND TANK 121142 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121142
Tank Type: SINGLE WALL
Additional Id: #03
Capacity Gallons: 10000
UST Contents: REGULAR UNLEADED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S106061822

Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1991-01-15 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 121142 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 121142
Tank Type: SINGLE WALL
Additional Id: #04
Capacity Gallons: 10000
UST Contents: LEADED
Other Content Info: LEADED
Reg Status: REMOVED
Remove Close Date: 1991-01-15 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 121142 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 121142
Tank Type: SINGLE WALL
Additional Id: #05
Capacity Gallons: 10000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1991-01-15 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 121142 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 121142
Tank Type: SINGLE WALL
Additional Id: #06
Capacity Gallons: 10000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1991-01-15 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S106061822

Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

C58

**1660 S. SHORES RD.
SAN DIEGO, CA 92109**

**CHMIRS S123295585
N/A**

**< 1/8
1 ft.**

Site 14 of 52 in cluster C

**Relative:
Lower**

CHMIRS:

**Actual:
15 ft.**

Name: Not reported
Address: 1660 S. SHORES RD.
City,State,Zip: SAN DIEGO, CA 92109
OES Incident Number: 18-2290
OES notification: 04/07/2018
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: San Diego Bay
Spill Site: Waterways
Cleanup By: Unknown
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Type: PETROLEUM
Measure: N/A
Other: Not reported
Date/Time: 1430
Year: 2018

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S123295585

Agency: NRC
Incident Date: 04/07/2018
Admin Agency: San Diego County Health Services Department
Amount: Not reported
Contained: No
Site Type: San Diego Bay
E Date: Not reported
Substance: Gasoline
Quantity Released: 2 drops
Unknown: Not reported
Substance #2: Not reported
Substance #3: Not reported
Evacuations: Not reported
Number of Injuries: Not reported
Number of Fatalities: Not reported
#1 Pipeline: No
#2 Pipeline: No
#3 Pipeline: No
#1 Vessel >= 300 Tons: No
#2 Vessel >= 300 Tons: No
#3 Vessel >= 300 Tons: No
Evacs: No
Injuries: No
Fatalis: No
Comments: Not reported
Description: Per the NRC report: "Gasoline discharged from the motor on a dinghy due to an unknown cause at this time." Remedial Actions: Notified the tenant, plastic bag was placed on the leak and absorbents are being used in the water.

C59

SEAWORLD
1700 S SHORES RD
SAN DIEGO, CA 92109

San Diego Co. HMMD

S123406591
N/A

< 1/8
1 ft.

Site 15 of 52 in cluster C

Relative:
Lower

HMMD SAN DIEGO:

Actual:
15 ft.

Name: SEAWORLD
Address: 1700 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 100905
Business Type: 6HK62
EPA Id Number: CAD981687221
APN: 435-480-15-00
Last HMMD Inspection: 08/20/2012
Facility Telephone: 619-222-6363
Permit Status: OPEN
Permit Expiration: 05/31/2013
Date Last Updated: 11/02/2012
Facility Owner: SEAWORLD, INC. DBA SEAWORLD SAN DIEGO
Facility Mailing Address: 500 SEA WORLD DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109-7994
UST Owner: SEA WORLD INC
Handle Regulated Hazmat: Y
Own Or Operate UST: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 74-86-2
Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7440-44-0
Name: ACTIVATED CARBON 100%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 1333-84-2
Name: ALUMINUM OXIDE (NON FIBROUS)
Other Information: ACTIVATED ALUMINA
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 10043-01-3
Name: ALUMINUM SULFATE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 1300-72-7
Name: ANIONIC SURFACTANT 1-5%
Other Information: KEYSTONE LOW TEMP RINSE ADDITIVE
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7440-37-1
Name: ARGON GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: MIXTURE
Name: ASSORTED POLYURETHANES
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: MIXTURE
Name: ASSORTED URETHANES
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: AUTOMATIC TRANSMISSION FLUID
Other Information: DEXRON II AUTOMATIC TRANSMISSION FLUID
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: CALCIUM HYPOCHLORITE ACUTAB
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 124-38-9
Name: CARBON DIOXIDE, C02, 99%, COMPRESSED GAS :
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Material Waste: Not reported
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Update Date: 11/02/2012
Case Number: 16291-96-6
Name: CHARCOAL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 8006-61-9
Name: DIESEL - T007
Other Information: UNDERGROUND TANK 100905 T007
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL
Other Information: (4 TANKS)
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 111-90-0
Name: DIETHYLENE GLYCOL MONOETHYL ETHER
Other Information: FLOOR FINISH
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: ECOTEMP ULTRA DRY
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 64-17-5
Name: ETHANOL, FOODSERVICE JOY
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 107-21-1
Name: ETHYLENE GLYCOL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	111-76-2
Name:	ETHYLENE GLYCOL N-BUTYL ETHER
Other Information:	WAX ELIMINATOR
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	1309-37-1
Name:	FERTILIZER, TURF GOLD : IRON OXIDE 1% :
Other Information:	22-3-6 W/AMMUMIM SULFATE
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	306-83-2
Name:	FREON R-123
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7647-01-0
Name:	HYDROCHLORIC ACID
Other Information:	MURIATIC ACID
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	HYDROGEN PEROXIDE
Other Information:	CLEAN BY PEROXY
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	2809-21-4
Name:	HYDROXYETHYLIDINE DIPHOSPHONIC
Other Information:	ACID, TRIDENT 6026 (WATER TREATMENT)
Material Waste:	Material
Hazardous Categories 1:	ACUTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7439-89-6
Name: IRON, 95% GALVANIZED STEEL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: MIXTURE
Name: LATEX PAINT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7439-92-1
Name: LEAD
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7439-92-1
Name: LEAD/LEAD OXIDE/LEAD SULFATE, ASSORTED INDUSTRIAL BATTERIES
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7439-96-5
Name: MANGANESE, 13% STAINLESS STEEL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 101-68-8
Name: MDI
Other Information: SAFE DECK
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Update Date: 11/02/2012
Case Number: Not reported
Name: MISSION OVEN CLEANER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 25655-41-8
Name: MONO AMMONIUM PHOSPHATE, 95%,
Other Information: ABC DRY CHEM. FIRE EXTINGUISHER
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7440-02-0
Name: NICKEL, 99% NICKEL STEEL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 6484-52-2
Name: NITRA KING 19-4-4 (FERTILIZER-NURSERY-BONEYARD
Other Information: AMMONIA NITRATE)
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN, N2, 99%, COMPRESSED GAS :
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 9016-45-9
Name: NONYL PHENOL POLYETHYLENE GLYCOL ETHER FLUID QUARTERNA
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 26027-38-3
Name: NONYLPHENOXY POLYETHOXYETANOL 1-10%

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Other Information:	MEGUIAR'S W-DRESSING / DETAILER
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	OIL LUBRICATING KENDALL BLUE
Other Information:	KENDALL L-427 NLG1 2 BLUE
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	8002-05-9
Name:	OIL, LUBRICATING : MOTOR OIL HYDRAULIC OIL :
Other Information:	APSA CONTAINERS
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7782-44-7
Name:	OXYGEN, 02, 99%, COMPRESSED GAS :
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	PRESSURE RELEASE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	OZZYJUICE SW-3 TRUCK DEGREASINF SOLIN
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	PAINT-ASSORTED ENAMELS AND ACRYLICS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	PHOSPHORIC ACID 45% MI-BRITE
Other Information:	MI-BRITE
Material Waste:	Material
Hazardous Categories 1:	ACUTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: MIXTURE
Name: PIG DRI (ABSORBENT SPILL MATERIAL)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 57-55-6
Name: PROPYLENE GLYCOL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: PROPYLENE GLYCOL OLYMPIC WATERGUARD
Other Information: OLYMPIC WATERGUARD WOOD
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: PWC-1 BACTERIAL ADDITIVE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 65977-15-1
Name: RED-E-CRETE, CALCIUM SALT-PORTLAND CEMENT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Update Date:	11/02/2012
Case Number:	684-76-346
Name:	REGULAR UNLEADED
Other Information:	UNDERGROUND TANK 100905 T001
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	8006-61-9
Name:	REGULAR UNLEADED - T006
Other Information:	UNDERGROUND TANK 100905 T006 UNLEADED
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	14808-60-7
Name:	SILICA SAND (WATER FILTERS)
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	14808-60-7
Name:	SILICON DIOXIDE (SAND-NURSERY)
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	14808-60-7
Name:	SILICON SAND (AQUARIUM)
Other Information:	NATURAL FINE AND COARSE AGGREGATE
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	14808-60-7
Name:	SILICON SAND (MERCHANRISE)
Other Information:	PLAYSAND
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7704-34-9
Name:	SILPUR 90%

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Other Information:	SULPHUR FERTILIZER
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	144-55-8
Name:	SODIUM BICARBONATE, SODA ASH
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	497-19-8
Name:	SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7647-14-5
Name:	SODIUM CHLORIDE, NaCl, 98% : TABLE SALT
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	1310-73-2
Name:	SODIUM HYDROXIDE 30% ECOLAB DETERGENT
Other Information:	ECOTEMP ULTRA KLENE
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7681-52-9
Name:	SODIUM HYPOCHLORITE, NaOCl, 13% : LIQUID POOL CHLORINE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7681-52-9
Name:	SODIUM HYPOCHLORITE, NaOCl, 5% : LIQ. HOUSEHOLD BLEACH
Other Information:	RELIANCE DISINFECTANT BLEACH, CLOROX, GENERIC
Material Waste:	Material
Hazardous Categories 1:	ACUTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7757-83-7
Name:	SODIUM SULFITE, 25% SOLUTION
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	10102-17-7
Name:	SODIUM THIOSULFATE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	124-38-9
Name:	SOLID CARBON DIOXIDE (DRY ICE)
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	SPRAY NINE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	STERNO CANNED COOKING FUEL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	SULFUR COATED UREA/X COTE 42-0-0
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Update Date:	11/02/2012
Case Number:	7664-93-9
Name:	SULFURIC ACID, 36%, H2SO4
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	EXTREMELY HAZARDOUS
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	SURFACTANT
Other Information:	0-111 DETAILER SHAMPOO PLUS
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	SURFACTANT BUBBLE MASTER
Other Information:	BUBBLE MASTER 2000 PREMIUM FLUID
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information:	INORG SOLID, HYPOCHLORITES
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER)-
Other Information:	MERCURY CONTAINING DEVICES
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER) (2)
Other Information:	PAINT CHIPS & PAINT BOOTH FLTRS (352)(212)
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 212 OXYGENATED SOLVENTS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Other Information:	LACQUER THINNER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	ENGINE/LUBE OIL-COGEN PLT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 311 PHARMACEUTICAL WASTE
Other Information:	Not reported
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	AEROSOLS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	67-63-0
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	IPA
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	WASTE, GAS, DIESEL, LPG
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS*
Other Information:	NON-RCRA LIQUID FRAGRANCE
Material Waste:	Waste
Hazardous Categories 1:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information:	ETHYLENE GLYCOL WASTE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information:	OILY ABSORBENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information:	RAGS CONTAMINATED W/ SOLVENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)*
Other Information:	WASTE METHANOL ACETONE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER).
Other Information:	ABSORBENT W/ FORMALIN
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	74-98-6
Name:	WASTE 352 ORGANIC SOLIDS (OTHER).
Other Information:	WASTE, PROPANE (551)
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 461 PAINT SLUDGE
Other Information:	PAINT WASTE - PAINTS, THINNERS (141)
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 791 LIQUIDS WITH PH <OR= 2
Other Information:	HYDROCHLORIC ACID/WASTE CORROSIVES
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 888 USED OIL FILTERS
Other Information:	DRAINED OIL FILTERS/FUEL FILTERS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information:	RED BAG
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information:	SHARPS WASTE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 903 INF WST, TISSUE/ANAT. REMAINS
Other Information:	PATH
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 905 INFECTIOUS WASTE, LAB

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Other Information: MEDICAL WASTE, LABORATORY
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WETSUIT CLEANER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7429-90-5
Name: WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 1314-13-2
Name: ZINC OXIDE, 3%, SIMPLOT 6-20-20 (FET W/ZINC)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/26/2011
Violation Code: 6HV1018
Violation: INVENTORY INCOMPLETE/NOT AMENDED
Violation Citation: Inventory not amended for 100% increase of hazardous material onsite or inventory is incomplete. 25509, 25510
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

date and/or are improperly labeled. CCR 66262.34(a)(2);
66262.34(a)(3) & 66262.34(f)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV1006
Violation: HMBP: INVENTORY INADEQUATE
Violation Citation: Business Plan inventory does not list all hazardous materials on site in disclosable quantities. HSC 25504(a),25503.5

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV3160
Violation: UST SYSTEM REPAIRS NOT PROPERLY DONE
Violation Citation: UST system repair(s) not completed properly. 25292.1(c); 2660 (a)(k)(l)(m)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 09/30/2009
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Activity: waste as defined by law. CCR 66262.11 & 66260.200(c)
ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV4204
Violation: WARNING SIGN NOT POSTED
Violation Citation: MW designated accumulation area not posted with an approved and legible biohazardous waste "warning sign" in English and Spanish.
118310

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV4212
Violation: RED BAGS NOT CONTAINERIZED
Violation Citation: Did not containerize and place red bags in rigid, leak resistant, and covered containers or bins. 118280(b)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 11/30/2006
Violation Code: 6HV3264
Violation: SPILL CONT. NOT TESTED ANNUALLY
Violation Citation: Spill containment at fill point not tested annually. 25284.2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 11/30/2006
Violation Code: 6HV3264
Violation: SPILL CONT. NOT TESTED ANNUALLY
Violation Citation: Spill containment at fill point not tested annually. 25284.2
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 11/30/2006
Violation Code: 6HV3264
Violation: SPILL CONT. NOT TESTED ANNUALLY
Violation Citation: Spill containment at fill point not tested annually. 25284.2
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 09/28/2010
Violation Code: 6HV4351
Violation: LQG:MWMP NOT SUBMITTED TO HMD
Violation Citation: Medical Waste Management Plan has not been submitted to County HMD (Initial Submission/updates)(LQG). 117960, 117970
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 100905 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: DOUBLE WALL
Additional Id: RT2050
Capacity Gallons: 10000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1984-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 30A
UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ WET TANK ANNULAR; POSITIVE SHUT-OFF & FAILSAFE, 3.0LLD; UDC W/ POSITIVE SHUT-OFF

UST Name: UNDERGROUND TANK 100905 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: SINGLE WALL
Additional Id: #02
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1991-11-01 00:00:00
Year Installed: Not reported
Pipe Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Delivery System:	Not reported
Monitor Code:	05
UST Monitor Method:	SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALYSIS MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/H
UST Name:	UNDERGROUND TANK 100905 T003
Last Update:	2012-11-02 14:17:38
Permit Number:	100905
Tank Type:	SINGLE WALL
Additional Id:	#07
Capacity Gallons:	300
UST Contents:	Not reported
Other Content Info:	WASTE OIL
Reg Status:	REMOVED
Remove Close Date:	1989-07-12 00:00:00
Year Installed:	Not reported
Pipe Type:	Not reported
Delivery System:	Not reported
Monitor Code:	07
UST Monitor Method:	SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY
UST Name:	UNDERGROUND TANK 100905 T004
Last Update:	2012-11-02 14:17:38
Permit Number:	100905
Tank Type:	SINGLE WALL
Additional Id:	#08
Capacity Gallons:	150
UST Contents:	Not reported
Other Content Info:	WASTE OIL
Reg Status:	REMOVED
Remove Close Date:	1989-07-12 00:00:00
Year Installed:	Not reported
Pipe Type:	Not reported
Delivery System:	Not reported
Monitor Code:	07
UST Monitor Method:	SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY
UST Name:	UNDERGROUND TANK 100905 T005
Last Update:	2012-11-02 14:17:38
Permit Number:	100905
Tank Type:	UNKNOWN
Additional Id:	12
Capacity Gallons:	10000
UST Contents:	AVIATION FUEL
Other Content Info:	AVIATION FUEL
Reg Status:	REMOVED
Remove Close Date:	1990-01-29 00:00:00
Year Installed:	Not reported
Pipe Type:	Not reported
Delivery System:	Not reported
Monitor Code:	90
UST Monitor Method:	NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.
UST Name:	UNDERGROUND TANK 100905 T006

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: DOUBLE WALL
Additional Id: RT2050
Capacity Gallons: 1000
UST Contents: PREMIUM UNLEADED
Other Content Info: PREMIUM UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1990-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 61
UST Monitor Method: DW TANK W/DRY ANNULAR, DW PRESSURE PIPE; FAILSAFE & POS SHUTOFF, 3.0 LLD; SW ABOVE GROUND PIPE & UDC W/VISUAL MONIT

UST Name: UNDERGROUND TANK 100905 T007
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: DOUBLE WALL
Additional Id: RT2050
Capacity Gallons: 2000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 31A
UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ DRY TANK ANNULAR; POSITIVE SHUT-OFF & FAILSAFE, 3.0 LLD; UDC W/ POSITIVE SHUT-OFF

Name: SEAWORLD
Address: 1700 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 100905
Business Type: 6HK62
EPA Id Number: CAD981687221
APN: 435-480-15-00
Last HMMD Inspection: 08/20/2012
Facility Telephone: 619-222-6363
Permit Status: OPEN
Permit Expiration: 05/31/2013
Date Last Updated: 11/02/2012
Facility Owner: SEAWORLD, INC. DBA SEAWORLD SAN DIEGO
Facility Mailing Address: 500 SEA WORLD DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109-7994
UST Owner: SEA WORLD INC
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 100905

Update Date: 11/02/2012

Case Number: 74-86-2

Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :

Other Information: Not reported

Material Waste: Material

Hazardous Categories 1: FIRE

Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100905

Update Date: 11/02/2012

Case Number: 7440-44-0

Name: ACTIVATED CARBON 100%

Other Information: Not reported

Material Waste: Material

Hazardous Categories 1: ACUTE

Hazardous Categories 2: Not reported

Permit Number: 100905

Update Date: 11/02/2012

Case Number: 1333-84-2

Name: ALUMINUM OXIDE (NON FIBROUS)

Other Information: ACTIVATED ALUMINA

Material Waste: Material

Hazardous Categories 1: ACUTE

Hazardous Categories 2: Not reported

Permit Number: 100905

Update Date: 11/02/2012

Case Number: 10043-01-3

Name: ALUMINUM SULFATE

Other Information: Not reported

Material Waste: Material

Hazardous Categories 1: ACUTE

Hazardous Categories 2: Not reported

Permit Number: 100905

Update Date: 11/02/2012

Case Number: 1300-72-7

Name: ANIONIC SURFACTANT 1-5%

Other Information: KEYSTONE LOW TEMP RINSE ADDITIVE

Material Waste: Material

Hazardous Categories 1: ACUTE

Hazardous Categories 2: Not reported

Permit Number: 100905

Update Date: 11/02/2012

Case Number: 7440-37-1

Name: ARGON GAS

Other Information: Not reported

Material Waste: Material

Hazardous Categories 1: PRESSURE RELEASE

Hazardous Categories 2: Not reported

Permit Number: 100905

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	ASSORTED POLYURETHANES
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	ASSORTED URETHANES
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	AUTOMATIC TRANSMISSION FLUID
Other Information:	DEXRON II AUTOMATIC TRANSMISSION FLUID
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	CALCIUM HYPOCHLORITE ACUTAB
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	124-38-9
Name:	CARBON DIOXIDE, CO2, 99%, COMPRESSED GAS :
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information:	BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Material Waste:	Not reported
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	16291-96-6
Name:	CHARCOAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	8006-61-9
Name:	DIESEL - T007
Other Information:	UNDERGROUND TANK 100905 T007
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	68476-34-6
Name:	DIESEL FUEL
Other Information:	(4 TANKS)
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	111-90-0
Name:	DIETHYLENE GLYCOL MONOETHYL ETHER
Other Information:	FLOOR FINISH
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	ECOTEMP ULTRA DRY
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	64-17-5
Name:	ETHANOL, FOODSERVICE JOY
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	107-21-1
Name:	ETHYLENE GLYCOL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	111-76-2
Name:	ETHYLENE GLYCOL N-BUTYL ETHER
Other Information:	WAX ELIMINATOR
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	1309-37-1
Name:	FERTILIZER, TURF GOLD : IRON OXIDE 1% :
Other Information:	22-3-6 W/AMMUMIM SULFATE
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	306-83-2
Name:	FREON R-123
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7647-01-0
Name:	HYDROCHLORIC ACID
Other Information:	MURIATIC ACID
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	HYDROGEN PEROXIDE
Other Information:	CLEAN BY PEROXY
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	2809-21-4
Name:	HYDROXYETHYLIDINE DIPHOSPHONIC
Other Information:	ACID, TRIDENT 6026 (WATER TREATMENT)
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Update Date:	11/02/2012
Case Number:	7439-89-6
Name:	IRON, 95% GALVANIZED STEEL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	LATEX PAINT
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7439-92-1
Name:	LEAD
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7439-92-1
Name:	LEAD/LEAD OXIDE/LEAD SULFATE, ASSORTED INDUSTRIAL BATTERIES
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	CHRONIC
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7439-96-5
Name:	MANGANESE, 13% STAINLESS STEEL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	101-68-8
Name:	MDI
Other Information:	SAFE DECK
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	MISSION OVEN CLEANER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 25655-41-8
Name: MONO AMMONIUM PHOSPHATE, 95%,
Other Information: ABC DRY CHEM. FIRE EXTINGUISHER
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7440-02-0
Name: NICKEL, 99% NICKEL STEEL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 6484-52-2
Name: NITRA KING 19-4-4 (FERTILIZER-NURSERY-BONEYARD
Other Information: AMMONIA NITRATE)
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN, N2, 99%, COMPRESSED GAS :
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 9016-45-9
Name: NONYL PHENOL POLYETHYLENE GLYCOL ETHER FLUID QUARTERNA
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 26027-38-3
Name: NONYLPHENOXY POLYETHOXYETANOL 1-10%
Other Information: MEGUIAR'S W-DRESSING / DETAILER
Material Waste: Material
Hazardous Categories 1: ACUTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	OIL LUBRICATING KENDALL BLUE
Other Information:	KENDALL L-427 NLG1 2 BLUE
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	8002-05-9
Name:	OIL, LUBRICATING : MOTOR OIL HYDRAULIC OIL :
Other Information:	APSA CONTAINERS
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7782-44-7
Name:	OXYGEN, 02, 99%, COMPRESSED GAS :
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	PRESSURE RELEASE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	OZZYJUICE SW-3 TRUCK DEGREASINF SOLIN
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	PAINT-ASSORTED ENAMELS AND ACRYLICS
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	PHOSPHORIC ACID 45% MI-BRITE
Other Information:	MI-BRITE
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Update Date: 11/02/2012
Case Number: MIXTURE
Name: PIG DRI (ABSORBENT SPILL MATERIAL)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 57-55-6
Name: PROPYLENE GLYCOL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: PROPYLENE GLYCOL OLYMPIC WATERGUARD
Other Information: OLYMPIC WATERGUARD WOOD
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: PWC-1 BACTERIAL ADDITIVE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 65977-15-1
Name: RED-E-CRETE, CALCIUM SALT-PORTLAND CEMENT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 684-76-346
Name: REGULAR UNLEADED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Other Information:	UNDERGROUND TANK 100905 T001
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	8006-61-9
Name:	REGULAR UNLEADED - T006
Other Information:	UNDERGROUND TANK 100905 T006 UNLEADED
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	14808-60-7
Name:	SILICA SAND (WATER FILTERS)
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	14808-60-7
Name:	SILICON DIOXIDE (SAND-NURSERY)
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	14808-60-7
Name:	SILICON SAND (AQUARIUM)
Other Information:	NATURAL FINE AND COARSE AGGREGATE
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	14808-60-7
Name:	SILICON SAND (MERCHANRISE)
Other Information:	PLAYSAND
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7704-34-9
Name:	SILPUR 90%
Other Information:	SULPHUR FERTILIZER
Material Waste:	Material
Hazardous Categories 1:	ACUTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 144-55-8
Name: SODIUM BICARBONATE, SODA ASH
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 497-19-8
Name: SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7647-14-5
Name: SODIUM CHLORIDE, NA_{CL}, 98% : TABLE SALT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 1310-73-2
Name: SODIUM HYDROXIDE 30% ECOLAB DETERGENT
Other Information: ECOTEMP ULTRA KLENE
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7681-52-9
Name: SODIUM HYPOCHLORITE, NA_{OCL}, 13% : LIQUID POOL CHLORINE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7681-52-9
Name: SODIUM HYPOCHLORITE, NA_{OCL}, 5% : LIQ. HOUSEHOLD BLEACH
Other Information: RELIANCE DISINFECTANT BLEACH, CLOROX, GENERIC
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Update Date: 11/02/2012
Case Number: 7757-83-7
Name: SODIUM SULFITE, 25% SOLUTION
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 10102-17-7
Name: SODIUM THIOSULFATE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 124-38-9
Name: SOLID CARBON DIOXIDE (DRY ICE)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: MIXTURE
Name: SPRAY NINE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: STERNO CANNED COOKING FUEL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: SULFUR COATED UREA/X COTE 42-0-0
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7664-93-9
Name: SULFURIC ACID, 36%, H2SO4

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	EXTREMELY HAZARDOUS
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	SURFACTANT
Other Information:	0-111 DETAILER SHAMPOO PLUS
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	SURFACTANT BUBBLE MASTER
Other Information:	BUBBLE MASTER 2000 PREMIUM FLUID
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information:	INORG SOLID, HYPOCHLORITES
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER)-
Other Information:	MERCURY CONTAINING DEVICES
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER) (2)
Other Information:	PAINT CHIPS & PAINT BOOTH FLTRS (352)(212)
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 212 OXYGENATED SOLVENTS
Other Information:	LACQUER THINNER
Material Waste:	Waste
Hazardous Categories 1:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	ENGINE/LUBE OIL-COGEN PLT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 311 PHARMACEUTICAL WASTE
Other Information:	Not reported
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	AEROSOLS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	67-63-0
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	IPA
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	WASTE, GAS, DIESEL, LPG
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS*
Other Information:	NON-RCRA LIQUID FRAGRANCE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information: ETHYLENE GLYCOL WASTE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: OILY ABSORBENT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: RAGS CONTAMINATED W/ SOLVENT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)*
Other Information: WASTE METHANOL ACETONE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER).
Other Information: ABSORBENT W/ FORMALIN
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 74-98-6
Name: WASTE 352 ORGANIC SOLIDS (OTHER).
Other Information: WASTE, PROPANE (551)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 461 PAINT SLUDGE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Other Information:	PAINT WASTE - PAINTS, THINNERS (141)
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 791 LIQUIDS WITH PH <OR= 2
Other Information:	HYDROCHLORIC ACID/WASTE CORROSIVES
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 888 USED OIL FILTERS
Other Information:	DRAINED OIL FILTERS/FUEL FILTERS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information:	RED BAG
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information:	SHARPS WASTE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 903 INF WST, TISSUE/ANAT. REMAINS
Other Information:	PATH
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 905 INFECTIOUS WASTE, LAB
Other Information:	MEDICAL WASTE, LABORATORY
Material Waste:	Waste
Hazardous Categories 1:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WETSUIT CLEANER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7429-90-5
Name: WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 1314-13-2
Name: ZINC OXIDE, 3%, SIMPLOT 6-20-20 (FET W/ZINC)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/26/2011
Violation Code: 6HV1018
Violation: INVENTORY INCOMPLETE/NOT AMENDED
Violation Citation: Inventory not amended for 100% increase of hazardous material onsite or inventory is incomplete. 25509, 25510
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV1006
Violation: HMBP: INADEQUATE
Violation Citation: Business Plan inventory does not list all hazardous materials on site in disclosable quantities. HSC 25504(a),25503.5
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV3160
Violation: UST SYSTEM REPAIRS NOT PROPERLY DONE
Violation Citation: UST system repair(s) not completed properly. 25292.1(c); 2660 (a)(k)(l)(m)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 09/30/2009
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 100905

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV4204
Violation: WARNING SIGN NOT POSTED
Violation Citation: MW designated accumulation area not posted with an approved and legible biohazardous waste "warning sign" in English and Spanish.
118310
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV4212
Violation: RED BAGS NOT CONTAINERIZED
Violation Citation: Did not containerize and place red bags in rigid, leak resistant, and covered containers or bins. 118280(b)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 11/30/2006
Violation Code: 6HV3264
Violation: SPILL CONT. NOT TESTED ANNUALLY
Violation Citation: Spill containment at fill point not tested annually. 25284.2
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Inspection Date: 11/30/2006
Violation Code: 6HV3264
Violation: SPILL CONT. NOT TESTED ANNUALLY
Violation Citation: Spill containment at fill point not tested annually. 25284.2
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 11/30/2006
Violation Code: 6HV3264
Violation: SPILL CONT. NOT TESTED ANNUALLY
Violation Citation: Spill containment at fill point not tested annually. 25284.2
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 09/28/2010
Violation Code: 6HV4351
Violation: LQG:MWMP NOT SUBMITTED TO HMD
Violation Citation: Medical Waste Management Plan has not been submitted to County HMD (Initial Submission/updates)(LQG). 117960, 117970
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 100905 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: DOUBLE WALL
Additional Id: RT2050
Capacity Gallons: 10000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1984-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 30A
UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ WET TANK ANNULAR; POSITIVE SHUT-OFF & FAILSAFE, 3.0LLD; UDC W/ POSITIVE SHUT-OFF

UST Name: UNDERGROUND TANK 100905 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: SINGLE WALL
Additional Id: #02
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1991-11-01 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALYSIS MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/H

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

UST Name: UNDERGROUND TANK 100905 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: SINGLE WALL
Additional Id: #07
Capacity Gallons: 300
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1989-07-12 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 100905 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: SINGLE WALL
Additional Id: #08
Capacity Gallons: 150
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1989-07-12 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 100905 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: UNKNOWN
Additional Id: 12
Capacity Gallons: 10000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: REMOVED
Remove Close Date: 1990-01-29 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 100905 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: DOUBLE WALL
Additional Id: RT2050
Capacity Gallons: 1000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

UST Contents: PREMIUM UNLEADED
Other Content Info: PREMIUM UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1990-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 61
UST Monitor Method: DW TANK W/DRY ANNULAR, DW PRESSURE PIPE; FAILSAFE & POS SHUTOFF, 3.0 LLD; SW ABOVE GROUND PIPE & UDC W/VISUAL MONIT

UST Name: UNDERGROUND TANK 100905 T007
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: DOUBLE WALL
Additional Id: RT2050
Capacity Gallons: 2000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 31A
UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ DRY TANK ANNULAR; POSITIVE SHUT-OFF & FAILSAFE, 3.0 LLD; UDC W/ POSITIVE SHUT-OFF

Name: SEAWORLD
Address: 1700 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 100905
Business Type: 6HK62
EPA Id Number: CAD981687221
APN: 435-480-15-00
Last HMMD Inspection: 08/20/2012
Facility Telephone: 619-222-6363
Permit Status: OPEN
Permit Expiration: 05/31/2013
Date Last Updated: 11/02/2012
Facility Owner: SEAWORLD, INC. DBA SEAWORLD SAN DIEGO
Facility Mailing Address: 500 SEA WORLD DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109-7994
UST Owner: SEA WORLD INC
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Y
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 74-86-2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7440-44-0
Name: ACTIVATED CARBON 100%
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 1333-84-2
Name: ALUMINUM OXIDE (NON FIBROUS)
Other Information: ACTIVATED ALUMINA
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 10043-01-3
Name: ALUMINUM SULFATE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 1300-72-7
Name: ANIONIC SURFACTANT 1-5%
Other Information: KEYSTONE LOW TEMP RINSE ADDITIVE
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7440-37-1
Name: ARGON GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: MIXTURE
Name: ASSORTED POLYURETHANES
Other Information: Not reported
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	ASSORTED URETHANES
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	AUTOMATIC TRANSMISSION FLUID
Other Information:	DEXRON II AUTOMATIC TRANSMISSION FLUID
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	CALCIUM HYPOCHLORITE ACUTAB
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	124-38-9
Name:	CARBON DIOXIDE, C02, 99%, COMPRESSED GAS :
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	PRESSURE RELEASE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	CARCINOGENS &/OR REPRODUCTIVE TOXINS
Other Information:	BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Material Waste:	Not reported
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	16291-96-6
Name:	CHARCOAL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Permit Number:	100905
Update Date:	11/02/2012
Case Number:	8006-61-9
Name:	DIESEL - T007
Other Information:	UNDERGROUND TANK 100905 T007
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	68476-34-6
Name:	DIESEL FUEL
Other Information:	(4 TANKS)
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	ACUTE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	111-90-0
Name:	DIETHYLENE GLYCOL MONOETHYL ETHER
Other Information:	FLOOR FINISH
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	ECOTEMP ULTRA DRY
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	64-17-5
Name:	ETHANOL, FOODSERVICE JOY
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	107-21-1
Name:	ETHYLENE GLYCOL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	111-76-2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Name:	ETHYLENE GLYCOL N-BUTYL ETHER
Other Information:	WAX ELIMINATOR
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	1309-37-1
Name:	FERTILIZER, TURF GOLD : IRON OXIDE 1% :
Other Information:	22-3-6 W/AMMUMIM SULFATE
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	306-83-2
Name:	FREON R-123
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7647-01-0
Name:	HYDROCHLORIC ACID
Other Information:	MURIATIC ACID
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	HYDROGEN PEROXIDE
Other Information:	CLEAN BY PEROXY
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	2809-21-4
Name:	HYDROXETHYLIDINE DIPHOSPHONIC
Other Information:	ACID, TRIDENT 6026 (WATER TREATMENT)
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7439-89-6
Name:	IRON, 95% GALVANIZED STEEL
Other Information:	Not reported
Material Waste:	Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: MIXTURE
Name: LATEX PAINT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7439-92-1
Name: LEAD
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7439-92-1
Name: LEAD/LEAD OXIDE/LEAD SULFATE, ASSORTED INDUSTRIAL BATTERIES
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7439-96-5
Name: MANGANESE, 13% STAINLESS STEEL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 101-68-8
Name: MDI
Other Information: SAFE DECK
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: MISSION OVEN CLEANER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 25655-41-8
Name: MONO AMMONIUM PHOSPHATE, 95%,
Other Information: ABC DRY CHEM. FIRE EXTINGUISHER
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7440-02-0
Name: NICKEL, 99% NICKEL STEEL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: CHRONIC

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 6484-52-2
Name: NITRA KING 19-4-4 (FERTILIZER-NURSERY-BONEYARD
Other Information: AMMONIA NITRATE)
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7727-37-9
Name: NITROGEN, N2, 99%, COMPRESSED GAS :
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: PRESSURE RELEASE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 9016-45-9
Name: NONYL PHENOL POLYETHYLENE GLYCOL ETHER FLUID QUARTERNA
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 26027-38-3
Name: NONYLPHENOXY POLYETHOXYETANOL 1-10%
Other Information: MEGUIAR'S W-DRESSING / DETAILER
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Name: OIL LUBRICATING KENDALL BLUE
Other Information: KENDALL L-427 NLG1 2 BLUE
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING : MOTOR OIL HYDRAULIC OIL :
Other Information: APSA CONTAINERS
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN, 02, 99%, COMPRESSED GAS :
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: OZZYJUICE SW-3 TRUCK DEGREASING SOLIN
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: MIXTURE
Name: PAINT-ASSORTED ENAMELS AND ACRYLICS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: PHOSPHORIC ACID 45% MI-BRITE
Other Information: MI-BRITE
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: MIXTURE
Name: PIG DRI (ABSORBENT SPILL MATERIAL)
Other Information: Not reported
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	74-98-6
Name:	PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	PRESSURE RELEASE
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	57-55-6
Name:	PROPYLENE GLYCOL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	PROPYLENE GLYCOL OLYMPIC WATERGUARD
Other Information:	OLYMPIC WATERGUARD WOOD
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	PWC-1 BACTERIAL ADDITIVE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	65977-15-1
Name:	RED-E-CRETE, CALCIUM SALT-PORTLAND CEMENT
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	684-76-346
Name:	REGULAR UNLEADED
Other Information:	UNDERGROUND TANK 100905 T001
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 8006-61-9
Name: REGULAR UNLEADED - T006
Other Information: UNDERGROUND TANK 100905 T006 UNLEADED
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 14808-60-7
Name: SILICA SAND (WATER FILTERS)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 14808-60-7
Name: SILICON DIOXIDE (SAND-NURSERY)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 14808-60-7
Name: SILICON SAND (AQUARIUM)
Other Information: NATURAL FINE AND COARSE AGGREGATE
Material Waste: Material
Hazardous Categories 1: CHRONIC
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 14808-60-7
Name: SILICON SAND (MERCHANRISE)
Other Information: PLAYSAND
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7704-34-9
Name: SILPUR 90%
Other Information: SULPHUR FERTILIZER
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 144-55-8

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Name:	SODIUM BICARBONATE, SODA ASH
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	497-19-8
Name:	SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7647-14-5
Name:	SODIUM CHLORIDE, NACL, 98% : TABLE SALT
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	1310-73-2
Name:	SODIUM HYDROXIDE 30% ECOLAB DETERGENT
Other Information:	ECOTEMP ULTRA KLENE
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7681-52-9
Name:	SODIUM HYPOCHLORITE, NAOCL, 13% : LIQUID POOL CHLORINE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7681-52-9
Name:	SODIUM HYPOCHLORITE, NAOCL, 5% : LIQ. HOUSEHOLD BLEACH
Other Information:	RELIANCE DISINFECTANT BLEACH, CLOROX, GENERIC
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7757-83-7
Name:	SODIUM SULFITE, 25% SOLUTION
Other Information:	Not reported
Material Waste:	Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	10102-17-7
Name:	SODIUM THIOSULFATE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	CHRONIC
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	124-38-9
Name:	SOLID CARBON DIOXIDE (DRY ICE)
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	MIXTURE
Name:	SPRAY NINE
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	STERNO CANNED COOKING FUEL
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	FIRE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	SULFUR COATED UREA/X COTE 42-0-0
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	7664-93-9
Name:	SULFURIC ACID, 36%, H2SO4
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	ACUTE
Hazardous Categories 2:	EXTREMELY HAZARDOUS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: SURFACTANT
Other Information: 0-111 DETAILER SHAMPOO PLUS
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: SURFACTANT BUBBLE MASTER
Other Information: BUBBLE MASTER 2000 PREMIUM FLUID
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Other Information: INORG SOLID, HYPOCHLORITES
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)-
Other Information: MERCURY CONTAINING DEVICES
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 181 INORGANIC SOLID WASTE (OTHER) (2)
Other Information: PAINT CHIPS & PAINT BOOTH FLTRS (352)(212)
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 212 OXYGENATED SOLVENTS
Other Information: LACQUER THINNER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	ENGINE/LUBE OIL-COGEN PLT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 311 PHARMACEUTICAL WASTE
Other Information:	Not reported
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	AEROSOLS
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	67-63-0
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	IPA
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Other Information:	WASTE, GAS, DIESEL, LPG
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS*
Other Information:	NON-RCRA LIQUID FRAGRANCE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information:	ETHYLENE GLYCOL WASTE
Material Waste:	Waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information:	OILY ABSORBENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information:	RAGS CONTAMINATED W/ SOLVENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER)*
Other Information:	WASTE METHANOL ACETONE
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 352 ORGANIC SOLIDS (OTHER).
Other Information:	ABSORBENT W/ FORMALIN
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	74-98-6
Name:	WASTE 352 ORGANIC SOLIDS (OTHER).
Other Information:	WASTE, PROPANE (551)
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	100905
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 461 PAINT SLUDGE
Other Information:	PAINT WASTE - PAINTS, THINNERS (141)
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 791 LIQUIDS WITH PH <OR= 2
Other Information: HYDROCHLORIC ACID/WASTE CORROSIVES
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: DRAINED OIL FILTERS/FUEL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information: RED BAG
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: SHARPS WASTE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 903 INF WST, TISSUE/ANAT. REMAINS
Other Information: PATH
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 905 INFECTIOUS WASTE, LAB
Other Information: MEDICAL WASTE, LABORATORY
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Name: WETSUIT CLEANER
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 7429-90-5
Name: WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Permit Number: 100905
Update Date: 11/02/2012
Case Number: 1314-13-2
Name: ZINC OXIDE, 3%, SIMPLOT 6-20-20 (FET W/ZINC)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: ACUTE
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/26/2011
Violation Code: 6HV1018
Violation: INVENTORY INCOMPLETE/NOT AMENDED
Violation Citation: Inventory not amended for 100% increase of hazardous material onsite or inventory is incomplete. 25509, 25510
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV0304

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV1006
Violation: HMBP: INVENTORY INADEQUATE
Violation Citation: Business Plan inventory does not list all hazardous materials on site in disclosable quantities. HSC 25504(a),25503.5
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 08/03/2004
Violation Code: 6HV3160
Violation: UST SYSTEM REPAIRS NOT PROPERLY DONE
Violation Citation: UST system repair(s) not completed properly. 25292.1(c); 2660 (a)(k)(l)(m)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 09/30/2009
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV4204
Violation: WARNING SIGN NOT POSTED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Violation Citation: MW designated accumulation area not posted with an approved and legible biohazardous waste "warning sign" in English and Spanish. 118310

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV4212
Violation: RED BAGS NOT CONTAINERIZED
Violation Citation: Did not containerize and place red bags in rigid, leak resistant, and covered containers or bins. 118280(b)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 12/03/2007
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 11/30/2006
Violation Code: 6HV3264
Violation: SPILL CONT. NOT TESTED ANNUALLY
Violation Citation: Spill containment at fill point not tested annually. 25284.2

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 11/30/2006
Violation Code: 6HV3264
Violation: SPILL CONT. NOT TESTED ANNUALLY
Violation Citation: Spill containment at fill point not tested annually. 25284.2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 11/30/2006
Violation Code: 6HV3264
Violation: SPILL CONT. NOT TESTED ANNUALLY
Violation Citation: Spill containment at fill point not tested annually. 25284.2
Activity: ACTIVE

Permit Number: 100905
Update Date: 11/02/2012
Inspection Date: 09/28/2010
Violation Code: 6HV4351
Violation: LQG:MWMP NOT SUBMITTED TO HMD
Violation Citation: Medical Waste Management Plan has not been submitted to County HMD (Initial Submission/updates)(LQG). 117960, 117970
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 100905 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: DOUBLE WALL
Additional Id: RT2050
Capacity Gallons: 10000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1984-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 30A
UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ WET TANK ANNULAR; POSITIVE SHUT-OFF & FAILSAFE, 3.0LLD; UDC W/ POSITIVE SHUT-OFF

UST Name: UNDERGROUND TANK 100905 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: SINGLE WALL
Additional Id: #02
Capacity Gallons: 1000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1991-11-01 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALYSIS MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/H

UST Name: UNDERGROUND TANK 100905 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 100905

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Tank Type: SINGLE WALL
Additional Id: #07
Capacity Gallons: 300
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1989-07-12 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 100905 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: SINGLE WALL
Additional Id: #08
Capacity Gallons: 150
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1989-07-12 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 100905 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: UNKNOWN
Additional Id: 12
Capacity Gallons: 10000
UST Contents: AVIATION FUEL
Other Content Info: AVIATION FUEL
Reg Status: REMOVED
Remove Close Date: 1990-01-29 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 100905 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: DOUBLE WALL
Additional Id: RT2050
Capacity Gallons: 1000
UST Contents: PREMIUM UNLEADED
Other Content Info: PREMIUM UNLEADED
Reg Status: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406591

Remove Close Date: Not reported
Year Installed: 1990-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 61
UST Monitor Method: DW TANK W/DRY ANNULAR, DW PRESSURE PIPE; FAILSAFE & POS SHUTOFF, 3.0 LLD; SW ABOVE GROUND PIPE & UDC W/VISUAL MONIT

UST Name: UNDERGROUND TANK 100905 T007
Last Update: 2012-11-02 14:17:38
Permit Number: 100905
Tank Type: DOUBLE WALL
Additional Id: RT2050
Capacity Gallons: 2000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 31A
UST Monitor Method: DW TANK, DW PRESSURIZED PIPE W/ DRY TANK ANNULAR; POSITIVE SHUT-OFF & FAILSAFE, 3.0 LLD; UDC W/ POSITIVE SHUT-OFF

C60

ERNS 2012020535
N/A

< 1/8
1 ft.

1660 S. SHORES ROAD
SAN DIEGO, CA 92109

Site 16 of 52 in cluster C

Relative:
Lower
Actual:
15 ft.

Incident Commons: 1020535
NRC Report #: 1020535
Description of Incident: CALLER IS REPORTING A BOAT THAT IS PARTIALLY AGROUND AND IS LEAKING OIL INTO THE WATER ALONG WITH FUEL. CALLER IS TRYING TO LOCATE THE OWNER AT THIS TIME.

Type of Incident: VESSEL
Incident Cause: UNKNOWN
Incident Date Time: 2012-08-09 13:30:00
Incident DTG: OCCURRED
Incident Location: Not reported
Loaction Address: 1660 S. SHORES ROAD
Location Street 1: Not reported
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2012020535

Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N

Incidents:

NRC Report #: 1020535
Aircraft Type: Not reported
Aircraft Model: Not reported
Aircraft ID: Not reported
Aircraft Fuel Capacity: Not reported
Aircraft Fuel Capacity Units: Not reported
Aircraft Fuel on Board: Not reported
Aircraft Fuel on Board Units: Not reported
Aircraft Spot Number: Not reported
Aircraft Hanger: Not reported
Aircraft Runway Number: Not reported
Road Mile Marker: Not reported
Building ID: Not reported
Type of Fixed Object: Not reported
Power Generating Facility: U
Generating Capacity: Not reported
Type of Fuel: Not reported
NPDES: Not reported
NPDES Compliance: U
Pipeline Type: Not reported
DOT Regulated: U
Pipeline Above Ground: ABOVE
Exposed Underwater: N
Pipeline Covered: U
Railroad Hotline: Not reported
Grade Crossing: U
Location Subdivision: Not reported
Railroad Milepost: Not reported
Type Vehicle Involved: Not reported
Crossing Device Type: Not reported
Device Operational: U
DOT Crossing Number: Not reported
Brake Failure: U
Description of Tank: Not reported
Tank Above Ground: ABOVE
Transportable Container: U
Tank Regulated: U
Tank Regulated By: Not reported
Tank ID: Not reported
Capacity of Tank: Not reported
Capacity of Tank Units: Not reported
Actual Amount: Not reported
Actual Amount Units: Not reported
Platform Rig Name: Not reported
Platform Letter: Not reported
Location Area ID: Not reported
Location Block ID: Not reported
OCSG Number: Not reported
OCSP Number: Not reported
State Lease Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2012020535

Pier Dock Number: Not reported
Berth Slip Number: Not reported
Continuous Release Type: Not reported
Initial Continuous Release No: Not reported
Continuous Release Permit: Not reported
Allision: N
Type of Structure: Not reported
Structure Name: Not reported
Structure Operational: U
Airbag Deployed: U
Date Tiem Normal Service: Not reported
Service Disruption Time: Not reported
Service Disruption Units: Not reported
Transit Bus Flag: Not reported
CR Begin Date: Not reported
CR End Date: Not reported
CR Change Date: Not reported
FBI Contact: Not reported
FBI Contact Date Time: Not reported
Sub Part C Testing Req: XXX
Conductor Testing: Not reported
Engineer Testing: Not reported
Trainman Testing: Not reported
Yard Foreman Testing: Not reported
RCL Operator Testing: Not reported
Brakeman Testing: Not reported
Train Dispatcher Testing: Not reported
Signalman Testing: Not reported
Other Employee Testing: Not reported
Unknown Testing: Not reported
Passenger Handling: Not reported
Passenger Route: XXX
Passenger Delay: XXX

Incident Details:

NRC Report #: 1020535
Fire Involved: N
Fire Extinguished: U
Any Evacuations: N
Number Evacuated: Not reported
Who Evacuated: Not reported
Radius of Evacuation: Not reported
Any Injuries: N
Number Injured: Not reported
Number Hospitalized: Not reported
Any Fatalities: N
Number Fatalities: Not reported
Any Damages: N
Damage Amount: Not reported
Air Corridor Closed: N
Air Corridor Desc: Not reported
Air Closure Time: Not reported
Waterway Closed: N
Waterway Desc: Not reported
Waterway Closure Time: Not reported
Road Closed: N
Road Desc: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2012020535

Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported
Media Interest:	NONE
Medium Desc:	WATER
Additional Medium Info:	MISSION BAY
Body of Water:	MISSION BAY
Tributary of:	PACIFIC OCEAN
Release Secured:	U
Estimated Duration of Release:	Not reported
Release rate:	Not reported
Desc Remedial Action:	LIFE GUARDS ARE ONSCENE, BOOMS HAVE BEEN PLACED OUT
State Agency on Scene:	Not reported
State Agency Report Number:	Not reported
Other Agency Notified:	Not reported
Weather Conditions:	PARTLY CLOUDY
Air Temperature:	85
Wind Speed:	Not reported
Wind Direction:	Not reported
Water Supply Contaminated:	U
Sheen Size:	Not reported
Sheen Color:	RAINBOW
Direction of Sheen Travel:	Not reported
Sheen Odor Description:	OIL AND GAS
Wave Condition:	Not reported
Current Speed:	Not reported
Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	Not reported
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported
Passenger Injuries:	Not reported
Occupant Fatality:	Not reported
Current Speed Unit:	Not reported
Road Closure Units:	Not reported
Track CLOsure Units:	Not reported
Sheen Size Units:	Not reported
Additional Info:	Not reported
State Agency Notified:	Not reported
Federal Agency Notified:	USCG
nearest River Mile Marker:	Not reported
Sheen Size Length:	100
Sheen Size Length Units:	FEET
Sheen Size Width:	75
Sheen Size Width Units:	FEET
Offshore:	N
Duration Unit:	Not reported
Release Rate Unit:	Not reported
Release Rate Rate:	Not reported
Passengers Transferred:	NO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2012020535

Calls:

NRC Report #: 1020535
Site ID: 20121020535
Date Time Received: 2012-08-09 16:38:54
Date Time Complete: 2012-08-09 16:45:14
Call Type: INC
Responsible Company: Not reported
Responsible Org Type: UNKNOWN
Responsible City: Not reported
Responsible State: XX
Responsible Zip: Not reported
On Behalf: Not reported
Source: TELEPHONE

Vessels Detail:

Site ID: 20121020535
Vessel Name: LUCKY CATCH
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: 26
Hull Construction: FIBERGLASS HULL
Fuel Capacity: Not reported
Fuel on Board: Not reported
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: Y
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 1020535
Chris Code: OMT
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: OIL, MISC: MOTOR
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

NRC Report #: 1020535
Chris Code: GAS
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: GASOLINE: AUTOMOTIVE (UNLEADED)
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

C61

CHMIRS

S124448042
N/A

< 1/8
1 ft.

1660 S. SHORES ROAD // MISSION BAY // SLIP 400 // NEAR THE F
SAN DIEGO, CA 92109

Site 17 of 52 in cluster C

Relative:
Lower

Actual:
15 ft.

CHMIRS:

Name:	Not reported
Address:	1660 S. SHORES ROAD // MISSION BAY // SLIP 400 // NEAR THE FLAG POLE
City,State,Zip:	SAN DIEGO, CA 92109
OES Incident Number:	18-8566
OES notification:	12/17/2018
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Waterways
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	UNSPECIFIED
Measure:	Sheen
Other:	Not reported
Date/Time:	1505
Year:	2018
Agency:	Seaworld Marina
Incident Date:	12/17/2018
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown if stopped,Not contained
Site Type:	Mission Bay

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S124448042

E Date: Not reported
Substance: Unknown Sheen
Quantity Released: 20 ft x 20 ft
Unknown: Not reported
Substance #2: Not reported
Substance #3: Not reported
Evacuations: Not reported
Number of Injuries: Not reported
Number of Fatalities: Not reported
#1 Pipeline: No
#2 Pipeline: No
#3 Pipeline: No
#1 Vessel >= 300 Tons: No
#2 Vessel >= 300 Tons: No
#3 Vessel >= 300 Tons: No
Evacs: No
Injuries: No
Fatafs: No
Comments: Not reported
Description: Per the caller, The sheen is coming from Mission Bay. Personnel have checked all vessels in the Marina and nothing was observed coming from the vessels. Sheen size is approx 20 feet by 20 feet, with a blue coloration. According to NRC #1233299, Caller is reporting the discovery of an unknown sheen in the water at the incident location on Mission Bay.

C62

< 1/8
1 ft.

1660 S. SHORES ROAD
SAN DIEGO, CA 92109

Site 18 of 52 in cluster C

ERNS 2013054517
N/A

Relative:
Lower

Actual:
15 ft.

Incident Commons:
NRC Report #: 1054517
Description of Incident: CALLER IS REPORTING A BOAT THAT IS LEAKING GAS AND OIL. CALLER SUSPECTS THAT THIS IS DUE TO EQUIPMENT FAILURE. THE BOAT IS AT A DOCK AT THE MARINA.
Type of Incident: VESSEL
Incident Cause: EQUIPMENT FAILURE
Incident Date Time: 2013-07-20 10:00:00
Incident DTG: OCCURRED
Incident Location: Not reported
Loaction Address: 1660 S. SHORES ROAD
Location Street 1: Not reported
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013054517

Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N

Incidents:

NRC Report #: 1054517
Aircraft Type: Not reported
Aircraft Model: Not reported
Aircraft ID: Not reported
Aircraft Fuel Capacity: Not reported
Aircraft Fuel Capacity Units: Not reported
Aircraft Fuel on Board: Not reported
Aircraft Fuel on Board Units: Not reported
Aircraft Spot Number: Not reported
Aircraft Hanger: Not reported
Aircraft Runway Number: Not reported
Road Mile Marker: Not reported
Building ID: Not reported
Type of Fixed Object: Not reported
Power Generating Facility: U
Generating Capacity: Not reported
Type of Fuel: Not reported
NPDES: Not reported
NPDES Compliance: U
Pipeline Type: Not reported
DOT Regulated: U
Pipeline Above Ground: ABOVE
Exposed Underwater: N
Pipeline Covered: U
Railroad Hotline: Not reported
Grade Crossing: U
Location Subdivision: Not reported
Railroad Milepost: Not reported
Type Vehicle Involved: Not reported
Crossing Device Type: Not reported
Device Operational: U
DOT Crossing Number: Not reported
Brake Failure: U
Description of Tank: Not reported
Tank Above Ground: ABOVE
Transportable Container: U
Tank Regulated: U
Tank Regulated By: Not reported
Tank ID: Not reported
Capacity of Tank: Not reported
Capacity of Tank Units: Not reported
Actual Amount: Not reported
Actual Amount Units: Not reported
Platform Rig Name: Not reported
Platform Letter: Not reported
Location Area ID: Not reported
Location Block ID: Not reported
OCSG Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013054517

OCSF Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	213
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	N
Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U
Airbag Deployed:	U
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported
Unknown Testing:	Not reported
Passenger Handling:	Not reported
Passenger Route:	XXX
Passenger Delay:	XXX

Incident Details:

NRC Report #:	1054517
Fire Involved:	N
Fire Extinguished:	U
Any Evacuations:	N
Number Evacuated:	Not reported
Who Evacuated:	Not reported
Radius of Evacuation:	Not reported
Any Injuries:	N
Number Injured:	Not reported
Number Hospitalized:	Not reported
Any Fatalities:	N
Number Fatalities:	Not reported
Any Damages:	N
Damage Amount:	Not reported
Air Corridor Closed:	N
Air Corridor Desc:	Not reported
Air Closure Time:	Not reported
Waterway Closed:	N
Waterway Desc:	Not reported
Waterway Closure Time:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013054517

Road Closed:	N
Road Desc:	Not reported
Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported
Media Interest:	UNKNOWN
Medium Desc:	WATER
Additional Medium Info:	MISSION BAY
Body of Water:	MISSION BAY
Tributary of:	SAN DIEGO BAY
Release Secured:	U
Estimated Duration of Release:	Not reported
Release rate:	Not reported
Desc Remedial Action:	ABSORBENTS APPLIED
State Agency on Scene:	Not reported
State Agency Report Number:	Not reported
Other Agency Notified:	Not reported
Weather Conditions:	PARTLY CLOUDY
Air Temperature:	Not reported
Wind Speed:	Not reported
Wind Direction:	Not reported
Water Supply Contaminated:	U
Sheen Size:	Not reported
Sheen Color:	RAINBOW
Direction of Sheen Travel:	Not reported
Sheen Odor Description:	GAS AND OIL
Wave Condition:	Not reported
Current Speed:	Not reported
Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	Not reported
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported
Passenger Injuries:	Not reported
Occupant Fatality:	Not reported
Current Speed Unit:	Not reported
Road Closure Units:	Not reported
Track Closure Units:	Not reported
Sheen Size Units:	Not reported
Additional Info:	Not reported
State Agency Notified:	Not reported
Federal Agency Notified:	USCG
nearest River Mile Marker:	Not reported
Sheen Size Length:	Not reported
Sheen Size Length Units:	Not reported
Sheen Size Width:	Not reported
Sheen Size Width Units:	Not reported
Offshore:	N
Duration Unit:	Not reported
Release Rate Unit:	Not reported
Release Rate Rate:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013054517

Passengers Transferred: NO

Calls:

NRC Report #: 1054517
Site ID: 20131054517
Date Time Received: 2013-07-20 13:11:58
Date Time Complete: 2013-07-20 13:17:19
Call Type: INC
Responsible Company: Not reported
Responsible Org Type: UNKNOWN
Responsible City: Not reported
Responsible State: XX
Responsible Zip: Not reported
On Behalf: Not reported
Source: TELEPHONE

Vessels Detail:

Site ID: 20131054517
Vessel Name: UNKNOWN
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: 25
Hull Construction: FIBERGLASS HULL
Fuel Capacity: Not reported
Fuel on Board: Not reported
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: N
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 1054517
Chris Code: GAS
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: GASOLINE: AUTOMOTIVE (UNLEADED)
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

NRC Report #: 1054517
Chris Code: OMT
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: OIL, MISC: MOTOR
If Reached Water: YES

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2013054517

Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

C63 **SEA WORLD, PEREZ COVE MAR**
1660 SHORES
< 1/8
1 ft.
SAN DIEGO, CA 92109

HIST CORTESE **S105026129**
N/A

Site 19 of 52 in cluster C

Relative: HIST CORTESE:
Lower edr_fname: SEA WORLD, PEREZ COVE MAR
edr_fadd1: 1660 SHORES
Actual: City,State,Zip: SAN DIEGO, CA 92109
15 ft. Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT464

C64 **1660 S. SHORES ROAD**
< 1/8
1 ft.
SAN DIEGO, CA 92109

ERNS **2016146674**
N/A

Site 20 of 52 in cluster C

Relative: Incident Commons:
Lower NRC Report #: 1146674
Actual: Description of Incident: CALLER STATED THERE IS A SPILL OF MOTOR OIL COMING FROM A PLEASURE
15 ft. CRAFT DUE TO UNKNOWN CAUSES.
Type of Incident: VESSEL
Incident Cause: UNKNOWN
Incident Date Time: 2016-05-01 16:00:00
Incident DTG: OCCURRED
Incident Location: Not reported
Loaction Address: 1660 S. SHORES ROAD
Location Street 1: MISSION BAY
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2016146674

Incidents:

NRC Report #:	1146674
Aircraft Type:	Not reported
Aircraft Model:	Not reported
Aircraft ID:	Not reported
Aircraft Fuel Capacity:	Not reported
Aircraft Fuel Capacity Units:	Not reported
Aircraft Fuel on Board:	Not reported
Aircraft Fuel on Board Units:	Not reported
Aircraft Spot Number:	Not reported
Aircraft Hanger:	Not reported
Aircraft Runway Number:	Not reported
Road Mile Marker:	Not reported
Building ID:	Not reported
Type of Fixed Object:	Not reported
Power Generating Facility:	U
Generating Capacity:	Not reported
Type of Fuel:	Not reported
NPDES:	Not reported
NPDES Compliance:	U
Pipeline Type:	Not reported
DOT Regulated:	U
Pipeline Above Ground:	ABOVE
Exposed Underwater:	N
Pipeline Covered:	U
Railroad Hotline:	Not reported
Grade Crossing:	U
Location Subdivision:	Not reported
Railroad Milepost:	Not reported
Type Vehicle Involved:	Not reported
Crossing Device Type:	Not reported
Device Operational:	U
DOT Crossing Number:	Not reported
Brake Failure:	U
Description of Tank:	Not reported
Tank Above Ground:	ABOVE
Transportable Container:	U
Tank Regulated:	U
Tank Regulated By:	Not reported
Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSP Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	318
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	U

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2016146674

Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U
Airbag Deployed:	U
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported
Unknown Testing:	Not reported
Passenger Handling:	Not reported
Passenger Route:	XXX
Passenger Delay:	XXX

Incident Details:

NRC Report #:	1146674
Fire Involved:	N
Fire Extinguished:	U
Any Evacuations:	N
Number Evacuated:	Not reported
Who Evacuated:	Not reported
Radius of Evacuation:	Not reported
Any Injuries:	N
Number Injured:	Not reported
Number Hospitalized:	Not reported
Any Fatalities:	N
Number Fatalities:	Not reported
Any Damages:	N
Damage Amount:	Not reported
Air Corridor Closed:	N
Air Corridor Desc:	Not reported
Air Closure Time:	Not reported
Waterway Closed:	N
Waterway Desc:	Not reported
Waterway Closure Time:	Not reported
Road Closed:	N
Road Desc:	Not reported
Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2016146674

Media Interest: UNKNOWN
Medium Desc: WATER
Additional Medium Info: MISSION BAY
Body of Water: MISSION BAY
Tributary of: Not reported
Release Secured: Y
Estimated Duration of Release: Not reported
Release rate: Not reported
Desc Remedial Action: BOOMS APPLIED, ABSORBENTS APPLIED
State Agency on Scene: Not reported
State Agency Report Number: Not reported
Other Agency Notified: Not reported
Weather Conditions: PARTLY CLOUDY
Air Temperature: Not reported
Wind Speed: 5
Wind Direction: Not reported
Water Supply Contaminated: U
Sheen Size: Not reported
Sheen Color: RAINBOW
Direction of Sheen Travel: Not reported
Sheen Odor Description: Not reported
Wave Condition: Not reported
Current Speed: Not reported
Current Direction: Not reported
Water Temperature: Not reported
Track Close Dir: Not reported
Empl Fatality: Not reported
Pass Fatality: Not reported
Community Impact: Not reported
Wind Speed Unit: MPH
Employee Injuries: Not reported
Passenger Injuries: Not reported
Occupant Fatality: Not reported
Current Speed Unit: Not reported
Road Closure Units: Not reported
Track Closure Units: Not reported
Sheen Size Units: Not reported
Additional Info: Not reported
State Agency Notified: Not reported
Federal Agency Notified: Not reported
nearest River Mile Marker: Not reported
Sheen Size Length: 6
Sheen Size Length Units: FEET
Sheen Size Width: 6
Sheen Size Width Units: FEET
Offshore: N
Duration Unit: Not reported
Release Rate Unit: Not reported
Release Rate Rate: Not reported
Passengers Transferred: NO

Calls:

NRC Report #: 1146674
Site ID: 20161146674
Date Time Received: 2016-05-01 19:11:30
Date Time Complete: 2016-05-01 19:16:52
Call Type: INC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

20161146674

Responsible Company: Not reported
Responsible Org Type: PRIVATE CITIZEN
Responsible City: RAMONA
Responsible State: CA
Responsible Zip: 92065
On Behalf: Not reported
Source: TELEPHONE

Vessels Detail:

Site ID: 20161146674
Vessel Name: MY FIN
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: Not reported
Hull Construction: Not reported
Fuel Capacity: Not reported
Fuel on Board: Not reported
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: N
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 1146674
Chris Code: OMT
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: OIL, MISC: MOTOR
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

C65
< 1/8
1 ft.

SEA WORLD HYDRO DOCK
1720 SOUTH SHORES RD
SAN DIEGO, CA

RGA LUST S114684307
N/A

Site 21 of 52 in cluster C

Relative:
Lower
Actual:
15 ft.

RGA LUST:
Name: SEA WORLD HYDRO DOCK
Address: 1720 SOUTH SHORES RD
City: SAN DIEGO
State: SAN DIEGO
2002 SEA WORLD HYDRO DOCK 1720 SOUTH SHORES RD
Name: SEA WORLD HYDRO DOCK
Address: 1720 SOUTH SHORES RD
City: SAN DIEGO
State: SAN DIEGO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD HYDRO DOCK (Continued)

S114684307

	2001	SEA WORLD HYDRO DOCK	1720 SOUTH SHORES RD
Name:	SEA WORLD HYDRO DOCK		
Address:	1720 SOUTH SHORES RD		
City:	SAN DIEGO		
State:	SAN DIEGO		
	2000	SEA WORLD HYDRO DOCK	1720 SOUTH SHORES RD
Name:	SEA WORLD HYDRO DOCK		
Address:	1720 SOUTH SHORES RD		
City:	SAN DIEGO		
State:	SAN DIEGO		
	1998	SEA WORLD HYDRO DOCK	1720 SOUTH SHORES RD
Name:	SEA WORLD HYDRO DOCK		
Address:	1720 SOUTH SHORES RD		
City:	SAN DIEGO		
State:	SAN DIEGO		
	1997	SEA WORLD HYDRO DOCK	1720 SOUTH SHORES RD
Name:	SEA WORLD HYDRO DOCK		
Address:	1720 SOUTH SHORES RD		
City:	SAN DIEGO		
State:	SAN DIEGO		
	1996	SEA WORLD HYDRO DOCK	1720 SOUTH SHORES RD

C66

**SEA WORLD
1720 SHORES
SAN DIEGO, CA**

HIST CORTESE

**S105026130
N/A**

**< 1/8
1 ft.**

Site 22 of 52 in cluster C

**Relative:
Lower**

HIST CORTESE:

**Actual:
15 ft.**

edr_fname:	SEA WORLD
edr_fadd1:	1720 SHORES
City,State,Zip:	SAN DIEGO, CA
Region:	CORTESE
Facility County Code:	37
Reg By:	WBC&D
Reg Id:	9 000000083

C67

**SEA WORLD MARINA
1660 S SHORES RD
SAN DIEGO, CA 92109**

FINDS

**1023330490
N/A**

**< 1/8
1 ft.**

Site 23 of 52 in cluster C

**Relative:
Lower**

FINDS:

**Actual:
15 ft.**

Registry ID:	110066250791
Environmental Interest/Information System	
STATE MASTER	

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C68
< 1/8
1 ft.

SEA WORLD
1720 S SHORES RD
SAN DIEGO, CA 92109

SWEEPS UST
HIST UST
CERS

1000136669
N/A

Site 24 of 52 in cluster C

Relative:
Lower

SWEEPS UST:

Actual:
15 ft.

Name: SEA WORLD
Address: 1720 S SHORES RD
City: SAN DIEGO
Status: Active
Comp Number: 905
Number: 9
Board Of Equalization: 44-021587
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000905-000001
Tank Status: A
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: 4

Name: SEA WORLD
Address: 1720 S SHORES RD
City: SAN DIEGO
Status: Active
Comp Number: 905
Number: 9
Board Of Equalization: 44-021587
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000905-000002
Tank Status: A
Capacity: 1000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: REG UNLEADED
Number Of Tanks: Not reported

Name: SEA WORLD
Address: 1720 S SHORES RD
City: SAN DIEGO
Status: Active
Comp Number: 905
Number: 9
Board Of Equalization: 44-021587
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000905-000006

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

1000136669

Tank Status: A
Capacity: 1000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: LEADED
Number Of Tanks: Not reported

Name: SEA WORLD
Address: 1720 S SHORES RD
City: SAN DIEGO
Status: Active
Comp Number: 905
Number: 9
Board Of Equalization: 44-021587
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000905-000007
Tank Status: A
Capacity: 2000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: LEADED
Number Of Tanks: Not reported

Name: SEA WORLD
Address: 1720 S SHORES RD
City: SAN DIEGO
Status: Not reported
Comp Number: 905
Number: Not reported
Board Of Equalization: 44-021587
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000905-000003
Tank Status: Not reported
Capacity: 300
Active Date: Not reported
Tank Use: PETROLEUM
STG: WASTE
Content: Not reported
Number Of Tanks: 3

Name: SEA WORLD
Address: 1720 S SHORES RD
City: SAN DIEGO
Status: Not reported
Comp Number: 905
Number: Not reported
Board Of Equalization: 44-021587
Referral Date: Not reported
Action Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

1000136669

Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000905-000004
Tank Status: Not reported
Capacity: 150
Active Date: Not reported
Tank Use: PETROLEUM
STG: WASTE
Content: Not reported
Number Of Tanks: Not reported

Name: SEA WORLD
Address: 1720 S SHORES RD
City: SAN DIEGO
Status: Not reported
Comp Number: 905
Number: Not reported
Board Of Equalization: 44-021587
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-000905-000005
Tank Status: Not reported
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: AVIA. GAS
Number Of Tanks: Not reported

HIST UST:

Name: SEA WORLD INC
Address: 1720 SOUTH SHORES ROAD
City,State,Zip: SAN DIEGO, CA 92109
File Number: 0002F2C8
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002F2C8.pdf>
Region: STATE
Facility ID: 00000011930
Facility Type: Other
Other Type: THEME PARK
Contact Name: GENE P. SCHOENESE
Telephone: 6192226363
Owner Name: SEA WORLD, INC.
Owner Address: 1720 SOUTH SHORES ROAD
Owner City,St,Zip: SAN DIEGO, CA 92109
Total Tanks: 0004

Tank Num: 001
Container Num: #01
Year Installed: Not reported
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

1000136669

Tank Num: 002
Container Num: #02
Year Installed: Not reported
Tank Capacity: 00001000
Tank Used for: PRODUCT
Type of Fuel: UNLEADED
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

Tank Num: 003
Container Num: #07
Year Installed: Not reported
Tank Capacity: 00000300
Tank Used for: WASTE
Type of Fuel: WASTE OIL
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

Tank Num: 004
Container Num: #08
Year Installed: Not reported
Tank Capacity: 00000150
Tank Used for: WASTE
Type of Fuel: WASTE OIL
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

[Click here for Geo Tracker PDF:](#)

CERS:

Name: SEA WORLD INC
Address: 1720 SOUTH SHORES ROAD
City,State,Zip: SAN DIEGO, CA 92109-7900
Site ID: 493171
CERS ID: 110002144019
CERS Description: US EPA Air Emission Inventory System (EIS)

Affiliation:

Affiliation Type Desc: Environmental Contact
Entity Name: JULIE BYFORDNA ENVIR MGMT
Entity Title: Not reported
Affiliation Address: 500 SEA WORLD DR
Affiliation City: SANDIEGO
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: UST PO Name
Entity Name: City of San Diego
Entity Title: Not reported
Affiliation Address: 500 SEA WORLD DRIVE
Affiliation City: SANDIEGO
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

1000136669

Affiliation Type Desc: Environmental Contact
Entity Name: JULIE BYFORD ENVIR MGMT
Entity Title: ENVIRONMENTAL CONTACT
Affiliation Address: 500 SEA WORLD DR
Affiliation City: SANDIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Environmental Contact
Entity Name: KEVIN CARR
Entity Title: WATER QUALITY MGR
Affiliation Address: 500 SEA WORLD DR
Affiliation City: SANDIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Facility Owner
Entity Name: CITY OF SAN DIEGO
Entity Title: OWNER
Affiliation Address: 500 SEA WORLD DRIVE
Affiliation City: SANDIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Operator
Entity Name: SEA WORLD
Entity Title: OPERATOR
Affiliation Address: 500 SEA WORLD DR
Affiliation City: SANDIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Environmental Contact
Entity Name: BUDDY BURTON
Entity Title: EHS DIRECTOR
Affiliation Address: 500 SEA WORLD DR
Affiliation City: SANDIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Public Contact
Entity Name: VALERIE S. NUNES
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD (Continued)

1000136669

Affiliation Zip: Not reported
Affiliation Phone: Not reported

C69

< 1/8
1 ft.

1660 S. SHORES ROAD
SAN DIEGO, CA 92109

CHMIRS S123298784
N/A

Site 25 of 52 in cluster C

Relative:
Lower

Actual:
15 ft.

CHMIRS:
Name: Not reported
Address: 1660 S. SHORES ROAD
City,State,Zip: SAN DIEGO, CA 92109
OES Incident Number: 18-5624
OES notification: 08/20/2018
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: Mission Bay
Spill Site: Waterways
Cleanup By: Unknown
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Type: PETROLEUM
Measure: Unknown
Other: Not reported
Date/Time: 800
Year: 2018
Agency: NRC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S123298784

Incident Date: 08/19/2018
Admin Agency: San Diego County Health Services Department
Amount: Not reported
Contained: Not stopped, Contained
Site Type: Mission Bay
E Date: Not reported
Substance: Unknown Oil
Quantity Released: Unknown
Unknown: Not reported
Substance #2: Not reported
Substance #3: Not reported
Evacuations: Not reported
Number of Injuries: Not reported
Number of Fatalities: Not reported
#1 Pipeline: No
#2 Pipeline: No
#3 Pipeline: No
#1 Vessel >= 300 Tons: No
#2 Vessel >= 300 Tons: Yes
#3 Vessel >= 300 Tons: No
Evacs: No
Injuries: No
Fatafs: No
Comments: Not reported
Description: Per NRC report: CALLER REPORTS A DISCHARGE OF AN UNKNOWN OIL DRIPPING FROM AN OUTBOARD ENGINE ON A VESSEL AT A MARINA. "

C70

1660 S. SHORES ROAD
SAN DIEGO, CA 92109

CHMIRS S118189292
N/A

< 1/8
1 ft.

Site 26 of 52 in cluster C

Relative:
Lower

CHMIRS:

Actual:
15 ft.

Name: Not reported
Address: 1660 S. SHORES ROAD
City, State, Zip: SAN DIEGO, CA 92109
OES Incident Number: 15-3891
OES notification: 07/08/2015
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S118189292

Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Ship/Harbor/Port
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Unknown
Other:	Not reported
Type:	PETROLEUM
Measure:	Unknown
Other:	Not reported
Date/Time:	820
Year:	2015
Agency:	NRC
Incident Date:	07/08/2015
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Gasoline
Quantity Released:	Unknown
Unknown:	Not reported
Substance #2:	Diesel Oil Unknown
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	Per the NRC Report: "Caller is reporting that a person was washing their vessel and gasoline/diesel fuel discharged into the water from the vessel."

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C71

CHMIRS

S114001210
N/A

< 1/8
1 ft.

1660 S. SHORES ROAD, SEAWORLD MARINA BERTH 142
SAN DIEGO, CA 92109

Site 27 of 52 in cluster C

Relative:
Lower

CHMIRS:

Actual:
15 ft.

Name: Not reported
Address: 1660 S. SHORES ROAD, SEAWORLD MARINA BERTH 142
City,State,Zip: SAN DIEGO, CA 92109
OES Incident Number: 13-5057
OES notification: 08/15/2013
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: Mission Bay
Spill Site: Waterways
Cleanup By: Reporting Party
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Gal(s)
Other: Not reported
Date/Time: 1700
Year: 2013
Agency: NRC
Incident Date: 8/15/2013
Admin Agency: San Diego County Health Services Department
Amount: Not reported
Contained: Yes
Site Type: Mission Bay
E Date: Not reported
Substance: Unknown Oil
Quantity Released: Unknown

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S114001210

Unknown: Not reported
Substance #2: Not reported
Substance #3: Not reported
Evacuations: Not reported
Number of Injuries: Not reported
Number of Fatalities: Not reported
#1 Pipeline: Not reported
#2 Pipeline: Not reported
#3 Pipeline: Not reported
#1 Vessel >= 300 Tons: Not reported
#2 Vessel >= 300 Tons: Not reported
#3 Vessel >= 300 Tons: Not reported
Evacs: Not reported
Injuries: Not reported
Fatafs: Not reported
Comments: Not reported
Description: Per NRC: "Caller is reporting a release of oil
from a boat at the marina, the cause is unknown."
Remedial Actions: "Booms applied"

C72

SEA WORLD MARINA
1660 S SHORES RD
SAN DIEGO, CA 92109

SAN DIEGO CO. SAM
LUST
CPS-SLIC
SWEEPS UST
CHMIRS
SAN DIEGO CO LOP
CERS

S105694533
N/A

< 1/8
1 ft.

Site 28 of 52 in cluster C

Relative:
Lower

Actual:
15 ft.

SAN DIEGO CO. SAM:

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921097903
Case Number: H21142-004
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: GW With No Beneficial Use Designation
Facility Status: Closed Case
Date: 10/31/2002
Date Began: 8/2/1991

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921097903
Case Number: H21142-002
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: Drinking Water Aquifer Impacted
Facility Status: Closed Case
Date: 1/10/1992
Date Began: 11/30/1987

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921097903
Case Number: H21142-003
Agency: DEH Site Assessment & Mitigation
Funding: Non Billable
Facility Type: Failed Integrity Test

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Facility Status: Closed Case
Date: 2/6/1989
Date Began: 9/1/1988

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921097903
Case Number: H21142-001
Agency: DEH Site Assessment & Mitigation
Funding: Non Billable
Facility Type: Failed Integrity Test
Facility Status: Closed Case
Date: 5/21/1987
Date Began: 5/1/1987

LUST:

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921097903
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607302766
Global Id: T0607302766
Latitude: 32.7657225
Longitude: -117.2309775
Status: Completed - Case Closed
Status Date: 01/10/1992
Case Worker: Not reported
RB Case Number: 9UT464
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H21142-002
Potential Media Affect: Aquifer used for drinking water supply
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:

Global Id: T0607302766
Action Type: Other
Date: 11/30/1987
Action: Leak Began

Global Id: T0607302766
Action Type: Other
Date: 11/30/1987
Action: Leak Discovery

Global Id: T0607302766
Action Type: Other
Date: 11/30/1987
Action: Leak Stopped

Global Id: T0607302766
Action Type: ENFORCEMENT
Date: 09/26/1986
Action: Notice of Responsibility

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Global Id: T0607302766
Action Type: Other
Date: 11/30/1987
Action: Leak Reported

LUST:

Global Id: T0607302766
Status: Open - Case Begin Date
Status Date: 09/26/1986

Global Id: T0607302766
Status: Completed - Case Closed
Status Date: 01/10/1992

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921097903
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607300861
Global Id: T0607300861
Latitude: 32.7627012
Longitude: -117.2241086
Status: Completed - Case Closed
Status Date: 10/31/2002
Case Worker: EM
RB Case Number: 9UT2091
Local Agency: SAN DIEGO COUNTY LOP
File Location: Local Agency
Local Case Number: H21142-004
Potential Media Affect: Other Groundwater (uses other than drinking water)
Potential Contaminants of Concern: Diesel
Site History: Not reported

LUST:

Global Id: T0607300861
Contact Type: Local Agency Caseworker
Contact Name: EWAN MOFFAT
Organization Name: SAN DIEGO COUNTY LOP
Address: P.O. Box 129261
City: San Diego
Email: ewan.moffat@sdcounty.ca.gov
Phone Number: Not reported

LUST:

Global Id: T0607300861
Action Type: Other
Date: 08/02/1991
Action: Leak Began

Global Id: T0607300861
Action Type: Other
Date: 08/02/1991
Action: Leak Discovery

Global Id: T0607300861

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Action Type: Other
Date: 08/02/1991
Action: Leak Stopped

Global Id: T0607300861
Action Type: ENFORCEMENT
Date: 12/09/1991
Action: Notice of Responsibility

Global Id: T0607300861
Action Type: Other
Date: 11/22/1991
Action: Leak Reported

Global Id: T0607300861
Action Type: ENFORCEMENT
Date: 10/31/2002
Action: Closure/No Further Action Letter

LUST:

Global Id: T0607300861
Status: Open - Case Begin Date
Status Date: 08/02/1991

Global Id: T0607300861
Status: Completed - Case Closed
Status Date: 10/31/2002

CPS-SLIC:

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921097903
Region: STATE
Facility Status: Completed - Case Closed
Status Date: 02/06/1989
Global Id: T0608107147
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H21142-003
Latitude: 32.764786
Longitude: -117.230664
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Under Investigation
Potential Contaminants of Concern: Gasoline
Site History: Not reported

Click here to access the California GeoTracker records for this facility:

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921097903
Region: STATE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Facility Status:	Completed - Case Closed
Status Date:	05/21/1987
Global Id:	T0608117690
Lead Agency:	SAN DIEGO COUNTY LOP
Lead Agency Case Number:	H21142-001
Latitude:	32.76546
Longitude:	-117.22383
Case Type:	Cleanup Program Site
Case Worker:	Not reported
Local Agency:	Not reported
RB Case Number:	Not reported
File Location:	Local Agency
Potential Media Affected:	Under Investigation
Potential Contaminants of Concern:	Diesel
Site History:	Not reported

[Click here to access the California GeoTracker records for this facility:](#)

SWEEPS UST:

Name:	SEA WORLD MARINA
Address:	1660 S SHORES RD
City:	SAN DIEGO
Status:	Active
Comp Number:	21142
Number:	9
Board Of Equalization:	44-023450
Referral Date:	Not reported
Action Date:	06-26-92
Created Date:	02-29-88
Owner Tank Id:	Not reported
SWRCB Tank Id:	Not reported
Tank Status:	Not reported
Capacity:	Not reported
Active Date:	Not reported
Tank Use:	Not reported
STG:	Not reported
Content:	Not reported
Number Of Tanks:	Not reported

Name:	SEA WORLD MARINA
Address:	1660 S SHORES RD
City:	SAN DIEGO
Status:	Not reported
Comp Number:	21142
Number:	Not reported
Board Of Equalization:	44-023450
Referral Date:	Not reported
Action Date:	Not reported
Created Date:	Not reported
Owner Tank Id:	Not reported
SWRCB Tank Id:	37-000-021142-000001
Tank Status:	Not reported
Capacity:	10000
Active Date:	Not reported
Tank Use:	M.V. FUEL
STG:	PRODUCT
Content:	REG UNLEADED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Number Of Tanks: 4

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City: SAN DIEGO
Status: Not reported
Comp Number: 21142
Number: Not reported
Board Of Equalization: 44-023450
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021142-000002
Tank Status: Not reported
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: LEADED
Number Of Tanks: Not reported

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City: SAN DIEGO
Status: Not reported
Comp Number: 21142
Number: Not reported
Board Of Equalization: 44-023450
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021142-000003
Tank Status: Not reported
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: WASTE
Content: OTHER
Number Of Tanks: Not reported

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City: SAN DIEGO
Status: Not reported
Comp Number: 21142
Number: Not reported
Board Of Equalization: 44-023450
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021142-000004
Tank Status: Not reported
Capacity: 10000
Active Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: Not reported

CHMIRS:

Name: Not reported
Address: 1660 S. SHORES ROAD
City,State,Zip: SAN DIEGO, CA 92109
OES Incident Number: 18-2098
OES notification: 03/31/2018
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: San Diego Bay
Spill Site: Merchant/Business
Cleanup By: Unknown
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Type: PETROLEUM
Measure: Sheen
Other: Not reported
Date/Time: 630
Year: 2018
Agency: NRC
Incident Date: 03/31/2018
Admin Agency: San Diego County Health Services Department
Amount: Not reported
Contained: Unknown

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Site Type:	San Diego Bay
E Date:	Not reported
Substance:	Unknown Oil
Quantity Released:	See Description
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	According to NRC #1208142, Caller stated that they observed an unknown sheen from an unknown source on the waters of the San Diego Bay. The length and width of the sheen is unknown, however the sheen has a rainbow coloration with a diesel odor. Per the RP, The size of the sheen is covering the entire 209 foot marina and the sheen appears to be coming in from the bay. The marinas environmental manger and the USCG Pollution Responders are enroute to the scene. No remedial action is being taken at this time, due to the sheen being to large to contain.
Name:	Not reported
Address:	1660 S. SHORES ROAD
City,State,Zip:	SAN DIEGO, CA 92109
OES Incident Number:	18-1904
OES notification:	03/23/2018
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	San Diego Bay
Spill Site:	Waterways
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Sheen
Other:	Not reported
Date/Time:	720
Year:	2018
Agency:	NRC
Incident Date:	03/23/2018
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown
Site Type:	San Diego Bay
E Date:	Not reported
Substance:	Oil, unknown type
Quantity Released:	Unknown
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	Per NRC #1207509, "Caller reported an unknown sheen from an unknown source." AFFECTED MEDIUM: San Diego Bay REMEDIAL ACTIONS: None
Name:	Not reported
Address:	1660 S. SHORES ROAD
City,State,Zip:	SAN DIEGO, CA 92109
OES Incident Number:	18-1900
OES notification:	03/23/2018
OES Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	San Diego Bay
Spill Site:	Ship/Harbor/Port
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Unknown
Other:	Not reported
Date/Time:	720
Year:	2018
Agency:	NRC
Incident Date:	03/23/2018
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	No
Site Type:	San Diego Bay
E Date:	Not reported
Substance:	Oil
Quantity Released:	Unknown
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	NRC REPORT #1207509 "CALLER REPORTED AN UNKNOWN SHEEN FROM AN UNKNOWN SOURCE"
Name:	Not reported
Address:	1660 S. SHORES ROAD
City,State,Zip:	SAN DIEGO, CA 92109
OES Incident Number:	18-1415
OES notification:	03/03/2018
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	MISSION BAY
Spill Site:	Waterways
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Gal(s)
Other:	Not reported
Date/Time:	1515
Year:	2018

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Agency:	NRC
Incident Date:	03/03/2018
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown
Site Type:	MISSION BAY
E Date:	Not reported
Substance:	OIL
Quantity Released:	1
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	PER NRC "CALLER REPORTED A RELEASE OF MATERIALS DUE TO A FAULTY SYSTEM." Type: PLEASURE CRAFT REMEDIAL ACTIONS: CLEAN UP UNDERWAY
Name:	Not reported
Address:	1660 S. SHORES ROAD
City,State,Zip:	SAN DIEGO, CA 92109
OES Incident Number:	4-0493
OES notification:	01/26/2014
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	San Diego Harbor
Spill Site:	Waterways
Cleanup By:	No
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	N/A
Other:	Not reported
Date/Time:	1315
Year:	2014
Agency:	NRC
Incident Date:	1/26/2014
Admin Agency:	Not reported
Amount:	Not reported
Contained:	Yes
Site Type:	San Diego Harbor
E Date:	Not reported
Substance:	Waste Oil
Quantity Released:	2 drops
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	Mechanical
Fatals:	No
Comments:	Not reported
Description:	per NRC #1072184 "The caller is reporting a discharge of bilge water into mission bay. The caller stated that a vessels bilge pump kicked on automatically pumping the material overboard." Remedial actions: "Booms applied, absorbents applied, material is non-recoverable." Sheen size: 20 ft X 10 ft

SAN DIEGO CO LOP:

Name:	SEA WORLD MARINA
Address:	1660 S SHORES RD
City,State,Zip:	SAN DIEGO, CA 92109-7903
Record ID:	DEH1991-LSAM-H21142-004
Record Status:	Completed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Opened Date: 11/22/1991
Parcel Number: 435-480-15-00
Case Type: LOP - Local Oversight Program
Historical Name: SEA WORLD HYDRO DOCK
SWRCB Global ID: T0607300861
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 12/06/1991
Census Tract: 76.00
Community: Not reported
Jurisdiction: Not reported
Watershed Basin Number: 906.70
Water Purveyor: Not reported
Fire Agency: Not reported
Latitude: Not reported
Longitude: Not reported
X MapCoord: Not reported
Y MapCoord: Not reported

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109-7903
Record ID: DEH1987-LSAM-H21142-002
Record Status: Completed
Opened Date: 11/30/1987
Parcel Number: 435-480-15-00
Case Type: LOP - Local Oversight Program
Historical Name: SEA WORLD MARINA
SWRCB Global ID: T0607302766
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 12/01/1987
Census Tract: 76.00
Community: Not reported
Jurisdiction: Not reported
Watershed Basin Number: 906.70
Water Purveyor: Not reported
Fire Agency: Not reported
Latitude: Not reported
Longitude: Not reported
X MapCoord: Not reported
Y MapCoord: Not reported

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109-7903
Record ID: DEH1987-LSAM-H21142-001
Record Status: Completed
Opened Date: 05/01/1987
Parcel Number: 435-480-15-00
Case Type: FIT - Failed Integrity Test
Historical Name: SEA WORLD MARINA
SWRCB Global ID: T0608117690
Funding: N - Non-Billable
Lead Agency: DEH/SAM
Lead Agency Date: 05/01/1987
Census Tract: 76.00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Community: Not reported
Jurisdiction: Not reported
Watershed Basin Number: 906.70
Water Purveyor: Not reported
Fire Agency: Not reported
Latitude: Not reported
Longitude: Not reported
X MapCoord: Not reported
Y MapCoord: Not reported

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109-7903
Record ID: DEH1989-LSAM-H21142-003
Record Status: Completed
Opened Date: 01/23/1989
Parcel Number: 435-480-15-00
Case Type: FIT - Failed Integrity Test
Historical Name: SEA WORLD MARINA
SWRCB Global ID: T0608107147
Funding: N - Non-Billable
Lead Agency: DEH/SAM
Lead Agency Date: 01/23/1989
Census Tract: 76.00
Community: Not reported
Jurisdiction: Not reported
Watershed Basin Number: 906.70
Water Purveyor: Not reported
Fire Agency: Not reported
Latitude: Not reported
Longitude: Not reported
X MapCoord: Not reported
Y MapCoord: Not reported

CERS:

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921097903
Site ID: 204360
CERS ID: T0607300861
CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker
Entity Name: EWAN MOFFAT - SAN DIEGO COUNTY LOP
Entity Title: Not reported
Affiliation Address: P.O. Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921097903

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

S105694533

Site ID: 204360
CERS ID: T0608117690
CERS Description: Cleanup Program Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker
Entity Name: EWAN MOFFAT - SAN DIEGO COUNTY LOP
Entity Title: Not reported
Affiliation Address: P.O. Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921097903
Site ID: 204360
CERS ID: T0608107147
CERS Description: Cleanup Program Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker
Entity Name: EWAN MOFFAT - SAN DIEGO COUNTY LOP
Entity Title: Not reported
Affiliation Address: P.O. Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Name: SEA WORLD MARINA
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921097903
Site ID: 204360
CERS ID: T0607302766
CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker
Entity Name: EWAN MOFFAT - SAN DIEGO COUNTY LOP
Entity Title: Not reported
Affiliation Address: P.O. Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

C73 **SEA WORLD, PEREZ COVE MARINA** **RGA LUST** **S114684310**
1660 SOUTH SHORES RD
< 1/8 **SAN DIEGO, CA** **N/A**
1 ft.

Site 29 of 52 in cluster C

Relative:
Lower
Actual:
15 ft.

RGALUST:
Name: SEA WORLD, PEREZ COVE MARINA
Address: 1660 SOUTH SHORES RD
City: SAN DIEGO
State: SAN DIEGO
2001 SEA WORLD, PEREZ COVE MARINA 1660 SOUTH SHORES RD
Name: SEA WORLD, PEREZ COVE MARINA
Address: 1660 SOUTH SHORES RD
City: SAN DIEGO
State: SAN DIEGO
2000 SEA WORLD, PEREZ COVE MARINA 1660 SOUTH SHORES RD
Name: SEA WORLD, PEREZ COVE MARINA
Address: 1660 SOUTH SHORES RD
City: SAN DIEGO
State: SAN DIEGO
1998 SEA WORLD, PEREZ COVE MARINA 1660 SOUTH SHORES RD
Name: SEA WORLD, PEREZ COVE MARINA
Address: 1660 SOUTH SHORES RD
City: SAN DIEGO
State: SAN DIEGO
1997 SEA WORLD, PEREZ COVE MARINA 1660 SOUTH SHORES RD
Name: SEA WORLD, PEREZ COVE MARINA
Address: 1660 SOUTH SHORES RD
City: SAN DIEGO
State: SAN DIEGO
1996 SEA WORLD, PEREZ COVE MARINA 1660 SOUTH SHORES RD

C74 **1660 S. SHORES ROAD, SLIP 406** **CHMIRS** **S119000583**
< 1/8 **SAN DIEGO, CA** **N/A**
1 ft.

Site 30 of 52 in cluster C

Relative:
Lower
Actual:
15 ft.

CHMIRS:
Name: Not reported
Address: 1660 S. SHORES ROAD, SLIP 406
City,State,Zip: SAN DIEGO, CA
OES Incident Number: 16-5498
OES notification: 09/09/2016
OES Date: Not reported
OES Time: Not reported
Date Completed: **Not reported**
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S119000583

Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	MISSION BAY
Spill Site:	Waterways
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Sheen
Other:	Not reported
Date/Time:	650
Year:	2016
Agency:	NRC
Incident Date:	09/09/2016
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown
Site Type:	MISSION BAY
E Date:	Not reported
Substance:	Motor Oil
Quantity Released:	300 yds x 20 ft
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	NRC Report states: "CALLER IS REPORTING A RELEASE OF MOTOR OIL FROM A VESSEL FOR UNKNOWN REASONS INTO MISSION BAY. Vessel Name: FINOLOGOYIV, Number: 1129860, 33ft fiberglass hull Pleasure Craft. REMEDIAL ACTIONS: NOTIFICATIONS. SORBENT BOOM AND PADS APPLI

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C75

< 1/8
1 ft.

1660 S. SHORES ROAD
SAN DIEGO, CA 92109

Site 31 of 52 in cluster C

ERNS 2015122161
N/A

Relative:
Lower

Actual:
15 ft.

Incident Commons:

NRC Report #:

1122161

Description of Incident:

CALLER IS REPORTING THAT A PERSON WAS WASHING THEIR VESSEL AND
GASOLINE/ DIESEL FUEL DISCHARGED INTO THE WATER FROM THE VESSEL.

Type of Incident:

VESSEL

Incident Cause:

OPERATOR ERROR

Incident Date Time:

2015-07-08 08:20:00

Incident DTG:

OCCURRED

Incident Location:

Not reported

Loaction Address:

1660 S. SHORES ROAD

Location Street 1:

Not reported

Location Street 2:

Not reported

Location Nearest City:

SAN DIEGO

Location State:

CA

Location County:

SAN DIEGO

Location Zip:

92109

Distance From City:

Not reported

Distance Units:

Not reported

Direction From City:

Not reported

Lat Deg:

Not reported

Lat Min:

Not reported

Lat Sec:

Not reported

Lat Quad:

Not reported

Long Deg:

Not reported

Long Min:

Not reported

Long Sec:

Not reported

Long Quad:

Not reported

Location Section:

Not reported

Location Township:

Not reported

Location range:

Not reported

Potential Range:

N

Incidents:

NRC Report #:

1122161

Aircraft Type:

Not reported

Aircraft Model:

Not reported

Aircraft ID:

Not reported

Aircraft Fuel Capacity:

Not reported

Aircraft Fuel Capacity Units:

Not reported

Aircraft Fuel on Board:

Not reported

Aircraft Fuel on Board Units:

Not reported

Aircraft Spot Number:

Not reported

Aircraft Hanger:

Not reported

Aircraft Runway Number:

Not reported

Road Mile Marker:

Not reported

Building ID:

Not reported

Type of Fixed Object:

Not reported

Power Generating Facility:

U

Generating Capacity:

Not reported

Type of Fuel:

Not reported

NPDES:

Not reported

NPDES Compliance:

U

Pipeline Type:

Not reported

DOT Regulated:

U

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2015122161

Pipeline Above Ground:	ABOVE
Exposed Underwater:	N
Pipeline Covered:	U
Railroad Hotline:	Not reported
Grade Crossing:	U
Location Subdivision:	Not reported
Railroad Milepost:	Not reported
Type Vehicle Involved:	Not reported
Crossing Device Type:	Not reported
Device Operational:	U
DOT Crossing Number:	Not reported
Brake Failure:	U
Description of Tank:	Not reported
Tank Above Ground:	ABOVE
Transportable Container:	U
Tank Regulated:	U
Tank Regulated By:	Not reported
Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSP Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	Not reported
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	U
Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U
Airbag Deployed:	U
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2015122161

Other Employee Testing: Not reported
Unknown Testing: Not reported
Passenger Handling: Not reported
Passenger Route: XXX
Passenger Delay: XXX

Incident Details:

NRC Report #: 1122161
Fire Involved: N
Fire Extinguished: U
Any Evacuations: N
Number Evacuated: Not reported
Who Evacuated: Not reported
Radius of Evacuation: Not reported
Any Injuries: N
Number Injured: Not reported
Number Hospitalized: Not reported
Any Fatalities: N
Number Fatalities: Not reported
Any Damages: N
Damage Amount: Not reported
Air Corridor Closed: N
Air Corridor Desc: Not reported
Air Closure Time: Not reported
Waterway Closed: N
Waterway Desc: Not reported
Waterway Closure Time: Not reported
Road Closed: N
Road Desc: Not reported
Road Closure Time: Not reported
Closure Direction: Not reported
Major Artery: N
Track Closed: N
Track Desc: Not reported
Track Closure Time: Not reported
Media Interest: UNKNOWN
Medium Desc: WATER
Additional Medium Info: / MISSION BAY
Body of Water: MISSION BAY
Tributary of: PACIFIC OCEAN
Release Secured: U
Estimated Duration of Release: Not reported
Release rate: Not reported
Desc Remedial Action: Not reported
State Agency on Scene: Not reported
State Agency Report Number: Not reported
Other Agency Notified: Not reported
Weather Conditions: UNKNOWN
Air Temperature: Not reported
Wind Speed: Not reported
Wind Direction: Not reported
Water Supply Contaminated: U
Sheen Size: Not reported
Sheen Color: RAINBOW
Direction of Sheen Travel: Not reported
Sheen Odor Description: Not reported
Wave Condition: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2015122161

Current Speed:	Not reported
Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	Not reported
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported
Passenger Injuries:	Not reported
Occupant Fatality:	Not reported
Current Speed Unit:	Not reported
Road Closure Units:	Not reported
Track Closure Units:	Not reported
Sheen Size Units:	Not reported
Additional Info:	Not reported
State Agency Notified:	Not reported
Federal Agency Notified:	USCG
nearest River Mile Marker:	Not reported
Sheen Size Length:	.5
Sheen Size Length Units:	MILES
Sheen Size Width:	Not reported
Sheen Size Width Units:	Not reported
Offshore:	N
Duration Unit:	Not reported
Release Rate Unit:	Not reported
Release Rate Rate:	Not reported
Passengers Transferred:	NO

Calls:

NRC Report #:	1122161
Site ID:	20151122161
Date Time Received:	2015-07-08 11:38:09
Date Time Complete:	2015-07-08 11:41:19
Call Type:	INC
Responsible Company:	Not reported
Responsible Org Type:	PRIVATE CITIZEN
Responsible City:	Not reported
Responsible State:	XX
Responsible Zip:	Not reported
On Behalf:	Not reported
Source:	TELEPHONE

Vessels Detail:

Site ID:	20151122161
Vessel Name:	N/A
Vessel Type:	PLEASURE CRAFT
Vessel Number:	Not reported
Vessel Length:	19
Hull Construction:	Not reported
Fuel Capacity:	Not reported
Fuel on Board:	Not reported
Cargo Capacity:	Not reported
Cargo on Board:	Not reported
Is Vessel Aground:	N
Flag:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2015122161

Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:
NRC Report #: 1122161
Chris Code: GAS
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: GASOLINE: AUTOMOTIVE (UNLEADED)
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

NRC Report #: 1122161
Chris Code: ODS
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: OIL: DIESEL
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

C76 SAMURAYA VESSEL# 943776
1660 S SHORES RD
< 1/8 SAN DIEGO, CA 92104
1 ft.

HAZNET S112948452
N/A

Site 32 of 52 in cluster C

Relative:
Lower

Actual:
15 ft.

HAZNET:
Name: SAMURAYA VESSEL# 943776
Address: 1660 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92104
Year: 2005
GEPAID: CAC002595304
Contact: DOUGLASS HIATT
Telephone: 6194211607
Mailing Name: Not reported
Mailing Address: 4210 CORRAL CANYON RD
Mailing City,St,Zip: BONITA, CA 91920
Gen County: San Diego
TSD EPA ID: CAT080033681
TSD County: Los Angeles
Tons: 0.417
CA Waste Code: 133-Aqueous solution with total organic residues 10 percent or more
Method: R01-Recycler
Facility County: San Diego

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C77
SEA WORLD HYDRO DOCK
1660 S SHORES RD
SAN DIEGO, CA
< 1/8
1 ft.

RGA LUST **S114684305**
N/A

Site 33 of 52 in cluster C

Relative:
Lower

RGA LUST:

Actual:
15 ft.

Name: SEA WORLD HYDRO DOCK
Address: 1660 S SHORES RD
City: SAN DIEGO
State: SAN DIEGO
2004 SEA WORLD HYDRO DOCK 1660 S SHORES RD
Name: SEA WORLD HYDRO DOCK
Address: 1660 S SHORES RD
City: SAN DIEGO
State: SAN DIEGO
2003 SEA WORLD HYDRO DOCK 1660 S SHORES RD

C78

1660 S. SHORES ROAD
SAN DIEGO, CA 92109
< 1/8
1 ft.

ERNS **2007851942**
N/A

Site 34 of 52 in cluster C

Relative:
Lower

Incident Commons:

Actual:
15 ft.

NRC Report #: 851942
Description of Incident: CALLER REPORTED THAT A PLEASURE CRAFT SANK AT THE SLIP DUE TO UNKNOWN CAUSES.
Type of Incident: VESSEL
Incident Cause: VESSEL SINKING
Incident Date Time: 2007-10-18 04:30:00
Incident DTG: OCCURRED
Incident Location: Not reported
Location Address: 1660 S. SHORES ROAD
Location Street 1: Not reported
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N

Incidents:

NRC Report #: 851942
Aircraft Type: Not reported
Aircraft Model: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2007851942

Aircraft ID:	Not reported
Aircraft Fuel Capacity:	Not reported
Aircraft Fuel Capacity Units:	Not reported
Aircraft Fuel on Board:	Not reported
Aircraft Fuel on Board Units:	Not reported
Aircraft Spot Number:	Not reported
Aircraft Hanger:	Not reported
Aircraft Runway Number:	Not reported
Road Mile Marker:	Not reported
Building ID:	Not reported
Type of Fixed Object:	Not reported
Power Generating Facility:	U
Generating Capacity:	Not reported
Type of Fuel:	Not reported
NPDES:	Not reported
NPDES Compliance:	U
Pipeline Type:	Not reported
DOT Regulated:	U
Pipeline Above Ground:	ABOVE
Exposed Underwater:	N
Pipeline Covered:	U
Railroad Hotline:	Not reported
Grade Crossing:	U
Location Subdivision:	Not reported
Railroad Milepost:	Not reported
Type Vehicle Involved:	Not reported
Crossing Device Type:	Not reported
Device Operational:	Y
DOT Crossing Number:	Not reported
Brake Failure:	U
Description of Tank:	Not reported
Tank Above Ground:	ABOVE
Transportable Container:	U
Tank Regulated:	U
Tank Regulated By:	Not reported
Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSP Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	Not reported
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	U
Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U
Airbag Deployed:	U

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2007851942

Date Tiem Normal Service: Not reported
Service Disruption Time: Not reported
Service Disruption Units: Not reported
Transit Bus Flag: Not reported
CR Begin Date: Not reported
CR End Date: Not reported
CR Change Date: Not reported
FBI Contact: Not reported
FBI Contact Date Time: Not reported
Sub Part C Testing Req: XXX
Conductor Testing: Not reported
Engineer Testing: Not reported
Trainman Testing: Not reported
Yard Foreman Testing: Not reported
RCL Operator Testing: Not reported
Brakeman Testing: Not reported
Train Dispatcher Testing: Not reported
Signalman Testing: Not reported
Other Employee Testing: Not reported
Unknown Testing: Not reported
Passenger Handling: Not reported
Passenger Route: XXX
Passenger Delay: XXX

Incident Details:

NRC Report #: 851942
Fire Involved: N
Fire Extinguished: U
Any Evacuations: N
Number Evacuated: Not reported
Who Evacuated: Not reported
Radius of Evacuation: Not reported
Any Injuries: N
Number Injured: Not reported
Number Hospitalized: Not reported
Any Fatalities: N
Number Fatalities: Not reported
Any Damages: N
Damage Amount: Not reported
Air Corridor Closed: N
Air Corridor Desc: Not reported
Air Closure Time: Not reported
Waterway Closed: N
Waterway Desc: Not reported
Waterway Closure Time: Not reported
Road Closed: N
Road Desc: Not reported
Road Closure Time: Not reported
Closure Direction: Not reported
Major Artery: N
Track Closed: N
Track Desc: Not reported
Track Closure Time: Not reported
Media Interest: NONE
Medium Desc: WATER
Additional Medium Info: MISSION BAY
Body of Water: MISSION BAY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2007851942

Tributary of: PACIFIC OCEAN
Release Secured: N
Estimated Duration of Release: Not reported
Release rate: Not reported
Desc Remedial Action: PADS WERE PLACED ON THE WATER, OWNER IS CALLING SEATOW TO REMOVE THE VESSEL FROM THE WATER.
State Agency on Scene: Not reported
State Agency Report Number: NO REPORT #
Other Agency Notified: Not reported
Weather Conditions: OVERCAST
Air Temperature: 65
Wind Speed: Not reported
Wind Direction: Not reported
Water Supply Contaminated: N
Sheen Size: Not reported
Sheen Color: Not reported
Direction of Sheen Travel: Not reported
Sheen Odor Description: Not reported
Wave Condition: Not reported
Current Speed: Not reported
Current Direction: Not reported
Water Temperature: Not reported
Track Close Dir: Not reported
Empl Fatality: Not reported
Pass Fatality: Not reported
Community Impact: Not reported
Wind Speed Unit: Not reported
Employee Injuries: Not reported
Passenger Injuries: Not reported
Occupant Fatality: Not reported
Current Speed Unit: Not reported
Road Closure Units: Not reported
Track Closure Units: Not reported
Sheen Size Units: Not reported
Additional Info: CALLER HAD NO FURTHER INFORMATION.
State Agency Notified: NONE
Federal Agency Notified: USCG
nearest River Mile Marker: Not reported
Sheen Size Length: Not reported
Sheen Size Length Units: Not reported
Sheen Size Width: Not reported
Sheen Size Width Units: Not reported
Offshore: N
Duration Unit: Not reported
Release Rate Unit: Not reported
Release Rate Rate: Not reported
Passengers Transferred: NO

Calls:

NRC Report #: 851942
Site ID: 2007851942
Date Time Received: 2007-10-18 09:46:11
Date Time Complete: 2007-10-18 09:52:30
Call Type: INC
Responsible Company: Not reported
Responsible Org Type: PRIVATE CITIZEN
Responsible City: SAN DIEGO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2007851942

Responsible State: CA
Responsible Zip: 92110
On Behalf: N
Source: TELEPHONE

Vessels Detail:

Site ID: 2007851942
Vessel Name: NONE
Vessel Type: PLEASURE CRAFT
Vessel Number: 4224 AV
Vessel Length: Not reported
Hull Construction: Not reported
Fuel Capacity: Not reported
Fuel on Board: Not reported
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: N
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 851942
Chris Code: GAS
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: GASOLINE: AUTOMOTIVE (UNLEADED)
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

C79

SEA WORLD, PEREZ COVE MARINA
1660 SOUTH SHORES DR
SAN DIEGO, CA

RGA LUST S114684309
N/A

< 1/8
1 ft.

Site 35 of 52 in cluster C

Relative:
Lower

RGA LUST:

Name: SEA WORLD, PEREZ COVE MARINA
Address: 1660 SOUTH SHORES DR
City: SAN DIEGO
State: SAN DIEGO
1995 SEA WORLD, PEREZ COVE MARINA 1660 SOUTH SHORES DR
Name: SEA WORLD, PEREZ COVE MARINA
Address: 1660 SOUTH SHORES DR
City: SAN DIEGO
State: SAN DIEGO
1994 SEA WORLD, PEREZ COVE MARINA 1660 SOUTH SHORES DR
Name: SEA WORLD, PEREZ COVE MARINA
Address: 1660 SOUTH SHORES DR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD, PEREZ COVE MARINA (Continued)

S114684309

City: SAN DIEGO
State: SAN DIEGO
1993 SEA WORLD, PEREZ COVE MARINA 1660 SOUTH SHORES DR

C80 **SEA WORLD SAN DIEGO**
1720 S SHORES RD
SAN DIEGO, CA 92109
< 1/8
1 ft.

HAZNET **S113010299**
N/A

Site 36 of 52 in cluster C

Relative:
Lower

Actual:
15 ft.

HAZNET:
Name: SEA WORLD SAN DIEGO
Address: 1720 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921090000
Year: 2017
GEPAID: CAD981687221
Contact: JULIE BYFORD
Telephone: 6192253247
Mailing Name: Not reported
Mailing Address: 500 SEAWORLD DR
Mailing City,St,Zip: SAN DIEGO, CA 921097995
Gen County: San Diego
TSD EPA ID: ARD069748192
TSD County: 99
Tons: 0.029
CA Waste Code: -
Method: H040-Incineration--Thermal Destruction Other Than Use As A Fuel
Facility County: San Diego

Name: SEA WORLD SAN DIEGO
Address: 1720 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921090000
Year: 2016
GEPAID: CAD981687221
Contact: JULIE BYFORD
Telephone: 6192253247
Mailing Name: Not reported
Mailing Address: 500 SEAWORLD DR
Mailing City,St,Zip: SAN DIEGO, CA 921097995
Gen County: San Diego
TSD EPA ID: OHD980613541
TSD County: 99
Tons: 0.0165
CA Waste Code: 331-Off-specification, aged or surplus organics
Method: -
Facility County: San Diego

Name: SEA WORLD SAN DIEGO
Address: 1720 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921090000
Year: 2016
GEPAID: CAD981687221
Contact: JULIE BYFORD
Telephone: 6192253247
Mailing Name: Not reported
Mailing Address: 500 SEAWORLD DR
Mailing City,St,Zip: SAN DIEGO, CA 921097995
Gen County: San Diego

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD SAN DIEGO (Continued)

S113010299

TSD EPA ID: OHD980613541
TSD County: 99
Tons: 0.0025
CA Waste Code: 311-Pharmaceutical waste
Method: H040-Incineration--Thermal Destruction Other Than Use As A Fuel
Facility County: San Diego

Name: SEA WORLD SAN DIEGO
Address: 1720 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921090000
Year: 2016
GEPAID: CAD981687221
Contact: JULIE BYFORD
Telephone: 6192253247
Mailing Name: Not reported
Mailing Address: 500 SEAWORLD DR
Mailing City,St,Zip: SAN DIEGO, CA 921097995
Gen County: San Diego
TSD EPA ID: OHD980613541
TSD County: 99
Tons: 0.0025
CA Waste Code: 181-Other inorganic solid waste
Method: -
Facility County: San Diego

Name: SEA WORLD SAN DIEGO
Address: 1720 S SHORES RD
City,State,Zip: SAN DIEGO, CA 921090000
Year: 2016
GEPAID: CAD981687221
Contact: JULIE BYFORD
Telephone: 6192253247
Mailing Name: Not reported
Mailing Address: 500 SEAWORLD DR
Mailing City,St,Zip: SAN DIEGO, CA 921097995
Gen County: San Diego
TSD EPA ID: OHD980613541
TSD County: 99
Tons: 0.0055
CA Waste Code: 122-Alkaline solution without metals pH >= 12.5
Method: -
Facility County: San Diego

[Click this hyperlink](#) while viewing on your computer to access
418 additional CA_HAZNET: record(s) in the EDR Site Report.

C81

< 1/8
1 ft.

1660 S. SHORES ROAD
SAN DIEGO, CA 92109

Site 37 of 52 in cluster C

Relative:
Lower

Actual:
15 ft.

Incident Commons:

NRC Report #:

1174663

Description of Incident:

CALLER IS REPORTING THAT A 24' PLEASURE CRAFT SANK DUE TO UNKNOWN
CAUSES, CALLER STATES THAT THE OUTBOARD IS DISCHARGING A SMALL AMOUNT
OF GASOLINE INTO THE WATERWAY.
VESSEL

Type of Incident:

ERNS 2017174663
N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2017174663

Incident Cause: VESSEL SINKING
Incident Date Time: 2017-04-02 10:20:00
Incident DTG: DISCOVERED
Incident Location: Not reported
Location Address: 1660 S. SHORES ROAD
Location Street 1: SLIP 247
Location Street 2: Not reported
Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N

Incidents:

NRC Report #: 1174663
Aircraft Type: Not reported
Aircraft Model: Not reported
Aircraft ID: Not reported
Aircraft Fuel Capacity: Not reported
Aircraft Fuel Capacity Units: Not reported
Aircraft Fuel on Board: Not reported
Aircraft Fuel on Board Units: Not reported
Aircraft Spot Number: Not reported
Aircraft Hanger: Not reported
Aircraft Runway Number: Not reported
Road Mile Marker: Not reported
Building ID: Not reported
Type of Fixed Object: Not reported
Power Generating Facility: U
Generating Capacity: Not reported
Type of Fuel: Not reported
NPDES: Not reported
NPDES Compliance: U
Pipeline Type: Not reported
DOT Regulated: U
Pipeline Above Ground: ABOVE
Exposed Underwater: N
Pipeline Covered: U
Railroad Hotline: Not reported
Grade Crossing: U
Location Subdivision: Not reported
Railroad Milepost: Not reported
Type Vehicle Involved: Not reported
Crossing Device Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2017174663

Device Operational: U
DOT Crossing Number: Not reported
Brake Failure: U
Description of Tank: Not reported
Tank Above Ground: ABOVE
Transportable Container: U
Tank Regulated: U
Tank Regulated By: Not reported
Tank ID: Not reported
Capacity of Tank: Not reported
Capacity of Tank Units: Not reported
Actual Amount: Not reported
Actual Amount Units: Not reported
Platform Rig Name: Not reported
Platform Letter: Not reported
Location Area ID: Not reported
Location Block ID: Not reported
OCSG Number: Not reported
OCSP Number: Not reported
State Lease Number: Not reported
Pier Dock Number: Not reported
Berth Slip Number: Not reported
Continuous Release Type: Not reported
Initial Continuous Release No: Not reported
Continuous Release Permit: Not reported
Allision: U
Type of Structure: Not reported
Structure Name: Not reported
Structure Operational: U
Airbag Deployed: U
Date Tiem Normal Service: Not reported
Service Disruption Time: Not reported
Service Disruption Units: Not reported
Transit Bus Flag: Not reported
CR Begin Date: Not reported
CR End Date: Not reported
CR Change Date: Not reported
FBI Contact: Not reported
FBI Contact Date Time: Not reported
Sub Part C Testing Req: XXX
Conductor Testing: Not reported
Engineer Testing: Not reported
Trainman Testing: Not reported
Yard Foreman Testing: Not reported
RCL Operator Testing: Not reported
Brakeman Testing: Not reported
Train Dispatcher Testing: Not reported
Signalman Testing: Not reported
Other Employee Testing: Not reported
Unknown Testing: Not reported
Passenger Handling: Not reported
Passenger Route: XXX
Passenger Delay: XXX

Incident Details:

NRC Report #: 1174663
Fire Involved: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2017174663

Fire Extinguished:	U
Any Evacuations:	N
Number Evacuated:	Not reported
Who Evacuated:	Not reported
Radius of Evacuation:	Not reported
Any Injuries:	N
Number Injured:	Not reported
Number Hospitalized:	Not reported
Any Fatalities:	N
Number Fatalities:	Not reported
Any Damages:	N
Damage Amount:	Not reported
Air Corridor Closed:	N
Air Corridor Desc:	Not reported
Air Closure Time:	Not reported
Waterway Closed:	N
Waterway Desc:	Not reported
Waterway Closure Time:	Not reported
Road Closed:	N
Road Desc:	Not reported
Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported
Media Interest:	UNKNOWN
Medium Desc:	WATER
Additional Medium Info:	GASOLINE DISCHARGE TO MISSION BAY
Body of Water:	MISSION BAY
Tributary of:	PACIFIC OCEAN
Release Secured:	N
Estimated Duration of Release:	Not reported
Release rate:	Not reported
Desc Remedial Action:	USING ABSORBANT MATERIAL TO COLLECT GAS, CREW ONSITE RAISING VESSEL.
State Agency on Scene:	Not reported
State Agency Report Number:	Not reported
Other Agency Notified:	Not reported
Weather Conditions:	SUNNY
Air Temperature:	70
Wind Speed:	Not reported
Wind Direction:	Not reported
Water Supply Contaminated:	U
Sheen Size:	Not reported
Sheen Color:	RAINBOW
Direction of Sheen Travel:	Not reported
Sheen Odor Description:	Not reported
Wave Condition:	Not reported
Current Speed:	Not reported
Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	Not reported
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2017174663

Passenger Injuries: Not reported
Occupant Fatality: Not reported
Current Speed Unit: Not reported
Road Closure Units: Not reported
Track Closure Units: Not reported
Sheen Size Units: Not reported
Additional Info: Not reported
State Agency Notified: Not reported
Federal Agency Notified: USCG SEC SAN DIEGO
nearest River Mile Marker: Not reported
Sheen Size Length: Not reported
Sheen Size Length Units: Not reported
Sheen Size Width: Not reported
Sheen Size Width Units: Not reported
Offshore: N
Duration Unit: Not reported
Release Rate Unit: Not reported
Release Rate Rate: Not reported
Passengers Transferred: NO

Calls:

NRC Report #: 1174663
Site ID: 20171174663
Date Time Received: 2017-04-02 14:23:41
Date Time Complete: 2017-04-02 14:28:31
Call Type: INC
Responsible Company: Not reported
Responsible Org Type: PRIVATE CITIZEN
Responsible City: SAN DIEGO
Responsible State: CA
Responsible Zip: Not reported
On Behalf: Not reported
Source: TELEPHONE

Vessels Detail:

Site ID: 20171174663
Vessel Name: CF 8205 VF
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: 24
Hull Construction: Not reported
Fuel Capacity: Not reported
Fuel on Board: Not reported
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: N
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 1174663

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2017174663

Chris Code: GAS
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 0
Unit of Measure: UNKNOWN AMOUNT
Name of Material: GASOLINE: AUTOMOTIVE (UNLEADED)
If Reached Water: YES
Amount in Water: 0
Unit of Measure Reach Water: UNKNOWN AMOUNT

82

MISSION BAY LANDFILL
MISSION BAY - SEA WORLD DR
SAN DIEGO, CA 92109

CHMIRS
ENF
WDS
CIWQS

S105255842
N/A

< 1/8
1 ft.

Relative:
Lower
Actual:
18 ft.

CHMIRS:
Name: Not reported
Address: MISSION BAY
City,State,Zip: SAN DIEGO, CA
OES Incident Number: 3-4193
OES notification: 08/17/2003
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: Mission Bay
Spill Site: Not reported
Cleanup By: none
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL (Continued)

S105255842

Date/Time:	Not reported
Year:	2003
Agency:	NRC
Incident Date:	8/17/200312:00:00 AM
Admin Agency:	San Diego County Health Services Dept.
Amount:	Not reported
Contained:	Unknown
Site Type:	Waterways
E Date:	Not reported
Substance:	Unk. Oil
Gallons:	0.000000
Sheen:	500
Unknown:	0
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	Per fax from the NRC: MSO was notified from USCGC Haddock of a spill, possibly from a recreational vessel. Material dissipating, no clean up. Duty Officer responded and no source could be determined, material could not be recovered.
Name:	Not reported
Address:	MISSION BAY
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	7-1545
OES notification:	03/10/2007
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL (Continued)

S105255842

Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Not reported
Waterway:	Mission Bay
Spill Site:	Not reported
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Date/Time:	Not reported
Year:	2007
Agency:	NRC
Incident Date:	3/10/2007 12:00:00 AM
Admin Agency:	San Diego County Health Services Dept.
Amount:	Not reported
Contained:	Unknown
Site Type:	Ship/Harbor/Port
E Date:	Not reported
Substance:	unknown oil
Gallons:	0.000000
Unknown:	0
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	Per NRC fax: "Caller stated there is an unknown sheen in the San Diego harbor." Remedial Actions: None. Sheen size: 20ft x 30ft. Color: Slivery./
Name:	Not reported
Address:	MISSION BAY
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	7-4062
OES notification:	07/06/2007
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL (Continued)

S105255842

Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Not reported
Waterway:	Mission Bay
Spill Site:	Not reported
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Date/Time:	Not reported
Year:	2007
Agency:	NRC
Incident Date:	7/6/2007 12:00:00 AM
Admin Agency:	San Diego County Health Services Dept.
Amount:	Not reported
Contained:	Unknown
Site Type:	Waterways
E Date:	Not reported
Substance:	Oil
Gallons:	0.000000
Unknown:	0
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL (Continued)

S105255842

Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	As per the NRC report " The caller is reporting a unknown sheen sighting in Mission Bay."
Name:	Not reported
Address:	MISSION BAY
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	6-5693
OES notification:	09/24/2006
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Not reported
Waterway:	Mission Bay
Spill Site:	Not reported
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Date/Time:	Not reported
Year:	2006
Agency:	NRC
Incident Date:	9/24/2006 12:00:00 AM
Admin Agency:	San Diego County Health Services Dept.
Amount:	Not reported
Contained:	Yes
Site Type:	Ship/Harbor/Port,Waterways
E Date:	Not reported
Substance:	Gasoline

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL (Continued)

S105255842

Gallons:	0.000000
Unknown:	0
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	Per NRC Fax, The caller is reporting a release of materials into Mission Bay from a vessel due to vessel sinking. Sheen size is 40 Ft X 20 Ft.
Name:	Not reported
Address:	MISSION BAY
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	3-4217
OES notification:	08/18/2003
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Not reported
Cleanup By:	Unknown

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL (Continued)

S105255842

Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Date/Time:	Not reported
Year:	2003
Agency:	NRC
Incident Date:	8/18/200312:00:00 AM
Admin Agency:	San Diego County Health Services Dept.
Amount:	Not reported
Contained:	Yes
Site Type:	Waterways
E Date:	Not reported
Substance:	Unknown oil
Gallons:	0.000000
Sheen:	2
Unknown:	0
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	Per NRC; Reporting material released from a vessel due to a failed bilge pump.
Name:	Not reported
Address:	MISSION BAY
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	0-1827
OES notification:	04/23/2000
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL (Continued)

S105255842

Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Not reported
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Date/Time:	Not reported
Year:	2000
Agency:	DFG
Incident Date:	4/23/200012:00:00 AM
Admin Agency:	San Diego County Health Services Dept.
Amount:	Not reported
Contained:	Yes
Site Type:	Waterways
E Date:	Not reported
Substance:	oil
Gallons:	0.000000
Quarts:	4
Unknown:	0
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	The vessel "That's Life" sank. 4 qts. of oil released into the water. It has already been cleaned up.
Name:	Not reported
Address:	MISSION BAY
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	12-3491
OES notification:	06/15/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL (Continued)

S105255842

OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personnel # Of Decontaminated:	Not reported
Responding Agency Personnel # Of Injuries:	Not reported
Responding Agency Personnel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Ship/Harbor/Port
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Unknown
Other:	Not reported
Date/Time:	745
Year:	2012
Agency:	NRC
Incident Date:	6/15/2012
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Unknown Oil
Quantity Released:	Unknown
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL (Continued)

S105255842

#2 Vessel >= 300 Tons: Not reported
#3 Vessel >= 300 Tons: Not reported
Evacs: Not reported
Injuries: Not reported
Fataals: Not reported
Comments: Not reported
Description: Per NRC Fax: Caller reported a sheen believed to be coming from a unmarked pleasure craft that sank. Sheen Color is Rainbow, Sheen size is 80 Yards X 20 Yards.

ENF:

Name: MISSION BAY LANDFILL
Address: MISSION BAY - SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 240934
Agency Name: San Diego City Environmental Services (Development Services Inspections)
Place Type: Waste Management Unit
Place Subtype: Land fill
Facility Type: Solid Waste Class III - nonhazardous solid wastes
Agency Type: City Agency
Of Agencies: 1
Place Latitude: Not reported
Place Longitude: Not reported
SIC Code 1: 4953
SIC Desc 1: Refuse Systems
SIC Code 2: Not reported
SIC Desc 2: Not reported
SIC Code 3: Not reported
SIC Desc 3: Not reported
NAICS Code 1: Not reported
NAICS Desc 1: Not reported
NAICS Code 2: Not reported
NAICS Desc 2: Not reported
NAICS Code 3: Not reported
NAICS Desc 3: Not reported
Of Places: 1
Source Of Facility: Reg Meas
Design Flow: 0
Threat To Water Quality: 1
Complexity: B
Pretreatment: X - Facility is not a POTW
Facility Waste Type: Solid wastes, NEC
Facility Waste Type 2: Not reported
Facility Waste Type 3: Not reported
Facility Waste Type 4: Not reported
Program: LFNONOPER
Program Category1: LNDISP
Program Category2: LNDISP
Of Programs: 1
WDID: 9 000000378
Reg Measure Id: 213843
Reg Measure Type: Enrollee
Region: 9
Order #: R9-2012-0002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL (Continued)

S105255842

Npdes# CA#:	Not reported
Major-Minor:	Not reported
Npdes Type:	Not reported
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	Not reported
Application Fee Amt Received:	Not reported
Status:	Active
Status Date:	11/12/2014
Effective Date:	06/13/2012
Expiration/Review Date:	06/13/2017
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Y
Individual/General:	I
Fee Code:	59 - Land Disposal Site not paying tipping fee
Direction/Voice:	Passive
Enforcement Id(EID):	235654
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	13267 Letter
Effective Date:	06/25/2001
Adoption/Issuance Date:	Not reported
Achieve Date:	2001-09-30
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000378
Description:	WC13267 letter requesting sample results from all existing groundwater monitoring wells located at Mission Bay Landfill and adjacent Sea World expansion area. Reporting results to be consistent with requirements of Order 97-11.
Program:	LFNONOPER
Latest Milestone Completion Date:	2001-09-30
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0

WDS:

Name:	MISSION BAY LANDFILL
Address:	MISSION BAY - SEA WORLD DR
City:	SAN DIEGO
Facility ID:	San Diego 000000378
Facility Type:	Solid Waste Site-Class III - Landfills for non hazardous solid wastes.
Facility Status:	Active - Any facility with a continuous or seasonal discharge that is under Waste Discharge Requirements.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL (Continued)

S105255842

NPDES Number: Not reported
Subregion: 9
Facility Telephone: 8584925035
Facility Contact: GEORGE MORTON
Agency Name: SAN DIEGO CITY OF ENV SERV
Agency Address: 9601 RIDGEHAVEN CT STE 310
Agency City,St,Zip: SAN DIEGO 921231636
Agency Contact: STEVE FONTANA
Agency Telephone: 8584925077
Agency Type: City
SIC Code: 4953
SIC Code 2: Not reported
Primary Waste Type: Nonhazardous Solid Wastes/Influent or Solid Wastes that contain nonhazardous putrescible and non putrescible solid, semisolid, and liquid wastes (E.G., garbage, trash, refuse, paper, demolition and construction wastes, manure, vegetable or animal solid and semisolid waste).

Primary Waste: SLDWST
Waste Type2: Not reported
Waste2: Solid Wastes
Primary Waste Type: Nonhazardous Solid Wastes/Influent or Solid Wastes that contain nonhazardous putrescible and non putrescible solid, semisolid, and liquid wastes (E.G., garbage, trash, refuse, paper, demolition and construction wastes, manure, vegetable or animal solid and semisolid waste).

Secondary Waste: Not reported
Secondary Waste Type: Not reported
Design Flow: 0
Baseline Flow: 0
Reclamation: No reclamation requirements associated with this facility.
POTW: The facility is not a POTW.
Treat To Water: Major Threat to Water Quality. A violation could render unusable a ground water or surface water resource used as a significant drink water supply, require closure of an area used for contact recreation, result in long-term deleterious effects on shell fish spawning or growth areas of aquatic resources, or directly expose the public to toxic substances.

Complexity: Category B - Any facility having a physical, chemical, or biological waste treatment system (except for septic systems with subsurface disposal), or any Class II or III disposal site, or facilities without treatment systems that are complex, such as marinas with petroleum products, solid wastes, and sewage pump out facilities.

CIWQS:

Name: MISSION BAY LANDFILL
Address: MISSION BAY - SEA WORLD DR
City,State,Zip: SAN DIEGO, CA 92109
Agency: San Diego City Environmental Services (Development Services Inspections)
Agency Address: 9601 Ridgehaven Court 310, San Diego, CA 92123-1636
Place/Project Type: Land fill
SIC/NAICS: 4953
Region: 9
Program: LFNONOPER, LNDISP
Regulatory Measure Status: Active
Regulatory Measure Type: Enrollee
Order Number: R9-2012-0002
WDID: 9 000000378

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL (Continued)

S105255842

NPDES Number: Not reported
Adoption Date: 06/13/2012
Effective Date: 06/13/2012
Termination Date: Not reported
Expiration/Review Date: 06/13/2017
Design Flow: 0
Major/Minor: Not reported
Complexity: B
TTWQ: 1
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: Not reported
Longitude: Not reported

C83

**SEA WORLD INC
1720 SOUTH SHORES ROAD
SAN DIEGO, CA 92109**

**< 1/8
1 ft.**

**LUST 1000136668
FINDS N/A
ECHO**

Site 38 of 52 in cluster C

**Relative:
Lower
Actual:
15 ft.**

LUST REG 9:
Region: 9
Status: Remedial action (cleanup) Underway
Case Number: 9UT2091
Local Case: H21142-004
Substance: Diesel
Qty Leaked: Not reported
Abate Method: Enhanced Biodegradation - use of any available technology to promote bacterial decomposition of contaminants
Local Agency: San Diego
How Found: Other Means
How Stopped: Other Means
Source: Unknown
Cause: Unknown
Lead Agency: Local Agency
Case Type: Other ground water affected
Date Found: 12/06/1991
Date Stopped: 12/06/1991
Confirm Date: 09/13/1991
Submit Workplan: Not reported
Prelim Assess: 09/13/1991
Desc Pollution: Not reported
Remed Plan: 08/13/1997
Remed Action: 8/13/96
Began Monitor: Not reported
Release Date: 12/06/1991
Enforce Date: Not reported
Closed Date: Not reported
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: 4.5'
Beneficial Use: NBNB/E
NPDES Number: Not reported
Priority: 1B
File Dispn: File discarded, case closed
Interim Remedial Actions: No
Cleanup and Abatement order Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD INC (Continued)

1000136668

Waste Discharge Requirement Number: Not reported

FINDS:

Registry ID: 110002144019

Environmental Interest/Information System

US EPA TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

STATE MASTER

US EPA RACT/BACT/LAER Clearinghouse (RBLC) database contains case-specific information on the "Best Available" air pollution technologies that have been required to reduce the emission of air pollutants from stationary sources (e.g., power plants, steel mills, chemical plants, etc.). RACT, or Reasonably Available Control Technology, is required on existing sources in areas that are not meeting national ambient air quality standards. BACT, or Best Available Control Technology, is required on major new or modified sources in clean areas. LAER, or Lowest Achievable Emission Rate, is required on major new or modified sources in non-attainment areas.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000136668
Registry ID: 110002144019
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002144019>

C84

**SEA WORLD, PEREZ COVE MARINA
1660 SOUTH SHORES RD
SAN DIEGO, CA 92109**

**LUST S100731962
N/A**

**< 1/8
1 ft.**

Site 39 of 52 in cluster C

**Relative:
Lower**

LUST REG 9:

**Actual:
15 ft.**

Region: 9
Status: Case Closed
Case Number: 9UT464
Local Case: H21142-002
Substance: Gasoline
Qty Leaked: 0
Abate Method: Remove Free Product - remove floating product from water table
Local Agency: San Diego
How Found: Tank Test
How Stopped: Remove Contents
Source: Tank

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD, PEREZ COVE MARINA (Continued)

S100731962

Cause: Unknown
Lead Agency: Local Agency
Case Type: Other ground water affected
Date Found: 12/10/1987
Date Stopped: 12/11/1987
Confirm Date: 11/30/1987
Submit Workplan: Not reported
Prelim Assess: 10/10/1986
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 12/22/1987
Enforce Date: Not reported
Closed Date: 12/20/91
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: Not reported
Beneficial Use: NBNB/E
NPDES Number: Not reported
Priority: High priority
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

C85 **SEA WORLD MARINA**
1660 SOUTH SHORES ROAD
SAN DIEGO, CA 92109

HIST UST **U001572801**
N/A

< 1/8
1 ft.

Site 40 of 52 in cluster C

Relative:
Lower

HIST UST:

Actual:
15 ft.

Name: SEA WORLD MARINA
Address: 1660 SOUTH SHORES ROAD
City,State,Zip: SAN DIEGO, CA 92109
File Number: 0002F2C7
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002F2C7.pdf>
Region: STATE
Facility ID: 00000011929
Facility Type: Other
Other Type: BOAT MARINA
Contact Name: DAN LARSON
Telephone: 6192251565
Owner Name: SEA WORLD, INC.
Owner Address: 1720 SOUTH SHORES ROAD
Owner City,St,Zip: SAN DIEGO, CA 92109
Total Tanks: 0004

Tank Num: 001
Container Num: #03
Year Installed: Not reported
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: PREMIUM
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEA WORLD MARINA (Continued)

U001572801

Tank Num: 002
Container Num: #04
Year Installed: Not reported
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: REGULAR
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

Tank Num: 003
Container Num: #05
Year Installed: Not reported
Tank Capacity: 00010000
Tank Used for: WASTE
Type of Fuel: 06
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

Tank Num: 004
Container Num: #06
Year Installed: Not reported
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

[Click here for Geo Tracker PDF:](#)

C86

**SEA WORLD, PEREZ COVE MARINA
1660 SOUTH SHORES ROAD
SAN DIEGO, CA**

RGA LUST

**S114684311
N/A**

**< 1/8
1 ft.**

Site 41 of 52 in cluster C

**Relative:
Lower**

RGA LUST:

Name: SEA WORLD, PEREZ COVE MARINA
Address: 1660 SOUTH SHORES ROAD
City: SAN DIEGO
State: SAN DIEGO

**Actual:
15 ft.**

1992 SEA WORLD, PEREZ COVE MARINA 1660 SOUTH SHORES ROAD

C87

**1660 S. SHORES ROAD, SLIP 247
SAN DIEGO, CA 92109**

CHMIRS

**S120833961
N/A**

**< 1/8
1 ft.**

Site 42 of 52 in cluster C

**Relative:
Lower**

CHMIRS:

Name: Not reported
Address: 1660 S. SHORES ROAD, SLIP 247
City,State,Zip: SAN DIEGO, CA 92109
OES Incident Number: 17-2525
OES notification: 04/02/2017
OES Date: Not reported
OES Time: Not reported

**Actual:
15 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S120833961

Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Waterways
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Unknown
Other:	Not reported
Date/Time:	1020
Year:	2017
Agency:	NRC
Incident Date:	04/02/2017
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	No
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Gasoline: Automotive (Unleaded)
Quantity Released:	Unknown
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S120833961

#1 Vessel >= 300 Tons: No
#2 Vessel >= 300 Tons: No
#3 Vessel >= 300 Tons: No
Evacs: No
Injuries: No
Fatales: No
Comments: Not reported
Description: Per RP: Per NRC Report: "CALLER IS REPORTING THAT
A 24' PLEASURE CRAFT SANK DUE TO UNKNOWN CAUSES,
CALLER STATES THAT THE OUTBOARD IS DISCHARGING A
SMALL AMOUNT OF GASOLINE INTO THE WATERWAY."
Remedial Actions: "USING ABSORBANT MATERIAL TO
COLLECT GAS, CREW ONSITE RAISING VESSEL."

C88 SEA WORLD HYDRO DOCK
1720 SOUTH SHORES DR
SAN DIEGO, CA
< 1/8
1 ft.

RGA LUST S114684306
N/A

Site 43 of 52 in cluster C

Relative:
Lower
Actual:
15 ft.

RGA LUST:
Name: SEA WORLD HYDRO DOCK
Address: 1720 SOUTH SHORES DR
City: SAN DIEGO
State: SAN DIEGO
1995 SEA WORLD HYDRO DOCK 1720 SOUTH SHORES DR
Name: SEA WORLD HYDRO DOCK
Address: 1720 SOUTH SHORES DR
City: SAN DIEGO
State: SAN DIEGO
1994 SEA WORLD HYDRO DOCK 1720 SOUTH SHORES DR
Name: SEA WORLD HYDRO DOCK
Address: 1720 SOUTH SHORES DR
City: SAN DIEGO
State: SAN DIEGO
1993 SEA WORLD HYDRO DOCK 1720 SOUTH SHORES DR

C89 1660 S. SHORES ROAD
SAN DIEGO, CA 92109
< 1/8
1 ft.

ERNS 2014072184
N/A

Site 44 of 52 in cluster C

Relative:
Lower
Actual:
15 ft.

Incident Commons:
NRC Report #: 1072184
Description of Incident: THE CALLER IS REPORTING A DISCHARGE OF BILGE WATER INTO MISSION BAY.
THE CALLER STATED THAT A VESSEL'S BILGE PUMP KICKED ON AUTOMATICALLY
PUMPING THE MATERIAL OVERBOARD.
Type of Incident: VESSEL
Incident Cause: EQUIPMENT FAILURE
Incident Date Time: 2014-01-26 13:15:00
Incident DTG: DISCOVERED
Incident Location: Not reported
Location Address: 1660 S. SHORES ROAD
Location Street 1: Not reported
Location Street 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2014072184

Location Nearest City: SAN DIEGO
Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: N

Incidents:

NRC Report #: 1072184
Aircraft Type: Not reported
Aircraft Model: Not reported
Aircraft ID: Not reported
Aircraft Fuel Capacity: Not reported
Aircraft Fuel Capacity Units: Not reported
Aircraft Fuel on Board: Not reported
Aircraft Fuel on Board Units: Not reported
Aircraft Spot Number: Not reported
Aircraft Hanger: Not reported
Aircraft Runway Number: Not reported
Road Mile Marker: Not reported
Building ID: Not reported
Type of Fixed Object: Not reported
Power Generating Facility: U
Generating Capacity: Not reported
Type of Fuel: Not reported
NPDES: Not reported
NPDES Compliance: U
Pipeline Type: Not reported
DOT Regulated: U
Pipeline Above Ground: ABOVE
Exposed Underwater: N
Pipeline Covered: U
Railroad Hotline: Not reported
Grade Crossing: U
Location Subdivision: Not reported
Railroad Milepost: Not reported
Type Vehicle Involved: Not reported
Crossing Device Type: Not reported
Device Operational: U
DOT Crossing Number: Not reported
Brake Failure: U
Description of Tank: Not reported
Tank Above Ground: ABOVE
Transportable Container: U
Tank Regulated: U

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2014072184

Tank Regulated By:	Not reported
Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSP Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	233
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	N
Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	U
Airbag Deployed:	U
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported
Unknown Testing:	Not reported
Passenger Handling:	Not reported
Passenger Route:	XXX
Passenger Delay:	XXX

Incident Details:

NRC Report #:	1072184
Fire Involved:	N
Fire Extinguished:	U
Any Evacuations:	N
Number Evacuated:	Not reported
Who Evacuated:	Not reported
Radius of Evacuation:	Not reported
Any Injuries:	N
Number Injured:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2014072184

Number Hospitalized:	Not reported
Any Fatalities:	N
Number Fatalities:	Not reported
Any Damages:	N
Damage Amount:	Not reported
Air Corridor Closed:	N
Air Corridor Desc:	Not reported
Air Closure Time:	Not reported
Waterway Closed:	N
Waterway Desc:	Not reported
Waterway Closure Time:	Not reported
Road Closed:	N
Road Desc:	Not reported
Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported
Media Interest:	UNKNOWN
Medium Desc:	WATER
Additional Medium Info:	MISSION BAY
Body of Water:	MISSION BAY
Tributary of:	PACIFIC OCEAN
Release Secured:	Y
Estimated Duration of Release:	Not reported
Release rate:	Not reported
Desc Remedial Action:	BOOMS APPLIED, ABSORBENTS APPLIED, MATERIAL IS NON-RECOVERABLE.
State Agency on Scene:	Not reported
State Agency Report Number:	Not reported
Other Agency Notified:	Not reported
Weather Conditions:	OVERCAST
Air Temperature:	Not reported
Wind Speed:	Not reported
Wind Direction:	Not reported
Water Supply Contaminated:	N
Sheen Size:	Not reported
Sheen Color:	RAINBOW
Direction of Sheen Travel:	Not reported
Sheen Odor Description:	Not reported
Wave Condition:	Not reported
Current Speed:	Not reported
Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	Not reported
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported
Passenger Injuries:	Not reported
Occupant Fatality:	Not reported
Current Speed Unit:	Not reported
Road Closure Units:	Not reported
Track CLosure Units:	Not reported
Sheen Size Units:	Not reported
Additional Info:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2014072184

State Agency Notified: Not reported
Federal Agency Notified: USCG
nearest River Mile Marker: Not reported
Sheen Size Length: 20
Sheen Size Length Units: FEET
Sheen Size Width: 10
Sheen Size Width Units: FEET
Offshore: N
Duration Unit: Not reported
Release Rate Unit: Not reported
Release Rate Rate: Not reported
Passengers Transferred: NO

Calls:

NRC Report #: 1072184
Site ID: 20141072184
Date Time Received: 2014-01-26 16:46:34
Date Time Complete: 2014-01-26 16:53:39
Call Type: INC
Responsible Company: Not reported
Responsible Org Type: PRIVATE CITIZEN
Responsible City: SANTEE
Responsible State: CA
Responsible Zip: 92071
On Behalf: Not reported
Source: TELEPHONE

Vessels Detail:

Site ID: 20141072184
Vessel Name: UNKNOWN
Vessel Type: PLEASURE CRAFT
Vessel Number: Not reported
Vessel Length: Not reported
Hull Construction: Not reported
Fuel Capacity: Not reported
Fuel on Board: Not reported
Cargo Capacity: Not reported
Cargo on Board: Not reported
Is Vessel Aground: N
Flag: Not reported
Breadth: Not reported
Draught: Not reported
Fuel Capacity Units: Not reported
Fuel on Board Units: Not reported
Cargo Capacity Units: Not reported
Cargo on Board Units: Not reported

Material Involved:

NRC Report #: 1072184
Chris Code: OWA
Case Number: 000000-00-0
UN Number: Not reported
Amount of Material: 2
Unit of Measure: DROP(S)
Name of Material: WASTE OIL
If Reached Water: YES

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

2014072184

Amount in Water: 2
Unit of Measure Reach Water: DROP(S)

C90 1720 S SHORES RD
1720 S SHORES RD
< 1/8 SAN DIEGO, CA 92109
1 ft.

CIWQS S121613876
N/A

Site 45 of 52 in cluster C

Relative: CIWQS:
Lower Name: 1720 S SHORES RD
Actual: Address: 1720 S SHORES RD
15 ft. City,State,Zip: SAN DIEGO, CA 92109
Agency: Sea World California
Agency Address: 1720 S Shores Rd, San Diego, CA 92109
Place/Project Type: Construction - Commercial
SIC/NAICS: Not reported
Region: 9
Program: CONSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water construction
Order Number: 99-08DW
WDID: 9 37C308866
NPDES Number: CAS000002
Adoption Date: Not reported
Effective Date: 04/20/1998
Termination Date: 02/08/2000
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: Not reported
Longitude: Not reported

C91 1720 SOUTH SHORES RD
< 1/8 SAN DIEGO, CA 92109
1 ft.

ERNS 97398202
N/A

Site 46 of 52 in cluster C

Relative: Incident Commons:
Lower NRC Report #: 398202
Actual: Description of Incident: FUEL PUMP ON SKI DOCK / LEAKING FROM BOTTOM OF PUMP FOR UNKNOWNREASONS
15 ft. Type of Incident: FIXED
Incident Cause: EQUIPMENT FAILURE
Incident Date Time: 1997-08-06 07:45:00
Incident DTG: DISCOVERED
Incident Location: Not reported
Loaction Address: 1720 SOUTH SHORES RD
Location Street 1: Not reported
Location Street 2: Not reported
Location Nearest City: SAN DIEGO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

97398202

Location State: CA
Location County: SAN DIEGO
Location Zip: 92109
Distance From City: Not reported
Distance Units: Not reported
Direction From City: Not reported
Lat Deg: Not reported
Lat Min: Not reported
Lat Sec: Not reported
Lat Quad: Not reported
Long Deg: Not reported
Long Min: Not reported
Long Sec: Not reported
Long Quad: Not reported
Location Section: Not reported
Location Township: Not reported
Location range: Not reported
Potential Range: Not reported

Incidents:

NRC Report #: 398202
Aircraft Type: UNKNOWN
Aircraft Model: Not reported
Aircraft ID: Not reported
Aircraft Fuel Capacity: Not reported
Aircraft Fuel Capacity Units: Not reported
Aircraft Fuel on Board: Not reported
Aircraft Fuel on Board Units: Not reported
Aircraft Spot Number: Not reported
Aircraft Hanger: Not reported
Aircraft Runway Number: Not reported
Road Mile Marker: Not reported
Building ID: Not reported
Type of Fixed Object: UNKNOWN
Power Generating Facility: U
Generating Capacity: Not reported
Type of Fuel: Not reported
NPDES: Not reported
NPDES Compliance: U
Pipeline Type: UNKNOWN
DOT Regulated: U
Pipeline Above Ground: ABOVE
Exposed Underwater: U
Pipeline Covered: U
Railroad Hotline: N
Grade Crossing: N
Location Subdivision: Not reported
Railroad Milepost: UNKNOWN
Type Vehicle Involved: UNKNOWN
Crossing Device Type: Not reported
Device Operational: Y
DOT Crossing Number: Not reported
Brake Failure: N
Description of Tank: Not reported
Tank Above Ground: ABOVE
Transportable Container: U
Tank Regulated: U
Tank Regulated By: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

97398202

Tank ID:	Not reported
Capacity of Tank:	Not reported
Capacity of Tank Units:	Not reported
Actual Amount:	Not reported
Actual Amount Units:	Not reported
Platform Rig Name:	Not reported
Platform Letter:	Not reported
Location Area ID:	Not reported
Location Block ID:	Not reported
OCSG Number:	Not reported
OCSF Number:	Not reported
State Lease Number:	Not reported
Pier Dock Number:	Not reported
Berth Slip Number:	Not reported
Continuous Release Type:	Not reported
Initial Continuous Release No:	Not reported
Continuous Release Permit:	Not reported
Allision:	N
Type of Structure:	Not reported
Structure Name:	Not reported
Structure Operational:	Y
Airbag Deployed:	Not reported
Date Tiem Normal Service:	Not reported
Service Disruption Time:	Not reported
Service Disruption Units:	Not reported
Transit Bus Flag:	Not reported
CR Begin Date:	Not reported
CR End Date:	Not reported
CR Change Date:	Not reported
FBI Contact:	Not reported
FBI Contact Date Time:	Not reported
Sub Part C Testing Req:	XXX
Conductor Testing:	Not reported
Engineer Testing:	Not reported
Trainman Testing:	Not reported
Yard Foreman Testing:	Not reported
RCL Operator Testing:	Not reported
Brakeman Testing:	Not reported
Train Dispatcher Testing:	Not reported
Signalman Testing:	Not reported
Other Employee Testing:	Not reported
Unknown Testing:	Not reported
Passenger Handling:	Not reported
Passenger Route:	XXX
Passenger Delay:	XXX

Incident Details:

NRC Report #:	398202
Fire Involved:	N
Fire Extinguished:	U
Any Evacuations:	N
Number Evacuated:	Not reported
Who Evacuated:	Not reported
Radius of Evacuation:	Not reported
Any Injuries:	U
Number Injured:	Not reported
Number Hospitalized:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

97398202

Any Fatalities:	U
Number Fatalities:	Not reported
Any Damages:	N
Damage Amount:	Not reported
Air Corridor Closed:	N
Air Corridor Desc:	Not reported
Air Closure Time:	Not reported
Waterway Closed:	N
Waterway Desc:	Not reported
Waterway Closure Time:	Not reported
Road Closed:	N
Road Desc:	Not reported
Road Closure Time:	Not reported
Closure Direction:	Not reported
Major Artery:	N
Track Closed:	N
Track Desc:	Not reported
Track Closure Time:	Not reported
Media Interest:	Not reported
Medium Desc:	WATER
Additional Medium Info:	MISSION BAY
Body of Water:	Not reported
Tributary of:	Not reported
Release Secured:	U
Estimated Duration of Release:	Not reported
Release rate:	Not reported
Desc Remedial Action:	CONTAINED SPILL WITH BOOMS AND RECOVERING WITH ABSORBENT PADS
State Agency on Scene:	Not reported
State Agency Report Number:	Not reported
Other Agency Notified:	Not reported
Weather Conditions:	Not reported
Air Temperature:	Not reported
Wind Speed:	Not reported
Wind Direction:	Not reported
Water Supply Contaminated:	U
Sheen Size:	Not reported
Sheen Color:	Not reported
Direction of Sheen Travel:	Not reported
Sheen Odor Description:	Not reported
Wave Condition:	Not reported
Current Speed:	Not reported
Current Direction:	Not reported
Water Temperature:	Not reported
Track Close Dir:	Not reported
Empl Fatality:	Not reported
Pass Fatality:	Not reported
Community Impact:	N
Wind Speed Unit:	Not reported
Employee Injuries:	Not reported
Passenger Injuries:	Not reported
Occupant Fatality:	Not reported
Current Speed Unit:	Not reported
Road Closure Units:	Not reported
Track Closure Units:	Not reported
Sheen Size Units:	Not reported
Additional Info:	WX: HOT, SUNNY, WIND AND SEAS ARE CALM WILL NOTIFY: GOVERNMENT OF EMERGENCY SERVICES

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

97398202

State Agency Notified: Not reported
Federal Agency Notified: Not reported
nearest River Mile Marker: Not reported
Sheen Size Length: Not reported
Sheen Size Length Units: Not reported
Sheen Size Width: Not reported
Sheen Size Width Units: Not reported
Offshore: N
Duration Unit: Not reported
Release Rate Unit: Not reported
Release Rate Rate: Not reported
Passengers Transferred: UNK

Calls:

NRC Report #: 398202
Site ID: 97398202
Date Time Received: 1997-08-06 11:22:26
Date Time Complete: 1997-08-06 11:39:44
Call Type: INC
Responsible Company: SEA WORLD
Responsible Org Type: PRIVATE ENTERPRISE
Responsible City: SAN DIEGO
Responsible State: CA
Responsible Zip: 92109
On Behalf: Not reported
Source: UNAVAILABLE

Material Involved:

NRC Report #: 398202
Chris Code: GAT
Case Number: Not reported
UN Number: Not reported
Amount of Material: 1
Unit of Measure: GALLON(S)
Name of Material: GASOLINE: AUTOMOTIVE (4.23G PB/G
If Reached Water: YES
Amount in Water: 1
Unit of Measure Reach Water: GALLON(S)

C92

< 1/8
1 ft.

1660 S. SHORES ROAD
SAN DIEGO, CA 92109

Site 47 of 52 in cluster C

CHMIRS S118738994
N/A

Relative:
Lower

Actual:
15 ft.

CHMIRS:
Name: Not reported
Address: 1660 S. SHORES ROAD
City,State,Zip: SAN DIEGO, CA 92109
OES Incident Number: 16-2577
OES notification: 05/01/2016
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S118738994

Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Other
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Gal(s)
Other:	Not reported
Date/Time:	1600
Year:	2016
Agency:	NRC
Incident Date:	05/01/2016
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Yes
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Motor Oil
Quantity Released:	Unknown
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S118738994

Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	Per NRC Report# 1146674: Caller stated there is a spill of motor oil coming from a pleasure craft due to unknown causes. A 6 ft. by 6 ft. rainbow sheen is reported. Booms and absorbents applied. Release is coming from a pleasure craft (MY FIN) at slip #
Name:	Not reported
Address:	1660 S. SHORES ROAD
City,State,Zip:	SAN DIEGO, CA 92109
OES Incident Number:	19-2943
OES notification:	05/05/2019
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	MISSION BAY
Spill Site:	Waterways
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Unknown
Other:	Not reported
Date/Time:	1312
Year:	2019

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S118738994

Agency: NRC
Incident Date: 05/05/2019
Admin Agency: San Diego County Health Services Department
Amount: Not reported
Contained: Not reported
Site Type: MISSION BAY
E Date: Not reported
Substance: DIESEL
Quantity Released: UNKNOWN
Unknown: Not reported
Substance #2: Not reported
Substance #3: Not reported
Evacuations: Not reported
Number of Injuries: Not reported
Number of Fatalities: Not reported
#1 Pipeline: No
#2 Pipeline: No
#3 Pipeline: No
#1 Vessel >= 300 Tons: No
#2 Vessel >= 300 Tons: No
#3 Vessel >= 300 Tons: No
Evacs: No
Injuries: No
Fatals: No
Comments: Not reported
Description: PER NRC REPORT " CALLER REPORTED AN UNKNOWN AMOUNT OF DIESEL DISCHARGED INTO MISSION BAY FROM A VESSEL DUE TO EQUIPMENT FAILURE." ---SHEEN INFORMATION--- Sheen Color: RAINBOW Sheen Size Length: 10 YARDS Sheen Size Width: 10 YARDS

C93

CHMIRS S118188904

< 1/8
1 ft.

1660 S. SHORES ROAD, BERTH SLIP NUMBER: 213
SAN DIEGO, CA 92109

N/A

Site 48 of 52 in cluster C

Relative:
Lower

Actual:
15 ft.

CHMIRS:
Name: Not reported
Address: 1660 S. SHORES ROAD, BERTH SLIP NUMBER: 213
City,State,Zip: SAN DIEGO, CA 92109
OES Incident Number: 15-3482
OES notification: 06/19/2015
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S118188904

Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Seaworld Marina
Spill Site:	Waterways
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	N/A
Other:	Not reported
Date/Time:	2035
Year:	2015
Agency:	NRC
Incident Date:	06/19/2015
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown
Site Type:	Seaworld Marina
E Date:	Not reported
Substance:	Oil, Unknown
Quantity Released:	Unknown
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	Per NRC #1120359, "What appears to be oil was observed in a slip at the Seaworld Marina, due to unknown causes. Suspected source is a 25' vessel on scene." SHEEN COLOR: Rainbow SHEEN SIZE LENGTH: 40 feet BODY OF WATER: Seaworld Marina REMEDIAL ACTIONS: Boom deployed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

C94 **1720 S SHORE RD**
1720 S SHORES RD
< 1/8 **SAN DIEGO, CA 92109**
1 ft.
Site 49 of 52 in cluster C

NPDES **S117692800**
CIWQS **N/A**

Relative:
Lower

Actual:
15 ft.

NPDES:
Name: 1720 S SHORE RD
Address: 1720 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported
Order Number: Not reported
WDID: 9 37C301623
Regulatory Measure Type: Construction
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Terminated
Status Date: 11/18/1992
Operator Name: Sea World California
Operator Address: 1720 S Shores Rd
Operator City: San Diego
Operator State: California
Operator Zip: 92109

NPDES as of 03/2018:
NPDES Number: Not reported
Status: Not reported
Agency Number: Not reported
Region: 9
Regulatory Measure ID: 285945
Order Number: Not reported
Regulatory Measure Type: Construction
Place ID: Not reported
WDID: 9 37C301623
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Received Date: 05/09/2008
Processed Date: 11/18/1992
Status: Terminated

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1720 S SHORE RD (Continued)

S117692800

Status Date:	11/18/1992
Place Size:	20
Place Size Unit:	Acres
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Sea World California
Operator Address:	1720 S Shores Rd
Operator City:	San Diego
Operator State:	California
Operator Zip:	92109
Operator Contact:	Kevin Carr
Operator Contact Title:	Not reported
Operator Contact Phone:	619-226-3934
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Other
Developer:	Sea World California
Developer Address:	1720 S Shores Rd
Developer City:	San Diego
Developer State:	California
Developer Zip:	92109
Developer Contact:	Kevin Carr
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Mission Bay
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

CIWQS:

Name: 1720 S SHORE RD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1720 S SHORE RD (Continued)

S117692800

Address: 1720 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Agency: Sea World California
Agency Address: 1720 S Shores Rd, San Diego, CA 92109
Place/Project Type: Construction
SIC/NAICS: Not reported
Region: 9
Program: CONSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water construction
Order Number: 2009-0009-DWQ
WDID: 9 37C301623
NPDES Number: CAS000002
Adoption Date: Not reported
Effective Date: 11/18/1992
Termination Date: Not reported
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: Not reported
Longitude: Not reported

C95

**SEAWORLD
1720 S SHORES RD
SAN DIEGO, CA 92109**

**AST A100424359
N/A**

**< 1/8
1 ft.**

Site 50 of 52 in cluster C

**Relative:
Lower**

AST:

**Actual:
15 ft.**

Name: SEAWORLD
Address: 1720 S SHORES RD
City/Zip: SAN DIEGO,92109
Certified Unified Program Agencies: Not reported
Owner: SeaWorld LLC
Total Gallons: Not reported
CERSID: 10383472
Facility ID: 37-000-100905
Business Name: SEAWORLD
Phone: 619-226-3996
Fax: 619-226-3999
Mailing Address: 500 SEA WORLD DR
Mailing Address City: SAN DIEGO
Mailing Address State: CA
Mailing Address Zip Code: Not reported
Operator Name: SEA WORLD LLC
Operator Phone: 619-222-6363
Owner Phone: 619-225-3219
Owner Mail Address: 500 Sea World Drive
Owner State: CA
Owner Zip Code: 92109
Owner Country: United States
Property Owner Name: City of San Diego
Property Owner Phone: Not reported
Property Owner Mailing Address: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

A100424359

Property Owner City: Not reported
Property Owner Stat : Not reported
Property Owner Zip Code: 0
Property Owner Country: United States
EPAID: CAD981687221

C96

**SEAWORLD
1720 S SHORES RD
SAN DIEGO, CA 92109**

**San Diego Co. HMMD
CERS HAZ WASTE
CERS TANKS
CERS**

**S123406592
N/A**

**< 1/8
1 ft.**

Site 51 of 52 in cluster C

**Relative:
Lower**

HMMD SAN DIEGO:

**Actual:
15 ft.**

Name: SEAWORLD
Address: 1720 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAD981687221
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 619-226-3996
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 07/24/2018
Facility Owner: Not reported
Facility Mailing Address: 500 SEA WORLD DR, SAN DIEGO, CA 92109-7994
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: Y
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

UST DTL:

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100905
Facility Type (Ust Facility): Other
Tank Owner Name: SEA WORLD LLC
Tankid: 15851
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2019-03-15T00:57:28.000
Tank Capacityin Gallons: 10000
Tank Contents: Regular Unleaded
Type Of Tank: Double Wall

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Facility Id Number: 37-000-100905
Facility Type (Ust Facility): Other
Tank Owner Name: SEA WORLD LLC
Tankid: 15857
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2019-03-15T00:57:28.000
Tank Capacityin Gallons: 2000
Tank Contents: Diesel
Type Of Tank: Double Wall

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100905
Facility Type (Ust Facility): Other
Tank Owner Name: SEA WORLD LLC
Tankid: 15856
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Motor Vehicle Fueling
Piping System Type: Pressure
Last Updated: 2019-03-15T00:57:28.000
Tank Capacityin Gallons: 1000
Tank Contents: Regular Unleaded
Type Of Tank: Double Wall

Waste and Materials:

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097044
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SILICA SAND (WATER FILTERS)
Common Name: SILICA SAND (WATER FILTERS)
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097045
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :
Common Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :
Case Number: 74-86-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097046
Trade Secret: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Common Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097047
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: ASSORTED POLYURETHANES
Common Name: ASSORTED POLYURETHANES
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097048
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: HYDROCHLORIC ACID
Common Name: MURIATIC ACID
Case Number: 7647-01-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097049
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: POLYDIMETHYLSILOXANE EMULSION
Common Name: QWIK DRESS / TIRE DETAILER
Case Number: 63148-62-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097050
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SULFURIC ACID, 36%, H2SO4
Common Name: SULFURIC ACID, 36%, H2SO4
Case Number: 7664-93-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097051
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Chemical Name:	SPRAY NINE
Common Name:	SPRAY NINE
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0097052
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2016-08-23T01:44:26.000
Chemical Name:	SODIUM HYPOCHLORITE, NAOCL, 13% : LIQUID POOL CHLORINE
Common Name:	SODIUM HYPOCHLORITE, NAOCL, 13% : LIQUID POOL CHLORINE
Case Number:	7681-52-9
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0097053
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2016-08-23T01:44:26.000
Chemical Name:	REGULAR UNLEADED - T006
Common Name:	UNDERGROUND TANK 100905 T006 UNLEADED
Case Number:	8006-61-9
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0097054
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2016-08-23T01:44:26.000
Chemical Name:	ETHYLENE GLYCOL N-BUTYL ETHER
Common Name:	WAX ELIMINATOR
Case Number:	111-76-2
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0097055
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2016-08-23T01:44:26.000
Chemical Name:	CALCIUM HYPOCHLORITE ACUTAB
Common Name:	CALCIUM HYPOCHLORITE ACUTAB
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0097056
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2016-08-23T01:44:26.000
Chemical Name:	HYDROXETHYLIDINE DIPHOSPHONIC
Common Name:	ACID, TRIDENT 6026 (WATER TREATMENT)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Case Number:	2809-21-4
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0097057
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2016-08-23T01:44:26.000
Chemical Name:	SODIUM THIOSULFATE
Common Name:	SODIUM THIOSULFATE
Case Number:	10102-17-7
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0097058
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2016-08-23T01:44:26.000
Chemical Name:	DIETHYLENE GLYCOL MONOETHYL ETHER
Common Name:	FLOOR FINISH
Case Number:	111-90-0
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0097059
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2016-08-23T01:44:26.000
Chemical Name:	DIESEL FUEL
Common Name:	Diesel Fuel
Case Number:	68476-34-6
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0097060
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2016-08-23T01:44:26.000
Chemical Name:	SODIUM SULFITE, 25% SOLUTION
Common Name:	SODIUM SULFITE, 25% SOLUTION
Case Number:	7757-83-7
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HCHEM-0097061
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2016-08-23T01:44:26.000
Chemical Name:	WETSUIT CLEANER
Common Name:	WETSUIT CLEANER
Case Number:	MIXTURE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097062
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: ETHANOL, FOODSERVICE JOY
Common Name: ETHANOL, FOODSERVICE JOY
Case Number: 64-17-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097063
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: STERNO CANNED COOKING FUEL
Common Name: STERNO CANNED COOKING FUEL
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097064
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: OIL LUBRICATING KENDALL
Common Name: KENDALL MOTOR OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097065
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: NONYL PHENOL POLYETHYLENE GLYCOL ETHER FLUID QUARTERNA
Common Name: NONYL PHENOL POLYETHYLENE GLYCOL ETHER FLUID QUARTERNA
Case Number: 9016-45-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097066
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: ASSORTED URETHANES
Common Name: ASSORTED URETHANES
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097067
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: RED-E-CRETE, CALCIUM SALT-PORTLAND CEMENT
Common Name: RED-E-CRETE, CALCIUM SALT-PORTLAND CEMENT
Case Number: 65977-15-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097068
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: LATEX PAINT
Common Name: LATEX PAINT
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097069
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: MDI
Common Name: SAFE DECK
Case Number: 101-68-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097070
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: OZZYJUICE SW-3 TRUCK DEGREASING SOLIN
Common Name: OZZYJUICE SW-3 TRUCK DEGREASING SOLIN
Case Number: NA

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097071
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: MISSION OVEN CLEANER
Common Name: MISSION OVEN CLEANER
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097072

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Common Name: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097073
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SURFACTANT
Common Name: SHOW-N-GO CAR SOAP
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097074
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SILPUR 90%
Common Name: SULPHUR FERTILIZER
Case Number: 7704-34-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097075
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: PAINT-ASSORTED ENAMELS AND ACRYLICS
Common Name: PAINT-ASSORTED ENAMELS AND ACRYLICS
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097076
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: AUTOMATIC TRANSMISSION FLUID
Common Name: DEXRON II AUTOMATIC TRANSMISSION FLUID
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097077
Trade Secret: N
Hazardous Material Type: Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SURFACTANT BUBBLE MASTER
Common Name: BUBBLE MASTER 2000 PREMIUM FLUID
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097078
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: HYDROGEN PEROXIDE
Common Name: CLEAN BY PEROXY
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097079
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: PWC-1 BACTERIAL ADDITIVE
Common Name: PWC-1 BACTERIAL ADDITIVE
Case Number: NONE LISTED

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097080
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: CARBON DIOXIDE, C02, 99%, COMPRESSED GAS :
Common Name: CARBON DIOXIDE, C02, 99%, COMPRESSED GAS :
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097081
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: OIL, LUBRICATING : MOTOR OIL HYDRAULIC OIL :
Common Name: hydraulic oil
Case Number: 8002-05-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097082
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: ETHYLENE GLYCOL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name: ETHYLENE GLYCOL
Case Number: 107-21-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097083
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: ARGON GAS
Common Name: ARGON GAS
Case Number: 7440-37-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097084
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: PIG DRI (ABSORBENT SPILL MATERIAL)
Common Name: PIG DRI (ABSORBENT SPILL MATERIAL)
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097085
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: PROPYLENE GLYCOL
Common Name: PROPYLENE GLYCOL
Case Number: 57-55-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097086
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SODIUM BICARBONATE, SODA ASH
Common Name: SODIUM BICARBONATE, SODA ASH
Case Number: 144-55-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097087
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SODIUM HYPOCHLORITE, NAOCL, 5% : LIQ. HOUSEHOLD BLEACH
Common Name: DISINFECTANT BLEACH, CLOROX, GENERIC
Case Number: 7681-52-9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097088
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SULFUR Fertilizer Tiger 90CR
Common Name: SULFUR COATED UREA/X COTE 42-0-0
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097089
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: LEAD
Common Name: LEAD
Case Number: 7439-92-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097090
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: DIESEL - T007
Common Name: UNDERGROUND TANK 100905 T007
Case Number: 8006-61-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097091
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: ACTIVATED CARBON 100%
Common Name: ACTIVATED CARBON 100%
Case Number: 7440-44-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097092
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: REGULAR UNLEADED
Common Name: UNDERGROUND TANK 100905 T001
Case Number: 684-76-346

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097093
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: NITROGEN, N2, 99%, COMPRESSED GAS :
Common Name: NITROGEN, N2, 99%, COMPRESSED GAS :
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097094
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: IRON, 95% GALVANIZED STEEL
Common Name: IRON, 95% GALVANIZED STEEL
Case Number: 7439-89-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097095
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SOLID CARBON DIOXIDE (DRY ICE)
Common Name: SOLID CARBON DIOXIDE (DRY ICE)
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097096
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: MONO AMMONIUM PHOSPHATE, 95%,
Common Name: ABC DRY CHEM. FIRE EXTINGUISHER
Case Number: 25655-41-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097097
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SODIUM CHLORIDE, NaCl, 98% : TABLE SALT
Common Name: SODIUM CHLORIDE, NaCl, 98% : TABLE SALT
Case Number: 7647-14-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097098

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: CHARCOAL
Common Name: CHARCOAL
Case Number: 16291-96-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097099
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: FERTILIZER, TURF GOLD : IRON OXIDE 1% :
Common Name: 22-3-6 W/AMMUMIM SULFATE
Case Number: 1309-37-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097100
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: ZINC OXIDE, 3%, SIMPLOT 6-20-20 (FET W/ZINC)
Common Name: ZINC OXIDE, 3%, SIMPLOT 6-20-20 (FET W/ZINC)
Case Number: 1314-13-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097101
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: NITRA KING 19-4-4 (FERTILIZER-NURSERY-BONEYARD
Common Name: AMMONIA NITRATE)
Case Number: 6484-52-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097102
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Common Name: WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Case Number: 7429-90-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097103
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2016-08-23T01:44:26.000
Chemical Name: MANGANESE, 13% STAINLESS STEEL
Common Name: MANGANESE, 13% STAINLESS STEEL
Case Number: 7439-96-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097104
Trade Secret: N

Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: OXYGEN, 02, 99%, COMPRESSED GAS :
Common Name: OXYGEN, 02, 99%, COMPRESSED GAS :
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097105
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: NICKEL, 99% NICKEL STEEL
Common Name: NICKEL, 99% NICKEL STEEL
Case Number: 7440-02-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097106
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: FREON R-123
Common Name: FREON R-123
Case Number: 306-83-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097107
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: ALUMINUM SULFATE
Common Name: ALUMINUM SULFATE
Case Number: 10043-01-3

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097108
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name: SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)
Case Number: 497-19-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097109
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SILICON SAND (AQUARIUM)
Common Name: NATURAL FINE AND COARSE AGGREGATE
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097110
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SILICON SAND (MERCHANRISE)
Common Name: PLAYSAND
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097111
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: SILICON DIOXIDE (SAND-NURSERY)
Common Name: SILICON DIOXIDE (SAND-NURSERY)
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097112
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: Nitrogen - Food Grade for Popcorn
Common Name: Nitrogen
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097113
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: Not reported
Common Name: Culinary Dewars 60% Nitrogen/40% CO2
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0097114
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2016-08-23T01:44:26.000
Chemical Name: Not reported
Common Name: Lanthanum Chloride 28% TREO Solution 99%
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079062
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER).
Common Name: WASTE ABSORBENT PAD W/ FORMALIN
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079063
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: VARIOUS LAB PACKS
Common Name: WASTE MEDICAL- LABORATORY
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079064
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Common Name: WASTE METHANOL WATER SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079065
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: WASTE 461 PAINT
Common Name: WASTE - PAINT LIQUIDS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0079066
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-08-23T01:44:30.000
Chemical Name:	WASTE 902 INFECTIOUS WASTE, SHARPS
Common Name:	WASTE SHARPS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0079067
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-08-23T01:44:30.000
Chemical Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER)-
Common Name:	WASTE MERCURY CONTAINING DEVICES
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0079068
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-08-23T01:44:30.000
Chemical Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name:	WASTE, GAS, DIESEL, LPG
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0079069
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-08-23T01:44:30.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER).
Common Name:	WASTE, PROPANE (551)
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0079070
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-08-23T01:44:30.000
Chemical Name:	WASTE 901 INFECTIOUS WASTE, GENERAL
Common Name:	WASTE RED BAG
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0079071

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-08-23T01:44:30.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)*
Common Name:	WASTE METHANOL - ACETIC ACID
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0079072
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-08-23T01:44:30.000
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2
Common Name:	WASTE HYDROCHLORIC ACID/CORROSIVES
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0079073
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-08-23T01:44:30.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name:	WASTE RAGS CONTAMINATED W/ SOLVENT
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0079074
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-08-23T01:44:30.000
Chemical Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER) (2)
Common Name:	WASTE PAINT CHIPS & PAINT BOOTH FLTRS (352)(212)
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0079075
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2016-08-23T01:44:30.000
Chemical Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER)
Common Name:	INORG SOLID, HYPOCHLORITES
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0079076
Trade Secret:	N
Hazardous Material Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2016-08-23T01:44:30.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: WASTE OILY ABSORBENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079077
Trade Secret: N

Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: WASTE 311 PHARMACEUTICAL WASTE
Common Name: WASTE 311 PHARMACEUTICAL WASTE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079078
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name: WASTE AEROSOLS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079079
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: WASTE 212 OXYGENATED SOLVENTS
Common Name: LACQUER THINNER
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079080
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: WASTE 903 INF WST,TISSUE/ANAT. REMAINS
Common Name: WASTE PATHOLOGY
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079081
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: Waste Motor oil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name: WASTE MOTOR OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079082
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: WASTE FUEL & OIL FILTERS
Common Name: WASTE FUEL & OIL FILTERS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079083
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: Not reported
Common Name: WASTE - Decalcifying Solution
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079084
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: Not reported
Common Name: WASTE _ Gram Stain
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079085
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: Not reported
Common Name: WASTE - Ethylene Glycol
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079086
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: Not reported
Common Name: WASTE - Activated Carbon
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HWAST-0079087
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-23T01:44:30.000
Chemical Name: Not reported
Common Name: WASTE - ExCell Plus
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171293
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SILICA SAND (WATER FILTERS)
Common Name: SILICA SAND (WATER FILTERS)
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171294
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :
Common Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :
Case Number: 74-86-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171295
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Common Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171296
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: HYDROCHLORIC ACID
Common Name: MURIATIC ACID 31%
Case Number: 7647-01-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171297
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: POLYDIMETHYLSILOXANE EMULSION
Common Name: QWIK DRESS / TIRE DETAILER
Case Number: 63148-62-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171298
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SULFURIC ACID, 36%, H2SO4
Common Name: SULFURIC ACID, 36%, H2SO4
Case Number: 7664-93-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171299
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SPRAY NINE
Common Name: SPRAY NINE
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171300
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SODIUM HYPOCHLORITE, NAOCL, 13% : LIQUID POOL CHLORINE
Common Name: SODIUM HYPOCHLORITE, NAOCL, 13% : LIQUID POOL CHLORINE
Case Number: 7681-52-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171301
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: REGULAR UNLEADED - T006
Common Name: UNDERGROUND TANK 100905 T006 UNLEADED
Case Number: 8006-61-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171302

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: ETHYLENE GLYCOL N-BUTYL ETHER
Common Name: WAX ELIMINATOR
Case Number: 111-76-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171303
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: CALCIUM HYPOCHLORITE ACUTAB
Common Name: CALCIUM HYPOCHLORITE ACUTAB
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171304
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: HYDROXETHYLIDINE DIPHOSPHONIC
Common Name: ACID, TRIDENT 6026 (WATER TREATMENT)
Case Number: 2809-21-4

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171305
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SODIUM THIOSULFATE
Common Name: SODIUM THIOSULFATE
Case Number: 10102-17-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171306
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: DIETHYLENE GLYCOL MONOETHYL ETHER
Common Name: FLOOR FINISH
Case Number: 111-90-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171307
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	DIESEL FUEL
Common Name:	Diesel Fuel
Case Number:	68476-34-6
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171308
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	SODIUM SULFITE, 25% SOLUTION
Common Name:	SODIUM SULFITE, 25% SOLUTION
Case Number:	7757-83-7
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171309
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	WETSUIT CLEANER
Common Name:	WETSUIT CLEANER
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171310
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	ETHANOL, FOODSERVICE JOY
Common Name:	ETHANOL, FOODSERVICE JOY
Case Number:	64-17-5
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171311
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	STERNO CANNED COOKING FUEL
Common Name:	STERNO CANNED COOKING FUEL
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171312
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	OIL LUBRICATING KENDALL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name:	KENDALL MOTOR OILS VARIOUS WEIGHTS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171313
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	NONYL PHENOL POLYETHYLENE GLYCOL ETHER FLUID QUARTERNA
Common Name:	Fullsan
Case Number:	9016-45-9
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171314
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	ASSORTED URETHANES
Common Name:	ASSORTED URETHANES
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171315
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	RED-E-CRETE, CALCIUM SALT-PORTLAND CEMENT
Common Name:	RED-E-CRETE, PORTLAND CEMENT
Case Number:	65977-15-1
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171316
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	LATEX PAINT
Common Name:	LATEX PAINT
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171317
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	OZZYJUICE SW-3 TRUCK DEGREASING SOLIN
Common Name:	OZZYJUICE SW-3 TRUCK DEGREASING SOLIN
Case Number:	NA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171318
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: MISSION OVEN CLEANER
Common Name: MISSION OVEN CLEANER
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171319
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Common Name: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171320
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SURFACTANT
Common Name: SHOW-N-GO CAR SOAP
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171321
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: PAINT-ASSORTED ENAMELS AND ACRYLICS
Common Name: PAINT-ASSORTED ENAMELS AND ACRYLICS
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171322
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: AUTOMATIC TRANSMISSION FLUID
Common Name: DEXRON II AUTOMATIC TRANSMISSION FLUID
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171323
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	SURFACTANT BUBBLE MASTER
Common Name:	BUBBLE MASTER 2000 PREMIUM FLUID
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171324
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	HYDROGEN PEROXIDE
Common Name:	CLEAN BY PEROXY
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171325
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	PWC-1 BACTERIAL ADDITIVE
Common Name:	PWC-1 BACTERIAL ADDITIVE
Case Number:	NONE LISTED
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171326
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	CARBON DIOXIDE, C02, 99%, COMPRESSED GAS :
Common Name:	CARBON DIOXIDE, C02, 99%, COMPRESSED GAS :
Case Number:	124-38-9
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171327
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	OIL, LUBRICATING : MOTOR OIL HYDRAULIC OIL :
Common Name:	hydraulic oil
Case Number:	8002-05-9
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171328

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: ETHYLENE GLYCOL
Common Name: ETHYLENE GLYCOL
Case Number: 107-21-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171329
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: ARGON GAS
Common Name: ARGON GAS
Case Number: 7440-37-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171330
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: PIG DRI (ABSORBENT SPILL MATERIAL)
Common Name: SOLID ABSORBENT SPILL MATERIALS
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171331
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: PROPYLENE GLYCOL
Common Name: PROPYLENE GLYCOL
Case Number: 57-55-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171332
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SODIUM BICARBONATE, SODA ASH
Common Name: SODIUM BICARBONATE, SODA ASH
Case Number: 144-55-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171333
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SODIUM HYPOCHLORITE, NaOCL, 5% : LIQ. HOUSEHOLD BLEACH
Common Name: DISINFECTANT BLEACH, CLOROX, GENERIC
Case Number: 7681-52-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171334
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SULFUR Fertilizer Tiger 90CR
Common Name: SULFUR COATED UREA/X COTE 42-0-0
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171335
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: LEAD
Common Name: LEAD
Case Number: 7439-92-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171336
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: DIESEL - T007
Common Name: UNDERGROUND TANK 100905 T007
Case Number: 8006-61-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171337
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: ACTIVATED CARBON 100%
Common Name: ACTIVATED CARBON 100%
Case Number: 7440-44-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171338
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: REGULAR UNLEADED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name: UNDERGROUND TANK 100905 T001
Case Number: 684-76-346

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171339
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: NITROGEN, N2, 99%, COMPRESSED GAS :
Common Name: NITROGEN, N2, 99%, COMPRESSED GAS :
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171340
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: IRON, 95% GALVANIZED STEEL
Common Name: IRON, 95% GALVANIZED STEEL
Case Number: 7439-89-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171341
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SOLID CARBON DIOXIDE (DRY ICE)
Common Name: SOLID CARBON DIOXIDE (DRY ICE)
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171342
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: MONO AMMONIUM PHOSPHATE, 95%,
Common Name: ABC DRY CHEM. FIRE EXTINGUISHER
Case Number: 25655-41-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171343
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SODIUM CHLORIDE, NaCl, 98% : TABLE SALT
Common Name: SODIUM CHLORIDE, NaCl, 98% : TABLE SALT
Case Number: 7647-14-5

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171344
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: CHARCOAL
Common Name: CHARCOAL
Case Number: 16291-96-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171345
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: FERTILIZER, TURF GOLD contains X-COTE
Common Name: 22-5-6 W/AMMONIUM SULFATE
Case Number: 7783-20-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171346
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: AMMONIA NITRATE FERTILIZER-NURSERY
Common Name: NITRA KING 19-4-4
Case Number: 6484-52-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171347
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Common Name: WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Case Number: 7429-90-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171348
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: MANGANESE, 13% STAINLESS STEEL
Common Name: MANGANESE, 13% STAINLESS STEEL
Case Number: 7439-96-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171349
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	OXYGEN, 02, 99%, COMPRESSED GAS :
Common Name:	OXYGEN, 02, 99%, COMPRESSED GAS :
Case Number:	7782-44-7
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171350
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	NICKEL, 46% NICKEL STEEL
Common Name:	NICKEL, 46% NICKEL STEEL
Case Number:	7440-02-0
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171351
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	FREON R-123
Common Name:	FREON R-123
Case Number:	306-83-2
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171352
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	ALUMINUM SULFATE
Common Name:	ALUMINUM SULFATE
Case Number:	10043-01-3
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171353
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)
Common Name:	SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)
Case Number:	497-19-8
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0171354

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SILICON SAND (AQUARIUM)
Common Name: NATURAL FINE AND COARSE AGGREGATE
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171355
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SILICON DIOXIDE (SAND-NURSERY)
Common Name: SILICON DIOXIDE (SAND-NURSERY)
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171356
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: Nitrogen - Food Grade for Popcorn
Common Name: Nitrogen
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171357
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: Not reported
Common Name: Culinary Dewars 60% Nitrogen/40% CO2
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171358
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: SODIUM HYDROXIDE 25%
Common Name: CAUSTIC SODA 25%
Case Number: 1310-73-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171359
Trade Secret: N
Hazardous Material Type: Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2018-07-24T02:30:22.000
Chemical Name: Not reported
Common Name: X-Cote 43-0-0
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171360
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: Oyster Shell
Common Name: Pacific Pearl Oyster Shell
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0171361
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: Chlorodifluoromethane
Common Name: Chlorodifluoromethane (R-22)
Case Number: 75-45-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145397
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER).
Common Name: WASTE ABSORBENT PAD W/ FORMALIN
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145398
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: VARIOUS LAB PACKS
Common Name: WASTE MEDICAL- LABORATORY
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145399
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name:	WASTE METHANOL WATER SOLUTION
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0145400
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	WASTE 461 PAINT
Common Name:	WASTE - PAINT LIQUIDS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0145401
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	WASTE 902 INFECTIOUS WASTE, SHARPS
Common Name:	WASTE SHARPS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0145402
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name:	WASTE, GAS, DIESEL, LPG
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0145403
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	WASTE 901 INFECTIOUS WASTE, GENERAL
Common Name:	WASTE RED BAG
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0145404
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-07-24T02:30:22.000
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2
Common Name:	WASTE HYDROCHLORIC ACID/CORROSIVES
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145405
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: WASTE RAGS CONTAMINATED W/ SOLVENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145406
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: WASTE 181 INORGANIC SOLID WASTE (OTHER) (2)
Common Name: WASTE PAINT CHIPS & PAINT BOOTH FLTRS (352)(212)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145407
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: WASTE 181 INORGANIC SOLID WASTE (OTHER)
Common Name: INORG SOLID, HYPOCHLORITES
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145408
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: WASTE OILY ABSORBENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145409
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: WASTE 311 PHARMACEUTICAL WASTE
Common Name: WASTE 311 PHARMACEUTICAL WASTE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit: Y
Child Record Id: DEH2018-HWAST-0145410
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name: WASTE AEROSOLS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145411
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: WASTE 212 OXYGENATED SOLVENTS & SOLIDS
Common Name: LACQUER THINNER & RAGS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145412
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: WASTE 903 INF WST,TISSUE/ANAT. REMAINS
Common Name: WASTE PATHOLOGY
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145413
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: Waste Motor oil
Common Name: WASTE MOTOR OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145414
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: WASTE FUEL & OIL FILTERS
Common Name: WASTE FUEL & OIL FILTERS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145415

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: Not reported
Common Name: WASTE - Decalcifying Solution
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145416
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: Not reported
Common Name: WASTE _ Gram Stain
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145417
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: Not reported
Common Name: WASTE - Ethylene Glycol
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145418
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: Not reported
Common Name: WASTE - Activated Carbon
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0145419
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-07-24T02:30:22.000
Chemical Name: Not reported
Common Name: WASTE - ExCell Plus
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211204
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SILICA SAND (WATER FILTERS)
Common Name: SILICA SAND (WATER FILTERS)
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211205
Trade Secret: N

Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :
Common Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :
Case Number: 74-86-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211206
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Common Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211207
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: HYDROCHLORIC ACID
Common Name: MURIATIC/HYDROCHLORIC ACID 31%
Case Number: 7647-01-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211208
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: POLYDIMETHYLSILOXANE EMULSION
Common Name: QWIK DRESS / TIRE DETAILER
Case Number: 63148-62-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211209
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SULFURIC ACID, 36%, H2SO4

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name: SULFURIC ACID, 36%, H2SO4
Case Number: 7664-93-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211210
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SPRAY NINE
Common Name: SPRAY NINE
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211211
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SODIUM HYPOCHLORITE, NaOCl, 13% : LIQUID POOL CHLORINE
Common Name: SODIUM HYPOCHLORITE, NaOCl, 13% : LIQUID POOL CHLORINE
Case Number: 7681-52-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211212
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: GASOLINE
Common Name: UNLEADED GASOLINE
Case Number: 8006-61-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211213
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: ETHYLENE GLYCOL N-BUTYL ETHER
Common Name: WAX ELIMINATOR
Case Number: 111-76-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211214
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: CALCIUM HYPOCHLORITE ACUTAB
Common Name: CALCIUM HYPOCHLORITE ACUTAB
Case Number: MIXTURE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211215
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: HYDROXETHYLIDINE DIPHOSPHONIC
Common Name: ACID, TRIDENT 6026 (WATER TREATMENT)
Case Number: 2809-21-4

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211216
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SODIUM THIOSULFATE
Common Name: SODIUM THIOSULFATE
Case Number: 10102-17-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211217
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: DIESEL FUEL
Common Name: Diesel Fuel
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211218
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SODIUM SULFITE, 25% SOLUTION
Common Name: SODIUM SULFITE, 25% SOLUTION
Case Number: 7757-83-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211219
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: ETHANOL, FOODSERVICE JOY
Common Name: ETHANOL, FOODSERVICE JOY
Case Number: 64-17-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211220
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: STERNO CANNED COOKING FUEL
Common Name: STERNO CANNED COOKING FUEL
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211221
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: OIL LUBRICATING KENDALL
Common Name: KENDALL MOTOR OILS VARIOUS WEIGHTS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211222
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: NONYL PHENOL POLYETHYLENE GLYCOL ETHER FULLIQUID QUARTERNA
Common Name: Fullsan
Case Number: 9016-45-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211223
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: ASSORTED URETHANES
Common Name: ASSORTED URETHANES
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211224
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: RED-E-CRETE, CALCIUM SALT-PORTLAND CEMENT
Common Name: RED-E-CRETE, PORTLAND CEMENT
Case Number: 65977-15-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211225

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: LATEX PAINT
Common Name: LATEX PAINT
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211226
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: OZZYJUICE SW-3 TRUCK DEGREASING SOLIN
Common Name: OZZYJUICE SW-3 TRUCK DEGREASING SOLIN
Case Number: NA

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211227
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: MISSION OVEN CLEANER
Common Name: MISSION OVEN CLEANER
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211228
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Common Name: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211229
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SURFACTANT
Common Name: SHOW-N-GO CAR SOAP
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211230
Trade Secret: N
Hazardous Material Type: Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2019-03-15T00:57:24.000
Chemical Name: PAINT-ASSORTED ENAMELS AND ACRYLICS
Common Name: PAINT-ASSORTED ENAMELS AND ACRYLICS
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211231
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: AUTOMATIC TRANSMISSION FLUID
Common Name: DEXRON II AUTOMATIC TRANSMISSION FLUID
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211232
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SURFACTANT BUBBLE MASTER
Common Name: BUBBLE MASTER 2000 PREMIUM FLUID
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211233
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: HYDROGEN PEROXIDE
Common Name: CLEAN BY PEROXY
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211234
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: CARBON DIOXIDE, C02, 99%, COMPRESSED GAS :
Common Name: CARBON DIOXIDE, C02, 99%, COMPRESSED GAS :
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211235
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: OIL, LUBRICATING : MOTOR OIL HYDRAULIC OIL :

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name: hydraulic oil
Case Number: 8002-05-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211236
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: ETHYLENE GLYCOL
Common Name: ETHYLENE GLYCOL
Case Number: 107-21-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211237
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: ARGON GAS
Common Name: ARGON GAS
Case Number: 7440-37-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211238
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: PROPYLENE GLYCOL
Common Name: PROPYLENE GLYCOL
Case Number: 57-55-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211239
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SODIUM BICARBONATE, SODA ASH
Common Name: SODIUM BICARBONATE, SODA ASH
Case Number: 144-55-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211240
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SODIUM HYPOCHLORITE, NaOCl, 5% : LIQ. HOUSEHOLD BLEACH
Common Name: DISINFECTANT BLEACH, CLOROX, GENERIC
Case Number: 7681-52-9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211241
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: LEAD
Common Name: LEAD
Case Number: 7439-92-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211242
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: DIESEL
Common Name: DIESEL FUEL
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211243
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: ACTIVATED CARBON 100%
Common Name: ACTIVATED CARBON 100%
Case Number: 7440-44-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211244
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: REGULAR UNLEADED
Common Name: UNDERGROUND TANK 100905 T001
Case Number: 684-76-346

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211245
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: IRON, 95% GALVANIZED STEEL
Common Name: IRON, 95% GALVANIZED STEEL
Case Number: 7439-89-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit:	Y
Child Record Id:	DEH2019-HCHEM-0211246
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2019-03-15T00:57:24.000
Chemical Name:	SOLID CARBON DIOXIDE (DRY ICE)
Common Name:	SOLID CARBON DIOXIDE (DRY ICE)
Case Number:	124-38-9
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HCHEM-0211247
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2019-03-15T00:57:24.000
Chemical Name:	SODIUM CHLORIDE, NaCl, 98% : TABLE SALT
Common Name:	SODIUM CHLORIDE, NaCl, 98% : TABLE SALT
Case Number:	7647-14-5
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HCHEM-0211248
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2019-03-15T00:57:24.000
Chemical Name:	CHARCOAL
Common Name:	CHARCOAL
Case Number:	16291-96-6
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HCHEM-0211249
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2019-03-15T00:57:24.000
Chemical Name:	FERTILIZER, TURF GOLD contains X-COTE
Common Name:	22-5-6 W/AMMONIUM SULFATE
Case Number:	7783-20-2
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HCHEM-0211250
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2019-03-15T00:57:24.000
Chemical Name:	AMMONIA NITRATE FERTILIZER-NURSERY
Common Name:	NITRA KING 19-4-4
Case Number:	6484-52-2
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HCHEM-0211251

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Common Name: WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Case Number: 7429-90-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211252
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: MANGANESE, 13% STAINLESS STEEL
Common Name: MANGANESE, 13% STAINLESS STEEL
Case Number: 7439-96-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211253
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: OXYGEN, 02, 99%, COMPRESSED GAS :
Common Name: OXYGEN, 02, 99%, COMPRESSED GAS :
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211254
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: NICKEL, 46% NICKEL STEEL
Common Name: NICKEL, 46% NICKEL STEEL
Case Number: 7440-02-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211255
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: FREON R-123
Common Name: FREON R-123
Case Number: 306-83-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211256
Trade Secret: N
Hazardous Material Type: Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2019-03-15T00:57:24.000
Chemical Name: ALUMINUM SULFATE
Common Name: Aluminum Chlorohydrate
Case Number: 12042-91-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211257
Trade Secret: N

Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)
Common Name: SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)
Case Number: 497-19-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211258
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SILICON SAND (AQUARIUM)
Common Name: NATURAL FINE AND COARSE AGGREGATE
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211259
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SILICON DIOXIDE (SAND-NURSERY)
Common Name: SILICON DIOXIDE (SAND-NURSERY)
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211260
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: Nitrogen - Food Grade for Popcorn
Common Name: Nitrogen
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211261
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name: Culinary Dewars 60% Nitrogen/40% CO2
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211262
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SODIUM HYDROXIDE 25%
Common Name: CAUSTIC SODA 25%
Case Number: 1310-73-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211263
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: Not reported
Common Name: X-Cote 43-0-0
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211264
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: Chlorodifluoromethane
Common Name: Chlorodifluoromethane (R-22)
Case Number: 75-45-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211265
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: NEPTUNE'S HARVEST HYDROLYZED FISH 2-4-1
Common Name: NEPTUNE'S HARVEST
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211266
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SNAPSHOT 2.5 TG HERBICIDE
Common Name: SNAPSHOT 2.5 TG
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211267
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: (Z)-2-BUTENEDIOIC ACID HOMOPOLYMER
Common Name: POLYMALEIC ACID
Case Number: 26099-09-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211268
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: SODIUM CARBONATE, ANHYDROUS
Common Name: SODA ASH DENSE
Case Number: 497-19-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HCHEM-0211269
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-03-15T00:57:24.000
Chemical Name: Lanthanum Chloride
Common Name: Lanthanum Chloride
Case Number: 10099-58-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HWAST-0183399
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-03-15T00:57:27.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER).
Common Name: WASTE ABSORBENT PAD W/ FORMALIN
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HWAST-0183400
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-03-15T00:57:27.000
Chemical Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Common Name: WASTE METHANOL WATER SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit:	Y
Child Record Id:	DEH2019-HWAST-0183401
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2019-03-15T00:57:27.000
Chemical Name:	WASTE 461 PAINT
Common Name:	WASTE - PAINT LIQUIDS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HWAST-0183402
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2019-03-15T00:57:27.000
Chemical Name:	WASTE 902 INFECTIOUS WASTE, SHARPS
Common Name:	WASTE SHARPS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HWAST-0183403
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2019-03-15T00:57:27.000
Chemical Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name:	WASTE, GAS, DIESEL, LPG
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HWAST-0183404
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2019-03-15T00:57:27.000
Chemical Name:	WASTE 901 INFECTIOUS WASTE, GENERAL
Common Name:	WASTE RED BAG
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HWAST-0183405
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2019-03-15T00:57:27.000
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2
Common Name:	WASTE HYDROCHLORIC ACID/CORROSIVES
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HWAST-0183406

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2019-03-15T00:57:27.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name:	WASTE RAGS CONTAMINATED W/ SOLVENT
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HWAST-0183407
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2019-03-15T00:57:27.000
Chemical Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER) (2)
Common Name:	WASTE PAINT CHIPS & PAINT BOOTH FLTRS (352)(212)
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HWAST-0183408
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2019-03-15T00:57:27.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name:	WASTE OILY ABSORBENT
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HWAST-0183409
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2019-03-15T00:57:27.000
Chemical Name:	WASTE 311 PHARMACEUTICAL WASTE
Common Name:	WASTE 311 PHARMACEUTICAL WASTE
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HWAST-0183410
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2019-03-15T00:57:27.000
Chemical Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name:	WASTE AEROSOLS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2019-HWAST-0183411
Trade Secret:	N
Hazardous Material Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2019-03-15T00:57:27.000
Chemical Name: WASTE 212 OXYGENATED SOLVENTS & SOLIDS
Common Name: LACQUER THINNER & RAGS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HWAST-0183412
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-03-15T00:57:27.000
Chemical Name: WASTE 903 INF WST, TISSUE/ANAT. REMAINS
Common Name: WASTE PATHOLOGY
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HWAST-0183413
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-03-15T00:57:27.000
Chemical Name: Waste Motor oil
Common Name: WASTE MOTOR OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HWAST-0183414
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-03-15T00:57:27.000
Chemical Name: WASTE FUEL & OIL FILTERS
Common Name: WASTE FUEL & OIL FILTERS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HWAST-0183415
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-03-15T00:57:27.000
Chemical Name: Not reported
Common Name: WASTE - Decalcifying Solution
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HWAST-0183416
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-03-15T00:57:27.000
Chemical Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name: WASTE _ Gram Stain
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HWAST-0183417
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-03-15T00:57:27.000
Chemical Name: Not reported
Common Name: WASTE - Ethylene Glycol
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HWAST-0183418
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-03-15T00:57:27.000
Chemical Name: Not reported
Common Name: WASTE - Activated Carbon
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2019-HWAST-0183419
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-03-15T00:57:27.000
Chemical Name: Not reported
Common Name: WASTE - ExCell Plus
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196891
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SILICA SAND (WATER FILTERS)
Common Name: SILICA SAND (WATER FILTERS)
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196892
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :
Common Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :
Case Number: 74-86-2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196893
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Common Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196894
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: HYDROCHLORIC ACID
Common Name: MURIATIC/HYDROCHLORIC ACID 31%
Case Number: 7647-01-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196895
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: POLYDIMETHYLSILOXANE EMULSION
Common Name: QWIK DRESS / TIRE DETAILER
Case Number: 63148-62-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196896
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SULFURIC ACID, 36%, H2SO4
Common Name: SULFURIC ACID, 36%, H2SO4
Case Number: 7664-93-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196897
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SPRAY NINE
Common Name: SPRAY NINE
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196898
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SODIUM HYPOCHLORITE, NAOCL, 13% : LIQUID POOL CHLORINE
Common Name: SODIUM HYPOCHLORITE, NAOCL, 13% : LIQUID POOL CHLORINE
Case Number: 7681-52-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196899
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: REGULAR UNLEADED - T006
Common Name: UNDERGROUND TANK 100905 T006 UNLEADED
Case Number: 8006-61-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196900
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: ETHYLENE GLYCOL N-BUTYL ETHER
Common Name: WAX ELIMINATOR
Case Number: 111-76-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196901
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: CALCIUM HYPOCHLORITE ACUTAB
Common Name: CALCIUM HYPOCHLORITE ACUTAB
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196902
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: HYDROXETHYLIDINE DIPHOSPHONIC
Common Name: ACID, TRIDENT 6026 (WATER TREATMENT)
Case Number: 2809-21-4

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196903

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SODIUM THIOSULFATE
Common Name: SODIUM THIOSULFATE
Case Number: 10102-17-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196904
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: DIESEL FUEL
Common Name: Diesel Fuel
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196905
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SODIUM SULFITE, 25% SOLUTION
Common Name: SODIUM SULFITE, 25% SOLUTION
Case Number: 7757-83-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196906
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: ETHANOL, FOODSERVICE JOY
Common Name: ETHANOL, FOODSERVICE JOY
Case Number: 64-17-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196907
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: STERNO CANNED COOKING FUEL
Common Name: STERNO CANNED COOKING FUEL
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196908
Trade Secret: N
Hazardous Material Type: Mixture

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2018-10-26T19:44:37.000
Chemical Name: OIL LUBRICATING KENDALL
Common Name: KENDALL MOTOR OILS VARIOUS WEIGHTS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196909
Trade Secret: N

Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: NONYL PHENOL POLYETHYLENE GLYCOL ETHER FLUID QUARTERNA
Common Name: Fullsan
Case Number: 9016-45-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196910
Trade Secret: N

Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: ASSORTED URETHANES
Common Name: ASSORTED URETHANES
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196911
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: RED-E-CRETE, CALCIUM SALT-PORTLAND CEMENT
Common Name: RED-E-CRETE, PORTLAND CEMENT
Case Number: 65977-15-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196912
Trade Secret: N

Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: LATEX PAINT
Common Name: LATEX PAINT
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196913
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: OZZYJUICE SW-3 TRUCK DEGREASING SOLIN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name:	OZZYJUICE SW-3 TRUCK DEGREASING SOLIN
Case Number:	NA
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0196914
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	MISSION OVEN CLEANER
Common Name:	MISSION OVEN CLEANER
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0196915
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	CARCINOGENS &/OR REPRODUCTIVE TOXINS
Common Name:	BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0196916
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	SURFACTANT
Common Name:	SHOW-N-GO CAR SOAP
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0196917
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	PAINT-ASSORTED ENAMELS AND ACRYLICS
Common Name:	PAINT-ASSORTED ENAMELS AND ACRYLICS
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0196918
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	AUTOMATIC TRANSMISSION FLUID
Common Name:	DEXRON II AUTOMATIC TRANSMISSION FLUID
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196919
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SURFACTANT BUBBLE MASTER
Common Name: BUBBLE MASTER 2000 PREMIUM FLUID
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196920
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: HYDROGEN PEROXIDE
Common Name: CLEAN BY PEROXY
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196921
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: CARBON DIOXIDE, C02, 99%, COMPRESSED GAS :
Common Name: CARBON DIOXIDE, C02, 99%, COMPRESSED GAS :
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196922
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: OIL, LUBRICATING : MOTOR OIL HYDRAULIC OIL :
Common Name: hydraulic oil
Case Number: 8002-05-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196923
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: ETHYLENE GLYCOL
Common Name: ETHYLENE GLYCOL
Case Number: 107-21-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196924
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: ARGON GAS
Common Name: ARGON GAS
Case Number: 7440-37-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196925
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: PROPYLENE GLYCOL
Common Name: PROPYLENE GLYCOL
Case Number: 57-55-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196926
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SODIUM BICARBONATE, SODA ASH
Common Name: SODIUM BICARBONATE, SODA ASH
Case Number: 144-55-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196927
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SODIUM HYPOCHLORITE, NAOCL, 5% : LIQ. HOUSEHOLD BLEACH
Common Name: DISINFECTANT BLEACH, CLOROX, GENERIC
Case Number: 7681-52-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196928
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: LEAD
Common Name: LEAD
Case Number: 7439-92-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196929

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: DIESEL - T007
Common Name: UNDERGROUND TANK 100905 T007
Case Number: 8006-61-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196930
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: ACTIVATED CARBON 100%
Common Name: ACTIVATED CARBON 100%
Case Number: 7440-44-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196931
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: REGULAR UNLEADED
Common Name: UNDERGROUND TANK 100905 T001
Case Number: 684-76-346

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196932
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: IRON, 95% GALVANIZED STEEL
Common Name: IRON, 95% GALVANIZED STEEL
Case Number: 7439-89-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196933
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SOLID CARBON DIOXIDE (DRY ICE)
Common Name: SOLID CARBON DIOXIDE (DRY ICE)
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196934
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SODIUM CHLORIDE, NaCl, 98% : TABLE SALT
Common Name: SODIUM CHLORIDE, NaCl, 98% : TABLE SALT
Case Number: 7647-14-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196935
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: CHARCOAL
Common Name: CHARCOAL
Case Number: 16291-96-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196936
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: FERTILIZER, TURF GOLD contains X-COTE
Common Name: 22-5-6 W/AMMONIUM SULFATE
Case Number: 7783-20-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196937
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: AMMONIA NITRATE FERTILIZER-NURSERY
Common Name: NITRA KING 19-4-4
Case Number: 6484-52-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196938
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Common Name: WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Case Number: 7429-90-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196939
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: MANGANESE, 13% STAINLESS STEEL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name: MANGANESE, 13% STAINLESS STEEL
Case Number: 7439-96-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196940
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: OXYGEN, 02, 99%, COMPRESSED GAS :
Common Name: OXYGEN, 02, 99%, COMPRESSED GAS :
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196941
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: NICKEL, 46% NICKEL STEEL
Common Name: NICKEL, 46% NICKEL STEEL
Case Number: 7440-02-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196942
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: FREON R-123
Common Name: FREON R-123
Case Number: 306-83-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196943
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: ALUMINUM SULFATE
Common Name: Aluminum Chlorohydrate
Case Number: 12042-91-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196944
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)
Common Name: SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)
Case Number: 497-19-8

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196945
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SILICON SAND (AQUARIUM)
Common Name: NATURAL FINE AND COARSE AGGREGATE
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196946
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SILICON DIOXIDE (SAND-NURSERY)
Common Name: SILICON DIOXIDE (SAND-NURSERY)
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196947
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: Nitrogen - Food Grade for Popcorn
Common Name: Nitrogen
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196948
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: Not reported
Common Name: Culinary Dewars 60% Nitrogen/40% CO2
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196949
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: SODIUM HYDROXIDE 25%
Common Name: CAUSTIC SODA 25%
Case Number: 1310-73-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196950
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: Not reported
Common Name: X-Cote 43-0-0
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0196951
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: Chlorodifluoromethane
Common Name: Chlorodifluoromethane (R-22)
Case Number: 75-45-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169686
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER).
Common Name: WASTE ABSORBENT PAD W/ FORMALIN
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169687
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Common Name: WASTE METHANOL WATER SOLUTION
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169688
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: WASTE 461 PAINT
Common Name: WASTE - PAINT LIQUIDS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169689

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	WASTE 902 INFECTIOUS WASTE, SHARPS
Common Name:	WASTE SHARPS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0169690
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name:	WASTE, GAS, DIESEL, LPG
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0169691
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	WASTE 901 INFECTIOUS WASTE, GENERAL
Common Name:	WASTE RED BAG
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0169692
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2
Common Name:	WASTE HYDROCHLORIC ACID/CORROSIVES
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0169693
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name:	WASTE RAGS CONTAMINATED W/ SOLVENT
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0169694
Trade Secret:	N
Hazardous Material Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2018-10-26T19:44:37.000
Chemical Name: WASTE 181 INORGANIC SOLID WASTE (OTHER) (2)
Common Name: WASTE PAINT CHIPS & PAINT BOOTH FLTRS (352)(212)
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169695
Trade Secret: N

Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: WASTE OILY ABSORBENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169696
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: WASTE 311 PHARMACEUTICAL WASTE
Common Name: WASTE 311 PHARMACEUTICAL WASTE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169697
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name: WASTE AEROSOLS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169698
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: WASTE 212 OXYGENATED SOLVENTS & SOLIDS
Common Name: LACQUER THINNER & RAGS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169699
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: WASTE 903 INF WST, TISSUE/ANAT. REMAINS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name:	WASTE PATHOLOGY
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0169700
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	Waste Motor oil
Common Name:	WASTE MOTOR OIL
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0169701
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	WASTE FUEL & OIL FILTERS
Common Name:	WASTE FUEL & OIL FILTERS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0169702
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	Not reported
Common Name:	WASTE - Decalcifying Solution
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0169703
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	Not reported
Common Name:	WASTE _ Gram Stain
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0169704
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-10-26T19:44:37.000
Chemical Name:	Not reported
Common Name:	WASTE - Ethylene Glycol
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169705
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: Not reported
Common Name: WASTE - Activated Carbon
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0169706
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-10-26T19:44:37.000
Chemical Name: Not reported
Common Name: WASTE - ExCell Plus
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152900
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SILICA SAND (WATER FILTERS)
Common Name: SILICA SAND (WATER FILTERS)
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152901
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :
Common Name: ACETYLENE, C2H2, 99%, COMPRESSED GAS :
Case Number: 74-86-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152902
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Common Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS :
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152903
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: ASSORTED POLYURETHANES
Common Name: ASSORTED POLYURETHANES
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152904
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: HYDROCHLORIC ACID
Common Name: MURIATIC ACID
Case Number: 7647-01-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152905
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: POLYDIMETHYLSILOXANE EMULSION
Common Name: QWIK DRESS / TIRE DETAILER
Case Number: 63148-62-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152906
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SULFURIC ACID, 36%, H2SO4
Common Name: SULFURIC ACID, 36%, H2SO4
Case Number: 7664-93-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152907
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SPRAY NINE
Common Name: SPRAY NINE
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152908

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SODIUM HYPOCHLORITE, NAOCL, 13% : LIQUID POOL CHLORINE
Common Name: SODIUM HYPOCHLORITE, NAOCL, 13% : LIQUID POOL CHLORINE
Case Number: 7681-52-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152909
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: REGULAR UNLEADED - T006
Common Name: UNDERGROUND TANK 100905 T006 UNLEADED
Case Number: 8006-61-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152910
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: ETHYLENE GLYCOL N-BUTYL ETHER
Common Name: WAX ELIMINATOR
Case Number: 111-76-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152911
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: CALCIUM HYPOCHLORITE ACUTAB
Common Name: CALCIUM HYPOCHLORITE ACUTAB
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152912
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: HYDROXYETHYLIDINE DIPHOSPHONIC
Common Name: ACID, TRIDENT 6026 (WATER TREATMENT)
Case Number: 2809-21-4

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152913
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	SODIUM THIOSULFATE
Common Name:	SODIUM THIOSULFATE
Case Number:	10102-17-7
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152914
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	DIETHYLENE GLYCOL MONOETHYL ETHER
Common Name:	FLOOR FINISH
Case Number:	111-90-0
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152915
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	DIESEL FUEL
Common Name:	Diesel Fuel
Case Number:	68476-34-6
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152916
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	SODIUM SULFITE, 25% SOLUTION
Common Name:	SODIUM SULFITE, 25% SOLUTION
Case Number:	7757-83-7
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152917
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WETSUIT CLEANER
Common Name:	WETSUIT CLEANER
Case Number:	MIXTURE
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152918
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	ETHANOL, FOODSERVICE JOY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name: ETHANOL, FOODSERVICE JOY
Case Number: 64-17-5

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152919
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: STERNO CANNED COOKING FUEL
Common Name: STERNO CANNED COOKING FUEL
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152920
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: OIL LUBRICATING KENDALL
Common Name: KENDALL MOTOR OILS VARIOUS WEIGHTS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152921
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: NONYL PHENOL POLYETHYLENE GLYCOL ETHER FLUID QUARTERNA
Common Name: NONYL PHENOL POLYETHYLENE GLYCOL ETHER FLUID QUARTERNA
Case Number: 9016-45-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152922
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: ASSORTED URETHANES
Common Name: ASSORTED URETHANES
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152923
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: RED-E-CRETE, CALCIUM SALT-PORTLAND CEMENT
Common Name: RED-E-CRETE, CALCIUM SALT-PORTLAND CEMENT
Case Number: 65977-15-1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152924
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: LATEX PAINT
Common Name: LATEX PAINT
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152925
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: MDI
Common Name: SAFE DECK
Case Number: 101-68-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152926
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: OZZYJUICE SW-3 TRUCK DEGREASING SOLIN
Common Name: OZZYJUICE SW-3 TRUCK DEGREASING SOLIN
Case Number: NA

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152927
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: MISSION OVEN CLEANER
Common Name: MISSION OVEN CLEANER
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152928
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: CARCINOGENS &/OR REPRODUCTIVE TOXINS
Common Name: BELOW STATE DISCLOSURE AMTS ARE/MAY BE ON SITE
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152929
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SURFACTANT
Common Name: SHOW-N-GO CAR SOAP
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152930
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SILPUR 90%
Common Name: SULPHUR FERTILIZER
Case Number: 7704-34-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152931
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: PAINT-ASSORTED ENAMELS AND ACRYLICS
Common Name: PAINT-ASSORTED ENAMELS AND ACRYLICS
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152932
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: AUTOMATIC TRANSMISSION FLUID
Common Name: DEXRON II AUTOMATIC TRANSMISSION FLUID
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152933
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SURFACTANT BUBBLE MASTER
Common Name: BUBBLE MASTER 2000 PREMIUM FLUID
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152934

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: HYDROGEN PEROXIDE
Common Name: CLEAN BY PEROXY
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152935
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: PWC-1 BACTERIAL ADDITIVE
Common Name: PWC-1 BACTERIAL ADDITIVE
Case Number: NONE LISTED

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152936
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: CARBON DIOXIDE, C02, 99%, COMPRESSED GAS :
Common Name: CARBON DIOXIDE, C02, 99%, COMPRESSED GAS :
Case Number: 124-38-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152937
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: OIL, LUBRICATING : MOTOR OIL HYDRAULIC OIL :
Common Name: hydraulic oil
Case Number: 8002-05-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152938
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: ETHYLENE GLYCOL
Common Name: ETHYLENE GLYCOL
Case Number: 107-21-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152939
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2017-10-23T20:36:56.000
Chemical Name: ARGON GAS
Common Name: ARGON GAS
Case Number: 7440-37-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152940
Trade Secret: N

Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: PIG DRI (ABSORTBENT SPILL MATERIAL)
Common Name: PIG DRI (ABSORTBENT SPILL MATERIAL)
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152941
Trade Secret: N

Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: PROPYLENE GLYCOL
Common Name: PROPYLENE GLYCOL
Case Number: 57-55-6

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152942
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SODIUM BICARBONATE, SODA ASH
Common Name: SODIUM BICARBONATE, SODA ASH
Case Number: 144-55-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152943
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SODIUM HYPOCHLORITE, NAOCL, 5% : LIQ. HOUSEHOLD BLEACH
Common Name: DISINFECTANT BLEACH, CLOROX, GENERIC
Case Number: 7681-52-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152944
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SULFUR Fertilizer Tiger 90CR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name: SULFUR COATED UREA/X COTE 42-0-0
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152945
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: LEAD
Common Name: LEAD
Case Number: 7439-92-1

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152946
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: DIESEL - T007
Common Name: UNDERGROUND TANK 100905 T007
Case Number: 8006-61-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152947
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: ACTIVATED CARBON 100%
Common Name: ACTIVATED CARBON 100%
Case Number: 7440-44-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152948
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: REGULAR UNLEADED
Common Name: UNDERGROUND TANK 100905 T001
Case Number: 684-76-346

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152949
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: NITROGEN, N2, 99%, COMPRESSED GAS :
Common Name: NITROGEN, N2, 99%, COMPRESSED GAS :
Case Number: 7727-37-9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152950
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	IRON, 95% GALVANIZED STEEL
Common Name:	IRON, 95% GALVANIZED STEEL
Case Number:	7439-89-6
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152951
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	SOLID CARBON DIOXIDE (DRY ICE)
Common Name:	SOLID CARBON DIOXIDE (DRY ICE)
Case Number:	124-38-9
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152952
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	MONO AMMONIUM PHOSPHATE, 95%,
Common Name:	ABC DRY CHEM. FIRE EXTINGUISHER
Case Number:	25655-41-8
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152953
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	SODIUM CHLORIDE, NACL, 98% : TABLE SALT
Common Name:	SODIUM CHLORIDE, NACL, 98% : TABLE SALT
Case Number:	7647-14-5
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152954
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	CHARCOAL
Common Name:	CHARCOAL
Case Number:	16291-96-6
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152955
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	FERTILIZER, TURF GOLD contains X-COTE
Common Name:	22-5-6 W/AMMONIUM SULFATE
Case Number:	7783-20-2
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152956
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	ZINC OXIDE, 3%, SIMPLOT 6-20-20 (FET W/ZINC)
Common Name:	ZINC OXIDE, 3%, SIMPLOT 6-20-20 (FET W/ZINC)
Case Number:	1314-13-2
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152957
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	NITRA KING 19-4-4 (FERTILIZER-NURSERY-BONEYARD
Common Name:	AMMONIA NITRATE)
Case Number:	6484-52-2
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152958
Trade Secret:	N
Hazardous Material Type:	Mixture
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Common Name:	WROUGHT ALUMINUM ALLOY, ALUMINUM 92%, BUILDING PRODUCT
Case Number:	7429-90-5
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152959
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	MANGANESE, 13% STAINLESS STEEL
Common Name:	MANGANESE, 13% STAINLESS STEEL
Case Number:	7439-96-5
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0152960

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: OXYGEN, 02, 99%, COMPRESSED GAS :
Common Name: OXYGEN, 02, 99%, COMPRESSED GAS :
Case Number: 7782-44-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152961
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: NICKEL, 99% NICKEL STEEL
Common Name: NICKEL, 99% NICKEL STEEL
Case Number: 7440-02-0

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152962
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: FREON R-123
Common Name: FREON R-123
Case Number: 306-83-2

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152963
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: ALUMINUM SULFATE
Common Name: ALUMINUM SULFATE
Case Number: 10043-01-3

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152964
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)
Common Name: SODIUM CARBONATE, 48% SOLID FUSION (SOLID DETERGENT)
Case Number: 497-19-8

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152965
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SILICON SAND (AQUARIUM)
Common Name: NATURAL FINE AND COARSE AGGREGATE
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152966
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SILICON SAND (MERCHANRISE)
Common Name: PLAYSAND
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152967
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SILICON DIOXIDE (SAND-NURSERY)
Common Name: SILICON DIOXIDE (SAND-NURSERY)
Case Number: 14808-60-7

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152968
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: Nitrogen - Food Grade for Popcorn
Common Name: Nitrogen
Case Number: 7727-37-9

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152969
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: Not reported
Common Name: Culinary Dewars 60% Nitrogen/40% CO2
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0152970
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: SODIUM HYDROXIDE 25%

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Common Name:	CAUSTIC SODA 25%
Case Number:	1310-73-2
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131212
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER).
Common Name:	WASTE ABSORBENT PAD W/ FORMALIN
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131213
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	VARIOUS LAB PACKS
Common Name:	WASTE MEDICAL- LABORATORY
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131214
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Common Name:	WASTE METHANOL WATER SOLUTION
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131215
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 461 PAINT
Common Name:	WASTE - PAINT LIQUIDS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131216
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 902 INFECTIOUS WASTE, SHARPS
Common Name:	WASTE SHARPS
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131217
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER)-
Common Name:	WASTE MERCURY CONTAINING DEVICES
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131218
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name:	WASTE, GAS, DIESEL, LPG
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131219
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER).
Common Name:	WASTE, PROPANE (551)
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131220
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 901 INFECTIOUS WASTE, GENERAL
Common Name:	WASTE RED BAG
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131221
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 791 LIQUIDS WITH PH <OR= 2
Common Name:	WASTE HYDROCHLORIC ACID/CORROSIVES
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131222
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name:	WASTE RAGS CONTAMINATED W/ SOLVENT
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131223
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER) (2)
Common Name:	WASTE PAINT CHIPS & PAINT BOOTH FLTRS (352)(212)
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131224
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 181 INORGANIC SOLID WASTE (OTHER)
Common Name:	INORG SOLID, HYPOCHLORITES
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131225
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name:	WASTE OILY ABSORBENT
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131226
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-10-23T20:36:56.000
Chemical Name:	WASTE 311 PHARMACEUTICAL WASTE
Common Name:	WASTE 311 PHARMACEUTICAL WASTE
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100905
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0131227

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: WASTE 331 OFF-SPEC,AGED,SURPLUS ORGANICS
Common Name: WASTE AEROSOLS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131228
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: WASTE 212 OXYGENATED SOLVENTS
Common Name: LACQUER THINNER
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131229
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: WASTE 903 INF WST, TISSUE/ANAT. REMAINS
Common Name: WASTE PATHOLOGY
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131230
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: Waste Motor oil
Common Name: WASTE MOTOR OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131231
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: WASTE FUEL & OIL FILTERS
Common Name: WASTE FUEL & OIL FILTERS
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131232
Trade Secret: N
Hazardous Material Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Last Updated: 2017-10-23T20:36:56.000
Chemical Name: Not reported
Common Name: WASTE - Decalcifying Solution
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131233
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: Not reported
Common Name: WASTE _ Gram Stain
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131234
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: Not reported
Common Name: WASTE - Ethylene Glycol
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131235
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: Not reported
Common Name: WASTE - Activated Carbon
Case Number: Not reported

Record ID: DEH2002-HUPFP-100905
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0131236
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-10-23T20:36:56.000
Chemical Name: Not reported
Common Name: WASTE - ExCell Plus
Case Number: Not reported

CERS HAZ WASTE:

Name: SEAWORLD
Address: 1720 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 401896
CERS ID: 10383472
CERS Description: Hazardous Waste Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

CERS TANKS:

Name: SEAWORLD
Address: 1720 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 401896
CERS ID: 10383472
CERS Description: Underground Storage Tank

Name: SEAWORLD
Address: 1720 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 401896
CERS ID: 10383472
CERS Description: Aboveground Petroleum Storage

CERS:

Name: SEAWORLD
Address: 1720 S SHORES RD
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 401896
CERS ID: 10383472
CERS Description: Chemical Storage Facilities

Evaluation:

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-06-2018
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Denslow Vikki Inspection ID:5944443
Eval Division: San Diego County Department of Env Health
Eval Program: APSA
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-06-2018
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Denslow Vikki Inspection ID:5944443
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-06-2018
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Denslow Vikki Inspection ID:5944443
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-06-2018
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Denslow Vikki Inspection ID:5944443
Eval Division: San Diego County Department of Env Health

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Eval Program:	UST
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	08-10-2017
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: McLernon Benjamin Inspection ID:5698017
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	08-12-2016
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: McLernon Benjamin Inspection ID:5472543
Eval Division:	San Diego County Department of Env Health
Eval Program:	APSA
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	08-12-2016
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: McLernon Benjamin Inspection ID:5472543
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	08-12-2016
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: McLernon Benjamin Inspection ID:5472543
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	08-12-2016
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: McLernon Benjamin Inspection ID:5472543
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	08-14-2014
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Griffith Gary Inspection ID:4982007
Eval Division:	San Diego County Department of Env Health
Eval Program:	APSA
Eval Source:	CERS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-14-2014
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Griffith Gary Inspection ID:4982007
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-14-2014
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Griffith Gary Inspection ID:4982007
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-14-2014
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Griffith Gary Inspection ID:4982007
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-14-2015
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Griffith Gary Inspection ID:5326269
Eval Division: San Diego County Department of Env Health
Eval Program: APSA
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-14-2015
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Griffith Gary Inspection ID:5326269
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-14-2015
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Griffith Gary Inspection ID:5326269
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-14-2015
Violations Found: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Eval Type: Routine done by local agency
Eval Notes: Inspector: Griffith Gary Inspection ID:5326269
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-22-2013
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Griffith Gary Inspection ID:4093358
Eval Division: San Diego County Department of Env Health
Eval Program: APSA
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-22-2013
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Griffith Gary Inspection ID:4093358
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-22-2013
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Griffith Gary Inspection ID:4093358
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-22-2013
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Griffith Gary Inspection ID:4093358
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Coordinates:
Site ID: 401896
Facility Name: SEAWORLD
Env Int Type Code: APSA
Program ID: 10383472
Coord Name: Not reported
Ref Point Type Desc: Center of a facility or station.
Latitude: 32.764820
Longitude: -117.230670

Affiliation:
Affiliation Type Desc: Document Preparer
Entity Name: Shari Sehlhorst
Entity Title: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer
Entity Name: Shari Sehlhorst
Entity Title: Environmental Leader
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner
Entity Name: SeaWorld LLC
Entity Title: Not reported
Affiliation Address: 500 Sea World Drive
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92109
Affiliation Phone: (619) 225-3219

Affiliation Type Desc: UST Permit Applicant
Entity Name: ATTN: JULIE BYFORD
Entity Title: Environmental Manager
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 225-3247

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 500 SEA WORLD DR
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92109-7994
Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District
Entity Name: San Diego County Env Health
Entity Title: Not reported
Affiliation Address: PO Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92112-9261
Affiliation Phone: (858) 505-6880

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Affiliation Type Desc:	Operator
Entity Name:	SEA WORLD LLC
Entity Title:	Not reported
Affiliation Address:	Not reported
Affiliation City:	Not reported
Affiliation State:	Not reported
Affiliation Country:	Not reported
Affiliation Zip:	Not reported
Affiliation Phone:	(619) 222-6363
Affiliation Type Desc:	Parent Corporation
Entity Name:	SEAWORLD
Entity Title:	Not reported
Affiliation Address:	Not reported
Affiliation City:	Not reported
Affiliation State:	Not reported
Affiliation Country:	Not reported
Affiliation Zip:	Not reported
Affiliation Phone:	Not reported
Affiliation Type Desc:	UST Tank Operator
Entity Name:	SEAWORLD SAN DIEGO
Entity Title:	Not reported
Affiliation Address:	500 SEA WORLD DRIVE
Affiliation City:	San Diego
Affiliation State:	CA
Affiliation Country:	United States
Affiliation Zip:	92109
Affiliation Phone:	(619) 226-3630
Affiliation Type Desc:	UST Tank Owner
Entity Name:	SEA WORLD INC
Entity Title:	Not reported
Affiliation Address:	1720 S SHORES ROAD
Affiliation City:	SAN DIEGO
Affiliation State:	CA
Affiliation Country:	United States
Affiliation Zip:	92109-
Affiliation Phone:	(619) 226-3630
Affiliation Type Desc:	Environmental Contact
Entity Name:	SHARI SEHLHORST
Entity Title:	Not reported
Affiliation Address:	500 SEA WORLD DR
Affiliation City:	SAN DIEGO
Affiliation State:	CA
Affiliation Country:	Not reported
Affiliation Zip:	92109
Affiliation Phone:	Not reported
Affiliation Type Desc:	UST Property Owner Name
Entity Name:	City of San Diego
Entity Title:	Not reported
Affiliation Address:	500 Sea World Drive
Affiliation City:	SAN DIEGO
Affiliation State:	CA
Affiliation Country:	United States

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAWORLD (Continued)

S123406592

Affiliation Zip: Not reported
Affiliation Phone: (619) 225-3247

C97
< 1/8
1 ft.
SEA WORLD HYDRO DOCK
1720 SHORES
SAN DIEGO, CA

HIST CORTESE
S105026131
N/A

Site 52 of 52 in cluster C

Relative: HIST CORTESE:
Lower edr_fname: SEA WORLD HYDRO DOCK
edr_fadd1: 1720 SHORES
Actual: City,State,Zip: SAN DIEGO, CA
15 ft. Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT2091

B98
WNW
< 1/8
0.019 mi.
100 ft.
GOLDEN STATE BOATS INC DBA FREEDOM BOAT CLUB
2630 INGRAHAM ST
SAN DIEGO, CA 92109
Site 9 of 14 in cluster B

RCRA NonGen / NLR
1024856382
CAL000420263

Relative: RCRA NonGen / NLR:
Lower Date form received by agency: 09/20/2016
Actual: Facility name: GOLDEN STATE BOATS INC DBA FREEDOM BOAT CLUB
12 ft. Facility address: 2630 INGRAHAM ST
SAN DIEGO, CA 92109
EPA ID: CAL000420263
Contact: DAN HASBROUCK
Contact address: 2630 INGRAHAM ST.
SAN DIEGO, CA 92109
Contact country: Not reported
Contact telephone: 619-981-2628
Contact email: DHASBROUCK@FREEDOMBOATCLUB.COM
EPA Region: 09
Classification: Non-Generator
Description: Handler: Non-Generators do not presently generate hazardous waste

Owner/Operator Summary:
Owner/operator name: DAN HASBROUCK
Owner/operator address: 2630 INGRAHAM ST.
SAN DIEGO, CA 92109
Owner/operator country: Not reported
Owner/operator telephone: 619-981-2628
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Other
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported
Owner/operator name: GOLDEN STATE BOATS INC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOLDEN STATE BOATS INC DBA FREEDOM BOAT CLUB (Continued)

1024856382

Owner/operator address: 2630 INGRAHAM ST
SAN DIEGO, CA 92109
Owner/operator country: Not reported
Owner/operator telephone: 619-981-2628
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Other
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: Yes
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

B99
WNW
< 1/8
0.019 mi.
102 ft.

DANA LANDING FUEL DOCK
2590 INGRAHAM ST
SAN DIEGO, CA 92109
Site 10 of 14 in cluster B

SAN DIEGO CO. SAM
UST
HIST UST
SAN DIEGO CO LOP

U001572781
N/A

Relative:
Lower
Actual:
11 ft.

SAN DIEGO CO. SAM:
Name: DANA LANDING FUEL DOCK
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 921097901
Case Number: H03337-001
Agency: DEH Site Assessment & Mitigation
Funding: **LOP - Federal Fund**
Facility Type: GW With No Beneficial Use Designation
Facility Status: Closed Case
Date: 1/6/2000
Date Began: 4/8/1997

UST:

Name: DANA LANDING FUEL DOCK
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Facility ID: H03337
Permitting Agency: SAN DIEGO COUNTY
Latitude: 32.76796
Longitude: -117.2338

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

U001572781

HIST UST:

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
File Number: Not reported
URL: Not reported
Region: STATE
Facility ID: 00000067207
Facility Type: Gas Station
Other Type: Not reported
Contact Name: DAVE SEEBER
Telephone: 6192243221
Owner Name: WESCO SALES CORPORATION
Owner Address: 21200 VICTORY BLVD., P.O. BOX
Owner City,St,Zip: WOODLAND HILLS, CA 91367
Total Tanks: 0003

Tank Num: 001
Container Num: #3
Year Installed: 1971
Tank Capacity: 00005000
Tank Used for: WASTE
Type of Fuel: 1
Container Construction Thickness: X
Leak Detection: None

Tank Num: 002
Container Num: #1
Year Installed: 1971
Tank Capacity: 00005000
Tank Used for: PRODUCT
Type of Fuel: REGULAR
Container Construction Thickness: Not reported
Leak Detection: None

Tank Num: 003
Container Num: #2
Year Installed: 1971
Tank Capacity: 00005000
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: Not reported
Leak Detection: None

SAN DIEGO CO LOP:

Name: DANA LANDING FUEL DOCK
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Record ID: DEH1997-LSAM-H03337-001
Record Status: Completed
Opened Date: 04/18/1997
Parcel Number: 760-029-01-00
Case Type: LOP - Local Oversight Program
Historical Name: DANA LANDING FUEL DOCK
SWRCB Global ID: T0607302265
Funding: F - LOP Federal Fund

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

U001572781

Lead Agency: DEH/SAM
Lead Agency Date: 04/30/1997
Census Tract: 76.00
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 906.7
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Latitude: 32.7682678
Longitude: -117.2350088
X MapCoord: 6258825.972
Y MapCoord: 1860783.340

B100
WNW
< 1/8
0.019 mi.
102 ft.
DANA MARINA BAIT & TACKLE
2590 INGRAHAM ST
SAN DIEGO, CA 92109
Site 11 of 14 in cluster B

HIST UST **U001572782**
N/A

Relative:
Lower
Actual:
11 ft.

HIST UST:
Name: DANA MARINA BAIT & TACKLE
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
File Number: Not reported
URL: Not reported
Region: STATE
Facility ID: 00000018546
Facility Type: Gas Station
Other Type: MARINE FUEL FACILITY
Contact Name: WALTER HEIM
Telephone: 6192250440
Owner Name: FISHERMEN'S SUPPLY CENTER, INC
Owner Address: 2590 INGRAHAM ST.
Owner City,St,Zip: SAN DIEGO, CA 92109
Total Tanks: 0003

Tank Num: 001
Container Num: 0000000001
Year Installed: Not reported
Tank Capacity: 00005000
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: Not reported
Leak Detection: Visual, Pressure Test

Tank Num: 002
Container Num: 2
Year Installed: Not reported
Tank Capacity: 00005000
Tank Used for: PRODUCT
Type of Fuel: REGULAR
Container Construction Thickness: Not reported
Leak Detection: Visual, Pressure Test

Tank Num: 003
Container Num: 1
Year Installed: Not reported
Tank Capacity: 00005000

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA MARINA BAIT & TACKLE (Continued)

U001572782

Tank Used for: PRODUCT
Type of Fuel: REGULAR
Container Construction Thickness: Not reported
Leak Detection: Visual, Pressure Test

B101
WNW
< 1/8
0.019 mi.
102 ft.

MARSHALL SHIELDS
2590 INGRAHAM ST
SAN DIEGO, CA 92109

HIST UST
HAZNET

S112869002
N/A

Site 12 of 14 in cluster B

Relative:
Lower

Actual:
11 ft.

HIST UST:

Name: DANA MARINA BAIT AND TACKLE
Address: 2590 INGRAHAM STREET
City,State,Zip: SAN DIEGO, CA 92109
File Number: 0002B2E7
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002B2E7.pdf>
Region: Not reported
Facility ID: Not reported
Facility Type: Not reported
Other Type: Not reported
Contact Name: Not reported
Telephone: Not reported
Owner Name: Not reported
Owner Address: Not reported
Owner City,St,Zip: Not reported
Total Tanks: Not reported

Tank Num: Not reported
Container Num: Not reported
Year Installed: Not reported
Tank Capacity: Not reported
Tank Used for: Not reported
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: Not reported

Tank Num: Not reported
Container Num: Not reported
Year Installed: Not reported
Tank Capacity: Not reported
Tank Used for: Not reported
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: Not reported

Click here for Geo Tracker PDF:

HAZNET:

Name: MARSHALL SHIELDS
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 921090000
Year: 1996
GEPAID: CAC001142784
Contact: MARSHALL SHIELDS
Telephone: 6192866611
Mailing Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MARSHALL SHIELDS (Continued)

S112869002

Mailing Address: 4698 ALVARADO CANYON RD
Mailing City,St,Zip: SAN DIEGO, CA 921200000
Gen County: San Diego
TSD EPA ID: CAT080013352
TSD County: Los Angeles
Tons: 0.231
CA Waste Code: 134-Aqueous solution with total organic residues less than 10 percent
Method: R01-Recycler
Facility County: San Diego

B102
WNW
< 1/8
0.019 mi.
102 ft.

DANA LANDING FUEL DOCK
2590 INGRAHAM ST
SAN DIEGO, CA 92109

Site 13 of 14 in cluster B

LUST **S103647222**
HIST CORTESE **N/A**
CERS

Relative:
Lower

Actual:
11 ft.

LUST:
Name: DANA LANDING FUEL DOCK
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 921097901
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607302265
Global Id: T0607302265
Latitude: 32.7676564
Longitude: -117.2337347
Status: Completed - Case Closed
Status Date: 01/06/2000
Case Worker: NS
RB Case Number: 9UT3499
Local Agency: SAN DIEGO COUNTY LOP
File Location: Local Agency
Local Case Number: H03337-001
Potential Media Affect: Other Groundwater (uses other than drinking water)
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:
Global Id: T0607302265
Contact Type: Local Agency Caseworker
Contact Name: NASSER SIONIT
Organization Name: SAN DIEGO COUNTY LOP
Address: P.O. Box 129261
City: San Diego
Email: nasser.sionit@sdcounty.ca.gov
Phone Number: Not reported

LUST:
Global Id: T0607302265
Action Type: Other
Date: 04/08/1997
Action: Leak Began

Global Id: T0607302265
Action Type: Other
Date: 04/08/1997
Action: Leak Discovery

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S103647222

Global Id: T0607302265
Action Type: ENFORCEMENT
Date: 05/21/1997
Action: Notice of Responsibility

Global Id: T0607302265
Action Type: Other
Date: 05/09/1997
Action: Leak Stopped

Global Id: T0607302265
Action Type: ENFORCEMENT
Date: 01/06/2000
Action: Closure/No Further Action Letter

Global Id: T0607302265
Action Type: Other
Date: 04/18/1997
Action: Leak Reported

LUST:

Global Id: T0607302265
Status: Open - Case Begin Date
Status Date: 04/08/1997

Global Id: T0607302265
Status: Completed - Case Closed
Status Date: 01/06/2000

HIST CORTESE:

edr_fname: DANA LANDING FUEL DOCK
edr_fadd1: 2590 INGRAHAM
City,State,Zip: SAN DIEGO, CA
Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT3499

CERS:

Name: DANA LANDING FUEL DOCK
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 921097901
Site ID: 201926
CERS ID: T0607302265
CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker
Entity Name: NASSER SIONIT - SAN DIEGO COUNTY LOP
Entity Title: Not reported
Affiliation Address: P.O. Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S103647222

Affiliation Phone: Not reported

B103
WNW
< 1/8
0.019 mi.
102 ft.

DANA LANDING FUEL DOCK
2590 INGRAHAM ST
SAN DIEGO, CA 92109

Site 14 of 14 in cluster B

LUST
San Diego Co. HMMD
SWEEPS UST
CHMIRS
EMI
CERS

S101669459
N/A

Relative:
Lower

Actual:
11 ft.

LUST REG 9:

Region: 9
Status: Preliminary site assessment workplan submitted
Case Number: 9UT3499
Local Case: H03337-001
Substance: Unleaded Gasoline
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Tank
Cause: Corrosion
Lead Agency: Local Agency
Case Type: Other ground water affected
Date Found: 04/08/1997
Date Stopped: 05/09/1997
Confirm Date: 04/08/1997
Submit Workplan: 4/8/97
Prelim Assess: / /
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 04/18/1997
Enforce Date: 5/21/97
Closed Date: Not reported
Enforce Type: SEL
Pilot Program: LOP
Basin Number: 906.30
GW Depth: Not reported
Beneficial Use: NBNOC
NPDES Number: Not reported
Priority: Medium priority
File Dispn: Administratively opened on database, however no file physically exists
Interim Remedial Actions: Not reported
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

HMMD SAN DIEGO:

Name: VONS MASTER MARINE
Address: 2590 N INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 125798
Business Type: 6HK26
EPA Id Number: CAL00159313
APN: 760-029-01-00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S101669459

Last HMMD Inspection: 05/12/1999
Facility Telephone: 619-223-1154
Permit Status: INAC
Permit Expiration: 05/31/2000
Date Last Updated: 11/02/2012
Facility Owner: VONS OUTBOARDS, LLC
Facility Mailing Address: 2590 INGRAHAM ST
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109-7901
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

SWEEPS UST:

Name: CLUB NAUTICO MISSION BAY
Address: 2590 INGRAHAM ST
City: SAN DIEGO
Status: Active
Comp Number: 3337
Number: 9
Board Of Equalization: 44-021840
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-003337-000001
Tank Status: A
Capacity: 5000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: 3

Name: CLUB NAUTICO MISSION BAY
Address: 2590 INGRAHAM ST
City: SAN DIEGO
Status: Active
Comp Number: 3337
Number: 9
Board Of Equalization: 44-021840
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-003337-000002
Tank Status: A
Capacity: 5000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: LEADED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S101669459

Number Of Tanks: Not reported

Name: CLUB NAUTICO MISSION BAY
Address: 2590 INGRAHAM ST
City: SAN DIEGO
Status: Active
Comp Number: 3337
Number: 9
Board Of Equalization: 44-021840
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-003337-000003
Tank Status: A
Capacity: 5000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: LEADED
Number Of Tanks: Not reported

CHMIRS:

Name: Not reported
Address: 2590 INGRAHAM
City,State,Zip: SAN DIEGO, CA
OES Incident Number: 1-0260
OES notification: 01/12/2001
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: Mission Bay/Pacific Ocean

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S101669459

Spill Site:	Not reported
Cleanup By:	TBD
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Date/Time:	Not reported
Year:	2001
Agency:	NRC
Incident Date:	1/12/200112:00:00 AM
Admin Agency:	Not reported
Amount:	Not reported
Contained:	Unknown
Site Type:	Waterways
E Date:	Not reported
Substance:	unk
Unknown:	N/A
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	Received an NRC report advising a caller reported an unidentified material, looks like paint? In the Marina Basin flowing in from the middle of the jetty, between the Ingraham Street Bridge and the West Mission Bay Bridge.

EMI:

Name:	DANA LANDING
Address:	2590 INGRAHAM ST
City,State,Zip:	SAN DIEGO, CA 921097901
Year:	2006
County Code:	37
Air Basin:	SD
Facility ID:	1437
Air District Name:	SD
SIC Code:	5541
Air District Name:	SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System:	Not reported
Consolidated Emission Reporting Rule:	Not reported
Total Organic Hydrocarbon Gases Tons/Yr:	.12
Reactive Organic Gases Tons/Yr:	.12
Carbon Monoxide Emissions Tons/Yr:	0
NOX - Oxides of Nitrogen Tons/Yr:	0
SOX - Oxides of Sulphur Tons/Yr:	0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S101669459

Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 933010000
Year: 2007
County Code: 37
Air Basin: SD
Facility ID: 1437
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: .12
Reactive Organic Gases Tons/Yr: .12
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Year: 2008
County Code: 37
Air Basin: SD
Facility ID: 1437
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: .12
Reactive Organic Gases Tons/Yr: .12
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Year: 2009
County Code: 37
Air Basin: SD
Facility ID: 1437
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.12
Reactive Organic Gases Tons/Yr: 0.12

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S101669459

Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Year: 2010
County Code: 37
Air Basin: SD
Facility ID: 1437
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.12
Reactive Organic Gases Tons/Yr: 0.12
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Year: 2011
County Code: 37
Air Basin: SD
Facility ID: 1437
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.12
Reactive Organic Gases Tons/Yr: 0.12
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Year: 2012
County Code: 37
Air Basin: SD
Facility ID: 1437
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S101669459

Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.12
Reactive Organic Gases Tons/Yr: 0.12
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Year: 2013
County Code: 37
Air Basin: SD
Facility ID: 1437
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.12
Reactive Organic Gases Tons/Yr: 0.12
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Year: 2014
County Code: 37
Air Basin: SD
Facility ID: 1437
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.12
Reactive Organic Gases Tons/Yr: 0.12
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Year: 2015
County Code: 37
Air Basin: SD
Facility ID: 1437
Air District Name: SD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S101669459

SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.12
Reactive Organic Gases Tons/Yr: 0.12
Carbon Monoxide Emissions Tons/Yr: 0
NOX - Oxides of Nitrogen Tons/Yr: 0
SOX - Oxides of Sulphur Tons/Yr: 0
Particulate Matter Tons/Yr: 0
Part. Matter 10 Micrometers and Smllr Tons/Yr:0

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Year: 2016
County Code: 37
Air Basin: SD
Facility ID: 1437
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.12
Reactive Organic Gases Tons/Yr: 0.12
Carbon Monoxide Emissions Tons/Yr: Not reported
NOX - Oxides of Nitrogen Tons/Yr: Not reported
SOX - Oxides of Sulphur Tons/Yr: Not reported
Particulate Matter Tons/Yr: Not reported
Part. Matter 10 Micrometers and Smllr Tons/Yr:Not reported

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Year: 2017
County Code: 37
Air Basin: SD
Facility ID: 1437
Air District Name: SD
SIC Code: 5541
Air District Name: SAN DIEGO COUNTY APCD
Community Health Air Pollution Info System: Not reported
Consolidated Emission Reporting Rule: Not reported
Total Organic Hydrocarbon Gases Tons/Yr: 0.12
Reactive Organic Gases Tons/Yr: 0.12
Carbon Monoxide Emissions Tons/Yr: Not reported
NOX - Oxides of Nitrogen Tons/Yr: Not reported
SOX - Oxides of Sulphur Tons/Yr: Not reported
Particulate Matter Tons/Yr: Not reported
Part. Matter 10 Micrometers and Smllr Tons/Yr:Not reported

CERS:

Name: DANA LANDING
Address: 2590 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109-7999
Site ID: 463744

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S101669459

CERS ID: 110038066268
CERS Description: US EPA Air Emission Inventory System (EIS)
Affiliation:
Affiliation Type Desc: Local Agency Caseworker
Entity Name: NASSER SIONIT SAN DIEGO CNTY LOP
Entity Title: Not reported
Affiliation Address: POBOX 129261
Affiliation City: SANDIEGO
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

**D104
ESE
< 1/8
0.047 mi.
248 ft.**

**RAD STATION L-6 MIS BCH
SAN DIEGO, CA
Site 1 of 2 in cluster D**

**ENVIROSTOR S107737119
N/A**

**Relative:
Lower**

**Actual:
15 ft.**

ENVIROSTOR:
Name: RAD STATION L-6 MIS BCH
Address: Not reported
City,State,Zip: SAN DIEGO, CA
Facility ID: 80000424
Status: Inactive - Needs Evaluation
Status Date: 07/01/2005
Site Code: Not reported
Site Type: Military Evaluation
Site Type Detailed: FUDS
Acres: Not reported
NPL: NO
Regulatory Agencies: SMBRP
Lead Agency: SMBRP
Program Manager: Not reported
Supervisor: Douglas Bautista
Division Branch: Cleanup Cypress
Assembly: 78
Senate: 39
Special Program: Not reported
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: DERA
Latitude: 32.7625
Longitude: -117.2166
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: NONE SPECIFIED
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: CA99799F557000
Alias Type: Federal Facility ID
Alias Name: J09CA0560
Alias Type: INPR
Alias Name: 80000424
Alias Type: Envirostor ID Number

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RAD STATION L-6 MIS BCH (Continued)

S107737119

Completed Info:

Completed Area Name: Not reported
Completed Sub Area Name: Not reported
Completed Document Type: Not reported
Completed Date: Not reported
Comments: Not reported

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

D105
ESE
< 1/8
0.048 mi.
252 ft.

RADAR STATION L-6 MISSION BECH

FUDS **1024903623**
N/A

SAN DIEGO, CA

Site 2 of 2 in cluster D

Relative:
Lower

FUDS:

Actual:
15 ft.

EPA Region: 9
Installation ID: CA99799F557000
Congressional District Number: 52
Facility Name: RADAR STATION L-6 MISSION BECH
FUDS Number: J09CA0560
City: SAN DIEGO
State: CA
County: SAN DIEGO
Telephone: 213-452-3920
USACE Division: South Pacific Division (SPD)
USACE District: Los Angeles District (SPL)
Status: Properties without projects
Current Owner: Local Government
X Coord: -117.21666667002999
Y Coord: 32.762500000275601
Latitude: 32.762500000000003
Longitude: -117.21666667

E106
WNW
< 1/8
0.078 mi.
414 ft.

DANA LANDING FUEL DOCK

2580 INGRAHAM ST
SAN DIEGO, CA 92109

San Diego Co. HMMD
CERS HAZ WASTE
CERS TANKS
CERS

S106060328
N/A

Site 1 of 2 in cluster E

Relative:
Lower

HMMD SAN DIEGO:

Actual:
10 ft.

Name: DANA LANDING FUEL DOCK
Address: 2580 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 103337
Business Type: 6HK33
EPA Id Number: CAD000219252
APN: 760-029-01-00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Last HMMD Inspection: 04/27/2012
Facility Telephone: 619-226-2929
Permit Status: OPEN
Permit Expiration: 09/30/2013
Date Last Updated: 11/02/2012
Facility Owner: GARY PELZER
Facility Mailing Address: 2580 INGRAHAM ST
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109-7901
UST Owner: WESCO SALES
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 103337
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL
Other Information: UNDERGROUND TANK 103337 T008
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 103337
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL
Other Information: UNDERGROUND TANK 103337 T009
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 103337
Update Date: 11/02/2012
Case Number: 8006-61-9
Name: REGULAR UNLEADED
Other Information: UNDERGROUND TANK 103337 T007
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 103337
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: USED OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103337
Update Date: 11/02/2012
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY ABSORBENT / RAGS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103337
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: USED GASOLINE FILTERS-US FILTER RECOVERY SERVICES
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/07/2003
Violation Code: 6HV3103
Violation: NO UST PLAN CHECK PERMIT OBTAINED
Violation Citation: UST repair/modify/closure permit not obtained .68.1004, 68.1005, 68.1009.5
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/07/2003
Violation Code: 6HV3152
Violation: ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation: All maintenance/monitoring/calibration/ repair records not available. 25293; 2712 (b)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/09/2009
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/09/2009
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/09/2009
Violation Code: 6HV3258
Violation: SENSORS NOT AT LOW POINT OR ADEQUATELY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Violation Citation: Sensors not placed adequately and/or at low point in sumps. 2641(a), 25291(a)(7)(C)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/09/2009
Violation Code: 6HV3258
Violation: SENSORS NOT AT LOW POINT OR ADEQUATELY
Violation Citation: Sensors not placed adequately and/or at low point in sumps. 2641(a), 25291(a)(7)(C)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/09/2009
Violation Code: 6HV3267
Violation: DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation: Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/09/2009
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3107
Violation: MONITORING PROCEDURES NOT AVAIL/TO HMD
Violation Citation: Monitoring procedures not available/complete/submitted to HMD 2632(b)& (d), 2634(d), 2641(h), 2711(a)(9)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3108
Violation: UST ER RESPONSE PLAN NOT COMPLETE/AVAIL
Violation Citation: Emergency Response Plan is not available/complete. 25289(b); 2632(b), 2634(e), 2641(h)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3109
Violation: NO SCALED PLOT PLAN AVAIL/TO HMD
Violation Citation: Scaled Plot plan showing tank, piping & equipment location not available/complete/submitted to HMD. 2711(a)(8), 2632(d)(1) (C)

Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3152
Violation: ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation: All maintenance/monitoring/calibration/ repair records not available. 25293; 2712 (b)

Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3255
Violation: SPILL CONTAIN. NOT DRY/IN GOOD CONDITION
Violation Citation: Spill container is not in good condition and/or liquid free. 2635(b)(1), 2636(a)(1)

Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3405
Violation: LLD DOESN'T DETECT 3.0 GPH OR EQUIVA
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not detect 3.0 gph or equivalent? 2636(f)(2)

Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3405
Violation: LLD DOESN'T DETECT 3.0 GPH OR EQUIVA
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not detect 3.0 gph or equivalent? 2636(f)(2)

Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3405
Violation: LLD DOESN'T DETECT 3.0 GPH OR EQUIVA
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not detect 3.0 gph or equivalent? 2636(f)(2)

Activity: ACTIVE

Permit Number: 103337

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Update Date: 11/02/2012
Inspection Date: 04/27/2012
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or
DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/22/2011
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment
(UDC):Line leak detector is not installed, not functional, or not
tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available.
25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3114
Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA
Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent
to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or
DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment
(UDC):Line leak detector is not installed, not functional, or not
tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Inspection Date: 04/21/2006
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3412
Violation: NO ANNUAL 0.1 GPH TEST
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):OPTION 1: No annual 0.1 gph (gallon per hour) test. 2636(f)(4)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3412
Violation: NO ANNUAL 0.1 GPH TEST
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):OPTION 1: No annual 0.1 gph (gallon per hour) test. 2636(f)(4)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3412
Violation: NO ANNUAL 0.1 GPH TEST
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):OPTION 1: No annual 0.1 gph (gallon per hour) test. 2636(f)(4)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/03/2007
Violation Code: 6HV3152
Violation: ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation: All maintenance/monitoring/calibration/ repair records not available. 25293; 2712 (b)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/02/2010

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Violation Code:	6HV3254
Violation:	UST SYSTEM W/O APPROVED OVERFILL PROTECT
Violation Citation:	UST system does not have an approved overfill protection system. 2635(b)(2)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/02/2010
Violation Code:	6HV3267
Violation:	DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation:	Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/02/2010
Violation Code:	6HV3267
Violation:	DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation:	Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/02/2010
Violation Code:	6HV3267
Violation:	DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation:	Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/02/2010
Violation Code:	6HV3411
Violation:	LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation:	DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/02/2010
Violation Code:	6HV1009
Violation:	HMBP: INADEQUATE SITE MAP
Violation Citation:	Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/02/2008
Violation Code:	6HV3259

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Violation: NO DISPENSER CONTAINMENT (REQUIRED)
Violation Citation: Dispenser containment currently required and not present.
25284.1(a)(5); 2636(g)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/02/2008
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment
(UDC):Line leak detector is not installed, not functional, or not
tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 103337 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: DOUBLE WALL
Additional Id: 0000000001 DIESEL
Capacity Gallons: 5000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1997-09-05 00:00:00
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 20
UST Monitor Method: DW TANK DW PRESSURE PIPE W/ SHUT OFF AND ALARM ON LINE LEAK
DETECTOR: INTERSTITIAL.

UST Name: UNDERGROUND TANK 103337 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: DOUBLE WALL
Additional Id: 2 UNLEADED
Capacity Gallons: 5000
UST Contents: Not reported
Other Content Info: GASOLINE(TYPE UNKNOWN)
Reg Status: REMOVED
Remove Close Date: 1997-09-05 00:00:00
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 20
UST Monitor Method: DW TANK DW PRESSURE PIPE W/ SHUT OFF AND ALARM ON LINE LEAK
DETECTOR: INTERSTITIAL.

UST Name: UNDERGROUND TANK 103337 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: DOUBLE WALL
Additional Id: 1 UNLEADED
Capacity Gallons: 10000
UST Contents: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Other Content Info: GASOLINE(TYPE UNKNOWN)
Reg Status: REMOVED
Remove Close Date: 1997-09-05 00:00:00
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 20
UST Monitor Method: DW TANK DW PRESSURE PIPE W/ SHUT OFF AND ALARM ON LINE LEAK
DETECTOR: INTERSTITIAL.

UST Name: UNDERGROUND TANK 103337 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: SINGLE WALL
Additional Id: 004 DIESEL
Capacity Gallons: 10000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1993-12-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: PRESSURE
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING
ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 103337 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: SINGLE WALL
Additional Id: 005 UNLEADED
Capacity Gallons: 5000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1993-12-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: PRESSURE
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING
ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 103337 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: SINGLE WALL
Additional Id: 006 UNLEADED
Capacity Gallons: 5000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1993-12-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: PRESSURE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 103337 T007
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: DOUBLE WALL
Additional Id: NT1934, RT2989
Capacity Gallons: 5000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1997-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 64
UST Monitor Method: DW TANK W/DRY ANNULAR, DW PRESSURE PIPE; FAILSAFE & POS SHUTOFF, 3.0 LLD; SW ABOVE GROUND PIPE W/VISUAL MONIT; UDC W/MECH FLOAT

UST Name: UNDERGROUND TANK 103337 T008
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: DOUBLE WALL
Additional Id: NT1934, RT2989, RT4898
Capacity Gallons: 5000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1997-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 64
UST Monitor Method: DW TANK W/DRY ANNULAR, DW PRESSURE PIPE; FAILSAFE & POS SHUTOFF, 3.0 LLD; SW ABOVE GROUND PIPE W/VISUAL MONIT; UDC W/MECH FLOAT

UST Name: UNDERGROUND TANK 103337 T009
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: DOUBLE WALL
Additional Id: NT1934, RT2989, RT4898
Capacity Gallons: 10000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1997-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 64
UST Monitor Method: DW TANK W/DRY ANNULAR, DW PRESSURE PIPE; FAILSAFE & POS SHUTOFF, 3.0 LLD; SW ABOVE GROUND PIPE W/VISUAL MONIT; UDC W/MECH FLOAT

Name: DANA LANDING FUEL DOCK

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Address: 2580 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000219252
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 619-226-2929
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 05/02/2018
Facility Owner: Not reported
Facility Mailing Address: 2580 INGRAHAM ST, SAN DIEGO, CA 92109-7901
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: Y
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 6121195
Return To Compliance Date: 2019-04-04T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: 17282
Container/Tank Id: Not reported
Last Update: 2019-05-03T11:06:47.000
Inspection Date: 2019-04-04T14:10:55.000
Violation Code: 2060020 (TCR 9a) Failure to meet one or more of the following requirements: Install or maintain a liquid-tight spill container. Have a minimum capacity of 5 gallons. Have a functional drain valve or other method for the removal of liquid from the spill container. Be resistant to galvanic corrosion. Perform a tightness test at installation, every 12 months thereafter, or within 30 days after a repair to the spill container, tested using applicable manufacturer guidelines, industry codes, engineering standards, or a method approved by a professional engineer. Tested by a certified UST service technician. Maintain records of spill containment testing for 36 months. 23 CCR 2635(b), 2637.1(a-c), 2665(a-b), 2712(b)(1)(F); HSC 25284.2

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Program Element: Underground Storage Tank
Inspection Type: Routine

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Inspection Number: 4087478
Return To Compliance Date: 2013-05-20T00:00:00.000
Nov: Not reported
Violation Classification: Not reported
Underground Storage Tank Id: 04
Container/Tank Id: Not reported
Last Update: 2019-05-03T11:06:47.000
Inspection Date: 2013-04-16T16:52:00.000
Violation Code: 2030026 Failure of line leak detector to detect a leak and/or failure of audible and visual alarm. 23 CCR 16 2636(f)(2), 2666

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 4821247
Return To Compliance Date: 2014-04-11T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 87
Container/Tank Id: Not reported
Last Update: 2019-05-03T11:06:47.000
Inspection Date: 2014-04-10T15:59:00.000
Violation Code: 2030026 Failure of line leak detector to detect a leak and/or failure of audible and visual alarm. 23 CCR 16 2636(f)(2), 2666.

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5165356
Return To Compliance Date: Not reported
Nov: Not reported
Violation Classification: Not reported
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-03T11:06:47.000
Inspection Date: 2015-04-07T10:35:00.000
Violation Code: 2010007 Failure to submit and maintain complete and current Certification of Financial Responsibility or other mechanism of financial assurance. 23 CCR 16 2711; 23 CCR 18 2808.1, 2809-2809.2; HSC 6.7 25292.2; HSC 6.75 25299.30-25299.34

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5646052
Return To Compliance Date: 2017-04-07T00:00:00.000
Nov: No
Violation Classification: Class II

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Underground Storage Tank Id: 17281
Container/Tank Id: Not reported
Last Update: 2019-05-03T11:06:47.000
Inspection Date: 2017-04-07T11:32:14.000
Violation Code: 2030025 (RD) Failure of the pressurized piping to meet one or more of the following requirements: monitored at least hourly with the capability of detecting a release of 3.0 gallons per hour, and will restrict the flow or product through the piping or trigger an alarm when a release occurs. 23 CCR 2636(f)(2)

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5863043
Return To Compliance Date: 2018-04-04T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: 17282
Container/Tank Id: Not reported
Last Update: 2019-05-03T11:06:47.000
Inspection Date: 2018-04-04T11:29:27.000
Violation Code: 2030025 (RD) Failure of the line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements: Monitored at least hourly. with the capability of detecting a release of 3.0 gallons per hour leak at 10 p.s.i.g. and restrict or shut off the flow of product through the piping when a leak is detected. 23 CCR 2636(f)(2)

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 6121195
Return To Compliance Date: Not reported
Nov: Not reported
Violation Classification: Not reported
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-03T11:06:47.000
Inspection Date: 2019-04-04T14:10:55.000
Violation Code: 2010004 (TCR 12) Failure to maintain on-site, or off-site at a readily available location if approved by the CUPA, copies of Designated Operator inspection records as follows: Designated operator monthly inspection records for inspections performed before October 1, 2018 must be kept for 12 months from the month of inspection. For inspections performed on or after October 1, 2018, copies of the "Designated Underground Storage Tank Operator Visual Inspection Report" must be kept for 36 months from the month of inspection. 23 CCR 2716(f)

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Active Permit: Y
Facility Id Number: 37-000-103337
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 6121195
Return To Compliance Date: 2019-04-04T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: 17281
Container/Tank Id: Not reported
Last Update: 2019-05-03T11:06:47.000
Inspection Date: 2019-04-04T14:10:55.000
Violation Code: 2030013 (TCR 12) Failure to comply with one or more of the following designated operator (DO) monthly inspection requirements: For designated operator (DO) monthly inspections conducted before October 1, 2018, failure to comply with one or more of the following requirements: Be performed by an ICC certified DO. Inspect monthly alarm history report, check that alarms are documented and responded to appropriately, and attach a copy. Inspect for the presence of liquid/debris in spill containers. Inspect for the presence of liquid/debris in under dispenser containment (UDC) and ensure that the monitoring equipment is positioned correctly. Inspect for liquid or debris in containment sumps where an alarm occurred with no service visit. Check that all testing and maintenance has been completed and documented. Verify that all facility employees have been trained in accordance with 23 CCR, 2715(c). For designated operator (DO) 30 day inspections conducted on and after October 1, 2018, failure to conduct the designated UST operator visual inspection at least once every 30 days. 23CCR 2716 (a-e)

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 6121195
Return To Compliance Date: 2019-04-04T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: 17281
Container/Tank Id: Not reported
Last Update: 2019-05-03T11:06:47.000
Inspection Date: 2019-04-04T14:10:55.000
Violation Code: 2030036 (TCR 9b) Failure to comply with one or more of the following overfill prevention equipment requirements: 1. Alert the transfer operator when the tank is 90% full by restricting the flow into the tank or triggering an audible and visual alarm; or 2. Restrict delivery of flow to the tank at least 30m before the tank overfills, provided the restriction occurs when the tank is filled to no more than 95% of capacity and activate an audible alarm at least 5m before the tank overfills; or 3. Provide positive shut-off of flow to the tank when the tank is filled to no more than 95% of capacity; or 4. Provide positive shut-off of flow to the tank so that none of the fittings located on the top of the tank are exposed to product due to overfilling. 5. Install/retrofit overfill prevention equipment that does not use flow restrictors on vent piping to meet overfill

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

prevention equipment requirements when the overfill prevention equipment is installed, repaired, or replaced on and after October 1, 2018. 6. For USTs installed before October 1, 2018, perform an inspection by October 13, 2018 and every 36 months thereafter. 7. For USTs installed on and after October 1, 2018, perform an inspection at installation and every 36 months thereafter. 8. Inspected within 30 days after a repair to the overfill prevention equipment. 9. Inspected using an applicable manufacturer guidelines, industry codes, engineering standards, or a method approved by a professional engineer. 10. Inspected by a certified UST service technician. 11. Maintain records of overfill prevention equipment inspection for 36 months. 23 CCR 2635(c)(1), 2635(d), 2637.2(a-c), 2665, 2712(b)(1)(G)

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 6121195
Return To Compliance Date: 2019-04-04T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-03T11:06:47.000
Inspection Date: 2019-04-04T14:10:55.000
Violation Code: HMD0138 Manifest signed by the TSDF not available for inspection. 22 CCR 66262.40(a); HSC 25185(a)(4)

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5646052
Return To Compliance Date: 2017-04-07T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-03T11:06:47.000
Inspection Date: 2017-04-07T11:32:14.000
Violation Code: 1010008 HMBP not certified annually as complete and accurate in CERS. HSC 25508.2

UST DTL:

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Facility Type (Ust Facility): Other
Tank Owner Name: STEVEN PINARD
Tankid: 17281
Tank Status: Active
Date Ust Permanently Closed: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Tank Use: Marina Fueling
Piping System Type: Pressure
Last Updated: 2018-08-14T02:30:29.000
Tank Capacityin Gallons: 5000
Tank Contents: Regular Unleaded
Type Of Tank: Double Wall

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Facility Type (Ust Facility): Other
Tank Owner Name: STEVEN PINARD
Tankid: 17283
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Marina Fueling
Piping System Type: Pressure
Last Updated: 2018-08-14T02:30:29.000
Tank Capacityin Gallons: 10000
Tank Contents: Diesel
Type Of Tank: Double Wall

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-103337
Facility Type (Ust Facility): Other
Tank Owner Name: STEVEN PINARD
Tankid: 17282
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Marina Fueling
Piping System Type: Pressure
Last Updated: 2018-08-14T02:30:29.000
Tank Capacityin Gallons: 5000
Tank Contents: Diesel
Type Of Tank: Double Wall

Waste and Materials:

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0181308
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-08-14T02:30:29.000
Chemical Name: DIESEL FUEL
Common Name: UNDERGROUND TANK 103337 T008
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0181310
Trade Secret: N
Hazardous Material Type: Pure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Last Updated:	2018-08-14T02:30:29.000
Chemical Name:	DIESEL FUEL
Common Name:	UNDERGROUND TANK 103337 T009
Case Number:	68476-34-6
Record ID:	DEH2002-HUPFP-103337
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0155778
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-08-14T02:30:29.000
Chemical Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Common Name:	OILY ABSORBENT / RAGS
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-103337
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0137748
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-08-23T02:33:21.000
Chemical Name:	DIESEL FUEL
Common Name:	UNDERGROUND TANK 103337 T008
Case Number:	68476-34-6
Record ID:	DEH2002-HUPFP-103337
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0137749
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-08-23T02:33:21.000
Chemical Name:	REGULAR UNLEADED
Common Name:	UNDERGROUND TANK 103337 T007
Case Number:	8006-61-9
Record ID:	DEH2002-HUPFP-103337
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HCHEM-0137750
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2017-08-23T02:33:21.000
Chemical Name:	DIESEL FUEL
Common Name:	UNDERGROUND TANK 103337 T009
Case Number:	68476-34-6
Record ID:	DEH2002-HUPFP-103337
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2017-HWAST-0116217
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-08-23T02:33:21.000
Chemical Name:	WASTE 352 ORGANIC SOLIDS (OTHER)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Common Name: USED GASOLINE FILTERS-US FILTER RECOVERY SERVICES
Case Number: Not reported

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0116218
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-08-23T02:33:21.000
Chemical Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Common Name: OILY ABSORBENT / RAGS
Case Number: Not reported

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0116219
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-08-23T02:33:21.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: USED OIL / DIESEL & WATER WASTE
Case Number: Not reported

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0116220
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2017-08-23T02:33:21.000
Chemical Name: Gasoline
Common Name: Gasoline
Case Number: Not reported

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0181309
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-08-14T02:30:29.000
Chemical Name: REGULAR UNLEADED
Common Name: UNDERGROUND TANK 103337 T007
Case Number: 8006-61-9

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0155777
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-08-14T02:30:29.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: USED GASOLINE FILTERS-US FILTER RECOVERY SERVICES
Case Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0155779
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-08-14T02:30:29.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: USED OIL / DIESEL & WATER WASTE
Case Number: Not reported

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0155780
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-08-14T02:30:29.000
Chemical Name: Gasoline
Common Name: Gasoline
Case Number: Not reported

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2015-HCHEM-0068034
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-19T02:32:42.000
Chemical Name: DIESEL FUEL
Common Name: UNDERGROUND TANK 103337 T008
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2015-HCHEM-0068035
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-19T02:32:42.000
Chemical Name: REGULAR UNLEADED
Common Name: UNDERGROUND TANK 103337 T007
Case Number: 8006-61-9

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2015-HCHEM-0068036
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2016-08-19T02:32:42.000
Chemical Name: DIESEL FUEL
Common Name: UNDERGROUND TANK 103337 T009
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Active Permit: Y
Child Record Id: DEH2015-HWAST-0052443
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-19T02:32:42.000
Chemical Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Common Name: USED GASOLINE FILTERS-US FILTER RECOVERY SERVICES
Case Number: Not reported

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2015-HWAST-0052444
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-19T02:32:42.000
Chemical Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Common Name: OILY ABSORBENT / RAGS
Case Number: Not reported

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2015-HWAST-0052445
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-19T02:32:42.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: USED OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-103337
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2015-HWAST-0052446
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2016-08-19T02:32:42.000
Chemical Name: Gasoline
Common Name: Gasoline
Case Number: Not reported

Name: DANA LANDING FUEL DOCK
Address: 2580 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 103337
Business Type: 6HK33
EPA Id Number: CAD000219252
APN: 760-029-01-00
Last HMMD Inspection: 04/27/2012
Facility Telephone: 619-226-2929
Permit Status: OPEN
Permit Expiration: 09/30/2013
Date Last Updated: 11/02/2012
Facility Owner: GARY PELZER
Facility Mailing Address: 2580 INGRAHAM ST

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109-7901
UST Owner: WESCO SALES
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 103337
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL
Other Information: UNDERGROUND TANK 103337 T008
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 103337
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL FUEL
Other Information: UNDERGROUND TANK 103337 T009
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 103337
Update Date: 11/02/2012
Case Number: 8006-61-9
Name: REGULAR UNLEADED
Other Information: UNDERGROUND TANK 103337 T007
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 103337
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: USED OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103337
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY ABSORBENT / RAGS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 103337

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 352 ORGANIC SOLIDS (OTHER)
Other Information: USED GASOLINE FILTERS-US FILTER RECOVERY SERVICES
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/07/2003
Violation Code: 6HV3103
Violation: NO UST PLAN CHECK PERMIT OBTAINED
Violation Citation: UST repair/modify/closure permit not obtained .68.1004, 68.1005, 68.1009.5
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/07/2003
Violation Code: 6HV3152
Violation: ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation: All maintenance/monitoring/calibration/ repair records not available. 25293; 2712 (b)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/09/2009
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/09/2009
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/09/2009
Violation Code: 6HV3258
Violation: SENSORS NOT AT LOW POINT OR ADEQUATELY
Violation Citation: Sensors not placed adequately and/or at low point in sumps. 2641(a), 25291(a)(7)(C)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/09/2009

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Violation Code: 6HV3258
Violation: SENSORS NOT AT LOW POINT OR ADEQUATELY
Violation Citation: Sensors not placed adequately and/or at low point in sumps. 2641(a), 25291(a)(7)(C)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/09/2009
Violation Code: 6HV3267
Violation: DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation: Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/09/2009
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3107
Violation: MONITORING PROCEDURES NOT AVAIL/TO HMD
Violation Citation: Monitoring procedures not available/complete/submitted to HMD 2632(b)& (d), 2634(d), 2641(h), 2711(a)(9)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3108
Violation: UST ER RESPONSE PLAN NOT COMPLETE/AVAIL
Violation Citation: Emergency Response Plan is not available/complete. 25289(b); 2632(b), 2634(e), 2641(h)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 02/10/2004
Violation Code: 6HV3109
Violation: NO SCALED PLOT PLAN AVAIL/TO HMD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Violation Citation:	Scaled Plot plan showing tank, piping & equipment location not available/complete/submitted to HMD. 2711(a)(8), 2632(d)(1) (C)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	02/10/2004
Violation Code:	6HV3152
Violation:	ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation:	All maintenance/monitoring/calibration/ repair records not available. 25293; 2712 (b)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	02/10/2004
Violation Code:	6HV3255
Violation:	SPILL CONTAIN. NOT DRY/IN GOOD CONDITION
Violation Citation:	Spill container is not in good condition and/or liquid free. 2635(b)(1), 2636(a)(1)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	02/10/2004
Violation Code:	6HV3405
Violation:	LLD DOESN'T DETECT 3.0 GPH OR EQUIVA
Violation Citation:	DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not detect 3.0 gph or equivalent? 2636(f)(2)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	02/10/2004
Violation Code:	6HV3405
Violation:	LLD DOESN'T DETECT 3.0 GPH OR EQUIVA
Violation Citation:	DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not detect 3.0 gph or equivalent? 2636(f)(2)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	02/10/2004
Violation Code:	6HV3405
Violation:	LLD DOESN'T DETECT 3.0 GPH OR EQUIVA
Violation Citation:	DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not detect 3.0 gph or equivalent? 2636(f)(2)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/27/2012
Violation Code:	6HV3192
Violation:	NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation:	Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity:	ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/22/2011
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3114
Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA
Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/21/2006
Violation Code:	6HV3411
Violation:	LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation:	DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/21/2006
Violation Code:	6HV3412
Violation:	NO ANNUAL 0.1 GPH TEST
Violation Citation:	DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):OPTION 1: No annual 0.1 gph (gallon per hour) test. 2636(f)(4)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/21/2006
Violation Code:	6HV3412
Violation:	NO ANNUAL 0.1 GPH TEST
Violation Citation:	DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):OPTION 1: No annual 0.1 gph (gallon per hour) test. 2636(f)(4)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/21/2006
Violation Code:	6HV3412
Violation:	NO ANNUAL 0.1 GPH TEST
Violation Citation:	DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):OPTION 1: No annual 0.1 gph (gallon per hour) test. 2636(f)(4)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/03/2007
Violation Code:	6HV3152
Violation:	ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation:	All maintenance/monitoring/calibration/ repair records not available. 25293; 2712 (b)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012
Inspection Date:	04/02/2010
Violation Code:	6HV3254
Violation:	UST SYSTEM W/O APPROVED OVERFILL PROTECT
Violation Citation:	UST system does not have an approved overfill protection system. 2635(b)(2)
Activity:	ACTIVE
Permit Number:	103337
Update Date:	11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Inspection Date: 04/02/2010
Violation Code: 6HV3267
Violation: DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation: Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/02/2010
Violation Code: 6HV3267
Violation: DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation: Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/02/2010
Violation Code: 6HV3267
Violation: DISP. CONTAINMENT NOT ADEQ. MONITORED
Violation Citation: Dispenser containment not adequately monitored. 2636(f)(1) or (f)(5)(A)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/02/2010
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/02/2010
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/02/2008
Violation Code: 6HV3259
Violation: NO DISPENSER CONTAINMENT (REQUIRED)
Violation Citation: Dispenser containment currently required and not present. 25284.1(a)(5); 2636(g)
Activity: ACTIVE

Permit Number: 103337
Update Date: 11/02/2012
Inspection Date: 04/02/2008

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 103337 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: DOUBLE WALL
Additional Id: 0000000001 DIESEL
Capacity Gallons: 5000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1997-09-05 00:00:00
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 20
UST Monitor Method: DW TANK DW PRESSURE PIPE W/ SHUT OFF AND ALARM ON LINE LEAK DETECTOR: INTERSTITIAL.

UST Name: UNDERGROUND TANK 103337 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: DOUBLE WALL
Additional Id: 2 UNLEADED
Capacity Gallons: 5000
UST Contents: Not reported
Other Content Info: GASOLINE(TYPE UNKNOWN)
Reg Status: REMOVED
Remove Close Date: 1997-09-05 00:00:00
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 20
UST Monitor Method: DW TANK DW PRESSURE PIPE W/ SHUT OFF AND ALARM ON LINE LEAK DETECTOR: INTERSTITIAL.

UST Name: UNDERGROUND TANK 103337 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: DOUBLE WALL
Additional Id: 1 UNLEADED
Capacity Gallons: 10000
UST Contents: Not reported
Other Content Info: GASOLINE(TYPE UNKNOWN)
Reg Status: REMOVED
Remove Close Date: 1997-09-05 00:00:00
Year Installed: Not reported
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 20
UST Monitor Method: DW TANK DW PRESSURE PIPE W/ SHUT OFF AND ALARM ON LINE LEAK

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

DETECTOR: INTERSTITIAL.

UST Name: UNDERGROUND TANK 103337 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: SINGLE WALL
Additional Id: 004 DIESEL
Capacity Gallons: 10000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1993-12-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: PRESSURE
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 103337 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: SINGLE WALL
Additional Id: 005 UNLEADED
Capacity Gallons: 5000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1993-12-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: PRESSURE
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 103337 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: SINGLE WALL
Additional Id: 006 UNLEADED
Capacity Gallons: 5000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1993-12-17 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: PRESSURE
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 103337 T007
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: DOUBLE WALL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Additional Id: NT1934, RT2989
Capacity Gallons: 5000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1997-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 64
UST Monitor Method: DW TANK W/DRY ANNULAR, DW PRESSURE PIPE; FAILSAFE & POS SHUTOFF, 3.0 LLD; SW ABOVE GROUND PIPE W/VISUAL MONIT; UDC W/MECH FLOAT

UST Name: UNDERGROUND TANK 103337 T008
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: DOUBLE WALL
Additional Id: NT1934, RT2989, RT4898
Capacity Gallons: 5000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1997-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 64
UST Monitor Method: DW TANK W/DRY ANNULAR, DW PRESSURE PIPE; FAILSAFE & POS SHUTOFF, 3.0 LLD; SW ABOVE GROUND PIPE W/VISUAL MONIT; UDC W/MECH FLOAT

UST Name: UNDERGROUND TANK 103337 T009
Last Update: 2012-11-02 14:17:38
Permit Number: 103337
Tank Type: DOUBLE WALL
Additional Id: NT1934, RT2989, RT4898
Capacity Gallons: 10000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1997-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 64
UST Monitor Method: DW TANK W/DRY ANNULAR, DW PRESSURE PIPE; FAILSAFE & POS SHUTOFF, 3.0 LLD; SW ABOVE GROUND PIPE W/VISUAL MONIT; UDC W/MECH FLOAT

CERS HAZ WASTE:

Name: DANA LANDING FUEL DOCK
Address: 2580 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 110158
CERS ID: 10383373
CERS Description: Hazardous Waste Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

CERS TANKS:

Name: DANA LANDING FUEL DOCK
Address: 2580 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 110158
CERS ID: 10383373
CERS Description: Underground Storage Tank

CERS:

Name: DANA LANDING FUEL DOCK
Address: 2580 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 110158
CERS ID: 10383373
CERS Description: Chemical Storage Facilities

Violations:

Site ID: 110158
Site Name: DANA LANDING FUEL DOCK
Violation Date: 04-04-2019
Citation: HSC 6.7 25284.2 - California Health and Safety Code, Chapter 6.7, Section(s) 25284.2

Violation Description: "Failure to meet one or more of the following requirements: Install or maintain a liquid-tight spill container. Have a minimum capacity of five gallons. Have a functional drain valve or other method for the removal of liquid from the spill container. Be resistant to galvanic corrosion. Perform a tightness test at installation, every 12 months thereafter, or within 30 days after a repair to the spill container. Tested using applicable manufacturer guidelines, industry codes, engineering standards, or a method approved by a professional engineer. Tested by a certified UST service technician. Maintain records of spill containment testing for 36 months. "

Violation Notes: Returned to compliance on 04/04/2019. Inspection Sequence ID:6121195;Tank ID:17282,17283;Violation Description:(TCR 9a) Failure to meet one or more of the following requirements: Install or maintain a liquid-tight spill container. Have a minimum capacity of 5 gallons. Have a functional drain valve or other method for the removal of liquid from the spill container. Be resistant to galvanic corrosion. Perform a tightness test at installation, every 12 months thereafter, or within 30 days after a repair to the spill container, tested using applicable manufacturer guidelines, industry codes, engineering standards, or a method approved by a professional engineer. Tested by a certified UST service technician. Maintain records of spill containment testing for 36 months. 23 CCR 2635(b), 2637.1(a-c), 2665(a-b), 2712(b)(1)(F); HSC 25284.2

Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 110158
Site Name: DANA LANDING FUEL DOCK
Violation Date: 04-04-2019
Citation: HSC 6.5 Multiple - California Health and Safety Code, Chapter 6.5, Section(s) Multiple
Violation Description: Hazardous Waste Generator Program - Administration/Documentation - General

Violation Notes: Returned to compliance on 04/04/2019. Inspection Sequence

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Violation Division: ID:6121195; Violation:HMD0138 Manifest signed by the TSDF not available for inspection. 22 CCR 66262.40(a); HSC 25185(a)(4)
Violation Program: San Diego County Department of Env Health
Violation Source: HW
CERS

Site ID: 110158
Site Name: DANA LANDING FUEL DOCK
Violation Date: 04-07-2017
Citation: 23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2636(f)(2)
Violation Description: Failure of the line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements: Monitor at least hourly. Be capable of detecting a release of 3.0 gallons per hour at 10 p.s.i.g. Restrict or shut off the flow of product through the piping when a leak is detected.
Violation Notes: Returned to compliance on 04/07/2017.
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 110158
Site Name: DANA LANDING FUEL DOCK
Violation Date: 04-04-2019
Citation: 23 CCR 16 2716(a) through (e) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2716(a) through (e)
Violation Description: For designated operator (DO) monthly inspections conducted before October 1, 2018, failure to comply with one or more of the following requirements: Be performed by an ICC certified DO. Inspect monthly alarm history report, check that alarms are documented and responded to appropriately, and attach a copy. Inspect for the presence of liquid/debris in spill containers. Inspect for the presence of liquid/debris in under dispenser containment (UDC) and ensure that the monitoring equipment is positioned correctly. Inspect for liquid or debris in containment sumps where an alarm occurred with no service visit. Check that all testing and maintenance has been completed and documented. Verify that all facility employees have been trained in accordance with 23 CCR 2715(c). For designated operator (DO) 30 day inspections conducted on and after October 1, 2018, failure to conduct the designated UST operator visual inspection at least once every 30 days.
Violation Notes: Returned to compliance on 04/04/2019. Inspection Sequence ID:6121195; Tank ID:17281,17282,17283; Violation Description:(TCR 12) Failure to comply with one or more of the following designated operator (DO) monthly inspection requirements: For designated operator (DO) monthly inspections conducted before October 1, 2018, failure to comply with one or more of the following requirements: Be performed by an ICC certified DO. Inspect monthly alarm history report, check that alarms are documented and responded to appropriately, and attach a copy. Inspect for the presence of liquid/debris in spill containers. Inspect for the presence of liquid/debris in under dispenser containment (UDC) and ensure that the monitoring equipment is positioned correctly. Inspect for liquid or debris in containment sumps where an alarm occurred with no service visit. Check that all testing and maintenance has been completed and documented. Verify that all facility employees have been trained in accordance with 23 CCR, 2715(c). For designated operator (D

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 110158
Site Name: DANA LANDING FUEL DOCK
Violation Date: 04-04-2018
Citation: 23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2636(f)(2)

Violation Description: Failure of the functional line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements: Monitored at least hourly with the capability of detecting a release of 3.0 gallons per hour leak at 10 p.s.i.g. and restrict or shut off the flow of product through the piping when a leak is detected.

Violation Notes: Returned to compliance on 04/04/2018.
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 110158
Site Name: DANA LANDING FUEL DOCK
Violation Date: 04-10-2014
Citation: 23 CCR 16 2666(c) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2666(c)

Violation Description: Failure of line leak detector to detect a leak and/or failure of audible and visual alarm.

Violation Notes: Returned to compliance on 04/11/2014.
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 110158
Site Name: DANA LANDING FUEL DOCK
Violation Date: 04-04-2019
Citation: 23 CCR 16 2716(f) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2716(f)

Violation Description: "Failure to maintain on-site, or off-site at a readily available location if approved by the UPA, copies of Designated Operator inspection records as follows: Designated operator monthly inspection records for inspections performed before October 1, 2018 must be kept for 12 months from the month of inspection. For inspections performed on or after October 1, 2018, copies of the ""Designated Underground Storage Tank Operator Visual Inspection Report"" must be kept for 36 months from the month of inspection. "

Violation Notes: Returned to compliance on 04/04/2019. Inspection Sequence ID:6121195;Tank ID:17281,17282,17283;Violation Description:(TCR 12) Failure to maintain on-site, or off-site at a readily available location if approved by the CUPA, copies of Designated Operator inspection records as follows: Designated operator monthly inspection records for inspections performed before October 1, 2018 must be kept for 12 months from the month of inspection. For inspections performed on or after October 1, 2018, copies of the "Designated Underground Storage Tank Operator Visual Inspection Report" must be kept for 36 months from the month of inspection. 23 CCR 2716(f)

Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Site ID: 110158
Site Name: DANA LANDING FUEL DOCK
Violation Date: 04-04-2019
Citation: 23 CCR 16 2712(b)(1)(G) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2712(b)(1)(G)
Violation Description: Failure to comply with one or more of the following overfill prevention equipment requirements: Alert the transfer operator when the tank is 90 percent full by restricting the flow into the tank or triggering an audible and visual alarm; or Restrict delivery of flow to the tank at least 30 minutes before the tank overfills, provided the restriction occurs when the tank is filled to no more than 95 percent of capacity; and activate an audible alarm at least five minutes before the tank overfills; or Provide positive shut-off of flow to the tank when the tank is filled to no more than 95 percent of capacity; or Provide positive shut-off of flow to the tank so that none of the fittings located on the top of the tank are exposed to product due to overfilling. Install/retrofit overfill prevention equipment that does not use flow restrictors on vent piping to meet overfill prevention equipment requirements when the overfill prevention equipment is installed, repaired, or replaced on and after October 1, 2018. For USTs installed before October 1, 2018, perform an inspection by October 13, 2018 and every 36 months thereafter. For USTs installed on and after October 1, 2018, perform an inspection at installation and every 36 months thereafter. Inspected within 30 days after a repair to the overfill prevention equipment. Inspected using an applicable manufacturer guidelines, industry codes, engineering standards, or a method approved by a professional engineer. Inspected by a certified UST service technician. Maintain records of overfill prevention equipment inspection for 36 months.
Violation Notes: Returned to compliance on 04/04/2019. Inspection Sequence ID:6121195;Tank ID:17281,17282,17283;Violation Description:(TCR 9b) Failure to comply with one or more of the following overfill prevention equipment requirements: 1. Alert the transfer operator when the tank is 90% full by restricting the flow into the tank or triggering an audible and visual alarm; or 2. Restrict delivery of flow to the tank at least 30m before the tank overfills, provided the restriction occurs when the tank is filled to no more than 95% of capacity and activate an audible alarm at least 5m before the tank overfills; or 3. Provide positive shut-off of flow to the tank when the tank is filled to no more than 95% of capacity; or 4. Provide positive shut-off of flow to the tank so that none of the fittings located on the top of the tank are exposed to product due to overfilling. 5. Install/retrofit overfill prevention equipment that does not use flow restrictors on vent piping to meet overfill prevention equipment requirements when the overfill prev
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS
Site ID: 110158
Site Name: DANA LANDING FUEL DOCK
Violation Date: 04-07-2017
Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2
Violation Description: Failure to annually review and electronically certify that the business plan is complete and accurate on or before the annual due date.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Violation Notes: Returned to compliance on 04/07/2017.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 110158
Site Name: DANA LANDING FUEL DOCK
Violation Date: 04-07-2015
Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code, Chapter 6.75, Section(s) 25299.30-25299.34
Violation Description: Failure to submit and maintain complete and current Certification of Financial Responsibility or other mechanism of financial assurance.

Violation Notes: Returned to compliance on 04/24/2015.
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-04-2018
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5863043
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-04-2018
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5863043
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-04-2018
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5863043
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-04-2019
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: LaPel Daniel Inspection ID:6121195
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-04-2019
Violations Found: Yes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Eval Type:	Routine done by local agency
Eval Notes:	Inspector: LaPel Daniel Inspection ID:6121195
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-04-2019
Violations Found:	Yes
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: LaPel Daniel Inspection ID:6121195
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-07-2015
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5165356
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-07-2015
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5165356
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-07-2015
Violations Found:	Yes
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5165356
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-07-2016
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5395691
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-07-2016
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5395691
Eval Division:	San Diego County Department of Env Health

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Eval Program:	HW
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-07-2016
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5395691
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-07-2017
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5646052
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-07-2017
Violations Found:	Yes
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5646052
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-07-2017
Violations Found:	Yes
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5646052
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-10-2014
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:4821247
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-10-2014
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:4821247
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-10-2014
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4821247
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Coordinates:

Site ID: 110158
Facility Name: DANA LANDING FUEL DOCK
Env Int Type Code: HWG
Program ID: 10383373
Coord Name: Not reported
Ref Point Type Desc: Center of a facility or station.
Latitude: 32.768270
Longitude: -117.235010

Affiliation:

Affiliation Type Desc: CUPA District
Entity Name: San Diego County Env Health
Entity Title: Not reported
Affiliation Address: PO Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92112-9261
Affiliation Phone: (858) 505-6880

Affiliation Type Desc: Document Preparer
Entity Name: STEVE PINARD
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Environmental Contact
Entity Name: JEFF HUGHES
Entity Title: Not reported
Affiliation Address: 2580 INGRAHAM ST
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92109
Affiliation Phone: Not reported

Affiliation Type Desc: Operator
Entity Name: STEVEN PINARD
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 246-6346

Affiliation Type Desc: Parent Corporation
Entity Name: DANA LANDING FUEL DOCK
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: UST Tank Operator
Entity Name: STEVE PINARD
Entity Title: Not reported
Affiliation Address: 2580 INGRAHAM ST
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92109
Affiliation Phone: (619) 226-2929

Affiliation Type Desc: UST Tank Owner
Entity Name: GARY PELZER
Entity Title: Not reported
Affiliation Address: 2580 INGRAHAM ST
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92109
Affiliation Phone: (619) 226-2929

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 2580 INGRAHAM ST
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92109-7901
Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer
Entity Name: Steve Pinard
Entity Title: MANAGER
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Property Owner
Entity Name: WESCO SALES CORP DBA DANA LAND
Entity Title: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DANA LANDING FUEL DOCK (Continued)

S106060328

Affiliation Address: 2630 INGRAHAM ST
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92109
Affiliation Phone: (619) 224-2513

Affiliation Type Desc: UST Permit Applicant
Entity Name: JEFFREY HUGHES
Entity Title: MANAGER
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 226-2929

Affiliation Type Desc: UST Property Owner Name
Entity Name: WESCO SALES CORP DBA DANA LAND
Entity Title: Not reported
Affiliation Address: 2590 INGRAHAM ST
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92109
Affiliation Phone: (619) 226-2929

Affiliation Type Desc: Legal Owner
Entity Name: DANA LANDING MARKET AND FUEL DOCK
Entity Title: Not reported
Affiliation Address: 2580 INGRAHAM ST
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92109
Affiliation Phone: (619) 226-2929

E107
WNW
< 1/8
0.078 mi.
414 ft.

DANA LANDING FUEL DOCK
2580 INGRAHAM ST
SAN DIEGO, CA 92109
Site 2 of 2 in cluster E

UST **U004261898**
N/A

Relative: UST:
Lower Name: DANA LANDING FUEL DOCK
Address: 2580 INGRAHAM ST
City,State,Zip: SAN DIEGO, CA 92109
Facility ID: 37-000-103337
Permitting Agency: San Diego County Department of Environmental Health
Latitude: 32.76827
Longitude: -117.23501

Actual:
10 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

108
West
< 1/8
0.086 mi.
455 ft.

2500 BLK OF INGRAHAM ST
DANA LANDING BOAT RAMP
SAN DIEGO, CA

Notify 65

S100178336
N/A

Relative:
Lower

NOTIFY 65:

Actual:
10 ft.

Date Reported: Not reported
Staff Initials: Not reported
Board File Number: Not reported
Facility Type: Not reported
Discharge Date: Not reported
Issue Date: Not reported
Incident Description: Not reported

109
ESE
< 1/8
0.098 mi.
515 ft.

MISSION BAY LDFL
BET SN DIEGO RIV & MISSION BAY
SAN DIEGO, CA 92100

SEMS-ARCHIVE

1012043099
CAD980881353

Relative:
Lower

SEMS Archive:

Actual:
12 ft.

Site ID: 0902103
EPA ID: CAD980881353
Cong District: 42
FIPS Code: 06073
FF: N
NPL: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

SEMS Archive Detail:

Region: 09
Site ID: 0902103
EPA ID: CAD980881353
Site Name: MISSION BAY LDFL
NPL: N
FF: N
OU: 00
Action Code: VS
Action Name: ARCH SITE
SEQ: 2
Start Date: Not reported
Finish Date: 2008-01-03 05:00:00
Qual: Not reported
Current Action Lead: EPA Perf In-Hse

Region: 09
Site ID: 0902103
EPA ID: CAD980881353
Site Name: MISSION BAY LDFL
NPL: N
FF: N
OU: 00
Action Code: VU
Action Name: UNARCHIVE
SEQ: 1
Start Date: Not reported
Finish Date: 2003-09-04 04:00:00
Qual: Not reported
Current Action Lead: EPA Perf In-Hse

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LDFL (Continued)

1012043099

Region: 09
Site ID: 0902103
EPA ID: CAD980881353
Site Name: MISSION BAY LDFL
NPL: N
FF: N
OU: 00
Action Code: VS
Action Name: ARCH SITE
SEQ: 1
Start Date: Not reported
Finish Date: 1993-08-27 04:00:00
Qual: Not reported
Current Action Lead: EPA Perf In-Hse

Region: 09
Site ID: 0902103
EPA ID: CAD980881353
Site Name: MISSION BAY LDFL
NPL: N
FF: N
OU: 00
Action Code: SI
Action Name: SI
SEQ: 1
Start Date: Not reported
Finish Date: 1984-02-01 05:00:00
Qual: L
Current Action Lead: EPA Perf

Region: 09
Site ID: 0902103
EPA ID: CAD980881353
Site Name: MISSION BAY LDFL
NPL: N
FF: N
OU: 00
Action Code: SI
Action Name: SI
SEQ: 2
Start Date: Not reported
Finish Date: 1989-12-13 05:00:00
Qual: N
Current Action Lead: EPA Perf

Region: 09
Site ID: 0902103
EPA ID: CAD980881353
Site Name: MISSION BAY LDFL
NPL: N
FF: N
OU: 00
Action Code: DS
Action Name: DISCVRY
SEQ: 1
Start Date: 1984-02-01 05:00:00
Finish Date: 1984-02-01 05:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LDFL (Continued)

1012043099

Qual: Not reported
Current Action Lead: EPA Perf

Region: 09
Site ID: 0902103
EPA ID: CAD980881353
Site Name: MISSION BAY LDFL
NPL: N
FF: N
OU: 00
Action Code: HR
Action Name: HAZRANK
SEQ: 1
Start Date: Not reported
Finish Date: 1984-02-01 05:00:00
Qual: Not reported
Current Action Lead: EPA Perf

Region: 09
Site ID: 0902103
EPA ID: CAD980881353
Site Name: MISSION BAY LDFL
NPL: N
FF: N
OU: 00
Action Code: PA
Action Name: PA
SEQ: 1
Start Date: Not reported
Finish Date: 1984-02-01 05:00:00
Qual: L
Current Action Lead: EPA Perf

110
ESE
< 1/8
0.104 mi.
549 ft.

MISSION BAY LANDFILL #1
SEA WORLD DRIVE
SAN DIEGO, CA 92101

SWF/LF
CERS S102362149
N/A

Relative:
Lower
Actual:
18 ft.

SWF/LF (SWIS):
Name: MISSION BAY LANDFILL #1
Address: SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA
Facility ID: 37-AA-0026
Lat/Long: 32.76333 / -117.21667
Owner Name: City Of San Diego
Owner Telephone: 6196947000
Owner Address: Environmental Services Department
Owner Address2: 9601 Ridgehaven Ct, Suite 310, MS 1102-A
Owner City,St,Zip: San Diego, CA 92123-1636
Operational Status: Closed
Operator: Not reported
Operator Phone: Not reported
Operator Address: Not reported
Operator Address2: Not reported
Operator City,St,Zip: Not reported
Permit Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY LANDFILL #1 (Continued)

S102362149

Permit Status: Not reported
Permitted Acreage: \$0.00
Activity: Solid Waste Disposal Site
Regulation Status: Unpermitted
Landuse Name: Not reported
GIS Source: Map
Category: Disposal
Unit Number: 01
Inspection Frequency: Quarterly
Accepted Waste: Not reported
Closure Date: 01/01/1988
Closure Type: Actual
Disposal Acreage: \$0.00
SWIS Num: 37-AA-0026
Waste Discharge Requirement Num: Not reported
Program Type: Not reported
Permitted Throughput with Units: Not reported
Actual Throughput with Units: Not reported
Permitted Capacity with Units: Not reported
Remaining Capacity: Not reported
Remaining Capacity with Units: Not reported
Lat/Long: 32.76333 / -117.21667

CERS:

Name: MISSION BAY LANDFILL #1
Address: SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA 92101
Site ID: 480949
CERS ID: 110013990725
CERS Description: US EPA Air Emission Inventory System (EIS)

Name: MISSION BAY LANDFILL #1
Address: SEA WORLD DRIVE
City,State,Zip: SAN DIEGO, CA
Site ID: 510217
CERS ID: 37-AA-0026
CERS Description: Solid Waste and Recycle Sites

Affiliation:

Affiliation Type Desc: Legal Owner
Entity Name: City of San Diego
Entity Title: Not reported
Affiliation Address: Environmental Services Department 9601 Ridgehaven Ct, Suite 310, MS
1102-A
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92123-1636
Affiliation Phone: 8584925010

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

F111
West
1/8-1/4
0.159 mi.
842 ft.
SEAFOORTH SPORTFISHING
1717 QUIVIRA CT
SAN DIEGO, CA 92109
Site 1 of 4 in cluster F

LUST
CERS HAZ WASTE
SWEEPS UST
CERS TANKS
SAN DIEGO CO LOP
CERS
S106931998
N/A

Relative:
Lower

Actual:
12 ft.

LUST:

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 921097811
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607302777
Global Id: T0607302777
Latitude: 32.7631231804087
Longitude: -117.235390142072
Status: Completed - Case Closed
Status Date: 10/16/1992
Case Worker: Not reported
RB Case Number: 9UT476
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H21141-001
Potential Media Affect: Soil
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:

Global Id: T0607302777
Action Type: Other
Date: 02/17/1987
Action: Leak Began

Global Id: T0607302777
Action Type: Other
Date: 02/17/1987
Action: Leak Discovery

Global Id: T0607302777
Action Type: Other
Date: 02/20/1987
Action: Leak Stopped

Global Id: T0607302777
Action Type: ENFORCEMENT
Date: 02/17/1987
Action: Notice of Responsibility

Global Id: T0607302777
Action Type: Other
Date: 02/20/1987
Action: Leak Reported

Global Id: T0607302777
Action Type: ENFORCEMENT
Date: 10/09/1992
Action: Closure/No Further Action Letter

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

LUST:

Global Id: T0607302777
Status: Open - Case Begin Date
Status Date: 02/17/1987

Global Id: T0607302777
Status: Completed - Case Closed
Status Date: 10/16/1992

CERS HAZ WASTE:

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 921097811
Site ID: 66346
CERS ID: 10383319
CERS Description: Hazardous Waste Generator

SWEEPS UST:

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA CT
City: SAN DIEGO
Status: Active
Comp Number: 21141
Number: 9
Board Of Equalization: 44-023449
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021141-000002
Tank Status: A
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: 1

CERS TANKS:

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 921097811
Site ID: 66346
CERS ID: 10383319
CERS Description: Underground Storage Tank

SAN DIEGO CO LOP:

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
Record ID: DEH1987-LSAM-H21141-001
Record Status: Completed
Opened Date: 02/20/1987
Parcel Number: 760-029-04-00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Case Type: LOP - Local Oversight Program
Historical Name: SEAFORTH SPORTFISHING
SWRCB Global ID: T0607302777
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 02/17/1987
Census Tract: 76.00
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 906.8
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Latitude: 32.7634399
Longitude: -117.2367155
X MapCoord: 6258368.122
Y MapCoord: 1859004.113

CERS:

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 921097811
Site ID: 66346
CERS ID: 10383319
CERS Description: Chemical Storage Facilities

Violations:

Site ID: 66346
Site Name: SEAFORTH SPORTFISHING
Violation Date: 04-25-2017
Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16, Section(s) 2665
Violation Description: Failure to comply with one or more of the following: Failure to install or maintain a liquid-tight spill bucket. Have a minimum capacity of five gallons. Have a functional drain valve or other method for the removal of liquid from the spill bucket/spill container. Be resistant to galvanic corrosion.
Violation Notes: Returned to compliance on 05/12/2017.
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 66346
Site Name: SEAFORTH SPORTFISHING
Violation Date: 04-25-2017
Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code, Chapter 6.75, Section(s) 25299.30-25299.34
Violation Description: Failure to submit and maintain complete and current Certification of Financial Responsibility or other mechanism of financial assurance.
Violation Notes: Returned to compliance on 05/18/2017.
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 66346
Site Name: SEAFORTH SPORTFISHING
Violation Date: 08-15-2014
Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Violation Description: Chapter 12, Section(s) 66262.34(f)
Failure to properly label hazardous waste accumulation containers with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 08/15/2014.

Violation Division: San Diego County Department of Env Health

Violation Program: HW

Violation Source: CERS

Site ID: 66346

Site Name: SEAFORTH SPORTFISHING

Violation Date: 06-03-2016

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the business plan is complete and accurate on or before the annual due date.

Violation Notes: Returned to compliance on 08/25/2016.

Violation Division: San Diego County Department of Env Health

Violation Program: HMRRP

Violation Source: CERS

Site ID: 66346

Site Name: SEAFORTH SPORTFISHING

Violation Date: 04-25-2018

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the business plan is complete and accurate on or before the annual due date.

Violation Notes: Returned to compliance on 06/07/2018.

Violation Division: San Diego County Department of Env Health

Violation Program: HMRRP

Violation Source: CERS

Site ID: 66346

Site Name: SEAFORTH SPORTFISHING

Violation Date: 08-15-2014

Citation: HSC 6.95 25508(b) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(b)

Violation Description: Failure to review, revise, and recertify the business plan at least once every three years.

Violation Notes: Returned to compliance on 01/27/2015.

Violation Division: San Diego County Department of Env Health

Violation Program: HMRRP

Violation Source: CERS

Site ID: 66346

Site Name: SEAFORTH SPORTFISHING

Violation Date: 08-15-2014

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the business plan is complete, accurate, and up-to-date.

Violation Notes: Returned to compliance on 01/27/2015.

Violation Division: San Diego County Department of Env Health

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Violation Program: HMRRP
Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-25-2017
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5654102
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-25-2017
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5654102
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-25-2017
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5654102
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-25-2018
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5873861
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-25-2018
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5873861
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-25-2018
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5873861
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-26-2019
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: LaPel Daniel Inspection ID:6135372
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-26-2019
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: LaPel Daniel Inspection ID:6135372
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-26-2019
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: LaPel Daniel Inspection ID:6135372
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	06-03-2016
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5430747
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	06-03-2016
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5430747
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	06-03-2016
Violations Found:	Yes
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5430747
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	06-04-2015
Violations Found:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5157363
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 06-04-2015
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5157363
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 06-04-2015
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5157363
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-15-2014
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4906146
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-15-2014
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4906146
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-15-2014
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4906146
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-16-2013
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4096246
Eval Division: San Diego County Department of Env Health

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-16-2013
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4096246
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-16-2013
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4096246
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Coordinates:
Site ID: 66346
Facility Name: SEAFORTH SPORTFISHING
Env Int Type Code: HWG
Program ID: 10383319
Coord Name: Not reported
Ref Point Type Desc: Center of a facility or station.
Latitude: 32.764340
Longitude: -117.236280

Affiliation:
Affiliation Type Desc: UST Permit Applicant
Entity Name: John Yamate
Entity Title: Manager
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 224-3383

Affiliation Type Desc: UST Tank Operator
Entity Name: SEAFORTH SPORTFISHING CORP
Entity Title: Not reported
Affiliation Address: 1717 Quivira Road
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92109
Affiliation Phone: (619) 224-3383

Affiliation Type Desc: UST Tank Owner
Entity Name: SEAFORTH SPORTFISHING CORP
Entity Title: Not reported
Affiliation Address: 1717 QUIVIRA RD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Affiliation City:	SAN DIEGO
Affiliation State:	CA
Affiliation Country:	United States
Affiliation Zip:	92109-
Affiliation Phone:	(619) 224-3383
Affiliation Type Desc:	Facility Mailing Address
Entity Name:	Mailing Address
Entity Title:	Not reported
Affiliation Address:	1717 QUIVIRA RD
Affiliation City:	SAN DIEGO
Affiliation State:	CA
Affiliation Country:	Not reported
Affiliation Zip:	92109
Affiliation Phone:	Not reported
Affiliation Type Desc:	UST Property Owner Name
Entity Name:	SEAFORTH SPORTFISHING CORP
Entity Title:	Not reported
Affiliation Address:	1717 QUIVIRA RD
Affiliation City:	SAN DIEGO
Affiliation State:	CA
Affiliation Country:	United States
Affiliation Zip:	92109
Affiliation Phone:	(619) 224-3383
Affiliation Type Desc:	CUPA District
Entity Name:	San Diego County Env Health
Entity Title:	Not reported
Affiliation Address:	PO Box 129261
Affiliation City:	San Diego
Affiliation State:	CA
Affiliation Country:	Not reported
Affiliation Zip:	92112-9261
Affiliation Phone:	(858) 505-6880
Affiliation Type Desc:	Document Preparer
Entity Name:	John D. Yamate
Entity Title:	Not reported
Affiliation Address:	Not reported
Affiliation City:	Not reported
Affiliation State:	Not reported
Affiliation Country:	Not reported
Affiliation Zip:	Not reported
Affiliation Phone:	Not reported
Affiliation Type Desc:	Environmental Contact
Entity Name:	John Yamate
Entity Title:	Not reported
Affiliation Address:	1717 Quivira Road
Affiliation City:	San Diego
Affiliation State:	CA
Affiliation Country:	Not reported
Affiliation Zip:	92109
Affiliation Phone:	Not reported
Affiliation Type Desc:	Identification Signer

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Entity Name: John D. Yamate
Entity Title: Manager
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner
Entity Name: SEAFORTH SPORTFISHING CORP
Entity Title: Not reported
Affiliation Address: 1717 QUIVIRA RD
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92109
Affiliation Phone: (619) 224-3383

Affiliation Type Desc: Operator
Entity Name: SEAFORTH SPORTFISHING CORP
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 224-3383

Affiliation Type Desc: Parent Corporation
Entity Name: SEAFORTH SPORTFISHING
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 921097811
Site ID: 66346
CERS ID: T0607302777
CERS Description: Leaking Underground Storage Tank Cleanup Site

Violations:
Site ID: 66346
Site Name: SEAFORTH SPORTFISHING
Violation Date: 04-25-2017
Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16, Section(s) 2665
Violation Description: Failure to comply with one or more of the following: Failure to install or maintain a liquid-tight spill bucket. Have a minimum capacity of five gallons. Have a functional drain valve or other method for the removal of liquid from the spill bucket/spill container. Be resistant to galvanic corrosion.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Violation Notes: Returned to compliance on 05/12/2017.
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 66346
Site Name: SEAFORTH SPORTFISHING
Violation Date: 04-25-2017
Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code, Chapter 6.75, Section(s) 25299.30-25299.34
Violation Description: Failure to submit and maintain complete and current Certification of Financial Responsibility or other mechanism of financial assurance.

Violation Notes: Returned to compliance on 05/18/2017.
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 66346
Site Name: SEAFORTH SPORTFISHING
Violation Date: 08-15-2014
Citation: 22 CCR 12 66262.34(f) - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.34(f)
Violation Description: Failure to properly label hazardous waste accumulation containers with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.

Violation Notes: Returned to compliance on 08/15/2014.
Violation Division: San Diego County Department of Env Health
Violation Program: HW
Violation Source: CERS

Site ID: 66346
Site Name: SEAFORTH SPORTFISHING
Violation Date: 06-03-2016
Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2
Violation Description: Failure to annually review and electronically certify that the business plan is complete and accurate on or before the annual due date.

Violation Notes: Returned to compliance on 08/25/2016.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 66346
Site Name: SEAFORTH SPORTFISHING
Violation Date: 04-25-2018
Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2
Violation Description: Failure to annually review and electronically certify that the business plan is complete and accurate on or before the annual due date.

Violation Notes: Returned to compliance on 06/07/2018.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Site ID: 66346
Site Name: SEAFORTH SPORTFISHING
Violation Date: 08-15-2014
Citation: HSC 6.95 25508(b) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(b)
Violation Description: Failure to review, revise, and recertify the business plan at least once every three years.
Violation Notes: Returned to compliance on 01/27/2015.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 66346
Site Name: SEAFORTH SPORTFISHING
Violation Date: 08-15-2014
Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2
Violation Description: Failure to annually review and electronically certify that the business plan is complete, accurate, and up-to-date.
Violation Notes: Returned to compliance on 01/27/2015.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Evaluation:
Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-25-2017
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5654102
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-25-2017
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5654102
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-25-2017
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5654102
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-25-2018
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5873861

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-25-2018
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5873861
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-25-2018
Violations Found:	Yes
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5873861
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-26-2019
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: LaPel Daniel Inspection ID:6135372
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-26-2019
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: LaPel Daniel Inspection ID:6135372
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-26-2019
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: LaPel Daniel Inspection ID:6135372
Eval Division:	San Diego County Department of Env Health
Eval Program:	UST
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	06-03-2016
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Fernandez Juan Inspection ID:5430747
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Eval General Type: Compliance Evaluation Inspection
Eval Date: 06-03-2016
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5430747
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 06-03-2016
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5430747
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 06-04-2015
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5157363
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 06-04-2015
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5157363
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 06-04-2015
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5157363
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-15-2014
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4906146
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-15-2014
Violations Found: Yes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4906146
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-15-2014
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4906146
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-16-2013
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4096246
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-16-2013
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4096246
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-16-2013
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4096246
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Coordinates:
Site ID: 66346
Facility Name: SEAFORTH SPORTFISHING
Env Int Type Code: HWG
Program ID: 10383319
Coord Name: Not reported
Ref Point Type Desc: Center of a facility or station.
Latitude: 32.764340
Longitude: -117.236280

Affiliation:
Affiliation Type Desc: UST Permit Applicant
Entity Name: John Yamate
Entity Title: Manager

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Affiliation Address:	Not reported
Affiliation City:	Not reported
Affiliation State:	Not reported
Affiliation Country:	Not reported
Affiliation Zip:	Not reported
Affiliation Phone:	(619) 224-3383
Affiliation Type Desc:	UST Tank Operator
Entity Name:	SEAFORTH SPORTFISHING CORP
Entity Title:	Not reported
Affiliation Address:	1717 Quivira Road
Affiliation City:	San Diego
Affiliation State:	CA
Affiliation Country:	United States
Affiliation Zip:	92109
Affiliation Phone:	(619) 224-3383
Affiliation Type Desc:	UST Tank Owner
Entity Name:	SEAFORTH SPORTFISHING CORP
Entity Title:	Not reported
Affiliation Address:	1717 QUIVIRA RD
Affiliation City:	SAN DIEGO
Affiliation State:	CA
Affiliation Country:	United States
Affiliation Zip:	92109-
Affiliation Phone:	(619) 224-3383
Affiliation Type Desc:	Facility Mailing Address
Entity Name:	Mailing Address
Entity Title:	Not reported
Affiliation Address:	1717 QUIVIRA RD
Affiliation City:	SAN DIEGO
Affiliation State:	CA
Affiliation Country:	Not reported
Affiliation Zip:	92109
Affiliation Phone:	Not reported
Affiliation Type Desc:	UST Property Owner Name
Entity Name:	SEAFORTH SPORTFISHING CORP
Entity Title:	Not reported
Affiliation Address:	1717 QUIVIRA RD
Affiliation City:	SAN DIEGO
Affiliation State:	CA
Affiliation Country:	United States
Affiliation Zip:	92109
Affiliation Phone:	(619) 224-3383
Affiliation Type Desc:	CUPA District
Entity Name:	San Diego County Env Health
Entity Title:	Not reported
Affiliation Address:	PO Box 129261
Affiliation City:	San Diego
Affiliation State:	CA
Affiliation Country:	Not reported
Affiliation Zip:	92112-9261
Affiliation Phone:	(858) 505-6880

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Affiliation Type Desc: Document Preparer
Entity Name: John D. Yamate
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Environmental Contact
Entity Name: John Yamate
Entity Title: Not reported
Affiliation Address: 1717 Quivira Road
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92109
Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer
Entity Name: John D. Yamate
Entity Title: Manager
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner
Entity Name: SEAFORTH SPORTFISHING CORP
Entity Title: Not reported
Affiliation Address: 1717 QUIVIRA RD
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92109
Affiliation Phone: (619) 224-3383

Affiliation Type Desc: Operator
Entity Name: SEAFORTH SPORTFISHING CORP
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 224-3383

Affiliation Type Desc: Parent Corporation
Entity Name: SEAFORTH SPORTFISHING
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S106931998

Affiliation Zip: Not reported
Affiliation Phone: Not reported

F112
West
1/8-1/4
0.159 mi.
842 ft.

SEAFORTH SPORTFISHING
1717 QUIVIRA RD
SAN DIEGO, CA 92109
Site 2 of 4 in cluster F

SAN DIEGO CO. SAM
UST
San Diego Co. HMMD
SWEEPS UST

U003789701
N/A

Relative:
Lower

SAN DIEGO CO. SAM:

Actual:
12 ft.

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 921097811
Case Number: H21141-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: Soils Only
Facility Status: Closed Case
Date: 10/16/1992
Date Began: 2/17/1987

UST:

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
Facility ID: 37-000-121141
Permitting Agency: San Diego County Department of Environmental Health
Latitude: 32.76434
Longitude: -117.23628

HMMD SAN DIEGO:

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000419804
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 619-224-3383
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 06/16/2018
Facility Owner: Not reported
Facility Mailing Address: 1717 QUIVIRA RD, SAN DIEGO, CA 92109
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: Y
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Inspection Violation:

Record ID: DEH2002-HUPFP-121141
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121141
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5654102
Return To Compliance Date: Not reported
Nov: Not reported
Violation Classification: Not reported
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-17T00:00:00.000
Inspection Date: 2017-04-25T13:05:00.000
Violation Code: 2010007 Failure to submit and maintain complete and current Certification of Financial Responsibility or other mechanism of financial assurance. HSC 25292.2, 25299.30-25299.34; 23 CCR 2711; 2808.1, 2809-2809.2

Record ID: DEH2002-HUPFP-121141
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121141
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4906146
Return To Compliance Date: 2014-08-15T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-17T00:00:00.000
Inspection Date: 2014-08-15T13:46:00.000
Violation Code: 3030007 Failure to properly label hazardous waste accumulation containers with the following requirements: "Hazardous Waste", name and address of the generator, physical and chemical characteristics of the Hazardous Waste, and starting accumulation date.; 22 CCR 12 66262.34(f).

Record ID: DEH2002-HUPFP-121141
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121141
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 4906146
Return To Compliance Date: 2015-01-27T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-17T00:00:00.000
Inspection Date: 2014-08-15T13:46:00.000
Violation Code: 1010008 Failure to submit inventory reports (Activities, Owner/Operator, Hazardous Materials Descriptions and Map pages, if required. Documentation must be resubmitted (for facilities which

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

exceed EPCRA thresholds) or re-certified (for facilities which do not exceed EPCRA thresholds) by March 1; 19 CCR 4 2729.4(b), 2729.5.

Record ID: DEH2002-HUPFP-121141
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121141
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5430747
Return To Compliance Date: 2016-08-25T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-17T00:00:00.000
Inspection Date: 2016-06-03T12:05:00.000
Violation Code: 1010008 HMBP not certified annually as complete and accurate in CERS.
HSC 25508.2

Record ID: DEH2002-HUPFP-121141
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121141
Program Element: Underground Storage Tank
Inspection Type: Routine
Inspection Number: 5654102
Return To Compliance Date: 2017-05-12T00:00:00.000
Nov: No
Violation Classification: Not reported
Underground Storage Tank Id: 26666
Container/Tank Id: Not reported
Last Update: 2019-05-17T00:00:00.000
Inspection Date: 2017-04-25T13:05:00.000
Violation Code: 2060020 (RP) Failure to comply with one or more of the following:
failure to install a spill bucket, have a functional drain valve or
other method for the removal of liquid from the spill bucket/spill
container, and/or be resistant to galvanic corrosion. 23 CCR 2635(b),
2665

Record ID: DEH2002-HUPFP-121141
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121141
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5873861
Return To Compliance Date: 2018-06-07T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-17T00:00:00.000
Inspection Date: 2018-04-25T12:16:00.000
Violation Code: 1010008 HMBP not certified annually as complete and accurate in CERS.
HSC 25508(a)(1)(A), 25508.2, 19 CCR 2654(b)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

UST DTL:

Record ID: DEH2002-HUPFP-121141
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-121141
Facility Type (Ust Facility): Other
Tank Owner Name: SEAFORTH SPORTFISHING CORP
Tankid: 26666
Tank Status: Active
Date Ust Permanently Closed: Not reported
Tank Use: Marina Fueling
Piping System Type: Pressure
Last Updated: 2018-07-27T11:33:42.000
Tank Capacityin Gallons: 10000
Tank Contents: Diesel
Type Of Tank: Double Wall

Waste and Materials:

Record ID: DEH2002-HUPFP-121141
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0186122
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-07-27T11:33:42.000
Chemical Name: Diesel Fuel No. 2
Common Name: Diesel Fuel No. 2
Case Number: 68476-34-6

Record ID: DEH2002-HUPFP-121141
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0111419
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-05-22T02:32:55.000
Chemical Name: Diesel Fuel No. 2
Common Name: Diesel Fuel No. 2
Case Number: 68476-34-6

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 121141
Business Type: 6HK33
EPA Id Number: CAL000191408
APN: 760-029-04-00
Last HMMI Inspection: 08/22/2012
Facility Telephone: 619-224-3383
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: SEAFORTH SPORTFISHING CORP
Facility Mailing Address: 1717 QUIVIRA RD
Facility Mailing City: SAN DIEGO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Facility Mailing State: CA
Facility Mailing Zip: 92109
UST Owner: SEAFORTH SPORTFISHING CORP
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 121141
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL
Other Information: UNDERGROUND TANK 121141 T002
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 121141
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: WATER OIL MIX / SUMPS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3102
Violation: OPER. PERMIT NOT CURRENT/ONSITE
Violation Citation: Current Operating Permit not available at facility. 25284(a), 25286(a); 2712(i); 68.1003
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3103
Violation: NO UST PLAN CHECK PERMIT OBTAINED
Violation Citation: UST repair/modify/closure permit not obtained .68.1004, 68.1005, 68.1009.5
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3107
Violation: MONITORING PROCEDURES NOT AVAIL/TO HMD
Violation Citation: Monitoring procedures not available/complete/submitted to HMD 2632(b)&(d), 2634(d), 2641(h), 2711(a)(9)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3108
Violation: UST ER RESPONSE PLAN NOT COMPLETE/AVAIL
Violation Citation: Emergency Response Plan is not available/complete. 25289(b); 2632(b), 2634(e), 2641(h)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3109
Violation: NO SCALED PLOT PLAN AVAIL/TO HMD
Violation Citation: Scaled Plot plan showing tank, piping & equipment location not available/complete/submitted to HMD. 2711(a)(8), 2632(d)(1) (C)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3112
Violation: 2NDRY CONT TEST NOT DONE (6/36 MOS.)
Violation Citation: Secondary containment testing not conducted at 6months/36 months. 25284.1; 2637(a)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3151
Violation: ALL RELEASES NOT REPORTED/RECORDED
Violation Citation: All releases not recorded and/or reported. 25294, 25295, 2650, 2651, 2652
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3152
Violation: ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation: All maintenance/monitoring/calibration/ repair records not available. 25293; 2712 (b)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Violation Code: 6HV3405
Violation: LLD DOESN'T DETECT 3.0 GPH OR EQUIVA
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not detect 3.0 gph or equivalent? 2636(f)(2)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3406
Violation: AUTOMATIC LLD NOT CERTIFIED ANNUALLY
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Automatic line leak detector not certified annually 25284.1(a)(4)(C); 2630(d), 2641(j)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3407
Violation: PIPE INT. TEST DOESN'T DETECT.1 GPH @150
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 2-Piping integrity test does not detect 0.1-gph leak with ELLD or at 150% pressure 2636(f)(4)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV0132
Violation: EPA ID NUMBER NOT OBTAINED/MAINTAINED
Violation Citation: Generator of hazardous waste has not obtained/maintained an EPA identification number. CCR 66262.12(a)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV1002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Violation: HMBP NOT ESTABLISHED/IMPLEMENTED.
Violation Citation: Hazardous materials handler has not established/implemented a business plan. HSC 25503.5(a)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/10/2008
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/10/2008
Violation Code: 6HV3193
Violation: NO TRAINING/RECORD INCOMPLETE-NOT ONSITE
Violation Citation: Facility employee(s) are not trained, training records are incomplete, and/or not onsite. 2715(f)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/10/2008
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/05/2011
Violation Code: 6HV3101
Violation: UPF PERMIT NOT CURRENT/ONSITE
Violation Citation: Current UPF permit not obtained/not available. 25284; 68.905, 68.1003, 68.1005
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/10/2009
Violation Code: 6HV3157
Violation: EQUIP. TAMPERING/RECORD FALSIFICATION
Violation Citation: Monitoring system disabled or tampered with and/or monitoring records falsified. 25299(f)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/13/2004
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/13/2004
Violation Code: 6HV3158
Violation: ALL OPERATING CONDITIONS NOT MET
Violation Citation: All permit operating conditions not met. 25284; 2712
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/13/2004
Violation Code: 6HV3407
Violation: PIPE INT. TEST DOESN'T DETECT.1 GPH @150
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 2-Piping integrity test does not detect 0.1-gph leak with ELLD or at 150% pressure 2636(f)(4)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 03/17/2005
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 03/17/2005
Violation Code: 6HV3107
Violation: MONITORING PROCEDURES NOT AVAIL/TO HMD
Violation Citation: Monitoring procedures not available/complete/submitted to HMD 2632(b)&(d), 2634(d), 2641(h), 2711(a)(9)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 03/17/2005
Violation Code: 6HV3108
Violation: UST ER RESPONSE PLAN NOT COMPLETE/AVAIL
Violation Citation: Emergency Response Plan is not available/complete. 25289(b); 2632(b), 2634(e), 2641(h)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 03/17/2005
Violation Code: 6HV3109
Violation: NO SCALED PLOT PLAN AVAIL/TO HMD
Violation Citation: Scaled Plot plan showing tank, piping & equipment location not available/complete/submitted to HMD. 2711(a)(8), 2632(d)(1) (C)
Activity: ACTIVE

Permit Number: 121141

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Update Date: 11/02/2012
Inspection Date: 08/22/2012
Violation Code: 6HV3108
Violation: UST ER RESPONSE PLAN NOT COMPLETE/AVAIL
Violation Citation: Emergency Response Plan is not available/complete. 25289(b); 2632(b), 2634(e), 2641(h)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/22/2012
Violation Code: 6HV3114
Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA
Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/22/2012
Violation Code: 6HV3115
Violation: NO 2NDARY CONTAINMT. TEST/REPAIRS
Violation Citation: Secondary containment testing not completed (passed) for all components &/or repairs to secondary containment components not completed. 25284.1, 25291(a)(2); 2637
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/22/2012
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3114
Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA
Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Inspection Date: 04/21/2006
Violation Code: 6HV3164
Violation: MONITOR EQUIP NOT PER MANUF. SPECS
Violation Citation: All monitoring equipment not installed, calibrated, operated, and/or maintained per manufacturer instructions. 2638(a), 2641(j)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional. 2630, 2641(j), 2632
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3412
Violation: NO ANNUAL 0.1 GPH TEST
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):OPTION 1: No annual 0.1 gph (gallon per hour) test. 2636(f)(4)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/09/2010
Violation Code: 6HV3193
Violation: NO TRAINING/RECORD INCOMPLETE-NOT ONSITE
Violation Citation: Facility employee(s) are not trained, training records are incomplete, and/or not onsite. 2715(f)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/03/2007
Violation Code: 6HV3105

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available.
25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/03/2007
Violation Code: 6HV3152
Violation: ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation: All maintenance/monitoring/calibration/ repair records not available.
25293; 2712 (b)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 121141 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121141
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 1000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1988-11-02 00:00:00
Year Installed: 1968-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: PRESSURE
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 121141 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 121141
Tank Type: DOUBLE WALL
Additional Id: RT1193, RT3620, RT3997,RT5421
Capacity Gallons: 10000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1987-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 61
UST Monitor Method: DW TANK W/DRY ANNULAR, DW PRESSURE PIPE; FAILSAFE & POS SHUTOFF, 3.0 LLD; SW ABOVE GROUND PIPE & UDC W/VISUAL MONIT

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 121141
Business Type: 6HK33
EPA Id Number: CAL000191408
APN: 760-029-04-00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Last HMMD Inspection: 08/22/2012
Facility Telephone: 619-224-3383
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: SEAFORTH SPORTFISHING CORP
Facility Mailing Address: 1717 QUIVIRA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109
UST Owner: SEAFORTH SPORTFISHING CORP
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 121141
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL
Other Information: UNDERGROUND TANK 121141 T002
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 121141
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: WATER OIL MIX / SUMPS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3102
Violation: OPER. PERMIT NOT CURRENT/ONSITE
Violation Citation: Current Operating Permit not available at facility. 25284(a),
25286(a); 2712(i); 68.1003
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3103
Violation: NO UST PLAN CHECK PERMIT OBTAINED
Violation Citation: UST repair/modify/closure permit not obtained .68.1004, 68.1005,
68.1009.5
Activity: ACTIVE

Permit Number: 121141

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available.
25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3107
Violation: MONITORING PROCEDURES NOT AVAIL/TO HMD
Violation Citation: Monitoring procedures not available/complete/submitted to HMD 2632(b)&
(d), 2634(d), 2641(h), 2711(a)(9)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3108
Violation: UST ER RESPONSE PLAN NOT COMPLETE/AVAIL
Violation Citation: Emergency Response Plan is not available/complete. 25289(b); 2632(b),
2634(e), 2641(h)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3109
Violation: NO SCALED PLOT PLAN AVAIL/TO HMD
Violation Citation: Scaled Plot plan showing tank, piping & equipment location not
available/complete/submitted to HMD. 2711(a)(8), 2632(d)(1) (C)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3112
Violation: 2NDRY CONT TEST NOT DONE (6/36 MOS.)
Violation Citation: Secondary containment testing not conducted at 6months/36 months.
25284.1; 2637(a)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3151
Violation: ALL RELEASES NOT REPORTED/RECORDED
Violation Citation: All releases not recorded and/or reported. 25294, 25295, 2650, 2651,
2652
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3152

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Violation: ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation: All maintenance/monitoring/calibration/ repair records not available.
25293; 2712 (b)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3405
Violation: LLD DOESN'T DETECT 3.0 GPH OR EQUIVA
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not
detect 3.0 gph or equivalent? 2636(f)(2)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3406
Violation: AUTOMATIC LLD NOT CERTIFIED ANNUALLY
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Automatic line leak
detector not certified annually 25284.1(a)(4)(C); 2630(d), 2641(j)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3407
Violation: PIPE INT. TEST DOESN'T DETECT.1 GPH @150
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 2-Piping integrity test does
not detect 0.1-gph leak with ELLD or at 150% pressure 2636(f)(4)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV0132
Violation: EPA ID NUMBER NOT OBTAINED/MAINTAINED
Violation Citation: Generator of hazardous waste has not obtained/maintained an EPA
identification number. CCR 66262.12(a)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation
date and/or are improperly labeled. CCR 66262.34(a)(2);
66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

with requirements for current and former employees. CCR
66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV1002
Violation: HMBP NOT ESTABLISHED/IMPLEMENTED.
Violation Citation: Hazardous materials handler has not established/implemented a business
plan. HSC 25503.5(a)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/10/2008
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available.
25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/10/2008
Violation Code: 6HV3193
Violation: NO TRAINING/RECORD INCOMPLETE-NOT ONSITE
Violation Citation: Facility employee(s) are not trained, training records are incomplete,
and/or not onsite. 2715(f)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/10/2008
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or
DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/05/2011
Violation Code: 6HV3101
Violation: UPF PERMIT NOT CURRENT/ONSITE
Violation Citation: Current UPF permit not obtained/not available. 25284; 68.905, 68.1003,
68.1005
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/10/2009
Violation Code: 6HV3157
Violation: EQUIP. TAMPERING/RECORD FALSIFICATION
Violation Citation: Monitoring system disabled or tampered with and/or monitoring records
falsified. 25299(f)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/13/2004
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/13/2004
Violation Code: 6HV3158
Violation: ALL OPERATING CONDITIONS NOT MET
Violation Citation: All permit operating conditions not met. 25284; 2712
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/13/2004
Violation Code: 6HV3407
Violation: PIPE INT. TEST DOESN'T DETECT.1 GPH @150
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 2-Piping integrity test does not detect 0.1-gph leak with ELLD or at 150% pressure 2636(f)(4)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 03/17/2005
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 03/17/2005
Violation Code: 6HV3107
Violation: MONITORING PROCEDURES NOT AVAIL/TO HMD
Violation Citation: Monitoring procedures not available/complete/submitted to HMD 2632(b)&(d), 2634(d), 2641(h), 2711(a)(9)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 03/17/2005
Violation Code: 6HV3108
Violation: UST ER RESPONSE PLAN NOT COMPLETE/AVAIL
Violation Citation: Emergency Response Plan is not available/complete. 25289(b); 2632(b), 2634(e), 2641(h)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 03/17/2005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Violation Code: 6HV3109
Violation: NO SCALED PLOT PLAN AVAIL/TO HMD
Violation Citation: Scaled Plot plan showing tank, piping & equipment location not available/complete/submitted to HMD. 2711(a)(8), 2632(d)(1) (C)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/22/2012
Violation Code: 6HV3108
Violation: UST ER RESPONSE PLAN NOT COMPLETE/AVAIL
Violation Citation: Emergency Response Plan is not available/complete. 25289(b); 2632(b), 2634(e), 2641(h)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/22/2012
Violation Code: 6HV3114
Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA
Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/22/2012
Violation Code: 6HV3115
Violation: NO 2NDARY CONTAINMT. TEST/REPAIRS
Violation Citation: Secondary containment testing not completed (passed) for all components &/or repairs to secondary containment components not completed. 25284.1, 25291(a)(2); 2637
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/22/2012
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3114

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA
Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3164
Violation: MONITOR EQUIP NOT PER MANUF. SPECS
Violation Citation: All monitoring equipment not installed, calibrated, operated, and/or maintained per manufacturer instructions. 2638(a), 2641(j)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional. 2630, 2641(j), 2632
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3412
Violation: NO ANNUAL 0.1 GPH TEST
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):OPTION 1: No annual 0.1 gph (gallon per hour) test. 2636(f)(4)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/09/2010
Violation Code: 6HV3193
Violation: NO TRAINING/RECORD INCOMPLETE-NOT ONSITE
Violation Citation: Facility employee(s) are not trained, training records are incomplete,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Activity: and/or not onsite. 2715(f)
ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/03/2007
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available.
25292.2(a), 25299.33; 2809

Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/03/2007
Violation Code: 6HV3152
Violation: ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation: All maintenance/monitoring/calibration/ repair records not available.
25293; 2712 (b)

Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 121141 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121141
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 1000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1988-11-02 00:00:00
Year Installed: 1968-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: PRESSURE
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 121141 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 121141
Tank Type: DOUBLE WALL
Additional Id: RT1193, RT3620, RT3997,RT5421
Capacity Gallons: 10000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1987-01-01 00:00:00
Pipe Type: DOUBLE WALL
Delivery System: PRESSURE
Monitor Code: 61
UST Monitor Method: DW TANK W/DRY ANNULAR, DW PRESSURE PIPE; FAILSAFE & POS SHUTOFF, 3.0 LLD; SW ABOVE GROUND PIPE & UDC W/VISUAL MONIT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 121141
Business Type: 6HK33
EPA Id Number: CAL000191408
APN: 760-029-04-00
Last HMMI Inspection: 08/22/2012
Facility Telephone: 619-224-3383
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: SEAFORTH SPORTFISHING CORP
Facility Mailing Address: 1717 QUIVIRA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109
UST Owner: SEAFORTH SPORTFISHING CORP
Handle Regulated Hazmat: Y
Own Or Operate UST: Y
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 121141
Update Date: 11/02/2012
Case Number: 68476-34-6
Name: DIESEL
Other Information: UNDERGROUND TANK 121141 T002
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 121141
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: WATER OIL MIX / SUMPS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3102
Violation: OPER. PERMIT NOT CURRENT/ONSITE
Violation Citation: Current Operating Permit not available at facility. 25284(a),
25286(a); 2712(i); 68.1003
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Violation Code: 6HV3103
Violation: NO UST PLAN CHECK PERMIT OBTAINED
Violation Citation: UST repair/modify/closure permit not obtained .68.1004, 68.1005, 68.1009.5
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3107
Violation: MONITORING PROCEDURES NOT AVAIL/TO HMD
Violation Citation: Monitoring procedures not available/complete/submitted to HMD 2632(b)& (d), 2634(d), 2641(h), 2711(a)(9)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3108
Violation: UST ER RESPONSE PLAN NOT COMPLETE/AVAIL
Violation Citation: Emergency Response Plan is not available/complete. 25289(b); 2632(b), 2634(e), 2641(h)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3109
Violation: NO SCALED PLOT PLAN AVAIL/TO HMD
Violation Citation: Scaled Plot plan showing tank, piping & equipment location not available/complete/submitted to HMD. 2711(a)(8), 2632(d)(1) (C)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3112
Violation: 2NDRY CONT TEST NOT DONE (6/36 MOS.)
Violation Citation: Secondary containment testing not conducted at 6months/36 months. 25284.1; 2637(a)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3151
Violation: ALL RELEASES NOT REPORTED/RECORDED
Violation Citation: All releases not recorded and/or reported. 25294, 25295, 2650, 2651,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

2652
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3152
Violation: ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation: All maintenance/monitoring/calibration/ repair records not available.
25293; 2712 (b)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3405
Violation: LLD DOESN'T DETECT 3.0 GPH OR EQUIVA
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Line leak detector does not
detect 3.0 gph or equivalent? 2636(f)(2)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3406
Violation: AUTOMATIC LLD NOT CERTIFIED ANNUALLY
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 3-Automatic line leak
detector not certified annually 25284.1(a)(4)(C); 2630(d), 2641(j)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV3407
Violation: PIPE INT. TEST DOESN'T DETECT.1 GPH @150
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 2-Piping integrity test does
not detect 0.1-gph leak with ELLD or at 150% pressure 2636(f)(4)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV0132
Violation: EPA ID NUMBER NOT OBTAINED/MAINTAINED
Violation Citation: Generator of hazardous waste has not obtained/maintained an EPA
identification number. CCR 66262.12(a)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation
date and/or are improperly labeled. CCR 66262.34(a)(2);
66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/08/2003
Violation Code: 6HV1002
Violation: HMBP NOT ESTABLISHED/IMPLEMENTED.
Violation Citation: Hazardous materials handler has not established/implemented a business plan. HSC 25503.5(a)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/10/2008
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/10/2008
Violation Code: 6HV3193
Violation: NO TRAINING/RECORD INCOMPLETE-NOT ONSITE
Violation Citation: Facility employee(s) are not trained, training records are incomplete, and/or not onsite. 2715(f)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/10/2008
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/05/2011
Violation Code: 6HV3101
Violation: UPF PERMIT NOT CURRENT/ONSITE
Violation Citation: Current UPF permit not obtained/not available. 25284; 68.905, 68.1003, 68.1005
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Inspection Date: 07/10/2009
Violation Code: 6HV3157
Violation: EQUIP. TAMPERING/RECORD FALSIFICATION
Violation Citation: Monitoring system disabled or tampered with and/or monitoring records falsified. 25299(f)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/13/2004
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/13/2004
Violation Code: 6HV3158
Violation: ALL OPERATING CONDITIONS NOT MET
Violation Citation: All permit operating conditions not met. 25284; 2712
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 01/13/2004
Violation Code: 6HV3407
Violation: PIPE INT. TEST DOESN'T DETECT.1 GPH @150
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING: OPTION 2-Piping integrity test does not detect 0.1-gph leak with ELLD or at 150% pressure 2636(f)(4)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 03/17/2005
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 03/17/2005
Violation Code: 6HV3107
Violation: MONITORING PROCEDURES NOT AVAIL/TO HMD
Violation Citation: Monitoring procedures not available/complete/submitted to HMD 2632(b)&(d), 2634(d), 2641(h), 2711(a)(9)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 03/17/2005
Violation Code: 6HV3108
Violation: UST ER RESPONSE PLAN NOT COMPLETE/AVAIL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Violation Citation: Emergency Response Plan is not available/complete. 25289(b); 2632(b), 2634(e), 2641(h)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 03/17/2005
Violation Code: 6HV3109
Violation: NO SCALED PLOT PLAN AVAIL/TO HMD
Violation Citation: Scaled Plot plan showing tank, piping & equipment location not available/complete/submitted to HMD. 2711(a)(8), 2632(d)(1) (C)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/22/2012
Violation Code: 6HV3108
Violation: UST ER RESPONSE PLAN NOT COMPLETE/AVAIL
Violation Citation: Emergency Response Plan is not available/complete. 25289(b); 2632(b), 2634(e), 2641(h)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/22/2012
Violation Code: 6HV3114
Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA
Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/22/2012
Violation Code: 6HV3115
Violation: NO 2NDARY CONTAINMT. TEST/REPAIRS
Violation Citation: Secondary containment testing not completed (passed) for all components &/or repairs to secondary containment components not completed. 25284.1, 25291(a)(2); 2637
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 08/22/2012
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3114
Violation: 2NDRY CONT TEST NOT DONE/SENT TO CUPA
Violation Citation: Secondary containment testing not done at 6/36 months and/or not sent to CUPA within 30 days. 25284.1; 2637(a)&(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3164
Violation: MONITOR EQUIP NOT PER MANUF. SPECS
Violation Citation: All monitoring equipment not installed, calibrated, operated, and/or maintained per manufacturer instructions. 2638(a), 2641(j)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3192
Violation: NO D.O INSPECTION/INCOMPL;NO REPORTS
Violation Citation: Designated Operator monthly inspection not conducted or incomplete; or DO inspection reports not onsite 2715 (c)(d)(e)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3263
Violation: MONITOR SYSTEM NOT ALL FUNCTIONAL
Violation Citation: Monitoring system components &/or devices are not all functional. 2630, 2641(j), 2632
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3411
Violation: LLD NOT INSTALLED/NOT FUNCTIONAL
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):Line leak detector is not installed, not functional, or not tested. 2636(f)(2), 25284.1(a)(4)(C), 2641(j)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/21/2006
Violation Code: 6HV3412
Violation: NO ANNUAL 0.1 GPH TEST
Violation Citation: DOUBLE WALLED PRESSURIZED PIPING-Including Under Dispenser Containment (UDC):OPTION 1: No annual 0.1 gph (gallon per hour) test. 2636(f)(4)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 07/09/2010
Violation Code: 6HV3193
Violation: NO TRAINING/RECORD INCOMPLETE-NOT ONSITE
Violation Citation: Facility employee(s) are not trained, training records are incomplete, and/or not onsite. 2715(f)
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/03/2007
Violation Code: 6HV3105
Violation: NO CURRENT FINANCIAL RESPONSIBILITY
Violation Citation: Current evidence of financial responsibility not available. 25292.2(a), 25299.33; 2809
Activity: ACTIVE

Permit Number: 121141
Update Date: 11/02/2012
Inspection Date: 04/03/2007
Violation Code: 6HV3152
Violation: ALL MAINT/MONITOR RECORDS NOT AVAILABLE
Violation Citation: All maintenance/monitoring/calibration/ repair records not available. 25293; 2712 (b)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 121141 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121141
Tank Type: SINGLE WALL
Additional Id: 1
Capacity Gallons: 1000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1988-11-02 00:00:00
Year Installed: 1968-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: PRESSURE
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

UST Name: UNDERGROUND TANK 121141 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 121141
Tank Type: DOUBLE WALL
Additional Id: RT1193, RT3620, RT3997,RT5421
Capacity Gallons: 10000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: ACTIVE
Remove Close Date: Not reported
Year Installed: 1987-01-01 00:00:00
Pipe Type: DOUBLE WALL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

U003789701

Delivery System: PRESSURE
Monitor Code: 61
UST Monitor Method: DW TANK W/DRY ANNULAR, DW PRESSURE PIPE; FAILSAFE & POS SHUTOFF, 3.0 LLD; SW ABOVE GROUND PIPE & UDC W/VISUAL MONIT

SWEEPS UST:

Name: SEAFORTH SPORTFISHING
Address: 1717 QUIVIRA RD
City: SAN DIEGO
Status: Not reported
Comp Number: 21141
Number: Not reported
Board Of Equalization: 44-023449
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021141-000001
Tank Status: Not reported
Capacity: 1000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: 1

F113
West
1/8-1/4
0.159 mi.
842 ft.

SEAFORTH SPORTFISHING
1717 QUIVIRA RD
SAN DIEGO, CA 92109

LUST **S100731961**
N/A

Site 3 of 4 in cluster F

Relative:
Lower
Actual:
12 ft.

LUST REG 9:
Region: 9
Status: Case Closed
Case Number: 9UT476
Local Case: H21141-001
Substance: Gasoline
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Remove Contents
Source: Tank
Cause: Corrosion
Lead Agency: Local Agency
Case Type: Other ground water affected
Date Found: 03/26/1987
Date Stopped: 02/20/1987
Confirm Date: 02/20/1987
Submit Workplan: Not reported
Prelim Assess: 08/21/1987
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: 2/18/88
Began Monitor: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH SPORTFISHING (Continued)

S100731961

Release Date: 03/04/1987
Enforce Date: Not reported
Closed Date: 10/16/92
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: 10'
Beneficial Use: No Beneficial groundwater use
NPDES Number: Not reported
Priority: Low priority. Priority ranking can change over time.
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

F114
West
1/8-1/4
0.180 mi.
949 ft.

SEAFORTH MARINA
1677 QUIVIRA RD
SAN DIEGO, CA 92109
Site 4 of 4 in cluster F

SAN DIEGO CO. SAM
LUST
CPS-SLIC
San Diego Co. HMMD
SWEEPS UST
CHMIRS
CERS

S100728081
N/A

Relative:
Lower

Actual:
12 ft.

SAN DIEGO CO. SAM:
Name: SEAFORTH MARINA T0116
Address: 1677 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 921097801
Case Number: H10554-001
Agency: DEH Site Assessment & Mitigation
Funding: Private - VAP
Facility Type: Soils Only
Facility Status: Closed Case
Date: 7/24/1986
Date Began: 5/1/1986

LUST REG 9:

Region: 9
Status: Case Closed
Case Number: 9UT57
Local Case: H10554-001
Substance: Diesel
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Tank
Cause: Corrosion
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 04/29/1986
Date Stopped: / /
Confirm Date: / /
Submit Workplan: Not reported
Prelim Assess: / /
Desc Pollution: Not reported
Remed Plan: / /

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH MARINA (Continued)

S100728081

Remed Action: Not reported
Began Monitor: Not reported
Release Date: 05/01/1986
Enforce Date: Not reported
Closed Date: 7/24/86
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 906.30
GW Depth: 10FT
Beneficial Use: Not reported
NPDES Number: Not reported
Priority: Low priority. Priority ranking can change over time.
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

CPS-SLIC:

Name: SEAFORTH MARINA T0116
Address: 1677 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 921097801
Region: STATE
Facility Status: **Completed - Case Closed**
Status Date: 07/24/1986
Global Id: T0607302858
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H10554-001
Latitude: 32.7638379815433
Longitude: -117.236411155068
Case Type: Cleanup Program Site
Case Worker: KH
Local Agency: SAN DIEGO COUNTY LOP
RB Case Number: 9UT57
File Location: Local Agency
Potential Media Affected: Soil
Potential Contaminants of Concern: Diesel
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

HMMD SAN DIEGO:

Name: SEAFORTH MARINA T0116
Address: 1677 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 110554
Business Type: Not reported
EPA Id Number: Not reported
APN: 760-029-04-00
Last HMMD Inspection: Not reported
Facility Telephone: Not reported
Permit Status: INAC
Permit Expiration: 11/30/2002
Date Last Updated: 11/02/2012
Facility Owner: SEAFORTH MARINA
Facility Mailing Address: 1677 QUIVERA RD
Facility Mailing City: SAN DIEGO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH MARINA (Continued)

S100728081

Facility Mailing State: CA
Facility Mailing Zip: 92109-7801
UST Owner: SEAFORTH MARINA
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 110554 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 110554
Tank Type: SINGLE WALL
Additional Id: 001
Capacity Gallons: 250
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1987-01-12 00:00:00
Year Installed: 1972-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

SWEEPS UST:

Name: SEAFORTH MARINA T0116
Address: 1677 QUIVIRA RD
City: SAN DIEGO
Status: Not reported
Comp Number: 10554
Number: Not reported
Board Of Equalization: Not reported
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-010554-000001
Tank Status: Not reported
Capacity: 250
Active Date: Not reported
Tank Use: PETROLEUM
STG: WASTE
Content: Not reported
Number Of Tanks: 1

CHMIRS:

Name: Not reported
Address: 1677 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 85021
OES Incident Number: 7-2533
OES notification: 06/26/1997
OES Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH MARINA (Continued)

S100728081

OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay, Quivira Basin
Spill Site:	Not reported
Cleanup By:	Reporting Party
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Date/Time:	Not reported
Year:	1997
Agency:	Seaforth Marina
Incident Date:	6/26/199712:00:00 AM
Admin Agency:	San Diego County Health Services Dept.
Amount:	Not reported
Contained:	Yes
Site Type:	Ship/Harbor/Port
E Date:	Not reported
Substance:	Paint thinner
Gallons:	0.000000
Unknown:	0
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH MARINA (Continued)

S100728081

#3 Vessel >= 300 Tons: Not reported
Evacs: Not reported
Injuries: Not reported
Fatales: Not reported
Comments: Not reported
Description: Boat sunk, unknown cause, no engine on board. was being restored and paint thinner got in water. Has been absorbed with pads.

CERS:

Name: SEAFORTH MARINA T0116
Address: 1677 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 921097801
Site ID: 232979
CERS ID: T0607302858
CERS Description: Cleanup Program Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker
Entity Name: KEVIN HEATON - SAN DIEGO COUNTY LOP
Entity Title: Not reported
Affiliation Address: P.O. Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

G115
West
1/4-1/2
0.259 mi.
1369 ft.

SEAFORTH SPORTFISHING
1717 QUIVIRA
SAN DIEGO, CA 92109
Site 1 of 2 in cluster G

HIST CORTESE **S104749717**
N/A

Relative:
Lower

HIST CORTESE:
edr_fname: SEAFORTH SPORTFISHING
edr_fadd1: 1717 QUIVIRA
City,State,Zip: SAN DIEGO, CA 92109
Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT476

Actual:
12 ft.

G116
West
1/4-1/2
0.303 mi.
1598 ft.

SEAFORTH MARINA
1677 QUIVIRA
SAN DIEGO, CA 92109
Site 2 of 2 in cluster G

HIST CORTESE **S104746938**
N/A

Relative:
Lower

HIST CORTESE:
edr_fname: SEAFORTH MARINA
edr_fadd1: 1677 QUIVIRA
City,State,Zip: SAN DIEGO, CA 92109
Region: CORTESE
Facility County Code: 37

Actual:
12 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SEAFORTH MARINA (Continued)

S104746938

Reg By: LTNKA
Reg Id: 9UT57

117
SE
1/4-1/2
0.312 mi.
1646 ft.

ACTIVCARE AT POINT LOMA
3423 CHANNEL WY
SAN DIEGO, CA 92110

SAN DIEGO CO. SAM
CPS-SLIC
San Diego Co. HMMD
CERS

S104748506
N/A

Relative:
Lower

SAN DIEGO CO. SAM:

Actual:
12 ft.

Name: ACTIVCARE AT POINT LOMA
Address: 3423 CHANNEL WY
City,State,Zip: SAN DIEGO, CA 921105104
Case Number: H15864-001
Agency: DEH Site Assessment & Mitigation
Funding: Private - VAP
Facility Type: Soils Only
Facility Status: Closed Case
Date: 10/22/1998
Date Began: Not reported

CPS-SLIC:

Name: ACTIVCARE AT POINT LOMA
Address: 3423 CHANNEL WY
City,State,Zip: SAN DIEGO, CA 921105104
Region: STATE
Facility Status: Completed - Case Closed
Status Date: 10/22/1998
Global Id: T0608166682
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H15864-001
Latitude: 32.756691
Longitude: -117.218358
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Soil
Potential Contaminants of Concern: Not reported
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

HMMD SAN DIEGO:

Name: ACTIVCARE AT POINT LOMA
Address: 3423 CHANNEL WY
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 115864
Business Type: Not reported
EPA Id Number: Not reported
APN: 441-184-18-00
Last HMMD Inspection: 09/08/1987
Facility Telephone: Not reported
Permit Status: INAC
Permit Expiration: Not reported
Date Last Updated: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ACTIVCARE AT POINT LOMA (Continued)

S104748506

Facility Owner: Not reported
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

CERS:

Name: ACTIVCARE AT POINT LOMA
Address: 3423 CHANNEL WY
City,State,Zip: SAN DIEGO, CA 921105104
Site ID: 191615
CERS ID: T0608166682
CERS Description: Cleanup Program Site

118
West
1/4-1/2
0.312 mi.
1650 ft.

ISLANDIA SPORTSFISHING
1551 MISSION BAY
SAN DIEGO, CA 92109

LUST **S103891830**
HIST CORTESE **N/A**

Relative:
Lower

LUST REG 9:

Actual:
12 ft.

Region: 9
Status: Preliminary site assessment underway
Case Number: 9UT3915
Local Case: H21138-001
Substance: Diesel
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Other Means
How Stopped: Other Means
Source: Unknown
Cause: Unknown
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 10/20/1998
Date Stopped: 10/20/1996
Confirm Date: / /
Submit Workplan: Not reported
Prelim Assess: 04/23/1999
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 10/20/1998
Enforce Date: Not reported
Closed Date: Not reported
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ISLANDIA SPORTSFISHING (Continued)

S103891830

GW Depth: Not reported
Beneficial Use: No Beneficial groundwater use
NPDES Number: Not reported
Priority: 2B
File Disp: Administratively opened on database, however no file physically exists
Interim Remedial Actions: Not reported
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

HIST CORTESE:

edr_fname: ISLANDIA SPORTSFISHING
edr_fadd1: 1551 MISSION BAY
City,State,Zip: SAN DIEGO, CA 92109
Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT3915

119
ESE
1/4-1/2
0.317 mi.
1672 ft.

Relative:
Lower

Actual:
12 ft.

BENTON ROOFING
3691 HANCOCK ST
SAN DIEGO, CA 92110

LUST
SAN DIEGO CO. SAM
San Diego Co. HMD
CERS HAZ WASTE
SWEEPS UST
HIST CORTESE
SAN DIEGO CO LOP
CERS

S100726580
N/A

LUST:

Name: EBERHARD BENTON ROOFING
Address: 3691 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 921104312
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607301928
Global Id: T0607301928
Latitude: 32.7580888
Longitude: -117.2132589
Status: Completed - Case Closed
Status Date: 02/18/2000
Case Worker: LA
RB Case Number: 9UT3161
Local Agency: SAN DIEGO COUNTY LOP
File Location: Local Agency
Local Case Number: H04267-001
Potential Media Affect: Soil
Potential Contaminants of Concern: Diesel
Site History: Not reported

LUST:

Global Id: T0607301928
Contact Type: Local Agency Caseworker
Contact Name: LAURIE APECECHEA
Organization Name: SAN DIEGO COUNTY LOP
Address: P.O. Box 129261
City: San Diego
Email: laurie.apecechea@sdcounty.ca.gov
Phone Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

LUST:

Global Id:	T0607301928
Action Type:	Other
Date:	05/06/1996
Action:	Leak Began
Global Id:	T0607301928
Action Type:	Other
Date:	05/06/1996
Action:	Leak Discovery
Global Id:	T0607301928
Action Type:	Other
Date:	05/06/1999
Action:	Leak Stopped
Global Id:	T0607301928
Action Type:	Other
Date:	05/06/1996
Action:	Leak Reported
Global Id:	T0607301928
Action Type:	ENFORCEMENT
Date:	02/18/2000
Action:	Closure/No Further Action Letter

LUST:

Global Id:	T0607301928
Status:	Open - Case Begin Date
Status Date:	05/06/1996
Global Id:	T0607301928
Status:	Completed - Case Closed
Status Date:	02/18/2000

LUST REG 9:

Region:	9
Status:	Case Closed
Case Number:	9UT3161
Local Case:	H04267-001
Substance:	Diesel
Qty Leaked:	0
Abate Method:	Not reported
Local Agency:	San Diego
How Found:	Not reported
How Stopped:	Not reported
Source:	Not reported
Cause:	Not reported
Lead Agency:	Local Agency
Case Type:	Other ground water affected
Date Found:	05/06/1996
Date Stopped:	/ /
Confirm Date:	/ /
Submit Workplan:	5/16/96
Prelim Assess:	05/21/1996

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 05/21/1996
Enforce Date: Not reported
Closed Date: 2/18/00
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: Not reported
Beneficial Use: No Beneficial groundwater use
NPDES Number: Not reported
Priority: Medium priority
File Disp: Administratively opened on database, however no file physically exists
Interim Remedial Actions: Not reported
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

SAN DIEGO CO. SAM:

Name: EBERHARD BENTON ROOFING
Address: 3691 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 921104312
Case Number: H04267-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: Soils Only
Facility Status: Closed Case
Date: 2/18/2000
Date Began: 5/6/1996

HMMD SAN DIEGO:

Name: EBERHARD BENTON ROOFING
Address: 3691 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 104267
Business Type: 6HK70
EPA Id Number: CAL000056697
APN: 441-590-04-00
Last HMMD Inspection: 12/20/2011
Facility Telephone: 619-291-6340
Permit Status: OPEN
Permit Expiration: 04/30/2013
Date Last Updated: 11/02/2012
Facility Owner: EBERHARD BENTON ROOFING
Facility Mailing Address: 3691 HANCOCK ST
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92110-4312
UST Owner: EVANS , LARRY AND IRENE
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Inventory Active Permits (not SQG Medical):

Permit Number: 104267
Update Date: 11/02/2012
Case Number: MIXTURE
Name: 4,4, DIPHENYLMETHANE DIISOCYANATE
Other Information: (MDI), 50%: ISOFOAM SS-1570A
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 104267
Update Date: 11/02/2012
Case Number: MIXTURE
Name: AQUEOUS ACRYLIC EMULSION, 42%: DIATHON PEARLWHITE PAINT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 104267
Update Date: 11/02/2012
Case Number: MIXTURE
Name: CALCIUM CARBONATE, 47%: DIATHON BASECOAT GRAY
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 104267
Update Date: 11/02/2012
Case Number: MIXTURE
Name: DICHLOROFOROETHANE (HCFC-144#), 15%: ISOFOAM SS-1570-3.0B
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 104267
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN, O2, 99%, COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 104267
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 104267
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Case Number: Not reported
Name: WASTE 132 AQUEOUS SOL'N WITH METALS
Other Information: SPENT COOLANT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 104267
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 104267
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: WASTE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 104267
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY ABSORBENT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 104267
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: DRAINED USED OIL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)

Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Violation Code: 6HV0238
Violation: FAILED TO MANAGE UW IN A MANNER TO PREVE
Violation Citation: Failed to manage UW in a manner to prevent release(s) to the
environment. 66273.33 & 66273.33.5
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011
Violation Code: 6HV1013
Violation: HMBP NOT AVAILABLE FOR REVIEW
Violation Citation: Copy of HMBP not onsite for inspector's review. 25505(e)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011
Violation Code: 6HV0216
Violation: HAZMATs WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days &
are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011
Violation Code: 6HV0228
Violation: CONTAINER NOT KEPT CLOSED
Violation Citation: Failed to keep container closed. CFR 265.173
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel
filters. 25250.22 and 66266.130(c)(3)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011
Violation Code: 6HV0407
Violation: EMPLOYEE TRAINING NOT ADEQUATE
Violation Citation: Employee training program for small quantity generator of hazardous
waste is inadequate. CFR 262.34(d)(5)(iii)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 12/20/2011
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank.
66262.34(f)
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 12/12/2006
Violation Code: 6HV0226
Violation: HW NOT ACCUMULATED IN TANK/CONTAINER
Violation Citation: Did not accumulate waste in container or tank. 66262.34 (d)(2)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 12/12/2006
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR 262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Violation Code: 6HV0224
Violation: MISMANAGED EMPTY CONTAINERS >5GALS.
Violation Citation: Failed to mark date on empty container larger than 5 gallons and/or manage it within one year. 66261.7(e) & (f).
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0407
Violation: EMPLOYEE TRAINING NOT ADEQUATE
Violation Citation: Employee training program for small quantity generator of hazardous waste is inadequate. CFR 262.34(d)(5)(iii)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 104267 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 104267
Tank Type: SINGLE WALL
Additional Id: AT3860
Capacity Gallons: 500
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1997-07-23 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 104267 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 104267
Tank Type: SINGLE WALL
Additional Id: AT3860
Capacity Gallons: 500
UST Contents: LEADED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Other Content Info: LEADED
Reg Status: REMOVED
Remove Close Date: 1997-07-23 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 104267 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 104267
Tank Type: SINGLE WALL
Additional Id: AT3860
Capacity Gallons: 500
UST Contents: PREMIUM UNLEADED
Other Content Info: PREMIUM UNLEADED
Reg Status: REMOVED
Remove Close Date: 1997-07-23 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 104267 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 104267
Tank Type: SINGLE WALL
Additional Id: AT3860
Capacity Gallons: 500
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1997-07-23 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

Name: EBERHARD BENTON ROOFING
Address: 3691 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 104267
Business Type: 6HK70
EPA Id Number: CAL000056697
APN: 441-590-04-00
Last HMD Inspection: 12/20/2011
Facility Telephone: 619-291-6340
Permit Status: OPEN
Permit Expiration: 04/30/2013
Date Last Updated: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Facility Owner: EBERHARD BENTON ROOFING
Facility Mailing Address: 3691 HANCOCK ST
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92110-4312
UST Owner: EVANS , LARRY AND IRENE
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 104267
Update Date: 11/02/2012
Case Number: MIXTURE
Name: 4,4, DIPHENYLMETHANE DIISOCYANATE
Other Information: (MDI), 50%: ISOFOAM SS-1570A
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 104267
Update Date: 11/02/2012
Case Number: MIXTURE
Name: AQUEOUS ACRYLIC EMULSION, 42%: DIATHON PEARLWHITE PAINT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 104267
Update Date: 11/02/2012
Case Number: MIXTURE
Name: CALCIUM CARBONATE, 47%: DIATHON BASECOAT GRAY
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 104267
Update Date: 11/02/2012
Case Number: MIXTURE
Name: DICHLOROFLOUROETHANE (HCFC-144#), 15%: ISOFOAM SS-1570-3.0B
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 104267
Update Date: 11/02/2012
Case Number: 7782-44-7
Name: OXYGEN, O2, 99%, COMPRESSED GAS
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Permit Number: 104267
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Permit Number: 104267
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 132 AQUEOUS SOL'N WITH METALS
Other Information: SPENT COOLANT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 104267
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 104267
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: WASTE OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 104267
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY ABSORBENT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 104267
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: DRAINED USED OIL FILTERS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 104267
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Inspection Date: 08/02/2011
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011
Violation Code: 6HV0238
Violation: FAILED TO MANAGE UW IN A MANNER TO PREVE
Violation Citation: Failed to manage UW in a manner to prevent release(s) to the environment. 66273.33 & 66273.33.5
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011
Violation Code: 6HV1013
Violation: HMBP NOT AVAILABLE FOR REVIEW
Violation Citation: Copy of HMBP not onsite for inspector's review. 25505(e)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011
Violation Code: 6HV0228
Violation: CONTAINER NOT KEPT CLOSED
Violation Citation: Failed to keep container closed. CFR 265.173
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel filters. 25250.22 and 66266.130(c)(3)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 08/02/2011
Violation Code: 6HV0407
Violation: EMPLOYEE TRAINING NOT ADEQUATE
Violation Citation: Employee training program for small quantity generator of hazardous

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

waste is inadequate. CFR 262.34(d)(5)(iii)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 12/20/2011
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 12/12/2006
Violation Code: 6HV0226
Violation: HW NOT ACCUMULATED IN TANK/CONTAINER
Violation Citation: Did not accumulate waste in container or tank. 66262.34 (d)(2)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 12/12/2006
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0225
Violation: ACCUMULATED HW>180 OR >270 DAYS
Violation Citation: Accumulated waste too long (>180 or 270 days). 66262.34(d), CFR 262.34(e)&(f), &/or 25201(a) [>90 days for AHW waste]
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0216
Violation: HAZMATS WITHOUT PROPER LABELS
Violation Citation: Hazardous materials have not been adequately labeled within 10 days & are now declared hazardous waste. HSC 25124(b)(3)(A) & 66262.34(f)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0224
Violation: MISMANAGED EMPTY CONTAINERS >5GALS.
Violation Citation: Failed to mark date on empty container larger than 5 gallons and/or manage it within one year. 66261.7(e) & (f).
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0229
Violation: HW CONTAINERS NOT INSPECTED WEEKLY
Violation Citation: Failed to conduct weekly inspections. CFR 265.174
Activity: ACTIVE

Permit Number: 104267
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0407
Violation: EMPLOYEE TRAINING NOT ADEQUATE
Violation Citation: Employee training program for small quantity generator of hazardous waste is inadequate. CFR 262.34(d)(5)(iii)
Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 104267 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 104267
Tank Type: SINGLE WALL
Additional Id: AT3860
Capacity Gallons: 500
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1997-07-23 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: SINGLE WALL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 104267 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 104267
Tank Type: SINGLE WALL
Additional Id: AT3860
Capacity Gallons: 500
UST Contents: LEADED
Other Content Info: LEADED
Reg Status: REMOVED
Remove Close Date: 1997-07-23 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 104267 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 104267
Tank Type: SINGLE WALL
Additional Id: AT3860
Capacity Gallons: 500
UST Contents: PREMIUM UNLEADED
Other Content Info: PREMIUM UNLEADED
Reg Status: REMOVED
Remove Close Date: 1997-07-23 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 104267 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 104267
Tank Type: SINGLE WALL
Additional Id: AT3860
Capacity Gallons: 500
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1997-07-23 00:00:00
Year Installed: 1978-01-01 00:00:00
Pipe Type: SINGLE WALL
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Name: EBERHARD BENTON ROOFING
Address: 3691 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000056697
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 619-291-6340
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 04/25/2018
Facility Owner: Not reported
Facility Mailing Address: 3691 HANCOCK ST, SAN DIEGO, CA 92110-4312
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:
Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104267
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4087148
Return To Compliance Date: 2017-01-23T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-15T03:31:48.000
Inspection Date: 2015-04-07T00:00:00.000
Violation Code: 3010002 Failure to obtain and/or maintain an Active EPA ID.; 22 CCR 12 66262.12.

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104267
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4087148
Return To Compliance Date: 2017-01-31T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-15T03:31:48.000
Inspection Date: 2015-04-07T00:00:00.000
Violation Code: 3030010 Failure to dispose of hazardous waste within 180 days (or 270

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

if waste is transported over 200 miles) for the generator who generates less than 1000 kilogram per month, but more than 100 kilograms per month.; 22 CCR 12 66262.34(d).

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104267
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 4087148
Return To Compliance Date: 2017-02-07T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-15T03:31:48.000
Inspection Date: 2015-04-07T00:00:00.000
Violation Code: 1010006 Failure to update hazardous material inventory within 30 days when one of the following occurs: A 100 percent or more increase in the quantity of a previously disclosed material; Any handling of a previously undisclosed hazardous materials; A change of business address, business ownership, or business name; HSC 6.95 25508.1(a)/(b)/(c)/(d)/(e).

UST DTL:

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104267
Facility Type (Ust Facility): Not reported
Tank Owner Name: EBERHARD BENTON ROOFING
Tankid: 18103
Tank Status: Removed
Date Ust Permanently Closed: 07/23/1997
Tank Use: 01
Piping System Type: Not reported
Last Updated: 2019-04-16T02:31:03.000
Tank Capacityin Gallons: 500
Tank Contents: 1A
Type Of Tank: 01

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104267
Facility Type (Ust Facility): Not reported
Tank Owner Name: EBERHARD BENTON ROOFING
Tankid: 18104
Tank Status: Removed
Date Ust Permanently Closed: 07/23/1997
Tank Use: 01
Piping System Type: Not reported
Last Updated: 2019-04-16T02:31:03.000
Tank Capacityin Gallons: 500
Tank Contents: 02
Type Of Tank: 01

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104267
Facility Type (Ust Facility): Not reported
Tank Owner Name: EBERHARD BENTON ROOFING
Tankid: 18106
Tank Status: Removed
Date Ust Permanently Closed: 07/23/1997
Tank Use: 01
Piping System Type: Not reported
Last Updated: 2019-04-16T02:31:03.000
Tank Capacityin Gallons: 500
Tank Contents: Diesel
Type Of Tank: 01

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-104267
Facility Type (Ust Facility): Not reported
Tank Owner Name: EBERHARD BENTON ROOFING
Tankid: 18105
Tank Status: Removed
Date Ust Permanently Closed: 07/23/1997
Tank Use: 01
Piping System Type: Not reported
Last Updated: 2019-04-16T02:31:03.000
Tank Capacityin Gallons: 500
Tank Contents: 1B
Type Of Tank: 01

Waste and Materials:

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0129463
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-04-16T02:31:03.000
Chemical Name: DICHLOROFLOUROETHANE (HCFC-144#), 15%: ISOFOAM SS-1570-3.0B
Common Name: POLYURATHANE FOAM "B" COMPONENT
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0129464
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-04-16T02:31:03.000
Chemical Name: Ethine
Common Name: Acetylene
Case Number: 74-86-2

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Active Permit: Y
Child Record Id: DEH2017-HCHEM-0129465
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-04-16T02:31:03.000
Chemical Name: Not reported
Common Name: diathon topcoat
Case Number: Not reported

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107892
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-04-16T02:31:03.000
Chemical Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Common Name: OILY ABSORBENT
Case Number: Not reported

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107893
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-04-16T02:31:03.000
Chemical Name: WASTE 221 WASTE OIL & MIXED OIL
Common Name: WASTE OIL
Case Number: Not reported

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0107894
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2019-04-16T02:31:03.000
Chemical Name: Ethylene Glycol
Common Name: anti-freeze
Case Number: Not reported

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0129460
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-04-16T02:31:03.000
Chemical Name: 4,4, DIPHENYLMETHANE DIISOCYANATE
Common Name: POLYURATHANE FOAM "A" COMPONENT
Case Number: MIXTURE

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0129461

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-04-16T02:31:03.000
Chemical Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Common Name: PROPANE, LIQUIFIED PETROLEUM COMPRESSED GAS:
Case Number: 74-98-6

Record ID: DEH2002-HUPFP-104267
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0129462
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-04-16T02:31:03.000
Chemical Name: OXYGEN, O2, 99%, COMPRESSED GAS
Common Name: OXYGEN, O2, 99%, COMPRESSED GAS
Case Number: 7782-44-7

CERS HAZ WASTE:

Name: EBERHARD BENTON ROOFING
Address: 3691 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 92110
Site ID: 391971
CERS ID: 10383940
CERS Description: Hazardous Waste Generator

SWEEPS UST:

Name: BENTON ROOF COMPANY INC
Address: 3691 HANCOCK ST
City: SAN DIEGO
Status: Active
Comp Number: 4267
Number: 9
Board Of Equalization: 44-022017
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-004267-000001
Tank Status: A
Capacity: 500
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: REG UNLEADED
Number Of Tanks: 4

Name: BENTON ROOF COMPANY INC
Address: 3691 HANCOCK ST
City: SAN DIEGO
Status: Active
Comp Number: 4267
Number: 9
Board Of Equalization: 44-022017
Referral Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-004267-000002
Tank Status: A
Capacity: 500
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: LEADED
Number Of Tanks: Not reported

Name: BENTON ROOF COMPANY INC
Address: 3691 HANCOCK ST
City: SAN DIEGO
Status: Active
Comp Number: 4267
Number: 9
Board Of Equalization: 44-022017
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-004267-000003
Tank Status: A
Capacity: 500
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: LEADED
Number Of Tanks: Not reported

Name: BENTON ROOF COMPANY INC
Address: 3691 HANCOCK ST
City: SAN DIEGO
Status: Active
Comp Number: 4267
Number: 9
Board Of Equalization: 44-022017
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-004267-000004
Tank Status: A
Capacity: 500
Active Date: Not reported
Tank Use: M.V. FUEL
STG: P
Content: OTHER
Number Of Tanks: Not reported

HIST CORTESE:
edr_fname: BENTON ROOFING
edr_fadd1: 3691 HANCOCK
City,State,Zip: SAN DIEGO, CA 92110
Region: CORTESE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT3161

SAN DIEGO CO LOP:

Name: EBERHARD BENTON ROOFING
Address: 3691 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 92110
Record ID: DEH1996-LSAM-H04267-001
Record Status: Completed
Opened Date: 05/06/1996
Parcel Number: 441-590-04-00
Case Type: LOP - Local Oversight Program
Historical Name: BENTON ROOFING
SWRCB Global ID: T0607301928
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 05/16/1996
Census Tract: 65.00
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Latitude: 32.7554082
Longitude: -117.2124650
X MapCoord: 6265417.409
Y MapCoord: 1856122.645

CERS:

Name: EBERHARD BENTON ROOFING
Address: 3691 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 921104312
Site ID: 201183
CERS ID: T0607301928
CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker
Entity Name: LAURIE APECECHEA - SAN DIEGO COUNTY LOP
Entity Title: Not reported
Affiliation Address: P.O. Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Name: EBERHARD BENTON ROOFING
Address: 3691 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 92110
Site ID: 391971
CERS ID: 10383940
CERS Description: Chemical Storage Facilities

Violations:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Site ID: 391971
Site Name: EBERHARD BENTON ROOFING
Violation Date: 04-07-2015
Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.12
Violation Description: Failure to obtain and/or maintain an Active EPA ID.
Violation Notes: Returned to compliance on 01/23/2017.
Violation Division: San Diego County Department of Env Health
Violation Program: HW
Violation Source: CERS

Site ID: 391971
Site Name: EBERHARD BENTON ROOFING
Violation Date: 04-07-2015
Citation: 22 CCR 12 66262.34(d) - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.34(d)
Violation Description: Failure to dispose of hazardous waste within 180 days (or 270 if waste is transported over 200 miles) for the generator who generates less than 1000 kilogram per month, but more than 100 kilograms per month.
Violation Notes: Returned to compliance on 01/31/2017.
Violation Division: San Diego County Department of Env Health
Violation Program: HW
Violation Source: CERS

Site ID: 391971
Site Name: EBERHARD BENTON ROOFING
Violation Date: 04-07-2015
Citation: HSC 6.95 25508.1(a)-(e) - California Health and Safety Code, Chapter 6.95, Section(s) 25508.1(a)-(e)
Violation Description: Failure to electronically update business plan within 30 days of any one of the following events: A 100 percent or more increase in the quantity of a previously disclosed material. Any handling of a previously undisclosed hazardous materials at or above reportable quantities. A change of business address, business ownership, or business name.
Violation Notes: Returned to compliance on 02/07/2017.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Evaluation:
Eval General Type: Compliance Evaluation Inspection
Eval Date: 03-20-2017
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Burke Mike Inspection ID:5645964
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 03-20-2017
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Burke Mike Inspection ID:5645964
Eval Division: San Diego County Department of Env Health
Eval Program: HW

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-07-2015
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: McLernon Benjamin Inspection ID:4087148
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-07-2015
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: McLernon Benjamin Inspection ID:4087148
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 05-14-2019
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Burke Mike Inspection ID:6133019
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 05-14-2019
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Burke Mike Inspection ID:6133019
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Coordinates:
Site ID: 391971
Facility Name: EBERHARD BENTON ROOFING
Env Int Type Code: HMBP
Program ID: 10383940
Coord Name: Not reported
Ref Point Type Desc: Center of a facility or station.
Latitude: 32.758210
Longitude: -117.210760

Affiliation:
Affiliation Type Desc: Document Preparer
Entity Name: Sergio Duron - Safety Officer
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Environmental Contact
Entity Name: Sergio Duron
Entity Title: Not reported
Affiliation Address: 3691 Hancock St.
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110-4312
Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 3691 HANCOCK ST
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110-4312
Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer
Entity Name: Tiffany Suwa
Entity Title: President / CEO
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner
Entity Name: Tiffany Suwa
Entity Title: Not reported
Affiliation Address: 3691 Hancock St.
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92110-4312
Affiliation Phone: (619) 719-8131

Affiliation Type Desc: CUPA District
Entity Name: San Diego County Env Health
Entity Title: Not reported
Affiliation Address: PO Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92112-9261
Affiliation Phone: (858) 505-6880

Affiliation Type Desc: Operator
Entity Name: EBERHARD BENTON ROOFING
Entity Title: Not reported
Affiliation Address: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BENTON ROOFING (Continued)

S100726580

Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 291-6340

Affiliation Type Desc: Parent Corporation
Entity Name: EBERHARD BENTON ROOFING
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

120
ESE
1/4-1/2
0.338 mi.
1783 ft.

Relative:
Lower

Actual:
12 ft.

BUTLER, LYLE
3612 KURTZ ST
SAN DIEGO, CA 92106

SAN DIEGO CO. SAM:

Name: SHOREBREAK
Address: 3612 KURTZ ST
City,State,Zip: SAN DIEGO, CA 921104432
Case Number: H21154-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: Drinking Water Aquifer Impacted
Facility Status: Closed Case
Date: 2/12/1998
Date Began: 9/26/1989

Name: SHOREBREAK
Address: 3612 KURTZ ST
City,State,Zip: SAN DIEGO, CA 921104432
Case Number: H21154-002
Agency: DEH Site Assessment & Mitigation
Funding: Private - VAP
Facility Type: Complaint
Facility Status: Closed Case
Date: 2/12/1998
Date Began: 6/30/1992

LUST:

Name: SHOREBREAK
Address: 3612 KURTZ ST
City,State,Zip: SAN DIEGO, CA 921104432
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607300339
Global Id: T0607300339
Latitude: 32.757529

SAN DIEGO CO. SAM
LUST
CPS-SLIC
San Diego Co. HMMD
HIST CORTESE
SAN DIEGO CO LOP
CERS

S101302057
N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUTLER, LYLE (Continued)

S101302057

Longitude: -117.211675
Status: Completed - Case Closed
Status Date: 02/12/1998
Case Worker: Not reported
RB Case Number: 9UT1519
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H21154-001
Potential Media Affect: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

LUST:

Global Id: T0607300339
Action Type: ENFORCEMENT
Date: 01/13/1998
Action: Closure/No Further Action Letter - #H21154-001

Global Id: T0607300339
Action Type: ENFORCEMENT
Date: 09/28/1989
Action: Notice of Responsibility

Global Id: T0607300339
Action Type: ENFORCEMENT
Date: 02/10/1998
Action: Closure/No Further Action Letter

LUST:

Global Id: T0607300339
Status: Open - Case Begin Date
Status Date: 09/26/1989

Global Id: T0607300339
Status: Completed - Case Closed
Status Date: 02/12/1998

LUST REG 9:

Region: 9
Status: Case Closed
Case Number: 9UT1519
Local Case: H21154-001
Substance: Gasoline
Qty Leaked: Not reported
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Tank
Cause: Corrosion
Lead Agency: Local Agency
Case Type: Other ground water affected
Date Found: 09/26/1989
Date Stopped: 09/26/1989
Confirm Date: 09/26/1989
Submit Workplan: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUTLER, LYLE (Continued)

S101302057

Prelim Assess: 05/09/1990
Desc Pollution: Not reported
Remed Plan: 09/01/1992
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 09/26/1989
Enforce Date: Not reported
Closed Date: 2/12/98
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: 4.7'
Beneficial Use: NBNISWOC
NPDES Number: Not reported
Priority: 2A
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

CPS-SLIC:

Name: SHOREBREAK
Address: 3612 KURTZ ST
City,State,Zip: SAN DIEGO, CA 921104432
Region: STATE
Facility Status: Completed - Case Closed
Status Date: 02/12/1998
Global Id: T0608198857
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H21154-002
Latitude: 32.757581
Longitude: -117.211626
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Under Investigation
Potential Contaminants of Concern: * Chlorinated Hydrocarbons
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

HMMD SAN DIEGO:

Name: ANDERSON NEWS COMPANY
Address: 3612 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 103570
Business Type: 6HK18
EPA Id Number: Not reported
APN: 441-340-03-01
Last HMMD Inspection: 03/22/2004
Facility Telephone: 619-497-1331
Permit Status: CHNG
Permit Expiration: 05/31/2007
Date Last Updated: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUTLER, LYLE (Continued)

S101302057

Facility Owner: ANDERSON NEWS COMPANY
Facility Mailing Address: 2590 LINDSEY PRIVADO
Facility Mailing City: ONTARIO
Facility Mailing State: CA
Facility Mailing Zip: 91761-
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Name: SOURCE INTERLINK DISTRIBUTION LLC
Address: 3612 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 207637
Business Type: 6HK18
EPA Id Number: Not reported
APN: 441-340-03-01
Last HMMD Inspection: 02/03/2009
Facility Telephone: 619-497-1331
Permit Status: OPEN
Permit Expiration: 05/31/2013
Date Last Updated: 11/02/2012
Facility Owner: SOURCE INTERLINK
Facility Mailing Address: 27500 RIVER VIEW CENTER BL
Facility Mailing City: BONITA SPRINGS
Facility Mailing State: FL
Facility Mailing Zip: 34134
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 207637
Update Date: 11/02/2012
Case Number: 68476-85-7
Name: PROPANE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Violations Active Permits:

Permit Number: 207637
Update Date: 11/02/2012
Inspection Date: 01/19/2007
Violation Code: 6HV1001
Violation: NO UPF PERMIT FOR HAZMATS
Violation Citation: A Unified Program Facility permit has not been obtained for hazardous materials. 68.905
Activity: ACTIVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUTLER, LYLE (Continued)

S101302057

Permit Number: 207637
Update Date: 11/02/2012
Inspection Date: 01/19/2007
Violation Code: 6HV1004
Violation: HMBP NOT SUBMITTED TO HMD
Violation Citation: Hazardous Materials Handler has not submitted a completed Business Plan to the HMMD. HSC 25505(a)
Activity: ACTIVE

HIST CORTESE:

edr_fname: BUTLER, LYLE
edr_fadd1: 3612 KURTZ
City,State,Zip: SAN DIEGO, CA 92106
Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT1519

SAN DIEGO CO LOP:

Name: SHOREBREAK
Address: 3612 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110-4432
Record ID: DEH1989-LSAM-H21154-001
Record Status: Completed
Opened Date: 09/26/1989
Parcel Number: 441-340-03-01
Case Type: LOP - Local Oversight Program
Historical Name: SHOREBREAK-BUTLER PROPERTIES
SWRCB Global ID: T0607300339
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 09/26/1989
Census Tract: 65.00
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Latitude: 32.7575278
Longitude: -117.2116757
X MapCoord: 6266026.882
Y MapCoord: 1856787.044

CERS:

Name: SHOREBREAK
Address: 3612 KURTZ ST
City,State,Zip: SAN DIEGO, CA 921104432
Site ID: 217403
CERS ID: T0608198857
CERS Description: Cleanup Program Site

Name: SHOREBREAK
Address: 3612 KURTZ ST
City,State,Zip: SAN DIEGO, CA 921104432
Site ID: 217403

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUTLER, LYLE (Continued)

S101302057

CERS ID: T0607300339
CERS Description: Leaking Underground Storage Tank Cleanup Site

**H121
ESE
1/4-1/2
0.358 mi.
1891 ft.**

**WRIGHT SURF REPAIR
3630 HANCOCK ST
SAN DIEGO, CA 92110

Site 1 of 2 in cluster H**

**ENVIROSTOR
San Diego Co. HMMD
CERS HAZ WASTE
NPDES
CERS**

**S110498157
N/A**

**Relative:
Lower**

ENVIROSTOR:
Name: SACKETT & PENDLEBURY BOAT BUILDERS
Address: 3630 HANCOCK ST.
City,State,Zip: SAN DIEGO, CA 92110
Facility ID: 37370122
Status: Refer: Other Agency
Status Date: 08/21/1995
Site Code: Not reported
Site Type: Historical
Site Type Detailed: * Historical
Acres: Not reported
NPL: NO
Regulatory Agencies: NONE SPECIFIED
Lead Agency: NONE SPECIFIED
Program Manager: Not reported
Supervisor: * Mmonroy
Division Branch: Cleanup Cypress
Assembly: 78
Senate: 39
Special Program: Not reported
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: Not reported
Latitude: 32.75824
Longitude: -117.2097
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: NONE SPECIFIED
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: HANGER PROPERTY
Alias Type: Alternate Name
Alias Name: CAD982360190
Alias Type: EPA Identification Number
Alias Name: 37370122
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * Discovery
Completed Date: 03/25/1983
Comments: FACILITY IDENTIFIED ID VIA DRIVEBY

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 10/28/1994
Comments: CalSites Validation Program confirms NFA for DTSC.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WRIGHT SURF REPAIR (Continued)

S110498157

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 02/08/1991
Comments: The PA Report was reviewed by Region 4 staff. The property was purchased in the '70s by Wilber & Betty Hanger. In 1980 they built a commercial building with 4 small warehouses for rent. From 1980 to 1983, Sackett & Pendlebury Boat Builders rented office space. The boat building was done accross the street at Clark Custom Boats. No evidence of any handling of hazardous substances at the site. Staff recommends NFA.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 06/22/1987
Comments: SITE SCREENING DONE NEED MORE INFO ON STORAGE AND DISPOSAL

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

HMMD SAN DIEGO:

Name: WRIGHT SURF REPAIR
Address: 3630 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAL000334254
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 361-815-4326
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 04/30/2018
Facility Owner: Not reported
Facility Mailing Address: 3630 Hancock St Ste D, San Diego, CA 92110
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:
Record ID: DEH2008-HUPFP-209403
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WRIGHT SURF REPAIR (Continued)

S110498157

Active Permit: Y
Facility Id Number: 37-000-209403
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 5613420
Return To Compliance Date: 2017-03-06T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-01T00:00:00.000
Inspection Date: 2017-02-28T14:29:00.000
Violation Code: 3010010 Failed to maintain uniform hazardous waste manifest, consolidated manifest, or bills of lading copies for 3 years. HSC 25160.2(b)(3), 25185(a)(4); 22 CCR 66262.40(a)

Record ID: DEH2008-HUPFP-209403
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-209403
Program Element: Hazardous Waste Generator
Inspection Type: Initial Inspection
Inspection Number: 5673312
Return To Compliance Date: Not reported
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-01T00:00:00.000
Inspection Date: 2017-03-06T15:27:03.000
Violation Code: 3010002 Failed to obtain and/or maintain an active EPA ID. 22 CCR 66262.12

Record ID: DEH2008-HUPFP-209403
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-209403
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 4095148
Return To Compliance Date: 2015-03-24T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-01T00:00:00.000
Inspection Date: 2015-02-24T00:00:00.000
Violation Code: 1010003 Owner/Operator failed to complete and/or submit the Business Activities Page and/or Business Owner Operator Identification Page; 19 CCR 4 2729.2(a)(1).

Record ID: DEH2008-HUPFP-209403
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-209403
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WRIGHT SURF REPAIR (Continued)

S110498157

Inspection Number: 4095148
Return To Compliance Date: 2015-03-24T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-05-01T00:00:00.000
Inspection Date: 2015-02-24T00:00:00.000
Violation Code: 1010001 Owner/Operator failed to establish and implement a Hazardous Materials Business Plan when storing hazardous materials at or above the thresholds quantities of 55 gallons/500 lbs/200 cubic feet; HSC 6.95 25507(a).

Waste and Materials:

Record ID: DEH2008-HUPFP-209403
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HWAST-0111770
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-04-30T02:30:14.000
Chemical Name: Waste Acetone/ Resin
Common Name: Waste Acetone/ Resin
Case Number: Not reported

Name: PLUS ONE SURFBOARDS
Address: 3630 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 209403
Business Type: 6HK77
EPA Id Number: CAL000334254
APN: 441-530-35-00
Last HMMD Inspection: 07/07/2010
Facility Telephone: 619-291-7873
Permit Status: OPEN
Permit Expiration: 11/30/2013
Date Last Updated: 11/02/2012
Facility Owner: JOE VIRGILIO
Facility Mailing Address: 3630 HANCOCK ST # D
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92110
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 209403
Update Date: 11/02/2012
Case Number: 67-63-0
Name: RESIN SOLUTION
Other Information: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WRIGHT SURF REPAIR (Continued)

S110498157

Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 209403
Update Date: 11/02/2012
Case Number: 67-64-1
Name: WASTE 212 OXYGENATED SOLVENTS
Other Information: ACETONE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV1001
Violation: NO UPF PERMIT FOR HAZMATS
Violation Citation: A Unified Program Facility permit has not been obtained for hazardous materials. 68.905
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV1002
Violation: HMBP NOT ESTABLISHED/IMPLEMENTED.
Violation Citation: Hazardous materials handler has not established/implemented a business plan. HSC 25503.5(a)
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV1004
Violation: HMBP NOT SUBMITTED TO HMD
Violation Citation: Hazardous Materials Handler has not submitted a completed Business

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WRIGHT SURF REPAIR (Continued)

S110498157

Activity: Plan to the HMMD. HSC 25505(a)
ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0132
Violation: EPA ID NUMBER NOT OBTAINED/MAINTAINED
Violation Citation: Generator of hazardous waste has not obtained/maintained an EPA
identification number. CCR 66262.12(a)
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0228
Violation: CONTAINER NOT KEPT CLOSED
Violation Citation: Failed to keep container closed. CFR 265.173
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0407
Violation: EMPLOYEE TRAINING NOT ADEQUATE
Violation Citation: Employee training program for small quantity generator of hazardous
waste is inadequate. CFR 262.34(d)(5)(iii)
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0408
Violation: FAILED TO POST ER PLAN BY PHONE
Violation Citation: Small quantity generator of hazardous waste failed to post emergency
response plan by phone. CFR 262.34(d)(5)(ii)
Activity: ACTIVE

Name: PLUS ONE SURFBOARDS
Address: 3630 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 209403
Business Type: 6HK77
EPA Id Number: CAL000334254
APN: 441-530-35-00
Last HMMD Inspection: 07/07/2010
Facility Telephone: 619-291-7873
Permit Status: OPEN
Permit Expiration: 11/30/2013
Date Last Updated: 11/02/2012
Facility Owner: JOE VIRGILIO
Facility Mailing Address: 3630 HANCOCK ST # D
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92110
UST Owner: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WRIGHT SURF REPAIR (Continued)

S110498157

Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 209403
Update Date: 11/02/2012
Case Number: 67-63-0
Name: RESIN SOLUTION
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: CHRONIC

Permit Number: 209403
Update Date: 11/02/2012
Case Number: 67-64-1
Name: WASTE 212 OXYGENATED SOLVENTS
Other Information: ACETONE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0301
Violation: HAZWASTE:UNAUTHORIZED DISPOSAL
Violation Citation: Disposal or causing the disposal of hazardous waste to an unauthorized point (ground, storm drain, sewer system, trash, or air). HSC 25189.5(a) or 25189(d)
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0304
Violation: WASTE DETERMINATION NOT MADE
Violation Citation: Generator of a waste has not determined if that waste is a hazardous waste as defined by law. CCR 66262.11 & 66260.200(c)
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV1001
Violation: NO UPF PERMIT FOR HAZMATS
Violation Citation: A Unified Program Facility permit has not been obtained for hazardous materials. 68.905
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WRIGHT SURF REPAIR (Continued)

S110498157

Inspection Date: 06/10/2008
Violation Code: 6HV1002
Violation: HMBP NOT ESTABLISHED/IMPLEMENTED.
Violation Citation: Hazardous materials handler has not established/implemented a business plan. HSC 25503.5(a)
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV1004
Violation: HMBP NOT SUBMITTED TO HMD
Violation Citation: Hazardous Materials Handler has not submitted a completed Business Plan to the HMMD. HSC 25505(a)
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0132
Violation: EPA ID NUMBER NOT OBTAINED/MAINTAINED
Violation Citation: Generator of hazardous waste has not obtained/maintained an EPA identification number. CCR 66262.12(a)
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0228
Violation: CONTAINER NOT KEPT CLOSED
Violation Citation: Failed to keep container closed. CFR 265.173
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0407
Violation: EMPLOYEE TRAINING NOT ADEQUATE
Violation Citation: Employee training program for small quantity generator of hazardous waste is inadequate. CFR 262.34(d)(5)(iii)
Activity: ACTIVE

Permit Number: 209403
Update Date: 11/02/2012
Inspection Date: 06/10/2008
Violation Code: 6HV0408
Violation: FAILED TO POST ER PLAN BY PHONE
Violation Citation: Small quantity generator of hazardous waste failed to post emergency response plan by phone. CFR 262.34(d)(5)(ii)
Activity: ACTIVE

CERS HAZ WASTE:

Name: WRIGHT SURF REPAIR
Address: 3630 HANCOCK ST STE D
City,State,Zip: SAN DIEGO, CA 92110
Site ID: 58015

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WRIGHT SURF REPAIR (Continued)

S110498157

CERS ID: 10384195
CERS Description: Hazardous Waste Generator

NPDES:

Name: PLUS ONE SURFBOARDS
Address: 3630 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 92110
Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported
Order Number: Not reported
WDID: 9 37IN601063
Regulatory Measure Type: Industrial
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Undetermined
Status Date: 05/06/2011
Operator Name: George Gall
Operator Address: 4505 Adair St
Operator City: San Diego
Operator State: California
Operator Zip: 92107

CERS:

Name: WRIGHT SURF REPAIR
Address: 3630 HANCOCK ST STE D
City,State,Zip: SAN DIEGO, CA 92110
Site ID: 58015
CERS ID: 10384195
CERS Description: Chemical Storage Facilities

Violations:

Site ID: 58015
Site Name: Wright Surf Repair
Violation Date: 03-06-2017
Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.12
Violation Description: Failure to obtain an Identification Number prior to treating, storing, disposing of, transporting or offering for transportation any hazardous waste.
Violation Notes: Returned to compliance on 06/05/2019. Inspection Sequence ID:5673312
Violation Division: San Diego County Department of Env Health
Violation Program: HW
Violation Source: CERS

Site ID: 58015

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WRIGHT SURF REPAIR (Continued)

S110498157

Site Name: Wright Surf Repair
Violation Date: 06-05-2019
Citation: 22 CCR 12 66262.12 - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.12
Violation Description: Failure to obtain an Identification Number prior to treating, storing, disposing of, transporting or offering for transportation any hazardous waste.
Violation Notes: Inspection Sequence ID:6123249
Violation Division: San Diego County Department of Env Health
Violation Program: HW
Violation Source: CERS

Site ID: 58015
Site Name: Wright Surf Repair
Violation Date: 02-28-2017
Citation: 22 CCR 12 66262.40(a) - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.40(a)
Violation Description: Failure to keep a copy of each properly signed manifest for at least three years from the date the waste was accepted by the initial transporter. The manifest signed at the time the waste was accepted for transport shall be kept until receiving a signed copy from the designated facility which received the waste.
Violation Notes: Returned to compliance on 03/06/2017.
Violation Division: San Diego County Department of Env Health
Violation Program: HW
Violation Source: CERS

Site ID: 58015
Site Name: Wright Surf Repair
Violation Date: 02-24-2015
Citation: HSC 6.95 25507 - California Health and Safety Code, Chapter 6.95, Section(s) 25507
Violation Description: Failure to adequately establish and implement a business plan when storing/handling a hazardous material at or above reportable quantities.
Violation Notes: Returned to compliance on 03/24/2015.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 58015
Site Name: Wright Surf Repair
Violation Date: 02-24-2015
Citation: 19 CCR 6.95 25508(a)(1) - California Code of Regulations, Title 19, Chapter 6.95, Section(s) 25508(a)(1)
Violation Description: Failure to complete and electronically submit the Business Activities Page and/or Business Owner Operator Identification Page.
Violation Notes: Returned to compliance on 03/24/2015.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Evaluation:
Eval General Type: Compliance Evaluation Inspection
Eval Date: 02-24-2015
Violations Found: No
Eval Type: Routine done by local agency

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WRIGHT SURF REPAIR (Continued)

S110498157

Eval Notes: Inspector: McLernon Benjamin Inspection ID:4095148
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 02-24-2015
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: McLernon Benjamin Inspection ID:4095148
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 02-28-2017
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Burke Mike Inspection ID:5613420
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 03-06-2017
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Burke Mike Inspection ID:5673312
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 06-05-2019
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Burke Mike Inspection ID:6123249
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Affiliation:
Affiliation Type Desc: Environmental Contact
Entity Name: AARON WRIGHT
Entity Title: Not reported
Affiliation Address: 3630 Hancock St Ste D
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110
Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 3630 Hancock St Ste D
Affiliation City: San Diego

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WRIGHT SURF REPAIR (Continued)

S110498157

Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110
Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer
Entity Name: Aaron Wright
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation
Entity Name: WRIGHT SURF REPAIR
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Document Preparer
Entity Name: Aaron Wright
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner
Entity Name: AARON WRIGHT
Entity Title: Not reported
Affiliation Address: 3630 Hancock St Ste D
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92110
Affiliation Phone: (361) 815-4326

Affiliation Type Desc: Operator
Entity Name: WRIGHT SURF REPAIR
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (361) 815-4326

Affiliation Type Desc: CUPA District
Entity Name: San Diego County Env Health

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WRIGHT SURF REPAIR (Continued)

S110498157

Entity Title: Not reported
Affiliation Address: PO Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92112-9261
Affiliation Phone: (858) 505-6880

**H122
ESE
1/4-1/2
0.358 mi.
1891 ft.**

**SACKETT & PENDLEBURY BOAT BUILDERS
3630 HANCOCK ST
SAN DIEGO, CA 92110
Site 2 of 2 in cluster H**

**SEMS-ARCHIVE 1003879271
CAD982360190**

**Relative:
Lower**

SEMS Archive:
Site ID: 0903101
EPA ID: CAD982360190
Cong District: 41
FIPS Code: 06073
FF: N
NPL: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

**Actual:
12 ft.**

SEMS Archive Detail:

Region: 09
Site ID: 0903101
EPA ID: CAD982360190
Site Name: SACKETT & PENDLEBURY BOAT BUILDERS
NPL: N
FF: N
OU: 00
Action Code: VS
Action Name: ARCH SITE
SEQ: 1
Start Date: Not reported
Finish Date: 1990-05-28 04:00:00
Qual: Not reported
Current Action Lead: EPA Perf In-Hse

Region: 09
Site ID: 0903101
EPA ID: CAD982360190
Site Name: SACKETT & PENDLEBURY BOAT BUILDERS
NPL: N
FF: N
OU: 00
Action Code: PA
Action Name: PA
SEQ: 1
Start Date: Not reported
Finish Date: 1990-05-28 04:00:00
Qual: N
Current Action Lead: EPA Perf

Region: 09
Site ID: 0903101
EPA ID: CAD982360190

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SACKETT & PENDLEBURY BOAT BUILDERS (Continued)

1003879271

Site Name: SACKETT & PENDLEBURY BOAT BUILDERS
NPL: N
FF: N
OU: 00
Action Code: DS
Action Name: DISCVRY
SEQ: 1
Start Date: 1987-12-01 05:00:00
Finish Date: 1987-12-01 05:00:00
Qual: Not reported
Current Action Lead: St Perf

I123
South
1/4-1/2
0.359 mi.
1896 ft.

4236 VENUS ST.
SAN DIEGO, CA 92110
Site 1 of 2 in cluster I

Notify 65 S100178274
N/A

Relative:
Lower
Actual:
9 ft.

NOTIFY 65:
Date Reported: Not reported
Staff Initials: Not reported
Board File Number: Not reported
Facility Type: Not reported
Discharge Date: Not reported
Issue Date: Not reported
Incident Description: Not reported

I124
South
1/4-1/2
0.361 mi.
1904 ft.

VENUS ST & CAMULOS ST
SAN DIEGO, CA
Site 2 of 2 in cluster I

Notify 65 S100178429
N/A

Relative:
Lower
Actual:
9 ft.

NOTIFY 65:
Date Reported: Not reported
Staff Initials: Not reported
Board File Number: Not reported
Facility Type: Not reported
Discharge Date: Not reported
Issue Date: Not reported
Incident Description: Not reported

J125
West
1/4-1/2
0.366 mi.
1930 ft.

ISLANDIA SPORTFISHING
1551 W MISSION BAY DR
SAN DIEGO, CA 92109
Site 1 of 4 in cluster J

LUST U003789700
SAN DIEGO CO. SAM N/A
UST
SWEEPS UST
SAN DIEGO CO LOP

Relative:
Lower
Actual:
12 ft.

LUST:
Name: ISLANDIA SPORTFISHING
Address: 1551 W MISSION BAY DR
City,State,Zip: SAN DIEGO, CA 921097807
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ISLANDIA SPORTFISHING (Continued)

U003789700

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607302675
Global Id: T0607302675
Latitude: 32.7645045481396
Longitude: -117.237545795241
Status: Completed - Case Closed
Status Date: 09/09/2005
Case Worker: Not reported
RB Case Number: 9UT3915
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H21138-001
Potential Media Affect: Soil
Potential Contaminants of Concern: Diesel
Site History: Not reported

LUST:

Global Id: T0607302675
Action Type: Other
Date: 10/20/1998
Action: Leak Began

Global Id: T0607302675
Action Type: Other
Date: 10/20/1998
Action: Leak Discovery

Global Id: T0607302675
Action Type: Other
Date: 10/20/1998
Action: Leak Stopped

Global Id: T0607302675
Action Type: Other
Date: 10/20/1998
Action: Leak Reported

Global Id: T0607302675
Action Type: ENFORCEMENT
Date: 09/09/2005
Action: Closure/No Further Action Letter

LUST:

Global Id: T0607302675
Status: Open - Case Begin Date
Status Date: 10/20/1998

Global Id: T0607302675
Status: Completed - Case Closed
Status Date: 09/09/2005

SAN DIEGO CO. SAM:

Name: ISLANDIA SPORTFISHING
Address: 1551 W MISSION BAY DR
City,State,Zip: SAN DIEGO, CA 921097807
Case Number: H21138-001
Agency: DEH Site Assessment & Mitigation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ISLANDIA SPORTFISHING (Continued)

U003789700

Funding:
Facility Type:
Facility Status:
Date:
Date Began:

POP
Soils Only
Closed Case
9/9/2005
10/20/1998

UST:

Name:
Address:
City,State,Zip:
Facility ID:
Permitting Agency:
Latitude:
Longitude:

ISLANDIA SPORTFISHING
1551 W MISSION BAY DR
SAN DIEGO, CA 92109
H21138
SAN DIEGO COUNTY
32.7656
-117.2387

SWEEPS UST:

Name:
Address:
City:
Status:
Comp Number:
Number:
Board Of Equalization:
Referral Date:
Action Date:
Created Date:
Owner Tank Id:
SWRCB Tank Id:
Tank Status:
Capacity:
Active Date:
Tank Use:
STG:
Content:
Number Of Tanks:

ISLANDIA SPORTFISHING
1551 W MISSION BAY DR
SAN DIEGO
Active
21138
9
44-023448
Not reported
06-26-92
02-29-88
Not reported
37-000-021138-000007
A
12000
Not reported
M.V. FUEL
P
OTHER
3

Name:
Address:
City:
Status:
Comp Number:
Number:
Board Of Equalization:
Referral Date:
Action Date:
Created Date:
Owner Tank Id:
SWRCB Tank Id:
Tank Status:
Capacity:
Active Date:
Tank Use:
STG:
Content:
Number Of Tanks:

ISLANDIA SPORTFISHING
1551 W MISSION BAY DR
SAN DIEGO
Active
21138
9
44-023448
Not reported
06-26-92
02-29-88
Not reported
37-000-021138-000008
A
10000
Not reported
M.V. FUEL
P
LEADED
Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ISLANDIA SPORTFISHING (Continued)

U003789700

Name: ISLANDIA SPORTFISHING
Address: 1551 W MISSION BAY DR
City: SAN DIEGO
Status: Active
Comp Number: 21138
Number: 9
Board Of Equalization: 44-023448
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021138-000009
Tank Status: A
Capacity: 550
Active Date: Not reported
Tank Use: PETROLEUM
STG: W
Content: Not reported
Number Of Tanks: Not reported

SAN DIEGO CO LOP:

Name: ISLANDIA SPORTFISHING
Address: 1551 W MISSION BAY DR
City,State,Zip: SAN DIEGO, CA 92109
Record ID: DEH1998-LSAM-H21138-001
Record Status: Completed
Opened Date: 10/20/1998
Parcel Number: 760-029-02-00
Case Type: LOP - Local Oversight Program
Historical Name: ISLANDIA SPORTSFISHING
SWRCB Global ID: T0607302675
Funding: S - LOP State Fund
Lead Agency: DEH/SAM
Lead Agency Date: 04/14/1999
Census Tract: 76.00
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 906.8
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Latitude: 32.7645236
Longitude: -117.2402081
X MapCoord: 6257261.998
Y MapCoord: 1859436.618

126
SSE
1/4-1/2
0.373 mi.
1970 ft.

**3936 JUPITER ST.
SAN DIEGO, CA 92110**

**Notify 65 S100178431
N/A**

**Relative:
Lower
Actual:
12 ft.**

NOTIFY 65:
Date Reported: Not reported
Staff Initials: Not reported
Board File Number: Not reported
Facility Type: Not reported
Discharge Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

(Continued)

S100178431

Issue Date: Not reported
Incident Description: Not reported

K127
South
1/4-1/2
0.395 mi.
2086 ft.
L.A. DISTRICT ENG OFFICE &YARD
SAN DIEGO, CA
Site 1 of 2 in cluster K

FUDS **1024903572**
N/A

Relative: FUDS:
Lower EPA Region: 9
Installation ID: CA99799F549600
Actual: Congressional District Number: 52
10 ft. Facility Name: L.A. DISTRICT ENG OFFICE &YARD
FUDS Number: J09CA0437
City: SAN DIEGO
State: CA
County: SAN DIEGO
Telephone: 213-452-3920
USACE Division: South Pacific Division (SPD)
USACE District: Los Angeles District (SPL)
Status: Properties without projects
Current Owner: Local Government
X Coord: -117.223611109864
Y Coord: 32.7555555604416
Latitude: 32.75555559999998
Longitude: -117.22361110999999

K128
South
1/4-1/2
0.395 mi.
2087 ft.
LA DE OFFICE & YD S D
SAN DIEGO, CA
Site 2 of 2 in cluster K

ENVIROSTOR **S107736556**
N/A

Relative: ENVIROSTOR:
Lower Name: LA DE OFFICE & YD S D
Address: Not reported
Actual: City,State,Zip: SAN DIEGO, CA
10 ft. Facility ID: 80000297
Status: Inactive - Needs Evaluation
Status Date: 07/01/2005
Site Code: Not reported
Site Type: Military Evaluation
Site Type Detailed: FUDS
Acres: 0
NPL: NO
Regulatory Agencies: SMBRP
Lead Agency: SMBRP
Program Manager: Not reported
Supervisor: Douglas Bautista
Division Branch: Cleanup Cypress
Assembly: 78
Senate: 39
Special Program: Not reported
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LA DE OFFICE & YD S D (Continued)

S107736556

Funding: DERA
Latitude: 32.75555
Longitude: -117.2236
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: NONE SPECIFIED
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: CA99799F549600
Alias Type: Federal Facility ID
Alias Name: J09CA0437
Alias Type: INPR
Alias Name: 80000297
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: Not reported
Completed Sub Area Name: Not reported
Completed Document Type: Not reported
Completed Date: Not reported
Comments: Not reported

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

L129
ESE
1/4-1/2
0.418 mi.
2205 ft.

SAN DIEGO GUN TOWER #3

FUDS 1024903650
N/A

SAN DIEGO, CA

Site 1 of 2 in cluster L

Relative:
Lower

FUDS:

Actual:
12 ft.

EPA Region: 9
Installation ID: CA99799F560300
Congressional District Number: 52
Facility Name: SAN DIEGO GUN TOWER #3
FUDS Number: J09CA0601
City: SAN DIEGO
State: CA
County: SAN DIEGO
Telephone: 213-452-3920
USACE Division: South Pacific Division (SPD)
USACE District: Los Angeles District (SPL)
Status: Properties without projects
Current Owner: Local Government
X Coord: -117.208333329818
Y Coord: 32.758333329720301
Latitude: 32.758333329999999
Longitude: -117.20833333

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

J130
West
1/4-1/2
0.419 mi.
2210 ft.
HYATT ISLANDIA HOTEL
1441 QUIVIRA CT
SAN DIEGO, CA 92109
Site 2 of 4 in cluster J

LUST
S106927450
SWEEPS UST
N/A
CHMIRS
HAZNET
CERS

Relative:
Lower

LUST:

Actual:
12 ft.

Name: HYATT ISLANDIA HOTEL
Address: 1441 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 921097805
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607303027
Global Id: T0607303027
Latitude: 32.7659474
Longitude: -117.2401999
Status: Completed - Case Closed
Status Date: 11/17/1994
Case Worker: Not reported
RB Case Number: 9UT775
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H12330-001
Potential Media Affect: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

LUST:

Global Id: T0607303027
Action Type: ENFORCEMENT
Date: 08/12/1987
Action: Notice of Responsibility

LUST:

Global Id: T0607303027
Status: Open - Case Begin Date
Status Date: 08/12/1987

Global Id: T0607303027
Status: Completed - Case Closed
Status Date: 11/17/1994

SWEEPS UST:

Name: HYATT ISLANDIA HOTEL
Address: 1441 QUIVIRA CT
City: SAN DIEGO
Status: Active
Comp Number: 12330
Number: 9
Board Of Equalization: 44-022546
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: Not reported
Tank Status: Not reported
Capacity: Not reported
Active Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT ISLANDIA HOTEL (Continued)

S106927450

Tank Use: Not reported
STG: Not reported
Content: Not reported
Number Of Tanks: Not reported

CHMIRS:

Name: Not reported
Address: 1441 QUIVIRA ROAD
City,State,Zip: SAN DIEGO, CA
OES Incident Number: 4-3941
OES notification: 07/12/2014
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: Pacific Ocean
Spill Site: Waterways
Cleanup By: No
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Type: PETROLEUM
Measure: Sheen
Other: Not reported
Date/Time: 1745
Year: 2014
Agency: NRC
Incident Date: 7/12/2014
Admin Agency: Not reported
Amount: Not reported
Contained: Unknown

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT ISLANDIA HOTEL (Continued)

S106927450

Site Type:	Pacific Ocean
E Date:	Not reported
Substance:	Sheen
Quantity Released:	20 x 20
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	Unknown
Fatals:	No
Comments:	Not reported
Description:	From the NRC report: CALLER RPEORTED AN UNKNWON SHEEN. BOOMS APPLIED

Name:	Not reported
Address:	1441 QUIVIRA ROAD
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	15-3088
OES notification:	06/02/2015
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT ISLANDIA HOTEL (Continued)

S106927450

Spill Site:	Ship/Harbor/Port
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Sheen
Other:	300 feet x 300 feet
Date/Time:	820
Year:	2015
Agency:	NRC
Incident Date:	06/02/2015
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Unknown Sheen
Quantity Released:	Unknown
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	Per the NRC Report - "Caller stated an unknown sheen from an unknown source has a large concentration along the "D" Dock."

HAZNET:

Name:	HYATT MISSION BAY
Address:	1441 QUIVIRA RD.
City,State,Zip:	SAN DIEGO, CA 92109
Year:	2017
GEPAID:	CAC002903691
Contact:	SARAH CORDON
Telephone:	8585660060
Mailing Name:	Not reported
Mailing Address:	1441 QUIVIRA RD.
Mailing City,St,Zip:	SAN DIEGO, CA 92109
Gen County:	San Diego
TSD EPA ID:	AZC950823111
TSD County:	99
Tons:	0.69
CA Waste Code:	151-Asbestos containing waste

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT ISLANDIA HOTEL (Continued)

S106927450

Method: H132-Landfill Or Surface Impoundment That Will Be Closed As Landfill(
To Include On-Site Treatment And/Or Stabilization)
Facility County: San Diego

CERS:

Name: HYATT ISLANDIA HOTEL
Address: 1441 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 921097805
Site ID: 251229
CERS ID: T0607303027
CERS Description: Leaking Underground Storage Tank Cleanup Site

J131
West
1/4-1/2
0.419 mi.
2210 ft.

HYATT ISLANDIA
1441 QUIVIRA RD
SAN DIEGO, CA 92109
Site 3 of 4 in cluster J

RCRA-SQG **1000421400**
LUST **CAD981387657**
CHMIRS
FINDS
ECHO
HIST CORTESE

Relative:
Lower

Actual:
12 ft.

RCRA-SQG:

Date form received by agency: 09/01/1996
Facility name: HYATT ISLANDIA
Facility address: 1441 QUIVIRA RD
SAN DIEGO, CA 92109
EPA ID: CAD981387657
Contact: Not reported
Contact address: Not reported
Not reported
Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 09
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: AMOROSO & GREENSTEIN
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT ISLANDIA (Continued)

1000421400

Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
Used oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Historical Generators:

Date form received by agency: 02/14/1986
Site name: HYATT ISLANDIA
Classification: Large Quantity Generator

Violation Status: No violations found

LUST REG 9:

Region: 9
Status: Case Closed
Case Number: 9UT775
Local Case: H12330-001
Substance: Gasoline
Qty Leaked: 0
Abate Method: VSIT
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Tank
Cause: Corrosion
Lead Agency: Local Agency
Case Type: Other ground water affected
Date Found: 07/31/1987
Date Stopped: 07/31/1987
Confirm Date: 07/31/1987
Submit Workplan: Not reported
Prelim Assess: 08/05/1987
Desc Pollution: Not reported
Remed Plan: 12/15/1987
Remed Action: 10/22/88
Began Monitor: 2/28/94

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT ISLANDIA (Continued)

1000421400

Release Date: 08/04/1987
Enforce Date: Not reported
Closed Date: 11/17/94
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: Not reported
Beneficial Use: No Beneficial groundwater use
NPDES Number: Not reported
Priority: 3B
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

CHMIRS:

Name: Not reported
Address: 1441 QUIVIRA ROAD
City,State,Zip: SAN DIEGO, CA 92109
OES Incident Number: 4-0421
OES notification: 01/23/2014
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: Mission Bay
Spill Site: Waterways
Cleanup By: No
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT ISLANDIA (Continued)

1000421400

Type:	PETROLEUM
Measure:	Sheen
Other:	Not reported
Date/Time:	745
Year:	2014
Agency:	NRC
Incident Date:	1/23/2014
Admin Agency:	Not reported
Amount:	Not reported
Contained:	Unknown
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Unknown Oil
Quantity Released:	200ft x 300ft
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	Unknown
Fatals:	No
Comments:	Not reported
Description:	Per NRC report #1071902: "Caller is reporting an unknown sheen in mission bay." Additional Information: "Caller stated the sheen is "huge" and at least 200 feet in width." Upon further contact with the RP, he stated that the sheen is approximately 200ft by 300ft in size and that the oil appears to be old.
Name:	Not reported
Address:	1441 QUIVIRA RD
City,State,Zip:	SAN DIEGO, CA 92109
OES Incident Number:	4-4194
OES notification:	07/26/2014
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT ISLANDIA (Continued)

1000421400

Responding Agency Personnel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: Pacific Ocean
Spill Site: Waterways
Cleanup By: No
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Not reported
Other: Not reported
Type: PETROLEUM
Measure: Qt.(s)
Other: Not reported
Date/Time: 1800
Year: 2014
Agency: NRC
Incident Date: 7/26/2014
Admin Agency: Not reported
Amount: Not reported
Contained: Yes
Site Type: Pacific Ocean
E Date: Not reported
Substance: Fuel- Diesel, #1-D
Quantity Released: 1
Unknown: Not reported
Substance #2: Not reported
Substance #3: Not reported
Evacuations: Not reported
Number of Injuries: Not reported
Number of Fatalities: Not reported
#1 Pipeline: No
#2 Pipeline: No
#3 Pipeline: No
#1 Vessel >= 300 Tons: No
#2 Vessel >= 300 Tons: No
#3 Vessel >= 300 Tons: No
Evacs: No
Injuries: Unknown
Fatafs: No
Comments: Not reported
Description: Per NRC report: Caller reported a diesel spill during a transfer of fuel.

Name: Not reported
Address: 1441 QUIVIRA ROAD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT ISLANDIA (Continued)

1000421400

City,State,Zip:	SAN DIEGO, CA 92109
OES Incident Number:	4-4208
OES notification:	07/28/2014
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Ship/Harbor/Port
Cleanup By:	No
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Sheen
Other:	Not reported
Date/Time:	815
Year:	2014
Agency:	NRC
Incident Date:	7/28/2014
Admin Agency:	Not reported
Amount:	Not reported
Contained:	Unknown
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Diesel
Quantity Released:	50 yards x 10 yards
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT ISLANDIA (Continued)

1000421400

Number of Injuries: Not reported
Number of Fatalities: Not reported
#1 Pipeline: No
#2 Pipeline: No
#3 Pipeline: No
#1 Vessel >= 300 Tons: No
#2 Vessel >= 300 Tons: No
#3 Vessel >= 300 Tons: No
Evacs: No
Injuries: Unknown
FataIs: No
Comments: Not reported
Description: Per the NRC Report: "Caller stated that there is diesel fuel coming from a vessel in the marina. The sheen has already spread across the marina and they are placing boom across the water. Sheen Color: Rainbow."

Name: Not reported
Address: 1441 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
OES Incident Number: 15-0338
OES notification: 01/19/2015
OES Date: Not reported
OES Time: Not reported
Date Completed: **Not reported**
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agncy Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: Mission Bay
Spill Site: Ship/Harbor/Port
Cleanup By: Unknown
Containment: Not reported
What Happened: Not reported
Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT ISLANDIA (Continued)

1000421400

Measure:	Not reported
Other:	Not reported
Type:	PETROLEUM
Measure:	Unknown
Other:	Not reported
Date/Time:	830
Year:	2015
Agency:	NRC
Incident Date:	01/19/2015
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Unknown Oil
Quantity Released:	Unknown
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	No
#2 Pipeline:	No
#3 Pipeline:	No
#1 Vessel >= 300 Tons:	No
#2 Vessel >= 300 Tons:	No
#3 Vessel >= 300 Tons:	No
Evacs:	No
Injuries:	No
Fatals:	No
Comments:	Not reported
Description:	Per NRC Fax: Unknown sheen sighting. Exact source of the sheen is unknown at this time. Sheen color is grayish, Sheen length is 300 Yards.

FINDS:

Registry ID: 110002690035

Environmental Interest/Information System

California Hazardous Waste Tracking System - Datamart (HWTS-DATAMART) provides California with information on hazardous waste shipments for generators, transporters, and treatment, storage, and disposal facilities.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

STATE MASTER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT ISLANDIA (Continued)

1000421400

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000421400
Registry ID: 110002690035
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002690035>

HIST CORTESE:

edr_fname: HYATT ISLANDIA
edr_fadd1: 1441 QUIVIRA
City,State,Zip: SAN DIEGO, CA 92109
Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT775

J132
West
1/4-1/2
0.419 mi.
2210 ft.

Relative:
Lower

Actual:
12 ft.

HYATT REGENCY MISSION BAY SPA & MARINA
1441 QUIVIRA RD
SAN DIEGO, CA 92109

Site 4 of 4 in cluster J

SAN DIEGO CO. SAM
San Diego Co. HMM
CERS HAZ WASTE
SWEEPS UST
CERS TANKS
CHMIRS
Notify 65
SAN DIEGO CO LOP
CERS

S100233066
N/A

SAN DIEGO CO. SAM:

Name: HYATT ISLANDIA HOTEL
Address: 1441 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 921097805
Case Number: H12330-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: GW With No Beneficial Use Designation
Facility Status: Closed Case
Date: 11/17/1994
Date Began: 7/31/1987

HMMD SAN DIEGO:

Name: HYATT REGENCY MISSION BAY SPA & MARINA
Address: 1441 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 112330
Business Type: 6HK41
EPA Id Number: CAL000309213
APN: 760-029-02-00
Last HMMD Inspection: 09/14/2011
Facility Telephone: 619-224-1234
Permit Status: SUSP
Permit Expiration: 10/31/2013
Date Last Updated: 11/02/2012
Facility Owner: HYATT REGENCY MISSION BAY
Facility Mailing Address: 1441 QUIVIRA RD
Facility Mailing City: SAN DIEGO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Facility Mailing State: CA
Facility Mailing Zip: 92109
UST Owner: HYATT ISLANDIA
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Y

Inventory Active Permits (not SQG Medical):

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: LATEX PAINT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: MUIATIC ACID
Other Information: POOL CHEMICALS
Material Waste: Material
Hazardous Categories 1: REACTIVE
Hazardous Categories 2: ACUTE

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: PROPANE GAS-CYLINDER (1 GALLON OF PROPANE= 37 CF)
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 213 HYDROCARBON SOLVENTS
Other Information: MINERAL SPIRITS/PAINT SLD
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 112330
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: USED OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information: OILY ABSORBENT
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information: WASTE PAINT SLUDGE/ THINNER
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information: WASTE GASOLINE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information: RED BAG BIOHAZARDOUS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 01/29/2003
Violation Code: 6HV0133

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Violation: MANIFEST COPY NOT SENT TO DTSC
Violation Citation: Generator of hazardous waste has not sent the appropriate copy of the manifest to DTSC/Cal-EPA. CCR 66262.23(a)(4)
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 09/14/2011
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 09/14/2011
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 07/27/2009
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name, address, and phone number. 68.1205
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 07/27/2009
Violation Code: 6HV4204
Violation: WARNING SIGN NOT POSTED
Violation Citation: MW designated accumulation area not posted with an approved and legible biohazardous waste "warning sign" in English and Spanish. 118310
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 07/27/2009
Violation Code: 6HV1017
Violation: HMBP NOT CERTIFIED ANNUALLY
Violation Citation: Business Plan not certified annually. 25505(d) & (e)(2)
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 07/27/2009
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Activity: & 25505(a)(2)
SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 11/30/2007
Violation Code: 6HV4203
Violation: MED WASTE STORAGE NOT SECURED
Violation Citation: Generator has not secured the enclosure or designated accumulation area for medical waste containers so as to deny access to unauthorized persons. 118307, 118310

Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 11/30/2007
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name, address, and phone number. 68.1205

Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 05/01/2006
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729

Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 05/01/2006
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)

Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 05/01/2006
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name, address, and phone number. 68.1205

Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 05/01/2006
Violation Code: 6HV4212
Violation: RED BAGS NOT CONTAINERIZED
Violation Citation: Did not containerize and place red bags in rigid, leak resistant, and covered containers or bins. 118280(b)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 05/01/2006
Violation Code: 6HV4303
Violation: SQG:NO MED WASTE DISPOSAL RECORDS
Violation Citation: Generator did not retain on file disposal receipts and/or tracking documents for waste shipped offsite for at least 2 years (SQG). 117945(b)

Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 05/01/2006
Violation Code: 6HV4309
Violation: SQG:MWMP OR EQUIV NOT ONSITE
Violation Citation: Medical Waste Management Plan or equivalent information not onsite for review (SQG). 117945
Activity: SUSP

UST:

UST Name: UNDERGROUND TANK 112330 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 112330
Tank Type: SINGLE WALL
Additional Id: 4
Capacity Gallons: 10000
UST Contents: PREMIUM UNLEADED
Other Content Info: PREMIUM UNLEADED
Reg Status: REMOVED
Remove Close Date: 1988-11-02 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 112330 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 112330
Tank Type: SINGLE WALL
Additional Id: 5
Capacity Gallons: 5000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1988-11-02 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 112330 T006

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Last Update: 2012-11-02 14:17:38
Permit Number: 112330
Tank Type: SINGLE WALL
Additional Id: 6
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1988-11-02 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

Name: HYATT REGENCY MISSION BAY SPA & MARINA
Address: 1441 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 112330
Business Type: 6HK41
EPA Id Number: CAL000309213
APN: 760-029-02-00
Last HMMD Inspection: 09/14/2011
Facility Telephone: 619-224-1234
Permit Status: SUSP
Permit Expiration: 10/31/2013
Date Last Updated: 11/02/2012
Facility Owner: HYATT REGENCY MISSION BAY
Facility Mailing Address: 1441 QUIVIRA RD
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92109
UST Owner: HYATT ISLANDIA
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: LATEX PAINT
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: Not reported

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: MUIATIC ACID
Other Information: POOL CHEMICALS
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Hazardous Categories 1:	REACTIVE
Hazardous Categories 2:	ACUTE
Permit Number:	112330
Update Date:	11/02/2012
Case Number:	Not reported
Name:	PROPANE GAS-CYLINDER (1 GALLON OF PROPANE= 37 CF)
Other Information:	Not reported
Material Waste:	Material
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	112330
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 135 UNSPECIFIED AQUEOUS SOL'N
Other Information:	Not reported
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	112330
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 213 HYDROCARBON SOLVENTS
Other Information:	MINERAL SPIRITS/PAINT SLD
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	112330
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 221 WASTE OIL & MIXED OIL
Other Information:	USED OIL
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	112330
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 223 UNSPEC OIL CONTAINING WASTE
Other Information:	OILY ABSORBENT
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported
Permit Number:	112330
Update Date:	11/02/2012
Case Number:	Not reported
Name:	WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information:	WASTE PAINT SLUDGE/ THINNER
Material Waste:	Waste
Hazardous Categories 1:	Not reported
Hazardous Categories 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 343 UNSPEC ORGANIC LIQUID MIXTURE
Other Information: WASTE GASOLINE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 901 INFECTIOUS WASTE, GENERAL
Other Information: RED BAG BIOHAZARDOUS
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 112330
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 902 INFECTIOUS WASTE, SHARPS
Other Information: Not reported
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 01/29/2003
Violation Code: 6HV0133
Violation: MANIFEST COPY NOT SENT TO DTSC
Violation Citation: Generator of hazardous waste has not sent the appropriate copy of the manifest to DTSC/Cal-EPA. CCR 66262.23(a)(4)
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 09/14/2011
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 09/14/2011
Violation Code: 6HV0227
Violation: HAZWASTE TANK/CONTAINER W/O LABEL/DATE
Violation Citation: Failed to properly label/date hazardous waste container &/or tank. 66262.34(f)
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Inspection Date: 07/27/2009
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name, address, and phone number. 68.1205
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 07/27/2009
Violation Code: 6HV4204
Violation: WARNING SIGN NOT POSTED
Violation Citation: MW designated accumulation area not posted with an approved and legible biohazardous waste "warning sign" in English and Spanish.
118310
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 07/27/2009
Violation Code: 6HV1017
Violation: HMBP NOT CERTIFIED ANNUALLY
Violation Citation: Business Plan not certified annually. 25505(d) & (e)(2)
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 07/27/2009
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 11/30/2007
Violation Code: 6HV4203
Violation: MED WASTE STORAGE NOT SECURED
Violation Citation: Generator has not secured the enclosure or designated accumulation area for medical waste containers so as to deny access to unauthorized persons. 118307, 118310
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 11/30/2007
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name, address, and phone number. 68.1205
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 05/01/2006

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 05/01/2006
Violation Code: 6HV0135
Violation: MANIFESTS/RECEIPTS FOR 3 YEARS NOT ONSIT
Violation Citation: Hazardous waste manifests/receipts for 3 years are not maintained onsite to document proper disposal of hazardous waste. CCR 66262.40(a) & 25160.2(b)(3)
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 05/01/2006
Violation Code: 6HV4209
Violation: NO GENERATOR'S INFO ON RED BAGS/SHARPS
Violation Citation: Red bags, sharps containers not labeled with generator's name, address, and phone number. 68.1205
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 05/01/2006
Violation Code: 6HV4212
Violation: RED BAGS NOT CONTAINERIZED
Violation Citation: Did not containerize and place red bags in rigid, leak resistant, and covered containers or bins. 118280(b)
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 05/01/2006
Violation Code: 6HV4303
Violation: SQG:NO MED WASTE DISPOSAL RECORDS
Violation Citation: Generator did not retain on file disposal receipts and/or tracking documents for waste shipped offsite for at least 2 years (SQG). 117945(b)
Activity: SUSP

Permit Number: 112330
Update Date: 11/02/2012
Inspection Date: 05/01/2006
Violation Code: 6HV4309
Violation: SQG:MWMP OR EQUIV NOT ONSITE
Violation Citation: Medical Waste Management Plan or equivalent information not onsite for review (SQG). 117945
Activity: SUSP

UST:

UST Name: UNDERGROUND TANK 112330 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 112330

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Tank Type: SINGLE WALL
Additional Id: 4
Capacity Gallons: 10000
UST Contents: PREMIUM UNLEADED
Other Content Info: PREMIUM UNLEADED
Reg Status: REMOVED
Remove Close Date: 1988-11-02 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 112330 T005
Last Update: 2012-11-02 14:17:38
Permit Number: 112330
Tank Type: SINGLE WALL
Additional Id: 5
Capacity Gallons: 5000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1988-11-02 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 112330 T006
Last Update: 2012-11-02 14:17:38
Permit Number: 112330
Tank Type: SINGLE WALL
Additional Id: 6
Capacity Gallons: 550
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1988-11-02 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

CERS HAZ WASTE:

Name: HYATT REGENCY MISSION BAY SPA & MARINA
Address: 1441 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 135552
CERS ID: 10395799
CERS Description: Hazardous Waste Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

SWEEPS UST:

Name: HYATT ISLANDIA HOTEL
Address: 1441 QUIVIRA RD
City: SAN DIEGO
Status: Not reported
Comp Number: 12330
Number: Not reported
Board Of Equalization: 44-022546
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-012330-000004
Tank Status: Not reported
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: LEADED
Number Of Tanks: 3

Name: HYATT ISLANDIA HOTEL
Address: 1441 QUIVIRA RD
City: SAN DIEGO
Status: Not reported
Comp Number: 12330
Number: Not reported
Board Of Equalization: 44-022546
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-012330-000005
Tank Status: Not reported
Capacity: 5000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: Not reported

Name: HYATT ISLANDIA HOTEL
Address: 1441 QUIVIRA RD
City: SAN DIEGO
Status: Not reported
Comp Number: 12330
Number: Not reported
Board Of Equalization: 44-022546
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-012330-000006
Tank Status: Not reported
Capacity: 550
Active Date: Not reported
Tank Use: PETROLEUM

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

STG: PRODUCT
Content: Not reported
Number Of Tanks: Not reported

CERS TANKS:

Name: HYATT REGENCY MISSION BAY SPA & MARINA
Address: 1441 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 135552
CERS ID: 10395799
CERS Description: Underground Storage Tank

CHMIRS:

Name: Not reported
Address: 1441 QUIVIRA ROAD
City,State,Zip: SAN DIEGO, CA 92109
OES Incident Number: 13-3286
OES notification: 05/31/2013
OES Date: Not reported
OES Time: Not reported
Date Completed: Not reported
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported
Estimated Temperature: Not reported
Property Management: Not reported
More Than Two Substances Involved?: Not reported
Resp Agency Personel # Of Decontaminated: Not reported
Responding Agency Personel # Of Injuries: Not reported
Responding Agency Personel # Of Fatalities: Not reported
Others Number Of Decontaminated: Not reported
Others Number Of Injuries: Not reported
Others Number Of Fatalities: Not reported
Vehicle Make/year: Not reported
Vehicle License Number: Not reported
Vehicle State: Not reported
Vehicle Id Number: Not reported
CA DOT PUC/ICC Number: Not reported
Company Name: Not reported
Reporting Officer Name/ID: Not reported
Report Date: Not reported
Facility Telephone: Not reported
Waterway Involved: Yes
Waterway: San Diego Bay
Spill Site: Waterways
Cleanup By: None
Containment: Not reported
What Happened: Not reported
Type: Not reported
Measure: Sheen
Other: Not reported
Date/Time: 845
Year: 2013

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Agency:	NRC
Incident Date:	5/31/2013
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown
Site Type:	San Diego Bay
E Date:	Not reported
Substance:	Diesel
Quantity Released:	Unk
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	Per NRC report: "Caller stated that there was a release of diesel fuel from a vessel that was fueling up at a marina, caller stated that the small boat left the area before any information could be gathered."
Name:	Not reported
Address:	1441 QUIVIRA ROAD
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	08-6457
OES notification:	09/03/2008
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Ship/Harbor/Port
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Unknown
Other:	Not reported
Date/Time:	2030
Year:	2008
Agency:	NRC
Incident Date:	9/3/2008
Admin Agency:	San Diego County Health Services Dept.
Amount:	Not reported
Contained:	Unknown
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Unknown Oil
Quantity Released:	Unknown
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	0
Number of Injuries:	0
Number of Fatalities:	0
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	Per NRC #882671, "Caller is reporting an unknown sheen in Mission Bay at the Hyatt Regency Mission Bay Marina".
Name:	Not reported
Address:	1441 QUIVIRA ROAD
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	13-1718
OES notification:	03/21/2013
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personnel # Of Decontaminated:	Not reported
Responding Agency Personnel # Of Injuries:	Not reported
Responding Agency Personnel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay
Spill Site:	Waterways
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Sheen
Other:	Not reported
Date/Time:	815
Year:	2013
Agency:	NRC
Incident Date:	3/21/2013
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown
Site Type:	Mission Bay
E Date:	Not reported
Substance:	Sheen
Quantity Released:	50 Yards
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Description:	Quoting the NRC Report: "A RAINBOW SHEEN FROM AN UNKNOWN SOURCE WAS DISCOVERED IN THE MARINA."
Name:	Not reported
Address:	1441 QUIVIRA ROAD
City,State,Zip:	SAN DIEGO, CA
OES Incident Number:	13-4620
OES notification:	07/27/2013
OES Date:	Not reported
OES Time:	Not reported
Date Completed:	Not reported
Property Use:	Not reported
Agency Id Number:	Not reported
Agency Incident Number:	Not reported
Time Notified:	Not reported
Time Completed:	Not reported
Surrounding Area:	Not reported
Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agncy Personel # Of Decontaminated:	Not reported
Responding Agency Personel # Of Injuries:	Not reported
Responding Agency Personel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Mission Bay/Pacific Ocean
Spill Site:	Waterways
Cleanup By:	Unrecoverable
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Gal(s)
Other:	Not reported
Date/Time:	1215
Year:	2013
Agency:	NRC
Incident Date:	7/27/2013
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Yes
Site Type:	Mission Bay/Pacific Ocean
E Date:	Not reported
Substance:	Hydraulic Oil
Quantity Released:	UNK
Unknown:	Not reported
Substance #2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	Quoting the NRC Report: "CALLER IS REPORTING A RELEASE OF HYDRAULIC FLUID FROM A VESSEL, THE CAUSE IS DUE TO THE MOVEMENT OF A SMALL BOAT OFF A VESSEL WITH A CRANE AND THE FLUID CAME FROM THE CRANE ON THE VESSEL." "DISSIPATE NATURALLY."

NOTIFY 65:

Date Reported:	Not reported
Staff Initials:	Not reported
Board File Number:	Not reported
Facility Type:	Not reported
Discharge Date:	Not reported
Issue Date:	Not reported
Incident Description:	Not reported

SAN DIEGO CO LOP:

Name:	HYATT ISLANDIA HOTEL
Address:	1441 QUIVIRA RD
City,State,Zip:	SAN DIEGO, CA 92109
Record ID:	DEH1987-LSAM-H12330-001
Record Status:	Completed
Opened Date:	07/31/1987
Parcel Number:	760-029-02-00
Case Type:	LOP - Local Oversight Program
Historical Name:	HYATT ISLANDIA
SWRCB Global ID:	T0607303027
Funding:	F - LOP Federal Fund
Lead Agency:	DEH/SAM
Lead Agency Date:	08/12/1987
Census Tract:	76.00
Community:	San Diego
Jurisdiction:	SAN DIEGO
Watershed Basin Number:	906.8
Water Purveyor:	SAN DIEGO
Fire Agency:	SAN DIEGO
Latitude:	32.7645236
Longitude:	-117.2402081
X MapCoord:	6257261.998
Y MapCoord:	1859436.618

CERS:

Name:	HYATT REGENCY MISSION BAY SPA & MARINA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Address: 1441 QUIVIRA RD
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 135552
CERS ID: 10395799
CERS Description: Chemical Storage Facilities

Violations:

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-02-2016
Citation: 23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2636(f)(2)
Violation Description: Failure of the line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements: Monitor at least hourly. Be capable of detecting a release of 3.0 gallons per hour at 10 p.s.i.g. Restrict or shut off the flow of product through the piping when a leak is detected.
Violation Notes: Returned to compliance on 09/26/2016. Inspection Sequence ID: 5489350; Tank ID: 26657; Violation Description: (RD) Failure of the pressurized piping to meet one or more of the following requirements: monitored at least hourly with the capability of detecting a release of 3.0 gallons per hour, and will restrict the flow or product through the piping or trigger an alarm when a release occurs. 23 CCR 2636(f)(2)
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-01-2017
Citation: 23 CCR 16 2715(e) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2715(e)
Violation Description: Failure to maintain a copy of the designated operator monthly inspections for the last 12 months on-site or off-site at a readily available location, if approved by the UPA.
Violation Notes: Returned to compliance on 10/19/2017. Inspection Sequence ID: 5711993; Tank ID: 26657, 26658, 26659; Violation Description: The owner/operator has failed to comply with one or more of the following: to maintain a copy of the designated operator monthly inspections for the last 12 months and/or maintain a list of trained employees on-site or off-site at a readily available location, if approved by the CUPA. 23 CCR 2715(e)
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-03-2014
Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2
Violation Description: Failure to annually review and electronically certify that the business plan is complete, accurate, and up-to-date.
Violation Notes: Returned to compliance on 09/08/2014.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-09-2013
Citation: HSC 6.75 25299.30-25299.34 - California Health and Safety Code, Chapter 6.75, Section(s) 25299.30-25299.34
Violation Description: Failure to submit and maintain complete and current Certification of Financial Responsibility or other mechanism of financial assurance.
Violation Notes: Returned to compliance on 01/01/2014.
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 08-30-2018
Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16, Section(s) 2665
Violation Description: Failure of the overflow prevention system to meet one of the following requirements: Alert the transfer operator when the tank is 90 percent full by restricting the flow into the tank or triggering an audible and visual alarm; or Restrict delivery of flow to the tank at least 30 minutes before the tank overfills, provided the restriction occurs when the tank is filled to no more than 95 percent of capacity; and activate an audible alarm at least five minutes before the tank overfills; or Provide positive shut-off of flow to the tank when the tank is filled to no more than 95 percent of capacity; or Provide positive shut-off of flow to the tank so that none of the fittings located on the top of the tank are exposed to product due to overfilling.
Violation Notes: Returned to compliance on 09/05/2018. Inspection Sequence ID:5960730;Tank ID:26657,26658,26659;Violation Description:(RP) Failure of the overflow prevention system to meet one of the following requirements: 1. Alert the transfer operator when the tank is 90% full by restricting the flow into the tank or triggering an audible and visual alarm; or 2. Restrict delivery of flow to the tank at least 30m before the tank overfills, provided the restriction occurs when the tank is filled to no more than 95% of capacity; and activate an audible alarm at least 5m before the tank overfills; or 3. Provide positive shut-off of flow to the tank when the tank is filled to no more than 95% of capacity; or 4. Provide positive shut-off of flow to the tank so that none of the fittings located on the top of the tank are exposed to product due to overfilling. 23 CCR 2635(b)(2), 2665
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 08-30-2018
Citation: 23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2636(f)(2)
Violation Description: Failure of the functional line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements: Monitored at least hourly with the capability of detecting a release of 3.0 gallons per hour leak at 10 p.s.i.g. and restrict or shut off the flow of product through the piping when a leak is detected.
Violation Notes: Returned to compliance on 09/05/2018. Inspection Sequence

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Violation Division: ID:5960730;Tank ID:26657;Violation Description:(RD) Failure of the line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements: Monitored at least hourly. with the capability of detecting a release of 3.0 gallons per hour leak at 10 p.s.i.g. and restrict or shut off the flow of product through the piping when a leak is detected. 23 CCR 2636(f)(2)
Violation Program: San Diego County Department of Env Health
Violation Source: UST
CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-09-2013
Citation: 23 CCR 16 2666(c) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2666(c)
Violation Description: Failure of line leak detector to detect a leak and/or failure of audible and visual alarm.
Violation Notes: Returned to compliance on 02/11/2014.
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-02-2016
Citation: 23 CCR 16 2715(e) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2715(e)
Violation Description: Failure to maintain a copy of the designated operator monthly inspections for the last 12 months on-site or off-site at a readily available location, if approved by the UPA.
Violation Notes: Returned to compliance on 10/28/2016. Inspection Sequence ID:5489350;Tank ID:26657,26658,26659;Violation Description:The owner/operator has failed to comply with one or more of the following: to maintain a copy of the designated operator monthly inspections for the last 12 months and/or maintain a list of trained employees on-site or off-site at a readily available location, if approved by the CUPA. 23 CCR 2715
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-01-2017
Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(a)(1)
Violation Description: Failure to complete and electronically submit hazardous material inventory information for all reportable hazardous materials on site at or above reportable quantities.
Violation Notes: Returned to compliance on 11/04/2017. Inspection Sequence ID:5711993
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-01-2017

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16, Section(s) 2665

Violation Description: Failure of the overfill prevention system to meet one of the following requirements: Alert the transfer operator when the tank is 90 percent full by restricting the flow into the tank or triggering an audible and visual alarm; or Restrict delivery of flow to the tank at least 30 minutes before the tank overfills, provided the restriction occurs when the tank is filled to no more than 95 percent of capacity; and activate an audible alarm at least five minutes before the tank overfills; or Provide positive shut-off of flow to the tank when the tank is filled to no more than 95 percent of capacity; or Provide positive shut-off of flow to the tank so that none of the fittings located on the top of the tank are exposed to product due to overfilling.

Violation Notes: Returned to compliance on 11/03/2017. Inspection Sequence ID:5711993;Tank ID:26657,26658;Violation Description:(RP) Failure of the overfill prevention system to meet one of the following requirements: 1. Alert the transfer operator when the tank is 90% full by restricting the flow into the tank or triggering an audible and visual alarm; or 2. Restrict delivery of flow to the tank at least 30m before the tank overfills, provided the restriction occurs when the tank is filled to no more than 95% of capacity; and activate an audible alarm at least 5m before the tank overfills; or 3. Provide positive shut-off of flow to the tank when the tank is filled to no more than 95% of capacity; or 4. Provide positive shut-off of flow to the tank so that none of the fittings located on the top of the tank are exposed to product due to overfilling. 23 CCR 2635(b)(2), 2665

Violation Division: San Diego County Department of Env Health

Violation Program: UST

Violation Source: CERS

Site ID: 135552

Site Name: HYATT REGENCY MISSION BAY SPA & MARINA

Violation Date: 09-10-2015

Citation: 23 CCR 16 2715 - California Code of Regulations, Title 23, Chapter 16, Section(s) 2715

Violation Description: The owner/operator has failed to comply with one or more of the following: to maintain a copy of the designated operator monthly inspections for the last 12 months and/or maintain a list of trained employees on-site or off-site at a readily available location, if approved by the CUPA.

Violation Notes: Returned to compliance on 02/01/2016. Inspection Sequence ID:5121211;Tank ID:26657,26658,26659;Violation Description:The owner/operator has failed to comply with one or more of the following: to maintain a copy of the designated operator monthly inspections for the last 12 months and/or maintain a list of trained employees on-site or off-site at a readily available location, if approved by the CUPA. 23 CCR 2715

Violation Division: San Diego County Department of Env Health

Violation Program: UST

Violation Source: CERS

Site ID: 135552

Site Name: HYATT REGENCY MISSION BAY SPA & MARINA

Violation Date: 09-01-2017

Citation: 23 CCR 16 2636(f)(2) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2636(f)(2)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Violation Description: Failure of the line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements: Monitor at least hourly. Be capable of detecting a release of 3.0 gallons per hour at 10 p.s.i.g. Restrict or shut off the flow of product through the piping when a leak is detected.

Violation Notes: Returned to compliance on 11/03/2017. Inspection Sequence ID:5711993; Tank ID:26657; Violation Description:(RD) Failure of the line leak detector (LLD) monitoring pressurized piping to meet one or more of the following requirements: Monitored at least hourly, be capable of detecting a release of 3.0 gallons per hour, restrict or shut off the flow of product through the piping or trigger an alarm when a leak is detected. 23 CCR 2636(f)(2)

Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-01-2017
Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(a)(1)

Violation Description: Failure to complete and electronically submit a site map with all required content.

Violation Notes: Returned to compliance on 11/04/2017. Inspection Sequence ID:5711993
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-02-2016
Citation: 23 CCR 16 2715(f) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2715(f)

Violation Description: Failure to have at least one employee present during operating hours that has been trained in the proper operation and maintenance of the UST system by a designated operator (DO).

Violation Notes: Returned to compliance on 10/02/2016. Inspection Sequence ID:5489350; Tank ID:26657,26658,26659; Violation Description: Failure to comply with one or more of the following: provide training to facility employee(s) responsible for proper operation and maintenance every 12 months and/or train new employee(s) who are responsible for proper operation and maintenance within 30-days of hire and/or to have at least one employee present during operating hours that has been trained in the proper operation and maintenance of the UST system. 23 CCR 16 2715(c)(6), 2715(f)

Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-03-2014
Citation: 23 CCR 16 2715(c)(2) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2715(c)(2)

Violation Description: Failure to comply with one or more of the following: maintain the spill bucket in good condition, containment free of debris/liquid, and/or to remove the contents of the spill bucket when a

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

release/leak/spill was observed.
Returned to compliance on 09/03/2014.
San Diego County Department of Env Health
Violation Notes: UST
Violation Division: CERS
Violation Program:
Violation Source:

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-10-2015
Citation: 23 CCR 16 2715(f) - California Code of Regulations, Title 23, Chapter 16, Section(s) 2715(f)
Violation Description: Failure to comply with one or more of the following: provide training to facility employee(s) responsible for proper operation and maintenance every 12 months and/or train new employee(s) who are responsible for proper operation and maintenance within 30-days of hire and/or to have at least one employee present during operating hours that has been trained in the proper operation and maintenance of the UST system.

Violation Notes: Returned to compliance on 02/01/2016. Inspection Sequence ID:5121211; Tank ID:26657,26658,26659; Violation Description: Failure to comply with one or more of the following: provide training to facility employee(s) responsible for proper operation and maintenance every 12 months and/or train new employee(s) who are responsible for proper operation and maintenance within 30-days of hire and/or to have at least one employee present during operating hours that has been trained in the proper operation and maintenance of the UST system. 23 CCR 16 2715(c)(6), 2715(f)
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-10-2015
Citation: HSC 6.95 25508(d) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(d)
Violation Description: Failure to complete and/or electronically submit a business plan when storing/handling a hazardous material at or above reportable quantities.

Violation Notes: Returned to compliance on 02/16/2016. Inspection Sequence ID:5121211
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 135552
Site Name: HYATT REGENCY MISSION BAY SPA & MARINA
Violation Date: 09-02-2016
Citation: 23 CCR 16 2665 - California Code of Regulations, Title 23, Chapter 16, Section(s) 2665
Violation Description: Failure of the overfill prevention system to meet one of the following requirements: Alert the transfer operator when the tank is 90 percent full by restricting the flow into the tank or triggering an audible and visual alarm; or Restrict delivery of flow to the tank at least 30 minutes before the tank overfills, provided the restriction occurs when the tank is filled to no more than 95 percent of capacity; and activate an audible alarm at least five minutes before the tank overfills; or Provide positive shut-off of flow to the tank when the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Violation Notes: tank is filled to no more than 95 percent of capacity; or Provide positive shut-off of flow to the tank so that none of the fittings located on the top of the tank are exposed to product due to overfilling.
Returned to compliance on 09/26/2016. Inspection Sequence ID:5489350;Tank ID:26657,26658,26659;Violation Description:(RP) Failure of the overfill prevention system to meet one of the following requirements: 1. Alert the transfer operator when the tank is 90% full by restricting the flow into the tank or triggering an audible and visual alarm; or 2. Restrict delivery of flow to the tank at least 30m before the tank overfills, provided the restriction occurs when the tank is filled to no more than 95% of capacity; and activate an audible alarm at least 5m before the tank overfills; or 3. Provide positive shut-off of flow to the tank when the tank is filled to no more than 95% of capacity; or 4. Provide positive shut-off of flow to the tank so that none of the fittings located on the top of the tank are exposed to product due to overfilling. 23 CCR 2635(b)(2), 2665
Violation Division: San Diego County Department of Env Health
Violation Program: UST
Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-30-2018
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: LaPel Daniel Inspection ID:5960730
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-30-2018
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: LaPel Daniel Inspection ID:5960730
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 08-30-2018
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: LaPel Daniel Inspection ID:5960730
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-01-2017
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5711993
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-01-2017
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5711993
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-01-2017
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5711993
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-02-2016
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5489350
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-02-2016
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5489350
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-02-2016
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5489350
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-03-2014
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4976417
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-03-2014
Violations Found: Yes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4976417
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-03-2014
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4976417
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-09-2013
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4100975
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-09-2013
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4100975
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-09-2013
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:4100975
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-10-2015
Violations Found: No
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5121211
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-10-2015
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5121211
Eval Division: San Diego County Department of Env Health

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-10-2015
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Fernandez Juan Inspection ID:5121211
Eval Division: San Diego County Department of Env Health
Eval Program: UST
Eval Source: CERS

Coordinates:
Site ID: 135552
Facility Name: HYATT REGENCY MISSION BAY SPA & MARINA
Env Int Type Code: HWG
Program ID: 10395799
Coord Name: Not reported
Ref Point Type Desc: Center of a facility or station.
Latitude: 32.764580
Longitude: -117.240200

Affiliation:
Affiliation Type Desc: Identification Signer
Entity Name: Eldio Gomes
Entity Title: Director of Engineering
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Operator
Entity Name: HYATT REGENCY MISSION BAY SPA & MARINA
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 221-4849

Affiliation Type Desc: CUPA District
Entity Name: San Diego County Env Health
Entity Title: Not reported
Affiliation Address: PO Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92112-9261
Affiliation Phone: (858) 505-6880

Affiliation Type Desc: Legal Owner
Entity Name: CHSP MISSION BAY LLC DBA HYATT
Entity Title: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Affiliation Address: 1997 ANNAPOLIS EXCHANGE PKWY 410
Affiliation City: ANNAPOLIS
Affiliation State: MD
Affiliation Country: United States
Affiliation Zip: 21401
Affiliation Phone: (410) 972-4147

Affiliation Type Desc: UST Property Owner Name
Entity Name: CHSP TRS MISSION BAY LLC, a Delaware Limited Liability Company
Entity Title: Not reported
Affiliation Address: 1997 ANNAPOLIS EXCHANGE PKWY., St. 410
Affiliation City: ANNAPOLIS
Affiliation State: MD
Affiliation Country: United States
Affiliation Zip: 21401
Affiliation Phone: (410) 972-4149

Affiliation Type Desc: UST Tank Operator
Entity Name: Milenko Bradasevic
Entity Title: Not reported
Affiliation Address: 1441 Quivira Rd.
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92109
Affiliation Phone: (619) 221-4849

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 1441 Quivira Rd
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92109
Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation
Entity Name: HYATT REGENCY MISSION BAY SPA & MARINA
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: UST Tank Owner
Entity Name: CHSP TRS MISSION BAY LLC, a Delaware Limited Liability Company
Entity Title: Not reported
Affiliation Address: 1997 ANNAPOLIS EXCHANGE PKWY., St. 410
Affiliation City: Annapolis
Affiliation State: MD
Affiliation Country: United States
Affiliation Zip: 21401
Affiliation Phone: (410) 972-4149

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HYATT REGENCY MISSION BAY SPA & MARINA (Continued)

S100233066

Affiliation Type Desc: Document Preparer
Entity Name: Bryan Stevens, ADOE
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Environmental Contact
Entity Name: Bud McCuaig
Entity Title: Not reported
Affiliation Address: PO Box 2301
Affiliation City: Orinda
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 94563
Affiliation Phone: Not reported

Affiliation Type Desc: Property Owner
Entity Name: CHSP MISSION BAY LLC DBA HYATT
Entity Title: Not reported
Affiliation Address: 1997 ANNAPOLIS EXCHANGE PKWY 410
Affiliation City: ANNAPOLIS
Affiliation State: MD
Affiliation Country: United States
Affiliation Zip: 21401
Affiliation Phone: (619) 224-1234

Affiliation Type Desc: UST Permit Applicant
Entity Name: Eldio Gomes
Entity Title: Dir. of Engineering
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 224-1234

L133
ESE
1/4-1/2
0.419 mi.
2214 ft.

SAN DIEGO GUN TOWER #3

ENVIROSTOR S107737237
N/A

SAN DIEGO, CA

Site 2 of 2 in cluster L

Relative:
Lower
Actual:
12 ft.

ENVIROSTOR:
Name: SAN DIEGO GUN TOWER #3
Address: Not reported
City,State,Zip: SAN DIEGO, CA
Facility ID: 80000454
Status: Inactive - Needs Evaluation
Status Date: 07/01/2005
Site Code: Not reported
Site Type: Military Evaluation
Site Type Detailed: FUDS
Acres: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAN DIEGO GUN TOWER #3 (Continued)

S107737237

NPL: NO
Regulatory Agencies: SMBRP
Lead Agency: SMBRP
Program Manager: Not reported
Supervisor: Douglas Bautista
Division Branch: Cleanup Cypress
Assembly: 78
Senate: 39
Special Program: Not reported
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: DERA
Latitude: 32.75833
Longitude: -117.2083
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: NONE SPECIFIED
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: CA99799F560300
Alias Type: Federal Facility ID
Alias Name: J09CA0601
Alias Type: INPR
Alias Name: 80000454
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: Not reported
Completed Sub Area Name: Not reported
Completed Document Type: Not reported
Completed Date: Not reported
Comments: Not reported

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

134
ESE
1/4-1/2
0.442 mi.
2335 ft.

PHOTIC OF SAN DIEGO INC
3515 HANCOCK ST
SAN DIEGO, CA 92110

ENVIROSTOR
San Diego Co. HMMD

1000411423
N/A

Relative:
Lower
Actual:
12 ft.

ENVIROSTOR:
Name: PHOTIC OF SAN DIEGO
Address: 3515 HANCOCK STREET
City,State,Zip: SAN DIEGO, CA 92110
Facility ID: 71002960
Status: Inactive - Needs Evaluation
Status Date: Not reported
Site Code: Not reported
Site Type: Tiered Permit

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PHOTIC OF SAN DIEGO INC (Continued)

1000411423

Site Type Detailed: Tiered Permit
Acres: Not reported
NPL: NO
Regulatory Agencies: NONE SPECIFIED
Lead Agency: NONE SPECIFIED
Program Manager: Not reported
Supervisor: Not reported
Division Branch: Cleanup Cypress
Assembly: 78
Senate: 39
Special Program: Not reported
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: Not reported
Latitude: 32.75706
Longitude: -117.2089
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: NONE SPECIFIED
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: CAD982013815
Alias Type: EPA Identification Number
Alias Name: 71002960
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: Not reported
Completed Sub Area Name: Not reported
Completed Document Type: Not reported
Completed Date: Not reported
Comments: Not reported

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

HMMD SAN DIEGO:

Name: PHOTIC OF SAN DIEGO INC
Address: 3515 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 111933
Business Type: 6HK38
EPA Id Number: CAD982013815
APN: 441-530-51-00
Last HMMD Inspection: 12/09/2004
Facility Telephone: 299-4410
Permit Status: INAC
Permit Expiration: 05/31/2005
Date Last Updated: 11/02/2012
Facility Owner: BURRELL COLOUR INC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PHOTIC OF SAN DIEGO INC (Continued)

1000411423

Facility Mailing Address: P O BOX 80487
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92138-0487
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Y
Generate Medical Waste: Not reported

**135
ESE
1/4-1/2
0.466 mi.
2459 ft.**

**Relative:
Lower**

**Actual:
12 ft.**

**BURKE CO THE 08
3870 HOUSTON ST
SAN DIEGO, CA 92110**

**SEMS-ARCHIVE
RCRA-SQG
ENVIROSTOR
FINDS
ECHO
NPDES
CIWQS
CERS**

**1000268195
CAD084240761**

SEMS Archive:
Site ID: 0903106
EPA ID: CAD084240761
Cong District: 44
FIPS Code: 06073
FF: N
NPL: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

SEMS Archive Detail:
Region: 09
Site ID: 0903106
EPA ID: CAD084240761
Site Name: BURKE CO THE 08
NPL: N
FF: N
OU: 00
Action Code: VS
Action Name: ARCH SITE
SEQ: 1
Start Date: Not reported
Finish Date: 1988-11-14 05:00:00
Qual: Not reported
Current Action Lead: EPA Perf In-Hse

Region: 09
Site ID: 0903106
EPA ID: CAD084240761
Site Name: BURKE CO THE 08
NPL: N
FF: N
OU: 00
Action Code: DS
Action Name: DISCVRY
SEQ: 1
Start Date: 1987-12-01 05:00:00
Finish Date: 1987-12-01 05:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BURKE CO THE 08 (Continued)

1000268195

Qual: Not reported
Current Action Lead: St Perf

Region: 09
Site ID: 0903106
EPA ID: CAD084240761
Site Name: BURKE CO THE 08
NPL: N
FF: N
OU: 00
Action Code: PA
Action Name: PA
SEQ: 1
Start Date: Not reported
Finish Date: 1988-11-14 05:00:00
Qual: N
Current Action Lead: St Perf

RCRA-SQG:

Date form received by agency: 09/01/1996
Facility name: BURKE CO THE 08
Facility address: 3870 HOUSTON ST
SAN DIEGO, CA 92110

EPA ID: CAD084240761
Mailing address: HOUSTON ST
SAN DIEGO, CA 92110

Contact: Not reported
Contact address: Not reported
Not reported

Contact country: US
Contact telephone: Not reported
Contact email: Not reported
EPA Region: 09
Classification: Small Small Quantity Generator
Description: Handler: generates more than 100 and less than 1000 kg of hazardous waste during any calendar month and accumulates less than 6000 kg of hazardous waste at any time; or generates 100 kg or less of hazardous waste during any calendar month, and accumulates more than 1000 kg of hazardous waste at any time

Owner/Operator Summary:

Owner/operator name: NOT REQUIRED
Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999

Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Operator
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Owner/operator name: H L WELLS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BURKE CO THE 08 (Continued)

1000268195

Owner/operator address: NOT REQUIRED
NOT REQUIRED, ME 99999
Owner/operator country: Not reported
Owner/operator telephone: 415-555-1212
Owner/operator email: Not reported
Owner/operator fax: Not reported
Owner/operator extension: Not reported
Legal status: Private
Owner/Operator Type: Owner
Owner/Op start date: Not reported
Owner/Op end date: Not reported

Handler Activities Summary:

U.S. importer of hazardous waste: No
Mixed waste (haz. and radioactive): No
Recycler of hazardous waste: No
Transporter of hazardous waste: No
Treater, storer or disposer of HW: No
Underground injection activity: No
On-site burner exemption: No
Furnace exemption: No
Used oil fuel burner: No
Used oil processor: No
User oil refiner: No
Used oil fuel marketer to burner: No
Used oil Specification marketer: No
Used oil transfer facility: No
Used oil transporter: No

Violation Status: No violations found

ENVIROSTOR:

Name: BURKE CO.
Address: 3870 HOUSTON
City,State,Zip: SAN DIEGO, CA 92110
Facility ID: 37290006
Status: No Further Action
Status Date: 02/24/1987
Site Code: Not reported
Site Type: Historical
Site Type Detailed: * Historical
Acres: 3
NPL: NO
Regulatory Agencies: NONE SPECIFIED
Lead Agency: NONE SPECIFIED
Program Manager: Not reported
Supervisor: Patrick Hsieh
Division Branch: Cleanup Cypress
Assembly: 78
Senate: 39
Special Program: * CERC2
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: Not reported
Latitude: 32.75745
Longitude: -117.2078
APN: NONE SPECIFIED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BURKE CO THE 08 (Continued)

1000268195

Past Use: NONE
Potential COC: NONE SPECIFIED No Contaminants found
Confirmed COC: 31000-NO
Potential Description: SOIL
Alias Name: 37290006
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 11/17/1994
Comments: CALSITES VALIDATION PROGRAM CONFIRMS NFA FOR DTSC.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Assessment Report
Completed Date: 06/28/1988
Comments: PRELIM ASSESS DONE NO FURTHER ACTION NEVER GENERATED HAZ. WASTE. NO RECORD OF ANY PROBLEMS

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 02/24/1987
Comments: SITE SCREENING DONE PA RECOM BASED ON DISCH OF UNDETERMINED FLUID AND STAINS ON PAVEMENT

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * Discovery
Completed Date: 01/18/1983
Comments: FACILITY IDENTIFIED ID VIA DRIVE-BY FACILITY DRIVE-BY STREAM OF UNDETERMINED FLUID RUNNING OFFSITE UNDER FENCE. LARGE LOT CONTAINS MANY NEW DRUMS.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 02/27/2018
Comments: Not reported

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

FINDS:

Registry ID: 110002661584

Environmental Interest/Information System

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BURKE CO THE 08 (Continued)

1000268195

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Registry ID: 110055809889

Environmental Interest/Information System
STATE MASTER

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000268195
Registry ID: 110002661584
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110002661584>

NPDES:

Name: GATE GOURMET UNIT 734
Address: 3870 HOUSTON ST
City,State,Zip: SAN DIEGO, CA 92110
Facility Status: Active
NPDES Number: CAS000001
Region: 9
Agency Number: 0
Regulatory Measure ID: 401913
Place ID: Not reported
Order Number: 97-03-DWQ
WDID: 9 37I022541
Regulatory Measure Type: Enrollee
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 03/03/2010
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: 3870 Houston Street
Discharge Name: Gate Gourmet
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92110
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

NPDES as of 03/2018:

NPDES Number: Not reported
Status: Not reported
Agency Number: Not reported
Region: 9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BURKE CO THE 08 (Continued)

1000268195

Regulatory Measure ID: 401913
Order Number: Not reported
Regulatory Measure Type: Industrial
Place ID: Not reported
WDID: 9 37I022541
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Received Date: 02/23/2010
Processed Date: 03/03/2010
Status: Active
Status Date: 03/03/2010
Place Size: 2.9
Place Size Unit: Acres
Contact: Kim Rentschler
Contact Title: Not reported
Contact Phone: 619-497-2425
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Gate Gourmet
Operator Address: 3870 Houston Street
Operator City: San Diego
Operator State: California
Operator Zip: 92110
Operator Contact: Dick Davis
Operator Contact Title: Not reported
Operator Contact Phone: 703-964-2343
Operator Contact Phone Ext: Not reported
Operator Contact Email: Not reported
Operator Type: Private Business
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: California
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: Not reported
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BURKE CO THE 08 (Continued)

1000268195

Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	N
Receiving Water Name:	San Diego Bay
Certifier:	Richard C Davis
Certifier Title:	Manager
Certification Date:	15-FEB-10
Primary Sic:	4212-Local Trucking Without Storage
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	CAS000001
Status:	Active
Agency Number:	0
Region:	9
Regulatory Measure ID:	401913
Order Number:	97-03-DWQ
Regulatory Measure Type:	Enrollee
Place ID:	Not reported
WDID:	9 371022541
Program Type:	Industrial
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	03/03/2010
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Gate Gourmet
Discharge Address:	3870 Houston Street
Discharge City:	San Diego
Discharge State:	California
Discharge Zip:	92110
Received Date:	Not reported
Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BURKE CO THE 08 (Continued)

1000268195

Developer Address: Not reported
Developer City: Not reported
Developer State: Not reported
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: Not reported
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported
Constype Recons Ind: Not reported
Constype Residential Ind: Not reported
Constype Transport Ind: Not reported
Constype Utility Description: Not reported
Constype Utility Ind: Not reported
Constype Water Sewer Ind: Not reported
Dir Discharge Uswater Ind: Not reported
Receiving Water Name: Not reported
Certifier: Not reported
Certifier Title: Not reported
Certification Date: Not reported
Primary Sic: Not reported
Secondary Sic: Not reported
Tertiary Sic: Not reported

Name: GATE GOURMET UNIT 734
Address: 3870 HOUSTON ST
City,State,Zip: SAN DIEGO, CA 92110
Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported
Order Number: Not reported
WDID: 9 37I022541
Regulatory Measure Type: Industrial
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BURKE CO THE 08 (Continued)

1000268195

Status: Active
Status Date: 03/03/2010
Operator Name: Gate Gourmet
Operator Address: 3870 Houston Street
Operator City: San Diego
Operator State: California
Operator Zip: 92110

NPDES as of 03/2018:

NPDES Number: Not reported
Status: Not reported
Agency Number: Not reported
Region: 9
Regulatory Measure ID: 401913
Order Number: Not reported
Regulatory Measure Type: Industrial
Place ID: Not reported
WDID: 9 371022541
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Received Date: 02/23/2010
Processed Date: 03/03/2010
Status: Active
Status Date: 03/03/2010
Place Size: 2.9
Place Size Unit: Acres
Contact: Kim Rentschler
Contact Title: Not reported
Contact Phone: 619-497-2425
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Gate Gourmet
Operator Address: 3870 Houston Street
Operator City: San Diego
Operator State: California
Operator Zip: 92110
Operator Contact: Dick Davis
Operator Contact Title: Not reported
Operator Contact Phone: 703-964-2343
Operator Contact Phone Ext: Not reported
Operator Contact Email: Not reported
Operator Type: Private Business
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: California
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BURKE CO THE 08 (Continued)

1000268195

Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	N
Receiving Water Name:	San Diego Bay
Certifier:	Richard C Davis
Certifier Title:	Manager
Certification Date:	15-FEB-10
Primary Sic:	4212-Local Trucking Without Storage
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	CAS000001
Status:	Active
Agency Number:	0
Region:	9
Regulatory Measure ID:	401913
Order Number:	97-03-DWQ
Regulatory Measure Type:	Enrollee
Place ID:	Not reported
WDID:	9 371022541
Program Type:	Industrial
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	03/03/2010
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Gate Gourmet
Discharge Address:	3870 Houston Street
Discharge City:	San Diego
Discharge State:	California
Discharge Zip:	92110
Received Date:	Not reported
Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BURKE CO THE 08 (Continued)

1000268195

Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

CIWQS:

Name:	GATE GOURMET UNIT 734
Address:	3870 HOUSTON ST
City,State,Zip:	SAN DIEGO, CA 92110
Agency:	Gate Gourmet
Agency Address:	3870 Houston Street, San Diego , CA 92110
Place/Project Type:	Industrial - Local Trucking Without Storage
SIC/NAICS:	4212
Region:	9
Program:	INDSTW

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BURKE CO THE 08 (Continued)

1000268195

Regulatory Measure Status: Active
Regulatory Measure Type: Storm water industrial
Order Number: 2014-0057-DWQ
WDID: 9 37I022541
NPDES Number: CAS000001
Adoption Date: Not reported
Effective Date: 03/03/2010
Termination Date: Not reported
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 0
Violations within 5 years: 0
Latitude: 32.75717
Longitude: -117.20859

CERS:

Name: GATE GOURMET UNIT 734
Address: 3870 HOUSTON ST
City,State,Zip: SAN DIEGO, CA 92110
Site ID: 532606
CERS ID: 801747
CERS Description: Industrial Facility Storm Water

Violations:

Site ID: 532606
Site Name: Gate Gourmet Unit 734
Violation Date: 07-02-2012
Citation: 2014-0057-DWQ - Industrial General Permit
Violation Description: SW - Late Report
Violation Notes: Notified by phone 08/08/12 that 2011-2012 Annual Storm Water Report was past due
Violation Division: Water Boards
Violation Program: INDSTW
Violation Source: SMARTS

Enforcement Action:

Site ID: 532606
Site Name: Gate Gourmet Unit 734
Site Address: 3870 HOUSTON ST
Site City: SAN DIEGO
Site Zip: 92110
Enf Action Date: 10-16-2012
Enf Action Type: Industrial Storm Water Enforcement
Enf Action Description: Industrial Storm Water Enforcement
Enf Action Notes: Sent letter of Notice of Non-Compliance
Enf Action Division: Water Boards
Enf Action Program: INDSTW
Enf Action Source: SMARTS

Affiliation:

Affiliation Type Desc: Owner/Operator
Entity Name: Gate Gourmet
Entity Title: Operator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BURKE CO THE 08 (Continued)

1000268195

Affiliation Address: 3870 Houston Street
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110
Affiliation Phone: Not reported

136
SSE
1/4-1/2
0.466 mi.
2461 ft.

STONEWOOD GARDENS APARTMENTS
3835 MIDWAY DR
SAN DIEGO, CA 92110

SAN DIEGO CO. SAM **S108724718**
N/A

Relative:
Lower
Actual:
12 ft.

SAN DIEGO CO. SAM:
Name: STONEWOOD GARDENS APARTMENTS
Address: 3835 MIDWAY DR
City,State,Zip: SAN DIEGO, CA 92110
Case Number: 2007-324-001
Agency: DEH Site Assessment & Mitigation
Funding: MLCP
Facility Type: Complaint
Facility Status: Closed Case
Date: 7/2/2007
Date Began: Not reported

M137
WSW
1/4-1/2
0.473 mi.
2496 ft.

MISSION BAY MARINA
1548 QUIVIRA
SAN DEIGO, CA 92109

SAN DIEGO CO. SAM **S104746937**
San Diego Co. HMMD **N/A**
HIST CORTESE

Site 1 of 3 in cluster M

Relative:
Lower
Actual:
12 ft.

SAN DIEGO CO. SAM:
Name: AMERICA'S CUP FRANCE
Address: 1548 QUIVIRA WY
City,State,Zip: SAN DIEGO, CA 921098307
Case Number: H10545-001
Agency: DEH Site Assessment & Mitigation
Funding: Private - VAP
Facility Type: Drinking Water Aquifer Impacted
Facility Status: Closed Case
Date: 6/15/1987
Date Began: 12/18/1986

HMMD SAN DIEGO:

Name: AMERICA'S CUP FRANCE
Address: 1548 QUIVIRA WY
City,State,Zip: SAN DIEGO, CA 92109
Permit Number: 110545
Business Type: 6HK33
EPA Id Number: Not reported
APN: DEH-110545
Last HMMD Inspection: 06/16/1992
Facility Telephone: Not reported
Permit Status: INAC
Permit Expiration: 06/16/1992

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY MARINA (Continued)

S104746937

Date Last Updated: 11/02/2012
Facility Owner: Not reported
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: MISSION BAY MARINA/C P BLUTH
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 110545 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 110545
Tank Type: SINGLE WALL
Additional Id: 001
Capacity Gallons: 2500
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1987-01-12 00:00:00
Year Installed: 1979-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 110545 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 110545
Tank Type: SINGLE WALL
Additional Id: 002
Capacity Gallons: 4000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1987-01-12 00:00:00
Year Installed: 1979-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 110545 T003
Last Update: 2012-11-02 14:17:38
Permit Number: 110545
Tank Type: SINGLE WALL
Additional Id: 003
Capacity Gallons: 4000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY MARINA (Continued)

S104746937

Remove Close Date: 1987-01-12 00:00:00
Year Installed: 1979-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

UST Name: UNDERGROUND TANK 110545 T004
Last Update: 2012-11-02 14:17:38
Permit Number: 110545
Tank Type: SINGLE WALL
Additional Id: 004
Capacity Gallons: 4000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1987-01-12 00:00:00
Year Installed: 1979-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

HIST CORTESE:
edr_fname: MISSION BAY MARINA
edr_fadd1: 1548 QUIVIRA
City,State,Zip: SAN DIEGO, CA 92109
Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT261

M138 MISSION BAY MARINA
WSW 1548 QUIVIRA WAY
1/4-1/2 SAN DIEGO, CA 92109
0.473 mi.
2496 ft. Site 2 of 3 in cluster M

LUST S102433420
CPS-SLIC N/A
SWEEPS UST
CERS

Relative: LUST REG 9:
Lower Region: 9
Actual: Status: Case Closed
12 ft. Case Number: 9UT261
Local Case: H10545-001
Substance: 0
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Remove Contents
Source: Tank
Cause: Structure Failure
Lead Agency: Local Agency
Case Type: Other ground water affected
Date Found: 12/18/1986

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY MARINA (Continued)

S102433420

Date Stopped: 12/18/1986
Confirm Date: / /
Submit Workplan: Not reported
Prelim Assess: 02/18/1987
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 12/18/1986
Enforce Date: Not reported
Closed Date: 6/15/87
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: ~10
Beneficial Use: No Beneficial groundwater use
NPDES Number: Not reported
Priority: High priority
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

CPS-SLIC:

Name: AMERICA'S CUP FRANCE
Address: 1548 QUIVIRA WY
City,State,Zip: SAN DIEGO, CA 921098307
Region: STATE
Facility Status: Completed - Case Closed
Status Date: 06/15/1987
Global Id: T0607301361
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H10545-001
Latitude: 32.758912
Longitude: -117.238712
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: 9UT261
File Location: Local Agency
Potential Media Affected: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

SWEEPS UST:

Name: AMERICA'S CUP FRANCE
Address: 1548 QUIVIRA WAY
City: SAN DIEGO
Status: Active
Comp Number: 10545
Number: 9
Board Of Equalization: 44-022469
Referral Date: Not reported
Action Date: 06-26-92

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY MARINA (Continued)

S102433420

Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: Not reported
Tank Status: Not reported
Capacity: Not reported
Active Date: Not reported
Tank Use: Not reported
STG: Not reported
Content: Not reported
Number Of Tanks: Not reported

Name: AMERICA'S CUP FRANCE
Address: 1548 QUIVIRA WAY
City: SAN DIEGO
Status: Not reported
Comp Number: 10545
Number: Not reported
Board Of Equalization: 44-022469
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-010545-000001
Tank Status: Not reported
Capacity: 2500
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: 4

Name: AMERICA'S CUP FRANCE
Address: 1548 QUIVIRA WAY
City: SAN DIEGO
Status: Not reported
Comp Number: 10545
Number: Not reported
Board Of Equalization: 44-022469
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-010545-000002
Tank Status: Not reported
Capacity: 4000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: Not reported

Name: AMERICA'S CUP FRANCE
Address: 1548 QUIVIRA WAY
City: SAN DIEGO
Status: Not reported
Comp Number: 10545
Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION BAY MARINA (Continued)

S102433420

Board Of Equalization: 44-022469
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-010545-000003
Tank Status: Not reported
Capacity: 4000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: Not reported

Name: AMERICA'S CUP FRANCE
Address: 1548 QUIVIRA WAY
City: SAN DIEGO
Status: Not reported
Comp Number: 10545
Number: Not reported
Board Of Equalization: 44-022469
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-010545-000004
Tank Status: Not reported
Capacity: 4000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: Not reported

CERS:
Name: AMERICA'S CUP FRANCE
Address: 1548 QUIVIRA WY
City,State,Zip: SAN DIEGO, CA 921098307
Site ID: 190609
CERS ID: T0607301361
CERS Description: Cleanup Program Site

139
SSE
1/4-1/2
0.473 mi.
2499 ft.

Relative:
Lower

Actual:
15 ft.

GENIE CAR WASH
3949 POINT LOMA BLVD W
SAN DIEGO, CA 92110

LUST:
Name: GENIE CAR WASH
Address: 3949 W POINT LOMA BL
City,State,Zip: SAN DIEGO, CA 92110
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site

LUST
SAN DIEGO CO. SAM
San Diego Co. HMMD
CERS HAZ WASTE
HIST UST
HIST CORTESE
SAN DIEGO CO LOP
CERS

1000248363
N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607302125
Global Id: T0607302125
Latitude: 32.7549018
Longitude: -117.2195591
Status: Completed - Case Closed
Status Date: 04/22/2011
Case Worker: NS
RB Case Number: 9UT3363
Local Agency: SAN DIEGO COUNTY LOP
File Location: Local Agency
Local Case Number: H00703-001
Potential Media Affect: Other Groundwater (uses other than drinking water)
Potential Contaminants of Concern: Gasoline
Site History: For Closure Summary, please refer to

LUST:

Global Id: T0607302125
Contact Type: Local Agency Caseworker
Contact Name: NASSER SIONIT
Organization Name: SAN DIEGO COUNTY LOP
Address: P.O. Box 129261
City: San Diego
Email: nasser.sionit@sdcounty.ca.gov
Phone Number: Not reported

LUST:

Global Id: T0607302125
Action Type: ENFORCEMENT
Date: 07/09/2009
Action: Letter - Notice

Global Id: T0607302125
Action Type: ENFORCEMENT
Date: 06/30/2009
Action: Notice to Comply

Global Id: T0607302125
Action Type: ENFORCEMENT
Date: 06/30/2009
Action: Letter - Notice

Global Id: T0607302125
Action Type: ENFORCEMENT
Date: 11/08/2010
Action: Clean Up Fund - Case Closure Review Summary Report (RSR)

Global Id: T0607302125
Action Type: ENFORCEMENT
Date: 11/04/2009
Action: Letter - Notice

Global Id: T0607302125
Action Type: ENFORCEMENT
Date: 04/14/2009
Action: File review

Global Id: T0607302125

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Action Type:	ENFORCEMENT
Date:	04/14/2010
Action:	Clean Up Fund - Case Closure Review Summary Report (RSR)
Global Id:	T0607302125
Action Type:	ENFORCEMENT
Date:	04/14/2010
Action:	Clean Up Fund - Case Closure Review Summary Report (RSR)
Global Id:	T0607302125
Action Type:	ENFORCEMENT
Date:	03/22/2010
Action:	Clean Up Fund - Case Closure Review Summary Report (RSR)
Global Id:	T0607302125
Action Type:	Other
Date:	12/13/1994
Action:	Leak Began
Global Id:	T0607302125
Action Type:	ENFORCEMENT
Date:	04/30/2010
Action:	File review
Global Id:	T0607302125
Action Type:	ENFORCEMENT
Date:	04/14/2010
Action:	Letter - Notice
Global Id:	T0607302125
Action Type:	ENFORCEMENT
Date:	04/14/2010
Action:	Letter - Notice
Global Id:	T0607302125
Action Type:	Other
Date:	12/13/1994
Action:	Leak Discovery
Global Id:	T0607302125
Action Type:	RESPONSE
Date:	02/04/2010
Action:	Site Assessment Report
Global Id:	T0607302125
Action Type:	RESPONSE
Date:	11/12/2010
Action:	Monitoring Report - Quarterly
Global Id:	T0607302125
Action Type:	RESPONSE
Date:	01/01/2011
Action:	Monitoring Report - Quarterly
Global Id:	T0607302125
Action Type:	ENFORCEMENT
Date:	04/22/2011

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Action: Closure/No Further Action Letter

Global Id: T0607302125

Action Type: Other

Date: 12/13/1994

Action: Leak Stopped

Global Id: T0607302125

Action Type: ENFORCEMENT

Date: 01/11/1995

Action: Notice of Responsibility

Global Id: T0607302125

Action Type: Other

Date: 12/13/1994

Action: Leak Reported

Global Id: T0607302125

Action Type: RESPONSE

Date: 08/13/2009

Action: Verbal Communication

LUST:

Global Id: T0607302125

Status: Open - Case Begin Date

Status Date: 12/13/1994

Global Id: T0607302125

Status: Open - Site Assessment

Status Date: 12/01/1997

Global Id: T0607302125

Status: Completed - Case Closed

Status Date: 04/22/2011

LUST REG 9:

Region: 9

Status: Preliminary site assessment workplan submitted

Case Number: 9UT3363

Local Case: H00703-001

Substance: Regular Gasoline

Qty Leaked: 0

Abate Method: Excavate and Dispose - remove contaminated soil and dispose in approved site

Local Agency: San Diego

How Found: Not reported

How Stopped: Not reported

Source: Not reported

Cause: Not reported

Lead Agency: Local Agency

Case Type: Soil only

Date Found: 12/13/1994

Date Stopped: 12/13/1994

Confirm Date: 01/05/1995

Submit Workplan: 1/5/95

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Prelim Assess: / /
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 12/13/1994
Enforce Date: 1/11/95
Closed Date: Not reported
Enforce Type: SEL
Pilot Program: LOP
Basin Number: 908.10
GW Depth: Not reported
Beneficial Use: No Beneficial groundwater use
NPDES Number: Not reported
Priority: Low priority. Priority ranking can change over time.
File Dispn: Administratively opened on database, however no file physically exists
Interim Remedial Actions: Not reported
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

SAN DIEGO CO. SAM:

Name: GENIE CAR WASH
Address: 3949 W POINT LOMA BL
City,State,Zip: SAN DIEGO, CA 92110
Case Number: H00703-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - State Fund
Facility Type: GW With No Beneficial Use Designation
Facility Status: Remedial Investigation
Date: 1/5/1999
Date Began: 12/13/1994

HMMD SAN DIEGO:

Name: GENIE CAR WASH
Address: 3949 W POINT LOMA BLVD
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 100703
Business Type: 6HK30
EPA Id Number: CAD981685340
APN: 441-370-20-00
Last HMMD Inspection: 02/19/2010
Facility Telephone: 619-223-6830
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: RAFIDAIN CORP
Facility Mailing Address: 3949 W POINT LOMA BL
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92110-5602
UST Owner: RAFIDAN CORP
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 100703
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING: MOTOR OIL
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: OIL: WASTE MOTOR OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100703
Update Date: 11/02/2012
Case Number: 107-21-1
Name: WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information: WASTE ANTIFREEZE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: VORTEX
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 10/04/2006
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2); 66262.34(a)(3) & 66262.34(f)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0208
Violation: STORAGE AREA: NO WEEKLY INSPECTION
Violation Citation: Hazardous waste storage area is not being inspected weekly for deteriorated or leaking containers CCR 66265.174

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0406
Violation: CONT PLAN NOT PREPARED/ONSITE
Violation Citation: Owner/Operator has not prepared an Emergency Contingency Plan, or maintained a copy on site, or submitted a copy to the HMMD. CCR 66265.51(a), 66265.53(a)&(b)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV1605
Violation: NO DAILY TANK INSPECTION/LOG
Violation Citation: Failed to inspect and/or document daily HW tank system inspections. 66265.195 (c)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV1606
Violation: IMPROPER/ABSENT SPILL OR OVERFILL PROTEC
Violation Citation: Failed to use proper spill/overfill prevention controls and practices. 66265.194(a)&(b)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0215
Violation: OIL FILTERS IMPROPERLY MANAGED
Violation Citation: Used oil filters not properly drained, stored, or labeled prior to transport for the purpose of metal reclamation. CCR 66266.130

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel filters. 25250.22 and 66266.130(c)(3)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0149
Violation: NO RECEIPTS (3 YRS) FOR OIL/FUEL FILTERS
Violation Citation: Failed to keep disposal receipts (3 years) for drained used oil filters and/or drained fuel filters. 25250.22 and 66266.130(c)(5)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 05/09/2008
Violation Code: 6HV1601
Violation: HAZWASTE TANKS W/O P.E. ASSESSMENT
Violation Citation: Failed to obtain a P.E. assessment for hazardous waste tank system. 66265.191(a) or 66265.192(a)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 05/09/2008
Violation Code: 6HV1605
Violation: NO DAILY TANK INSPECTION/LOG
Violation Citation: Failed to inspect and/or document daily HW tank system inspections. 66265.195 (c)

Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 100703 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 100703
Tank Type: SINGLE WALL
Additional Id: REGULAR UN
Capacity Gallons: 10000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Remove Close Date: 1994-12-13 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 100703 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 100703
Tank Type: SINGLE WALL
Additional Id: PREMIUM UN
Capacity Gallons: 10000
UST Contents: PREMIUM UNLEADED
Other Content Info: PREMIUM UNLEADED
Reg Status: REMOVED
Remove Close Date: 1994-12-13 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

Name: GENIE CAR WASH
Address: 3949 W POINT LOMA BLVD
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 100703
Business Type: 6HK30
EPA Id Number: CAD981685340
APN: 441-370-20-00
Last HMMD Inspection: 02/19/2010
Facility Telephone: 619-223-6830
Permit Status: OPEN
Permit Expiration: 06/30/2013
Date Last Updated: 11/02/2012
Facility Owner: RAFIDAIN CORP
Facility Mailing Address: 3949 W POINT LOMA BL
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92110-5602
UST Owner: RAFIDAN CORP
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 100703
Update Date: 11/02/2012
Case Number: 8002-05-9
Name: OIL, LUBRICATING: MOTOR OIL
Other Information: Not reported
Material Waste: Material

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Hazardous Categories 1: FIRE
Hazardous Categories 2: ACUTE

Permit Number: 100703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 221 WASTE OIL & MIXED OIL
Other Information: OIL: WASTE MOTOR OIL
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100703
Update Date: 11/02/2012
Case Number: 107-21-1
Name: WASTE 342 ORGANIC LIQUIDS W/METALS
Other Information: WASTE ANTIFREEZE
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Permit Number: 100703
Update Date: 11/02/2012
Case Number: Not reported
Name: WASTE 888 USED OIL FILTERS
Other Information: VORTEX
Material Waste: Waste
Hazardous Categories 1: Not reported
Hazardous Categories 2: Not reported

Violations Active Permits:

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 10/04/2006
Violation Code: 6HV1009
Violation: HMBP: INADEQUATE SITE MAP
Violation Citation: Business Plan does not have a site map which provides sufficient or complete information for emergency response agencies. HSC 25509(a)(5) & 25505(a)(2)
Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0201
Violation: WASTE CONTAINER NOT CLOSED
Violation Citation: Hazardous waste containers are not kept closed while in storage. CCR 66265.173(a)
Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0202
Violation: WASTE CONTAINER W/O LABELS
Violation Citation: Hazardous waste containers &/or tanks are missing labels, accumulation date and/or are improperly labeled. CCR 66262.34(a)(2);

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

66262.34(a)(3) & 66262.34(f)
Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0208
Violation: STORAGE AREA: NO WEEKLY INSPECTION
Violation Citation: Hazardous waste storage area is not being inspected weekly for deteriorated or leaking containers CCR 66265.174

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0401
Violation: TRAINING RECORDS UNAVAILABLE
Violation Citation: Personnel training records are not maintained to document compliance with requirements for current and former employees. CCR 66265.16(d)&(e)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0406
Violation: CONT PLAN NOT PREPARED/ONSITE
Violation Citation: Owner/Operator has not prepared an Emergency Contingency Plan, or maintained a copy on site, or submitted a copy to the HMMD. CCR 66265.51(a), 66265.53(a)&(b)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV1605
Violation: NO DAILY TANK INSPECTION/LOG
Violation Citation: Failed to inspect and/or document daily HW tank system inspections. 66265.195 (c)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV1606
Violation: IMPROPER/ABSENT SPILL OR OVERFILL PROTEC
Violation Citation: Failed to use proper spill/overfill prevention controls and practices. 66265.194(a)&(b)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0215
Violation: OIL FILTERS IMPROPERLY MANAGED
Violation Citation: Used oil filters not properly drained, stored, or labeled prior to transport for the purpose of metal reclamation. CCR 66266.130

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0218
Violation: FILTERS:FUEL/OIL NOT LABELED OR CLOSED
Violation Citation: Failed to label &/or close drained used oil filters &/or used fuel filters. 25250.22 and 66266.130(c)(3)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 02/19/2010
Violation Code: 6HV0149
Violation: NO RECEIPTS (3 YRS) FOR OIL/FUEL FILTERS
Violation Citation: Failed to keep disposal receipts (3 years) for drained used oil filters and/or drained fuel filters. 25250.22 and 66266.130(c)(5)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 05/09/2008
Violation Code: 6HV1601
Violation: HAZWASTE TANKS W/O P.E. ASSESSMENT
Violation Citation: Failed to obtain a P.E. assessment for hazardous waste tank system. 66265.191(a) or 66265.192(a)

Activity: ACTIVE

Permit Number: 100703
Update Date: 11/02/2012
Inspection Date: 05/09/2008
Violation Code: 6HV1605
Violation: NO DAILY TANK INSPECTION/LOG
Violation Citation: Failed to inspect and/or document daily HW tank system inspections. 66265.195 (c)

Activity: ACTIVE

UST:

UST Name: UNDERGROUND TANK 100703 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 100703
Tank Type: SINGLE WALL
Additional Id: REGULAR UN
Capacity Gallons: 10000
UST Contents: REGULAR UNLEADED
Other Content Info: REGULAR UNLEADED
Reg Status: REMOVED
Remove Close Date: 1994-12-13 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 100703 T002

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Last Update: 2012-11-02 14:17:38
Permit Number: 100703
Tank Type: SINGLE WALL
Additional Id: PREMIUM UN
Capacity Gallons: 10000
UST Contents: PREMIUM UNLEADED
Other Content Info: PREMIUM UNLEADED
Reg Status: REMOVED
Remove Close Date: 1994-12-13 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

Name: GENIE CAR WASH
Address: 3949 W POINT LOMA BLVD
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: Not reported
Business Type: Not reported
EPA Id Number: CAD981685340
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 619-223-6830
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 06/19/2018
Facility Owner: Not reported
Facility Mailing Address: 3949 W POINT LOMA BL, SAN DIEGO, CA 92110-5602
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:
Record ID: DEH2002-HUPFP-100703
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100703
Program Element: Hazardous Waste Generator
Inspection Type: Routine
Inspection Number: 4088759
Return To Compliance Date: 2016-01-27T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-19T00:00:00.000
Inspection Date: 2014-09-30T14:14:00.000
Violation Code: 3030029 Failure of the owner or operator to conduct inspections and

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

maintain inspection records at the facility of the following tank equipment: 22 CCR 15 66265.195(a).

Record ID: DEH2002-HUPFP-100703
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100703
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 4088759
Return To Compliance Date: 2016-01-27T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-19T00:00:00.000
Inspection Date: 2014-09-30T14:14:00.000
Violation Code: 1010008 Failure to submit inventory reports (Activities, Owner/Operator, Hazardous Materials Descriptions and Map pages, if required. Documentation must be resubmitted (for facilities which exceed EPCRA thresholds) or re-certified (for facilities which do not exceed EPCRA thresholds) by March 1; 19 CCR 4 2729.4(b), 2729.5.

Record ID: DEH2002-HUPFP-100703
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100703
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5426115
Return To Compliance Date: 2016-03-01T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-19T00:00:00.000
Inspection Date: 2016-01-27T16:42:00.000
Violation Code: 1020002 Initial and/or annual employee training not conducted for hazardous materials management and/or employee training records not available or not maintained for 3 years. HSC 25505(a)(4)

Record ID: DEH2002-HUPFP-100703
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100703
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5837535
Return To Compliance Date: 2018-02-15T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-06-19T00:00:00.000
Inspection Date: 2018-01-29T14:40:00.000
Violation Code: 1020002 Initial &/or annual employee training not conducted in safety procedures for a hazardous material release or threatened release &/or

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

employee training records not available or not maintained for 3 years.
HSC 25505(a)(4); 19 CCR 2659(b)

UST DTL:

Record ID: DEH2002-HUPFP-100703
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100703
Facility Type (Ust Facility): Not reported
Tank Owner Name: RAFIDAIN CORP
Tankid: 15825
Tank Status: Removed
Date Ust Permanently Closed: 12/13/1994
Tank Use: 01
Piping System Type: Not reported
Last Updated: 2018-06-19T02:31:23.000
Tank Capacityin Gallons: 10000
Tank Contents: 1A
Type Of Tank: 01

Record ID: DEH2002-HUPFP-100703
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-100703
Facility Type (Ust Facility): Not reported
Tank Owner Name: RAFIDAIN CORP
Tankid: 15826
Tank Status: Removed
Date Ust Permanently Closed: 12/13/1994
Tank Use: 01
Piping System Type: Not reported
Last Updated: 2018-06-19T02:31:23.000
Tank Capacityin Gallons: 10000
Tank Contents: 1B
Type Of Tank: 01

Waste and Materials:

Record ID: DEH2002-HUPFP-100703
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088516
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-24T02:31:28.000
Chemical Name: OIL, LUBRICATING: MOTOR OIL
Common Name: OIL, LUBRICATING: MOTOR OIL
Case Number: 8002-05-9

Record ID: DEH2002-HUPFP-100703
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0088517
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-06-24T02:31:28.000
Chemical Name: Ethylene Glycol

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Common Name:	Ethylene Glycol
Case Number:	107-21-1
Record ID:	DEH2002-HUPFP-100703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0070693
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-24T02:31:28.000
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL
Common Name:	OIL: WASTE MOTOR OIL
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2016-HWAST-0070694
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2017-06-24T02:31:28.000
Chemical Name:	WASTE 342 ORGANIC LIQUIDS W/METALS
Common Name:	WASTE ANTIFREEZE
Case Number:	Not reported
Record ID:	DEH2002-HUPFP-100703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0167785
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-06-19T02:31:23.000
Chemical Name:	OIL, LUBRICATING: MOTOR OIL
Common Name:	OIL, LUBRICATING: MOTOR OIL
Case Number:	8002-05-9
Record ID:	DEH2002-HUPFP-100703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HCHEM-0167786
Trade Secret:	N
Hazardous Material Type:	Pure
Last Updated:	2018-06-19T02:31:23.000
Chemical Name:	Ethylene Glycol
Common Name:	Ethylene Glycol
Case Number:	107-21-1
Record ID:	DEH2002-HUPFP-100703
Permit Status:	Permit Renewed
Active Permit:	Y
Child Record Id:	DEH2018-HWAST-0142312
Trade Secret:	N
Hazardous Material Type:	Not reported
Last Updated:	2018-06-19T02:31:23.000
Chemical Name:	WASTE 221 WASTE OIL & MIXED OIL
Common Name:	OIL: WASTE MOTOR OIL
Case Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Record ID: DEH2002-HUPFP-100703
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HWAST-0142313
Trade Secret: N
Hazardous Material Type: Not reported
Last Updated: 2018-06-19T02:31:23.000
Chemical Name: WASTE 342 ORGANIC LIQUIDS W/METALS
Common Name: WASTE ANTIFREEZE
Case Number: Not reported

CERS HAZ WASTE:

Name: GENIE CAR WASH
Address: 3949 W POINT LOMA BLVD
City,State,Zip: SAN DIEGO, CA 92110
Site ID: 32922
CERS ID: 10383805
CERS Description: Hazardous Waste Generator

HIST UST:

Name: GENIE CAR WASH
Address: 3949 W POINT LOMA BLVD
City,State,Zip: SAN DIEGO, CA 92110
File Number: 0002F1C3
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002F1C3.pdf>
Region: STATE
Facility ID: 00000011400
Facility Type: Gas Station
Other Type: CAR WASH
Contact Name: CHEVRON DEALER
Telephone: 6192236830
Owner Name: RAFIDAIN CORPORATION, FILING N
Owner Address: 3949 W. POINT LOMA BLVD.
Owner City,St,Zip: SAN DIEGO, CA 92110
Total Tanks: 0002

Tank Num: 001
Container Num: REGULAR UN
Year Installed: Not reported
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: UNLEADED
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

Tank Num: 002
Container Num: PREMIUM UN
Year Installed: Not reported
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: PREMIUM
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

[Click here for Geo Tracker PDF:](#)

HIST CORTESE:

edr_fname: GENIE CAR WASH
edr_fadd1: 3949 POINT LOMA
City,State,Zip: SAN DIEGO, CA 92110
Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT3363

SAN DIEGO CO LOP:

Name: GENIE CAR WASH
Address: 3949 W POINT LOMA BLVD
City,State,Zip: SAN DIEGO, CA 92110
Record ID: DEH1994-LSAM-H00703-001
Record Status: Completed
Opened Date: 12/13/1994
Parcel Number: 441-370-20-00
Case Type: LOP - Local Oversight Program
Historical Name: GENIE CAR WASH
SWRCB Global ID: T0607302125
Funding: S - LOP State Fund
Lead Agency: DEH/SAM
Lead Agency Date: 01/05/1995
Census Tract: 68.02
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Latitude: 32.7542456
Longitude: -117.2213095
X MapCoord: 6263034.370
Y MapCoord: 1855608.270

CERS:

Name: GENIE CAR WASH
Address: 3949 W POINT LOMA BLVD
City,State,Zip: SAN DIEGO, CA 92110
Site ID: 32922
CERS ID: 10383805
CERS Description: Chemical Storage Facilities

Violations:

Site ID: 32922
Site Name: GENIE CAR WASH
Violation Date: 09-30-2014
Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2
Violation Description: Failure to annually review and electronically certify that the business plan is complete, accurate, and up-to-date.
Violation Notes: Returned to compliance on 01/27/2016.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Site ID: 32922
Site Name: GENIE CAR WASH
Violation Date: 01-27-2016
Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter 6.95, Section(s) 25505(a)(4)
Violation Description: Failure to provide initial and annual training to all employees in safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training records for a minimum of three years.
Violation Notes: Returned to compliance on 03/01/2016.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 32922
Site Name: GENIE CAR WASH
Violation Date: 01-29-2018
Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter 6.95, Section(s) 25505(a)(4)
Violation Description: Failure to provide initial and annual training to all employees in safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training records for a minimum of three years.
Violation Notes: Returned to compliance on 02/15/2018.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 32922
Site Name: GENIE CAR WASH
Violation Date: 09-30-2014
Citation: 22 CCR 15 66265.195(a) - California Code of Regulations, Title 22, Chapter 15, Section(s) 66265.195(a)
Violation Description: Failure of the owner or operator to conduct inspections and maintain inspection records at the facility of the following tank equipment: 1) Overfill/spill control equipment (e.g., waste-feed cutoff systems, bypass systems, and drainage systems) to ensure that it is in good working order; 2) The aboveground portions of the tank system, if any, to detect corrosion or releases of waste; 3) Data gathered from monitoring equipment and leak-detection equipment, (e.g., pressure and temperature gauges, monitoring wells) to ensure that the tank system is being operated according to its design; 4) The construction materials and the area immediately surrounding the externally accessible portion of the tank system including secondary containment structures (e.g., dikes) to detect erosion or signs of releases of hazardous waste (e.g., wet spots, dead vegetation); and 5) For uncovered tanks, the level of waste in the tank, to ensure compliance with section 66265.194(b)(3).
Violation Notes: Returned to compliance on 01/27/2016.
Violation Division: San Diego County Department of Env Health
Violation Program: HW
Violation Source: CERS

Evaluation:
Eval General Type: Compliance Evaluation Inspection
Eval Date: 01-27-2016
Violations Found: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Burke Mike Inspection ID:5426115
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	01-27-2016
Violations Found:	Yes
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Burke Mike Inspection ID:5426115
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	01-29-2018
Violations Found:	No
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Burke Mike Inspection ID:5837535
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	01-29-2018
Violations Found:	Yes
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Burke Mike Inspection ID:5837535
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	09-30-2014
Violations Found:	Yes
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Central HC009 Inspection ID:4088759
Eval Division:	San Diego County Department of Env Health
Eval Program:	HMRRP
Eval Source:	CERS
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	09-30-2014
Violations Found:	Yes
Eval Type:	Routine done by local agency
Eval Notes:	Inspector: Central HC009 Inspection ID:4088759
Eval Division:	San Diego County Department of Env Health
Eval Program:	HW
Eval Source:	CERS
Coordinates:	
Site ID:	32922
Facility Name:	GENIE CAR WASH
Env Int Type Code:	HWG
Program ID:	10383805
Coord Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Ref Point Type Desc: Center of a facility or station.
Latitude: 32.754250
Longitude: -117.221310

Affiliation:

Affiliation Type Desc: Legal Owner
Entity Name: rafidain
Entity Title: Not reported
Affiliation Address: 3949 west point loma blvd
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92110
Affiliation Phone: (619) 223-6830

Affiliation Type Desc: Local Agency Caseworker
Entity Name: NASSER SIONIT - SAN DIEGO COUNTY LOP
Entity Title: Not reported
Affiliation Address: P.O. Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation
Entity Name: GENIE CAR WASH
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 3949 W POINT LOMA BL
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110-5602
Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District
Entity Name: San Diego County Env Health
Entity Title: Not reported
Affiliation Address: PO Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92112-9261
Affiliation Phone: (858) 505-6880

Affiliation Type Desc: Environmental Contact
Entity Name: zaid daymia

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Entity Title: Not reported
Affiliation Address: 3949 W POINT LOMA BLVD
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110
Affiliation Phone: Not reported

Affiliation Type Desc: Operator
Entity Name: RAFIDAIN CORP
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 223-6830

Name: GENIE CAR WASH
Address: 3949 W POINT LOMA BLVD
City,State,Zip: SAN DIEGO, CA 92110
Site ID: 32922
CERS ID: T0607302125
CERS Description: Leaking Underground Storage Tank Cleanup Site

Violations:
Site ID: 32922
Site Name: GENIE CAR WASH
Violation Date: 09-30-2014
Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2
Violation Description: Failure to annually review and electronically certify that the business plan is complete, accurate, and up-to-date.
Violation Notes: Returned to compliance on 01/27/2016.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 32922
Site Name: GENIE CAR WASH
Violation Date: 01-27-2016
Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter 6.95, Section(s) 25505(a)(4)
Violation Description: Failure to provide initial and annual training to all employees in safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training records for a minimum of three years.
Violation Notes: Returned to compliance on 03/01/2016.
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 32922
Site Name: GENIE CAR WASH
Violation Date: 01-29-2018
Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter 6.95, Section(s) 25505(a)(4)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Violation Description: Failure to provide initial and annual training to all employees in safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training records for a minimum of three years.

Violation Notes: Returned to compliance on 02/15/2018.

Violation Division: San Diego County Department of Env Health

Violation Program: HMRRP

Violation Source: CERS

Site ID: 32922

Site Name: GENIE CAR WASH

Violation Date: 09-30-2014

Citation: 22 CCR 15 66265.195(a) - California Code of Regulations, Title 22, Chapter 15, Section(s) 66265.195(a)

Violation Description: Failure of the owner or operator to conduct inspections and maintain inspection records at the facility of the following tank equipment: 1) Overfill/spill control equipment (e.g., waste-feed cutoff systems, bypass systems, and drainage systems) to ensure that it is in good working order; 2) The aboveground portions of the tank system, if any, to detect corrosion or releases of waste; 3) Data gathered from monitoring equipment and leak-detection equipment, (e.g., pressure and temperature gauges, monitoring wells) to ensure that the tank system is being operated according to its design; 4) The construction materials and the area immediately surrounding the externally accessible portion of the tank system including secondary containment structures (e.g., dikes) to detect erosion or signs of releases of hazardous waste (e.g., wet spots, dead vegetation); and 5) For uncovered tanks, the level of waste in the tank, to ensure compliance with section 66265.194(b)(3).

Violation Notes: Returned to compliance on 01/27/2016.

Violation Division: San Diego County Department of Env Health

Violation Program: HW

Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 01-27-2016

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Inspector: Burke Mike Inspection ID:5426115

Eval Division: San Diego County Department of Env Health

Eval Program: HW

Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 01-27-2016

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Inspector: Burke Mike Inspection ID:5426115

Eval Division: San Diego County Department of Env Health

Eval Program: HMRRP

Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 01-29-2018

Violations Found: No

Eval Type: Routine done by local agency

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Eval Notes: Inspector: Burke Mike Inspection ID:5837535
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 01-29-2018
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Burke Mike Inspection ID:5837535
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-30-2014
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Central HC009 Inspection ID:4088759
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-30-2014
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Central HC009 Inspection ID:4088759
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Coordinates:
Site ID: 32922
Facility Name: GENIE CAR WASH
Env Int Type Code: HWG
Program ID: 10383805
Coord Name: Not reported
Ref Point Type Desc: Center of a facility or station.
Latitude: 32.754250
Longitude: -117.221310

Affiliation:
Affiliation Type Desc: Legal Owner
Entity Name: rafidain
Entity Title: Not reported
Affiliation Address: 3949 west point loma blvd
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92110
Affiliation Phone: (619) 223-6830

Affiliation Type Desc: Local Agency Caseworker
Entity Name: NASSER SIONIT - SAN DIEGO COUNTY LOP
Entity Title: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GENIE CAR WASH (Continued)

1000248363

Affiliation Address: P.O. Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Parent Corporation
Entity Name: GENIE CAR WASH
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 3949 W POINT LOMA BL
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110-5602
Affiliation Phone: Not reported

Affiliation Type Desc: CUPA District
Entity Name: San Diego County Env Health
Entity Title: Not reported
Affiliation Address: PO Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92112-9261
Affiliation Phone: (858) 505-6880

Affiliation Type Desc: Environmental Contact
Entity Name: zaid daymia
Entity Title: Not reported
Affiliation Address: 3949 W POINT LOMA BLVD
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110
Affiliation Phone: Not reported

Affiliation Type Desc: Operator
Entity Name: RAFIDAIN CORP
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 223-6830

Map ID
Direction
Distance
Elevation

MAP FINDINGS

EDR ID Number
EPA ID Number

N140
SE
1/4-1/2
0.488 mi.
2577 ft.
Site 1 of 3 in cluster N

LUST
CPS-SLIC
San Diego Co. HMM
HIST UST
SAN DIEGO CO LOP
CERS
U001572840
N/A

Relative:
Lower

Actual:
12 ft.

LUST:

Name: GOLDEN CHARIOT TRUCKING
Address: 3495 KURTZ ST
City,State,Zip: SAN DIEGO, CA 921104430
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0608122119
Global Id: T0608122119
Latitude: 32.755628
Longitude: -117.210315
Status: Completed - Case Closed
Status Date: 10/01/2001
Case Worker: JC
RB Case Number: Not reported
Local Agency: SAN DIEGO COUNTY LOP
File Location: Local Agency
Local Case Number: H21153-001
Potential Media Affect: Other Groundwater (uses other than drinking water)
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:

Global Id: T0608122119
Contact Type: Local Agency Caseworker
Contact Name: JAMES CLAY
Organization Name: SAN DIEGO COUNTY LOP
Address: P.O. Box 129261
City: San Diego
Email: james.clay@sdcounty.ca.gov
Phone Number: Not reported

LUST:

Global Id: T0608122119
Action Type: Other
Date: 03/15/2001
Action: Leak Began

Global Id: T0608122119
Action Type: Other
Date: 03/15/2001
Action: Leak Discovery

Global Id: T0608122119
Action Type: Other
Date: 03/15/2001
Action: Leak Stopped

Global Id: T0608122119
Action Type: ENFORCEMENT
Date: 04/23/2001
Action: Notice of Responsibility

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOLDEN CHARIOT TRUCK LINES (Continued)

U001572840

Global Id: T0608122119
Action Type: ENFORCEMENT
Date: 10/01/2001
Action: Closure/No Further Action Letter

Global Id: T0608122119
Action Type: Other
Date: 03/15/2001
Action: Leak Reported

LUST:

Global Id: T0608122119
Status: Open - Case Begin Date
Status Date: 03/15/2001

Global Id: T0608122119
Status: Completed - Case Closed
Status Date: 10/01/2001

CPS-SLIC:

Name: LOYOLA TRUCKING INC
Address: 3495 KURTZ ST
City,State,Zip: SAN DIEGO, CA 921104430
Region: STATE
Facility Status: Completed - Case Closed
Status Date: 04/05/2001
Global Id: T0608180738
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H19221-001
Latitude: 32.755628
Longitude: -117.210315
Case Type: Cleanup Program Site
Case Worker: JC
Local Agency: SAN DIEGO COUNTY LOP
RB Case Number: Not reported
File Location: Local Agency
Potential Media Affected: Soil
Potential Contaminants of Concern: Gasoline
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

HMMD SAN DIEGO:

Name: CLEAN HARBORS ENVIRONMENTAL LLC
Address: 3495 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110-4430
Permit Number: Not reported
Business Type: Not reported
EPA Id Number: Not reported
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 310-403-3379
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 01/16/2018

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOLDEN CHARIOT TRUCK LINES (Continued)

U001572840

Facility Owner: Not reported
Facility Mailing Address: 3495 Kurtz St, San Diego, CA 92110
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: N
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:
Record ID: DEH2015-HUPFP-002071
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-002071
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5355275
Return To Compliance Date: 2015-09-29T00:00:00.000
Nov: No
Violation Classification: CLASS II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-11-21T13:47:40.000
Inspection Date: 2015-09-17T15:07:00.000
Violation Code: 1010001 HMBP not established/ implemented. HSC 25505(a) and 25507(a)

Record ID: DEH2015-HUPFP-002071
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-002071
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5355275
Return To Compliance Date: 2015-09-29T00:00:00.000
Nov: No
Violation Classification: CLASS II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2018-11-21T13:47:40.000
Inspection Date: 2015-09-17T15:07:00.000
Violation Code: HMD1001 Unified Program Facility permit not obtained for hazardous materials. SDCC 68.905

Record ID: DEH2015-HUPFP-002071
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-002071
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5741300
Return To Compliance Date: 2017-10-06T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOLDEN CHARIOT TRUCK LINES (Continued)

U001572840

Container/Tank Id: Not reported
Last Update: 2018-11-21T13:47:40.000
Inspection Date: 2017-09-08T15:00:00.000
Violation Code: 1010008 HMBP not certified annually as complete and accurate in CERS.
HSC 25508(a)(1)(A), 25508.2, 19 CCR 2654(b)

Waste and Materials:

Record ID: DEH2015-HUPFP-002071
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2015-HCHEM-0077763
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-03-29T09:39:12.000
Chemical Name: Propane
Common Name: Liquefied Petroleum Gas (lpg)
Case Number: 74-98-6

Record ID: DEH2015-HUPFP-002071
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0159671
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2018-11-21T13:47:44.000
Chemical Name: Propane
Common Name: Liquefied Petroleum Gas (lpg)
Case Number: 74-98-6

HIST UST:

Name: GOLDEN CHARIOT TRUCK LINES
Address: 3495 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110
File Number: Not reported
URL: Not reported
Region: STATE
Facility ID: 00000065109
Facility Type: Other
Other Type: TRUCKING CO.
Contact Name: DON FRITZGES
Telephone: 6192983800
Owner Name: WILLIAM & EDYTHE KENTON, TRUST
Owner Address: 3235 HANCOCK STREET
Owner City,St,Zip: SAN DIEGO, CA 92110
Total Tanks: 0001

Tank Num: 001
Container Num: #1
Year Installed: Not reported
Tank Capacity: 00010000
Tank Used for: PRODUCT
Type of Fuel: DIESEL
Container Construction Thickness: Not reported
Leak Detection: Stock Inventor

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOLDEN CHARIOT TRUCK LINES (Continued)

U001572840

SAN DIEGO CO LOP:

Name: GOLDEN CHARIOT TRUCKING
Address: 3495 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110
Record ID: DEH2001-LSAM-H21153-001
Record Status: Completed
Opened Date: 03/15/2001
Parcel Number: 441-330-01-00
Case Type: LOP - Local Oversight Program
Historical Name: TRUCK TERMINAL
SWRCB Global ID: T0608122119
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 04/05/2001
Census Tract: 65.00
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Latitude: 32.7555740
Longitude: -117.2102903
X MapCoord: 6266423.392
Y MapCoord: 1856072.636

CERS:

Name: CLEAN HARBORS ENVIRONMENTAL LLC
Address: 3495 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110
Site ID: 357962
CERS ID: 10643602
CERS Description: Chemical Storage Facilities

Violations:

Site ID: 357962
Site Name: Clean Harbors Environmental LLC
Violation Date: 09-17-2015
Citation: HSC 6.95 Multiple - California Health and Safety Code, Chapter 6.95, Section(s) Multiple
Violation Description: Business Plan Program - Administration/Documentation - General
Violation Notes: Returned to compliance on 09/29/2015. Inspection Sequence ID:5355275;Violation:HMD1001 Unified Program Facility permit not obtained for hazardous materials. SDCC 68.905
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 357962
Site Name: Clean Harbors Environmental LLC
Violation Date: 09-08-2017
Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2
Violation Description: Failure to annually review and electronically certify that the business plan is complete and accurate on or before the annual due date.
Violation Notes: Returned to compliance on 10/06/2017.
Violation Division: San Diego County Department of Env Health

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOLDEN CHARIOT TRUCK LINES (Continued)

U001572840

Violation Program: HMRRP
Violation Source: CERS

Site ID: 357962
Site Name: Clean Harbors Environmental LLC
Violation Date: 09-17-2015
Citation: HSC 6.95 25507 - California Health and Safety Code, Chapter 6.95, Section(s) 25507
Violation Description: Failure to adequately establish and implement a business plan when storing/handling a hazardous material at or above reportable quantities.

Violation Notes: Returned to compliance on 09/29/2015. Inspection Sequence ID:5355275
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Evaluation:
Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-08-2017
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Burke Mike Inspection ID:5741300
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-17-2015
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: McLernon Benjamin Inspection ID:5355275
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Coordinates:
Site ID: 357962
Facility Name: Clean Harbors Environmental LLC
Env Int Type Code: HMBP
Program ID: 10643602
Coord Name: Not reported
Ref Point Type Desc: Center of a facility or station.
Latitude: 32.755570
Longitude: -117.210290

Affiliation:
Affiliation Type Desc: Operator
Entity Name: Javier Manzano
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (310) 403-3379

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOLDEN CHARIOT TRUCK LINES (Continued)

U001572840

Affiliation Type Desc: Parent Corporation
Entity Name: Clean Harbors Environmental LLC
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Property Owner
Entity Name: William Kenton
Entity Title: Not reported
Affiliation Address: 3235 Hancock #200
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92110
Affiliation Phone: (619) 298-3818

Affiliation Type Desc: CUPA District
Entity Name: San Diego County Env Health
Entity Title: Not reported
Affiliation Address: PO Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92112-9261
Affiliation Phone: (858) 505-6880

Affiliation Type Desc: Document Preparer
Entity Name: Javier Manzano
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 3495 Kurtz St
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner
Entity Name: Alan McKim
Entity Title: Not reported
Affiliation Address: 42 Longwater Drive
Affiliation City: Norwell
Affiliation State: MA
Affiliation Country: United States

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOLDEN CHARIOT TRUCK LINES (Continued)

U001572840

Affiliation Zip: 02061
Affiliation Phone: (781) 792-5000

Affiliation Type Desc: Environmental Contact
Entity Name: Russ Stogsdill
Entity Title: Not reported
Affiliation Address: 3495 Kurtz St
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110
Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer
Entity Name: Javier Manzano
Entity Title: TS District Manager
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Name: GOLDEN CHARIOT TRUCKING
Address: 3495 KURTZ ST
City,State,Zip: SAN DIEGO, CA 921104430
Site ID: 198515
CERS ID: T0608122119
CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:
Affiliation Type Desc: Local Agency Caseworker
Entity Name: JAMES CLAY - SAN DIEGO COUNTY LOP
Entity Title: Not reported
Affiliation Address: P.O. Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

N141
SE
1/4-1/2
0.488 mi.
2577 ft.

GOLDEN CHARIOT TRUCKING
3495 KURTZ ST
SAN DIEGO, CA 92110
Site 2 of 3 in cluster N

SAN DIEGO CO. SAM
San Diego Co. HMM
SWEEPS UST
HIST UST
CERS

S104748888
N/A

Relative:
Lower
Actual:
12 ft.

SAN DIEGO CO. SAM:
Name: LOYOLA TRUCKING INC
Address: 3495 KURTZ ST
City,State,Zip: SAN DIEGO, CA 921104430
Case Number: H19221-001
Agency: DEH Site Assessment & Mitigation
Funding: **Private - VAP**
Facility Type: Soils Only
Facility Status: Closed Case

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOLDEN CHARIOT TRUCKING (Continued)

S104748888

Date: 4/5/2001
Date Began: 3/15/2001

Name: GOLDEN CHARIOT TRUCKING
Address: 3495 KURTZ ST
City,State,Zip: SAN DIEGO, CA 921104430
Case Number: H21153-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: GW With No Beneficial Use Designation
Facility Status: Closed Case
Date: 10/1/2001
Date Began: 3/15/2001

HMMD SAN DIEGO:

Name: GOLDEN CHARIOT TRUCKING
Address: 3495 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 121153
Business Type: Not reported
EPA Id Number: Not reported
APN: DEH-121153
Last HMMD Inspection: 12/19/1990
Facility Telephone: 619-226-1344
Permit Status: INAC
Permit Expiration: 12/19/1990
Date Last Updated: 11/02/2012
Facility Owner: GOLDEN CHARIOT TRUCKING
Facility Mailing Address: 3495 KURTZ ST
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92110-4430
UST Owner: GOLDEN CHARIOT TRUCKING
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 121153 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 121153
Tank Type: SINGLE WALL
Additional Id: 001
Capacity Gallons: 10000
UST Contents: DIESEL
Other Content Info: DIESEL
Reg Status: REMOVED
Remove Close Date: 1987-01-12 00:00:00
Year Installed: 1970-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOLDEN CHARIOT TRUCKING (Continued)

S104748888

Name: LOYOLA TRUCKING INC
Address: 3495 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 119221
Business Type: Not reported
EPA Id Number: Not reported
APN: DEH-119221
Last HMMI Inspection: 02/01/1991
Facility Telephone: 619-222-0548
Permit Status: INAC
Permit Expiration: 02/01/1991
Date Last Updated: 11/02/2012
Facility Owner: WILLIAM PLUMLEY
Facility Mailing Address: 3495 KURTZ ST
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92110-4430
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

SWEEPS UST:

Name: GOLDEN CHARIOT TRUCKING
Address: 3495 KURTZ ST
City: SAN DIEGO
Status: Not reported
Comp Number: 21153
Number: Not reported
Board Of Equalization: Not reported
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-021153-000001
Tank Status: Not reported
Capacity: 10000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: OTHER
Number Of Tanks: 1

HIST UST:

Name: GOLDEN CHARIOT TRUCK LINES
Address: 3495 KURTZ STREET
City,State,Zip: SAN DIEGO, CA 92110
File Number: 0002F58C
URL: <http://geotracker.waterboards.ca.gov/ustpdfs/pdf/0002F58C.pdf>
Region: Not reported
Facility ID: Not reported
Facility Type: Not reported
Other Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GOLDEN CHARIOT TRUCKING (Continued)

S104748888

Contact Name: Not reported
Telephone: Not reported
Owner Name: Not reported
Owner Address: Not reported
Owner City,St,Zip: Not reported
Total Tanks: Not reported

Tank Num: Not reported
Container Num: Not reported
Year Installed: Not reported
Tank Capacity: Not reported
Tank Used for: Not reported
Type of Fuel: Not reported
Container Construction Thickness: Not reported
Leak Detection: Not reported

[Click here for Geo Tracker PDF:](#)

CERS:

Name: LOYOLA TRUCKING INC
Address: 3495 KURTZ ST
City,State,Zip: SAN DIEGO, CA 921104430
Site ID: 249834
CERS ID: T0608180738
CERS Description: Cleanup Program Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker
Entity Name: JAMES CLAY - SAN DIEGO COUNTY LOP
Entity Title: Not reported
Affiliation Address: P.O. Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

**N142
SE
1/4-1/2
0.491 mi.
2590 ft.**

**TRUCK TERMINAL
3495 KURTS STREET
SAN DIEGO, CA 92110**

Site 3 of 3 in cluster N

**ENVIROSTOR S106797709
N/A**

**Relative:
Lower
Actual:
12 ft.**

ENVIROSTOR:
Name: TRUCK TERMINAL
Address: 3495 KURTS STREET
City,State,Zip: SAN DIEGO, CA 92110
Facility ID: 37420016
Status: Refer: 1248 Local Agency
Status Date: 04/12/2001
Site Code: Not reported
Site Type: Evaluation
Site Type Detailed: Evaluation
Acres: Not reported
NPL: NO
Regulatory Agencies: NONE SPECIFIED
Lead Agency: NONE SPECIFIED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TRUCK TERMINAL (Continued)

S106797709

Program Manager: Not reported
Supervisor: Referred - Not Assigned
Division Branch: Cleanup Cypress
Assembly: 78
Senate: 39
Special Program: Not reported
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: Not Applicable
Latitude: 32.75557
Longitude: -117.2102
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: NONE SPECIFIED
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: 37420016
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: SB 1248 Notification
Completed Date: 04/12/2001
Comments: SB 1248 San Diego County

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

143
ESE
1/4-1/2
0.493 mi.
2602 ft.

Relative:
Lower

Actual:
12 ft.

JENSEN MEAT COMPANY
3477 HANCOCK ST
SAN DIEGO, CA 92110

SAN DIEGO CO. SAM:

Name: XTERMITE INC
Address: 3477 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 921104307
Case Number: H04589-001
Agency: DEH Site Assessment & Mitigation
Funding: Private - VAP
Facility Type: Soils Only
Facility Status: Closed Case
Date: 10/22/1986
Date Began: 10/13/1986

LUST REG 9:

Region: 9

SAN DIEGO CO. SAM
LUST
CPS-SLIC
San Diego Co. HMMD
SWEEPS UST
HIST CORTESE
CERS

S102431899
N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JENSEN MEAT COMPANY (Continued)

S102431899

Status: Case Closed
Case Number: 9UT229
Local Case: H04589-001
Substance: 0
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Tank
Cause: Corrosion
Lead Agency: Local Agency
Case Type: Soil only
Date Found: 10/08/1986
Date Stopped: / /
Confirm Date: / /
Submit Workplan: Not reported
Prelim Assess: / /
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 10/08/1986
Enforce Date: Not reported
Closed Date: 10/22/86
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 907.11
GW Depth: >8FT
Beneficial Use: Not reported
NPDES Number: Not reported
Priority: Low priority. Priority ranking can change over time.
File Dispn: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

CPS-SLIC:

Name: XTERMITE INC
Address: 3477 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 921104307
Region: STATE
Facility Status: **Completed - Case Closed**
Status Date: 10/22/1986
Global Id: T0607301056
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H04589-001
Latitude: 32.756377
Longitude: -117.209079
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: 9UT229
File Location: Local Agency
Potential Media Affected: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JENSEN MEAT COMPANY (Continued)

S102431899

[Click here to access the California GeoTracker records for this facility:](#)

HMMD SAN DIEGO:

Name: XTERMITE INC
Address: 3477 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 104589
Business Type: 6HK18
EPA Id Number: Not reported
APN: 441-582-02-00
Last HMMD Inspection: 12/27/1999
Facility Telephone: Not reported
Permit Status: INAC
Permit Expiration: 03/31/2000
Date Last Updated: 11/02/2012
Facility Owner: Not reported
Facility Mailing Address: Not reported
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: JENSE MEAT CO
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 104589 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 104589
Tank Type: SINGLE WALL
Additional Id: 001
Capacity Gallons: 3000
UST Contents: LEADED
Other Content Info: LEADED
Reg Status: REMOVED
Remove Close Date: 1987-01-12 00:00:00
Year Installed: Not reported
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 90
UST Monitor Method: NO MONITORING ALTERNATIVE SELECTED. VERIFY AND ENTER MONITORING ALTERNATIVE DURING INSPECTION.

SWEEPS UST:

Name: JENSE MEAT CO AT0555
Address: 3477 HANCOCK ST
City: SAN DIEGO
Status: Active
Comp Number: 4589
Number: 9
Board Of Equalization: 44-022071
Referral Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

JENSEN MEAT COMPANY (Continued)

S102431899

Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: Not reported
Tank Status: Not reported
Capacity: Not reported
Active Date: Not reported
Tank Use: Not reported
STG: Not reported
Content: Not reported
Number Of Tanks: Not reported

Name: JENSE MEAT CO AT0555
Address: 3477 HANCOCK ST
City: SAN DIEGO
Status: Not reported
Comp Number: 4589
Number: Not reported
Board Of Equalization: 44-022071
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-004589-000001
Tank Status: Not reported
Capacity: 3000
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: LEADED
Number Of Tanks: 1

HIST CORTESE:

edr_fname: JENSEN MEAT COMPANY
edr_fadd1: 3477 HANCOCK
City,State,Zip: SAN DIEGO, CA 92110
Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT2298

CERS:

Name: XTERMITE INC
Address: 3477 HANCOCK ST
City,State,Zip: SAN DIEGO, CA 921104307
Site ID: 226931
CERS ID: T0607301056
CERS Description: Cleanup Program Site

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

M144
WSW
1/4-1/2
0.494 mi.
2607 ft.
Relative:
Lower
Actual:
12 ft.

1500 QUIVIRA WAY
1500 QUIVIRA WAY
SAN DIEGO, CA 92109
Site 3 of 3 in cluster M

LUST
CPS-SLIC
CERS HAZ WASTE
CHMIRS
ENF
NPDES
WDS
SAN DIEGO CO LOP
CIWQS
CERS
S102006434
N/A

LUST:

Name: 1500 QUIVIRA WAY
Address: 1500 QUIVIRA WAY
City,State,Zip: SAN DIEGO, CA 92109
Lead Agency: SAN DIEGO RWQCB (REGION 9)
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T10000005269
Global Id: T10000005269
Latitude: 32.7591915210515
Longitude: -117.239759984131
Status: Completed - Case Closed
Status Date: 08/27/2015
Case Worker: SM
RB Case Number: Not reported
Local Agency: Not reported
File Location: Local Agency
Local Case Number: Not reported
Potential Media Affect: Other Groundwater (uses other than drinking water), Soil
Potential Contaminants of Concern: Other Chlorinated Hydrocarbons, Other Petroleum, Waste Oil / Motor / Hydraulic / Lubricating
Site History: This is a new LOP Case. This section will be updated as data is received.

LUST:

Global Id: T10000005269
Contact Type: Regional Board Caseworker
Contact Name: SEAN MCCLAIN
Organization Name: SAN DIEGO RWQCB (REGION 9)
Address: 2375 NORTHSIDE DRIVE, SUITE 100
City: SAN DIEGO
Email: sean.mcclain@waterboards.ca.gov
Phone Number: 6195213374

LUST:

Global Id: T10000005269
Action Type: ENFORCEMENT
Date: 10/09/2014
Action: Referral to Regional Board

Global Id: T10000005269
Action Type: ENFORCEMENT
Date: 04/15/2014
Action: Technical Correspondence / Assistance / Other

Global Id: T10000005269
Action Type: ENFORCEMENT
Date: 06/15/2015
Action: Notification - Public Notice of Case Closure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Global Id:	T10000005269
Action Type:	Other
Date:	08/05/2013
Action:	Leak Began
Global Id:	T10000005269
Action Type:	ENFORCEMENT
Date:	06/15/2015
Action:	Notification - Fee Title Owners Notice
Global Id:	T10000005269
Action Type:	ENFORCEMENT
Date:	08/27/2015
Action:	Closure/No Further Action Letter
Global Id:	T10000005269
Action Type:	Other
Date:	08/05/2013
Action:	Leak Discovery
Global Id:	T10000005269
Action Type:	RESPONSE
Date:	12/18/2013
Action:	Site Assessment Report - Regulator Responded
Global Id:	T10000005269
Action Type:	RESPONSE
Date:	06/10/2015
Action:	Request for Closure - Regulator Responded
Global Id:	T10000005269
Action Type:	Other
Date:	08/07/2013
Action:	Leak Reported
Global Id:	T10000005269
Action Type:	ENFORCEMENT
Date:	12/04/2013
Action:	Notice of Responsibility
Global Id:	T10000005269
Action Type:	RESPONSE
Date:	02/09/2015
Action:	Other Report / Document

LUST:

Global Id:	T10000005269
Status:	Open - Case Begin Date
Status Date:	08/05/2013
Global Id:	T10000005269
Status:	Open - Site Assessment
Status Date:	11/19/2013
Global Id:	T10000005269
Status:	Open - Eligible for Closure
Status Date:	06/10/2015

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Global Id: T10000005269
Status: Completed - Case Closed
Status Date: 08/27/2015

CPS-SLIC:

Name: DRISCOLL MISSION BAY BOATYARD
Address: 1500 QUIVIRA WAY
City,State,Zip: SAN DIEGO, CA 92109
Region: STATE
Facility Status: **Open - Inactive**
Status Date: 11/15/2015
Global Id: T10000006510
Lead Agency: SAN DIEGO RWQCB (REGION 9)
Lead Agency Case Number: Not reported
Latitude: 32.7590976
Longitude: -117.2392433
Case Type: Cleanup Program Site
Case Worker: SAM
Local Agency: Not reported
RB Case Number: 3100109
File Location: Regional Board
Potential Media Affected: Sediments
Potential Contaminants of Concern: Copper
Site History: The property has been used as a boatyard since at least the mid-1960s for boat repair and maintenance operations. Historical discharges of copper have resulted in contamination of sediments proximal to the shoreline. The current 3.5-acre Driscoll Mission Bay facility is used for boat repair and maintenance operations and includes two travel lifts. The facility is enrolled in the NPDES program.

[Click here to access the California GeoTracker records for this facility:](#)

CERS HAZ WASTE:

Name: DRISCOLL MISSION BAY
Address: 1500 QUIVIRA WAY
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 391761
CERS ID: 10383379
CERS Description: Hazardous Waste Generator

CHMIRS:

Name: Not reported
Address: 1500 QUIVIRA WAY
City,State,Zip: SAN DIEGO, CA
OES Incident Number: 10-6804
OES notification: 11/11/2010
OES Date: Not reported
OES Time: Not reported
Date Completed: **Not reported**
Property Use: Not reported
Agency Id Number: Not reported
Agency Incident Number: Not reported
Time Notified: Not reported
Time Completed: Not reported
Surrounding Area: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Estimated Temperature:	Not reported
Property Management:	Not reported
More Than Two Substances Involved?:	Not reported
Resp Agency Personnel # Of Decontaminated:	Not reported
Responding Agency Personnel # Of Injuries:	Not reported
Responding Agency Personnel # Of Fatalities:	Not reported
Others Number Of Decontaminated:	Not reported
Others Number Of Injuries:	Not reported
Others Number Of Fatalities:	Not reported
Vehicle Make/year:	Not reported
Vehicle License Number:	Not reported
Vehicle State:	Not reported
Vehicle Id Number:	Not reported
CA DOT PUC/ICC Number:	Not reported
Company Name:	Not reported
Reporting Officer Name/ID:	Not reported
Report Date:	Not reported
Facility Telephone:	Not reported
Waterway Involved:	Yes
Waterway:	Quivira Basin
Spill Site:	Waterways,Ship/Harbor/Port
Cleanup By:	Unknown
Containment:	Not reported
What Happened:	Not reported
Type:	Not reported
Measure:	Sheen
Other:	Not reported
Date/Time:	1640
Year:	2010
Agency:	NRC
Incident Date:	11/11/2010
Admin Agency:	San Diego County Health Services Department
Amount:	Not reported
Contained:	Unknown
Site Type:	Quivira Basin
E Date:	Not reported
Substance:	Unknown Oil, Rainbow Colored, Fuel Oil Odor
Unknown:	Not reported
Substance #2:	Not reported
Substance #3:	Not reported
Evacuations:	Not reported
Number of Injuries:	Not reported
Number of Fatalities:	Not reported
#1 Pipeline:	Not reported
#2 Pipeline:	Not reported
#3 Pipeline:	Not reported
#1 Vessel >= 300 Tons:	Not reported
#2 Vessel >= 300 Tons:	Not reported
#3 Vessel >= 300 Tons:	Not reported
Evacs:	Not reported
Injuries:	Not reported
Fatals:	Not reported
Comments:	Not reported
Description:	Per NRC Report, "the caller is reporting a fuel spill at the Driscoll Docks, the source is unknown. The sheen has a heavy fuel oil odor."

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

ENF:

Name: DRISCOLL MISSION BAY
Address: 1500 QUIVIRA WAY
City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 220750
Agency Name: Driscoll Mission Bay, LLC
Place Type: Manufacturing
Place Subtype: Boatyard/Shipyard
Facility Type: Industrial
Agency Type: Privately-Owned Business
Of Agencies: 1
Place Latitude: 32.758614
Place Longitude: -117.24023
SIC Code 1: 3732
SIC Desc 1: Boat Building and Repairing
SIC Code 2: Not reported
SIC Desc 2: Not reported
SIC Code 3: Not reported
SIC Desc 3: Not reported
NAICS Code 1: Not reported
NAICS Desc 1: Not reported
NAICS Code 2: Not reported
NAICS Desc 2: Not reported
NAICS Code 3: Not reported
NAICS Desc 3: Not reported
Of Places: 1
Source Of Facility: Reg Meas
Design Flow: 0
Threat To Water Quality: 2
Complexity: C
Pretreatment: X - Facility is not a POTW
Facility Waste Type: Process waste, NEC
Facility Waste Type 2: Stormwater runoff
Facility Waste Type 3: Not reported
Facility Waste Type 4: Not reported
Program: NPDNONMUNIPRCS
Program Category1: NPDESWW
Program Category2: NPDESWW
Of Programs: 1
WDID: 9 000000305
Reg Measure Id: 388928
Reg Measure Type: Enrollee
Region: 9
Order #: R9-2013-0026
Npdes# CA#: CAG719001
Major-Minor: Minor
Npdes Type: OTH
Reclamation: N - No
Dredge Fill Fee: Not reported
301H: N
Application Fee Amt Received: Not reported
Status: Active
Status Date: 11/10/2014
Effective Date: 10/01/2013
Expiration/Review Date: 09/30/2018
Termination Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Y
Individual/General:	I
Fee Code:	57 - RB SW industrial Permits (INDSTW)
Direction/Voice:	Passive
Enforcement Id(EID):	403977
Region:	9
Order / Resolution Number:	Not reported
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	12/16/2015
Adoption/Issuance Date:	12/16/2015
Achieve Date:	Not reported
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Active
Title:	SEL for Driscoll Mission Bay, LLC
Description:	Not reported
Program:	NPDNONMUNIPRCS
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0

Name:	DRISCOLL MISSION BAY
Address:	1500 QUIVIRA WAY
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	220750
Agency Name:	Driscoll Mission Bay, LLC
Place Type:	Manufacturing
Place Subtype:	Boatyard/Shipyard
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.758614
Place Longitude:	-117.24023
SIC Code 1:	3732
SIC Desc 1:	Boat Building and Repairing
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	0
Threat To Water Quality:	2
Complexity:	C
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Stormwater runoff
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDNONMUNIPRCS
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000305
Reg Measure Id:	388928
Reg Measure Type:	Enrollee
Region:	9
Order #:	R9-2013-0026
Npdes# CA#:	CAG719001
Major-Minor:	Minor
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Active
Status Date:	11/10/2014
Effective Date:	10/01/2013
Expiration/Review Date:	09/30/2018
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Y
Individual/General:	I
Fee Code:	57 - RB SW industrial Permits (INDSTW)
Direction/Voice:	Passive
Enforcement Id(EID):	399391
Region:	9
Order / Resolution Number:	Not reported
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	01/15/2015
Adoption/Issuance Date:	01/15/2015
Achieve Date:	Not reported
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Active
Title:	SEL for Driscoll Mission Bay, LLC
Description:	October 9, 2014 Monitoring Plan is not acceptable.
Program:	NPDNONMUNIPRCS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	DRISCOLL MISSION BAY
Address:	1500 QUIVIRA WAY
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	220750
Agency Name:	Driscoll Mission Bay, LLC
Place Type:	Manufacturing
Place Subtype:	Boatyard/Shipyard
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.758614
Place Longitude:	-117.24023
SIC Code 1:	3732
SIC Desc 1:	Boat Building and Repairing
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	0
Threat To Water Quality:	2
Complexity:	C
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Stormwater runoff
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDPNONMUNIPRCS
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000305
Reg Measure Id:	388928
Reg Measure Type:	Enrollee
Region:	9
Order #:	R9-2013-0026
Npdes# CA#:	CAG719001
Major-Minor:	Minor
Npdes Type:	OTH

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Active
Status Date:	11/10/2014
Effective Date:	10/01/2013
Expiration/Review Date:	09/30/2018
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Y
Individual/General:	I
Fee Code:	57 - RB SW industrial Permits (INDSTW)
Direction/Voice:	Passive
Enforcement Id(EID):	396859
Region:	9
Order / Resolution Number:	Not reported
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	07/03/2014
Adoption/Issuance Date:	07/03/2014
Achieve Date:	Not reported
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Active
Title:	SEL for Driscoll Mission Bay, LLC - SW Retention
Description:	Category 1, but no sampling plan. Upgrading to meet 5 year storage
Program:	NPDNONMUNIPRCS
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	DRISCOLL MISSION BAY
Address:	1500 QUIVIRA WAY
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	220750
Agency Name:	Driscoll Mission Bay, LLC
Place Type:	Manufacturing
Place Subtype:	Boatyard/Shipyard
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.758614
Place Longitude:	-117.24023

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

SIC Code 1:	3732
SIC Desc 1:	Boat Building and Repairing
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	0
Threat To Water Quality:	2
Complexity:	C
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Stormwater runoff
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDISMSML
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000305
Reg Measure Id:	301234
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2006-0020
Npdes# CA#:	CA0109291
Major-Minor:	Minor
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	08/13/2013
Effective Date:	04/22/2006
Expiration/Review Date:	04/22/2011
Termination Date:	09/30/2013
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	399396
Region:	9
Order / Resolution Number:	Not reported
Enforcement Action Type:	Staff Enforcement Letter

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Effective Date: 01/15/2015
Adoption/Issuance Date: 01/15/2015
Achieve Date: Not reported
Termination Date: Not reported
ACL Issuance Date: Not reported
EPL Issuance Date: Not reported
Status: Active
Title: SEL for Driscoll Mission Bay, LLC
Description: Not reported
Program: NPDINDSML
Latest Milestone Completion Date: Not reported
Of Programs1: 1
Total Assessment Amount: 0
Initial Assessed Amount: 0
Liability \$ Amount: 0
Project \$ Amount: 0
Liability \$ Paid: 0
Project \$ Completed: 0
Total \$ Paid/Completed Amount: 0

Name: DRISCOLL MISSION BAY
Address: 1500 QUIVIRA WAY
City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 220750
Agency Name: Driscoll Mission Bay, LLC
Place Type: Manufacturing
Place Subtype: Boatyard/Shipyard
Facility Type: Industrial
Agency Type: Privately-Owned Business
Of Agencies: 1
Place Latitude: 32.758614
Place Longitude: -117.24023
SIC Code 1: 3732
SIC Desc 1: Boat Building and Repairing
SIC Code 2: Not reported
SIC Desc 2: Not reported
SIC Code 3: Not reported
SIC Desc 3: Not reported
NAICS Code 1: Not reported
NAICS Desc 1: Not reported
NAICS Code 2: Not reported
NAICS Desc 2: Not reported
NAICS Code 3: Not reported
NAICS Desc 3: Not reported
Of Places: 1
Source Of Facility: Reg Meas
Design Flow: 0
Threat To Water Quality: 2
Complexity: C
Pretreatment: X - Facility is not a POTW
Facility Waste Type: Process waste, NEC
Facility Waste Type 2: Stormwater runoff
Facility Waste Type 3: Not reported
Facility Waste Type 4: Not reported
Program: NPDINDSML
Program Category1: NPDESWWW

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000305
Reg Measure Id:	301234
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2006-0020
Npdes# CA#:	CA0109291
Major-Minor:	Minor
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	Not reported
Status:	Historical
Status Date:	08/13/2013
Effective Date:	04/22/2006
Expiration/Review Date:	04/22/2011
Termination Date:	09/30/2013
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	385573
Region:	9
Order / Resolution Number:	Not reported
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	01/30/2012
Adoption/Issuance Date:	01/30/2012
Achieve Date:	Not reported
Termination Date:	Not reported
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Active
Title:	SEL for Driscoll Mission Bay, LLC
Description:	Review of Oct-Dec 2006 through Jul-Sep 2011 quarterly reports and Jul 2006-Jun 2007 through Jul 2010-Jun 2011 annual reports.
Program:	NPDINDSML
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	DRISCOLL MISSION BAY
Address:	1500 QUIVIRA WAY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 220750
Agency Name: Driscoll Mission Bay, LLC
Place Type: Manufacturing
Place Subtype: Boatyard/Shipyard
Facility Type: Industrial
Agency Type: Privately-Owned Business
Of Agencies: 1
Place Latitude: 32.758614
Place Longitude: -117.24023
SIC Code 1: 3732
SIC Desc 1: Boat Building and Repairing
SIC Code 2: Not reported
SIC Desc 2: Not reported
SIC Code 3: Not reported
SIC Desc 3: Not reported
NAICS Code 1: Not reported
NAICS Desc 1: Not reported
NAICS Code 2: Not reported
NAICS Desc 2: Not reported
NAICS Code 3: Not reported
NAICS Desc 3: Not reported
Of Places: 1
Source Of Facility: Reg Meas
Design Flow: 0
Threat To Water Quality: 2
Complexity: C
Pretreatment: X - Facility is not a POTW
Facility Waste Type: Process waste, NEC
Facility Waste Type 2: Washwater waste
Facility Waste Type 3: Not reported
Facility Waste Type 4: Not reported
Program: NPDNONMUNIPRCS
Program Category1: NPDESWW
Program Category2: NPDESWW
Of Programs: 1
WDID: 9 000000305
Reg Measure Id: 213835
Reg Measure Type: Enrollee
Region: 9
Order #: R9-2000-0214
Npdes# CA#: CAG719001
Major-Minor: Not reported
Npdes Type: Not reported
Reclamation: N - No
Dredge Fill Fee: Not reported
301H: Not reported
Application Fee Amt Received: 1200
Status: Historical
Status Date: 05/17/2000
Effective Date: 10/22/1979
Expiration/Review Date: 05/16/2000
Termination Date: 05/16/2000
WDR Review - Amend: Not reported
WDR Review - Revise/Renew: Not reported
WDR Review - Rescind: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	Y
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	249677
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	01/22/2004
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	01/22/2004
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000305
Description:	see descriptions in violations; Tetra Tech inspection results
Program:	NPDNONMUNIPRCS
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	DRISCOLL MISSION BAY
Address:	1500 QUIVIRA WAY
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	220750
Agency Name:	Driscoll Mission Bay, LLC
Place Type:	Manufacturing
Place Subtype:	Boatyard/Shipyard
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.758614
Place Longitude:	-117.24023
SIC Code 1:	3732
SIC Desc 1:	Boat Building and Repairing
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	0
Threat To Water Quality:	2
Complexity:	C
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Washwater waste
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDSML
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000305
Reg Measure Id:	148279
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2000-0214
Npdes# CA#:	CA0109291
Major-Minor:	Minor
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	1200
Status:	Historical
Status Date:	04/18/2006
Effective Date:	10/11/2000
Expiration/Review Date:	04/12/2006
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	234783
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	05/31/2000
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	05/31/2000
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000305
Description:	Letter requesting penalty of perjury statement, timely report submittal, and revisions to discharger's visual observations practices.
Program:	NPDINDSML

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	DRISCOLL MISSION BAY
Address:	1500 QUIVIRA WAY
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	220750
Agency Name:	Driscoll Mission Bay, LLC
Place Type:	Manufacturing
Place Subtype:	Boatyard/Shipyard
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.758614
Place Longitude:	-117.24023
SIC Code 1:	3732
SIC Desc 1:	Boat Building and Repairing
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	0
Threat To Water Quality:	2
Complexity:	C
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Washwater waste
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDSML
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000305
Reg Measure Id:	148279
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2000-0214
Npdes# CA#:	CA0109291
Major-Minor:	Minor
Npdes Type:	OTH

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	1200
Status:	Historical
Status Date:	04/18/2006
Effective Date:	10/11/2000
Expiration/Review Date:	04/12/2006
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	234222
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Notice of Violation
Effective Date:	05/08/2000
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	05/08/2000
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000305
Description:	NOV 2000-95 issued for failure to submit self-monitoring reports for the 2, 3, and 4 quarters of 1998
Program:	NPDINDSML
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	DRISCOLL MISSION BAY
Address:	1500 QUIVIRA WAY
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	220750
Agency Name:	Driscoll Mission Bay, LLC
Place Type:	Manufacturing
Place Subtype:	Boatyard/Shipyard
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.758614
Place Longitude:	-117.24023

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

SIC Code 1:	3732
SIC Desc 1:	Boat Building and Repairing
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	0
Threat To Water Quality:	2
Complexity:	C
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Washwater waste
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDESML
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000305
Reg Measure Id:	148279
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2000-0214
Npdes# CA#:	CA0109291
Major-Minor:	Minor
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	1200
Status:	Historical
Status Date:	04/18/2006
Effective Date:	10/11/2000
Expiration/Review Date:	04/12/2006
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	234131
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Effective Date:	03/06/2000
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	03/06/2000
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000305
Description:	staff enforcement letter requesting submittal of delinquent monitoring reports
Program:	NPDINDSML
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	DRISCOLL MISSION BAY
Address:	1500 QUIVIRA WAY
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	220750
Agency Name:	Driscoll Mission Bay, LLC
Place Type:	Manufacturing
Place Subtype:	Boatyard/Shipyard
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.758614
Place Longitude:	-117.24023
SIC Code 1:	3732
SIC Desc 1:	Boat Building and Repairing
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported
# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	0
Threat To Water Quality:	2
Complexity:	C
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Washwater waste
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDSML

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000305
Reg Measure Id:	148279
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2000-0214
Npdes# CA#:	CA0109291
Major-Minor:	Minor
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	1200
Status:	Historical
Status Date:	04/18/2006
Effective Date:	10/11/2000
Expiration/Review Date:	04/12/2006
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	234130
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Oral Communication
Effective Date:	03/02/2000
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	03/02/2000
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000305
Description:	staff telephone call requesting submittal of delinquent monitoring reports
Program:	NPDINDSML
Latest Milestone Completion Date:	Not reported
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	DRISCOLL MISSION BAY
Address:	1500 QUIVIRA WAY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

City,State,Zip: SAN DIEGO, CA 92109
Region: 9
Facility Id: 220750
Agency Name: Driscoll Mission Bay, LLC
Place Type: Manufacturing
Place Subtype: Boatyard/Shipyards
Facility Type: Industrial
Agency Type: Privately-Owned Business
Of Agencies: 1
Place Latitude: 32.758614
Place Longitude: -117.24023
SIC Code 1: 3732
SIC Desc 1: Boat Building and Repairing
SIC Code 2: Not reported
SIC Desc 2: Not reported
SIC Code 3: Not reported
SIC Desc 3: Not reported
NAICS Code 1: Not reported
NAICS Desc 1: Not reported
NAICS Code 2: Not reported
NAICS Desc 2: Not reported
NAICS Code 3: Not reported
NAICS Desc 3: Not reported
Of Places: 1
Source Of Facility: Reg Meas
Design Flow: 0
Threat To Water Quality: 2
Complexity: C
Pretreatment: X - Facility is not a POTW
Facility Waste Type: Process waste, NEC
Facility Waste Type 2: Washwater waste
Facility Waste Type 3: Not reported
Facility Waste Type 4: Not reported
Program: NPDES SML
Program Category1: NPDES WW
Program Category2: NPDES WW
Of Programs: 1
WDID: 9 000000305
Reg Measure Id: 148279
Reg Measure Type: NPDES Permits
Region: 9
Order #: R9-2000-0214
Npdes# CA#: CA0109291
Major-Minor: Minor
Npdes Type: OTH
Reclamation: N - No
Dredge Fill Fee: Not reported
301H: N
Application Fee Amt Received: 1200
Status: Historical
Status Date: 04/18/2006
Effective Date: 10/11/2000
Expiration/Review Date: 04/12/2006
Termination Date: Not reported
WDR Review - Amend: Not reported
WDR Review - Revise/Renew: Not reported
WDR Review - Rescind: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	234129
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	05/28/1999
Adoption/Issuance Date:	Not reported
Achieve Date:	2000-10-16
Termination Date:	05/28/1999
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000305
Description:	staff enforcement letter requesting submittal of delinquent monitoring reports
Program:	NPDINDSML
Latest Milestone Completion Date:	2000-10-16
# Of Programs1:	1
Total Assessment Amount:	0
Initial Assessed Amount:	0
Liability \$ Amount:	0
Project \$ Amount:	0
Liability \$ Paid:	0
Project \$ Completed:	0
Total \$ Paid/Completed Amount:	0
Name:	DRISCOLL MISSION BAY
Address:	1500 QUIVIRA WAY
City,State,Zip:	SAN DIEGO, CA 92109
Region:	9
Facility Id:	220750
Agency Name:	Driscoll Mission Bay, LLC
Place Type:	Manufacturing
Place Subtype:	Boatyard/Shipyard
Facility Type:	Industrial
Agency Type:	Privately-Owned Business
# Of Agencies:	1
Place Latitude:	32.758614
Place Longitude:	-117.24023
SIC Code 1:	3732
SIC Desc 1:	Boat Building and Repairing
SIC Code 2:	Not reported
SIC Desc 2:	Not reported
SIC Code 3:	Not reported
SIC Desc 3:	Not reported
NAICS Code 1:	Not reported
NAICS Desc 1:	Not reported
NAICS Code 2:	Not reported
NAICS Desc 2:	Not reported
NAICS Code 3:	Not reported
NAICS Desc 3:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

# Of Places:	1
Source Of Facility:	Reg Meas
Design Flow:	0
Threat To Water Quality:	2
Complexity:	C
Pretreatment:	X - Facility is not a POTW
Facility Waste Type:	Process waste, NEC
Facility Waste Type 2:	Washwater waste
Facility Waste Type 3:	Not reported
Facility Waste Type 4:	Not reported
Program:	NPDINDSML
Program Category1:	NPDESWW
Program Category2:	NPDESWW
# Of Programs:	1
WDID:	9 000000305
Reg Measure Id:	148279
Reg Measure Type:	NPDES Permits
Region:	9
Order #:	R9-2000-0214
Npdes# CA#:	CA0109291
Major-Minor:	Minor
Npdes Type:	OTH
Reclamation:	N - No
Dredge Fill Fee:	Not reported
301H:	N
Application Fee Amt Received:	1200
Status:	Historical
Status Date:	04/18/2006
Effective Date:	10/11/2000
Expiration/Review Date:	04/12/2006
Termination Date:	Not reported
WDR Review - Amend:	Not reported
WDR Review - Revise/Renew:	Not reported
WDR Review - Rescind:	Not reported
WDR Review - No Action Required:	Not reported
WDR Review - Pending:	Not reported
WDR Review - Planned:	Not reported
Status Enrollee:	N
Individual/General:	I
Fee Code:	66 - NPDES Based on Flow
Direction/Voice:	Passive
Enforcement Id(EID):	233303
Region:	9
Order / Resolution Number:	UNKNOWN
Enforcement Action Type:	Staff Enforcement Letter
Effective Date:	12/21/1999
Adoption/Issuance Date:	Not reported
Achieve Date:	Not reported
Termination Date:	12/21/1999
ACL Issuance Date:	Not reported
EPL Issuance Date:	Not reported
Status:	Historical
Title:	Enforcement - 9 000000305
Description:	Failure to pay annual fee for 96/97, 97/98, and 99/2000 fiscal years.
Program:	NPDINDSML
Latest Milestone Completion Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Of Programs1: 1
Total Assessment Amount: 0
Initial Assessed Amount: 0
Liability \$ Amount: 0
Project \$ Amount: 0
Liability \$ Paid: 0
Project \$ Completed: 0
Total \$ Paid/Completed Amount: 0

NPDES:

Name: DRISCOLL MISSION BAY
Address: 1500 QUIVIRA WAY
City,State,Zip: SAN DIEGO, CA 92109
Facility Status: Active
NPDES Number: CAG719001
Region: 9
Agency Number: 13241
Regulatory Measure ID: 388928
Place ID: 220750
Order Number: R9-2013-0026
WDID: 9 000000305
Regulatory Measure Type: Enrollee - NPDES
Program Type: NPDNONMUNIPRCS
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 10/01/2013
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: 09/30/2018
Discharge Address: 1500 Quivira Way
Discharge Name: Driscoll Mission Bay, LLC
Discharge City: San Diego
Discharge State: CA
Discharge Zip: 92109
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

NPDES as of 03/2018:

NPDES Number: CAG719001
Status: Active
Agency Number: 13241
Region: 9
Regulatory Measure ID: 388928
Order Number: R9-2013-0026
Regulatory Measure Type: Enrollee
Place ID: 220750
WDID: 9 000000305
Program Type: NPDNONMUNIPRCS
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 10/01/2013
Expiration Date Of Regulatory Measure: 09/30/2018
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Driscoll Mission Bay, LLC
Discharge Address: 1500 Quivira Way

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Discharge City:	San Diego
Discharge State:	CA
Discharge Zip:	92109
Received Date:	Not reported
Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	CAG719001
Status:	Active
Agency Number:	13241
Region:	9
Regulatory Measure ID:	388928
Order Number:	R9-2013-0026
Regulatory Measure Type:	Enrollee
Place ID:	785854
WDID:	9 000000305
Program Type:	NPDNONMUNIPRCS
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	10/01/2013
Expiration Date Of Regulatory Measure:	09/30/2018
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Driscoll Mission Bay, LLC
Discharge Address:	1500 Quivira Way
Discharge City:	San Diego
Discharge State:	CA
Discharge Zip:	92109
Received Date:	Not reported
Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

WDS:

Name:	DRISCOLL MISSION BAY
Address:	1500 QUIVIRA WAY
City:	SAN DIEGO
Facility ID:	San Diego 000000305
Facility Type:	Industrial - Facility that treats and/or disposes of liquid or semisolid wastes from any servicing, producing, manufacturing or processing operation of whatever nature, including mining, gravel washing, geothermal operations, air conditioning, ship building and repairing, oil production, storage and disposal operations, water pumping.
Facility Status:	Active - Any facility with a continuous or seasonal discharge that is under Waste Discharge Requirements.
NPDES Number:	CA0109291 The 1st 2 characters designate the state. The remaining 7 are assigned by the Regional Board
Subregion:	9
Facility Telephone:	6192218456
Facility Contact:	MICHAEL DRISCOLL
Agency Name:	DRISCOLL MISSION BAY LLC
Agency Address:	1500 QUIVIRA WAY
Agency City,St,Zip:	SAN DIEGO 92109
Agency Contact:	MICHAEL DRISCOLL
Agency Telephone:	6192218456
Agency Type:	Private
SIC Code:	3732
SIC Code 2:	Not reported
Primary Waste Type:	Designated/Influent or Solid Wastes that pose a significant threat to water quality because of their high concentrations (E.G., BOD, Hardness, TRF, Chloride). 'Manageable' hazardous wastes (E.G., inorganic salts and heavy metals) are included in this category.
Primary Waste:	PROCES
Waste Type2:	D
Waste2:	Process Waste (Waste produced as part of the industrial/manufacturing process)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Primary Waste Type: Designated/Influent or Solid Wastes that pose a significant threat to water quality because of their high concentrations (E.G., BOD, Hardness, TRF, Chloride). 'Manageable' hazardous wastes (E.G., inorganic salts and heavy metals) are included in this category.

Secondary Waste: Washwater Waste (Product washwater wastes: E.G., photo reuse wastewater, vegetable washwater)

Secondary Waste Type: Designated/Influent or Solid Wastes that pose a significant threat to water quality because of their high concentrations (E.G., BOD, Hardness, TRF, Chloride). 'Manageable' hazardous wastes (E.G., inorganic salts and heavy metals) are included in this category.

Design Flow: 0

Baseline Flow: 0

Reclamation: No reclamation requirements associated with this facility.

POTW: The facility is not a POTW.

Treat To Water: Moderate Threat to Water Quality. A violation could have a major adverse impact on receiving biota, can cause aesthetic impairment to a significant human population, or render unusable a potential domestic or municipal water supply. Aesthetic impairment would include nuisance from a waste treatment facility.

Complexity: Category C - Facilities having no waste treatment systems, such as cooling water dischargers or those who must comply through best management practices, facilities with passive waste treatment and disposal systems, such as septic systems with subsurface disposal, or dischargers having waste storage systems with land disposal such as dairy waste ponds.

SAN DIEGO CO LOP:

Name: 1500 QUIVIRA WAY

Address: 1500 QUIVIRA WAY

City,State,Zip: SAN DIEGO, CA 92109-8303

Record ID: DEH2013-LSAM-000208

Record Status: Completed

Opened Date: 11/19/2013

Parcel Number: 760-029-05-00

Case Type: LOP - Local Oversight Program

Historical Name: 1500 Quivira Way

SWRCB Global ID: T10000005269

Funding: S - LOP State Fund

Lead Agency: RWQCB

Lead Agency Date: 10/09/2014

Census Tract: 76.00

Community: San Diego

Jurisdiction: SAN DIEGO

Watershed Basin Number: 906.8

Water Purveyor: CWA CITY OF SAN DIEGO

Fire Agency: SAN DIEGO

Latitude: 32.7597865

Longitude: -117.2392452

X MapCoord: 6257532.458

Y MapCoord: 1857721.444

CIWQS:

Name: DRISCOLL MISSION BAY

Address: 1500 QUIVIRA WAY

City,State,Zip: SAN DIEGO, CA 92109

Agency: Driscoll Mission Bay, LLC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Agency Address: 1500 Quivira Way, San Diego, CA 92109
Place/Project Type: Boatyard/Shipyard
SIC/NAICS: 3732
Region: 9
Program: NPDINDSML, NPDNONMUNIPRCS
Regulatory Measure Status: Active
Regulatory Measure Type: Enrollee - NPDES
Order Number: R9-2013-0026
WDID: 9 000000305
NPDES Number: CAG719001
Adoption Date: Not reported
Effective Date: 10/01/2013
Termination Date: Not reported
Expiration/Review Date: 09/30/2018
Design Flow: 0
Major/Minor: Minor
Complexity: C
TTWQ: 2
Enforcement Actions within 5 years: 5
Violations within 5 years: 4
Latitude: 32.758614
Longitude: -117.24023

CERS:

Name: DRISCOLL MISSION BAY BOATYARD
Address: 1500 QUIVIRA WAY
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 275277
CERS ID: T10000006510
CERS Description: Cleanup Program Site

Affiliation:

Affiliation Type Desc: Regional Board Caseworker
Entity Name: SARAH A. MEARON - SAN DIEGO RWQCB (REGION 9)
Entity Title: Not reported
Affiliation Address: 2375 NORTHSIDE DRIVE, SUITE 100
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: 6195213363

Name: DRISCOLL MISSION BAY
Address: 1500 QUIVIRA WAY
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 391761
CERS ID: 10383379
CERS Description: Chemical Storage Facilities

Violations:

Site ID: 391761
Site Name: DRISCOLL MISSION BAY
Violation Date: 02-16-2015
Citation: 19 CCR 6.95 25508(a)(1) - California Code of Regulations, Title 19, Chapter 6.95, Section(s) 25508(a)(1)
Violation Description: Failure to complete and electronically submit the Business Activities Page and/or Business Owner Operator Identification Page.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Violation Notes: Returned to compliance on 02/23/2015. Inspection Sequence ID:4314364
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 391761
Site Name: DRISCOLL MISSION BAY
Violation Date: 02-16-2015
Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2
Violation Description: Failure to annually review and electronically certify that the business plan is complete, accurate, and up-to-date.

Violation Notes: Returned to compliance on 04/10/2015. Inspection Sequence ID:4314364
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 391761
Site Name: DRISCOLL MISSION BAY
Violation Date: 02-16-2015
Citation: 22 CCR 12 66262.40(a) - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.40(a)
Violation Description: Failure to maintain uniform hazardous waste manifest, consolidated manifest, or bills of lading copies for three years.

Violation Notes: Returned to compliance on 02/23/2015. Inspection Sequence ID:4314364
Violation Division: San Diego County Department of Env Health
Violation Program: HW
Violation Source: CERS

Site ID: 391761
Site Name: DRISCOLL MISSION BAY
Violation Date: 02-16-2015
Citation: HSC 6.95 Multiple - California Health and Safety Code, Chapter 6.95, Section(s) Multiple
Violation Description: Business Plan Program - Administration/Documentation - General
Violation Notes: Returned to compliance on 02/23/2015. Inspection Sequence ID:4314364; Violation: HMD1001 Unified Program Facility (UPF) permit was not obtained for the handling of hazardous materials; SDCC 68.905.

Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 391761
Site Name: DRISCOLL MISSION BAY
Violation Date: 06-11-2019
Citation: HSC 6.5 25250.22 - California Health and Safety Code, Chapter 6.5, Section(s) 25250.22
Violation Description: Failure to properly manage used oil and/or fuel filters in accordance with the requirements.

Violation Notes: Returned to compliance on 06/13/2019. Inspection Sequence ID:6153741
Violation Division: San Diego County Department of Env Health
Violation Program: HW
Violation Source: CERS

Site ID: 391761
Site Name: DRISCOLL MISSION BAY
Violation Date: 04-25-2017

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Citation: 22 CCR 12 66262.11 - California Code of Regulations, Title 22, Chapter 12, Section(s) 66262.11

Violation Description: Failure to determine if wastes generated are hazardous waste by using generator knowledge or applying testing method.

Violation Notes: Returned to compliance on 04/25/2017.

Violation Division: San Diego County Department of Env Health

Violation Program: HW

Violation Source: CERS

Site ID: 391761

Site Name: DRISCOLL MISSION BAY

Violation Date: 04-25-2017

Citation: HSC 6.95 25508.2 - California Health and Safety Code, Chapter 6.95, Section(s) 25508.2

Violation Description: Failure to annually review and electronically certify that the business plan is complete and accurate on or before the annual due date.

Violation Notes: Returned to compliance on 04/25/2017.

Violation Division: San Diego County Department of Env Health

Violation Program: HMRRP

Violation Source: CERS

Site ID: 391761

Site Name: DRISCOLL MISSION BAY

Violation Date: 02-16-2015

Citation: HSC 6.5 Multiple - California Health and Safety Code, Chapter 6.5, Section(s) Multiple

Violation Description: Haz Waste Generator Program - Administration/Documentation - General

Violation Notes: Returned to compliance on 02/23/2015. Inspection Sequence ID:4314364; Violation:HMD0131 No Unified Program Facility (UPF) permit not obtained for the generation of hazardous waste. SDCC 68.905.

Violation Division: San Diego County Department of Env Health

Violation Program: HW

Violation Source: CERS

Site ID: 391761

Site Name: DRISCOLL MISSION BAY

Violation Date: 02-16-2015

Citation: HSC 6.95 25508(d) - California Health and Safety Code, Chapter 6.95, Section(s) 25508(d)

Violation Description: Failure to complete and/or electronically submit a business plan when storing/handling a hazardous material at or above reportable quantities.

Violation Notes: Returned to compliance on 02/23/2015. Inspection Sequence ID:4314364

Violation Division: San Diego County Department of Env Health

Violation Program: HMRRP

Violation Source: CERS

Site ID: 391761

Site Name: DRISCOLL MISSION BAY

Violation Date: 06-11-2019

Citation: HSC 6.5 25123.3(h)(1) - California Health and Safety Code, Chapter 6.5, Section(s) 25123.3(h)(1)

Violation Description: Failure to send hazardous waste offsite for treatment, storage, or disposal within 180 days (or 270 days if waste is transported over 200 miles) for a generator who generates less than 1000 kilogram per month if all of the following conditions are met: (1) The quantity of

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Violation Notes: hazardous waste accumulated onsite never exceeds 6,000 kilograms. (2)
Violation Division: The generator complies with the requirements of 40 Code of Federal
Violation Program: Regulations section 262.34(d), (e) and (f). (3) The generator does not
Violation Source: hold acutely hazardous waste or extremely hazardous waste in an amount
greater than one kilogram for more than 90 days.
Returned to compliance on 07/03/2019. Inspection Sequence ID:6153741
San Diego County Department of Env Health
HW
CERS

Site ID: 391761
Site Name: DRISCOLL MISSION BAY
Violation Date: 02-16-2015
Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter
6.95, Section(s) 25508(a)(1)
Violation Description: Failure to establish and electronically submit an adequate training
program in safety procedures in the event of a release or threatened
release of a hazardous material.

Violation Notes: Returned to compliance on 02/23/2015. Inspection Sequence ID:4314364
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 391761
Site Name: DRISCOLL MISSION BAY
Violation Date: 06-11-2019
Citation: HSC 6.95 25508(a)(1) - California Health and Safety Code, Chapter
6.95, Section(s) 25508(a)(1)
Violation Description: Failure to complete and electronically submit hazardous material
inventory information for all reportable hazardous materials on site
at or above reportable quantities.

Violation Notes: Returned to compliance on 06/11/2019. Inspection Sequence ID:6153741
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Evaluation:
Eval General Type: Compliance Evaluation Inspection
Eval Date: 02-16-2015
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Preece Sharon Inspection ID:4314364
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 02-16-2015
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Preece Sharon Inspection ID:4314364
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-25-2017

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Denslow VikkiT. Inspection ID:5609828
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 04-25-2017
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Denslow VikkiT. Inspection ID:5609828
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 06-11-2019
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Moreau Marie Inspection ID:6153741
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection
Eval Date: 06-11-2019
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Moreau Marie Inspection ID:6153741
Eval Division: San Diego County Department of Env Health
Eval Program: HW
Eval Source: CERS

Coordinates:
Site ID: 391761
Facility Name: DRISCOLL MISSION BAY
Env Int Type Code: HMBP
Program ID: 10383379
Coord Name: Not reported
Ref Point Type Desc: Center of a facility or station.
Latitude: 32.759790
Longitude: -117.239240

Affiliation:
Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 1500 QUIVIRA WAY Suite #2
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92109-8307
Affiliation Phone: Not reported

Affiliation Type Desc: Document Preparer

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Entity Name: Max Maher
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Operator
Entity Name: Jack Driscoll
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 268-1860

Affiliation Type Desc: CUPA District
Entity Name: San Diego County Env Health
Entity Title: Not reported
Affiliation Address: PO Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92112-9261
Affiliation Phone: (858) 505-6880

Affiliation Type Desc: Environmental Contact
Entity Name: Max Maher
Entity Title: Not reported
Affiliation Address: 1500 Quivira Way Suite #2
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92109
Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer
Entity Name: Max Maher
Entity Title: Marina Manager
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner
Entity Name: THOMAS DRISCOLL
Entity Title: Not reported
Affiliation Address: 2500 shelter island dr
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92106

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

1500 QUIVIRA WAY (Continued)

S102006434

Affiliation Phone: (619) 226-2500

Affiliation Type Desc: Parent Corporation
Entity Name: DRISCOLL MISSION BAY
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Name: 1500 QUIVIRA WAY
Address: 1500 QUIVIRA WAY
City,State,Zip: SAN DIEGO, CA 92109
Site ID: 245147
CERS ID: T10000005269
CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:
Affiliation Type Desc: Regional Board Caseworker
Entity Name: SEAN MCCLAIN - SAN DIEGO RWQCB (REGION 9)
Entity Title: Not reported
Affiliation Address: 2375 NORTHSIDE DRIVE, SUITE 100
Affiliation City: SAN DIEGO
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: 6195213374

145
SSE
1/4-1/2
0.496 mi.
2621 ft.

Relative:
Lower

Actual:
12 ft.

U HAUL INTERNATIONAL
3820 MIDWAY DR
SAN DIEGO, CA 92110

LUST:
Name: U HAUL MIDWAY MOVING CENTER
Address: 3820 MIDWAY DR
City,State,Zip: SAN DIEGO, CA 921105208
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607300360
Global Id: T0607300360
Latitude: 32.7542309
Longitude: -117.2182941
Status: Completed - Case Closed
Status Date: 03/13/2001
Case Worker: Not reported
RB Case Number: 9UT1541
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H12159-001

LUST
SAN DIEGO CO. SAM
San Diego Co. HMMMD
SWEEPS UST
HIST CORTESE
NPDES
SAN DIEGO CO LOP
CERS

S100232967
N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U HAUL INTERNATIONAL (Continued)

S100232967

Potential Media Affect: Not reported
Potential Contaminants of Concern: Not reported
Site History: Not reported

LUST:

Global Id: T0607300360
Action Type: ENFORCEMENT
Date: 10/16/1989
Action: Notice of Responsibility

Global Id: T0607300360
Action Type: ENFORCEMENT
Date: 03/13/2001
Action: Closure/No Further Action Letter

LUST:

Global Id: T0607300360
Status: Open - Case Begin Date
Status Date: 10/10/1989

Global Id: T0607300360
Status: Completed - Case Closed
Status Date: 03/13/2001

LUST REG 9:

Region: 9
Status: Preliminary site assessment underway
Case Number: 9UT1541
Local Case: H12159-001
Substance: Gasoline
Qty Leaked: 0
Abate Method: Not reported
Local Agency: San Diego
How Found: Tank Closure
How Stopped: Close Tank
Source: Tank
Cause: Corrosion
Lead Agency: Local Agency
Case Type: Other ground water affected
Date Found: 10/10/1989
Date Stopped: 10/10/1989
Confirm Date: 10/10/1989
Submit Workplan: Not reported
Prelim Assess: 08/02/1993
Desc Pollution: Not reported
Remed Plan: / /
Remed Action: Not reported
Began Monitor: Not reported
Release Date: 10/10/1989
Enforce Date: Not reported
Closed Date: Not reported
Enforce Type: Not reported
Pilot Program: LOP
Basin Number: 908.10
GW Depth: 6'
Beneficial Use: No Beneficial groundwater use

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U HAUL INTERNATIONAL (Continued)

S100232967

NPDES Number: Not reported
Priority: 2B
File Disp: File discarded, case closed
Interim Remedial Actions: Yes
Cleanup and Abatement order Number: Not reported
Waste Discharge Requirement Number: Not reported

SAN DIEGO CO. SAM:

Name: U HAUL MIDWAY MOVING CENTER
Address: 3820 MIDWAY DR
City,State,Zip: SAN DIEGO, CA 921105208
Case Number: H12159-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: Drinking Water Aquifer Impacted
Facility Status: Closed Case
Date: 3/13/2001
Date Began: 10/10/1989

HMMD SAN DIEGO:

Name: U-HAUL MOVING & STORAGE OF POINT LOMA
Address: 3820 MIDWAY DR
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 209570
Business Type: 6HK18
EPA Id Number: Not reported
APN: 441-270-52-00
Last HMMD Inspection: 07/07/2010
Facility Telephone: 619-223-2131
Permit Status: OPEN
Permit Expiration: 11/30/2012
Date Last Updated: 11/02/2012
Facility Owner: U-HAUL COMPANY OF CALIFORNIA, INC
Facility Mailing Address: 1805 MASSACHUSETTS AV
Facility Mailing City: LEMON GROVE
Facility Mailing State: CA
Facility Mailing Zip: 91945
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: N
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 209570
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Violations Active Permits:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U HAUL INTERNATIONAL (Continued)

S100232967

Permit Number: 209570
Update Date: 11/02/2012
Inspection Date: 07/07/2010
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Name: U-HAUL MOVING & STORAGE OF POINT LOMA
Address: 3820 MIDWAY DR
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 209570
Business Type: 6HK18
EPA Id Number: Not reported
APN: 441-270-52-00
Last HMMD Inspection: 07/07/2010
Facility Telephone: 619-223-2131
Permit Status: OPEN
Permit Expiration: 11/30/2012
Date Last Updated: 11/02/2012
Facility Owner: U-HAUL COMPANY OF CALIFORNIA, INC
Facility Mailing Address: 1805 MASSACHUSETTS AV
Facility Mailing City: LEMON GROVE
Facility Mailing State: CA
Facility Mailing Zip: 91945
UST Owner: Not reported
Handle Regulated Hazmat: Y
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: N
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Inventory Active Permits (not SQG Medical):

Permit Number: 209570
Update Date: 11/02/2012
Case Number: 74-98-6
Name: PROPANE
Other Information: Not reported
Material Waste: Material
Hazardous Categories 1: FIRE
Hazardous Categories 2: PRESSURE RELEASE

Violations Active Permits:

Permit Number: 209570
Update Date: 11/02/2012
Inspection Date: 07/07/2010
Violation Code: 6HV1014
Violation: HMBP INCOMPLETE/NOT AMENDED
Violation Citation: HMBP is incomplete/inadequate/not amended to reflect changes. 25504, 25505(a)(2) &/or 25509(a); 25505(b); 19 CCR 2729
Activity: ACTIVE

Name: U-HAUL MOVING & STORAGE OF POINT LOMA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U HAUL INTERNATIONAL (Continued)

S100232967

Address: 3820 MIDWAY DR
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: Not reported
Business Type: Not reported
EPA Id Number: Not reported
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: (619) 223-2131
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 12/01/2017
Facility Owner: Not reported
Facility Mailing Address: c/o U-Haul Co. of San Diego, 1300 Wilson Ave, National City, CA 91950
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: N
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2008-HUPFP-209570
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: 37-000-209570
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Routine
Inspection Number: 5605922
Return To Compliance Date: 2017-02-17T00:00:00.000
Nov: No
Violation Classification: Minor
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-04-19T20:17:53.000
Inspection Date: 2017-02-14T14:05:00.000
Violation Code: 1020002 Initial and/or annual employee training not conducted for hazardous materials management and/or employee training records not available or not maintained for 3 years. HSC 25505(a)(4)

Waste and Materials:

Record ID: DEH2008-HUPFP-209570
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2017-HCHEM-0157956
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-12-01T00:42:49.000
Chemical Name: Propane
Common Name: Odorized Propane
Case Number: 74-98-6

Record ID: DEH2008-HUPFP-209570
Permit Status: Permit Renewed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U HAUL INTERNATIONAL (Continued)

S100232967

Active Permit: Y
Child Record Id: DEH2018-HCHEM-0195707
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2019-04-19T20:17:53.000
Chemical Name: Propane
Common Name: Odorized Propane
Case Number: 74-98-6

Record ID: DEH2008-HUPFP-209570
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2016-HCHEM-0114358
Trade Secret: N
Hazardous Material Type: Pure
Last Updated: 2017-04-18T17:20:35.000
Chemical Name: Propane
Common Name: Odorized Propane
Case Number: 74-98-6

Name: U HAUL MIDWAY MOVING CENTER
Address: 3820 MIDWAY DR
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 112159
Business Type: Not reported
EPA Id Number: Not reported
APN: 441-270-52-00
Last HMMD Inspection: 11/28/1989
Facility Telephone: 619-464-6023
Permit Status: INAC
Permit Expiration: Not reported
Date Last Updated: 11/02/2012
Facility Owner: AMERCO INT
Facility Mailing Address: 3820 MIDWAY DR
Facility Mailing City: SAN DIEGO
Facility Mailing State: CA
Facility Mailing Zip: 92110-5208
UST Owner: U-HAUL CO OF SAN DIEGO
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Not reported
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

UST:

UST Name: UNDERGROUND TANK 112159 T001
Last Update: 2012-11-02 14:17:38
Permit Number: 112159
Tank Type: SINGLE WALL
Additional Id: 7175001
Capacity Gallons: 550
UST Contents: LEADED
Other Content Info: LEADED
Reg Status: REMOVED
Remove Close Date: 1989-10-10 00:00:00
Year Installed: 1977-01-01 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U HAUL INTERNATIONAL (Continued)

S100232967

Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 05
UST Monitor Method: SW TANK DW PIPE W/ POS SHUTOFF-ALARM ON LLD W/ SIRS:SIR ANALY
MONTHLY, TANK TEST BIENNIALY, PIPE TEST ANN 0.1 G/HR OR MO 0.2 G/HR

UST Name: UNDERGROUND TANK 112159 T002
Last Update: 2012-11-02 14:17:38
Permit Number: 112159
Tank Type: SINGLE WALL
Additional Id: 7175002
Capacity Gallons: 500
UST Contents: Not reported
Other Content Info: WASTE OIL
Reg Status: REMOVED
Remove Close Date: 1989-10-10 00:00:00
Year Installed: 1977-01-01 00:00:00
Pipe Type: Not reported
Delivery System: Not reported
Monitor Code: 07
UST Monitor Method: SW TANK SW PRESSURE PIPE W/RESTRICTIVE LLD W/DAILY RECONCILIATION OR
WEEKLY GAUGING: TANK AND PIPE TEST ANNUALLY

SWEEPS UST:

Name: U HAUL MIDWAY MOVING CENTER
Address: 3820 MIDWAY DR
City: SAN DIEGO
Status: Active
Comp Number: 12159
Number: 9
Board Of Equalization: Not reported
Referral Date: Not reported
Action Date: 06-26-92
Created Date: 02-29-88
Owner Tank Id: Not reported
SWRCB Tank Id: Not reported
Tank Status: Not reported
Capacity: Not reported
Active Date: Not reported
Tank Use: Not reported
STG: Not reported
Content: Not reported
Number Of Tanks: Not reported

Name: U HAUL MIDWAY MOVING CENTER
Address: 3820 MIDWAY DR
City: SAN DIEGO
Status: Not reported
Comp Number: 12159
Number: Not reported
Board Of Equalization: Not reported
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-012159-000001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U HAUL INTERNATIONAL (Continued)

S100232967

Tank Status: Not reported
Capacity: 550
Active Date: Not reported
Tank Use: M.V. FUEL
STG: PRODUCT
Content: LEADED
Number Of Tanks: 2

Name: U HAUL MIDWAY MOVING CENTER
Address: 3820 MIDWAY DR
City: SAN DIEGO
Status: Not reported
Comp Number: 12159
Number: Not reported
Board Of Equalization: Not reported
Referral Date: Not reported
Action Date: Not reported
Created Date: Not reported
Owner Tank Id: Not reported
SWRCB Tank Id: 37-000-012159-000002
Tank Status: Not reported
Capacity: 500
Active Date: Not reported
Tank Use: PETROLEUM
STG: WASTE
Content: Not reported
Number Of Tanks: Not reported

HIST CORTESE:
edr_fname: U HAUL INTERNATIONAL
edr_fadd1: 3820 MIDWAY
City,State,Zip: SAN DIEGO, CA 92110
Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT1541

NPDES:
Name: U HAUL COMPANY OF CALIFORNIA
Address: 3820 MIDWAY DRIVE
City,State,Zip: SAN DIEGO, CA 92110
Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported
Order Number: Not reported
WDID: 9 37IN602500
Regulatory Measure Type: Industrial
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U HAUL INTERNATIONAL (Continued)

S100232967

Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Undetermined
Status Date: 11/04/2013
Operator Name: U Haul Company of California
Operator Address: 1805 Massachusetts Avenue
Operator City: Lemon Grove
Operator State: California
Operator Zip: 91945

SAN DIEGO CO LOP:

Name: U HAUL MIDWAY MOVING CENTER
Address: 3820 MIDWAY DR
City,State,Zip: SAN DIEGO, CA 92110
Record ID: DEH1989-LSAM-H12159-001
Record Status: Completed
Opened Date: 10/10/1989
Parcel Number: 441-270-52-00
Case Type: LOP - Local Oversight Program
Historical Name: U HAUL INTERNATIONAL
SWRCB Global ID: T0607300360
Funding: F - LOP Federal Fund
Lead Agency: DEH/SAM
Lead Agency Date: 10/10/1989
Census Tract: 65.00
Community: San Diego
Jurisdiction: SAN DIEGO
Watershed Basin Number: 907.11
Water Purveyor: SAN DIEGO
Fire Agency: SAN DIEGO
Latitude: 32.7543149
Longitude: -117.2178385
X MapCoord: 6264106.215
Y MapCoord: 1855616.179

CERS:

Name: U HAUL MIDWAY MOVING CENTER
Address: 3820 MIDWAY DR
City,State,Zip: SAN DIEGO, CA 921105208
Site ID: 232119
CERS ID: T0607300360
CERS Description: Leaking Underground Storage Tank Cleanup Site

Name: U-HAUL MOVING & STORAGE OF POINT LOMA
Address: 3820 MIDWAY DR
City,State,Zip: SAN DIEGO, CA 92110
Site ID: 404612
CERS ID: 10384207
CERS Description: Chemical Storage Facilities

Violations:

Site ID: 404612
Site Name: U-Haul Moving & Storage of Point Loma
Violation Date: 02-14-2017
Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U HAUL INTERNATIONAL (Continued)

S100232967

Violation Description: 6.95, Section(s) 25505(a)(4)
Failure to provide initial and annual training to all employees in safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training records for a minimum of three years.

Violation Notes: Returned to compliance on 02/17/2017.

Violation Division: San Diego County Department of Env Health

Violation Program: HMRRP

Violation Source: CERS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Eval Date: 01-30-2019

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Inspector: Burke Mike Inspection ID:6111698

Eval Division: San Diego County Department of Env Health

Eval Program: HMRRP

Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 02-10-2015

Violations Found: No

Eval Type: Routine done by local agency

Eval Notes: Inspector: McLernon Benjamin Inspection ID:4486252

Eval Division: San Diego County Department of Env Health

Eval Program: HMRRP

Eval Source: CERS

Eval General Type: Compliance Evaluation Inspection

Eval Date: 02-14-2017

Violations Found: Yes

Eval Type: Routine done by local agency

Eval Notes: Inspector: Burke Mike Inspection ID:5605922

Eval Division: San Diego County Department of Env Health

Eval Program: HMRRP

Eval Source: CERS

Coordinates:

Site ID: 404612

Facility Name: U-Haul Moving & Storage of Point Loma

Env Int Type Code: HMBP

Program ID: 10384207

Coord Name: Not reported

Ref Point Type Desc: Unknown

Latitude: 32.754047

Longitude: -117.218148

Affiliation:

Affiliation Type Desc: Identification Signer

Entity Name: Don Chae

Entity Title: Marketing Company President

Affiliation Address: Not reported

Affiliation City: Not reported

Affiliation State: Not reported

Affiliation Country: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U HAUL INTERNATIONAL (Continued)

S100232967

Affiliation Zip:	Not reported
Affiliation Phone:	Not reported
Affiliation Type Desc:	Legal Owner
Entity Name:	U-Haul Co. of California
Entity Title:	Not reported
Affiliation Address:	c/o U-Haul Co. of San Diego, 1300 Wilson Ave
Affiliation City:	National City
Affiliation State:	CA
Affiliation Country:	United States
Affiliation Zip:	91950
Affiliation Phone:	(619) 399-3189
Affiliation Type Desc:	Document Preparer
Entity Name:	James Muniz
Entity Title:	Not reported
Affiliation Address:	Not reported
Affiliation City:	Not reported
Affiliation State:	Not reported
Affiliation Country:	Not reported
Affiliation Zip:	Not reported
Affiliation Phone:	Not reported
Affiliation Type Desc:	Operator
Entity Name:	U-Haul Moving & Storage of Point Loma
Entity Title:	Not reported
Affiliation Address:	Not reported
Affiliation City:	Not reported
Affiliation State:	Not reported
Affiliation Country:	Not reported
Affiliation Zip:	Not reported
Affiliation Phone:	(619) 399-3189
Affiliation Type Desc:	Parent Corporation
Entity Name:	U-Haul Moving and Storage of Point Loma
Entity Title:	Not reported
Affiliation Address:	Not reported
Affiliation City:	Not reported
Affiliation State:	Not reported
Affiliation Country:	Not reported
Affiliation Zip:	Not reported
Affiliation Phone:	Not reported
Affiliation Type Desc:	CUPA District
Entity Name:	San Diego County Env Health
Entity Title:	Not reported
Affiliation Address:	PO Box 129261
Affiliation City:	San Diego
Affiliation State:	CA
Affiliation Country:	Not reported
Affiliation Zip:	92112-9261
Affiliation Phone:	(858) 505-6880
Affiliation Type Desc:	Property Owner
Entity Name:	Four Reys Properties LLC
Entity Title:	Not reported
Affiliation Address:	P.O. Box 29046

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

U HAUL INTERNATIONAL (Continued)

S100232967

Affiliation City: Phoenix
Affiliation State: AZ
Affiliation Country: United States
Affiliation Zip: 85038
Affiliation Phone: (602) 263-6555

Affiliation Type Desc: Environmental Contact
Entity Name: 717 MCO President
Entity Title: Not reported
Affiliation Address: 1300 Wilson Ave
Affiliation City: National City
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 91950
Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 1300 Wilson Ave
Affiliation City: National City
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 91950
Affiliation Phone: Not reported

**146
NW
1/2-1
0.522 mi.
2755 ft.**

**S. D. PRINCESS RESORT
1404 VACATION VILLAGE ROA
SAN DIEGO, CA**

**Notify 65 S100178691
N/A**

**Relative:
Lower
Actual:
12 ft.**

NOTIFY 65:
Date Reported: Not reported
Staff Initials: Not reported
Board File Number: Not reported
Facility Type: Not reported
Discharge Date: Not reported
Issue Date: Not reported
Incident Description: Not reported

**O147
SSW
1/2-1
0.535 mi.
2823 ft.**

**DYKE-SAN DIEGO HARBOR
SAN DIEGO, CA
Site 1 of 2 in cluster O**

**FUDS 1024903647
N/A**

**Relative:
Lower
Actual:
12 ft.**

FUDS:
EPA Region: 9
Installation ID: CA99799F560000
Congressional District Number: 52
Facility Name: DYKE-SAN DIEGO HARBOR
FUDS Number: J09CA0597
City: SAN DIEGO
State: CA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DYKE-SAN DIEGO HARBOR (Continued)

1024903647

County: SAN DIEGO
Telephone: 213-452-3920
USACE Division: South Pacific Division (SPD)
USACE District: Los Angeles District (SPL)
Status: Properties without projects
Current Owner: Local Government
X Coord: -117.229166670005
Y Coord: 32.754166669956703
Latitude: 32.754166669999996
Longitude: -117.22916667

O148
SSW
1/2-1
0.536 mi.
2828 ft.

DYKE - SAN DIEGO HBR
SAN DIEGO, CA
Site 2 of 2 in cluster O

ENVIROSTOR S107736242
N/A

Relative:
Lower
Actual:
12 ft.

ENVIROSTOR:
Name: DYKE - SAN DIEGO HBR
Address: Not reported
City,State,Zip: SAN DIEGO, CA
Facility ID: 80000451
Status: Inactive - Needs Evaluation
Status Date: 07/01/2005
Site Code: Not reported
Site Type: Military Evaluation
Site Type Detailed: FUDS
Acres: Not reported
NPL: NO
Regulatory Agencies: SMBRP
Lead Agency: SMBRP
Program Manager: Not reported
Supervisor: Douglas Bautista
Division Branch: Cleanup Cypress
Assembly: 78
Senate: 39
Special Program: Not reported
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: DERA
Latitude: 32.75416
Longitude: -117.2291
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: NONE SPECIFIED
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: CA99799F560000
Alias Type: Federal Facility ID
Alias Name: J09CA0597
Alias Type: INPR
Alias Name: 80000451
Alias Type: Envirostor ID Number

Completed Info:
Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Inventory Project Report (INPR)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DYKE - SAN DIEGO HBR (Continued)

S107736242

Completed Date: 03/25/1992
Comments: Not reported

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

149
East
1/2-1
0.541 mi.
2857 ft.

**RELIEF VALVE CLAPPERS
I-5 AND S.D. RIVER CHANNE
SAN DIEGO, CA**

**Notify 65 S100178438
N/A**

**Relative:
Lower**

NOTIFY 65:

Date Reported: Not reported
Staff Initials: Not reported
Board File Number: Not reported
Facility Type: Not reported
Discharge Date: Not reported
Issue Date: Not reported
Incident Description: Not reported

**Actual:
18 ft.**

150
NNE
1/2-1
0.566 mi.
2990 ft.

**SAN DIEGO RIVER/MISSION BAY
SAN DIEGO, CA**

**FUDS 1024903655
N/A**

**Relative:
Higher**

FUDS:

EPA Region: 9
Installation ID: CA99799F560800
Congressional District Number: 52
Facility Name: SAN DIEGO RIVER/MISSION BAY
FUDS Number: J09CA0606
City: SAN DIEGO
State: CA
County: SAN DIEGO
Telephone: 213-452-3920
USACE Division: South Pacific Division (SPD)
USACE District: Los Angeles District (SPL)
Status: Properties without projects
Current Owner: Other
X Coord: -117.222222220278
Y Coord: 32.775000000250699
Latitude: 32.774999999999999
Longitude: -117.22222222000001

**Actual:
22 ft.**

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

151
South
1/2-1
0.590 mi.
3113 ft.

3050 RUE DE ORLEANS
PACIFIC ISLAND APTS.
SAN DIEGO, CA

Notify 65 S100178432
N/A

Relative:
Lower

NOTIFY 65:

Actual:
13 ft.

Date Reported: Not reported
Staff Initials: Not reported
Board File Number: Not reported
Facility Type: Not reported
Discharge Date: Not reported
Issue Date: Not reported
Incident Description: Not reported

152
East
1/2-1
0.596 mi.
3147 ft.

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT
5000 PACIFIC COAST HWY
SAN DIEGO, CA 92167

HWP S121273336
CERS N/A

Relative:
Higher

HWP:

Actual:
22 ft.

Name: SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT
Address: 5000 PACIFIC COAST HWY
City,State,Zip: SAN DIEGO, CA 92167
EPA Id: CAD000630921
Cleanup Status: OPERATING PERMIT
Latitude: 33.36883
Longitude: -117.5544
Facility Type: Permitted - Operating
Facility Size: Small Storage
Team: EDWARD NIETO
Supervisor: SAM COE
Site Code: 400643
Assembly District: 76
Senate District: 36
Public Information Officer: Not reported
Public Information Officer: Not reported

Activities:

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: Not reported
Event Description: *Mod Class 1 - No Prior Approval Required - FINAL PERMIT MODIFICATION (EFFECTIVE)
Actual Date: 03/23/2012

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: Not reported
Event Description: Mod Class 1 - No Prior Approval Required - FINAL PERMIT MODIFICATION
Actual Date: 10/16/2018

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: LSAW - MPHF STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY
STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description: New Operating Permit - INITIAL ADMINISTRATIVE REVIEW COMPLETED
Actual Date: 02/22/2001

EPA Id: CAD000630921

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT (Continued)

S121273336

Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	Mod Class 1 - No Prior Approval Required - UPDATED APPLICATION RECEIVED
Actual Date:	01/03/2019
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	Mod Class 1 - No Prior Approval Required - FINAL PERMIT MODIFICATION
Actual Date:	01/10/2019
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - 1ST NOTICE OF DEFICIENCY ISSUED
Actual Date:	12/31/2014
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - PUBLIC COMMENT (END)
Actual Date:	02/24/2016
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - FINAL PERMIT RENEWAL (EFFECTIVE)
Actual Date:	05/23/2016
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - DRAFT PERMIT RENEWAL
Actual Date:	01/07/2016
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	New Operating Permit - FINAL PERMIT (EFFECTIVE)
Actual Date:	01/31/2005
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - FINAL CEQA
Actual Date:	02/27/2015
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT (Continued)

S121273336

Event Description: Renewal - No Changes - FINAL PERMIT RENEWAL (EXPIRES)
Actual Date: 05/23/2026

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: LSAW - MPHF STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY
STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)

Event Description: Renewal - No Changes - FINAL PERMIT RENEWAL
Actual Date: 04/20/2016

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: Not reported
Event Description: Mod Class 1 - No Prior Approval Required - ACKNOWLEDGEMENT OF PERMIT MOD LETTER
Actual Date: 12/18/2019

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: Not reported
Event Description: Mod Class 1 - No Prior Approval Required - RESPONSE TO 1ST REQUEST FOR FUTHER INFORMATION
Actual Date: 01/03/2019

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: LSAW - MPHF STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY
STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description: New Operating Permit - FINAL PERMIT (EXPIRES)
Actual Date: 01/30/2015

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: Not reported
Event Description: *Mod Class 1 - No Prior Approval Required - FINAL PERMIT MODIFICATION
Actual Date: 03/23/2012

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: Not reported
Event Description: Mod Class 1 - No Prior Approval Required - ACKNOWLEDGEMENT OF PERMIT MOD LETTER
Actual Date: 10/16/2018

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: LSAW - MPHF STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY
STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description: New Operating Permit - APPLICATION PART B RECEIVED
Actual Date: 02/27/1998

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: LSAW - MPHF STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY
STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description: New Operating Permit - PUBLIC COMMENT (PUBLIC HEARING)
Actual Date: 09/08/2003

EPA Id: CAD000630921
Facility Type: Permitted - Operating

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT (Continued)

S121273336

Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - CEQA DETERMINATION
Actual Date:	05/31/2016
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - PUBLIC COMMENT (PUBLIC HEARING)
Actual Date:	02/11/2016
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	New Operating Permit - TECHNICAL COMPLETE LETTER
Actual Date:	09/24/2002
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	New Variance - FINAL VARIANCE
Actual Date:	09/30/2010
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	New Variance - FINAL VARIANCE (EFFECTIVE)
Actual Date:	09/30/2010
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	*Mod Class 1 - No Prior Approval Required - PUBLIC NOTICE BY PERMITTEE
Actual Date:	05/29/2012
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	*Mod Class 1 - No Prior Approval Required - FINAL PERMIT MODIFICATION (EXPIRES)
Actual Date:	01/30/2015
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	New Variance - PUBLIC COMMENT (BEGIN)
Actual Date:	05/08/2010
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	Mod Class 1 - No Prior Approval Required - FINAL PERMIT MODIFICATION (EFFECTIVE)
Actual Date:	01/18/2019
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT (Continued)

S121273336

Unit Names:	Not reported
Event Description:	New Variance - DRAFT CEQA
Actual Date:	05/05/2010
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	*Mod Class 1 - No Prior Approval Required - FINAL PERMIT MODIFICATION (EFFECTIVE)
Actual Date:	05/29/2012
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHF STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	New Operating Permit - FINAL CEQA
Actual Date:	12/06/2004
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHF STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - FINAL PART A & PART B RECEIVED
Actual Date:	10/26/2015
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	Mod Class 1 - No Prior Approval Required - 1ST REQUEST FOR FURTHER INFORMATION
Actual Date:	01/02/2019
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	Mod Class 1 - No Prior Approval Required - PUBLIC NOTICE OF MOD BY PERMITTEE
Actual Date:	01/09/2019
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	New Variance - CEQA DETERMINATION
Actual Date:	09/30/2010
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHF STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	New Operating Permit - FINAL PERMIT
Actual Date:	12/17/2004
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	New Variance - PUBLIC COMMENT (END)
Actual Date:	06/14/2010
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT (Continued)

S121273336

Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - APPLICATION PART A RECEIVED
Actual Date:	01/02/2014
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - TECHNICAL COMPLETE LETTER
Actual Date:	10/30/2015
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	New Variance - PERMIT TERMINATED - TERMINATION RECEIVED
Actual Date:	08/31/2015
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - INITIAL ADMINISTRATIVE REVIEW COMPLETED
Actual Date:	01/27/2014
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	New Variance - FINAL CEQA
Actual Date:	09/30/2010
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	New Operating Permit - PUBLIC COMMENT (BEGIN)
Actual Date:	08/08/2003
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - APPLICATION PART B RECEIVED
Actual Date:	01/02/2014
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - PUBLIC NOTICE - PERMIT RECEIVED
Actual Date:	11/21/2014
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	New Variance - FINAL VARIANCE (EXPIRES)
Actual Date:	09/29/2018

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT (Continued)

S121273336

EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - PUBLIC COMMENT (BEGIN)
Actual Date:	01/07/2016
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - 2ND NOTICE OF DEFICIENCY ISSUED
Actual Date:	04/10/2015
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	New Operating Permit - FINAL PART A & PART B RECEIVED
Actual Date:	09/24/2002
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - CALL-IN LETTER ISSUED
Actual Date:	10/14/2013
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	*Mod Class 1 - No Prior Approval Required - PUBLIC NOTICE BY PERMITTEE
Actual Date:	03/23/2012
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	Not reported
Event Description:	*Mod Class 1 - No Prior Approval Required - FINAL PERMIT MODIFICATION
Actual Date:	05/29/2012
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	New Operating Permit - PUBLIC COMMENT (END)
Actual Date:	09/23/2003
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description:	Renewal - No Changes - RESPONSE TO 1ST NOD RECEIVED
Actual Date:	02/16/2015
EPA Id:	CAD000630921
Facility Type:	Permitted - Operating
Unit Names:	LSAW - MPHf STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT (Continued)

S121273336

Event Description: STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Renewal - No Changes - RESPONSE TO 2ND NOD RECEIVED
Actual Date: 05/14/2015

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: Not reported
Event Description: New Variance - PERMIT TERMINATED - TERMINATION APPROVED
Actual Date: 10/14/2015

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Unit Names: LSAW - MPHF STORAGE AREA (GPRA Unit), MULTI PURPOSE HANDLING FACILITY
STORAGE (GPRA Unit), S. YARD FACILITY MIXED WASTE STORAGE (GPRA Unit)
Event Description: Renewal - No Changes - DISCLOSURE (CLEARED)
Actual Date: 04/24/2015

Alias:
EPA Id: CAD000630921
Facility Type: Permitted - Operating
Alias Type: FRS
Alias: 110000915724

EPA Id: CAD000630921
Facility Type: Permitted - Operating
Alias Type: Project Code (Site Code)
Alias: 400643

Maintenance:
EPA Id: CAD000630921
Title: Facility submitted Semi-annual Inventory Report_6-21-2010
Document Type: Certification Documents from Facility
Received Date: 08/25/2010

EPA Id: CAD000630921
Title: Facility submitted Semi-annual Inventory Report_12-20-2010
Document Type: Certification Documents from Facility
Received Date: 02/23/2011

EPA Id: CAD000630921
Title: Semi-Annual Inventory Report 12-30-2014
Document Type: Certification Documents from Facility
Received Date: 12/30/2014

CERS:
Name: SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT
Address: 5000 PACIFIC COAST HWY
City,State,Zip: SAN DIEGO, CA 92167
Site ID: 238226
CERS ID: CAD000630921
CERS Description: Hazardous Waste

Evaluation:
Eval General Type: Compliance Evaluation Inspection
Eval Date: 01-22-2003

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT (Continued)

S121273336

Violations Found:	No
Eval Type:	DTSC Compliance Evaluation Inspection
Eval Notes:	Compliance Evaluation Inspection - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	01-24-2001
Violations Found:	No
Eval Type:	DTSC Compliance Evaluation Inspection
Eval Notes:	Compliance Evaluation Inspection - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Compliance Followup Inspection
Eval Date:	01-26-1999
Violations Found:	No
Eval Type:	DTSC Follow-up Inspection
Eval Notes:	Follow-up Inspection - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Information Request
Eval Date:	01-27-2003
Violations Found:	No
Eval Type:	DTSC Financial Records Review
Eval Notes:	Financial Records Review - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	01-29-2015
Violations Found:	No
Eval Type:	DTSC Compliance Evaluation Inspection
Eval Notes:	Compliance Evaluation Inspection - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Information Request
Eval Date:	02-10-2004
Violations Found:	No
Eval Type:	DTSC Financial Records Review
Eval Notes:	Financial Records Review - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Information Request
Eval Date:	02-27-2001
Violations Found:	Yes
Eval Type:	DTSC Financial Records Review
Eval Notes:	Financial Records Review - Treatment, Storage and Disposal Return To

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT (Continued)

S121273336

Eval Division:	Compliance: 2002-03-12 00:00:00
Eval Program:	Department of Toxic Substances Control
Eval Source:	DTSC_ENF
	ENVSTORHAZ
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	02-27-2017
Violations Found:	No
Eval Type:	DTSC Compliance Evaluation Inspection
Eval Notes:	Compliance Evaluation Inspection - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	03-23-2010
Violations Found:	No
Eval Type:	DTSC Compliance Evaluation Inspection
Eval Notes:	Compliance Evaluation Inspection - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	03-28-2012
Violations Found:	No
Eval Type:	DTSC Compliance Evaluation Inspection
Eval Notes:	Compliance Evaluation Inspection - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	04-29-1997
Violations Found:	Yes
Eval Type:	DTSC Compliance Evaluation Inspection
Eval Notes:	Compliance Evaluation Inspection - * Non Major Return To Compliance: 1997-05-29 00:00:00
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	05-11-2000
Violations Found:	No
Eval Type:	DTSC Compliance Evaluation Inspection
Eval Notes:	Compliance Evaluation Inspection - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Information Request
Eval Date:	05-11-2000
Violations Found:	Yes
Eval Type:	DTSC Financial Records Review
Eval Notes:	Financial Records Review - Treatment, Storage and Disposal Return To Compliance: 2000-09-18 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT (Continued)

S121273336

Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	05-13-2008
Violations Found:	No
Eval Type:	DTSC Compliance Evaluation Inspection
Eval Notes:	Compliance Evaluation Inspection - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Information Request
Eval Date:	05-28-2008
Violations Found:	No
Eval Type:	DTSC Financial Records Review
Eval Notes:	Financial Records Review - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Compliance Evaluation Inspection
Eval Date:	06-26-2006
Violations Found:	No
Eval Type:	DTSC Compliance Evaluation Inspection
Eval Notes:	Compliance Evaluation Inspection - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Information Request
Eval Date:	07-06-2000
Violations Found:	Yes
Eval Type:	DTSC Financial Records Review
Eval Notes:	Financial Records Review - Treatment, Storage and Disposal Return To Compliance: 2000-08-23 00:00:00
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Information Request
Eval Date:	07-23-2015
Violations Found:	No
Eval Type:	DTSC Financial Records Review
Eval Notes:	Financial Records Review - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF
Eval Source:	ENVSTORHAZ
Eval General Type:	Information Request
Eval Date:	07-26-2017
Violations Found:	No
Eval Type:	DTSC Financial Records Review
Eval Notes:	Financial Records Review - Treatment, Storage and Disposal
Eval Division:	Department of Toxic Substances Control
Eval Program:	DTSC_ENF

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT (Continued)

S121273336

Eval Source: ENVSTORHAZ

Eval General Type: Compliance Evaluation Inspection
Eval Date: 09-20-2017
Violations Found: No
Eval Type: DTSC Compliance Evaluation Inspection
Eval Notes: Compliance Evaluation Inspection - Treatment, Storage and Disposal
Eval Division: Department of Toxic Substances Control
Eval Program: DTSC_ENF
Eval Source: ENVSTORHAZ

Eval General Type: Information Request
Eval Date: 09-22-2006
Violations Found: No
Eval Type: DTSC Financial Records Review
Eval Notes: Financial Records Review - Treatment, Storage and Disposal
Eval Division: Department of Toxic Substances Control
Eval Program: DTSC_ENF
Eval Source: ENVSTORHAZ

Eval General Type: Information Request
Eval Date: 09-28-2012
Violations Found: No
Eval Type: DTSC Financial Records Review
Eval Notes: Financial Records Review - Treatment, Storage and Disposal
Eval Division: Department of Toxic Substances Control
Eval Program: DTSC_ENF
Eval Source: ENVSTORHAZ

Eval General Type: Information Request
Eval Date: 11-30-2017
Violations Found: No
Eval Type: DTSC Financial Records Review
Eval Notes: Financial Records Review - Treatment, Storage and Disposal
Eval Division: Department of Toxic Substances Control
Eval Program: DTSC_ENF
Eval Source: ENVSTORHAZ

Eval General Type: Compliance Evaluation Inspection
Eval Date: 12-16-2003
Violations Found: Yes
Eval Type: DTSC Compliance Evaluation Inspection
Eval Notes: Compliance Evaluation Inspection - Treatment, Storage and Disposal
Return To Compliance: 2003-12-17 00:00:00
Eval Division: Department of Toxic Substances Control
Eval Program: DTSC_ENF
Eval Source: ENVSTORHAZ

Enforcement Action:

Site ID: 238226
Site Name: SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT
Site Address: 5000 PACIFIC COAST HWY
Site City: SAN DIEGO
Site Zip: 92167
Enf Action Date: 03-25-2004
Enf Action Type: Federal Consent Order with Enforcement and Settlement
Enf Action Description: Federal Consent Order with Enforcement and Settlement

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT (Continued)

S121273336

Enf Action Notes: Not reported
Enf Action Division: Department of Toxic Substances Control
Enf Action Program: DTSC_ENF
Enf Action Source: ENVSTORHAZ

Site ID: 238226
Site Name: SOUTHERN CALIFORNIA EDISON SAN ONOFRE PLANT
Site Address: 5000 PACIFIC COAST HWY
Site City: SAN DIEGO
Site Zip: 92167
Enf Action Date: 06-15-1999
Enf Action Type: Federal Consent Order with Enforcement and Settlement
Enf Action Description: Federal Consent Order with Enforcement and Settlement
Enf Action Notes: Not reported
Enf Action Division: Department of Toxic Substances Control
Enf Action Program: DTSC_ENF
Enf Action Source: ENVSTORHAZ

Affiliation:

Affiliation Type Desc: Facility Contact
Entity Name: SARA M DUVALL
Entity Title: Not reported
Affiliation Address: PO BOX 800
Affiliation City: ROSEMEAD
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 91770
Affiliation Phone: 6268628458

Affiliation Type Desc: Facility Owner
Entity Name: Southern California Edison
Entity Title: Not reported
Affiliation Address: PO BOX 800
Affiliation City: ROSEMEAD
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 917700000
Affiliation Phone: 6268628458

P153
ESE
1/2-1
0.608 mi.
3211 ft.

DON POLLOCK EXCAVATING INC
3366 KURTZ STREET
SAN DIEGO, CA 92110

ENVIROSTOR **1000128087**
N/A

Relative:
Lower
Actual:
12 ft.

Site 1 of 2 in cluster P

ENVIROSTOR:
Name: DON POLLOCK EXCAVATING INC
Address: 3366 KURTZ STREET
City,State,Zip: SAN DIEGO, CA 92110
Facility ID: 37170001
Status: Refer: Other Agency
Status Date: 08/21/1995
Site Code: Not reported
Site Type: Historical
Site Type Detailed: * Historical
Acres: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DON POLLOCK EXCAVATING INC (Continued)

1000128087

NPL: NO
Regulatory Agencies: NONE SPECIFIED
Lead Agency: NONE SPECIFIED
Program Manager: Not reported
Supervisor: * Mmonroy
Division Branch: Cleanup Cypress
Assembly: 78
Senate: 39
Special Program: * CERC2
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: Not reported
Latitude: 32.75496
Longitude: -117.2076
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: * CONTAMINATED SOIL
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: 37170001
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 10/25/1994
Comments: CALSITES VALIDATION PROGRAM CONFIRMS NFA FOR DTSC.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Assessment Report
Completed Date: 01/08/1988
Comments: PRELIM ASSESS DONE NO EVIDENCE U/G TANKS REMOVED PRIOR TO PROPERTY DEVELOPMENT. REFER TO COUNTY U/G TANK PROGRAM FOR NECESSARY FOLLOWUP

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 06/12/1987
Comments: SITE SCREENING DONE

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * Discovery
Completed Date: 01/18/1983
Comments: FACILITY IDENTIFIED ID VIA DRIVEBY FACILITY DRIVE-BY SEVERAL DRUMS OBSERVED STAINED EARTH (PERHAPS OIL) ON SITE GROUND PHOTOS 2 PHOTOS TAKEN-SHOW DRUMS & STAINING

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

DON POLLOCK EXCAVATING INC (Continued)

1000128087

Schedule Revised Date: Not reported

P154
ESE
1/2-1
0.627 mi.
3309 ft.

BOYCE INDUSTRIES
3344 KURTZ ST
SAN DIEGO, CA 92110

Site 2 of 2 in cluster P

ENVIROSTOR
San Diego Co. HMMD
HIST CORTESE
CERS

S101481989
N/A

Relative:
Lower

Actual:
12 ft.

ENVIROSTOR:
Name: BOYCE INDUSTRIES
Address: 3344 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110
Facility ID: 37510093
Status: No Further Action
Status Date: 08/09/1989
Site Code: Not reported
Site Type: Historical
Site Type Detailed: * Historical
Acres: 5
NPL: NO
Regulatory Agencies: NONE SPECIFIED
Lead Agency: NONE SPECIFIED
Program Manager: Not reported
Supervisor: Patrick Hsieh
Division Branch: Cleanup Cypress
Assembly: 78
Senate: 39
Special Program: Not reported
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: Not reported
Latitude: 32.75480
Longitude: -117.2074
APN: NONE SPECIFIED
Past Use: DISTRIBUTOR - CHEMICAL
Potential COC: * DETERGENT & SOAP * UNSPECIFIED ACID SOLUTION * POLYMERIC RESIN WASTE

Confirmed COC: NONE SPECIFIED
Potential Description: IA, SOIL, SV
Alias Name: SPACE AGE PRODUCTS (3344 KURTZ)
Alias Type: Alternate Name
Alias Name: 37510093
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * Discovery
Completed Date: 12/10/1982
Comments: FACILITY IDENTIFIED VIA 66 PHONE BOOK

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 03/06/2018
Comments: Not reported

Completed Area Name: PROJECT WIDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOYCE INDUSTRIES (Continued)

S101481989

Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 10/28/1994
Comments: CALSITES VALIDATION PROJECT CONFIRMS NFA FOR DTSC.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Assessment Report
Completed Date: 08/09/1989
Comments: DELETED FROM CORTESE PRELIM ASSESS DONE NFA DUE TO NO EVIDENCE OF CONTAMINATION SITE IS ONLY A DISTRIBUTOR OF DETERGENTS AND WASHER PARTS. ORIGINAL ASP ID'D SITE AS SPACE AGE AT 3344, HOWEVER, THE ACTUAL SITE OF DRUM STORAGE IS 3346 KURTZ (BOYCE INDUSTRIES)

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 06/04/1987
Comments: SITE SCREENING DONE EVIDENCE OF SPILLS AND LEAKAGE

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

HMMD SAN DIEGO:

Name: BOYCE INDUSTRIES
Address: 3344 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110
Permit Number: 100497
Business Type: 6HK68
EPA Id Number: Not reported
APN: 441-582-19-00
Last HMMD Inspection: 01/27/2000
Facility Telephone: 619-291-3012
Permit Status: INAC
Permit Expiration: 01/27/2000
Date Last Updated: 11/02/2012
Facility Owner: ED BOYCE
Facility Mailing Address: 1105 POINSETTA ST
Facility Mailing City: SANTA ANA
Facility Mailing State: CA
Facility Mailing Zip: 92701-
UST Owner: Not reported
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: Y
Treat Haz Waste: Not reported
Generate Medical Waste: Not reported

Name: CHRIS RUDDY SURFBOARDS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOYCE INDUSTRIES (Continued)

S101481989

Address: 3344 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110-4428
Permit Number: Not reported
Business Type: Not reported
EPA Id Number: Not reported
APN: Not reported
Last HMMD Inspection: Not reported
Facility Telephone: 619-787-2833
Permit Status: Permit Renewed
Permit Expiration: Not reported
Date Last Updated: 04/24/2018
Facility Owner: Not reported
Facility Mailing Address: 3344 Kurtz St, San Diego, CA 92110
Facility Mailing City: Not reported
Facility Mailing State: Not reported
Facility Mailing Zip: Not reported
UST Owner: N
Handle Regulated Hazmat: Not reported
Own Or Operate UST: Not reported
Subject To APSA: Not reported
Generate Haz Waste: N
Treat Haz Waste: N
Generate Medical Waste: Not reported

Inspection Violation:

Record ID: DEH2018-HUPFP-004194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: Not reported
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Initial Inspection
Inspection Number: 5909127
Return To Compliance Date: 2018-04-24T00:00:00.000
Nov: Yes
Violation Classification: Class I
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-04-23T00:00:00.000
Inspection Date: 2018-02-09T11:41:00.000
Violation Code: HMD1001 Unified Program Facility permit not obtained for hazardous materials. SDCC 68.905; 68.906, 68.907

Record ID: DEH2018-HUPFP-004194
Permit Status: Permit Renewed
Active Permit: Y
Facility Id Number: Not reported
Program Element: Hazardous Materials Release Response Plans
Inspection Type: Initial Inspection
Inspection Number: 5909127
Return To Compliance Date: 2018-02-09T00:00:00.000
Nov: No
Violation Classification: Class II
Underground Storage Tank Id: Not reported
Container/Tank Id: Not reported
Last Update: 2019-04-23T00:00:00.000
Inspection Date: 2018-02-09T11:41:00.000
Violation Code: 1020002 Initial &/or annual employee training not conducted in safety procedures for a hazardous material release or threatened release &/or

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOYCE INDUSTRIES (Continued)

S101481989

employee training records not available or not maintained for 3 years.
HSC 25505(a)(4); 19 CCR 2659(b)

Waste and Materials:

Record ID: DEH2018-HUPFP-004194
Permit Status: Permit Renewed
Active Permit: Y
Child Record Id: DEH2018-HCHEM-0169044
Trade Secret: N
Hazardous Material Type: Mixture
Last Updated: 2019-04-23T02:32:02.000
Chemical Name: Polyester Resin
Common Name: Polyester Resin
Case Number: Not reported

HIST CORTESE:

edr_fname: BOYCE INDUSTRIES
edr_fadd1: 3344 KURTZ
City,State,Zip: SAN DIEGO, CA 92110
Region: CORTESE
Facility County Code: 37
Reg By: CALSI
Reg Id: 37510093

CERS:

Name: CHRIS RUDDY SURFBOARDS
Address: 3344 KURTZ ST
City,State,Zip: SAN DIEGO, CA 92110
Site ID: 433606
CERS ID: 10756114
CERS Description: Chemical Storage Facilities

Violations:

Site ID: 433606
Site Name: Chris Ruddy Surfboards
Violation Date: 02-09-2018
Citation: HSC 6.95 Multiple - California Health and Safety Code, Chapter 6.95, Section(s) Multiple
Violation Description: Business Plan Program - Administration/Documentation - General
Violation Notes: Returned to compliance on 04/24/2018. Inspection Sequence ID:5909127;Violation:HMD1001 Unified Program Facility permit not obtained for hazardous materials. SDCC 68.905; 68.906, 68.907
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Site ID: 433606
Site Name: Chris Ruddy Surfboards
Violation Date: 02-09-2018
Citation: HSC 6.95 25505(a)(4) - California Health and Safety Code, Chapter 6.95, Section(s) 25505(a)(4)
Violation Description: Failure to provide initial and annual training to all employees in safety procedures in the event of a release or threatened release of a hazardous material or failure to document and maintain training records for a minimum of three years.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOYCE INDUSTRIES (Continued)

S101481989

Violation Notes: Returned to compliance on 02/09/2018. Inspection Sequence ID:5909127
Violation Division: San Diego County Department of Env Health
Violation Program: HMRRP
Violation Source: CERS

Evaluation:
Eval General Type: Compliance Evaluation Inspection
Eval Date: 02-09-2018
Violations Found: Yes
Eval Type: Routine done by local agency
Eval Notes: Inspector: Burke Mike Inspection ID:5909127
Eval Division: San Diego County Department of Env Health
Eval Program: HMRRP
Eval Source: CERS

Coordinates:
Site ID: 433606
Facility Name: Chris Ruddy Surfboards
Env Int Type Code: HMBP
Program ID: 10756114
Coord Name: Not reported
Ref Point Type Desc: Center of a facility or station.
Latitude: 32.754800
Longitude: -117.207410

Affiliation:
Affiliation Type Desc: CUPA District
Entity Name: San Diego County Env Health
Entity Title: Not reported
Affiliation Address: PO Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92112-9261
Affiliation Phone: (858) 505-6880

Affiliation Type Desc: Environmental Contact
Entity Name: Chris Ruddy
Entity Title: Not reported
Affiliation Address: 3344 Kurtz St
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110
Affiliation Phone: Not reported

Affiliation Type Desc: Legal Owner
Entity Name: Christopher Ruddy
Entity Title: Not reported
Affiliation Address: 3344 Kurtz St
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: United States
Affiliation Zip: 92110
Affiliation Phone: (619) 787-2833

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOYCE INDUSTRIES (Continued)

S101481989

Affiliation Type Desc: Operator
Entity Name: Chris Ruddy
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: (619) 787-2833

Affiliation Type Desc: Parent Corporation
Entity Name: Christopher Ruddy
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Identification Signer
Entity Name: Christopher Ruddy
Entity Title: Owner
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Affiliation Type Desc: Facility Mailing Address
Entity Name: Mailing Address
Entity Title: Not reported
Affiliation Address: 3344 Kurtz St
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: 92110
Affiliation Phone: Not reported

Affiliation Type Desc: Document Preparer
Entity Name: Christopher Ruddy
Entity Title: Not reported
Affiliation Address: Not reported
Affiliation City: Not reported
Affiliation State: Not reported
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

155
SE
1/2-1
0.868 mi.
4584 ft.

HOWARD TAYLOR DODGE
3740 ROSECRANS
SAN DIEGO, CA 92110

CPS-SLIC
HIST CORTESE
Notify 65

S100178497
N/A

Relative:
Lower

CPS-SLIC:

Actual:
15 ft.

Name: ALAN JOHNSON DODGE,INC.
Address: 3740 ROSECRANS ST
City,State,Zip: SAN DIEGO, CA 921103112
Region: STATE
Facility Status: Completed - Case Closed
Status Date: 09/01/1998
Global Id: T0607300425
Lead Agency: SAN DIEGO COUNTY LOP
Lead Agency Case Number: H12788-001
Latitude: 32.752331
Longitude: -117.2041145
Case Type: Cleanup Program Site
Case Worker: Not reported
Local Agency: Not reported
RB Case Number: 9UT1604
File Location: Local Agency
Potential Media Affected: Other Groundwater (uses other than drinking water)
Potential Contaminants of Concern: Gasoline
Site History: Not reported

[Click here to access the California GeoTracker records for this facility:](#)

HIST CORTESE:

edr_fname: HOWARD TAYLOR DODGE
edr_fadd1: 3740 ROSECRANS
City,State,Zip: SAN DIEGO, CA 92110
Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT1604

NOTIFY 65:

Date Reported: Not reported
Staff Initials: Not reported
Board File Number: Not reported
Facility Type: Not reported
Discharge Date: Not reported
Issue Date: Not reported
Incident Description: Not reported

Q156
SE
1/2-1
0.884 mi.
4669 ft.

MIDWAY DRIVE (A.K.A. CAUSEWAY)
SAN DIEGO, CA
Site 1 of 2 in cluster Q

FUDS 1024904061
N/A

Relative:
Lower

FUDS:

Actual:
12 ft.

EPA Region: 9
Installation ID: CA99799FA43300
Congressional District Number: 52
Facility Name: MIDWAY DRIVE (A.K.A. CAUSEWAY)
FUDS Number: J09CA7406

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MIDWAY DRIVE (A.K.A. CAUSEWAY) (Continued)

1024904061

City: SAN DIEGO
State: CA
County: SAN DIEGO
Telephone: 213-452-3920
USACE Division: South Pacific Division (SPD)
USACE District: Los Angeles District (SPL)
Status: Properties without projects
Current Owner: Not reported
X Coord: -117.208333329818
Y Coord: 32.750000000300602
Latitude: 32.75
Longitude: -117.20833333

Q157
SE
1/2-1
0.885 mi.
4673 ft.

MIDWAY DRIVE (A.K.A. CAUSEWAY)

ENVIROSTOR

S107736739
N/A

SAN DIEGO, CA

Site 2 of 2 in cluster Q

Relative:
Lower
Actual:
12 ft.

ENVIROSTOR:
Name: MIDWAY DRIVE (A.K.A. CAUSEWAY)
Address: Not reported
City,State,Zip: SAN DIEGO, CA
Facility ID: 80001106
Status: Inactive - Needs Evaluation
Status Date: 07/01/2005
Site Code: Not reported
Site Type: Military Evaluation
Site Type Detailed: FUDS
Acres: 0
NPL: NO
Regulatory Agencies: SMBRP
Lead Agency: SMBRP
Program Manager: Not reported
Supervisor: Douglas Bautista
Division Branch: Cleanup Cypress
Assembly: 78
Senate: 39
Special Program: Not reported
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: DERA
Latitude: 32.75
Longitude: -117.2083
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: NONE SPECIFIED
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: Causeway
Alias Type: Alternate Name
Alias Name: CA99799FA43300
Alias Type: Federal Facility ID
Alias Name: J09CA7406
Alias Type: INPR
Alias Name: 80001106
Alias Type: Envirostor ID Number

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MIDWAY DRIVE (A.K.A. CAUSEWAY) (Continued)

S107736739

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Inventory Project Report (INPR)
Completed Date: 08/24/1999
Comments: Not reported

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

158
ENE
1/2-1
0.886 mi.
4680 ft.

Relative:
Higher

Actual:
30 ft.

**MISSION CHEMICAL CO. (2)
4990 NAPLES
SAN DIEGO, CA 92110**

**ENVIROSTOR 1000382469
LUST N/A
HAZNET
HIST CORTESE
NPDES
SAN DIEGO CO LOP
CIWQS
CERS**

ENVIROSTOR:

Name: MISSION CHEMICAL CO. (2)
Address: 4990 NAPLES
City,State,Zip: SAN DIEGO, CA 92110
Facility ID: 37510124
Status: Refer: Other Agency
Status Date: 06/01/1995
Site Code: Not reported
Site Type: Historical
Site Type Detailed: * Historical
Acres: Not reported
NPL: NO
Regulatory Agencies: NONE SPECIFIED
Lead Agency: NONE SPECIFIED
Program Manager: Not reported
Supervisor: * Mmonroy
Division Branch: Cleanup Cypress
Assembly: Not reported
Senate: Not reported
Special Program: Not reported
Restricted Use: NO
Site Mgmt Req: NONE SPECIFIED
Funding: Not reported
Latitude: 32.76972
Longitude: -117.2020
APN: NONE SPECIFIED
Past Use: NONE SPECIFIED
Potential COC: * Sludge - Paint * UNSPECIFIED ACID SOLUTION
Confirmed COC: NONE SPECIFIED
Potential Description: NONE SPECIFIED
Alias Name: CAD9823599895

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION CHEMICAL CO. (2) (Continued)

1000382469

Alias Type: EPA Identification Number
Alias Name: 37510124
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 06/01/1995
Comments: SD County Environmental Assessment Listing indicates that the County overseeing a Preliminary Assessment as of 12/04/91. Tank case, soil contamination only. Local oversight program. NFA for DTSC.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 05/02/1995
Comments: SD County Environmental Assessment history indicates that the county overseeing a Preliminary Assessment as of 12/04/91. Tank case, soil contamination only. Local oversight program. NFA for DTSC.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 02/08/1991
Comments: PA report was reviewed by Region 4 staff. The site consists of a 15,000 sf bldg., a paved storage area, & a concrete loading dock. 99% of chemicals handled were detergent, wax and window cleaner. Presently, the bldg is used as an auto parts warehouse by Volks Parts. A driveby in 1983 by SDDHS reported that concrete was eroded outside the bldg. No sampling was done to determine if there is a hazard at the site. Staff recommends PEARM to determine if there is a hazard DTSC should address.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Site Screening
Completed Date: 06/02/1987
Comments: SITE SCREENING DONE WILL BE WORKED ON UNDER NEW CERCLA GRANT EVIDENCE OF ACID SPILLS WHICH ATE THROUGH CONCRETE

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: * Discovery
Completed Date: 01/18/1983
Comments: FACILITY IDENTIFIED VIA 72 PHONE BOOK (IMP. CO)

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION CHEMICAL CO. (2) (Continued)

1000382469

LUST:

Name: MISSION CHEMICAL
Address: 4990 NAPLES ST
City,State,Zip: SAN DIEGO, CA 921103820
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607300951
Global Id: T0607300951
Latitude: 32.7700096
Longitude: -117.2016994
Status: Completed - Case Closed
Status Date: 02/21/2003
Case Worker: LA
RB Case Number: 9UT2181
Local Agency: SAN DIEGO COUNTY LOP
File Location: Local Agency
Local Case Number: H22857-001
Potential Media Affect: Other Groundwater (uses other than drinking water)
Potential Contaminants of Concern: Gasoline
Site History: Not reported

LUST:

Global Id: T0607300951
Contact Type: Local Agency Caseworker
Contact Name: LAURIE APECECHEA
Organization Name: SAN DIEGO COUNTY LOP
Address: P.O. Box 129261
City: San Diego
Email: laurie.apecechea@sdcounty.ca.gov
Phone Number: Not reported

LUST:

Global Id: T0607300951
Action Type: Other
Date: 12/04/1991
Action: Leak Began

Global Id: T0607300951
Action Type: Other
Date: 12/04/1991
Action: Leak Discovery

Global Id: T0607300951
Action Type: Other
Date: 12/04/1991
Action: Leak Stopped

Global Id: T0607300951
Action Type: ENFORCEMENT
Date: 02/19/1992
Action: Notice of Responsibility

Global Id: T0607300951
Action Type: Other
Date: 12/04/1991
Action: Leak Reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION CHEMICAL CO. (2) (Continued)

1000382469

Global Id: T0607300951
Action Type: ENFORCEMENT
Date: 02/21/2003
Action: Closure/No Further Action Letter

LUST:

Global Id: T0607300951
Status: Open - Case Begin Date
Status Date: 12/04/1991

Global Id: T0607300951
Status: Completed - Case Closed
Status Date: 02/21/2003

HAZNET:

Name: GLOBAL MARITEK SYSTEMS INC
Address: 4990 NAPLES ST
City,State,Zip: SAN DIEGO, CA 92110
Year: 2017
GEPAID: CAL000426659
Contact: MARK EDDO
Telephone: 6192761264
Mailing Name: Not reported
Mailing Address: 4990 NAPLES ST
Mailing City,St,Zip: SAN DIEGO, CA 92110
Gen County: San Diego
TSD EPA ID: CAL000330453
TSD County: Los Angeles
Tons: 0.1
CA Waste Code: 352-Other organic solids
Method: H010-Metals Recovery Including Retoring,Smelting,Chemicals,Ect
Facility County: San Diego

HIST CORTESE:

edr_fname: IMPORT PARTS DEPO
edr_fadd1: 4990 NAPLES
City,State,Zip: SAN DEIGO, CA 92110
Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT2181

edr_fname: MISSION CHEMICAL CO. (2)
edr_fadd1: 4990 NAPLES
City,State,Zip: SAN DEIGO, CA 92110
Region: CORTESE
Facility County Code: 37
Reg By: CALSI
Reg Id: 37510124

NPDES:

Name: SAN DIEGO VESSEL MAINTENANCE FACILITY
Address: 4990 NAPLES STREET
City,State,Zip: SAN DIEGO, CA 92110

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION CHEMICAL CO. (2) (Continued)

1000382469

Facility Status:	Active
NPDES Number:	CAS000001
Region:	9
Agency Number:	0
Regulatory Measure ID:	450293
Place ID:	Not reported
Order Number:	97-03-DWQ
WDID:	9 37NEC000066
Regulatory Measure Type:	Enrollee
Program Type:	Industrial
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	07/13/2015
Termination Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Discharge Address:	3501 B N Ponce De Leon Blvd #368
Discharge Name:	Global Maritek Systems Inc
Discharge City:	St Augustine
Discharge State:	Florida
Discharge Zip:	32094
Status:	Not reported
Status Date:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
NPDES as of 03/2018:	
NPDES Number:	Not reported
Status:	Not reported
Agency Number:	Not reported
Region:	9
Regulatory Measure ID:	450293
Order Number:	Not reported
Regulatory Measure Type:	Industrial
Place ID:	Not reported
WDID:	9 37NEC000066
Program Type:	Not reported
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	Not reported
Discharge Name:	Not reported
Discharge Address:	Not reported
Discharge City:	Not reported
Discharge State:	Not reported
Discharge Zip:	Not reported
Received Date:	07/08/2015
Processed Date:	07/13/2015
Status:	Active
Status Date:	07/13/2015
Place Size:	35152
Place Size Unit:	SqFt
Contact:	Mark Eddo
Contact Title:	Site Manager
Contact Phone:	619-276-1264
Contact Phone Ext:	Not reported
Contact Email:	Mark.eddo@nmsc.gov

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION CHEMICAL CO. (2) (Continued)

1000382469

Operator Name:	Global Maritek Systems Inc
Operator Address:	5251 NW 33rd Ave
Operator City:	Fort Lauderdale
Operator State:	Florida
Operator Zip:	33309
Operator Contact:	Roger Mitchell
Operator Contact Title:	Contact
Operator Contact Phone:	954-766-9999
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	RMitchell@GlobalMaritek.com
Operator Type:	Private Business
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Florida
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	N
Receiving Water Name:	Tecolote Creek
Certifier:	Darrell Meron
Certifier Title:	Program Manager
Certification Date:	12-SEP-16
Primary Sic:	3732-Boat Building and Repairing
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	CAS000001
Status:	Active
Agency Number:	0
Region:	9
Regulatory Measure ID:	450293
Order Number:	97-03-DWQ
Regulatory Measure Type:	Enrollee
Place ID:	Not reported
WDID:	9 37NEC000066
Program Type:	Industrial
Adoption Date Of Regulatory Measure:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION CHEMICAL CO. (2) (Continued)

1000382469

Effective Date Of Regulatory Measure: 07/13/2015
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Global Maritek Systems Inc
Discharge Address: 5251 NW 33rd Ave
Discharge City: Fort Lauderdale
Discharge State: Florida
Discharge Zip: 33309
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported
Contact: Not reported
Contact Title: Not reported
Contact Phone: Not reported
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Contact: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported
Operator Contact Phone Ext: Not reported
Operator Contact Email: Not reported
Operator Type: Not reported
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: Not reported
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: Not reported
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported
Constype Recons Ind: Not reported
Constype Residential Ind: Not reported
Constype Transport Ind: Not reported
Constype Utility Description: Not reported
Constype Utility Ind: Not reported
Constype Water Sewer Ind: Not reported
Dir Discharge Uswater Ind: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION CHEMICAL CO. (2) (Continued)

1000382469

Receiving Water Name: Not reported
Certifier: Not reported
Certifier Title: Not reported
Certification Date: Not reported
Primary Sic: Not reported
Secondary Sic: Not reported
Tertiary Sic: Not reported

Name: SAN DIEGO VESSEL MAINTENANCE FACILITY
Address: 4990 NAPLES STREET
City,State,Zip: SAN DIEGO, CA 92110
Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported
Order Number: Not reported
WDID: 9 37NEC000066
Regulatory Measure Type: Industrial
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Active
Status Date: 07/13/2015
Operator Name: Global Maritek Systems Inc
Operator Address: 3501 B N Ponce De Leon Blvd #368
Operator City: St Augustine
Operator State: Florida
Operator Zip: 32094

NPDES as of 03/2018:

NPDES Number: Not reported
Status: Not reported
Agency Number: Not reported
Region: 9
Regulatory Measure ID: 450293
Order Number: Not reported
Regulatory Measure Type: Industrial
Place ID: Not reported
WDID: 9 37NEC000066
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Not reported
Discharge Address: Not reported
Discharge City: Not reported
Discharge State: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION CHEMICAL CO. (2) (Continued)

1000382469

Discharge Zip:	Not reported
Received Date:	07/08/2015
Processed Date:	07/13/2015
Status:	Active
Status Date:	07/13/2015
Place Size:	35152
Place Size Unit:	SqFt
Contact:	Mark Eddo
Contact Title:	Site Manager
Contact Phone:	619-276-1264
Contact Phone Ext:	Not reported
Contact Email:	Mark.eddo@nmsc.gov
Operator Name:	Global Maritek Systems Inc
Operator Address:	5251 NW 33rd Ave
Operator City:	Fort Lauderdale
Operator State:	Florida
Operator Zip:	33309
Operator Contact:	Roger Mitchell
Operator Contact Title:	Contact
Operator Contact Phone:	954-766-9999
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	RMitchell@GlobalMaritek.com
Operator Type:	Private Business
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Florida
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	N
Receiving Water Name:	Tecolote Creek
Certifier:	Darrell Meron
Certifier Title:	Program Manager
Certification Date:	12-SEP-16
Primary Sic:	3732-Boat Building and Repairing
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION CHEMICAL CO. (2) (Continued)

1000382469

NPDES Number: CAS000001
Status: Active
Agency Number: 0
Region: 9
Regulatory Measure ID: 450293
Order Number: 97-03-DWQ
Regulatory Measure Type: Enrollee
Place ID: Not reported
WDID: 9 37NEC000066
Program Type: Industrial
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 07/13/2015
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Discharge Name: Global Maritek Systems Inc
Discharge Address: 5251 NW 33rd Ave
Discharge City: Fort Lauderdale
Discharge State: Florida
Discharge Zip: 33309
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported
Contact: Not reported
Contact Title: Not reported
Contact Phone: Not reported
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Contact: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported
Operator Contact Phone Ext: Not reported
Operator Contact Email: Not reported
Operator Type: Not reported
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: Not reported
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: Not reported
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION CHEMICAL CO. (2) (Continued)

1000382469

Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

SAN DIEGO CO LOP:

Name:	MISSION CHEMICAL
Address:	4990 NAPLES ST
City,State,Zip:	SAN DIEGO, CA 92110
Record ID:	DEH1991-LSAM-H22857-001
Record Status:	Completed
Opened Date:	12/04/1991
Parcel Number:	436-192-14-00
Case Type:	LOP - Local Oversight Program
Historical Name:	FORMER MISSION CHEMICAL CO.
SWRCB Global ID:	T0607300951
Funding:	F - LOP Federal Fund
Lead Agency:	DEH/SAM
Lead Agency Date:	12/04/1992
Census Tract:	91.06
Community:	San Diego
Jurisdiction:	SAN DIEGO
Watershed Basin Number:	906.5
Water Purveyor:	SAN DIEGO
Fire Agency:	SAN DIEGO
Latitude:	32.7697033
Longitude:	-117.2020295
X MapCoord:	6269020.724
Y MapCoord:	1861182.414

CIWQS:

Name:	SAN DIEGO VESSEL MAINTENANCE FACILITY
Address:	4990 NAPLES STREET
City,State,Zip:	SAN DIEGO, CA 92110
Agency:	Global Maritek Systems Inc
Agency Address:	3501 B N Ponce De Leon Blvd #368, St Augustine, FL 32094
Place/Project Type:	Industrial - Boat Building and Repairing
SIC/NAICS:	3732
Region:	9
Program:	INDSTW
Regulatory Measure Status:	Active

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION CHEMICAL CO. (2) (Continued)

1000382469

Regulatory Measure Type: Storm water industrial
Order Number: 2014-0057-DWQ
WDID: 9 37NEC000066
NPDES Number: CAS000001
Adoption Date: Not reported
Effective Date: 07/13/2015
Termination Date: Not reported
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 1
Violations within 5 years: 1
Latitude: 32.76984
Longitude: -117.20175

CERS:

Name: MISSION CHEMICAL
Address: 4990 NAPLES ST
City,State,Zip: SAN DIEGO, CA 921103820
Site ID: 248789
CERS ID: T0607300951
CERS Description: Leaking Underground Storage Tank Cleanup Site

Affiliation:

Affiliation Type Desc: Local Agency Caseworker
Entity Name: LAURIE APECECHEA - SAN DIEGO COUNTY LOP
Entity Title: Not reported
Affiliation Address: P.O. Box 129261
Affiliation City: San Diego
Affiliation State: CA
Affiliation Country: Not reported
Affiliation Zip: Not reported
Affiliation Phone: Not reported

Name: SAN DIEGO VESSEL MAINTENANCE FACILITY
Address: 4990 NAPLES STREET
City,State,Zip: SAN DIEGO, CA 92110
Site ID: 541626
CERS ID: 832049
CERS Description: Industrial Facility Storm Water

Violations:

Site ID: 541626
Site Name: San Diego Vessel Maintenance Facility
Violation Date: 10-02-2017
Citation: 2014-0057-DWQ - Industrial General Permit
Violation Description: SW - Failure to Obtain Permit
Violation Notes: DISCHARGER FAILED TO RECERTIFY THE NEC BY OCTOBER 1, 2017
Violation Division: Water Boards
Violation Program: INDSTW
Violation Source: SMARTS

Evaluation:

Eval General Type: Compliance Evaluation Inspection

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MISSION CHEMICAL CO. (2) (Continued)

1000382469

Eval Date: 10-14-2015
Violations Found: No
Eval Type: Industrial Storm Water Compliance Evaluation
Eval Notes: Inspection by Lucas Lima to verify No Exposure Certification. There were no issues found. Driving around was sufficient for this facility. Met NEC qualifications.
Eval Division: Water Boards
Eval Program: INDSTW
Eval Source: SMARTS

Enforcement Action:
Site ID: 541626
Site Name: San Diego Vessel Maintenance Facility
Site Address: 4990 NAPLES STREET
Site City: SAN DIEGO
Site Zip: 92110
Enf Action Date: 10-05-2017
Enf Action Type: Industrial Storm Water Enforcement
Enf Action Description: Industrial Storm Water Enforcement
Enf Action Notes: DISCHARGER FAILED TO RECERTIFY THE NEC BY OCTOBER 1, 2017
Enf Action Division: Water Boards
Enf Action Program: INDSTW
Enf Action Source: SMARTS

Affiliation:
Affiliation Type Desc: Owner/Operator
Entity Name: Global Maritek Systems Inc
Entity Title: Operator
Affiliation Address: 3501 B N Ponce De Leon Blvd #368
Affiliation City: St Augustine
Affiliation State: FL
Affiliation Country: Not reported
Affiliation Zip: 32094
Affiliation Phone: Not reported

159
SSW
1/2-1
0.897 mi.
4737 ft.
Relative:
Higher
Actual:
64 ft.

CORREIA JUNIOR HIGH SCHOO
4302 VALETA
SAN DIEGO, CA 92107

ENVIROSTOR
LUST
SAN DIEGO CO. SAM
SCH
DEED
HIST CORTESE
NPDES
SAN DIEGO CO LOP
CIWQS
CERS

S100873086
N/A

ENVIROSTOR:
Name: CORREIA MIDDLE SCHOOL
Address: 4302 VALETA STREET
City,State,Zip: SAN DIEGO, CA 92107
Facility ID: 60000103
Status: Active
Status Date: 11/08/2010
Site Code: 404627
Site Type: School Cleanup
Site Type Detailed: School

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOOL (Continued)

S100873086

Acres: 5
NPL: NO
Regulatory Agencies: SMBRP
Lead Agency: SMBRP
Program Manager: Rana Georges
Supervisor: Yolanda Garza
Division Branch: Southern California Schools & Brownfields Outreach
Assembly: 78
Senate: 39
Special Program: Not reported
Restricted Use: YES
Site Mgmt Req: NONE SPECIFIED
Funding: School District
Latitude: 32.74879
Longitude: -117.2314
APN: 449-110-03-00
Past Use: INCINERATOR - OTHER, LANDFILL - DOMESTIC
Potential COC: Dioxin (as 2,3,7,8-TCDD TEQ Lead
Confirmed COC: Dioxin (as 2,3,7,8-TCDD TEQ Lead
Potential Description: SOIL
Alias Name: Correia MS
Alias Type: Alternate Name
Alias Name: SAN DIEGO CITY USD-CORREIA JUNIOR HS
Alias Type: Alternate Name
Alias Name: 449-110-03-00
Alias Type: APN
Alias Name: 110033616406
Alias Type: EPA (FRS #)
Alias Name: 404627
Alias Type: Project Code (Site Code)
Alias Name: 60000103
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: CEQA - Notice of Exemption
Completed Date: 08/11/2011
Comments: NOE approved as final and filed with the state clearinghouse.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Environmental Oversight Agreement
Completed Date: 11/16/2006
Comments: Master Oversight Agreement executed on 4/5/2002 was amended on 11/16/2006 to include the correia site.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 06/13/2011
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Inactive Status Letter
Completed Date: 03/09/2010
Comments: DTSC issued an inactive status letter due to timeline uncertainty.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 10/12/2005
Comments: Finalize schedule.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Endangerment Assessment Workplan
Completed Date: 12/14/2005
Comments: WP Approved.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Endangerment Assessment Report
Completed Date: 11/17/2006
Comments: DTSC approved the PEA for further action. PDF copy was sent to district/consultant.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Removal Action Workplan
Completed Date: 08/11/2011
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fact Sheets
Completed Date: 12/13/2006
Comments: Fact sheet was completed but wasn't delivered to community. District chose to send out letter with District's heading to notify community of activities (see attached document).

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Community Profile
Completed Date: 11/20/2006
Comments: Survey was sent out to community surrounding school site.

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: Supplemental Site Investigation Tech Memo
Completed Date: 02/27/2007
Comments: Wrote an email to District and Consultant to approve the Technical Memorandum for the new Study Area 3. In the email, one issue was noted which was the sampling method for PAHs, indicated that demonstration of equivalent reporting limits must be included for future data with different analytical method.

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 06/12/2007
Comments: Consultant performed housekeeping, pictures will be forwarded to DTSC along with lab sampling results. Consultant stated that according to XRF sampling results no sample exceeded 150 ppm.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: Supplemental Site Investigation Tech Memo
Completed Date: 05/18/2007
Comments: DTSC approved the Sampling Workplan for the bottom of Study Area 3 (city property)

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Newsletter
Completed Date: 05/14/2007
Comments: District notified DTSC that update has been sent to school for distribution.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fact Sheets
Completed Date: 06/10/2011
Comments: Final fact sheet attached.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Public Notice
Completed Date: 06/13/2011
Comments: DTSC approves English and Spanish versions of the Public Notice.

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: Supplemental Site Investigation Report
Completed Date: 08/16/2007
Comments: DTSC approved the Study Area 3 (City Portion) sampling report with a No Further Action determination.

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: Supplemental Site Investigation Report
Completed Date: 10/04/2007
Comments: DTSC approved Study Area 3 for No Further Action

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 11/09/2007
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fact Sheets
Completed Date: 12/19/2007
Comments: DTSC has reviewed and approved the work notice (english and spanish).

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fact Sheets
Completed Date: 01/24/2007
Comments: Fact sheet was made available for participants during a parent meeting held by the District on January 24,2007 regarding the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Preliminary Environmental Investigation at the site and the upcoming Removal Action Workplan.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 10/24/2007
Comments: DTSC conditionally approved the engineering plans given that the District completes a soil management plan for the proper excavation and disposal of soil during the installation of the stormceptor which is the main part of the Storm Water Improvement Plan. The stormceptor will be installed in the parking lot area, eastern portion of the site.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 09/30/2008
Comments: Consultant submitted email describing summary of field work activities. Resue and disposal of excavated soil.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 01/04/2008
Comments: Groundwater well installation fieldwork schedule: Dec. 26, 2007 to Jan. 4, 2008. Three wells are to be installed on site.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 12/24/2007
Comments: DTSC approved the Soil Management Plan on 12/24/2007.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 01/29/2008
Comments: Groundwater results were received on 01/22/2008. Data shows groundwater has not been impacted. Therefore, the RAW will move forward. The groundwater results including flow direction will be included in the RAW.

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: *Correspondence - Received
Completed Date: 08/11/2011
Comments: RAW approval. See RAW deliverable.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 04/03/2007
Comments: A second round of groundwater sampling was conducted at the three onsite wells.

Completed Area Name: PROJECT WIDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 05/19/2008
Comments: According to the Letter Report, lead was not detected in groundwater in any of the groundwater monitoring wells at the Site above the laboratory reporting limit. The Letter Report concluded that it does not appear that the burned waste present at the Site has impacted groundwater. The letter report further recommended that DTSC approves the elimination of the low permeability cap from the slope stabilization project located along the slope in Study Area 2 and that the monitoring wells may be abandoned. Based on review of the Letter Report, groundwater does not appear to have been impacted by lead from burned waste present at the Site. Therefore, DTSC concurred with the conclusions of the Letter Report that the utilization of a low permeability cap may be eliminated from the slope stabilization project located along the slope in Study Area 2 and that the monitoring wells may be abandoned.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Community Profile
Completed Date: 06/16/2011
Comments: Final Community Profile.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Operations and Maintenance Plan
Completed Date: 02/27/2015
Comments: DTSC approved the O&M Plan

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Removal Action Completion Report
Completed Date: 08/31/2018
Comments: Approval of RACR.

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 12/28/2016
Comments: Slope stabilization completed.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Operations and Maintenance Report
Completed Date: 02/16/2016
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Operations and Maintenance Report
Completed Date: 08/28/2017
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Operations and Maintenance Report

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOOL (Continued)

S100873086

Completed Date: 06/20/2018
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Soils Management Plan
Completed Date: 05/22/2018
Comments: DTSC concurrence with proposed excavation activities.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Operation & Maintenance Order/Agreement
Completed Date: 04/09/2018
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Land Use Restriction
Completed Date: 06/14/2018
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 08/20/2014
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 09/21/2016
Comments: Annual Cost Estimate Letter, dated 9/21/16, sent to RP via email and regular mail.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 09/24/2015
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 08/31/2017
Comments: Annual Cost Estimate sent 08/31/17.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 08/24/2017
Comments: FY 1819 Estimate: \$

Future Area Name: PROJECT WIDE
Future Sub Area Name: Not reported
Future Document Type: 5 Year Review Reports
Future Due Date: 2021
Future Area Name: PROJECT WIDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Future Sub Area Name: Not reported
Future Document Type: Operations and Maintenance Report
Future Due Date: 2019
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Certification
Schedule Due Date: 04/04/2019
Schedule Revised Date: Not reported

LUST:

Name: SDUSD, CORREIA JR HIGH
Address: 4302 VALETA ST
City,State,Zip: SAN DIEGO, CA 921071510
Lead Agency: SAN DIEGO COUNTY LOP
Case Type: LUST Cleanup Site
Geo Track: http://geotracker.waterboards.ca.gov/profile_report.asp?global_id=T0607300087
Global Id: T0607300087
Latitude: 32.7487763
Longitude: -117.2313848
Status: Completed - Case Closed
Status Date: 01/20/1989
Case Worker: Not reported
RB Case Number: 9UT1076
Local Agency: Not reported
File Location: Local Agency
Local Case Number: H00132-001
Potential Media Affect: Soil
Potential Contaminants of Concern: Heating Oil / Fuel Oil
Site History: Not reported

LUST:

Global Id: T0607300087
Action Type: Other
Date: 07/27/1988
Action: Leak Began

Global Id: T0607300087
Action Type: Other
Date: 07/27/1988
Action: Leak Discovery

Global Id: T0607300087
Action Type: Other
Date: 07/27/1988
Action: Leak Stopped

Global Id: T0607300087
Action Type: Other
Date: 07/27/1988
Action: Leak Reported

LUST:

Global Id: T0607300087
Status: Open - Case Begin Date
Status Date: 07/27/1988

Global Id: T0607300087

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Status: Completed - Case Closed
Status Date: 01/20/1989

SAN DIEGO CO. SAM:

Name: SDUSD, CORREIA JR HIGH
Address: 4302 VALETA ST
City,State,Zip: SAN DIEGO, CA 921071510
Case Number: H00132-001
Agency: DEH Site Assessment & Mitigation
Funding: LOP - Federal Fund
Facility Type: Soils Only
Facility Status: Closed Case
Date: 1/20/1989
Date Began: 7/27/1988

SCH:

Name: CORREIA MIDDLE SCHOOL
Address: 4302 VALETA STREET
City,State,Zip: SAN DIEGO, CA 92107
Facility ID: 60000103
Site Type: School Cleanup
Site Type Detail: School
Site Mgmt. Req.: NONE SPECIFIED
Acres: 5
National Priorities List: NO
Cleanup Oversight Agencies: SMBRP
Lead Agency: SMBRP
Lead Agency Description: DTSC - Site Cleanup Program
Project Manager: Rana Georges
Supervisor: Yolanda Garza
Division Branch: Southern California Schools & Brownfields Outreach
Site Code: 404627
Assembly: 78
Senate: 39
Special Program Status: Not reported
Status: Active
Status Date: 11/08/2010
Restricted Use: YES
Funding: School District
Latitude: 32.74879
Longitude: -117.2314
APN: 449-110-03-00
Past Use: INCINERATOR - OTHER, LANDFILL - DOMESTIC
Potential COC: Dioxin (as 2,3,7,8-TCDD TEQ, Lead
Confirmed COC: Dioxin (as 2,3,7,8-TCDD TEQ, Lead
Potential Description: SOIL
Alias Name: Correia MS
Alias Type: Alternate Name
Alias Name: SAN DIEGO CITY USD-CORREIA JUNIOR HS
Alias Type: Alternate Name
Alias Name: 449-110-03-00
Alias Type: APN
Alias Name: 110033616406
Alias Type: EPA (FRS #)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Alias Name: 404627
Alias Type: Project Code (Site Code)
Alias Name: 60000103
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: CEQA - Notice of Exemption
Completed Date: 08/11/2011
Comments: NOE approved as final and filed with the state clearinghouse.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Environmental Oversight Agreement
Completed Date: 11/16/2006
Comments: Master Oversight Agreement executed on 4/5/2002 was amended on 11/16/2006 to include the correia site.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Correspondence
Completed Date: 06/13/2011
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Inactive Status Letter
Completed Date: 03/09/2010
Comments: DTSC issued an inactive status letter due to timeline uncertainty.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 10/12/2005
Comments: Finalize schedule.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Endangerment Assessment Workplan
Completed Date: 12/14/2005
Comments: WP Approved.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Preliminary Endangerment Assessment Report
Completed Date: 11/17/2006
Comments: DTSC approved the PEA for further action. PDF copy was sent to district/consultant.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Removal Action Workplan
Completed Date: 08/11/2011
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOOL (Continued)

S100873086

Completed Document Type: Fact Sheets
Completed Date: 12/13/2006
Comments: Fact sheet was completed but wasn't delivered to community. District chose to send out letter with District's heading to notify community of activities (see attached document).

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Community Profile
Completed Date: 11/20/2006
Comments: Survey was sent out to community surrounding school site.

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: Supplemental Site Investigation Tech Memo
Completed Date: 02/27/2007
Comments: Wrote an email to District and Consultant to approve the Technical Memorandum for the new Study Area 3. In the email, one issue was noted which was the sampling method for PAHs, indicated that demonstration of equivalent reporting limits must be included for future data with different analytical method.

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 06/12/2007
Comments: Consultant performed housekeeping, pictures will be forwarded to DTSC along with lab sampling results. Consultant stated that according to XRF sampling results no sample exceeded 150 ppm.

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: Supplemental Site Investigation Tech Memo
Completed Date: 05/18/2007
Comments: DTSC approved the Sampling Workplan for the bottom of Study Area 3 (city property)

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Newsletter
Completed Date: 05/14/2007
Comments: District notified DTSC that update has been sent to school for distribution.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fact Sheets
Completed Date: 06/10/2011
Comments: Final fact sheet attached.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Public Notice
Completed Date: 06/13/2011
Comments: DTSC approves English and Spanish versions of the Public Notice.

Completed Area Name: Slope Area

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOOL (Continued)

S100873086

Completed Sub Area Name: Not reported
Completed Document Type: Supplemental Site Investigation Report
Completed Date: 08/16/2007
Comments: DTSC approved the Study Area 3 (City Portion) sampling report with a No Further Action determination.

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: Supplemental Site Investigation Report
Completed Date: 10/04/2007
Comments: DTSC approved Study Area 3 for No Further Action

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 11/09/2007
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fact Sheets
Completed Date: 12/19/2007
Comments: DTSC has reviewed and approved the work notice (english and spanish).

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fact Sheets
Completed Date: 01/24/2007
Comments: Fact sheet was made available for participants during a parent meeting held by the District on January 24, 2007 regarding the Preliminary Environmental Investigation at the site and the upcoming Removal Action Workplan.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 10/24/2007
Comments: DTSC conditionally approved the engineering plans given that the District completes a soil management plan for the proper excavation and disposal of soil during the installation of the stormceptor which is the main part of the Storm Water Improvement Plan. The stormceptor will be installed in the parking lot area, eastern portion of the site.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 09/30/2008
Comments: Consultant submitted email describing summary of field work activities. Resue and disposal of excavated soil.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 01/04/2008
Comments: Groundwater well installation fieldwork schedule: Dec. 26, 2007 to Jan. 4, 2008. Three wells are to be installed on site.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 12/24/2007
Comments: DTSC approved the Soil Management Plan on 12/24/2007.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Technical Workplan
Completed Date: 01/29/2008
Comments: Groundwater results were received on 01/22/2008. Data shows groundwater has not been impacted. Therefore, the RAW will move forward. The groundwater results including flow direction will be included in the RAW.

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: *Correspondence - Received
Completed Date: 08/11/2011
Comments: RAW approval. See RAW deliverable.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 04/03/2007
Comments: A second round of groundwater sampling was conducted at the three onsite wells.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Other Report
Completed Date: 05/19/2008
Comments: According to the Letter Report, lead was not detected in groundwater in any of the groundwater monitoring wells at the Site above the laboratory reporting limit. The Letter Report concluded that it does not appear that the burned waste present at the Site has impacted groundwater. The letter report further recommended that DTSC approves the elimination of the low permeability cap from the slope stabilization project located along the slope in Study Area 2 and that the monitoring wells may be abandoned. Based on review of the Letter Report, groundwater does not appear to have been impacted by lead from burned waste present at the Site. Therefore, DTSC concurred with the conclusions of the Letter Report that the utilization of a low permeability cap may be eliminated from the slope stabilization project located along the slope in Study Area 2 and that the monitoring wells may be abandoned.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Community Profile
Completed Date: 06/16/2011
Comments: Final Community Profile.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Operations and Maintenance Plan
Completed Date: 02/27/2015

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Comments: DTSC approved the O&M Plan

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Removal Action Completion Report
Completed Date: 08/31/2018
Comments: Approval of RACR.

Completed Area Name: Slope Area
Completed Sub Area Name: Not reported
Completed Document Type: Fieldwork
Completed Date: 12/28/2016
Comments: Slope stabilization completed.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Operations and Maintenance Report
Completed Date: 02/16/2016
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Operations and Maintenance Report
Completed Date: 08/28/2017
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Operations and Maintenance Report
Completed Date: 06/20/2018
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Soils Management Plan
Completed Date: 05/22/2018
Comments: DTSC concurrence with proposed excavation activities.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Operation & Maintenance Order/Agreement
Completed Date: 04/09/2018
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Land Use Restriction
Completed Date: 06/14/2018
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 08/20/2014
Comments: Not reported

Completed Area Name: PROJECT WIDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 09/21/2016
Comments: Annual Cost Estimate Letter, dated 9/21/16, sent to RP via email and regular mail.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 09/24/2015
Comments: Not reported

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 08/31/2017
Comments: Annual Cost Estimate sent 08/31/17.

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Annual Oversight Cost Estimate
Completed Date: 08/24/2017
Comments: FY 1819 Estimate: \$

Future Area Name: PROJECT WIDE
Future Sub Area Name: Not reported
Future Document Type: 5 Year Review Reports
Future Due Date: 2021
Future Area Name: PROJECT WIDE
Future Sub Area Name: Not reported
Future Document Type: Operations and Maintenance Report
Future Due Date: 2019
Schedule Area Name: PROJECT WIDE
Schedule Sub Area Name: Not reported
Schedule Document Type: Certification
Schedule Due Date: 04/04/2019
Schedule Revised Date: Not reported

DEED:

Name: CORREIA MIDDLE SCHOOL
Address: 4302 VALETA STREET
City,State,Zip: SAN DIEGO, CA 92107
Envirostor ID: 60000103
Area: PROJECT WIDE
Sub Area: Not reported
Site Type: SCHOOL CLEANUP
Status: ACTIVE
Agency: Not reported
Covenant Uploaded: Not reported
Deed Date(s): 06/14/2018
File Name: Envirostor Land Use Restrictions

HIST CORTESE:

edr_fname: CORREIA JUNIOR HIGH SCHOO
edr_fadd1: 4302 VALETA
City,State,Zip: SAN DIEGO, CA 92107

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Region: CORTESE
Facility County Code: 37
Reg By: LTNKA
Reg Id: 9UT1076

NPDES:

Name: CORREIA JHS RETAININNG WALL
Address: 4302 VALETA STREET
City,State,Zip: SAN DIEGO, CA 92107
Facility Status: Not reported
NPDES Number: Not reported
Region: Not reported
Agency Number: Not reported
Regulatory Measure ID: Not reported
Place ID: Not reported
Order Number: Not reported
WDID: 9 37C371787
Regulatory Measure Type: Construction
Program Type: Not reported
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: Not reported
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: Not reported
Discharge Name: Not reported
Discharge City: Not reported
Discharge State: Not reported
Discharge Zip: Not reported
Status: Terminated
Status Date: 12/12/2016
Operator Name: San Diego Unified School District
Operator Address: 4860 Ruffner Street
Operator City: San Diego
Operator State: California
Operator Zip: 92111

NPDES as of 03/2018:

NPDES Number: CAS000002
Status: Terminated
Agency Number: 0
Region: 9
Regulatory Measure ID: 451538
Order Number: 2009-0009-DWQ
Regulatory Measure Type: Enrollee
Place ID: Not reported
WDID: 9 37C371787
Program Type: Construction
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 12/23/2014
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: 12/12/2016
Discharge Name: San Diego Unified School District
Discharge Address: 4860 Ruffner Street
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92111
Received Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Processed Date:	Not reported
Status:	Not reported
Status Date:	Not reported
Place Size:	Not reported
Place Size Unit:	Not reported
Contact:	Not reported
Contact Title:	Not reported
Contact Phone:	Not reported
Contact Phone Ext:	Not reported
Contact Email:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City:	Not reported
Operator State:	Not reported
Operator Zip:	Not reported
Operator Contact:	Not reported
Operator Contact Title:	Not reported
Operator Contact Phone:	Not reported
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	Not reported
Operator Type:	Not reported
Developer:	Not reported
Developer Address:	Not reported
Developer City:	Not reported
Developer State:	Not reported
Developer Zip:	Not reported
Developer Contact:	Not reported
Developer Contact Title:	Not reported
Constype Linear Utility Ind:	Not reported
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	Not reported
Constype Below Ground Ind:	Not reported
Constype Cable Line Ind:	Not reported
Constype Comm Line Ind:	Not reported
Constype Commercial Ind:	Not reported
Constype Electrical Line Ind:	Not reported
Constype Gas Line Ind:	Not reported
Constype Industrial Ind:	Not reported
Constype Other Description:	Not reported
Constype Other Ind:	Not reported
Constype Recons Ind:	Not reported
Constype Residential Ind:	Not reported
Constype Transport Ind:	Not reported
Constype Utility Description:	Not reported
Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Status:	Not reported
Agency Number:	Not reported
Region:	9
Regulatory Measure ID:	451538
Order Number:	Not reported
Regulatory Measure Type:	Construction
Place ID:	Not reported
WDID:	9 37C371787
Program Type:	Not reported
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	12/12/2016
Discharge Name:	Not reported
Discharge Address:	Not reported
Discharge City:	Not reported
Discharge State:	Not reported
Discharge Zip:	Not reported
Received Date:	12/10/2014
Processed Date:	12/23/2014
Status:	Terminated
Status Date:	12/12/2016
Place Size:	1.32
Place Size Unit:	Acres
Contact:	Gary Stanford
Contact Title:	Director, Project Mgmt
Contact Phone:	585-637-6280
Contact Phone Ext:	Not reported
Contact Email:	gstanford1@sandi.net
Operator Name:	San Diego Unified School District
Operator Address:	4860 Ruffner Street
Operator City:	San Diego
Operator State:	California
Operator Zip:	92111
Operator Contact:	Gary Stanford
Operator Contact Title:	Director, Project Mgmt
Operator Contact Phone:	585-637-6280
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	gstanford1@sandi.net
Operator Type:	Special District
Developer:	SDUSD
Developer Address:	4860 Ruffner Street
Developer City:	San Diego
Developer State:	California
Developer Zip:	92111
Developer Contact:	Gary Stanford
Developer Contact Title:	Director, Project Mgmt.
Constype Linear Utility Ind:	N
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	N
Constype Below Ground Ind:	N
Constype Cable Line Ind:	N
Constype Comm Line Ind:	N
Constype Commercial Ind:	N
Constype Electrical Line Ind:	N
Constype Gas Line Ind:	N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Constype Industrial Ind: N
Constype Other Description: Retaining Wall and Erosion Control
Constype Other Ind: Y
Constype Recons Ind: N
Constype Residential Ind: N
Constype Transport Ind: N
Constype Utility Description: Not reported
Constype Utility Ind: N
Constype Water Sewer Ind: N
Dir Discharge Uswater Ind: N
Receiving Water Name: Famosa Slough
Certifier: Don Webb
Certifier Title: Director of Project Mgt.
Certification Date: 25-FEB-16
Primary Sic: Not reported
Secondary Sic: Not reported
Tertiary Sic: Not reported

Name: CORREIA JHS RETAININNG WALL
Address: 4302 VALETA STREET
City,State,Zip: SAN DIEGO, CA 92107
Facility Status: Terminated
NPDES Number: CAS000002
Region: 9
Agency Number: 0
Regulatory Measure ID: 451538
Place ID: Not reported
Order Number: 2009-0009-DWQ
WDID: 9 37C371787
Regulatory Measure Type: Enrollee
Program Type: Construction
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 12/23/2014
Termination Date Of Regulatory Measure: 12/12/2016
Expiration Date Of Regulatory Measure: Not reported
Discharge Address: 4860 Ruffner Street
Discharge Name: San Diego Unified School District
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92111
Status: Not reported
Status Date: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported

NPDES as of 03/2018:

NPDES Number: CAS000002
Status: Terminated
Agency Number: 0
Region: 9
Regulatory Measure ID: 451538
Order Number: 2009-0009-DWQ
Regulatory Measure Type: Enrollee
Place ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

WDID: 9 37C371787
Program Type: Construction
Adoption Date Of Regulatory Measure: Not reported
Effective Date Of Regulatory Measure: 12/23/2014
Expiration Date Of Regulatory Measure: Not reported
Termination Date Of Regulatory Measure: 12/12/2016
Discharge Name: San Diego Unified School District
Discharge Address: 4860 Ruffner Street
Discharge City: San Diego
Discharge State: California
Discharge Zip: 92111
Received Date: Not reported
Processed Date: Not reported
Status: Not reported
Status Date: Not reported
Place Size: Not reported
Place Size Unit: Not reported
Contact: Not reported
Contact Title: Not reported
Contact Phone: Not reported
Contact Phone Ext: Not reported
Contact Email: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City: Not reported
Operator State: Not reported
Operator Zip: Not reported
Operator Contact: Not reported
Operator Contact Title: Not reported
Operator Contact Phone: Not reported
Operator Contact Phone Ext: Not reported
Operator Contact Email: Not reported
Operator Type: Not reported
Developer: Not reported
Developer Address: Not reported
Developer City: Not reported
Developer State: Not reported
Developer Zip: Not reported
Developer Contact: Not reported
Developer Contact Title: Not reported
Constype Linear Utility Ind: Not reported
Emergency Phone: Not reported
Emergency Phone Ext: Not reported
Constype Above Ground Ind: Not reported
Constype Below Ground Ind: Not reported
Constype Cable Line Ind: Not reported
Constype Comm Line Ind: Not reported
Constype Commercial Ind: Not reported
Constype Electrical Line Ind: Not reported
Constype Gas Line Ind: Not reported
Constype Industrial Ind: Not reported
Constype Other Description: Not reported
Constype Other Ind: Not reported
Constype Recons Ind: Not reported
Constype Residential Ind: Not reported
Constype Transport Ind: Not reported
Constype Utility Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Constype Utility Ind:	Not reported
Constype Water Sewer Ind:	Not reported
Dir Discharge Uswater Ind:	Not reported
Receiving Water Name:	Not reported
Certifier:	Not reported
Certifier Title:	Not reported
Certification Date:	Not reported
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported
NPDES Number:	Not reported
Status:	Not reported
Agency Number:	Not reported
Region:	9
Regulatory Measure ID:	451538
Order Number:	Not reported
Regulatory Measure Type:	Construction
Place ID:	Not reported
WDID:	9 37C371787
Program Type:	Not reported
Adoption Date Of Regulatory Measure:	Not reported
Effective Date Of Regulatory Measure:	Not reported
Expiration Date Of Regulatory Measure:	Not reported
Termination Date Of Regulatory Measure:	12/12/2016
Discharge Name:	Not reported
Discharge Address:	Not reported
Discharge City:	Not reported
Discharge State:	Not reported
Discharge Zip:	Not reported
Received Date:	12/10/2014
Processed Date:	12/23/2014
Status:	Terminated
Status Date:	12/12/2016
Place Size:	1.32
Place Size Unit:	Acres
Contact:	Gary Stanford
Contact Title:	Director, Project Mgmt
Contact Phone:	585-637-6280
Contact Phone Ext:	Not reported
Contact Email:	gstanford1@sandi.net
Operator Name:	San Diego Unified School District
Operator Address:	4860 Ruffner Street
Operator City:	San Diego
Operator State:	California
Operator Zip:	92111
Operator Contact:	Gary Stanford
Operator Contact Title:	Director, Project Mgmt
Operator Contact Phone:	585-637-6280
Operator Contact Phone Ext:	Not reported
Operator Contact Email:	gstanford1@sandi.net
Operator Type:	Special District
Developer:	SDUSD
Developer Address:	4860 Ruffner Street
Developer City:	San Diego
Developer State:	California
Developer Zip:	92111

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

Developer Contact:	Gary Stanford
Developer Contact Title:	Director, Project Mgmt.
Constype Linear Utility Ind:	N
Emergency Phone:	Not reported
Emergency Phone Ext:	Not reported
Constype Above Ground Ind:	N
Constype Below Ground Ind:	N
Constype Cable Line Ind:	N
Constype Comm Line Ind:	N
Constype Commercial Ind:	N
Constype Electrical Line Ind:	N
Constype Gas Line Ind:	N
Constype Industrial Ind:	N
Constype Other Description:	Retaining Wall and Erosion Control
Constype Other Ind:	Y
Constype Recons Ind:	N
Constype Residential Ind:	N
Constype Transport Ind:	N
Constype Utility Description:	Not reported
Constype Utility Ind:	N
Constype Water Sewer Ind:	N
Dir Discharge Uswater Ind:	N
Receiving Water Name:	Famosa Slough
Certifier:	Don Webb
Certifier Title:	Director of Project Mgt.
Certification Date:	25-FEB-16
Primary Sic:	Not reported
Secondary Sic:	Not reported
Tertiary Sic:	Not reported

SAN DIEGO CO LOP:

Name:	SDUSD, CORREIA JR HIGH
Address:	4302 VALETA ST
City,State,Zip:	SAN DIEGO, CA 92107
Record ID:	DEH1988-LSAM-H00132-001
Record Status:	Completed
Opened Date:	07/27/1988
Parcel Number:	449-110-03-00
Case Type:	LOP - Local Oversight Program
Historical Name:	CORREIA JR HIGH SCHOOL
SWRCB Global ID:	T0607300087
Funding:	F - LOP Federal Fund
Lead Agency:	DEH/SAM
Lead Agency Date:	07/27/1988
Census Tract:	74.00
Community:	San Diego
Jurisdiction:	SAN DIEGO
Watershed Basin Number:	907.11
Water Purveyor:	SAN DIEGO
Fire Agency:	SAN DIEGO
Latitude:	32.7472514
Longitude:	-117.2313208
X MapCoord:	6260024.614
Y MapCoord:	1853172.770

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CORREIA JUNIOR HIGH SCHOO (Continued)

S100873086

CIWQS:

Name: CORREIA JHS RETAININNG WALL
Address: 4302 VALETA STREET
City,State,Zip: SAN DIEGO, CA 92107
Agency: San Diego Unified School District
Agency Address: 4860 Ruffner Street, San Diego, CA 92111
Place/Project Type: Construction - Other: Retaining Wall and Erosion Control
SIC/NAICS: Not reported
Region: 9
Program: CONSTW
Regulatory Measure Status: Terminated
Regulatory Measure Type: Storm water construction
Order Number: 2009-0009-DWQ
WDID: 9 37C371787
NPDES Number: CAS000002
Adoption Date: Not reported
Effective Date: 12/23/2014
Termination Date: 12/12/2016
Expiration/Review Date: Not reported
Design Flow: Not reported
Major/Minor: Not reported
Complexity: Not reported
TTWQ: Not reported
Enforcement Actions within 5 years: 2
Violations within 5 years: 6
Latitude: 32.74744
Longitude: -117.22888

CERS:

Name: SDUSD, CORREIA JR HIGH
Address: 4302 VALETA ST
City,State,Zip: SAN DIEGO, CA 921071510
Site ID: 209748
CERS ID: T0607300087
CERS Description: Leaking Underground Storage Tank Cleanup Site

160
East
1/2-1
0.910 mi.
4806 ft.

1079 WEST MORENA BLVD.
SAN DIEGO, CA 92110

Notify 65 S100178171
N/A

Relative:
Higher
Actual:
32 ft.

NOTIFY 65:

Date Reported: Not reported
Staff Initials: Not reported
Board File Number: Not reported
Facility Type: Not reported
Discharge Date: Not reported
Issue Date: Not reported
Incident Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

R161 **SAN DIEGO MANUFACTURING PLANT**
ESE
1/2-1 **SAN DIEGO, CA**
0.980 mi.
5176 ft. **Site 1 of 2 in cluster R**

FUDS **1024903652**
 N/A

Relative: FUDS:
Lower EPA Region: 9
 Installation ID: CA99799F560500
Actual: Congressional District Number: 53
15 ft. Facility Name: SAN DIEGO MANUFACTURING PLANT
 FUDS Number: J09CA0603
 City: SAN DIEGO
 State: CA
 County: SAN DIEGO
 Telephone: 213-452-3920
 USACE Division: South Pacific Division (SPD)
 USACE District: Los Angeles District (SPL)
 Status: Properties without projects
 Current Owner: State Government
 X Coord: -117.200000000399
 Y Coord: 32.754166669956703
 Latitude: 32.754166669999996
 Longitude: -117.2

R162 **SAN DIEGO MFG PLT**
ESE
1/2-1 **SAN DIEGO, CA**
0.981 mi.
5178 ft. **Site 2 of 2 in cluster R**

ENVIROSTOR **S107737240**
 N/A

Relative: ENVIROSTOR:
Lower Name: SAN DIEGO MFG PLT
Actual: Address: Not reported
15 ft. City,State,Zip: SAN DIEGO, CA
 Facility ID: 80000456
 Status: Inactive - Needs Evaluation
 Status Date: 07/01/2005
 Site Code: Not reported
 Site Type: Military Evaluation
 Site Type Detailed: FUDS
 Acres: Not reported
 NPL: NO
 Regulatory Agencies: SMBRP
 Lead Agency: SMBRP
 Program Manager: Not reported
 Supervisor: Douglas Bautista
 Division Branch: Cleanup Cypress
 Assembly: 78
 Senate: 39
 Special Program: Not reported
 Restricted Use: NO
 Site Mgmt Req: NONE SPECIFIED
 Funding: DERA
 Latitude: 32.75416
 Longitude: -117.2
 APN: NONE SPECIFIED
 Past Use: NONE SPECIFIED
 Potential COC: NONE SPECIFIED
 Confirmed COC: NONE SPECIFIED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAN DIEGO MFG PLT (Continued)

S107737240

Potential Description: NONE SPECIFIED
Alias Name: CA99799F560500
Alias Type: Federal Facility ID
Alias Name: J09CA0603
Alias Type: INPR
Alias Name: 80000456
Alias Type: Envirostor ID Number

Completed Info:

Completed Area Name: PROJECT WIDE
Completed Sub Area Name: Not reported
Completed Document Type: Inventory Project Report (INPR)
Completed Date: 04/18/1994
Comments: Not reported

Future Area Name: Not reported
Future Sub Area Name: Not reported
Future Document Type: Not reported
Future Due Date: Not reported
Schedule Area Name: Not reported
Schedule Sub Area Name: Not reported
Schedule Document Type: Not reported
Schedule Due Date: Not reported
Schedule Revised Date: Not reported

Count: 3 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
SAN DIEGO	S100732068	MISSION BAY (MZB VOR)	MISSION BAY ISLAND	92109	San Diego Co. HMMD, SWEEPS UST
SAN DIEGO	S100186120	MISSION BAY LANDFILL	NORTHWEST OF INTERSTATE 5 & SE	92109	ENVIROSTOR
SAN DIEGO	S108407193	PUBLIC AUTO SERVICE	PACIFIC HY	92110	SAN DIEGO CO. SAM

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Federal NPL site list

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 04/11/2019	Source: EPA
Date Data Arrived at EDR: 04/18/2019	Telephone: N/A
Date Made Active in Reports: 05/14/2019	Last EDR Contact: 07/02/2019
Number of Days to Update: 26	Next Scheduled EDR Contact: 10/14/2019
	Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 04/11/2019	Source: EPA
Date Data Arrived at EDR: 04/18/2019	Telephone: N/A
Date Made Active in Reports: 05/14/2019	Last EDR Contact: 07/02/2019
Number of Days to Update: 26	Next Scheduled EDR Contact: 10/14/2019
	Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

Federal Delisted NPL site list

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 04/11/2019
Date Data Arrived at EDR: 04/18/2019
Date Made Active in Reports: 05/14/2019
Number of Days to Update: 26

Source: EPA
Telephone: N/A
Last EDR Contact: 07/02/2019
Next Scheduled EDR Contact: 10/14/2019
Data Release Frequency: Quarterly

Federal CERCLIS list

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 04/03/2019
Date Data Arrived at EDR: 04/05/2019
Date Made Active in Reports: 05/14/2019
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 703-603-8704
Last EDR Contact: 07/03/2019
Next Scheduled EDR Contact: 10/14/2019
Data Release Frequency: Varies

SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly known as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 04/11/2019
Date Data Arrived at EDR: 04/18/2019
Date Made Active in Reports: 05/23/2019
Number of Days to Update: 35

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 07/02/2019
Next Scheduled EDR Contact: 10/28/2019
Data Release Frequency: Quarterly

Federal CERCLIS NFRAP site list

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 04/11/2019	Source: EPA
Date Data Arrived at EDR: 04/18/2019	Telephone: 800-424-9346
Date Made Active in Reports: 05/23/2019	Last EDR Contact: 07/02/2019
Number of Days to Update: 35	Next Scheduled EDR Contact: 10/28/2019
	Data Release Frequency: Quarterly

Federal RCRA CORRACTS facilities list

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 03/25/2019	Source: EPA
Date Data Arrived at EDR: 03/27/2019	Telephone: 800-424-9346
Date Made Active in Reports: 04/17/2019	Last EDR Contact: 06/26/2019
Number of Days to Update: 21	Next Scheduled EDR Contact: 10/07/2019
	Data Release Frequency: Quarterly

Federal RCRA non-CORRACTS TSD facilities list

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 03/25/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/27/2019	Telephone: (415) 495-8895
Date Made Active in Reports: 04/17/2019	Last EDR Contact: 06/26/2019
Number of Days to Update: 21	Next Scheduled EDR Contact: 10/07/2019
	Data Release Frequency: Quarterly

Federal RCRA generators list

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 03/25/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/27/2019	Telephone: (415) 495-8895
Date Made Active in Reports: 04/17/2019	Last EDR Contact: 06/26/2019
Number of Days to Update: 21	Next Scheduled EDR Contact: 10/07/2019
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 03/25/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/27/2019	Telephone: (415) 495-8895
Date Made Active in Reports: 04/17/2019	Last EDR Contact: 06/26/2019
Number of Days to Update: 21	Next Scheduled EDR Contact: 10/07/2019
	Data Release Frequency: Quarterly

RCRA-CESQG: RCRA - Conditionally Exempt Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Conditionally exempt small quantity generators (CESQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 03/25/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/27/2019	Telephone: (415) 495-8895
Date Made Active in Reports: 04/17/2019	Last EDR Contact: 06/26/2019
Number of Days to Update: 21	Next Scheduled EDR Contact: 10/07/2019
	Data Release Frequency: Quarterly

Federal institutional controls / engineering controls registries

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 02/22/2019	Source: Department of the Navy
Date Data Arrived at EDR: 03/07/2019	Telephone: 843-820-7326
Date Made Active in Reports: 04/17/2019	Last EDR Contact: 05/10/2019
Number of Days to Update: 41	Next Scheduled EDR Contact: 08/26/2019
	Data Release Frequency: Varies

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 01/31/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 02/04/2019	Telephone: 703-603-0695
Date Made Active in Reports: 03/08/2019	Last EDR Contact: 05/29/2019
Number of Days to Update: 32	Next Scheduled EDR Contact: 09/09/2019
	Data Release Frequency: Varies

US INST CONTROL: Sites with Institutional Controls

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 01/31/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 02/04/2019	Telephone: 703-603-0695
Date Made Active in Reports: 03/08/2019	Last EDR Contact: 05/29/2019
Number of Days to Update: 32	Next Scheduled EDR Contact: 09/09/2019
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 03/25/2019

Date Data Arrived at EDR: 03/26/2019

Date Made Active in Reports: 05/01/2019

Number of Days to Update: 36

Source: National Response Center, United States Coast Guard

Telephone: 202-267-2180

Last EDR Contact: 06/26/2019

Next Scheduled EDR Contact: 10/07/2019

Data Release Frequency: Quarterly

State- and tribal - equivalent NPL

RESPONSE: State Response Sites

Identifies confirmed release sites where DTSC is involved in remediation, either in a lead or oversight capacity.

These confirmed release sites are generally high-priority and high potential risk.

Date of Government Version: 04/29/2019

Date Data Arrived at EDR: 04/30/2019

Date Made Active in Reports: 06/27/2019

Number of Days to Update: 58

Source: Department of Toxic Substances Control

Telephone: 916-323-3400

Last EDR Contact: 04/30/2019

Next Scheduled EDR Contact: 08/12/2019

Data Release Frequency: Quarterly

State- and tribal - equivalent CERCLIS

ENVIROSTOR: EnviroStor Database

The Department of Toxic Substances Control's (DTSC's) Site Mitigation and Brownfields Reuse Program's (SMBRP's) EnviroStor database identifies sites that have known contamination or sites for which there may be reasons to investigate further. The database includes the following site types: Federal Superfund sites (National Priorities List (NPL)); State Response, including Military Facilities and State Superfund; Voluntary Cleanup; and School sites. EnviroStor provides similar information to the information that was available in CalSites, and provides additional site information, including, but not limited to, identification of formerly-contaminated properties that have been released for reuse, properties where environmental deed restrictions have been recorded to prevent inappropriate land uses, and risk characterization information that is used to assess potential impacts to public health and the environment at contaminated sites.

Date of Government Version: 04/29/2019

Date Data Arrived at EDR: 04/30/2019

Date Made Active in Reports: 06/27/2019

Number of Days to Update: 58

Source: Department of Toxic Substances Control

Telephone: 916-323-3400

Last EDR Contact: 04/30/2019

Next Scheduled EDR Contact: 08/12/2019

Data Release Frequency: Quarterly

State and tribal landfill and/or solid waste disposal site lists

SWF/LF (SWIS): Solid Waste Information System

Active, Closed and Inactive Landfills. SWF/LF records typically contain an inventory of solid waste disposal facilities or landfills. These may be active or inactive facilities or open dumps that failed to meet RCRA Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 05/13/2019

Date Data Arrived at EDR: 05/14/2019

Date Made Active in Reports: 07/17/2019

Number of Days to Update: 64

Source: Department of Resources Recycling and Recovery

Telephone: 916-341-6320

Last EDR Contact: 05/14/2019

Next Scheduled EDR Contact: 08/26/2019

Data Release Frequency: Quarterly

State and tribal leaking storage tank lists

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

LUST REG 7: Leaking Underground Storage Tank Case Listing

Leaking Underground Storage Tank locations. Imperial, Riverside, San Diego, Santa Barbara counties.

Date of Government Version: 02/26/2004
Date Data Arrived at EDR: 02/26/2004
Date Made Active in Reports: 03/24/2004
Number of Days to Update: 27

Source: California Regional Water Quality Control Board Colorado River Basin Region (7)
Telephone: 760-776-8943
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: No Update Planned

LUST REG 8: Leaking Underground Storage Tanks

California Regional Water Quality Control Board Santa Ana Region (8). For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 02/14/2005
Date Data Arrived at EDR: 02/15/2005
Date Made Active in Reports: 03/28/2005
Number of Days to Update: 41

Source: California Regional Water Quality Control Board Santa Ana Region (8)
Telephone: 909-782-4496
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

LUST REG 9: Leaking Underground Storage Tank Report

Orange, Riverside, San Diego counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 03/01/2001
Date Data Arrived at EDR: 04/23/2001
Date Made Active in Reports: 05/21/2001
Number of Days to Update: 28

Source: California Regional Water Quality Control Board San Diego Region (9)
Telephone: 858-637-5595
Last EDR Contact: 09/26/2011
Next Scheduled EDR Contact: 01/09/2012
Data Release Frequency: No Update Planned

LUST: Leaking Underground Fuel Tank Report (GEOTRACKER)

Leaking Underground Storage Tank (LUST) Sites included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 12/10/2018
Date Data Arrived at EDR: 12/11/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 35

Source: State Water Resources Control Board
Telephone: see region list
Last EDR Contact: 06/11/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Quarterly

LUST REG 6V: Leaking Underground Storage Tank Case Listing

Leaking Underground Storage Tank locations. Inyo, Kern, Los Angeles, Mono, San Bernardino counties.

Date of Government Version: 06/07/2005
Date Data Arrived at EDR: 06/07/2005
Date Made Active in Reports: 06/29/2005
Number of Days to Update: 22

Source: California Regional Water Quality Control Board Victorville Branch Office (6)
Telephone: 760-241-7365
Last EDR Contact: 09/12/2011
Next Scheduled EDR Contact: 12/26/2011
Data Release Frequency: No Update Planned

LUST REG 4: Underground Storage Tank Leak List

Los Angeles, Ventura counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 09/07/2004
Date Data Arrived at EDR: 09/07/2004
Date Made Active in Reports: 10/12/2004
Number of Days to Update: 35

Source: California Regional Water Quality Control Board Los Angeles Region (4)
Telephone: 213-576-6710
Last EDR Contact: 09/06/2011
Next Scheduled EDR Contact: 12/19/2011
Data Release Frequency: No Update Planned

LUST REG 3: Leaking Underground Storage Tank Database

Leaking Underground Storage Tank locations. Monterey, San Benito, San Luis Obispo, Santa Barbara, Santa Cruz counties.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 05/19/2003
Date Data Arrived at EDR: 05/19/2003
Date Made Active in Reports: 06/02/2003
Number of Days to Update: 14

Source: California Regional Water Quality Control Board Central Coast Region (3)
Telephone: 805-542-4786
Last EDR Contact: 07/18/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: No Update Planned

LUST REG 2: Fuel Leak List

Leaking Underground Storage Tank locations. Alameda, Contra Costa, Marin, Napa, San Francisco, San Mateo, Santa Clara, Solano, Sonoma counties.

Date of Government Version: 09/30/2004
Date Data Arrived at EDR: 10/20/2004
Date Made Active in Reports: 11/19/2004
Number of Days to Update: 30

Source: California Regional Water Quality Control Board San Francisco Bay Region (2)
Telephone: 510-622-2433
Last EDR Contact: 09/19/2011
Next Scheduled EDR Contact: 01/02/2012
Data Release Frequency: No Update Planned

LUST REG 1: Active Toxic Site Investigation

Del Norte, Humboldt, Lake, Mendocino, Modoc, Siskiyou, Sonoma, Trinity counties. For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 02/01/2001
Date Data Arrived at EDR: 02/28/2001
Date Made Active in Reports: 03/29/2001
Number of Days to Update: 29

Source: California Regional Water Quality Control Board North Coast (1)
Telephone: 707-570-3769
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: No Update Planned

LUST REG 6L: Leaking Underground Storage Tank Case Listing

For more current information, please refer to the State Water Resources Control Board's LUST database.

Date of Government Version: 09/09/2003
Date Data Arrived at EDR: 09/10/2003
Date Made Active in Reports: 10/07/2003
Number of Days to Update: 27

Source: California Regional Water Quality Control Board Lahontan Region (6)
Telephone: 530-542-5572
Last EDR Contact: 09/12/2011
Next Scheduled EDR Contact: 12/26/2011
Data Release Frequency: No Update Planned

LUST REG 5: Leaking Underground Storage Tank Database

Leaking Underground Storage Tank locations. Alameda, Alpine, Amador, Butte, Colusa, Contra Costa, Calaveras, El Dorado, Fresno, Glenn, Kern, Kings, Lake, Lassen, Madera, Mariposa, Merced, Modoc, Napa, Nevada, Placer, Plumas, Sacramento, San Joaquin, Shasta, Solano, Stanislaus, Sutter, Tehama, Tulare, Tuolumne, Yolo, Yuba counties.

Date of Government Version: 07/01/2008
Date Data Arrived at EDR: 07/22/2008
Date Made Active in Reports: 07/31/2008
Number of Days to Update: 9

Source: California Regional Water Quality Control Board Central Valley Region (5)
Telephone: 916-464-4834
Last EDR Contact: 07/01/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: No Update Planned

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 10/17/2018
Date Data Arrived at EDR: 03/07/2019
Date Made Active in Reports: 05/01/2019
Number of Days to Update: 55

Source: EPA Region 10
Telephone: 206-553-2857
Last EDR Contact: 07/24/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Arizona, California, New Mexico and Nevada

Date of Government Version: 10/10/2018
Date Data Arrived at EDR: 03/08/2019
Date Made Active in Reports: 05/01/2019
Number of Days to Update: 54

Source: Environmental Protection Agency
Telephone: 415-972-3372
Last EDR Contact: 07/24/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 10/16/2018	Source: EPA Region 8
Date Data Arrived at EDR: 03/07/2019	Telephone: 303-312-6271
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/24/2019
Number of Days to Update: 55	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 02/19/2019	Source: EPA Region 7
Date Data Arrived at EDR: 03/07/2019	Telephone: 913-551-7003
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/24/2019
Number of Days to Update: 55	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 09/24/2018	Source: EPA Region 4
Date Data Arrived at EDR: 03/12/2019	Telephone: 404-562-8677
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/23/2019
Number of Days to Update: 50	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land

A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 10/13/2018	Source: EPA Region 1
Date Data Arrived at EDR: 03/07/2019	Telephone: 617-918-1313
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/24/2019
Number of Days to Update: 55	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land

Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 10/12/2018	Source: EPA, Region 5
Date Data Arrived at EDR: 03/07/2019	Telephone: 312-886-7439
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/24/2019
Number of Days to Update: 55	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 11/01/2018	Source: EPA Region 6
Date Data Arrived at EDR: 03/07/2019	Telephone: 214-665-6597
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/24/2019
Number of Days to Update: 55	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

CPS-SLIC: Statewide SLIC Cases (GEOTRACKER)

Cleanup Program Sites (CPS; also known as Site Cleanups [SC] and formerly known as Spills, Leaks, Investigations, and Cleanups [SLIC] sites) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 12/10/2018	Source: State Water Resources Control Board
Date Data Arrived at EDR: 12/11/2018	Telephone: 866-480-1028
Date Made Active in Reports: 01/15/2019	Last EDR Contact: 06/11/2019
Number of Days to Update: 35	Next Scheduled EDR Contact: 09/23/2019
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SLIC REG 1: Active Toxic Site Investigations

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 04/03/2003
Date Data Arrived at EDR: 04/07/2003
Date Made Active in Reports: 04/25/2003
Number of Days to Update: 18

Source: California Regional Water Quality Control Board, North Coast Region (1)
Telephone: 707-576-2220
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: No Update Planned

SLIC REG 2: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 09/30/2004
Date Data Arrived at EDR: 10/20/2004
Date Made Active in Reports: 11/19/2004
Number of Days to Update: 30

Source: Regional Water Quality Control Board San Francisco Bay Region (2)
Telephone: 510-286-0457
Last EDR Contact: 09/19/2011
Next Scheduled EDR Contact: 01/02/2012
Data Release Frequency: No Update Planned

SLIC REG 3: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 05/18/2006
Date Data Arrived at EDR: 05/18/2006
Date Made Active in Reports: 06/15/2006
Number of Days to Update: 28

Source: California Regional Water Quality Control Board Central Coast Region (3)
Telephone: 805-549-3147
Last EDR Contact: 07/18/2011
Next Scheduled EDR Contact: 10/31/2011
Data Release Frequency: No Update Planned

SLIC REG 4: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 11/17/2004
Date Data Arrived at EDR: 11/18/2004
Date Made Active in Reports: 01/04/2005
Number of Days to Update: 47

Source: Region Water Quality Control Board Los Angeles Region (4)
Telephone: 213-576-6600
Last EDR Contact: 07/01/2011
Next Scheduled EDR Contact: 10/17/2011
Data Release Frequency: No Update Planned

SLIC REG 5: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 04/01/2005
Date Data Arrived at EDR: 04/05/2005
Date Made Active in Reports: 04/21/2005
Number of Days to Update: 16

Source: Regional Water Quality Control Board Central Valley Region (5)
Telephone: 916-464-3291
Last EDR Contact: 09/12/2011
Next Scheduled EDR Contact: 12/26/2011
Data Release Frequency: No Update Planned

SLIC REG 6V: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 05/24/2005
Date Data Arrived at EDR: 05/25/2005
Date Made Active in Reports: 06/16/2005
Number of Days to Update: 22

Source: Regional Water Quality Control Board, Victorville Branch
Telephone: 619-241-6583
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SLIC REG 6L: SLIC Sites

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 09/07/2004
Date Data Arrived at EDR: 09/07/2004
Date Made Active in Reports: 10/12/2004
Number of Days to Update: 35

Source: California Regional Water Quality Control Board, Lahontan Region
Telephone: 530-542-5574
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

SLIC REG 7: SLIC List

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 11/24/2004
Date Data Arrived at EDR: 11/29/2004
Date Made Active in Reports: 01/04/2005
Number of Days to Update: 36

Source: California Regional Quality Control Board, Colorado River Basin Region
Telephone: 760-346-7491
Last EDR Contact: 08/01/2011
Next Scheduled EDR Contact: 11/14/2011
Data Release Frequency: No Update Planned

SLIC REG 8: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 04/03/2008
Date Data Arrived at EDR: 04/03/2008
Date Made Active in Reports: 04/14/2008
Number of Days to Update: 11

Source: California Region Water Quality Control Board Santa Ana Region (8)
Telephone: 951-782-3298
Last EDR Contact: 09/12/2011
Next Scheduled EDR Contact: 12/26/2011
Data Release Frequency: No Update Planned

SLIC REG 9: Spills, Leaks, Investigation & Cleanup Cost Recovery Listing

The SLIC (Spills, Leaks, Investigations and Cleanup) program is designed to protect and restore water quality from spills, leaks, and similar discharges.

Date of Government Version: 09/10/2007
Date Data Arrived at EDR: 09/11/2007
Date Made Active in Reports: 09/28/2007
Number of Days to Update: 17

Source: California Regional Water Quality Control Board San Diego Region (9)
Telephone: 858-467-2980
Last EDR Contact: 08/08/2011
Next Scheduled EDR Contact: 11/21/2011
Data Release Frequency: No Update Planned

State and tribal registered storage tank lists

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 05/15/2017
Date Data Arrived at EDR: 05/30/2017
Date Made Active in Reports: 10/13/2017
Number of Days to Update: 136

Source: FEMA
Telephone: 202-646-5797
Last EDR Contact: 07/10/2019
Next Scheduled EDR Contact: 10/21/2019
Data Release Frequency: Varies

MILITARY UST SITES: Military UST Sites (GEOTRACKER)

Military ust sites

Date of Government Version: 06/10/2019
Date Data Arrived at EDR: 06/11/2019
Date Made Active in Reports: 07/24/2019
Number of Days to Update: 43

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 06/11/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

UST CLOSURE: Proposed Closure of Underground Storage Tank (UST) Cases

UST cases that are being considered for closure by either the State Water Resources Control Board or the Executive Director have been posted for a 60-day public comment period. UST Case Closures being proposed for consideration by the State Water Resources Control Board. These are primarily UST cases that meet closure criteria under the decisional framework in State Water Board Resolution No. 92-49 and other Board orders. UST Case Closures proposed for consideration by the Executive Director pursuant to State Water Board Resolution No. 2012-0061. These are cases that meet the criteria of the Low-Threat UST Case Closure Policy. UST Case Closure Review Denials and Approved Orders.

Date of Government Version: 06/10/2019	Source: State Water Resources Control Board
Date Data Arrived at EDR: 06/12/2019	Telephone: 916-327-7844
Date Made Active in Reports: 07/23/2019	Last EDR Contact: 06/12/2019
Number of Days to Update: 41	Next Scheduled EDR Contact: 09/23/2019
	Data Release Frequency: Varies

UST: Active UST Facilities

Active UST facilities gathered from the local regulatory agencies

Date of Government Version: 06/10/2019	Source: SWRCB
Date Data Arrived at EDR: 06/11/2019	Telephone: 916-341-5851
Date Made Active in Reports: 07/23/2019	Last EDR Contact: 06/11/2019
Number of Days to Update: 42	Next Scheduled EDR Contact: 09/23/2019
	Data Release Frequency: Semi-Annually

AST: Aboveground Petroleum Storage Tank Facilities

A listing of aboveground storage tank petroleum storage tank locations.

Date of Government Version: 07/06/2016	Source: California Environmental Protection Agency
Date Data Arrived at EDR: 07/12/2016	Telephone: 916-327-5092
Date Made Active in Reports: 09/19/2016	Last EDR Contact: 06/17/2019
Number of Days to Update: 69	Next Scheduled EDR Contact: 09/30/2019
	Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 11/07/2018	Source: EPA Region 7
Date Data Arrived at EDR: 03/07/2019	Telephone: 913-551-7003
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/24/2019
Number of Days to Update: 55	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 10/16/2018	Source: EPA Region 8
Date Data Arrived at EDR: 03/07/2019	Telephone: 303-312-6137
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 04/26/2019
Number of Days to Update: 55	Next Scheduled EDR Contact: 08/05/2019
	Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 11/01/2018	Source: EPA Region 6
Date Data Arrived at EDR: 03/07/2019	Telephone: 214-665-7591
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/24/2019
Number of Days to Update: 55	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 10/12/2018	Source: EPA Region 5
Date Data Arrived at EDR: 03/07/2019	Telephone: 312-886-6136
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/24/2019
Number of Days to Update: 55	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 09/24/2018	Source: EPA Region 4
Date Data Arrived at EDR: 03/12/2019	Telephone: 404-562-9424
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/23/2019
Number of Days to Update: 50	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 10/17/2018	Source: EPA Region 10
Date Data Arrived at EDR: 03/07/2019	Telephone: 206-553-2857
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/24/2019
Number of Days to Update: 55	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 10/10/2018	Source: EPA Region 9
Date Data Arrived at EDR: 03/08/2019	Telephone: 415-972-3368
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/24/2019
Number of Days to Update: 54	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 10/03/2018	Source: EPA, Region 1
Date Data Arrived at EDR: 03/07/2019	Telephone: 617-918-1313
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 07/24/2019
Number of Days to Update: 55	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Varies

State and tribal voluntary cleanup sites

INDIAN VCP R7: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008	Source: EPA, Region 7
Date Data Arrived at EDR: 04/22/2008	Telephone: 913-551-7365
Date Made Active in Reports: 05/19/2008	Last EDR Contact: 04/20/2009
Number of Days to Update: 27	Next Scheduled EDR Contact: 07/20/2009
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 07/27/2015
Date Data Arrived at EDR: 09/29/2015
Date Made Active in Reports: 02/18/2016
Number of Days to Update: 142

Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 06/20/2019
Next Scheduled EDR Contact: 10/07/2019
Data Release Frequency: Varies

VCP: Voluntary Cleanup Program Properties

Contains low threat level properties with either confirmed or unconfirmed releases and the project proponents have request that DTSC oversee investigation and/or cleanup activities and have agreed to provide coverage for DTSC's costs.

Date of Government Version: 04/29/2019
Date Data Arrived at EDR: 04/30/2019
Date Made Active in Reports: 06/27/2019
Number of Days to Update: 58

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 04/30/2019
Next Scheduled EDR Contact: 08/12/2019
Data Release Frequency: Quarterly

State and tribal Brownfields sites

BROWNFIELDS: Considered Brownfields Sites Listing

A listing of sites the SWRCB considers to be Brownfields since these are sites have come to them through the MOA Process.

Date of Government Version: 03/25/2019
Date Data Arrived at EDR: 03/26/2019
Date Made Active in Reports: 04/29/2019
Number of Days to Update: 34

Source: State Water Resources Control Board
Telephone: 916-323-7905
Last EDR Contact: 06/25/2019
Next Scheduled EDR Contact: 10/07/2019
Data Release Frequency: Quarterly

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 12/17/2018
Date Data Arrived at EDR: 12/18/2018
Date Made Active in Reports: 01/11/2019
Number of Days to Update: 24

Source: Environmental Protection Agency
Telephone: 202-566-2777
Last EDR Contact: 06/04/2019
Next Scheduled EDR Contact: 09/30/2019
Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

WMUDS/SWAT: Waste Management Unit Database

Waste Management Unit Database System. WMUDS is used by the State Water Resources Control Board staff and the Regional Water Quality Control Boards for program tracking and inventory of waste management units. WMUDS is composed of the following databases: Facility Information, Scheduled Inspections Information, Waste Management Unit Information, SWAT Program Information, SWAT Report Summary Information, SWAT Report Summary Data, Chapter 15 (formerly Subchapter 15) Information, Chapter 15 Monitoring Parameters, TPCA Program Information, RCRA Program Information, Closure Information, and Interested Parties Information.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 04/01/2000
Date Data Arrived at EDR: 04/10/2000
Date Made Active in Reports: 05/10/2000
Number of Days to Update: 30

Source: State Water Resources Control Board
Telephone: 916-227-4448
Last EDR Contact: 04/25/2019
Next Scheduled EDR Contact: 08/12/2019
Data Release Frequency: No Update Planned

SWRCY: Recycler Database

A listing of recycling facilities in California.

Date of Government Version: 03/11/2019
Date Data Arrived at EDR: 03/13/2019
Date Made Active in Reports: 04/30/2019
Number of Days to Update: 48

Source: Department of Conservation
Telephone: 916-323-3836
Last EDR Contact: 06/12/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Quarterly

HAULERS: Registered Waste Tire Haulers Listing

A listing of registered waste tire haulers.

Date of Government Version: 03/26/2019
Date Data Arrived at EDR: 03/27/2019
Date Made Active in Reports: 04/30/2019
Number of Days to Update: 34

Source: Integrated Waste Management Board
Telephone: 916-341-6422
Last EDR Contact: 05/09/2019
Next Scheduled EDR Contact: 08/26/2019
Data Release Frequency: Varies

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998
Date Data Arrived at EDR: 12/03/2007
Date Made Active in Reports: 01/24/2008
Number of Days to Update: 52

Source: Environmental Protection Agency
Telephone: 703-308-8245
Last EDR Contact: 04/26/2019
Next Scheduled EDR Contact: 08/12/2019
Data Release Frequency: Varies

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009
Date Data Arrived at EDR: 05/07/2009
Date Made Active in Reports: 09/21/2009
Number of Days to Update: 137

Source: EPA, Region 9
Telephone: 415-947-4219
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: No Update Planned

IHS OPEN DUMPS: Open Dumps on Indian Land

A listing of all open dumps located on Indian Land in the United States.

Date of Government Version: 04/01/2014
Date Data Arrived at EDR: 08/06/2014
Date Made Active in Reports: 01/29/2015
Number of Days to Update: 176

Source: Department of Health & Human Services, Indian Health Service
Telephone: 301-443-1452
Last EDR Contact: 04/23/2019
Next Scheduled EDR Contact: 08/12/2019
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 02/24/2019
Date Data Arrived at EDR: 02/26/2019
Date Made Active in Reports: 04/17/2019
Number of Days to Update: 50

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 05/24/2019
Next Scheduled EDR Contact: 09/09/2019
Data Release Frequency: No Update Planned

HIST CAL-SITES: Calsites Database

The Calsites database contains potential or confirmed hazardous substance release properties. In 1996, California EPA reevaluated and significantly reduced the number of sites in the Calsites database. No longer updated by the state agency. It has been replaced by ENVIROSTOR.

Date of Government Version: 08/08/2005
Date Data Arrived at EDR: 08/03/2006
Date Made Active in Reports: 08/24/2006
Number of Days to Update: 21

Source: Department of Toxic Substance Control
Telephone: 916-323-3400
Last EDR Contact: 02/23/2009
Next Scheduled EDR Contact: 05/25/2009
Data Release Frequency: No Update Planned

SCH: School Property Evaluation Program

This category contains proposed and existing school sites that are being evaluated by DTSC for possible hazardous materials contamination. In some cases, these properties may be listed in the CalSites category depending on the level of threat to public health and safety or the environment they pose.

Date of Government Version: 04/29/2019
Date Data Arrived at EDR: 04/30/2019
Date Made Active in Reports: 06/27/2019
Number of Days to Update: 58

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 04/30/2019
Next Scheduled EDR Contact: 08/12/2019
Data Release Frequency: Quarterly

CDL: Clandestine Drug Labs

A listing of drug lab locations. Listing of a location in this database does not indicate that any illegal drug lab materials were or were not present there, and does not constitute a determination that the location either requires or does not require additional cleanup work.

Date of Government Version: 12/31/2017
Date Data Arrived at EDR: 06/12/2018
Date Made Active in Reports: 08/06/2018
Number of Days to Update: 55

Source: Department of Toxic Substances Control
Telephone: 916-255-6504
Last EDR Contact: 07/08/2019
Next Scheduled EDR Contact: 10/21/2019
Data Release Frequency: Varies

TOXIC PITS: Toxic Pits Cleanup Act Sites

Toxic PITS Cleanup Act Sites. TOXIC PITS identifies sites suspected of containing hazardous substances where cleanup has not yet been completed.

Date of Government Version: 07/01/1995
Date Data Arrived at EDR: 08/30/1995
Date Made Active in Reports: 09/26/1995
Number of Days to Update: 27

Source: State Water Resources Control Board
Telephone: 916-227-4364
Last EDR Contact: 01/26/2009
Next Scheduled EDR Contact: 04/27/2009
Data Release Frequency: No Update Planned

CERS HAZ WASTE: CERS HAZ WASTE

List of sites in the California Environmental Protection Agency (CalEPA) Regulated Site Portal which fall under the Hazardous Chemical Management, Hazardous Waste Onsite Treatment, Household Hazardous Waste Collection, Hazardous Waste Generator, and RCRA LQ HW Generator programs.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 04/09/2019
Date Data Arrived at EDR: 04/11/2019
Date Made Active in Reports: 05/08/2019
Number of Days to Update: 27

Source: CalEPA
Telephone: 916-323-2514
Last EDR Contact: 07/23/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Quarterly

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 02/24/2019
Date Data Arrived at EDR: 02/26/2019
Date Made Active in Reports: 04/17/2019
Number of Days to Update: 50

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 05/24/2019
Next Scheduled EDR Contact: 09/09/2019
Data Release Frequency: Quarterly

PFAS: PFAS Contamination Site Location Listing

A listing of PFAS contaminated sites included in the GeoTracker database.

Date of Government Version: 06/28/2019
Date Data Arrived at EDR: 06/28/2019
Date Made Active in Reports: 07/24/2019
Number of Days to Update: 26

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 06/28/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Varies

Local Lists of Registered Storage Tanks

SWEEPS UST: SWEEPS UST Listing

Statewide Environmental Evaluation and Planning System. This underground storage tank listing was updated and maintained by a company contacted by the SWRCB in the early 1990's. The listing is no longer updated or maintained. The local agency is the contact for more information on a site on the SWEEPS list.

Date of Government Version: 06/01/1994
Date Data Arrived at EDR: 07/07/2005
Date Made Active in Reports: 08/11/2005
Number of Days to Update: 35

Source: State Water Resources Control Board
Telephone: N/A
Last EDR Contact: 06/03/2005
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

UST MENDOCINO: Mendocino County UST Database

A listing of underground storage tank locations in Mendocino County.

Date of Government Version: 12/04/2018
Date Data Arrived at EDR: 12/06/2018
Date Made Active in Reports: 12/14/2018
Number of Days to Update: 8

Source: Department of Public Health
Telephone: 707-463-4466
Last EDR Contact: 05/24/2019
Next Scheduled EDR Contact: 09/09/2019
Data Release Frequency: Annually

HIST UST: Hazardous Substance Storage Container Database

The Hazardous Substance Storage Container Database is a historical listing of UST sites. Refer to local/county source for current data.

Date of Government Version: 10/15/1990
Date Data Arrived at EDR: 01/25/1991
Date Made Active in Reports: 02/12/1991
Number of Days to Update: 18

Source: State Water Resources Control Board
Telephone: 916-341-5851
Last EDR Contact: 07/26/2001
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SAN FRANCISCO AST: Aboveground Storage Tank Site Listing

Aboveground storage tank sites

Date of Government Version: 09/11/2018
Date Data Arrived at EDR: 09/12/2018
Date Made Active in Reports: 10/11/2018
Number of Days to Update: 29

Source: San Francisco County Department of Public Health
Telephone: 415-252-3896
Last EDR Contact: 05/02/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Varies

CA FID UST: Facility Inventory Database

The Facility Inventory Database (FID) contains a historical listing of active and inactive underground storage tank locations from the State Water Resource Control Board. Refer to local/county source for current data.

Date of Government Version: 10/31/1994
Date Data Arrived at EDR: 09/05/1995
Date Made Active in Reports: 09/29/1995
Number of Days to Update: 24

Source: California Environmental Protection Agency
Telephone: 916-341-5851
Last EDR Contact: 12/28/1998
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

CERS TANKS: California Environmental Reporting System (CERS) Tanks

List of sites in the California Environmental Protection Agency (CalEPA) Regulated Site Portal which fall under the Aboveground Petroleum Storage and Underground Storage Tank regulatory programs.

Date of Government Version: 04/09/2019
Date Data Arrived at EDR: 04/11/2019
Date Made Active in Reports: 05/08/2019
Number of Days to Update: 27

Source: California Environmental Protection Agency
Telephone: 916-323-2514
Last EDR Contact: 07/23/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Quarterly

Local Land Records

LIENS: Environmental Liens Listing

A listing of property locations with environmental liens for California where DTSC is a lien holder.

Date of Government Version: 02/28/2019
Date Data Arrived at EDR: 03/01/2019
Date Made Active in Reports: 04/02/2019
Number of Days to Update: 32

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 06/03/2019
Next Scheduled EDR Contact: 09/16/2019
Data Release Frequency: Varies

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 04/11/2019
Date Data Arrived at EDR: 04/18/2019
Date Made Active in Reports: 05/23/2019
Number of Days to Update: 35

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 07/02/2019
Next Scheduled EDR Contact: 10/14/2019
Data Release Frequency: Semi-Annually

DEED: Deed Restriction Listing

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Site Mitigation and Brownfields Reuse Program Facility Sites with Deed Restrictions & Hazardous Waste Management Program Facility Sites with Deed / Land Use Restriction. The DTSC Site Mitigation and Brownfields Reuse Program (SMBRP) list includes sites cleaned up under the program's oversight and generally does not include current or former hazardous waste facilities that required a hazardous waste facility permit. The list represents deed restrictions that are active. Some sites have multiple deed restrictions. The DTSC Hazardous Waste Management Program (HWMP) has developed a list of current or former hazardous waste facilities that have a recorded land use restriction at the local county recorder's office. The land use restrictions on this list were required by the DTSC HWMP as a result of the presence of hazardous substances that remain on site after the facility (or part of the facility) has been closed or cleaned up. The types of land use restriction include deed notice, deed restriction, or a land use restriction that binds current and future owners.

Date of Government Version: 03/04/2019	Source: DTSC and SWRCB
Date Data Arrived at EDR: 03/05/2019	Telephone: 916-323-3400
Date Made Active in Reports: 04/01/2019	Last EDR Contact: 06/04/2019
Number of Days to Update: 27	Next Scheduled EDR Contact: 09/16/2019
	Data Release Frequency: Semi-Annually

Records of Emergency Release Reports

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 03/25/2019	Source: U.S. Department of Transportation
Date Data Arrived at EDR: 03/26/2019	Telephone: 202-366-4555
Date Made Active in Reports: 05/14/2019	Last EDR Contact: 06/26/2019
Number of Days to Update: 49	Next Scheduled EDR Contact: 10/07/2019
	Data Release Frequency: Quarterly

CHMIRS: California Hazardous Material Incident Report System

California Hazardous Material Incident Reporting System. CHMIRS contains information on reported hazardous material incidents (accidental releases or spills).

Date of Government Version: 10/24/2018	Source: Office of Emergency Services
Date Data Arrived at EDR: 01/24/2019	Telephone: 916-845-8400
Date Made Active in Reports: 03/05/2019	Last EDR Contact: 06/24/2019
Number of Days to Update: 40	Next Scheduled EDR Contact: 08/05/2019
	Data Release Frequency: Semi-Annually

LDS: Land Disposal Sites Listing (GEOTRACKER)

Land Disposal sites (Landfills) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 12/10/2018	Source: State Water Quality Control Board
Date Data Arrived at EDR: 12/11/2018	Telephone: 866-480-1028
Date Made Active in Reports: 01/15/2019	Last EDR Contact: 06/11/2019
Number of Days to Update: 35	Next Scheduled EDR Contact: 09/23/2019
	Data Release Frequency: Quarterly

MCS: Military Cleanup Sites Listing (GEOTRACKER)

Military sites (consisting of: Military UST sites; Military Privatized sites; and Military Cleanup sites [formerly known as DoD non UST]) included in GeoTracker. GeoTracker is the Water Boards data management system for sites that impact, or have the potential to impact, water quality in California, with emphasis on groundwater.

Date of Government Version: 06/10/2019	Source: State Water Resources Control Board
Date Data Arrived at EDR: 06/11/2019	Telephone: 866-480-1028
Date Made Active in Reports: 07/24/2019	Last EDR Contact: 06/11/2019
Number of Days to Update: 43	Next Scheduled EDR Contact: 09/23/2019
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 06/06/2012

Date Data Arrived at EDR: 01/03/2013

Date Made Active in Reports: 02/22/2013

Number of Days to Update: 50

Source: FirstSearch

Telephone: N/A

Last EDR Contact: 01/03/2013

Next Scheduled EDR Contact: N/A

Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

Date of Government Version: 03/25/2019

Date Data Arrived at EDR: 03/27/2019

Date Made Active in Reports: 04/17/2019

Number of Days to Update: 21

Source: Environmental Protection Agency

Telephone: (415) 495-8895

Last EDR Contact: 06/26/2019

Next Scheduled EDR Contact: 10/07/2019

Data Release Frequency: Quarterly

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 03/07/2019

Date Data Arrived at EDR: 04/03/2019

Date Made Active in Reports: 05/23/2019

Number of Days to Update: 50

Source: U.S. Army Corps of Engineers

Telephone: 202-528-4285

Last EDR Contact: 05/21/2019

Next Scheduled EDR Contact: 09/02/2019

Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 12/31/2005

Date Data Arrived at EDR: 11/10/2006

Date Made Active in Reports: 01/11/2007

Number of Days to Update: 62

Source: USGS

Telephone: 888-275-8747

Last EDR Contact: 07/09/2019

Next Scheduled EDR Contact: 10/21/2019

Data Release Frequency: Semi-Annually

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 12/31/2005

Date Data Arrived at EDR: 02/06/2006

Date Made Active in Reports: 01/11/2007

Number of Days to Update: 339

Source: U.S. Geological Survey

Telephone: 888-275-8747

Last EDR Contact: 07/10/2019

Next Scheduled EDR Contact: 10/21/2019

Data Release Frequency: N/A

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 01/01/2017
Date Data Arrived at EDR: 02/03/2017
Date Made Active in Reports: 04/07/2017
Number of Days to Update: 63

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 05/13/2019
Next Scheduled EDR Contact: 08/26/2019
Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 03/25/2019
Date Data Arrived at EDR: 03/26/2019
Date Made Active in Reports: 05/07/2019
Number of Days to Update: 42

Source: Environmental Protection Agency
Telephone: 202-566-1917
Last EDR Contact: 06/26/2019
Next Scheduled EDR Contact: 10/07/2019
Data Release Frequency: Quarterly

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 08/30/2013
Date Data Arrived at EDR: 03/21/2014
Date Made Active in Reports: 06/17/2014
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 617-520-3000
Last EDR Contact: 05/06/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 09/30/2017
Date Data Arrived at EDR: 05/08/2018
Date Made Active in Reports: 07/20/2018
Number of Days to Update: 73

Source: Environmental Protection Agency
Telephone: 703-308-4044
Last EDR Contact: 05/10/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Varies

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2016
Date Data Arrived at EDR: 06/21/2017
Date Made Active in Reports: 01/05/2018
Number of Days to Update: 198

Source: EPA
Telephone: 202-260-5521
Last EDR Contact: 06/18/2019
Next Scheduled EDR Contact: 09/30/2019
Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 12/31/2016
Date Data Arrived at EDR: 01/10/2018
Date Made Active in Reports: 01/12/2018
Number of Days to Update: 2

Source: EPA
Telephone: 202-566-0250
Last EDR Contact: 05/24/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Annually

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 12/31/2009
Date Data Arrived at EDR: 12/10/2010
Date Made Active in Reports: 02/25/2011
Number of Days to Update: 77

Source: EPA
Telephone: 202-564-4203
Last EDR Contact: 04/24/2019
Next Scheduled EDR Contact: 08/05/2019
Data Release Frequency: Annually

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 04/11/2019
Date Data Arrived at EDR: 04/18/2019
Date Made Active in Reports: 05/23/2019
Number of Days to Update: 35

Source: EPA
Telephone: 703-416-0223
Last EDR Contact: 07/01/2019
Next Scheduled EDR Contact: 09/16/2019
Data Release Frequency: Annually

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 04/25/2019
Date Data Arrived at EDR: 05/02/2019
Date Made Active in Reports: 05/23/2019
Number of Days to Update: 21

Source: Environmental Protection Agency
Telephone: 202-564-8600
Last EDR Contact: 07/22/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995
Date Data Arrived at EDR: 07/03/1995
Date Made Active in Reports: 08/07/1995
Number of Days to Update: 35

Source: EPA
Telephone: 202-564-4104
Last EDR Contact: 06/02/2008
Next Scheduled EDR Contact: 09/01/2008
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 04/11/2019	Source: EPA
Date Data Arrived at EDR: 04/18/2019	Telephone: 202-564-6023
Date Made Active in Reports: 05/23/2019	Last EDR Contact: 07/01/2019
Number of Days to Update: 35	Next Scheduled EDR Contact: 08/19/2019
	Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 03/20/2019	Source: EPA
Date Data Arrived at EDR: 04/10/2019	Telephone: 202-566-0500
Date Made Active in Reports: 05/14/2019	Last EDR Contact: 07/12/2019
Number of Days to Update: 34	Next Scheduled EDR Contact: 10/21/2019
	Data Release Frequency: Annually

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 11/18/2016	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/23/2016	Telephone: 202-564-2501
Date Made Active in Reports: 02/10/2017	Last EDR Contact: 07/03/2019
Number of Days to Update: 79	Next Scheduled EDR Contact: 10/21/2019
	Data Release Frequency: Quarterly

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009	Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 08/18/2017
Number of Days to Update: 25	Next Scheduled EDR Contact: 12/04/2017
	Data Release Frequency: No Update Planned

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)

A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009	Source: EPA
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 08/18/2017
Number of Days to Update: 25	Next Scheduled EDR Contact: 12/04/2017
	Data Release Frequency: No Update Planned

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 08/30/2016	Source: Nuclear Regulatory Commission
Date Data Arrived at EDR: 09/08/2016	Telephone: 301-415-7169
Date Made Active in Reports: 10/21/2016	Last EDR Contact: 07/22/2019
Number of Days to Update: 43	Next Scheduled EDR Contact: 11/04/2019
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

COAL ASH DOE: Steam-Electric Plant Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2005	Source: Department of Energy
Date Data Arrived at EDR: 08/07/2009	Telephone: 202-586-8719
Date Made Active in Reports: 10/22/2009	Last EDR Contact: 06/07/2019
Number of Days to Update: 76	Next Scheduled EDR Contact: 09/16/2019
	Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 07/01/2014	Source: Environmental Protection Agency
Date Data Arrived at EDR: 09/10/2014	Telephone: N/A
Date Made Active in Reports: 10/20/2014	Last EDR Contact: 06/07/2019
Number of Days to Update: 40	Next Scheduled EDR Contact: 09/16/2019
	Data Release Frequency: Varies

PCB TRANSFORMER: PCB Transformer Registration Database

The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 05/24/2017	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/30/2017	Telephone: 202-566-0517
Date Made Active in Reports: 12/15/2017	Last EDR Contact: 04/26/2019
Number of Days to Update: 15	Next Scheduled EDR Contact: 08/05/2019
	Data Release Frequency: Varies

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 04/02/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 04/02/2019	Telephone: 202-343-9775
Date Made Active in Reports: 05/14/2019	Last EDR Contact: 07/01/2019
Number of Days to Update: 42	Next Scheduled EDR Contact: 10/14/2019
	Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/01/2007	Telephone: 202-564-2501
Date Made Active in Reports: 04/10/2007	Last EDR Contact: 12/17/2007
Number of Days to Update: 40	Next Scheduled EDR Contact: 03/17/2008
	Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/19/2006
Date Data Arrived at EDR: 03/01/2007
Date Made Active in Reports: 04/10/2007
Number of Days to Update: 40

Source: Environmental Protection Agency
Telephone: 202-564-2501
Last EDR Contact: 12/17/2008
Next Scheduled EDR Contact: 03/17/2008
Data Release Frequency: No Update Planned

DOT OPS: Incident and Accident Data

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 12/03/2018
Date Data Arrived at EDR: 01/29/2019
Date Made Active in Reports: 03/21/2019
Number of Days to Update: 51

Source: Department of Transportation, Office of Pipeline Safety
Telephone: 202-366-4595
Last EDR Contact: 04/30/2019
Next Scheduled EDR Contact: 08/12/2019
Data Release Frequency: Quarterly

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

Date of Government Version: 03/31/2019
Date Data Arrived at EDR: 04/23/2019
Date Made Active in Reports: 05/23/2019
Number of Days to Update: 30

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 07/08/2019
Next Scheduled EDR Contact: 10/21/2019
Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2015
Date Data Arrived at EDR: 02/22/2017
Date Made Active in Reports: 09/28/2017
Number of Days to Update: 218

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 06/26/2019
Next Scheduled EDR Contact: 10/07/2019
Data Release Frequency: Biennially

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 07/14/2015
Date Made Active in Reports: 01/10/2017
Number of Days to Update: 546

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 07/10/2019
Next Scheduled EDR Contact: 10/21/2019
Data Release Frequency: Semi-Annually

FUSRAP: Formerly Utilized Sites Remedial Action Program

DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.

Date of Government Version: 08/08/2017
Date Data Arrived at EDR: 09/11/2018
Date Made Active in Reports: 09/14/2018
Number of Days to Update: 3

Source: Department of Energy
Telephone: 202-586-3559
Last EDR Contact: 05/02/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 06/23/2017
Date Data Arrived at EDR: 10/11/2017
Date Made Active in Reports: 11/03/2017
Number of Days to Update: 23

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 05/24/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 04/11/2019
Date Data Arrived at EDR: 04/18/2019
Date Made Active in Reports: 05/14/2019
Number of Days to Update: 26

Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 07/01/2019
Next Scheduled EDR Contact: 10/14/2019
Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931 and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust.

Date of Government Version: 04/05/2001
Date Data Arrived at EDR: 10/27/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 36

Source: American Journal of Public Health
Telephone: 703-305-6451
Last EDR Contact: 12/02/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US AIRS MINOR: Air Facility System Data

A listing of minor source facilities.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 11/27/2018
Date Data Arrived at EDR: 02/27/2019
Date Made Active in Reports: 04/01/2019
Number of Days to Update: 33

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 05/29/2019
Next Scheduled EDR Contact: 09/09/2019
Data Release Frequency: Semi-Annually

US MINES 2: Ferrous and Nonferrous Metal Mines Database Listing

This map layer includes ferrous (ferrous metal mines are facilities that extract ferrous metals, such as iron ore or molybdenum) and nonferrous (Nonferrous metal mines are facilities that extract nonferrous metals, such as gold, silver, copper, zinc, and lead) metal mines in the United States.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 12/05/2005
Date Data Arrived at EDR: 02/29/2008
Date Made Active in Reports: 04/18/2008
Number of Days to Update: 49

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 05/31/2019
Next Scheduled EDR Contact: 09/09/2019
Data Release Frequency: Varies

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011
Date Data Arrived at EDR: 06/08/2011
Date Made Active in Reports: 09/13/2011
Number of Days to Update: 97

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 05/31/2019
Next Scheduled EDR Contact: 09/09/2019
Data Release Frequency: Varies

ABANDONED MINES: Abandoned Mines

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by OSMRE to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

Date of Government Version: 03/27/2019
Date Data Arrived at EDR: 03/28/2019
Date Made Active in Reports: 05/01/2019
Number of Days to Update: 34

Source: Department of Interior
Telephone: 202-208-2609
Last EDR Contact: 06/19/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 02/15/2019
Date Data Arrived at EDR: 03/05/2019
Date Made Active in Reports: 03/15/2019
Number of Days to Update: 10

Source: EPA
Telephone: (415) 947-8000
Last EDR Contact: 06/05/2019
Next Scheduled EDR Contact: 09/16/2019
Data Release Frequency: Quarterly

ECHO: Enforcement & Compliance History Information

ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

Date of Government Version: 04/07/2019
Date Data Arrived at EDR: 04/09/2019
Date Made Active in Reports: 05/23/2019
Number of Days to Update: 44

Source: Environmental Protection Agency
Telephone: 202-564-2280
Last EDR Contact: 07/09/2019
Next Scheduled EDR Contact: 10/21/2019
Data Release Frequency: Quarterly

DOCKET HWC: Hazardous Waste Compliance Docket Listing

A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

Date of Government Version: 05/31/2018
Date Data Arrived at EDR: 07/26/2018
Date Made Active in Reports: 10/05/2018
Number of Days to Update: 71

Source: Environmental Protection Agency
Telephone: 202-564-0527
Last EDR Contact: 05/24/2019
Next Scheduled EDR Contact: 09/09/2019
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

UXO: Unexploded Ordnance Sites

A listing of unexploded ordnance site locations

Date of Government Version: 12/31/2017	Source: Department of Defense
Date Data Arrived at EDR: 01/17/2019	Telephone: 703-704-1564
Date Made Active in Reports: 04/01/2019	Last EDR Contact: 07/15/2019
Number of Days to Update: 74	Next Scheduled EDR Contact: 10/28/2019
	Data Release Frequency: Varies

FUELS PROGRAM: EPA Fuels Program Registered Listing

This listing includes facilities that are registered under the Part 80 (Code of Federal Regulations) EPA Fuels Programs. All companies now are required to submit new and updated registrations.

Date of Government Version: 02/19/2019	Source: EPA
Date Data Arrived at EDR: 02/21/2019	Telephone: 800-385-6164
Date Made Active in Reports: 04/01/2019	Last EDR Contact: 05/21/2019
Number of Days to Update: 39	Next Scheduled EDR Contact: 09/02/2019
	Data Release Frequency: Quarterly

CA BOND EXP. PLAN: Bond Expenditure Plan

Department of Health Services developed a site-specific expenditure plan as the basis for an appropriation of Hazardous Substance Cleanup Bond Act funds. It is not updated.

Date of Government Version: 01/01/1989	Source: Department of Health Services
Date Data Arrived at EDR: 07/27/1994	Telephone: 916-255-2118
Date Made Active in Reports: 08/02/1994	Last EDR Contact: 05/31/1994
Number of Days to Update: 6	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

CORTESE: "Cortese" Hazardous Waste & Substances Sites List

The sites for the list are designated by the State Water Resource Control Board (LUST), the Integrated Waste Board (SWF/LS), and the Department of Toxic Substances Control (Cal-Sites).

Date of Government Version: 03/25/2019	Source: CAL EPA/Office of Emergency Information
Date Data Arrived at EDR: 03/26/2019	Telephone: 916-323-3400
Date Made Active in Reports: 05/01/2019	Last EDR Contact: 06/25/2019
Number of Days to Update: 36	Next Scheduled EDR Contact: 10/07/2019
	Data Release Frequency: Quarterly

CUPA LIVERMORE-PLEASANTON: CUPA Facility Listing

list of facilities associated with the various CUPA programs in Livermore-Pleasanton

Date of Government Version: 05/01/2019	Source: Livermore-Pleasanton Fire Department
Date Data Arrived at EDR: 05/14/2019	Telephone: 925-454-2361
Date Made Active in Reports: 07/17/2019	Last EDR Contact: 05/14/2019
Number of Days to Update: 64	Next Scheduled EDR Contact: 08/26/2019
	Data Release Frequency: Varies

CUPA SAN FRANCISCO CO: CUPA Facility Listing

Cupa facilities

Date of Government Version: 04/18/2019	Source: San Francisco County Department of Environmental Health
Date Data Arrived at EDR: 04/19/2019	Telephone: 415-252-3896
Date Made Active in Reports: 04/30/2019	Last EDR Contact: 04/18/2019
Number of Days to Update: 11	Next Scheduled EDR Contact: 08/19/2019
	Data Release Frequency: Varies

DRYCLEAN AVAQMD: Antelope Valley Air Quality Management District Drycleaner Listing

A listing of dry cleaners in the Antelope Valley Air Quality Management District.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 02/27/2019
Date Data Arrived at EDR: 02/28/2019
Date Made Active in Reports: 04/01/2019
Number of Days to Update: 32

Source: Antelope Valley Air Quality Management District
Telephone: 661-723-8070
Last EDR Contact: 06/03/2019
Next Scheduled EDR Contact: 09/16/2019
Data Release Frequency: Varies

DRYCLEAN SOUTH COAST: South Coast Air Quality Management District Drycleaner Listing

A listing of dry cleaners in the South Coast Air Quality Management District

Date of Government Version: 03/19/2019
Date Data Arrived at EDR: 03/22/2019
Date Made Active in Reports: 04/09/2019
Number of Days to Update: 18

Source: South Coast Air Quality Management District
Telephone: 909-396-3211
Last EDR Contact: 05/23/2019
Next Scheduled EDR Contact: 09/09/2019
Data Release Frequency: Varies

DRYCLEANERS: Cleaner Facilities

A list of drycleaner related facilities that have EPA ID numbers. These are facilities with certain SIC codes: power laundries, family and commercial; garment pressing and cleaner's agents; linen supply; coin-operated laundries and cleaning; drycleaning plants, except rugs; carpet and upholster cleaning; industrial launderers; laundry and garment services.

Date of Government Version: 03/01/2019
Date Data Arrived at EDR: 04/25/2019
Date Made Active in Reports: 05/30/2019
Number of Days to Update: 35

Source: Department of Toxic Substance Control
Telephone: 916-327-4498
Last EDR Contact: 06/03/2019
Next Scheduled EDR Contact: 09/16/2019
Data Release Frequency: Annually

EMI: Emissions Inventory Data

Toxics and criteria pollutant emissions data collected by the ARB and local air pollution agencies.

Date of Government Version: 12/31/2017
Date Data Arrived at EDR: 06/20/2018
Date Made Active in Reports: 08/06/2018
Number of Days to Update: 47

Source: California Air Resources Board
Telephone: 916-322-2990
Last EDR Contact: 06/24/2019
Next Scheduled EDR Contact: 09/30/2019
Data Release Frequency: Varies

ENF: Enforcement Action Listing

A listing of Water Board Enforcement Actions. Formal is everything except Oral/Verbal Communication, Notice of Violation, Expedited Payment Letter, and Staff Enforcement Letter.

Date of Government Version: 11/01/2018
Date Data Arrived at EDR: 11/02/2018
Date Made Active in Reports: 12/13/2018
Number of Days to Update: 41

Source: State Water Resources Control Board
Telephone: 916-445-9379
Last EDR Contact: 07/18/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

Financial Assurance 1: Financial Assurance Information Listing

Financial Assurance information

Date of Government Version: 04/22/2019
Date Data Arrived at EDR: 04/23/2019
Date Made Active in Reports: 06/26/2019
Number of Days to Update: 64

Source: Department of Toxic Substances Control
Telephone: 916-255-3628
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

Financial Assurance 2: Financial Assurance Information Listing

A listing of financial assurance information for solid waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 05/15/2019
Date Data Arrived at EDR: 05/16/2019
Date Made Active in Reports: 07/18/2019
Number of Days to Update: 63

Source: California Integrated Waste Management Board
Telephone: 916-341-6066
Last EDR Contact: 05/09/2019
Next Scheduled EDR Contact: 08/26/2019
Data Release Frequency: Varies

HAZNET: Facility and Manifest Data

Facility and Manifest Data. The data is extracted from the copies of hazardous waste manifests received each year by the DTSC. The annual volume of manifests is typically 700,000 - 1,000,000 annually, representing approximately 350,000 - 500,000 shipments. Data are from the manifests submitted without correction, and therefore many contain some invalid values for data elements such as generator ID, TSD ID, waste category, and disposal method. This database begins with calendar year 1993.

Date of Government Version: 12/31/2017
Date Data Arrived at EDR: 05/29/2019
Date Made Active in Reports: 07/22/2019
Number of Days to Update: 54

Source: California Environmental Protection Agency
Telephone: 916-255-1136
Last EDR Contact: 07/12/2019
Next Scheduled EDR Contact: 10/21/2019
Data Release Frequency: Annually

ICE: ICE

Contains data pertaining to the Permitted Facilities with Inspections / Enforcements sites tracked in Envirostor.

Date of Government Version: 05/20/2019
Date Data Arrived at EDR: 05/21/2019
Date Made Active in Reports: 07/18/2019
Number of Days to Update: 58

Source: Department of Toxic Substances Control
Telephone: 877-786-9427
Last EDR Contact: 05/21/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Quarterly

HIST CORTESE: Hazardous Waste & Substance Site List

The sites for the list are designated by the State Water Resource Control Board [LUST], the Integrated Waste Board [SWF/LS], and the Department of Toxic Substances Control [CALSITES]. This listing is no longer updated by the state agency.

Date of Government Version: 04/01/2001
Date Data Arrived at EDR: 01/22/2009
Date Made Active in Reports: 04/08/2009
Number of Days to Update: 76

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 01/22/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

HWP: EnviroStor Permitted Facilities Listing

Detailed information on permitted hazardous waste facilities and corrective action ("cleanups") tracked in EnviroStor.

Date of Government Version: 05/20/2019
Date Data Arrived at EDR: 05/21/2019
Date Made Active in Reports: 07/18/2019
Number of Days to Update: 58

Source: Department of Toxic Substances Control
Telephone: 916-323-3400
Last EDR Contact: 05/21/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Quarterly

HWT: Registered Hazardous Waste Transporter Database

A listing of hazardous waste transporters. In California, unless specifically exempted, it is unlawful for any person to transport hazardous wastes unless the person holds a valid registration issued by DTSC. A hazardous waste transporter registration is valid for one year and is assigned a unique registration number.

Date of Government Version: 04/08/2019
Date Data Arrived at EDR: 04/09/2019
Date Made Active in Reports: 05/30/2019
Number of Days to Update: 51

Source: Department of Toxic Substances Control
Telephone: 916-440-7145
Last EDR Contact: 07/09/2019
Next Scheduled EDR Contact: 10/21/2019
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

MINES: Mines Site Location Listing

A listing of mine site locations from the Office of Mine Reclamation.

Date of Government Version: 12/10/2018	Source: Department of Conservation
Date Data Arrived at EDR: 12/12/2018	Telephone: 916-322-1080
Date Made Active in Reports: 01/15/2019	Last EDR Contact: 06/11/2019
Number of Days to Update: 34	Next Scheduled EDR Contact: 09/23/2019
	Data Release Frequency: Quarterly

MWMP: Medical Waste Management Program Listing

The Medical Waste Management Program (MWMP) ensures the proper handling and disposal of medical waste by permitting and inspecting medical waste Offsite Treatment Facilities (PDF) and Transfer Stations (PDF) throughout the state. MWMP also oversees all Medical Waste Transporters.

Date of Government Version: 02/20/2019	Source: Department of Public Health
Date Data Arrived at EDR: 03/05/2019	Telephone: 916-558-1784
Date Made Active in Reports: 04/02/2019	Last EDR Contact: 06/04/2019
Number of Days to Update: 28	Next Scheduled EDR Contact: 09/16/2019
	Data Release Frequency: Varies

NPDES: NPDES Permits Listing

A listing of NPDES permits, including stormwater.

Date of Government Version: 05/13/2019	Source: State Water Resources Control Board
Date Data Arrived at EDR: 05/14/2019	Telephone: 916-445-9379
Date Made Active in Reports: 07/17/2019	Last EDR Contact: 05/14/2019
Number of Days to Update: 64	Next Scheduled EDR Contact: 08/26/2019
	Data Release Frequency: Quarterly

PEST LIC: Pesticide Regulation Licenses Listing

A listing of licenses and certificates issued by the Department of Pesticide Regulation. The DPR issues licenses and/or certificates to: Persons and businesses that apply or sell pesticides; Pest control dealers and brokers; Persons who advise on agricultural pesticide applications.

Date of Government Version: 03/04/2019	Source: Department of Pesticide Regulation
Date Data Arrived at EDR: 03/05/2019	Telephone: 916-445-4038
Date Made Active in Reports: 04/05/2019	Last EDR Contact: 06/04/2019
Number of Days to Update: 31	Next Scheduled EDR Contact: 09/16/2019
	Data Release Frequency: Quarterly

PROC: Certified Processors Database

A listing of certified processors.

Date of Government Version: 03/11/2019	Source: Department of Conservation
Date Data Arrived at EDR: 03/13/2019	Telephone: 916-323-3836
Date Made Active in Reports: 04/29/2019	Last EDR Contact: 06/12/2019
Number of Days to Update: 47	Next Scheduled EDR Contact: 09/23/2019
	Data Release Frequency: Quarterly

NOTIFY 65: Proposition 65 Records

Listings of all Proposition 65 incidents reported to counties by the State Water Resources Control Board and the Regional Water Quality Control Board. This database is no longer updated by the reporting agency.

Date of Government Version: 03/18/2019	Source: State Water Resources Control Board
Date Data Arrived at EDR: 03/19/2019	Telephone: 916-445-3846
Date Made Active in Reports: 04/29/2019	Last EDR Contact: 06/17/2019
Number of Days to Update: 41	Next Scheduled EDR Contact: 09/30/2019
	Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

UIC: UIC Listing

A listing of wells identified as underground injection wells, in the California Oil and Gas Wells database.

Date of Government Version: 04/27/2018	Source: Department of Conservation
Date Data Arrived at EDR: 06/13/2018	Telephone: 916-445-2408
Date Made Active in Reports: 07/17/2018	Last EDR Contact: 06/11/2019
Number of Days to Update: 34	Next Scheduled EDR Contact: 09/23/2019
	Data Release Frequency: Varies

UIC GEO: Underground Injection Control Sites (GEOTRACKER)

Underground control injection sites

Date of Government Version: 06/10/2019	Source: State Water Resource Control Board
Date Data Arrived at EDR: 06/11/2019	Telephone: 866-480-1028
Date Made Active in Reports: 07/24/2019	Last EDR Contact: 06/11/2019
Number of Days to Update: 43	Next Scheduled EDR Contact: 09/23/2019
	Data Release Frequency: Varies

WASTEWATER PITS: Oil Wastewater Pits Listing

Water officials discovered that oil producers have been dumping chemical-laden wastewater into hundreds of unlined pits that are operating without proper permits. Inspections completed by the Central Valley Regional Water Quality Control Board revealed the existence of previously unidentified waste sites. The water boards review found that more than one-third of the region's active disposal pits are operating without permission.

Date of Government Version: 05/08/2018	Source: RWQCB, Central Valley Region
Date Data Arrived at EDR: 07/11/2018	Telephone: 559-445-5577
Date Made Active in Reports: 09/13/2018	Last EDR Contact: 07/12/2019
Number of Days to Update: 64	Next Scheduled EDR Contact: 10/21/2019
	Data Release Frequency: Varies

WDS: Waste Discharge System

Sites which have been issued waste discharge requirements.

Date of Government Version: 06/19/2007	Source: State Water Resources Control Board
Date Data Arrived at EDR: 06/20/2007	Telephone: 916-341-5227
Date Made Active in Reports: 06/29/2007	Last EDR Contact: 05/16/2019
Number of Days to Update: 9	Next Scheduled EDR Contact: 09/02/2019
	Data Release Frequency: No Update Planned

WIP: Well Investigation Program Case List

Well Investigation Program case in the San Gabriel and San Fernando Valley area.

Date of Government Version: 07/03/2009	Source: Los Angeles Water Quality Control Board
Date Data Arrived at EDR: 07/21/2009	Telephone: 213-576-6726
Date Made Active in Reports: 08/03/2009	Last EDR Contact: 06/19/2019
Number of Days to Update: 13	Next Scheduled EDR Contact: 10/07/2019
	Data Release Frequency: No Update Planned

MILITARY PRIV SITES: Military Privatized Sites (GEOTRACKER)

Military privatized sites

Date of Government Version: 06/10/2019	Source: State Water Resources Control Board
Date Data Arrived at EDR: 06/11/2019	Telephone: 866-480-1028
Date Made Active in Reports: 07/24/2019	Last EDR Contact: 06/11/2019
Number of Days to Update: 43	Next Scheduled EDR Contact: 09/23/2019
	Data Release Frequency: Varies

PROJECT: Project Sites (GEOTRACKER)

Projects sites

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 06/10/2019
Date Data Arrived at EDR: 06/11/2019
Date Made Active in Reports: 07/24/2019
Number of Days to Update: 43

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 06/11/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Varies

WDR: Waste Discharge Requirements Listing

In general, the Waste Discharge Requirements (WDRs) Program (sometimes also referred to as the "Non Chapter 15 (Non 15) Program") regulates point discharges that are exempt pursuant to Subsection 20090 of Title 27 and not subject to the Federal Water Pollution Control Act. Exemptions from Title 27 may be granted for nine categories of discharges (e.g., sewage, wastewater, etc.) that meet, and continue to meet, the preconditions listed for each specific exemption. The scope of the WDRs Program also includes the discharge of wastes classified as inert, pursuant to section 20230 of Title 27.

Date of Government Version: 03/11/2019
Date Data Arrived at EDR: 03/13/2019
Date Made Active in Reports: 04/29/2019
Number of Days to Update: 47

Source: State Water Resources Control Board
Telephone: 916-341-5810
Last EDR Contact: 06/12/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Quarterly

CIWQS: California Integrated Water Quality System

The California Integrated Water Quality System (CIWQS) is a computer system used by the State and Regional Water Quality Control Boards to track information about places of environmental interest, manage permits and other orders, track inspections, and manage violations and enforcement activities.

Date of Government Version: 03/05/2019
Date Data Arrived at EDR: 03/05/2019
Date Made Active in Reports: 04/02/2019
Number of Days to Update: 28

Source: State Water Resources Control Board
Telephone: 866-794-4977
Last EDR Contact: 06/04/2019
Next Scheduled EDR Contact: 09/16/2019
Data Release Frequency: Varies

CERS: CalEPA Regulated Site Portal Data

The CalEPA Regulated Site Portal database combines data about environmentally regulated sites and facilities in California into a single database. It combines data from a variety of state and federal databases, and provides an overview of regulated activities across the spectrum of environmental programs for any given location in California. These activities include hazardous materials and waste, state and federal cleanups, impacted ground and surface waters, and toxic materials

Date of Government Version: 04/09/2019
Date Data Arrived at EDR: 04/11/2019
Date Made Active in Reports: 05/08/2019
Number of Days to Update: 27

Source: California Environmental Protection Agency
Telephone: 916-323-2514
Last EDR Contact: 07/23/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

NON-CASE INFO: Non-Case Information Sites (GEOTRACKER)

Non-Case Information sites

Date of Government Version: 06/10/2019
Date Data Arrived at EDR: 06/11/2019
Date Made Active in Reports: 07/24/2019
Number of Days to Update: 43

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 06/11/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Varies

OTHER OIL GAS: Other Oil & Gas Projects Sites (GEOTRACKER)

Other Oil & Gas Projects sites

Date of Government Version: 06/10/2019
Date Data Arrived at EDR: 06/11/2019
Date Made Active in Reports: 07/24/2019
Number of Days to Update: 43

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 06/11/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PROD WATER PONDS: Produced Water Ponds Sites (GEOTRACKER)

Produced water ponds sites

Date of Government Version: 06/10/2019
Date Data Arrived at EDR: 06/11/2019
Date Made Active in Reports: 07/24/2019
Number of Days to Update: 43

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 06/11/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Varies

SAMPLING POINT: Sampling Point ? Public Sites (GEOTRACKER)

Sampling point - public sites

Date of Government Version: 06/10/2019
Date Data Arrived at EDR: 06/11/2019
Date Made Active in Reports: 07/24/2019
Number of Days to Update: 43

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 06/11/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Varies

WELL STIM PROJ: Well Stimulation Project (GEOTRACKER)

Includes areas of groundwater monitoring plans, a depiction of the monitoring network, and the facilities, boundaries, and subsurface characteristics of the oilfield and the features (oil and gas wells, produced water ponds, UIC wells, water supply wells, etc?) being monitored

Date of Government Version: 06/10/2019
Date Data Arrived at EDR: 06/11/2019
Date Made Active in Reports: 07/24/2019
Number of Days to Update: 43

Source: State Water Resources Control Board
Telephone: 866-480-1028
Last EDR Contact: 06/11/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Varies

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Hist Auto: EDR Exclusive Historical Auto Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

EDR Hist Cleaner: EDR Exclusive Historical Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Resources Recycling and Recovery in California.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 01/13/2014
Number of Days to Update: 196

Source: Department of Resources Recycling and Recovery
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

RGA LUST: Recovered Government Archive Leaking Underground Storage Tank

The EDR Recovered Government Archive Leaking Underground Storage Tank database provides a list of LUST incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the State Water Resources Control Board in California.

Date of Government Version: N/A
Date Data Arrived at EDR: 07/01/2013
Date Made Active in Reports: 12/30/2013
Number of Days to Update: 182

Source: State Water Resources Control Board
Telephone: N/A
Last EDR Contact: 06/01/2012
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

COUNTY RECORDS

ALAMEDA COUNTY:

CS ALAMEDA: Contaminated Sites

A listing of contaminated sites overseen by the Toxic Release Program (oil and groundwater contamination from chemical releases and spills) and the Leaking Underground Storage Tank Program (soil and ground water contamination from leaking petroleum USTs).

Date of Government Version: 01/09/2019
Date Data Arrived at EDR: 01/11/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 53

Source: Alameda County Environmental Health Services
Telephone: 510-567-6700
Last EDR Contact: 07/08/2019
Next Scheduled EDR Contact: 10/21/2019
Data Release Frequency: Semi-Annually

UST ALAMEDA: Underground Tanks

Underground storage tank sites located in Alameda county.

Date of Government Version: 04/10/2019
Date Data Arrived at EDR: 04/11/2019
Date Made Active in Reports: 06/20/2019
Number of Days to Update: 70

Source: Alameda County Environmental Health Services
Telephone: 510-567-6700
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 04/24/2047
Data Release Frequency: Semi-Annually

AMADOR COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA AMADOR: CUPA Facility List Cupa Facility List

Date of Government Version: 06/27/2019
Date Data Arrived at EDR: 06/28/2019
Date Made Active in Reports: 07/24/2019
Number of Days to Update: 26

Source: Amador County Environmental Health
Telephone: 209-223-6439
Last EDR Contact: 06/17/2019
Next Scheduled EDR Contact: 09/16/2019
Data Release Frequency: Varies

BUTTE COUNTY:

CUPA BUTTE: CUPA Facility Listing Cupa facility list.

Date of Government Version: 04/21/2017
Date Data Arrived at EDR: 04/25/2017
Date Made Active in Reports: 08/09/2017
Number of Days to Update: 106

Source: Public Health Department
Telephone: 530-538-7149
Last EDR Contact: 07/08/2019
Next Scheduled EDR Contact: 10/21/2019
Data Release Frequency: No Update Planned

CALVERAS COUNTY:

CUPA CALVERAS: CUPA Facility Listing Cupa Facility Listing

Date of Government Version: 05/01/2019
Date Data Arrived at EDR: 05/02/2019
Date Made Active in Reports: 05/29/2019
Number of Days to Update: 27

Source: Calveras County Environmental Health
Telephone: 209-754-6399
Last EDR Contact: 06/24/2019
Next Scheduled EDR Contact: 10/07/2019
Data Release Frequency: Quarterly

COLUSA COUNTY:

CUPA COLUSA: CUPA Facility List Cupa facility list.

Date of Government Version: 05/17/2019
Date Data Arrived at EDR: 05/21/2019
Date Made Active in Reports: 07/18/2019
Number of Days to Update: 58

Source: Health & Human Services
Telephone: 530-458-0396
Last EDR Contact: 05/16/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Semi-Annually

CONTRA COSTA COUNTY:

SL CONTRA COSTA: Site List

List includes sites from the underground tank, hazardous waste generator and business plan/2185 programs.

Date of Government Version: 05/22/2019
Date Data Arrived at EDR: 05/23/2019
Date Made Active in Reports: 07/18/2019
Number of Days to Update: 56

Source: Contra Costa Health Services Department
Telephone: 925-646-2286
Last EDR Contact: 04/29/2019
Next Scheduled EDR Contact: 08/12/2019
Data Release Frequency: Semi-Annually

DEL NORTE COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA DEL NORTE: CUPA Facility List Cupa Facility list

Date of Government Version: 02/20/2019
Date Data Arrived at EDR: 05/01/2019
Date Made Active in Reports: 05/30/2019
Number of Days to Update: 29

Source: Del Norte County Environmental Health Division
Telephone: 707-465-0426
Last EDR Contact: 04/25/2019
Next Scheduled EDR Contact: 08/12/2019
Data Release Frequency: Varies

EL DORADO COUNTY:

CUPA EL DORADO: CUPA Facility List CUPA facility list.

Date of Government Version: 06/05/2019
Date Data Arrived at EDR: 06/06/2019
Date Made Active in Reports: 07/23/2019
Number of Days to Update: 47

Source: El Dorado County Environmental Management Department
Telephone: 530-621-6623
Last EDR Contact: 04/29/2019
Next Scheduled EDR Contact: 08/12/2019
Data Release Frequency: Varies

FRESNO COUNTY:

CUPA FRESNO: CUPA Resources List

Certified Unified Program Agency. CUPA's are responsible for implementing a unified hazardous materials and hazardous waste management regulatory program. The agency provides oversight of businesses that deal with hazardous materials, operate underground storage tanks or aboveground storage tanks.

Date of Government Version: 04/10/2019
Date Data Arrived at EDR: 04/11/2019
Date Made Active in Reports: 04/30/2019
Number of Days to Update: 19

Source: Dept. of Community Health
Telephone: 559-445-3271
Last EDR Contact: 06/26/2019
Next Scheduled EDR Contact: 10/14/2019
Data Release Frequency: Semi-Annually

GLENN COUNTY:

CUPA GLENN: CUPA Facility List Cupa facility list

Date of Government Version: 01/22/2018
Date Data Arrived at EDR: 01/24/2018
Date Made Active in Reports: 03/14/2018
Number of Days to Update: 49

Source: Glenn County Air Pollution Control District
Telephone: 830-934-6500
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: No Update Planned

HUMBOLDT COUNTY:

CUPA HUMBOLDT: CUPA Facility List CUPA facility list.

Date of Government Version: 12/11/2018
Date Data Arrived at EDR: 12/13/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 33

Source: Humboldt County Environmental Health
Telephone: N/A
Last EDR Contact: 05/20/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Semi-Annually

IMPERIAL COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA IMPERIAL: CUPA Facility List Cupa facility list.

Date of Government Version: 04/24/2019
Date Data Arrived at EDR: 04/25/2019
Date Made Active in Reports: 06/27/2019
Number of Days to Update: 63

Source: San Diego Border Field Office
Telephone: 760-339-2777
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

INYO COUNTY:

CUPA INYO: CUPA Facility List Cupa facility list.

Date of Government Version: 04/02/2018
Date Data Arrived at EDR: 04/03/2018
Date Made Active in Reports: 06/14/2018
Number of Days to Update: 72

Source: Inyo County Environmental Health Services
Telephone: 760-878-0238
Last EDR Contact: 05/16/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Varies

KERN COUNTY:

UST KERN: Underground Storage Tank Sites & Tank Listing Kern County Sites and Tanks Listing.

Date of Government Version: 05/06/2019
Date Data Arrived at EDR: 05/07/2019
Date Made Active in Reports: 07/16/2019
Number of Days to Update: 70

Source: Kern County Environment Health Services Department
Telephone: 661-862-8700
Last EDR Contact: 05/02/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Quarterly

KINGS COUNTY:

CUPA KINGS: CUPA Facility List

A listing of sites included in the county's Certified Unified Program Agency database. California's Secretary for Environmental Protection established the unified hazardous materials and hazardous waste regulatory program as required by chapter 6.11 of the California Health and Safety Code. The Unified Program consolidates the administration, permits, inspections, and enforcement activities.

Date of Government Version: 05/16/2019
Date Data Arrived at EDR: 05/17/2019
Date Made Active in Reports: 05/30/2019
Number of Days to Update: 13

Source: Kings County Department of Public Health
Telephone: 559-584-1411
Last EDR Contact: 05/16/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Varies

LAKE COUNTY:

CUPA LAKE: CUPA Facility List Cupa facility list

Date of Government Version: 05/30/2019
Date Data Arrived at EDR: 05/31/2019
Date Made Active in Reports: 07/23/2019
Number of Days to Update: 53

Source: Lake County Environmental Health
Telephone: 707-263-1164
Last EDR Contact: 07/15/2019
Next Scheduled EDR Contact: 10/28/2019
Data Release Frequency: Varies

LASSEN COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA LASSEN: CUPA Facility List Cupa facility list

Date of Government Version: 01/17/2019
Date Data Arrived at EDR: 01/18/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 46

Source: Lassen County Environmental Health
Telephone: 530-251-8528
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

LOS ANGELES COUNTY:

AOCONCERN: Key Areas of Concerns in Los Angeles County

San Gabriel Valley areas where VOC contamination is at or above the MCL as designated by region 9 EPA office. Date of Government Version: 3/30/2009 Exide Site area is a cleanup plan of lead-impacted soil surrounding the former Exide Facility as designated by the DTSC. Date of Government Version: 7/17/2017

Date of Government Version: 03/30/2009
Date Data Arrived at EDR: 03/31/2009
Date Made Active in Reports: 10/23/2009
Number of Days to Update: 206

Source: N/A
Telephone: N/A
Last EDR Contact: 06/17/2019
Next Scheduled EDR Contact: 09/30/2019
Data Release Frequency: No Update Planned

HMS LOS ANGELES: HMS: Street Number List Industrial Waste and Underground Storage Tank Sites.

Date of Government Version: 05/13/2019
Date Data Arrived at EDR: 05/16/2019
Date Made Active in Reports: 07/18/2019
Number of Days to Update: 63

Source: Department of Public Works
Telephone: 626-458-3517
Last EDR Contact: 07/08/2019
Next Scheduled EDR Contact: 10/21/2019
Data Release Frequency: Semi-Annually

LF LOS ANGELES: List of Solid Waste Facilities Solid Waste Facilities in Los Angeles County.

Date of Government Version: 04/15/2019
Date Data Arrived at EDR: 04/16/2019
Date Made Active in Reports: 06/21/2019
Number of Days to Update: 66

Source: La County Department of Public Works
Telephone: 818-458-5185
Last EDR Contact: 07/17/2019
Next Scheduled EDR Contact: 10/28/2019
Data Release Frequency: Varies

LF LOS ANGELES CITY: City of Los Angeles Landfills Landfills owned and maintained by the City of Los Angeles.

Date of Government Version: 01/01/2019
Date Data Arrived at EDR: 01/15/2019
Date Made Active in Reports: 03/07/2019
Number of Days to Update: 51

Source: Engineering & Construction Division
Telephone: 213-473-7869
Last EDR Contact: 07/12/2019
Next Scheduled EDR Contact: 10/28/2019
Data Release Frequency: Varies

LOS ANGELES AST: Active & Inactive AST Inventory

A listing of active & inactive above ground petroleum storage tank site locations, located in the City of Los Angeles.

Date of Government Version: 01/01/2019
Date Data Arrived at EDR: 04/05/2019
Date Made Active in Reports: 05/29/2019
Number of Days to Update: 54

Source: Los Angeles Fire Department
Telephone: 213-978-3800
Last EDR Contact: 06/25/2019
Next Scheduled EDR Contact: 10/07/2019
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

LOS ANGELES CO LF METHANE: Methane Producing Landfills

This data was created on April 30, 2012 to represent known disposal sites in Los Angeles County that may produce and emanate methane gas. The shapefile contains disposal sites within Los Angeles County that once accepted degradable refuse material. Information used to create this data was extracted from a landfill survey performed by County Engineers (Major Waste System Map, 1973) as well as historical records from CalRecycle, Regional Water Quality Control Board, and Los Angeles County Department of Public Health

Date of Government Version: 04/30/2012
Date Data Arrived at EDR: 04/17/2019
Date Made Active in Reports: 05/29/2019
Number of Days to Update: 42

Source: Los Angeles County Department of Public Works
Telephone: 626-458-6973
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 10/28/2019
Data Release Frequency: No Update Planned

LOS ANGELES HM: Active & Inactive Hazardous Materials Inventory

A listing of active & inactive hazardous materials facility locations, located in the City of Los Angeles.

Date of Government Version: 01/01/2019
Date Data Arrived at EDR: 04/05/2019
Date Made Active in Reports: 05/29/2019
Number of Days to Update: 54

Source: Los Angeles Fire Department
Telephone: 213-978-3800
Last EDR Contact: 06/25/2019
Next Scheduled EDR Contact: 10/07/2019
Data Release Frequency: Varies

LOS ANGELES UST: Active & Inactive UST Inventory

A listing of active & inactive underground storage tank site locations and underground storage tank historical sites, located in the City of Los Angeles.

Date of Government Version: 01/01/2019
Date Data Arrived at EDR: 04/05/2019
Date Made Active in Reports: 05/29/2019
Number of Days to Update: 54

Source: Los Angeles Fire Department
Telephone: 213-978-3800
Last EDR Contact: 06/25/2019
Next Scheduled EDR Contact: 10/07/2019
Data Release Frequency: Varies

SITE MIT LOS ANGELES: Site Mitigation List

Industrial sites that have had some sort of spill or complaint.

Date of Government Version: 04/08/2019
Date Data Arrived at EDR: 04/16/2019
Date Made Active in Reports: 06/21/2019
Number of Days to Update: 66

Source: Community Health Services
Telephone: 323-890-7806
Last EDR Contact: 07/17/2019
Next Scheduled EDR Contact: 10/28/2019
Data Release Frequency: Annually

UST EL SEGUNDO: City of El Segundo Underground Storage Tank

Underground storage tank sites located in El Segundo city.

Date of Government Version: 01/21/2017
Date Data Arrived at EDR: 04/19/2017
Date Made Active in Reports: 05/10/2017
Number of Days to Update: 21

Source: City of El Segundo Fire Department
Telephone: 310-524-2236
Last EDR Contact: 07/12/2019
Next Scheduled EDR Contact: 10/28/2019
Data Release Frequency: No Update Planned

UST LONG BEACH: City of Long Beach Underground Storage Tank

Underground storage tank sites located in the city of Long Beach.

Date of Government Version: 04/22/2019
Date Data Arrived at EDR: 04/23/2019
Date Made Active in Reports: 06/27/2019
Number of Days to Update: 65

Source: City of Long Beach Fire Department
Telephone: 562-570-2563
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

UST TORRANCE: City of Torrance Underground Storage Tank
Underground storage tank sites located in the city of Torrance.

Date of Government Version: 04/04/2019
Date Data Arrived at EDR: 04/23/2019
Date Made Active in Reports: 06/27/2019
Number of Days to Update: 65

Source: City of Torrance Fire Department
Telephone: 310-618-2973
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Semi-Annually

MADERA COUNTY:

CUPA MADERA: CUPA Facility List

A listing of sites included in the county's Certified Unified Program Agency database. California's Secretary for Environmental Protection established the unified hazardous materials and hazardous waste regulatory program as required by chapter 6.11 of the California Health and Safety Code. The Unified Program consolidates the administration, permits, inspections, and enforcement activities.

Date of Government Version: 02/20/2019
Date Data Arrived at EDR: 02/22/2019
Date Made Active in Reports: 03/07/2019
Number of Days to Update: 13

Source: Madera County Environmental Health
Telephone: 559-675-7823
Last EDR Contact: 05/16/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Varies

MARIN COUNTY:

UST MARIN: Underground Storage Tank Sites
Currently permitted USTs in Marin County.

Date of Government Version: 09/26/2018
Date Data Arrived at EDR: 10/04/2018
Date Made Active in Reports: 11/02/2018
Number of Days to Update: 29

Source: Public Works Department Waste Management
Telephone: 415-473-6647
Last EDR Contact: 06/26/2019
Next Scheduled EDR Contact: 10/14/2019
Data Release Frequency: Semi-Annually

MERCED COUNTY:

CUPA MERCED: CUPA Facility List
CUPA facility list.

Date of Government Version: 05/29/2019
Date Data Arrived at EDR: 05/30/2019
Date Made Active in Reports: 07/22/2019
Number of Days to Update: 53

Source: Merced County Environmental Health
Telephone: 209-381-1094
Last EDR Contact: 05/16/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Varies

MONO COUNTY:

CUPA MONO: CUPA Facility List
CUPA Facility List

Date of Government Version: 05/23/2019
Date Data Arrived at EDR: 05/30/2019
Date Made Active in Reports: 07/22/2019
Number of Days to Update: 53

Source: Mono County Health Department
Telephone: 760-932-5580
Last EDR Contact: 05/23/2019
Next Scheduled EDR Contact: 09/09/2019
Data Release Frequency: Varies

MONTEREY COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA MONTEREY: CUPA Facility Listing

CUPA Program listing from the Environmental Health Division.

Date of Government Version: 02/05/2019
Date Data Arrived at EDR: 02/07/2019
Date Made Active in Reports: 03/05/2019
Number of Days to Update: 26

Source: Monterey County Health Department
Telephone: 831-796-1297
Last EDR Contact: 06/28/2019
Next Scheduled EDR Contact: 10/14/2019
Data Release Frequency: Varies

NAPA COUNTY:

LUST NAPA: Sites With Reported Contamination

A listing of leaking underground storage tank sites located in Napa county.

Date of Government Version: 01/09/2017
Date Data Arrived at EDR: 01/11/2017
Date Made Active in Reports: 03/02/2017
Number of Days to Update: 50

Source: Napa County Department of Environmental Management
Telephone: 707-253-4269
Last EDR Contact: 05/24/2019
Next Scheduled EDR Contact: 09/09/2019
Data Release Frequency: No Update Planned

UST NAPA: Closed and Operating Underground Storage Tank Sites

Underground storage tank sites located in Napa county.

Date of Government Version: 02/21/2019
Date Data Arrived at EDR: 02/22/2019
Date Made Active in Reports: 03/08/2019
Number of Days to Update: 14

Source: Napa County Department of Environmental Management
Telephone: 707-253-4269
Last EDR Contact: 05/24/2019
Next Scheduled EDR Contact: 09/09/2019
Data Release Frequency: No Update Planned

NEVADA COUNTY:

CUPA NEVADA: CUPA Facility List

CUPA facility list.

Date of Government Version: 05/20/2019
Date Data Arrived at EDR: 05/21/2019
Date Made Active in Reports: 05/30/2019
Number of Days to Update: 9

Source: Community Development Agency
Telephone: 530-265-1467
Last EDR Contact: 05/13/2019
Next Scheduled EDR Contact: 08/12/2019
Data Release Frequency: Varies

ORANGE COUNTY:

IND_SITE ORANGE: List of Industrial Site Cleanups

Petroleum and non-petroleum spills.

Date of Government Version: 05/01/2019
Date Data Arrived at EDR: 05/09/2019
Date Made Active in Reports: 05/30/2019
Number of Days to Update: 21

Source: Health Care Agency
Telephone: 714-834-3446
Last EDR Contact: 05/06/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Annually

LUST ORANGE: List of Underground Storage Tank Cleanups

Orange County Underground Storage Tank Cleanups (LUST).

Date of Government Version: 05/01/2019
Date Data Arrived at EDR: 05/09/2019
Date Made Active in Reports: 05/30/2019
Number of Days to Update: 21

Source: Health Care Agency
Telephone: 714-834-3446
Last EDR Contact: 05/06/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

UST ORANGE: List of Underground Storage Tank Facilities

Orange County Underground Storage Tank Facilities (UST).

Date of Government Version: 04/02/2019
Date Data Arrived at EDR: 05/07/2019
Date Made Active in Reports: 07/16/2019
Number of Days to Update: 70

Source: Health Care Agency
Telephone: 714-834-3446
Last EDR Contact: 05/07/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Quarterly

PLACER COUNTY:

MS PLACER: Master List of Facilities

List includes aboveground tanks, underground tanks and cleanup sites.

Date of Government Version: 02/28/2019
Date Data Arrived at EDR: 03/01/2019
Date Made Active in Reports: 04/12/2019
Number of Days to Update: 42

Source: Placer County Health and Human Services
Telephone: 530-745-2363
Last EDR Contact: 06/03/2019
Next Scheduled EDR Contact: 06/17/2019
Data Release Frequency: Semi-Annually

PLUMAS COUNTY:

CUPA PLUMAS: CUPA Facility List

Plumas County CUPA Program facilities.

Date of Government Version: 03/31/2019
Date Data Arrived at EDR: 04/23/2019
Date Made Active in Reports: 06/26/2019
Number of Days to Update: 64

Source: Plumas County Environmental Health
Telephone: 530-283-6355
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

RIVERSIDE COUNTY:

LUST RIVERSIDE: Listing of Underground Tank Cleanup Sites

Riverside County Underground Storage Tank Cleanup Sites (LUST).

Date of Government Version: 04/11/2019
Date Data Arrived at EDR: 04/12/2019
Date Made Active in Reports: 04/30/2019
Number of Days to Update: 18

Source: Department of Environmental Health
Telephone: 951-358-5055
Last EDR Contact: 06/17/2019
Next Scheduled EDR Contact: 09/30/2019
Data Release Frequency: Quarterly

UST RIVERSIDE: Underground Storage Tank Tank List

Underground storage tank sites located in Riverside county.

Date of Government Version: 04/11/2019
Date Data Arrived at EDR: 04/12/2019
Date Made Active in Reports: 06/20/2019
Number of Days to Update: 69

Source: Department of Environmental Health
Telephone: 951-358-5055
Last EDR Contact: 06/17/2019
Next Scheduled EDR Contact: 09/30/2019
Data Release Frequency: Quarterly

SACRAMENTO COUNTY:

CS SACRAMENTO: Toxic Site Clean-Up List

List of sites where unauthorized releases of potentially hazardous materials have occurred.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 02/05/2019
Date Data Arrived at EDR: 04/02/2019
Date Made Active in Reports: 06/18/2019
Number of Days to Update: 77

Source: Sacramento County Environmental Management
Telephone: 916-875-8406
Last EDR Contact: 06/28/2019
Next Scheduled EDR Contact: 10/14/2019
Data Release Frequency: Quarterly

ML SACRAMENTO: Master Hazardous Materials Facility List

Any business that has hazardous materials on site - hazardous material storage sites, underground storage tanks, waste generators.

Date of Government Version: 02/06/2019
Date Data Arrived at EDR: 04/02/2019
Date Made Active in Reports: 06/20/2019
Number of Days to Update: 79

Source: Sacramento County Environmental Management
Telephone: 916-875-8406
Last EDR Contact: 06/28/2019
Next Scheduled EDR Contact: 10/14/2019
Data Release Frequency: Quarterly

SAN BENITO COUNTY:

CUPA SAN BENITO: CUPA Facility List Cupa facility list

Date of Government Version: 03/11/2019
Date Data Arrived at EDR: 03/13/2019
Date Made Active in Reports: 04/30/2019
Number of Days to Update: 48

Source: San Benito County Environmental Health
Telephone: N/A
Last EDR Contact: 07/16/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Varies

SAN BERNARDINO COUNTY:

PERMITS SAN BERNARDINO: Hazardous Material Permits

This listing includes underground storage tanks, medical waste handlers/generators, hazardous materials handlers, hazardous waste generators, and waste oil generators/handlers.

Date of Government Version: 05/31/2019
Date Data Arrived at EDR: 05/31/2019
Date Made Active in Reports: 07/22/2019
Number of Days to Update: 52

Source: San Bernardino County Fire Department Hazardous Materials Division
Telephone: 909-387-3041
Last EDR Contact: 05/06/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Quarterly

SAN DIEGO COUNTY:

HMMD SAN DIEGO: Hazardous Materials Management Division Database

The database includes: HE58 - This report contains the business name, site address, business phone number, establishment 'H' permit number, type of permit, and the business status. HE17 - In addition to providing the same information provided in the HE58 listing, HE17 provides inspection dates, violations received by the establishment, hazardous waste generated, the quantity, method of storage, treatment/disposal of waste and the hauler, and information on underground storage tanks. Unauthorized Release List - Includes a summary of environmental contamination cases in San Diego County (underground tank cases, non-tank cases, groundwater contamination, and soil contamination are included.)

Date of Government Version: 03/04/2019
Date Data Arrived at EDR: 03/05/2019
Date Made Active in Reports: 04/02/2019
Number of Days to Update: 28

Source: Hazardous Materials Management Division
Telephone: 619-338-2268
Last EDR Contact: 06/04/2019
Next Scheduled EDR Contact: 09/16/2019
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

LF SAN DIEGO: Solid Waste Facilities

San Diego County Solid Waste Facilities.

Date of Government Version: 04/18/2018
Date Data Arrived at EDR: 04/24/2018
Date Made Active in Reports: 06/19/2018
Number of Days to Update: 56

Source: Department of Health Services
Telephone: 619-338-2209
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

SAN DIEGO CO LOP: Local Oversight Program Listing

A listing of all LOP release sites that are or were under the County of San Diego's jurisdiction. Included are closed or transferred cases, open cases, and cases that did not have a case type indicated. The cases without a case type are mostly complaints; however, some of them could be LOP cases.

Date of Government Version: 04/24/2019
Date Data Arrived at EDR: 04/25/2019
Date Made Active in Reports: 06/27/2019
Number of Days to Update: 63

Source: Department of Environmental Health
Telephone: 858-505-6874
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

SAN DIEGO CO SAM: Environmental Case Listing

The listing contains all underground tank release cases and projects pertaining to properties contaminated with hazardous substances that are actively under review by the Site Assessment and Mitigation Program.

Date of Government Version: 03/23/2010
Date Data Arrived at EDR: 06/15/2010
Date Made Active in Reports: 07/09/2010
Number of Days to Update: 24

Source: San Diego County Department of Environmental Health
Telephone: 619-338-2371
Last EDR Contact: 06/03/2019
Next Scheduled EDR Contact: 09/16/2019
Data Release Frequency: No Update Planned

SAN FRANCISCO COUNTY:

LUST SAN FRANCISCO: Local Oversight Facilities

A listing of leaking underground storage tank sites located in San Francisco county.

Date of Government Version: 09/19/2008
Date Data Arrived at EDR: 09/19/2008
Date Made Active in Reports: 09/29/2008
Number of Days to Update: 10

Source: Department Of Public Health San Francisco County
Telephone: 415-252-3920
Last EDR Contact: 05/02/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: No Update Planned

UST SAN FRANCISCO: Underground Storage Tank Information

Underground storage tank sites located in San Francisco county.

Date of Government Version: 11/05/2018
Date Data Arrived at EDR: 11/06/2018
Date Made Active in Reports: 12/14/2018
Number of Days to Update: 38

Source: Department of Public Health
Telephone: 415-252-3920
Last EDR Contact: 05/02/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Quarterly

SAN JOAQUIN COUNTY:

UST SAN JOAQUIN: San Joaquin Co. UST

A listing of underground storage tank locations in San Joaquin county.

Date of Government Version: 06/22/2018
Date Data Arrived at EDR: 06/26/2018
Date Made Active in Reports: 07/11/2018
Number of Days to Update: 15

Source: Environmental Health Department
Telephone: N/A
Last EDR Contact: 06/17/2019
Next Scheduled EDR Contact: 09/30/2019
Data Release Frequency: Semi-Annually

SAN LUIS OBISPO COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA SAN LUIS OBISPO: CUPA Facility List Cupa Facility List.

Date of Government Version: 05/20/2019
Date Data Arrived at EDR: 05/21/2019
Date Made Active in Reports: 07/18/2019
Number of Days to Update: 58

Source: San Luis Obispo County Public Health Department
Telephone: 805-781-5596
Last EDR Contact: 05/16/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Varies

SAN MATEO COUNTY:

BI SAN MATEO: Business Inventory

List includes Hazardous Materials Business Plan, hazardous waste generators, and underground storage tanks.

Date of Government Version: 03/04/2019
Date Data Arrived at EDR: 03/13/2019
Date Made Active in Reports: 04/29/2019
Number of Days to Update: 47

Source: San Mateo County Environmental Health Services Division
Telephone: 650-363-1921
Last EDR Contact: 06/12/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Annually

LUST SAN MATEO: Fuel Leak List

A listing of leaking underground storage tank sites located in San Mateo county.

Date of Government Version: 03/29/2019
Date Data Arrived at EDR: 03/29/2019
Date Made Active in Reports: 05/29/2019
Number of Days to Update: 61

Source: San Mateo County Environmental Health Services Division
Telephone: 650-363-1921
Last EDR Contact: 06/10/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Semi-Annually

SANTA BARBARA COUNTY:

CUPA SANTA BARBARA: CUPA Facility Listing

CUPA Program Listing from the Environmental Health Services division.

Date of Government Version: 09/08/2011
Date Data Arrived at EDR: 09/09/2011
Date Made Active in Reports: 10/07/2011
Number of Days to Update: 28

Source: Santa Barbara County Public Health Department
Telephone: 805-686-8167
Last EDR Contact: 05/16/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: No Update Planned

SANTA CLARA COUNTY:

CUPA SANTA CLARA: Cupa Facility List Cupa facility list

Date of Government Version: 05/16/2019
Date Data Arrived at EDR: 05/23/2019
Date Made Active in Reports: 07/18/2019
Number of Days to Update: 56

Source: Department of Environmental Health
Telephone: 408-918-1973
Last EDR Contact: 05/16/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Varies

HIST LUST SANTA CLARA: HIST LUST - Fuel Leak Site Activity Report

A listing of open and closed leaking underground storage tanks. This listing is no longer updated by the county. Leaking underground storage tanks are now handled by the Department of Environmental Health.

Date of Government Version: 03/29/2005
Date Data Arrived at EDR: 03/30/2005
Date Made Active in Reports: 04/21/2005
Number of Days to Update: 22

Source: Santa Clara Valley Water District
Telephone: 408-265-2600
Last EDR Contact: 03/23/2009
Next Scheduled EDR Contact: 06/22/2009
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

LUST SANTA CLARA: LOP Listing

A listing of leaking underground storage tanks located in Santa Clara county.

Date of Government Version: 03/03/2014
Date Data Arrived at EDR: 03/05/2014
Date Made Active in Reports: 03/18/2014
Number of Days to Update: 13

Source: Department of Environmental Health
Telephone: 408-918-3417
Last EDR Contact: 05/24/2019
Next Scheduled EDR Contact: 09/09/2019
Data Release Frequency: No Update Planned

SAN JOSE HAZMAT: Hazardous Material Facilities

Hazardous material facilities, including underground storage tank sites.

Date of Government Version: 05/19/2019
Date Data Arrived at EDR: 05/23/2019
Date Made Active in Reports: 07/22/2019
Number of Days to Update: 60

Source: City of San Jose Fire Department
Telephone: 408-535-7694
Last EDR Contact: 05/16/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Annually

SANTA CRUZ COUNTY:

CUPA SANTA CRUZ: CUPA Facility List

CUPA facility listing.

Date of Government Version: 01/21/2017
Date Data Arrived at EDR: 02/22/2017
Date Made Active in Reports: 05/23/2017
Number of Days to Update: 90

Source: Santa Cruz County Environmental Health
Telephone: 831-464-2761
Last EDR Contact: 05/16/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Varies

SHASTA COUNTY:

CUPA SHASTA: CUPA Facility List

Cupa Facility List.

Date of Government Version: 06/15/2017
Date Data Arrived at EDR: 06/19/2017
Date Made Active in Reports: 08/09/2017
Number of Days to Update: 51

Source: Shasta County Department of Resource Management
Telephone: 530-225-5789
Last EDR Contact: 05/16/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Varies

SOLANO COUNTY:

LUST SOLANO: Leaking Underground Storage Tanks

A listing of leaking underground storage tank sites located in Solano county.

Date of Government Version: 03/05/2019
Date Data Arrived at EDR: 03/07/2019
Date Made Active in Reports: 04/29/2019
Number of Days to Update: 53

Source: Solano County Department of Environmental Management
Telephone: 707-784-6770
Last EDR Contact: 06/03/2019
Next Scheduled EDR Contact: 09/16/2019
Data Release Frequency: Quarterly

UST SOLANO: Underground Storage Tanks

Underground storage tank sites located in Solano county.

Date of Government Version: 06/04/2019
Date Data Arrived at EDR: 06/06/2019
Date Made Active in Reports: 07/23/2019
Number of Days to Update: 47

Source: Solano County Department of Environmental Management
Telephone: 707-784-6770
Last EDR Contact: 06/03/2019
Next Scheduled EDR Contact: 09/16/2019
Data Release Frequency: Quarterly

SONOMA COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CUPA SONOMA: Cupa Facility List Cupa Facility list

Date of Government Version: 06/18/2019
Date Data Arrived at EDR: 06/25/2019
Date Made Active in Reports: 07/24/2019
Number of Days to Update: 29

Source: County of Sonoma Fire & Emergency Services Department
Telephone: 707-565-1174
Last EDR Contact: 06/19/2019
Next Scheduled EDR Contact: 10/07/2019
Data Release Frequency: Varies

LUST SONOMA: Leaking Underground Storage Tank Sites

A listing of leaking underground storage tank sites located in Sonoma county.

Date of Government Version: 04/03/2019
Date Data Arrived at EDR: 04/11/2019
Date Made Active in Reports: 04/30/2019
Number of Days to Update: 19

Source: Department of Health Services
Telephone: 707-565-6565
Last EDR Contact: 06/19/2019
Next Scheduled EDR Contact: 10/07/2019
Data Release Frequency: Quarterly

STANISLAUS COUNTY:

CUPA STANISLAUS: CUPA Facility List Cupa facility list

Date of Government Version: 12/11/2018
Date Data Arrived at EDR: 12/13/2018
Date Made Active in Reports: 01/15/2019
Number of Days to Update: 33

Source: Stanislaus County Department of Environmental Protection
Telephone: 209-525-6751
Last EDR Contact: 07/15/2019
Next Scheduled EDR Contact: 10/28/2019
Data Release Frequency: Varies

SUTTER COUNTY:

UST SUTTER: Underground Storage Tanks

Underground storage tank sites located in Sutter county.

Date of Government Version: 06/03/2019
Date Data Arrived at EDR: 06/04/2019
Date Made Active in Reports: 07/23/2019
Number of Days to Update: 49

Source: Sutter County Environmental Health Services
Telephone: 530-822-7500
Last EDR Contact: 06/03/2019
Next Scheduled EDR Contact: 09/16/2019
Data Release Frequency: Semi-Annually

TEHAMA COUNTY:

CUPA TEHAMA: CUPA Facility List Cupa facilities

Date of Government Version: 05/20/2019
Date Data Arrived at EDR: 05/21/2019
Date Made Active in Reports: 07/18/2019
Number of Days to Update: 58

Source: Tehama County Department of Environmental Health
Telephone: 530-527-8020
Last EDR Contact: 05/16/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Varies

TRINITY COUNTY:

CUPA TRINITY: CUPA Facility List Cupa facility list

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 04/24/2019
Date Data Arrived at EDR: 04/25/2019
Date Made Active in Reports: 06/28/2019
Number of Days to Update: 64

Source: Department of Toxic Substances Control
Telephone: 760-352-0381
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

TULARE COUNTY:

CUPA TULARE: CUPA Facility List Cupa program facilities

Date of Government Version: 05/09/2019
Date Data Arrived at EDR: 05/10/2019
Date Made Active in Reports: 07/17/2019
Number of Days to Update: 68

Source: Tulare County Environmental Health Services Division
Telephone: 559-624-7400
Last EDR Contact: 05/06/2019
Next Scheduled EDR Contact: 08/19/2019
Data Release Frequency: Varies

TUOLUMNE COUNTY:

CUPA TUOLUMNE: CUPA Facility List Cupa facility list

Date of Government Version: 04/23/2018
Date Data Arrived at EDR: 04/25/2018
Date Made Active in Reports: 06/25/2018
Number of Days to Update: 61

Source: Division of Environmental Health
Telephone: 209-533-5633
Last EDR Contact: 07/19/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Varies

VENTURA COUNTY:

BWT VENTURA: Business Plan, Hazardous Waste Producers, and Operating Underground Tanks

The BWT list indicates by site address whether the Environmental Health Division has Business Plan (B), Waste Producer (W), and/or Underground Tank (T) information.

Date of Government Version: 03/26/2019
Date Data Arrived at EDR: 04/25/2019
Date Made Active in Reports: 06/27/2019
Number of Days to Update: 63

Source: Ventura County Environmental Health Division
Telephone: 805-654-2813
Last EDR Contact: 07/22/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Quarterly

LF VENTURA: Inventory of Illegal Abandoned and Inactive Sites

Ventura County Inventory of Closed, Illegal Abandoned, and Inactive Sites.

Date of Government Version: 12/01/2011
Date Data Arrived at EDR: 12/01/2011
Date Made Active in Reports: 01/19/2012
Number of Days to Update: 49

Source: Environmental Health Division
Telephone: 805-654-2813
Last EDR Contact: 06/26/2019
Next Scheduled EDR Contact: 10/14/2019
Data Release Frequency: No Update Planned

LUST VENTURA: Listing of Underground Tank Cleanup Sites

Ventura County Underground Storage Tank Cleanup Sites (LUST).

Date of Government Version: 05/29/2008
Date Data Arrived at EDR: 06/24/2008
Date Made Active in Reports: 07/31/2008
Number of Days to Update: 37

Source: Environmental Health Division
Telephone: 805-654-2813
Last EDR Contact: 05/09/2019
Next Scheduled EDR Contact: 08/26/2019
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

MED WASTE VENTURA: Medical Waste Program List

To protect public health and safety and the environment from potential exposure to disease causing agents, the Environmental Health Division Medical Waste Program regulates the generation, handling, storage, treatment and disposal of medical waste throughout the County.

Date of Government Version: 03/26/2019
Date Data Arrived at EDR: 04/25/2019
Date Made Active in Reports: 05/30/2019
Number of Days to Update: 35

Source: Ventura County Resource Management Agency
Telephone: 805-654-2813
Last EDR Contact: 07/22/2019
Next Scheduled EDR Contact: 11/04/2019
Data Release Frequency: Quarterly

UST VENTURA: Underground Tank Closed Sites List

Ventura County Operating Underground Storage Tank Sites (UST)/Underground Tank Closed Sites List.

Date of Government Version: 06/10/2019
Date Data Arrived at EDR: 06/12/2019
Date Made Active in Reports: 07/24/2019
Number of Days to Update: 42

Source: Environmental Health Division
Telephone: 805-654-2813
Last EDR Contact: 06/12/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Quarterly

YOLO COUNTY:

UST YOLO: Underground Storage Tank Comprehensive Facility Report

Underground storage tank sites located in Yolo county.

Date of Government Version: 03/29/2019
Date Data Arrived at EDR: 04/05/2019
Date Made Active in Reports: 06/20/2019
Number of Days to Update: 76

Source: Yolo County Department of Health
Telephone: 530-666-8646
Last EDR Contact: 06/26/2019
Next Scheduled EDR Contact: 10/14/2019
Data Release Frequency: Annually

YUBA COUNTY:

CUPA YUBA: CUPA Facility List

CUPA facility listing for Yuba County.

Date of Government Version: 05/03/2019
Date Data Arrived at EDR: 05/07/2019
Date Made Active in Reports: 07/16/2019
Number of Days to Update: 70

Source: Yuba County Environmental Health Department
Telephone: 530-749-7523
Last EDR Contact: 04/25/2019
Next Scheduled EDR Contact: 08/12/2019
Data Release Frequency: Varies

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 02/11/2019
Date Data Arrived at EDR: 02/12/2019
Date Made Active in Reports: 03/04/2019
Number of Days to Update: 20

Source: Department of Energy & Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 05/14/2019
Next Scheduled EDR Contact: 08/26/2019
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 04/10/2019
Date Made Active in Reports: 05/16/2019
Number of Days to Update: 36

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 07/09/2019
Next Scheduled EDR Contact: 10/21/2019
Data Release Frequency: Annually

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 01/01/2019
Date Data Arrived at EDR: 05/01/2019
Date Made Active in Reports: 06/21/2019
Number of Days to Update: 51

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 05/01/2019
Next Scheduled EDR Contact: 08/12/2019
Data Release Frequency: Quarterly

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2017
Date Data Arrived at EDR: 10/23/2018
Date Made Active in Reports: 11/27/2018
Number of Days to Update: 35

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 07/15/2019
Next Scheduled EDR Contact: 10/28/2019
Data Release Frequency: Annually

RI MANIFEST: Manifest information

Hazardous waste manifest information

Date of Government Version: 12/31/2017
Date Data Arrived at EDR: 02/23/2018
Date Made Active in Reports: 04/09/2018
Number of Days to Update: 45

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 05/17/2019
Next Scheduled EDR Contact: 09/02/2019
Data Release Frequency: Annually

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2017
Date Data Arrived at EDR: 06/15/2018
Date Made Active in Reports: 07/09/2018
Number of Days to Update: 24

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 06/10/2019
Next Scheduled EDR Contact: 09/23/2019
Data Release Frequency: Annually

Oil/Gas Pipelines

Source: PennWell Corporation

Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Electric Power Transmission Line Data

Source: PennWell Corporation

This map includes information copyrighted by PennWell Corporation. This information is provided on a best effort basis and PennWell Corporation does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of PennWell.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Licensed Facilities

Source: Department of Social Services

Telephone: 916-657-4041

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA

Telephone: 877-336-2627

Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory

Source: Department of Fish and Wildlife

Telephone: 916-445-0411

Current USGS 7.5 Minute Topographic Map

Source: U.S. Geological Survey

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK[®] - PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

SEAWORLD
500 SEAWORLD DR
SAN DIEGO, CA 92109

TARGET PROPERTY COORDINATES

Latitude (North):	32.764841 - 32° 45' 53.43"
Longitude (West):	117.225696 - 117° 13' 32.51"
Universal Transverse Mercator:	Zone 11
UTM X (Meters):	478860.2
UTM Y (Meters):	3625050.0
Elevation:	19 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map:	5622824 LA JOLLA, CA
Version Date:	2012
South Map:	5622832 POINT LOMA, CA
Version Date:	2012
Southwest Map:	5622850 POINT LOMA OE W, CA
Version Date:	2012
Northwest Map:	5622840 LA JOLLA OE W, CA
Version Date:	2012

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General NNW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

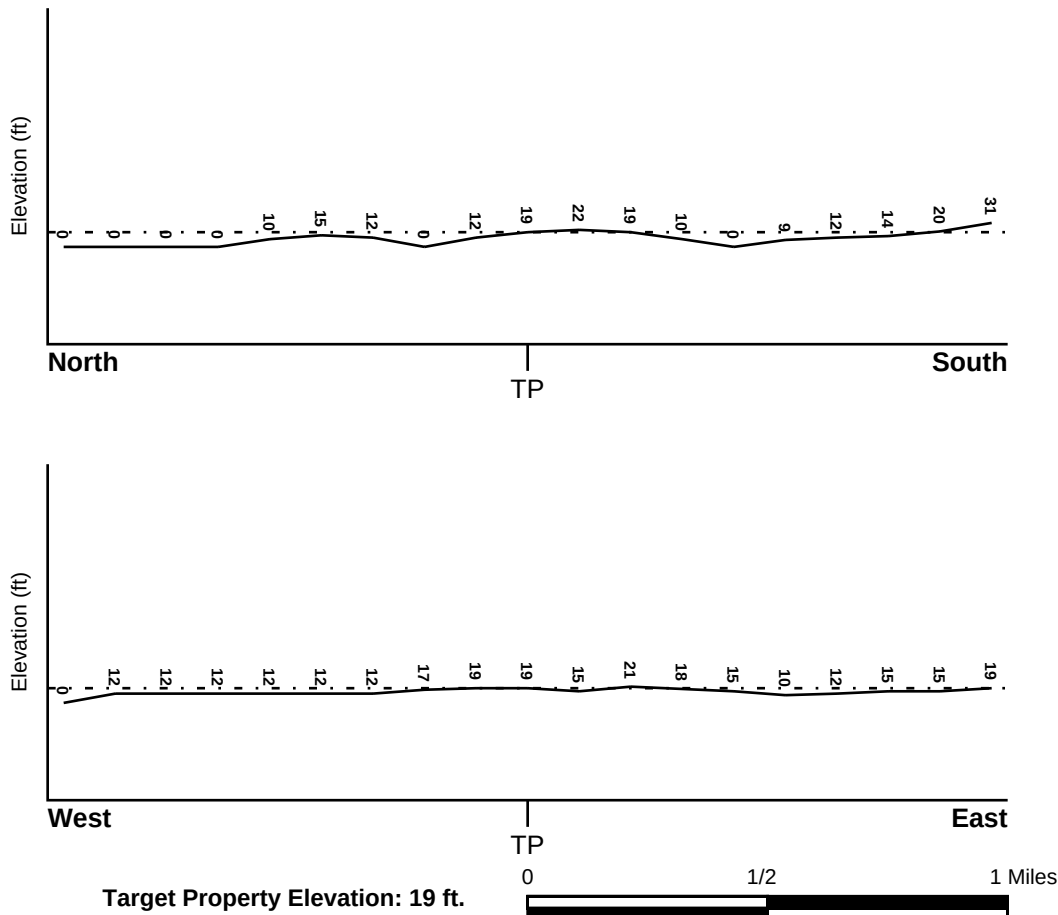

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

<u>Flood Plain Panel at Target Property</u>	<u>FEMA Source Type</u>
06073C1613G	FEMA FIRM Flood data
<u>Additional Panels in search area:</u>	<u>FEMA Source Type</u>
06073C1614G	FEMA FIRM Flood data

NATIONAL WETLAND INVENTORY

<u>NWI Quad at Target Property</u>	<u>NWI Electronic Data Coverage</u>
LA JOLLA	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius:	1.25 miles
Status:	Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

<u>MAP ID</u>	<u>LOCATION FROM TP</u>	<u>GENERAL DIRECTION GROUNDWATER FLOW</u>
1	1/2 - 1 Mile SSE	W
2	1/2 - 1 Mile SSE	Not Reported
3	1/2 - 1 Mile SE	N
4	1/2 - 1 Mile WSW	N
1G	1/2 - 1 Mile WSW	N
2G	1/2 - 1 Mile SE	N
3G	1/2 - 1 Mile SSE	W
4G	1/2 - 1 Mile SSE	Not Reported

For additional site information, refer to Physical Setting Source Map Findings.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT


Era:	Cenozoic
System:	Tertiary
Series:	Pliocene
Code:	Tp (decoded above as Era, System & Series)

GEOLOGIC AGE IDENTIFICATION

Category: Stratified Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 5775389.2s

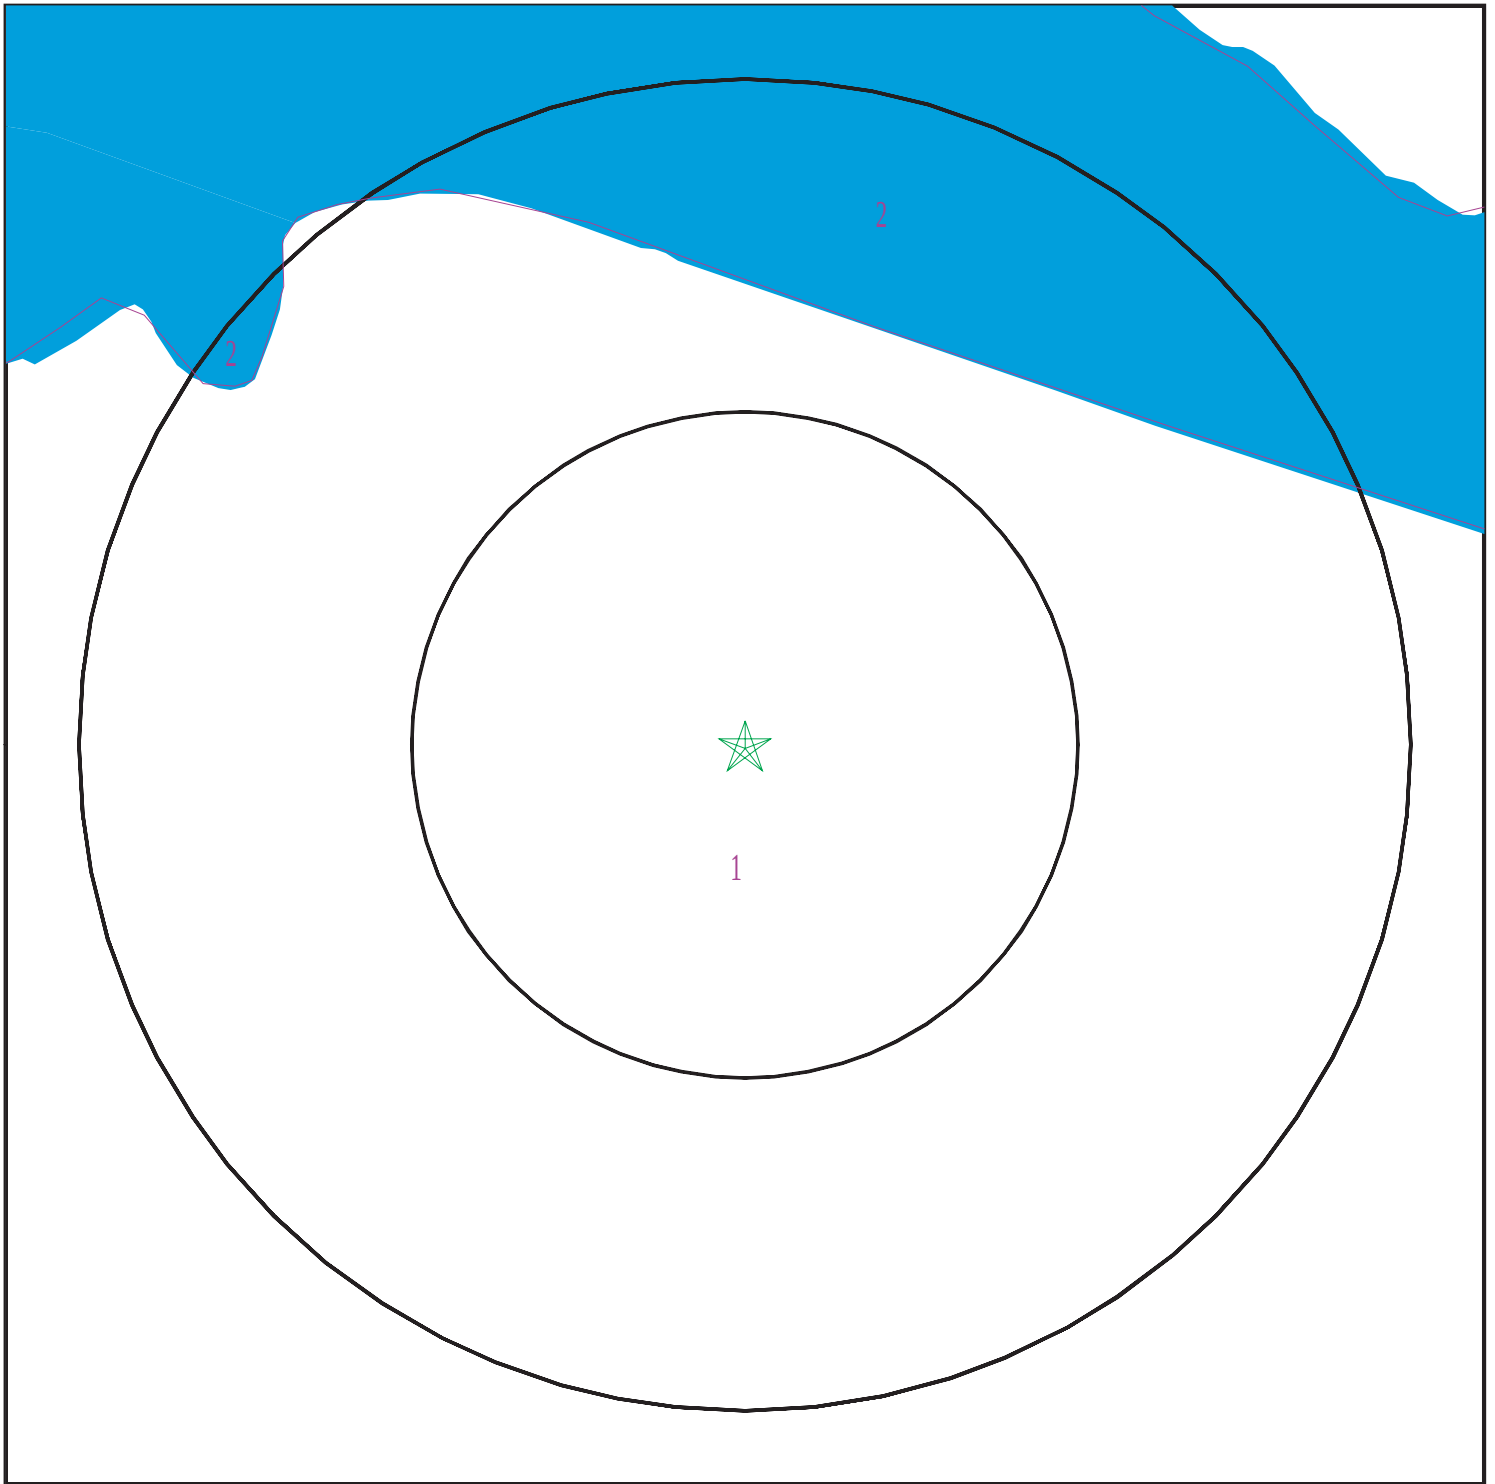

- ★ Target Property
- SSURGO Soil
- Water

0 1/16 1/8 1/4 Miles



SITE NAME: SeaWorld
ADDRESS: 500 SeaWorld Dr
San Diego CA 92109
LAT/LONG: 32.764841 / 117.225696

CLIENT: Brown & Caldwell Consultants
CONTACT: Laura Carpenter
INQUIRY #: 5775389.2s
DATE: September 03, 2019 5:40 pm

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name: MADE LAND

Soil Surface Texture: variable

Hydrologic Group: Not reported

Soil Drainage Class:
Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

Soil Layer Information							
Layer	Boundary		Soil Texture Class	Classification		Saturated hydraulic conductivity micro m/sec	Soil Reaction (pH)
	Upper	Lower		AASHTO Group	Unified Soil		
1	0 inches	5 inches	variable	Not reported	Not reported	Max: Min:	Max: Min:

Soil Map ID: 2

Soil Component Name: LAKES AND LAGOONS

Soil Surface Texture: variable

Hydrologic Group: Not reported

Soil Drainage Class:
Hydric Status: Not hydric

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

No Layer Information available.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No Wells Found		

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION



<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No PWS System Found		

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No Wells Found		

PHYSICAL SETTING SOURCE MAP - 5775389.2s

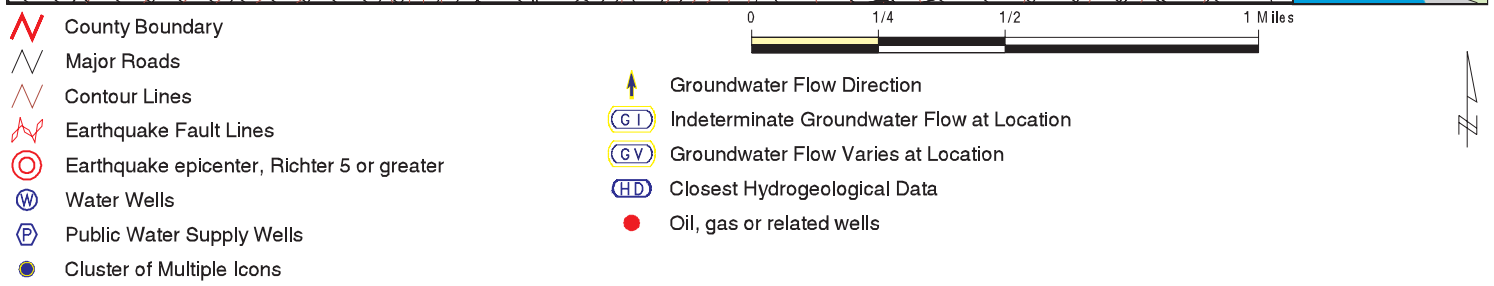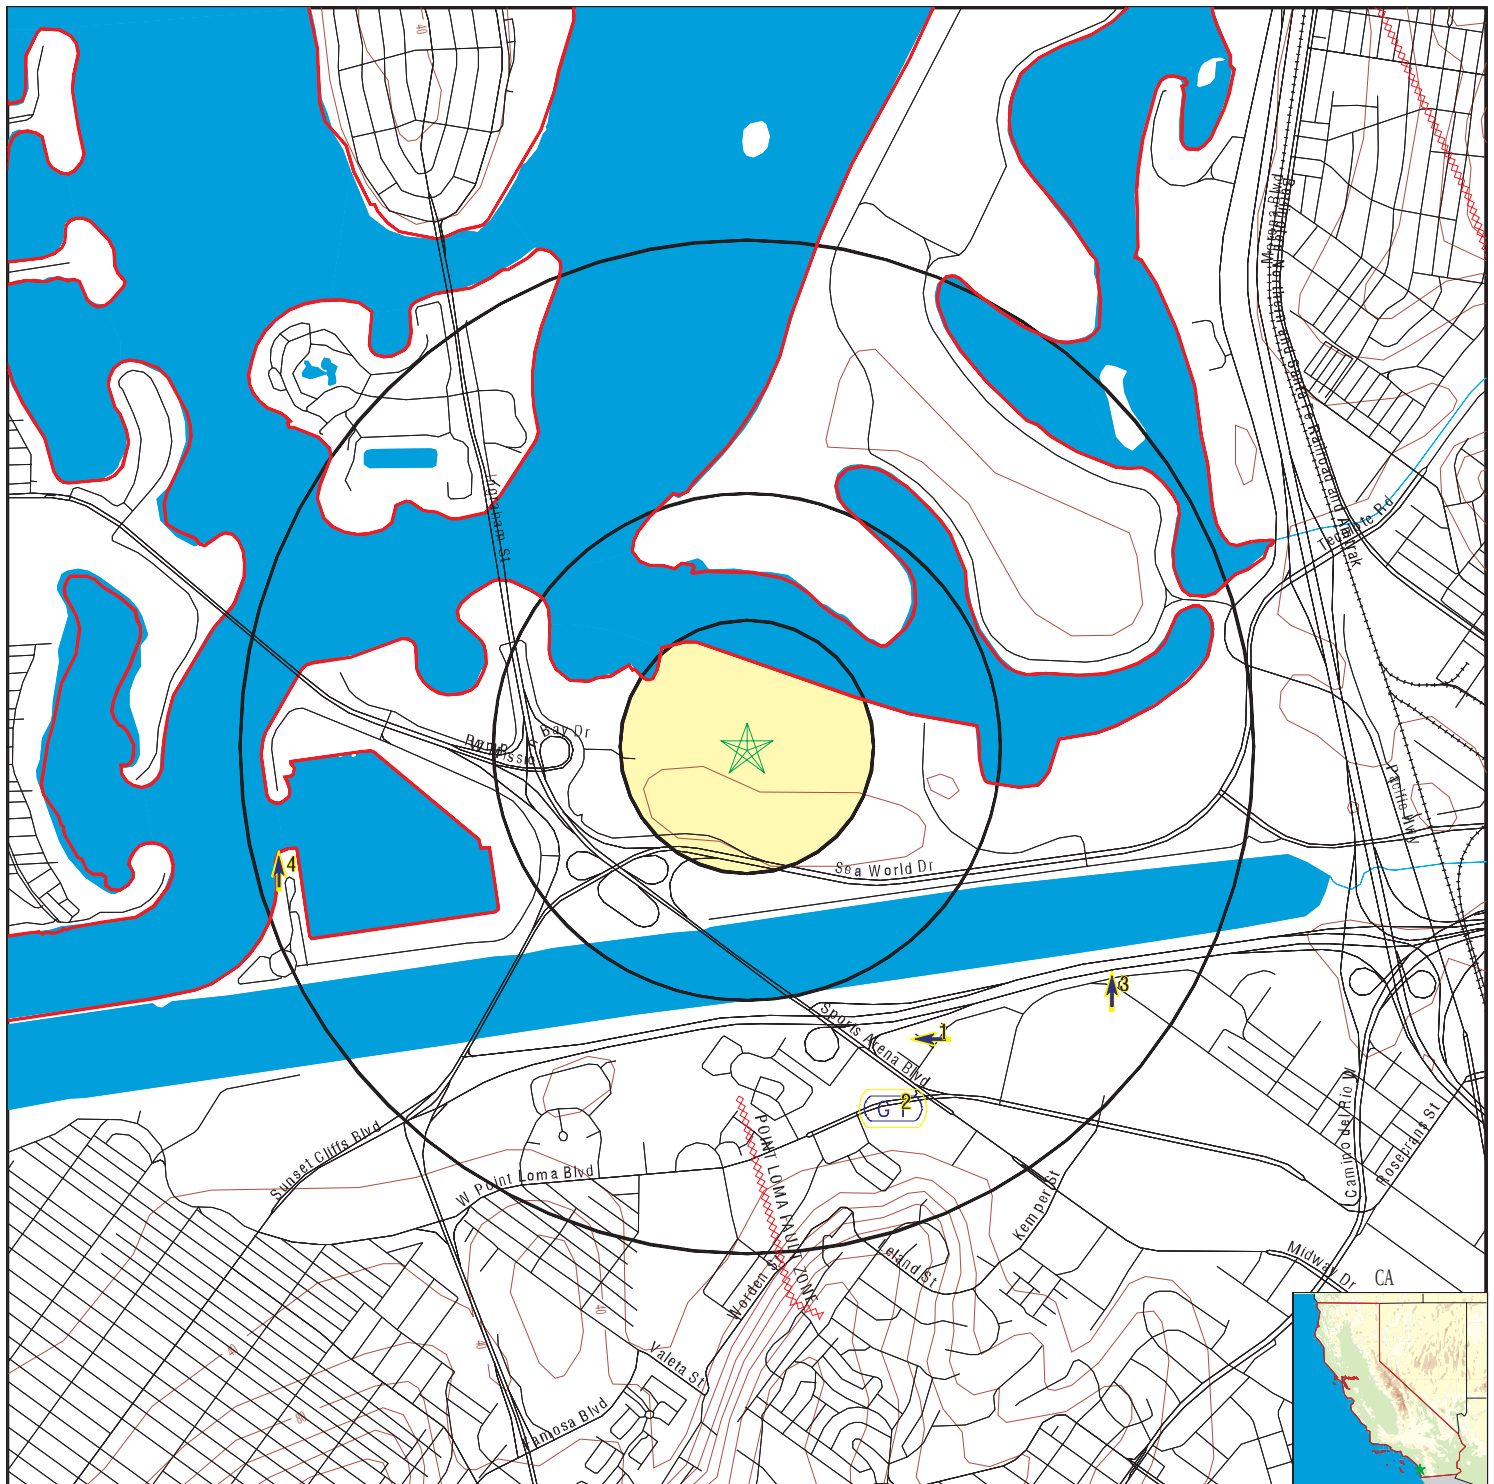

SITE NAME: SeaWorld
 ADDRESS: 500 SeaWorld Dr
 San Diego CA 92109
 LAT/LONG: 32.764841 / 117.225696

CLIENT: Brown & Caldwell Consultants
 CONTACT: Laura Carpenter
 INQUIRY #: 5775389.2s
 DATE: September 03, 2019 5:39 pm

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

1 SSE 1/2 - 1 Mile Lower	Site ID: Groundwater Flow: Shallow Water Depth: Deep Water Depth: Average Water Depth: Date:	Not Reported W Not Reported Not Reported 10 05/21/1998	AQUIFLOW	55158
2 SSE 1/2 - 1 Mile Lower	Site ID: Groundwater Flow: Shallow Water Depth: Deep Water Depth: Average Water Depth: Date:	Not Reported Not Reported 16 20 Not Reported 11/27/1995	AQUIFLOW	33850
3 SE 1/2 - 1 Mile Lower	Site ID: Groundwater Flow: Shallow Water Depth: Deep Water Depth: Average Water Depth: Date:	Not Reported N 8 10 Not Reported 09/25/1997	AQUIFLOW	38461
4 WSW 1/2 - 1 Mile Lower	Site ID: Groundwater Flow: Shallow Water Depth: Deep Water Depth: Average Water Depth: Date:	9UT2032 N Not Reported Not Reported 10 08/10/1992	AQUIFLOW	38012
1G WSW 1/2 - 1 Mile Lower	Site ID: Groundwater Flow: Shallow Water Depth: Deep Water Depth: Average Water Depth: Date:	9UT2032 N Not Reported Not Reported 10 08/10/1992	AQUIFLOW	38012
2G SE 1/2 - 1 Mile Lower	Site ID: Groundwater Flow: Shallow Water Depth: Deep Water Depth: Average Water Depth: Date:	Not Reported N 8 10 Not Reported 09/25/1997	AQUIFLOW	38461
3G SSE 1/2 - 1 Mile Lower	Site ID: Groundwater Flow: Shallow Water Depth: Deep Water Depth: Average Water Depth: Date:	Not Reported W Not Reported Not Reported 10 05/21/1998	AQUIFLOW	55158

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database

EDR ID Number

4G
SSE
1/2 - 1 Mile
Lower

Site ID: Not Reported
Groundwater Flow: Not Reported
Shallow Water Depth: 16
Deep Water Depth: 20
Average Water Depth: Not Reported
Date: 11/27/1995

AQUIFLOW 33850

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS RADON

AREA RADON INFORMATION

State Database: CA Radon

Radon Test Results

Zipcode	Num Tests	> 4 pCi/L
92109	14	0

Federal EPA Radon Zone for SAN DIEGO County: 3

Note: Zone 1 indoor average level > 4 pCi/L.
: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.
: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for Zip Code: 92109

Number of sites tested: 1

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area - 1st Floor	0.500 pCi/L	100%	0%	0%
Living Area - 2nd Floor	Not Reported	Not Reported	Not Reported	Not Reported
Basement	Not Reported	Not Reported	Not Reported	Not Reported

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Current USGS 7.5 Minute Topographic Map

Source: U.S. Geological Survey

HYDROLOGIC INFORMATION

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA

Telephone: 877-336-2627

Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Wetland Inventory

Source: Department of Fish and Wildlife

Telephone: 916-445-0411

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Service, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

Water Well Database

Source: Department of Water Resources

Telephone: 916-651-9648

California Drinking Water Quality Database

Source: Department of Public Health

Telephone: 916-324-2319

The database includes all drinking water compliance and special studies monitoring for the state of California since 1984. It consists of over 3,200,000 individual analyses along with well and water system information.

OTHER STATE DATABASE INFORMATION

California Oil and Gas Well Locations

Source: Department of Conservation

Telephone: 916-323-1779

Oil and Gas well locations in the state.

California Earthquake Fault Lines

Source: California Division of Mines and Geology

The fault lines displayed on EDR's Topographic map are digitized quaternary fault lines prepared in 1975 by the United State Geological Survey. Additional information (also from 1975) regarding activity at specific fault lines comes from California's Preliminary Fault Activity Map prepared by the California Division of Mines and Geology.

RADON

State Database: CA Radon

Source: Department of Public Health

Telephone: 916-210-8558

Radon Database for California

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

EPA Radon Zones

Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRRA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

California Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary fault lines, prepared in 1975 by the United State Geological Survey. Additional information (also from 1975) regarding activity at specific fault lines comes from California's Preliminary Fault Activity Map prepared by the California Division of Mines and Geology.

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.